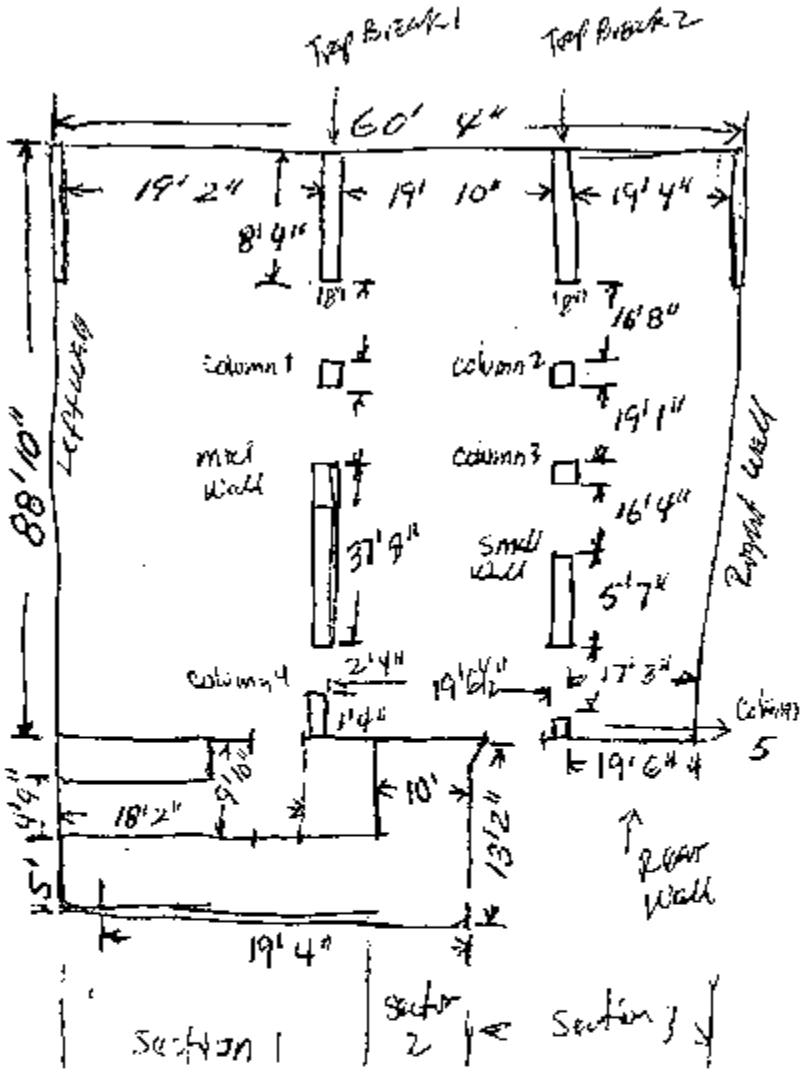

Floor Samples

PIK-120706-001 – Inside Room 211 adjacent to Range

6' 3" → Door

Pic # 837

PIK-120706-002 – Entrance to range from Room 211

12' 6" Door — 6' 11" → Restroom

1' 4" Door to Range

Pic # 838

PIK-120706-003 – Inside restroom Room 211

3' 11" → wall

Toilet

Pic # 839

PIK-120706-004 – Small area of Dead space before plenum to the left wall

Wall 0' — 6' 7" → 1 Range Door

3' 7" wall

Room 211

Pic # 840

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1056 of 5269

BEST AVAILABLE COPY

PIK-120706-005 – Area cooler radiator in dead space behind range door

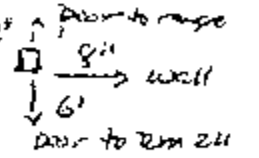

Pic # 841

PIK-120706-006 – Left side door to range

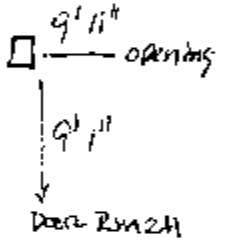

Pic # 842

PIK-120706-007 – Outside Right entry to range next to room 211

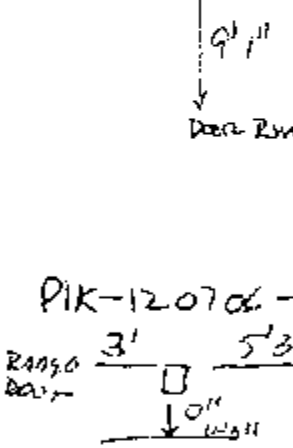

Pic # 843

PIK-120706-008 – Restroom 210 outside the Containment area

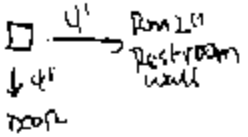

Pic # 844

PIK-120706-009 – Window sill outside Rm 210 (restroom) on top of furnace radiator

Pic # 845

PIK-120706-010 – Hallway right outside Containment Entrance.

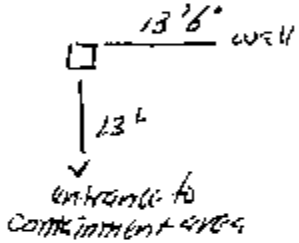

Pic # 846

Range Floor Right side

PIK-120706-011 – Floor inside right side next to middle Column from the entrance (Repeat Sample)

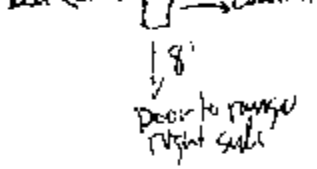

Pic # 847

PIK-120706-012 – Floor right side b/t entrance Door & right side (Repeat Sample)

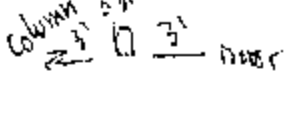

Pic # 848

BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room May 2018
FOIA Requested Record #1-15-0085 (MD) – Released by National Guard Bureau
Page 1057 of 5269

PIK-120706-013 – Floor under radiator right side of Range

Wall 19' □ 8' Door

Pic # 849

PIK-120706-014 – Floor sample on right side range next to right wall across from small wall

Small wall 10'6" □ 3'6" Right wall

21' Rear wall

(Repeat Sample) Pic # 850

PIK-120706-015 – Floor sample next to column #3 on right side of range

Column 3 3' □ 10' wall

(Repeat Sample) Pic # 851

PIK-120706-016 – Floor Sample Trap wall midpoint between Trap Break 2 and right wall end of range right side

Trap Break 2 9'1" □ 9'1" Right wall

(Repeat sample) Pic # 852

PIK-120706-017 – Floor Sample between small wall and mid wall (Repeat Sample)

Small wall 4' □ 16' Mid wall

Pic # 853

PIK-120706-018 – Floor Sample next to Column 1 middle range area

□ 2" column 1

Pic # 854 (Repeat Sample)

PIK-120706-019 – Floor Sample next to Trap break 2 (Repeat Sample)

Trap Break 1 19'8' □ 2" Trap break

Pic # 855

Continue back

Posted to NGB FOIA Reading Room May 2018 BEST AVAILABLE COPY FOIA Requested Record #1-15-0085 (MD) Released by National Guard Bureau Page 1058 of 5269

BEST AVAILABLE COPY

Range Floor left side

PIK-120706-020 – Floor Sample left side range Firing Position #3

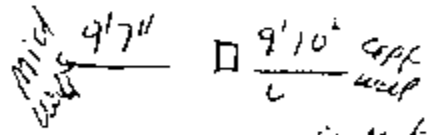

(Repeat Sample) PIC 856

PIK-120706-021 – Floor left side of break Trap 1 left side range

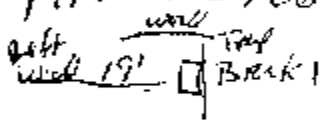

(Repeat Sample) PIC 857

WALLS

PIK-120706-022 – Trap wall on the left side and left wall

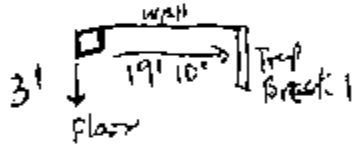

(Repeat Sample) PIC # 858

PIK-120706-023 – Wall Sample on the left side of Trap break 1

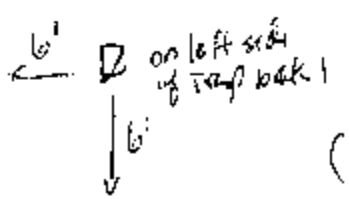

(Repeat Sample) PIC 859

PIK-120706-024 – Sample on column 2 inside face of mid wall



(Repeat Sample) PIC #860

PIK-120706-025 – Rear wall next to column 4 (Repeat Sample)

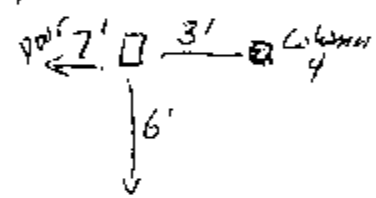

PIC # 861

PIK-120706-026 – Wall Sample next to column 5 at Rear wall (vertical)

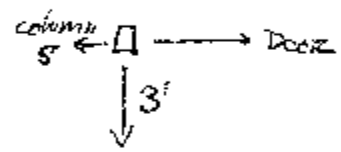

PIC 862

PIK-120706-027 – Wall Sample of window sill at Rear wall next to column 5 (horizontal)

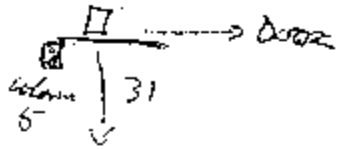

PIC 863

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room May 2018 FOIA Requested Record #1-15-0085 (MD)

PIK-120706-028 - Left side wall of the mid wall (Repeat Sample)

Rear wall ← 18' □ ↓ 5' Floor

Pic #864

PIK-120706-029 - Left face of column #2 mid range (Repeat Sample)

□ ↓ 6' Floor

PIC 865

PIK-120706-030 - Right Face of Trap Break 1 (Repeat Sample)

□ ↓ 6' Floor

Pic 866

PIK-120706-031 - Trap Break 2 Right ~~Left~~ Face (Repeat Sample)

□ ↓ 6' Floor

Pic 867

PIK-120706-032 - Under covered window sill Right wall (Repeat Sample)

□ → 11' Rear wall ↓ 4' Floor

Pic 868

PIK-120706-033 - Rear wall (Repeat Sample)

Right wall ← 5' □ ↓ 4' Floor

Pic 869

PIK-120706-B1 Blank 1

PIK-120706-B2 Blank 2

PIK-120706-B2 Blank 3

PIK-120706-B3 Blank 4

PIK-120706-ASB1 - Rear wall wired mesh next to column 5

PIK-120706-ASB2 - Brick under mesh Rear wall

PIK-120706-ASB3 - Behind window right side of Rear wall entrance door right side range

Posted on NCBI Site Document Page 1060 of 5269 BEST AVAILABLE COPY FOIA Requested Record #J-15-0085 (MD)

FOIA Requested Record #J-15-0085 (MB)
Released by National Guard Bureau
Page 1061 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	Pikesville Clear 4	**Chain Of Custody:**	150778		
Address:	301-B1 Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Pikesville Armory	**Date Submitted:**	12/19/2006		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	12/19/2006	**Report Date:**	19-Dec-06

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0720056	20061215PIK4 01	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720057	20061215PIK4 02	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720058	20061215PIK4 03	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720059	20061215PIK4 04	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720060	20061215PIK4 05	Flame	Wipe	****	0.444	27.00	ug/ft²		96	ug/ft²	
0720061	20061215PIK4 06	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720062	20061215PIK4 07	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720063	20061215PIK4 08	Flame	Wipe	****	0.444	27.00	ug/ft²		3400	ug/ft²	
0720064	20061215PIK4 09	Flame	Wipe	****	0.444	27.00	ug/ft²		49	ug/ft²	
0720065	20061215PIK4 10	Flame	Wipe	****	0.444	27.00	ug/ft²		760	ug/ft²	
0720066	20061215PIK4 11	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720067	20061215PIK4 12	Flame	Wipe	****	0.444	27.00	ug/ft²		37	ug/ft²	
0720068	20061215PIK4 13	Flame	Wipe	****	0.444	27.00	ug/ft²	<	27	ug/ft²	
0720069	20061215PIK4 14	Flame	Wipe	****	0.444	27.00	ug/ft²		920	ug/ft²	
0720070	20061215PIK4 15	Flame	Wipe	****	0.444	27.00	ug/ft²		1100	ug/ft²	
0720071	20061215PIK4 16	Flame	Wipe	****	0.444	27.00	ug/ft²		130	ug/ft²	
0720072	20061215PIK4 17	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0720073	20061215PIK4 18	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted in NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1062 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	Pikesville Clear 4	**Chain Of Custody:**	150778
Address:	301-H Old Bay Lane, Attn NGB-AVN-SI, State Military Reservation	**Job Location:**	Pikesville Armory	**Date Submitted:**	12/19/2006
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	12/19/2006
				Report Date:	04-Jan-07

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

Page 1 of 2

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result		Comments
0720056	20061215PIK4 01	Flame	Wipe	****	0.111	108.01	ug/ft²	< 110	ug/ft²	
0720057	20061215PIK4 02	Flame	Wipe	****	0.111	108.01	ug/ft²	~~< 110~~	~~ug/ft²~~	
0720058	20061215PIK4 03	Flame	Wipe	****	0.111	108.01	ug/ft²	~~< 110~~	~~ug/ft²~~	
0720059	20061215PIK4 04	Flame	Wipe	****	0.111	108.01	ug/ft²	~~< 110~~	~~ug/ft²~~	
0720060	20061215PIK4 05	Flame	Wipe	****	0.111	108.01	ug/ft²	380	ug/ft² 5	
0720061	20061215PIK4 06	Flame	Wipe	****	0.111	108.01	ug/ft²	< ~~110~~	~~ug/ft²~~	
0720062	20061215PIK4 07	Flame	Wipe	****	0.111	108.01	ug/ft²	< ~~110~~	~~ug/ft²~~	
0720063	20061215PIK4 08	Flame	Wipe	****	0.111	108.01	ug/ft²	~~13000~~	~~ug/ft²~~ 8	
0720064	20061215PIK4 09	Flame	Wipe	****	0.111	108.01	ug/ft²	~~200~~	~~ug/ft²~~	
0720065	20061215PIK4 10	Flame	Wipe	****	0.111	108.01	ug/ft²	~~3000~~	~~ug/ft²~~ 10	
0720066	20061215PIK4 11	Flame	Wipe	****	0.111	108.01	ug/ft²	< ~~110~~	~~ug/ft²~~	
0720067	20061215PIK4 12	Flame	Wipe	****	0.111	108.01	ug/ft²	~~150~~	~~ug/ft²~~	
0720068	20061215PIK4 13	Flame	Wipe	****	0.111	108.01	ug/ft²	< ~~110~~	~~ug/ft²~~	
0720069	20061215PIK4 14	Flame	Wipe	****	0.111	108.01	ug/ft²	~~9000~~	~~ug/ft²~~ 14	
0720070	20061215PIK4 15	Flame	Wipe	****	0.111	108.01	ug/ft²	~~1200~~	~~ug/ft²~~ 15	
0720071	20061215PIK4 16	Flame	Wipe	****	0.111	108.01	ug/ft²	~~540~~	~~ug/ft²~~ 16	
0720072	20061215PIK4 17	Flame	Wipe Blank	****	N/A	12.00	ug	< ~~12~~	~~ug~~	
0720073	20061215PIK4 18	Flame	Wipe Blank	****	N/A	12.00	ug	< ~~12~~	~~ug~~	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

Pikesville Indoor Firing Range Clearance Sampling – 2nd Attempt

~~20 October 2006~~
28 November 2006

Large range, approximately 15 lanes.
Stone construction, slat and plaster visible in some areas.

Lead Check sticks tested positive for lead.

floor possibly sealed ?

Sampling Diagram:

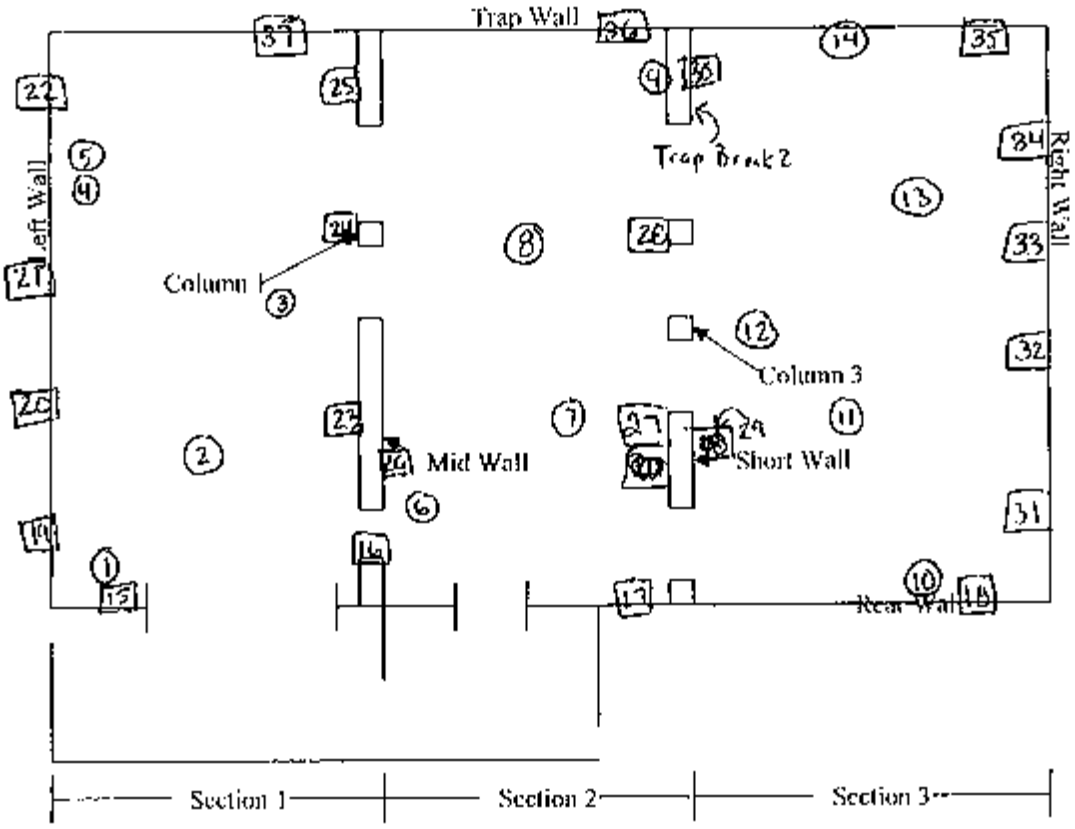

BEST AVAILABLE COPY

Pikesville Indoor Firing Range Clearance Sampling – 1st Attempt
26 October 2006

Large range, approximately 15 lanes.
Stone construction, slat and plaster visible in some areas.

Lead Check sticks tested positive for lead.

Sampling Diagram:

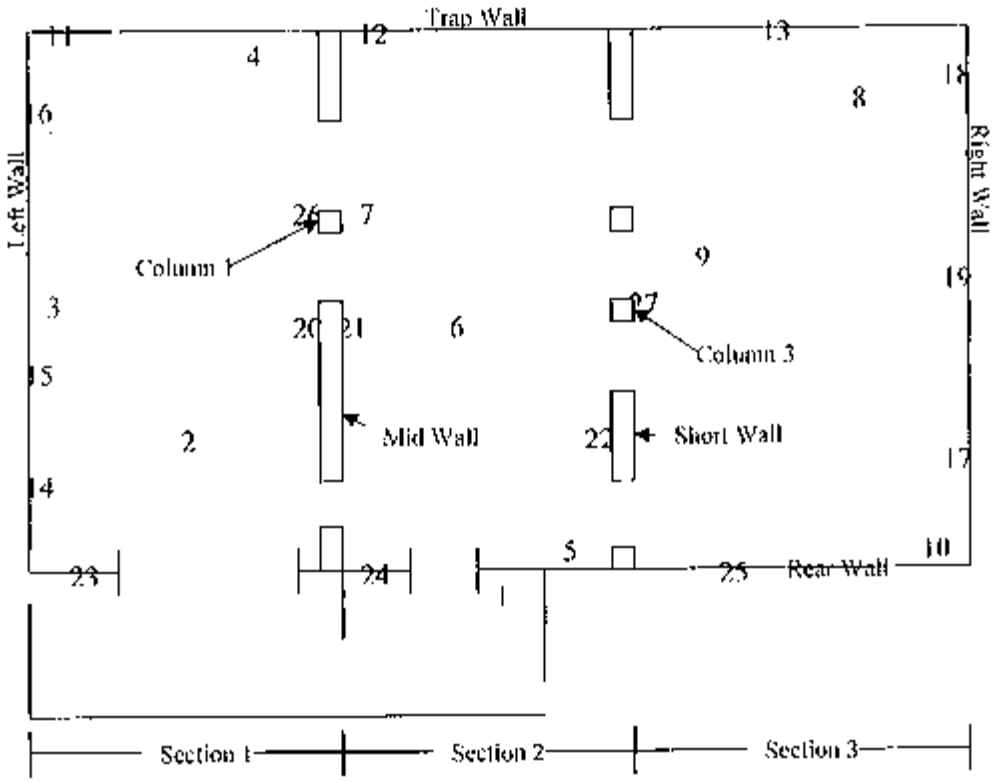

BEST AVAILABLE COPY

Pikesville Indoor Firing Range Clearance Sampling – 1st Attempt
26 October 2006

Sample Number	Sample Location
2006 1016 PKV1 01	Entry Area, floor, 0.5 ft right of door, adjacent to Rear wall
2006 1016 PKV1 02	Floor, Sec 1, 6 ft from Rear wall, 12 ft from Mid wall
2006 1016 PKV1 03	Floor, Sec 1, 54 ft from Rear wall, adjacent to Left wall
2006 1016 PKV1 04	Floor, Sec 1, adjacent to Trap wall, 18 ft from Left wall
2006 1016 PKV1 05	Floor, Sec 2, adjacent to Rear wall, 18 ft from Mid wall
2006 1016 PKV1 06	Floor, Sec 2, 48 ft from Rear wall, 12 ft Left of Column 3
2006 1016 PKV1 07	Floor, Sec 2, 70 ft from Rear wall, adjacent to Column 1
2006 1016 PKV1 08	Floor, Sec 3, 9 ft from Rear wall, 6 ft from Right wall
2006 1016 PKV1 09	Floor, Sec 3, 60 ft from Rear wall, 15 ft from Right wall
2006 1016 PKV1 10	Floor, Sec 3, corner of Rear wall and Right wall
2006 1016 PKV1 11	Wall, Trap, corner of Rear wall and Left wall, 3 ft from Floor
2006 1016 PKV1 12	Wall, Trap, adjacent to protruding column, 6 ft from Floor
2006 1016 PKV1 13	Wall, Trap, 9 ft from Right wall, 7 ft from Floor
2006 1016 PKV1 14	Wall, Left, 6 ft from Rear wall, 6 ft from Floor
2006 1016 PKV1 15	Wall, Left, 36 ft from Rear wall, 4 ft from Floor
2006 1016 PKV1 16	Wall, Left, 15 ft from Trap wall, 4 ft from Floor
2006 1016 PKV1 17	Wall, Right, 3 ft from Rear wall, 6 ft from Floor
2006 1016 PKV1 18	Wall, Right, 3 ft from Trap wall, 3 ft from Floor
2006 1016 PKV1 19	Wall, Right, 33 ft from Rear wall, 5 ft from Floor
2006 1016 PKV1 20	Wall, Mid, in sec 1, 3 ft from trap end, 6 ft from Floor
2006 1016 PKV1 21	Wall, Mid, in sec 2, 3 ft from trap end, 3 ft from Floor
2006 1016 PKV1 22	Wall, Short, in sec 2, centered on column, 6 ft from Floor
2006 1016 PKV1 23	Wall, Rear, 3 ft from Left wall, 4 ft from Floor
2006 1016 PKV1 24	Wall, Rear, in sec 2, 3 ft from Mid wall, 6 ft from Floor
2006 1016 PKV1 25	Wall, Rear, on glass, bottom row, closest to R wall, corner
2006 1016 PKV1 26	Column 1, in sec 1, 8 ft from Floor, centered
2006 1016 PKV1 27	Column 2, in sec 3, 5 ft from Floor, centered
2006 1016 PKV1 28	Blank
2006 1016 PKV1 29	Blank
2006 1016 PKV1 30	Blank

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1066 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	Pikesville Clear I	**Chain Of Custody:**	150772		
Address:	301-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Pikesville Military Reservation	**Date Submitted:**	10/30/2006		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	10/30/2006	**Report Date:**	30-Oct-06

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0708711	20061026PKV101	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708712	20061026PKV102	Flame	Wipe	****	0.111	108.01	ug/ft²		2000	ug/ft²	
0708713	20061026PKV103	Flame	Wipe	****	0.111	108.01	ug/ft²		1000	ug/ft²	
0708714	20061026PKV104	Flame	Wipe	****	0.111	108.01	ug/ft²		7800	ug/ft²	
0708715	20061026PKV105	Flame	Wipe	****	0.111	108.01	ug/ft²		600	ug/ft²	
0708716	20061026PKV106	Flame	Wipe	****	0.111	108.01	ug/ft²		510	ug/ft²	
0708717	20061026PKV107	Flame	Wipe	****	0.111	108.01	ug/ft²		31000	ug/ft²	
0708718	20061026PKV108	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708719	20061026PKV109	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708720	20061026PKV110	Flame	Wipe	****	0.111	108.01	ug/ft²		2900	ug/ft²	
0708721	20061026PKV111	Flame	Wipe	****	0.111	108.01	ug/ft²		3700	ug/ft²	
0708722	20061026PKV112	Flame	Wipe	****	0.111	108.01	ug/ft²		2600	ug/ft²	
0708723	20061026PKV113	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708724	20061026PKV114	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708725	20061026PKV115	Flame	Wipe	****	0.111	108.01	ug/ft²		580	ug/ft²	
0708726	20061026PKV116	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708727	20061026PKV117	Flame	Wipe	****	0.111	108.01	ug/ft²		230	ug/ft²	
0708728	20061026PKV118	Flame	Wipe	****	0.111	108.01	ug/ft²		35000	ug/ft²	
0708729	20061026PKV119	Flame	Wipe	****	0.111	108.01	ug/ft²		2100	ug/ft²	
0708730	20061026PKV120	Flame	Wipe	****	0.111	108.01	ug/ft²		1200	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1067 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	Pikesville Clear I	**Chain Of Custody:**	150772		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Pikesville Military Reservation	**Date Submitted:**	10/30/2006		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	10/30/2006	**Report Date:**	30-Oct-06

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0708731	20061026PKV121	Flame	Wipe	****	0.111	108.01	ug/ft²		180	ug/ft²	
0708732	20061026PKV122	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708733	20061026PKV123	Flame	Wipe	****	0.111	108.01	ug/ft²		450	ug/ft²	
0708734	20061026PKV124	Flame	Wipe	****	0.111	108.01	ug/ft²		180	ug/ft²	
0708735	20061026PKV125	Flame	Wipe	****	0.111	108.01	ug/ft²	<	110	ug/ft²	
0708736	20061026PKV126	Flame	Wipe	****	0.111	108.01	ug/ft²		1200	ug/ft²	
0708737	20061026PKV127	Flame	Wipe	****	0.111	108.01	ug/ft²		370	ug/ft²	
0708738	20061026PKV128	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0708739	20061026PKV129	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0708740	20061026PKV130	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

See QC Summary for analytical results of quality control samples associated with these samples.

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Analyst: Non-Responsive [redacted]

Technical Manager: Non-Responsive [redacted]

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

JUN 1 2 2007

MCHB-TS-OFS

MEMORANDUM FOR National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Non-Responsive, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Survey, MG Harry C. Ruhl Armory, Towson, MD, Report No. 55-ML-048L-05/07, 26 August 2005

1. Enclosed is the final copy of subject report and two CD-ROMs.

2. Our point of contact is Ms Non-Responsive at commercial (410) 436-5475/3118, DSN 584-5475/3118 or electronic mail: Non-Responsive@us.army.mil

FOR THE COMMANDER:

Non-Responsive

Encl

Director, Occupational Health Sciences

CF: (w/o CD-ROMs)
USACHPPM-NORTH (MCHB-AN-IH/MR. Non-Responsive)

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

[illegible]

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433 E (MCHB-CE-IPD), OCT 03 (reverse)

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-048L-05/07
MARYLAND NATIONAL GUARD FACILITIES
MG HARRY C. RUHL ARMORY
TOWSON, MARYLAND
26 AUGUST 2005

Distribution limited to U.S. Government agencies only. Requests for this document must be referred to the National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Vanessa Franchere), 301-III Old Bay Lane, Havre de Grace, MD 21078

CHPPM FORM 433-R (MCHB-CS-IPD), OCT 03

Readiness Thru Health

DESTRUCTION NOTICE - Destroy by any method that will prevent disclosure of contents or reconstruction of the document.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

EXECUTIVE SUMMARY
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-048L-05/07
MARYLAND ARMY NATIONAL GUARD FACILITIES
MG HARRY C. RUHL ARMORY
TOWSON, MARYLAND
26 AUGUST 2005

1. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions.

2. CONCLUSIONS. Significant health and safety concerns were: high levels of lead in dust and deteriorating lead-containing paint in the former indoor firing range (IFR) where toys and utensils were being stored; inadequate vehicle exhaust ventilation; incompatible chemical storage; incomplete enrollment in the Hearing Conservation Program (HCP); and inadequate lighting.

3. RECOMMENDATIONS.

a. Lead Exposure. Health Risk Assessment Code (RAC) 3 for Child Exposure. Health RAC 4 for Adult Exposure. Clean horizontal surfaces in the administrative areas to the National Guard Bureau (NGB) Region North Industrial Hygiene Office and the U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended levels. Follow the guidance in Appendix E and National Guard Pamphlet 420-15. Address all potential lead hazards before continuing to extend the use of this facility to children. If children will visit this facility, clean the floors in the Drill Hall and Classroom to the Environmental Protection Agency and State of Maryland lead in dust standards for young children, and clean other horizontal surfaces in the Drill Hall and Conference Room to the NGB Region North Industrial Hygiene Office and USACHPPM recommended level for lead in dust on frequently contacted surfaces. Eliminate the moisture source causing mold and deteriorating paint in the former IFR and repair paint. Ensure that personnel wear disposable gloves and disposable coveralls as extra protection when cleaning in all areas identified as having elevated levels of lead. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1071 of 5269

BEST AVAILABLE COPY

b. Vehicle Exhaust Ventilation. Health RAC 3. Install a system that can provide at least 1,500 cubic feet per minute per drop to accommodate large turbocharged diesel engines. Evaluate the systems to ensure that exhaust generated by the engine is removed.

c. Safety. Safety RAC 3. Store the Super Tropical Bleach in a separate cabinet or storage area away from potential water sources. Inspect other stored chemicals for compatibility and relocate them as needed.

d. Lighting. Health RAC 4. Provide portable task lighting to conform to the Illuminating Engineering Society of North America guidelines.

e. Safety and Occupational Health Programs. Health RAC 3. Ensure that part time NGB employees are enrolled in the HCP. Ensure that personnel wear hearing protection when working in the automotive bay and in areas that require hearing protection. Ensure that personnel receive baseline and annual audiometric exams.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1072 of 5269

BEST AVAILABLE COPY

MDARNG IH Baseline Survey, MG Harry C. Ruhl Armory, Towson, MD, Report No. 55-ML-048L-05/07, 26 August 2005

CONTENTS

Paragraph Page

1. REFERENCES 1

2. PURPOSE 1

3. AUTHORITY 1

4. BACKGROUND INFORMATION 1

5. METHODOLOGY 2

6. FACILITY EVALUATION 2

7. ASSESSMENT CRITERIA FOR LEAD 3

8. SAMPLING RESULTS AND DISCUSSION 4

9. CONCLUSIONS 9

10. RECOMMENDATIONS 9

11. ADDITIONAL ASSISTANCE 10

APPENDICES

A. REFERENCES A-1

B. PHOTOGRAPHS B-1

C. PROPOSED CRITERIA FOR LEAD C-1

D. LABORATORY REPORTS D-1

E. LEAD CLEANING GUIDANCE E-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1073 of 5269

BEST AVAILABLE COPY

INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-048L-05/07
MARYLAND ARMY NATIONAL GUARD FACILITIES
MG HARRY C. RUHL ARMORY
TOWSON, MARYLAND
26 AUGUST 2005

1. REFERENCES. See Appendix A.

2. PURPOSE. To conduct an industrial hygiene survey at the Maryland Army National Guard (MDARNG) MG Harry C. Ruhl Armory, Towson, MD, to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve as a baseline so that an occupational exposure history can be compiled for each civilian or military employee.

3. AUTHORITY. Fax, National Guard Bureau (NGB) Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Non-Responsive, 22 June 2004, subject: SAB.

4. BACKGROUND INFORMATION.

a. Background. The resident units were the 129th Signal Battalion and the Headquarters Command Division Support Command. The original building, which included an attached automotive maintenance shop, was built in 1956. An addition was constructed in 1998 that included a weight room, classroom, and an office. A disused indoor firing range (IFR) had been converted into a storage room (See Photograph 1, Appendix B). The bullet trap had been removed. The IFR had reportedly been decontaminated, although no records of decontamination could be located, and there was a lead hazard warning sign posted outside the room.

b. Armory Use by Children. The manager stated that the Armory was used for family functions. After the survey, we informed the NGB Region North Industrial Hygiene Office of high lead in dust sample results. As of late 2005, the Maryland Military Department was advertising Ruhl Armory as available for rental for activities that include young children. We do not know whether the lead had been cleaned up.

c. Armory Manager. The Armory manager was Mr. Non-Responsive Phone: 410-616-0520.

Use of trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

BEST AVAILABLE COPY

5. METHODOLOGY.

a. Assessment Criteria. Army Regulation 40-5 contains the requirement that airborne chemical exposures in Army facilities must comply with the lower of the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit or the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Value®. The NGB Region North Industrial Hygiene Office criterion for lead in surface dust is discussed in Appendix C. The ACGIH provides criteria for industrial ventilation systems. The American Society of Heating, Refrigeration, and Air-conditioning Engineers publish criteria for indoor air quality. The National Fire Protection Association National Fire Codes provides standards for fire and life safety. The Illumination Engineering Society – North America provides standards for minimum light levels. The Environmental Protection Agency (EPA) provides drinking water standards.

b. Calibration. All instruments were calibrated in accordance with manufacturer's instructions using National Institute of Standards and Testing traceable method.

c. Methodology. The survey consisted of the collection of indoor air quality and ventilation measurements, sampling surface dust and paint for lead, observation of work practices and procedures, and employee interviews.

6. FACILITY EVALUATION.

a. Physical Condition of Facilities.

(1) Paint. The age of the original building indicated that the presence of lead in paint was likely. The converted IFR had extensive areas of deteriorated paint (See Photograph 2, Appendix B). The manager stated that there were no records of lead-based paint (LBP) abatement at the Armory.

(2) Asbestos. The manager stated that all asbestos had been abated in the Armory. A site Asbestos Management Program Plan was found.

(3) Mold and Moisture Problems. Mold was observed on the walls of the converted IFR (See Photograph 2, Appendix B).

(4) Safety Hazards. The only safety hazard observed was improper storage of a container of Super Tropical Bleach in the Petroleum Oil and Lubricant/Flammable Storage Room. This product is caustic and corrosive and should only be stored with other oxidizers. We separated the product from the other stored items during the survey.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1075 of 5269

BEST AVAILABLE COPY

(5) Heating, Ventilation, and Air-Conditioning (HVAC) Systems. The building was heated and cooled by central HVAC systems.

b. Vehicle Exhaust Ventilation System. Airflow measurements were conducted. No vehicle maintenance personnel were present the day of the survey.

c. Safety and Occupational Health Programs. Employees participated in the Armory Hazard Communication (HAZCOM) Program. There were no known tasks requiring respiratory protection. Employees were enrolled in a separate Hearing Conservation Program (HCP) for part time National Guard employees.

d. Noise Dosimetry. No noise producing operations were conducted the day of the survey.

e. Lighting. Lighting measurements were conducted to determine if the lighting in the Armory met the Illuminating Engineering Society of North America (IESNA) recommended guidelines. Lighting was measured in foot candles using a light meter.

f. Indoor Air Quality (IAQ). Measurements were conducted to determine if the IAQ parameters met the American Society of Heating, Refrigerating, and Air-Conditioning Engineers, Inc. (ASHRAE) recommended guidelines, and the ACGIH exposure limits adopted by the Army.

7. ASSESSMENT CRITERIA FOR LEAD.

a. Lead in Air. The Army complies with the OSHA 8 hour time-weighted average Permissible Exposure Limit of 50 micrograms of lead per cubic meter of air.

b. Lead in Dust.

(1) The EPA and State of Maryland limits for lead in dust are 40 micrograms per square foot ($\mu g/ft^2$) on floors, 250 $\mu g/ft^2$ on windowsills, and 400 $\mu g/ft^2$ in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The NGB Region North Industrial Hygiene Office concurs with the U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended maximum level of 200 $\mu g/ft^2$ on floors and surfaces frequently contacted by facility employees, which is more stringent for windowsills than the EPA/State standards. This limit was adopted from guidance in OSHA CPL 02-02-58. Additional information is provided in Appendix C.

c. Lead in Paint. Paint containing lead levels of 0.5 percent or more by weight in dried solid (also reported as 5,000 milligrams per kilogram) is considered to be Lead Based Paint

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1076 of 5269

BEST AVAILABLE COPY

(LBP) according to both Federal and Maryland State Regulations. Paint containing lead levels of more than 0.7
milligrams per square centimeter is considered to be LBP according to Maryland State Regulations. In Army Regulation 420-70, Buildings and Structures, lead-contaminated paint (LCP) is defined as any paint containing detectable amounts of lead. The Army considers LCP to be potentially hazardous to children if it is disturbed or deteriorating.

8. SAMPLING RESULTS AND DISCUSSION.

a. Lead Sampling Locations and Results. Samples were collected for lead on surfaces (wipe samples), and by bulk paint samples to determine the presence of lead hazards. The laboratory report is in Appendix D.

b. Lead in Dust. Lead in dust sample locations and analytical results are shown in Table 1. Sample results greater than 40 $\mu g/ft^2$ for floors or 200 $\mu g/ft^2$ for other surfaces are highlighted. High levels of lead were found throughout the converted IFR areas.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1077 of 5269

MDARNG IH Baseline Survey, MG Harry C. Ruhl Armory, Towson, MD, Report No. 55-ML-048L-05/07, 26 August 2005

TABLE 1. LEAD IN SURFACE DUST

Wipe Sample Number	Location of Samples	Result (µg/ft²)
RUHLW01	Blank	<2.7
RUHLW02	IFR Bullet Trap Corner	45,000
RUHLW03	IFR Light Fixture	80
RUHLW04	IFR Kitchen Supplies	9.4
RUHLW05	IFR Shelf	310
RUHLW06	IFR Plastic Utensils	13
RUHLW07	Blank	3.3
RUHLW08	IFR Heater	1,500
RUHLW09	IFR Cage Storage Toy Box	5.6
RUHLW10	IFR Bullet Trap Duct Work	3,400
RUHLW11	IFR Cage Storage Christmas Supplies	23
RUHLW12	Blank	<2.7
RUHLW13	IFR Storage Tent Bag Exterior	170
RUHLW14	IFR Storage Tent Camouflage	36
RUHLW15	IFR Outside Doorway End of Hallway	36
RUHLW16	Drill Floor Center	6.6
RUHLW17	Drill Floor North East Corner	3.6
RUHLW18	Blank	<2.7
RUHLW19	Drill Floor North West Corner	<2.7
RUHLW20	Drill Floor South West Corner	5.1
RUHLW21	Drill Floor South East Corner	4.1
RUHLW22	Drill Hall Supply Room Door	<2.7
RUHLW23	Drill Hall Chair	3.6
RUHLW24	Room 112 A Vault	1,100
RUHLW25	Room 124 Vault	100
RUHLW26	Blank	<2.7
RUHLW27	Kitchen- Max Soap Dispenser	9.21
RUHLW28	Dining Hall- Top of Heater	35
RUHLW29	Room 206- File Cabinet Northeast Exit Door	11
RUHLW30	Room 206 Second Floor Logistics	9.7
RUHLW31	Second Floor Hallway	<2.7
RUHLW32	Second Floor Foyer (Original Building)	3.8
RUHLW33	Room 206 Supply Air Vent	<2.7
RUHLW34	Blank	<2.7
RUHLW35	Shop Office Desk	4.3
RUHLW36	Roof Air Supply	15
RUHLW37	Roof Air Return	11

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1078 of 5269

(1) Child Lead Exposure. Three lead in dust sample results exceeded the EPA and the State of Maryland lead exposure standard for children of 40 µg/ft² on floors and 250 µg/ft² on windowsills. Some boxes of toys were stored in areas of the former IFR and were therefore liable to become contaminated (See Photograph 3, Appendix B). Some of the toys were made of fabrics that could not be easily cleaned. The toys were owned by the Family Support Group that resides in the Armory. We notified the Armory manager who stated that the toys would be removed and discarded as soon as possible.

(2) Adult Lead Exposure. Three lead in dust results exceeded the NGB Region North Industrial Hygiene Office and USACHPPM recommended maximum level for lead in dust on frequently contacted surfaces. There were very high levels of lead in dust throughout the converted IFR storage areas. Personnel working in these areas were potentially exposed to lead, and may have been tracking lead out of the area and redistributing it into adjacent rooms in the Armory. Photograph 4, Appendix B shows the lead hazard warning posted outside the converted IFR.

c. Lead in Paint. The deteriorated paint sample result was below the EPA standard for LBP of 0.5 percent lead in paint, and is referred to as LCP. Deteriorated LCP is potentially hazardous to employees and children.

d. Vehicle Exhaust Ventilation System. Table 2 summarizes the vehicle exhaust system measurements. Photograph 5, Appendix B, shows one of the two drops.

TABLE 2. Vehicle Exhaust Ventilation Flow Rates.

Tailpipe Exhaust Drop #	Average Face Velocity (feet per minute) (fpm)	Duct Opening Diameter (in) / Area (ft^2)	Calculated Flow Rate (cubic feet per minute) (cfm)
1	1338	7.5" / 0.2925	391
2	1410	7.5" / 0.2925	412

(1) Vehicle exhaust ventilation was measured using a thermoanemometer. Both drops had a 7½ inch flanged opening.

(2) The manager stated that the vehicles serviced included 2½ and 5 ton diesel trucks.

BEST AVAILABLE COPY

(3) The system should provide at least 1,500 cubic feet per minute (cfm) exhaust at each drop in accordance with the ACGIH Industrial Ventilation Manual recommendation for 9 liter displacement turbocharged diesel engines run at 1,000 revolutions per minute. This exhaust rate is intended to accommodate large turbocharged diesel engines that are, or may be, maintained at this Organizational Maintenance Shop. Neither drop met this criterion, and the fan was unlikely to be able to meet it even if fitted with a single larger drop.

c. IAQ. Table 3 summarizes IAQ measurements.

TABLE 3. INDOOR AIR QUALITY MEASUREMENTS

Location	CO_2 (ppm)	CO_2 Standard	Temp (°F)	T Standard (°F) (summer)	T Standard (°F) (winter)	RH (%)	RH Standard (%)	CO (ppm)	CO Exposure Limit (ppm)
Outdoors	345		75.0			48.0		0	
Automotive Bay	454	1080	76.0	71-81	68.0-74.5	54.0	30-60	6	25
IFR Bullet Trap	680	1080	78.0	71-81	68.0-74.5	49.0	30-60	NA	NA
Drill Hall	540	1080	72.0	71-81	68.0-74.5	45.0	30-60	NA	NA
Dining Hall	580	1080	77.0	71-81	68.0-74.5	43.0	30-60	NA	NA
Room 206	450	1080	77.0	71-81	68.0-74.5	44.0	30-60	NA	NA
Room 118	575	1080	75.0	71-81	68.0-74.5	47.0	30-60	NA	NA

(1) Temperature. The indoor temperatures of all rooms sampled were within the ASHRAE recommended guidelines of 71-81 degrees Fahrenheit for an acceptable thermal environment in the summer at 50 percent relative humidity (RH).

(2) Carbon Dioxide. The indoor carbon dioxide levels for all rooms sampled were within the ASHRAE recommended guidelines. The outdoor carbon dioxide measurement was 345 parts per million (ppm) versus a true value of approximately 380 ppm, indicating that readings had a downward bias. The ASHRAE recommends, for occupant comfort, maintaining carbon dioxide levels below the value of 700 ppm plus the outdoor ambient level. Therefore, carbon dioxide levels should be maintained below 1,045 ppm (700 ppm plus 380 ppm). All measured spaces complied, even after accounting for readings being biased low.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1080 of 5269

BEST AVAILABLE COPY

(3) RH. The RH levels in the rooms were all within the ASHRAE recommended guidelines of 30-60 percent RH.

(4) Carbon Monoxide. Carbon monoxide levels were well below the 25 ppm 8-hour time-weighted average ACGIH exposure limit adopted by the Army.

f. Lighting. Table 4 summarizes the lighting measurements. Lighting levels were measured throughout the Armory. Several areas of the Maintenance Bay, the Drill Hall, the Arms Room, and the Division Support Command Supply Room Storage area were not adequately lit. According to the IESNA these areas should have at least 50 foot candles of illumination.

TABLE 4. LIGHTING

Location	Measurement (Foot candles)	Standard (Foot candles)
Maintenance Bay Area	24.4- 29.5	75
Drill Hall (Center, Doors Open)	18.0	50
Dining Hall	70.0-80.0	50
Room 206 (Table, Center of Room)	48.0	50
Room 118	65.0	50
Arms Room 124 HHC DISCOM	29.5-31.0	50
DISCOM Supply Room NCO Office	55.0	50
DISCOM Supply Room Storage Area	13.0	50

g. Safety and Occupational Health Programs.

(1) HAZCOM (Title 29 Code of Federal Regulations (CFR) 1910.1200). Armory records document that employees attended annual HAZCOM training. Material Safety Data Sheets and appropriate safety signs were in a central location and easily accessible to employees. A comprehensive Hazardous Materials Inventory was maintained in the Armory.

(2) Hearing Conservation Program (29 CFR 1910.95 and Department of the Army Pamphlet 40-501). According to LTC Sharon Hoffman, MDARNG Safety and Occupational Health Manager, automotive maintenance personnel were not enrolled in the HCP because they were "traditional" or part time NGB employees. The MDARNG is currently working on an initiative to include personnel classified as part time employees statewide in the HCP.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1081 of 5269

BEST AVAILABLE COPY

9. CONCLUSIONS. Significant health and safety concerns were: high levels of lead in dust and deteriorating lead-containing paint in the former IFR where toys and utensils were being stored; inadequate vehicle exhaust ventilation; incompatible chemical storage; incomplete enrolment in the HCP; and inadequate lighting.

10. RECOMMENDATIONS. The Department of Defense Instruction 6055.1 provides Risk Assessment Codes (RACs) for health hazards, a procedure which allows assessment of the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single number. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead Exposure. Health RAC 3 for Child Exposure. Health RAC 4 for Adult Exposure. Clean horizontal surfaces in the administrative areas to the NGB Region North Industrial Hygiene Office and USACHPPM recommended levels. Follow the guidance in Appendix E and National Guard Pamphlet 420-15. Address all potential lead hazards before continuing to extend the use of this facility to children. If children will visit this facility, clean the floors in the Drill Hall and Classroom to the EPA and State of Maryland lead in dust standards for young children, and clean other horizontal surfaces in the Drill Hall and Conference Room to the NGB Region North Industrial Hygiene Office and USACHPPM recommended level for lead in dust on frequently contacted surfaces. Eliminate the moisture source causing mold and deteriorating paint in the former IFR and repair paint. Ensure that personnel wear disposable gloves and disposable coveralls as extra protection when cleaning in all areas identified as having elevated levels of lead. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up.

b. Vehicle Exhaust Ventilation. Health RAC 3. Install a system that can provide at least 1,500 cfm per drop to accommodate large turbocharged diesel engines. Evaluate the systems to ensure that exhaust generated by the engine is removed.

c. Safety. Safety RAC 3. Store the Super Tropical Bleach in a separate cabinet or storage area away from potential water sources. Inspect other stored chemicals for compatibility and relocate them as needed.

d. Lighting. Health RAC 4. Provide portable task lighting to conform to the IESNA guidelines.

e. Safety and Occupational Health Programs. Health RAC 3. Ensure that part time NGB employees are enrolled in the HCP. Ensure that personnel wear hearing protection when working in the automotive bay and in areas that require hearing protection. Ensure that personnel receive baseline and annual audiometric exams.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1082 of 5269

MDARNG IH Baseline Survey, MG Harry C. Ruhl Armory, Towson, MD, Report No. 55-ML-048L-05/07, 26 August 2005

11. ADDITIONAL ASSISTANCE. For additional assistance or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by electronic mail: Non-Responsive@us.army.mil

Non-Responsive

Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive

MAJ, MS
Administrative Program Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1083 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

Literature Cited

1. Occupational Safety and Health Administration, Title 29 Code of Federal Regulations (CFR) Part 1910, current ed. http://www.osha.gov/comp-links.html

2. DA PAM 40-501, Medical Services, Hearing Conservation Program, 10 December 1998. http://www.usapaarmy.mil/pdffiles/p40_501.pdf

3. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p4C_503.pdf

4. American Conference of Governmental Industrial Hygienists (ACGIH), Threshold Limit Values and Biological Exposure Indices, ACGIH, Cincinnati, OH, 2005. http://www.acgih.org/TLV/

5. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62.1-2004, Ventilation for Acceptable Indoor Air Quality.http://www.ashrae.org

6. Illuminating Engineering Society of North America, ANSI/IESNA, RP-1-2004, Office Lighting.

7. ACGIH, Industrial Ventilation: A Manual of Recommended Practices, 25th ed., ACGIH, Cincinnati, OH, 2004.

8. U.S. Army National Guard Bureau, Design Guide 415-2, Design Guide for Logistics Facilities, May 2005.

9. Environmental Protection Agency, Title 40 CFR Part 745, Lead; Identification of Dangerous Levels of Lead; Final Rule, 5 January 2001.

10. NG Pam 420-15, Facilities Engineering, Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 November 2006.

11. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, 19 August 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1084 of 5269

BEST AVAILABLE COPY

APPENDIX B

PHOTOGRAPHS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1085 of 5269

BEST AVAILABLE COPY

Photograph 1. Converted IFR - Storage Room

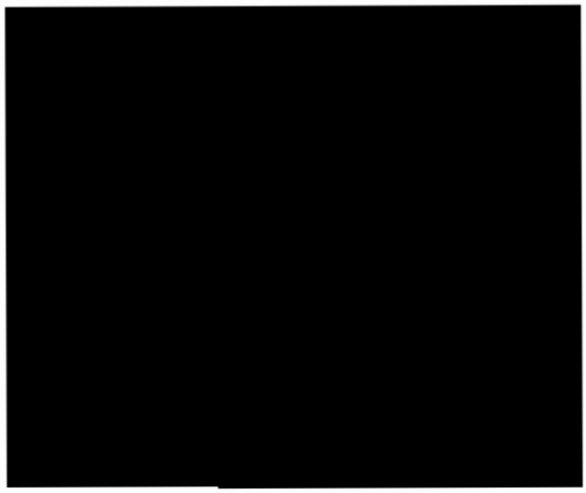

Photograph 2. Converted IFR – Deteriorated LCP and Mold

Photograph 3. Converted IFR - Toy Storage

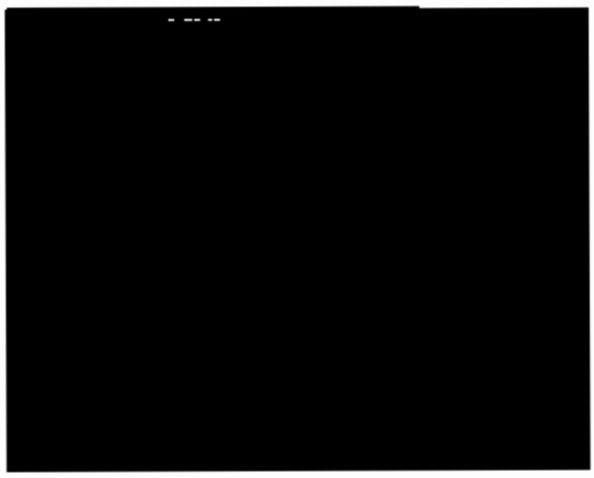

Photograph 4. Converted IFR -Lead Hazard Sign

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1086 of 5269

BEST AVAILABLE COPY

Photograph 5. Vehicle Exhaust Ventilation System

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1087 of 5269

BEST AVAILABLE COPY

APPENDIX C

PROPOSED CRITERIA FOR LEAD

Subject: Recommendations for Surface Lead Dust in Armories

1. In armories that do not contain childcare facilities, the National Guard Bureau (NGB) Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 micrograms per square foot ($\mu g/ft^2$). If a special function will be held in which children will be present in this facility, consider thoroughly cleaning the areas that will be accessible to children prior to the function. This guidance is based on professional judgment, risk assessments, adaptation of Occupational Safety and Health Administration (OSHA) guidance, and feasibility of cleaning to a certain level.

a. Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3)) are not directly applicable because they are criteria for dust-lead hazards developed for floors (40 $\mu g/ft^2$) and windowsills (250 $\mu g/ft^2$) in residential dwellings and child occupied facilities. A child occupied facility is defined as a building, or portion of a building, constructed prior to 1978, visited regularly by the same child, 6 years of age or under, on at least two different days within any week (Sunday through Saturday period), provided that each day's visit lasts at least 3 hours and the combined weekly visit lasts at least 6 hours, and the combined annual visits last at least 60 hours. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. The OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead dust. In workplaces where lead dust is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. The OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1088 of 5269

BEST AVAILABLE COPY

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed. In the interim, we recommend the following actions:

a. Clean all areas that will be accessible to children to the EPA dust-lead standard for children 6 years of age or under (40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ on windowsills).

b. Refer to the local authorities' regulations since they can be more stringent than Federal regulations.

c. Post signs in the area to inform people of the presence of lead dust and its effects.

d. If Soldiers clean weapons in the facility, change the policy so that they cannot clean their weapons in the facility, or if they are allowed to clean their weapons indoors, they must clean the area by wet wiping and mopping the area when they are done.

e. If the paint is peeling, contact the state Environmental Office to test for lead content and provide recommendations.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1089 of 5269

BEST AVAILABLE COPY

APPENDIX D

LABORATORY REPORT

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1090 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1091 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	RUHL Armory	**Chain Of Custody:**	142990		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Towson, MD	**Date Submitted:**	9/7/2005		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2005	**Report Date:**	09-Sep-05

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0564267	RUHL-W-01	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564268	RUHL-W-02	Furnace	Wipe	****	0.111	13501.35	ug/ft²		45000	ug/ft²	
0564269	RUHL-W-03	Furnace	Wipe	****	0.111	33.75	ug/ft²		80	ug/ft²	
0564270	RUHL-W-04	Furnace	Wipe	****	0.111	2.70	ug/ft²		9.4	ug/ft²	
0564271	RUHL-W-05	Furnace	Wipe	****	0.111	33.75	ug/ft²		310	ug/ft²	
0564272	RUHL-W-06	Furnace	Wipe	****	0.111	2.70	ug/ft²		13	ug/ft²	
0564273	RUHL-W-07	Furnace	Wipe	****	0.111	2.70	ug/ft²		3.3	ug/ft²	
0564274	RUHL-W-08	Furnace	Wipe	****	0.111	337.53	ug/ft²		1500	ug/ft²	
0564275	RUHL-W-09	Furnace	Wipe	****	0.111	2.70	ug/ft²		5.6	ug/ft²	
0564276	RUHL-W-10	Furnace	Wipe	****	0.111	1350.14	ug/ft²		3400	ug/ft²	
0564277	RUHL-W-11	Furnace	Wipe	****	0.111	13.50	ug/ft²		23	ug/ft²	
0564278	RUHL-W-12	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564279	RUHL-W-13	Furnace	Wipe	****	0.111	33.75	ug/ft²		170	ug/ft²	
0564280	RUHL-W-14	Furnace	Wipe	****	0.111	33.75	ug/ft²		36	ug/ft²	
0564281	RUHL-W-15	Furnace	Wipe	****	0.111	33.75	ug/ft²		36	ug/ft²	
0564282	RUHL-W-16	Furnace	Wipe	****	0.111	2.70	ug/ft²		6.6	ug/ft²	
0564283	RUHL-W-17	Furnace	Wipe	****	0.111	2.70	ug/ft²		3.6	ug/ft²	
0564284	RUHL-W-18	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564285	RUHL-W-19	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564286	RUHL-W-20	Furnace	Wipe	****	0.111	2.70	ug/ft²		5.1	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1092 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	RUHL Armory	**Chain Of Custody:**	142990		
Address:	301-lH Old Bay Lane, Attn: NGB-AVN-Sl, State Military Reservation	**Job Location:**	Towson, MD	**Date Submitted:**	9/7/2005		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2005	**Report Date:**	09-Sep-05

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0564287	RUHL-W-21	Furnace	Wipe	****	0.111	2.70	ug/ft²		4.1	ug/ft²	
0564288	RUHL-W-22	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564289	RUHL-W-23	Furnace	Wipe	****	0.111	2.70	ug/ft²		3.6	ug/ft²	
0564290	RUHL-W-24	Furnace	Wipe	****	0.111	135.01	ug/ft²		1100	ug/ft²	
0564291	RUHL-W-25	Furnace	Wipe	****	0.111	33.75	ug/ft²		100	ug/ft²	
0564292	RUHL-W-26	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564293	RUHL-W-27	Furnace	Wipe	****	0.111	2.70	ug/ft²		9.2	ug/ft²	
0564294	RUHL-W-28	Furnace	Wipe	****	0.111	33.75	ug/ft²		35	ug/ft²	
0564295	RUHL-W-29	Furnace	Wipe	****	0.111	2.70	ug/ft²		11	ug/ft²	
0564296	RUHL-W-30	Furnace	Wipe	****	0.111	2.70	ug/ft²		9.7	ug/ft²	
0564297	RUHL-W-31	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564298	RUHL-W-32	Furnace	Wipe	****	0.111	2.70	ug/ft²		3.8	ug/ft²	
0564299	RUHL-W-33	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564300	RUHL-W-34	Furnace	Wipe	****	0.111	2.70	ug/ft²	<	2.7	ug/ft²	
0564301	RUHL-W-35	Furnace	Wipe	****	0.111	2.70	ug/ft²		4.3	ug/ft²	
0564302	RUHL-W-36	Furnace	Wipe	****	0.111	2.70	ug/ft²		15	ug/ft²	
0564303	RUHL-W-37	Furnace	Wipe	****	0.111	2.70	ug/ft²		11	ug/ft²	

BEST AVAILABLE COPY

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1093 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Client:	National Guard Bureau	**Job Name:**	RUHL Armory	**Chain Of Custody:**	142990		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Towson, MD	**Date Submitted:**	9/7/2005		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2005	**Report Date:**	09-Sep-05

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.
Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: [redacted] Non-Responsive

Technical Manager: [redacted] Non-Responsive

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX E

LEAD CLEANING GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1094 of 5269

BEST AVAILABLE COPY

CHAPTER 14: CLEANING

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1095 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1096 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1097 of 5269

BEST AVAILABLE COPY

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

- HEPA vacuums.
- Detergent.
- Waterproof gloves.
- Rags.
- Sponges.
- Mops.
- Buckets.
- HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
- 6-mil plastic bags.
- Debris containers.
- Waste water containers.
- Shovels.
- Rakes.
- Water-misting sprayers.
- 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1098 of 5269

BEST AVAILABLE COPY

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris and dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove all leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1099 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter 9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1100 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1101 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards and were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1102 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

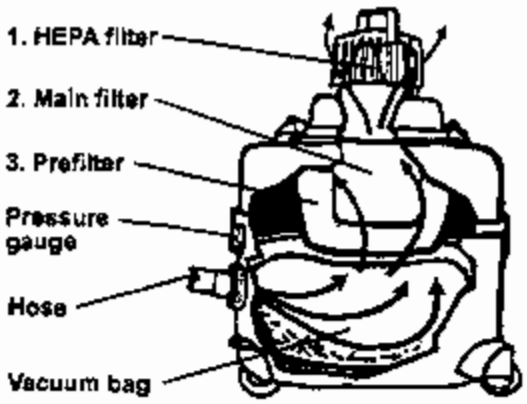

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and prefilter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the prefilter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1103 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

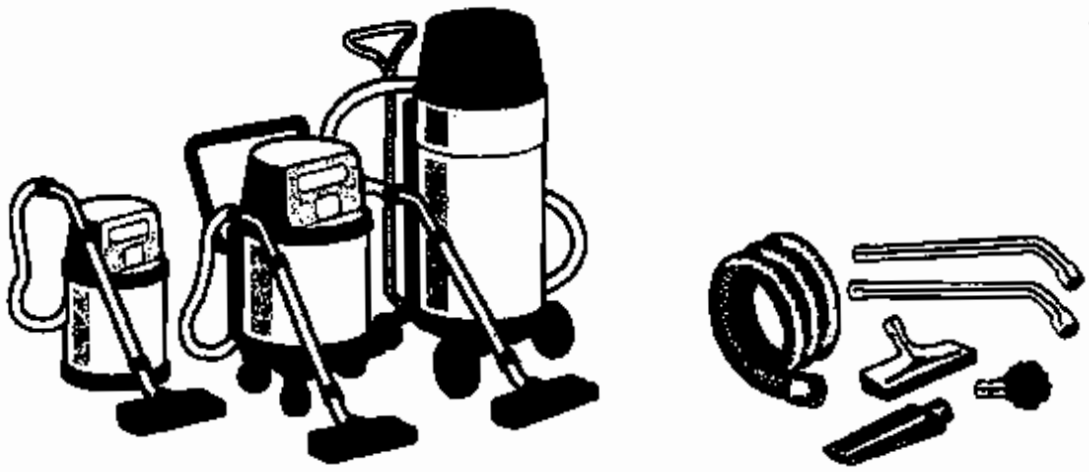

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1104 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

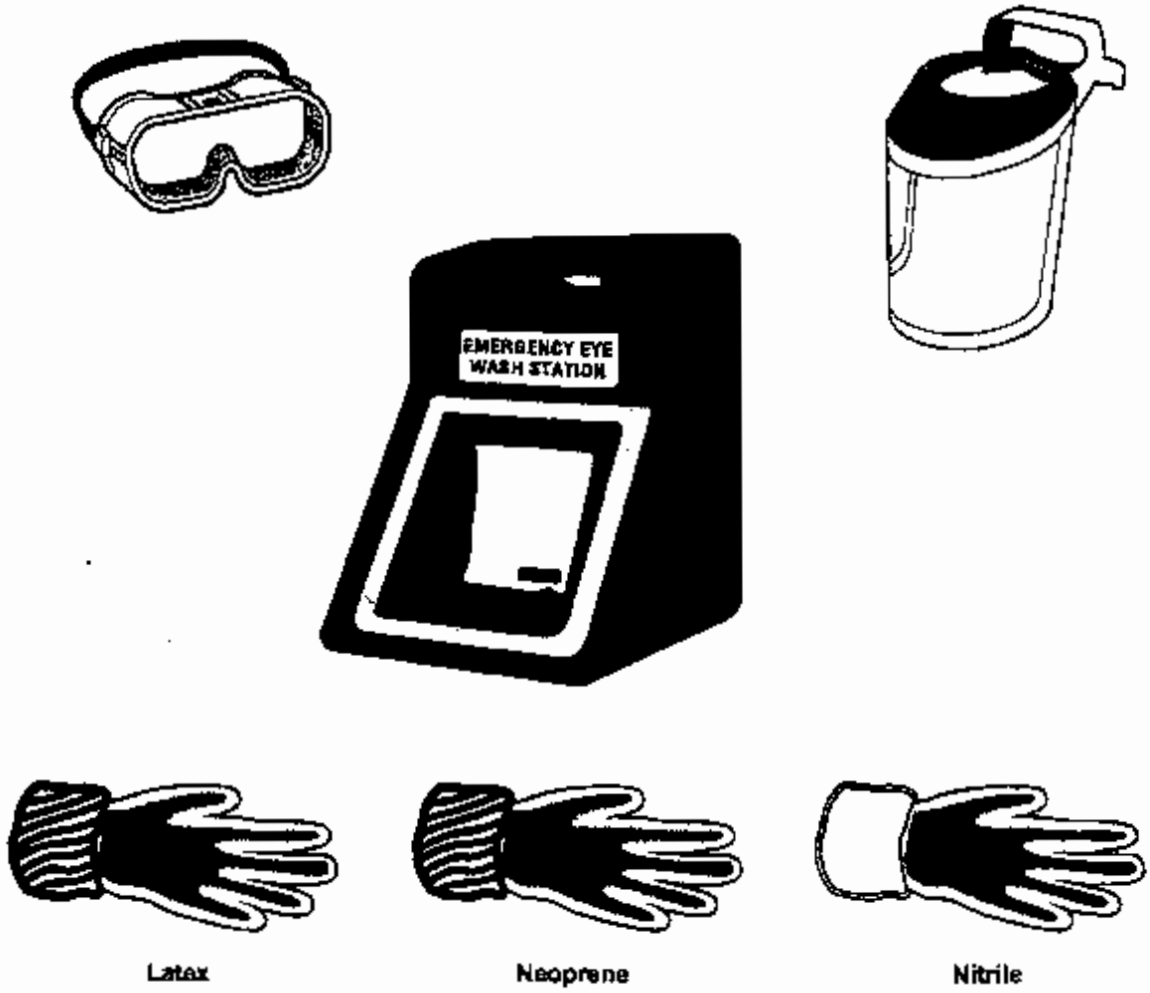

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and than poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1105 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

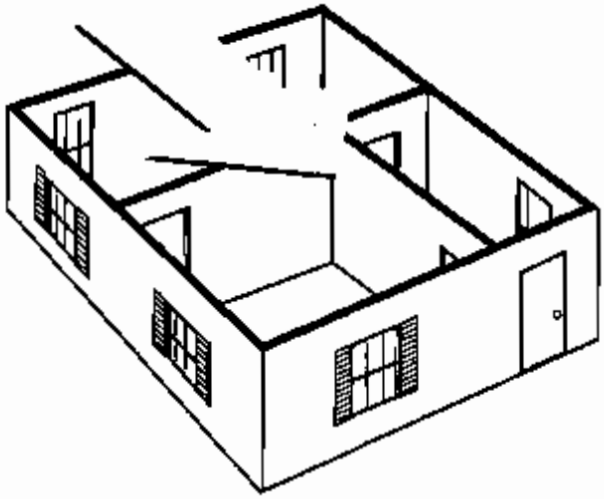

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

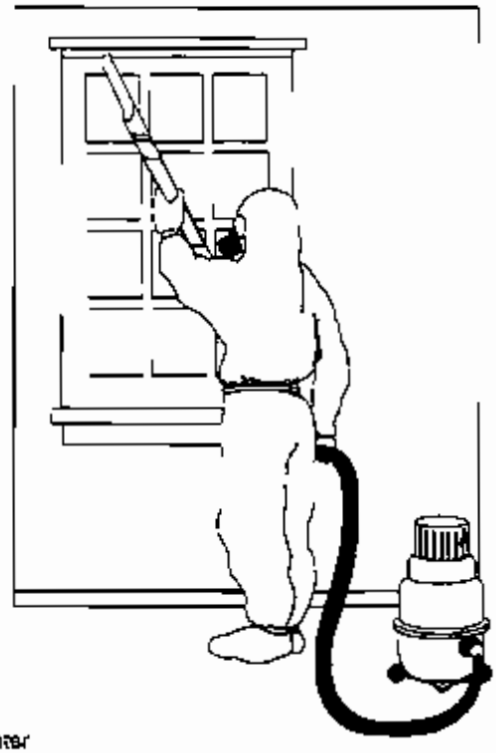

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1106 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1107 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

Wipe All Surfaces

Wet Mop Floor

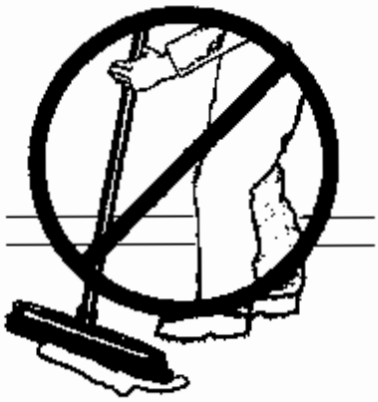

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1108 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

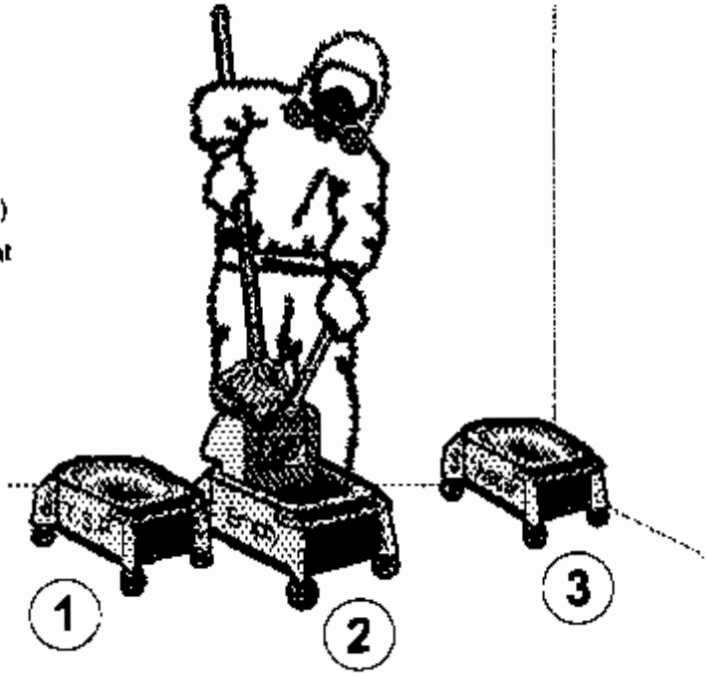

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

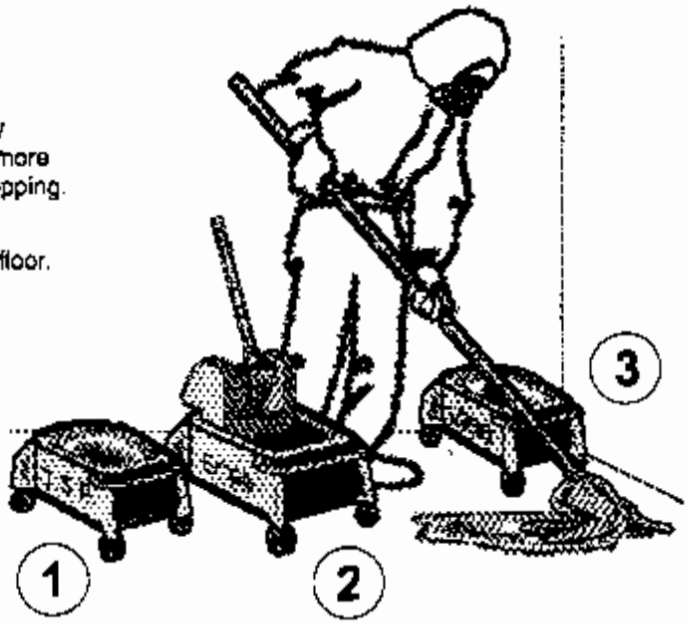

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1109 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1110 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

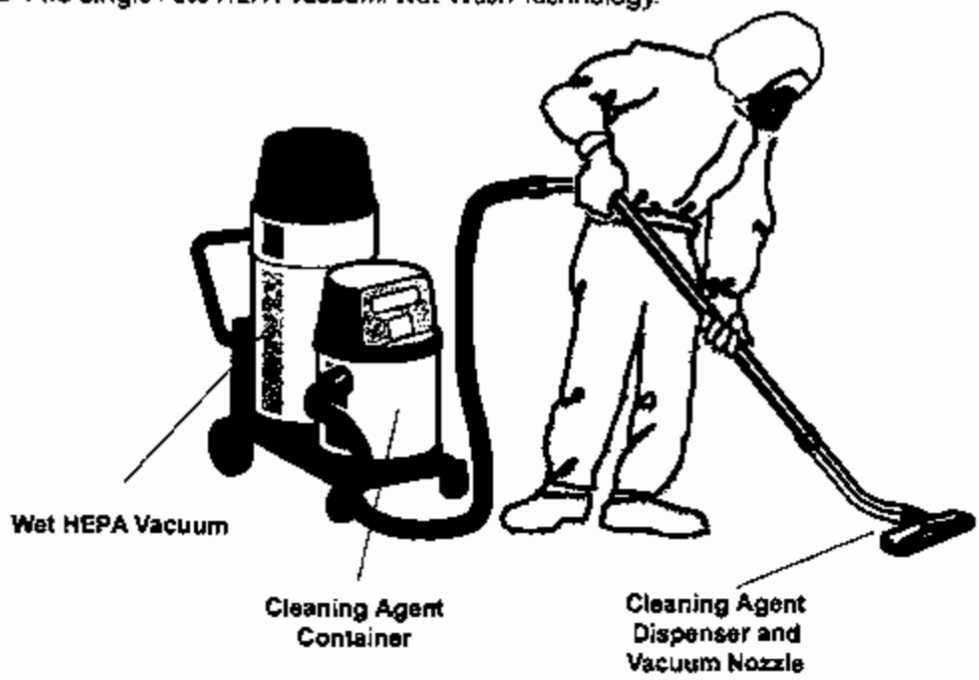

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

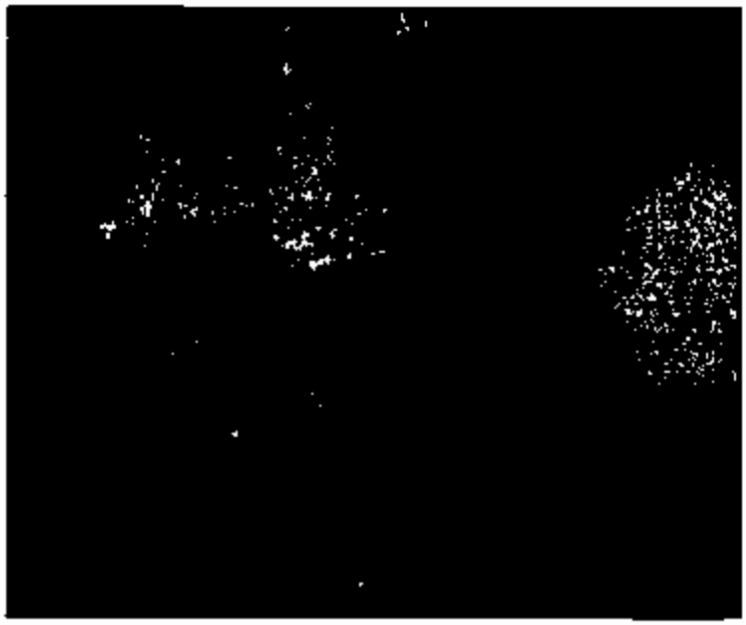

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1111 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1112 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water and cleaned. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1113 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1114 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experienced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1115 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1116 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These Guidelines do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation; Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1117 of 5269

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Study

National Guard Facility
Towson Ruhl Readiness Center
1035 York Road
Towson, MD 21204

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Towson Ruhl Readiness Center** **1035 York Road** **Towson, MD 21204**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**June 10-11, 2010**
Report Date:	**July 22, 2010**
ALSI Project #:	**1006345**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1118 of 5269

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Suspect Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Ventilation Assessment 13

Section 10.0 Limitations 14

Appendix A. Laboratory Analysis Report 15

Appendix B. Photographs 16

Appendix C. Floor Plan 17

Appendix D. References 18

Section 1.0 Executive Summary

An industrial hygiene survey was conducted June 10-11, 2010, at the Towson Ruhl Readiness Center Facility located at 1035 York Road Towson, Maryland 21204. The survey was performed by Mr [redacted] CIH.

1. Lead surface, air and bulk samples were collected. Surface levels of lead exceeded 200 ug/ft^2 in Assembly/Drill Hall on the return vent of the HVAC system. Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2.

2. Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

3. Lighting levels met the minimum recommended guidelines in all locations except the Garage, Kitchen and Old Firing Range (storage). Lighting should be improved to meet the recommended guideline.

4. Indoor air quality parameters of temperature, relative humidity carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment. Temperature, relative humidity, carbon dioxide, and carbon monoxide levels were within parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1120 of 5269

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Towson Ruhl Readiness Center primarily serves as an office setting and training center with vehicle and equipment storage areas. The facility consists of offices, classrooms, a drill hall, garage, and storage areas. There are approximately 25 full-time employees stationed at the facility. On drill weekends there can be many more occupants.

The Armory building was initially constructed in 1979. The training center was built in 1997. The exterior of the building is brick. The interior walls are primarily concrete block and drywall. The heating, ventilating, and air conditioning system (HVAC) consisted of boilers and roof top units. Outdoor air ventilation is provided via the roof-top units in some areas of the building. The ceilings were generally composed of a metal roof deck. Many areas were finished with a suspended drop ceiling system.

There is an old firing range in the building. It was closed in the 1970's and has been fully abated. It is used for storage. It is full of contents and was difficult to inspect.

Site personnel at the time of the site assessment consisted of approximately 25 administrative personnel. The employees on site were conducting general administrative work.

Overall housekeeping was good. Areas are clean and well kept.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1121 of 5269

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels. No noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1122 of 5269

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. Personnel reportedly clean rifles sometimes during drill weekends. The facility contains an unoccupied room which was once an indoor firing range. It is now a storage area.

Various surfaces within the facility were screened for lead using surface/wipe samples and the collection of air samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um MCE cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2	Paint Chip %Pb
1	Drill Hall Classroom	<3.9		
2	Old Firing Range	<4.1		
3	Blank	<3 ug		
4	HVAC – Supply Side		<110	
5	HVAC – Return Side		**360**	
6	Assembly Hall – Amnesty Box		<110	
7	Kitchen – Prep Table		<110	
8	HVAC Supply in Office		<110	
9	Old Firing Range - Floor		<110	
10	Old Firing Range – Stored Items		<110	
11	Old Firing Range – Light Fixture		120	
12	Room 121 - Storage Cabinet		<110	
13	Room 204 - Desk		<110	
14	Room 206 – Desk		<110	
15	Blank		<12 ug	
16	Drill Hall – Peeling Paint on Wall			<0.01
Criteria		**50**	**200**	**0.5**

Key: **Bolded** results exceed listed criteria

Surface levels of lead exceeded 200 ug/ft^2 in the sample collected from the return side of the HVAC system in the assembly hall.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for Environmental Chemicals," the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1123 of 5269

and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3. In fact, no detectable levels of lead were identified in the air samples collected.

Deteriorated paint was observed in a few isolated areas throughout the facility most notable the men's locker room and the wall in the drill hall. Delaminated paint is most likely due to age along with prolonged exposure to elevated relative humidity levels. A paint chip sample was collected from the Assembly/Drill Hall wall where paint was peeling. No lead was detected in the sample collected. The result was less than the HUD definition of lead-based paint (0.5%).

Housekeeping and cleaning activities should be improved to maintain surface lead dust concentrations below 200 ug/ft^2. Emphasis should be placed on any areas where rifle cleaning is performed. Deteriorated and peeling paint should be properly remediated and repaired.

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Old Firing Range (Storage)	**15.7**	30	No
Assembly Hall/Drill Floor	45	30-50	Yes
Kitchen	**46.7**	50	No
Drill Hall Classroom	67.9	30-50	Yes
Office 201	57.5	30-50	Yes
Conference Room 204	33.5	30-50	Yes
Office 203	49.8	30-50	Yes
Men's Latrine	26.8	5	Yes
Office 206	49.3	30-50	Yes
Fitness Center	36	30	Yes
Classroom 102	63.2	30-50	Yes
Classroom 118	58.5	30-50	Yes
Classroom 121	72.7	30-50	Yes
Garage Bays	**44**	75	No

Lighting levels met the minimum recommended guidelines in all locations except the Garage, Kitchen and Old Firing Range (storage). Lighting should be improved in these areas. It should be noted that the old firing range was so full of contents that it was difficult to collect measurements. Illuminance levels could be higher when contents are removed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1125 of 5269

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The IAQ Meter was last calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 73.6 to 77.8 degrees F with relative humidity readings ranging from 42.4% to 55.3%. During the survey, carbon dioxide (CO_2) levels ranged from 437 ppm to 843 ppm within the facility compared to an outdoor CO_2 level of 411 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,111 ppm (411 ppm + 700 ppm). The results of the testing met the ASHRAE guidelines. The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Old Firing Range (storage)	77	51.6	450	1.0
Drill Hall	76.9	48.6	443	0.6
Kitchen	77.7	45.3	452	0.4
Drill Hall Classroom	77.8	44.6	440	0.7
Office 201	75.7	42.6	843	0.6
Conference Room 204	74.2	42.4	437	0.6
Office 203	73.6	44.5	438	0.6
Office 206	75.9	50.8	478	0.2
Fitness Center	75.0	51.7	446	0.6
Classroom 102	74.5	54	495	0.5
Classroom 118	74.1	55.3	465	0.6
Classroom 121	74.2	41.7	511	1.2
Outdoors (Sunny & Warm)	82.3	38.8	411	0
Criteria	**73.0-79.0**	**30-60**	**<1,111**	**<9.0**

Key: **Bolded** results exceed listed criteria

Temperature, relative humidity, carbon dioxide, and carbon monoxide levels were within recommended guidelines.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The roof-top units were inspected as much as possible. However, facility personnel could not open the units for inspection. It was reported that the air-conditioning was not working properly on the day of the survey. The visual inspection revealed the following items that may be potential sources of poor IAQ:

1. Supply vents were dirty in some areas. There were also some isolated areas of visible fungal growth on supply vents in a few locations. This is most likely due to condensation on the supply vent.

2. Water damage was observed in on the ceiling in Room 107. This is believed to be from a previous roof leak that has been repaired. No current water leaks were noted. A few water damaged ceiling tile were observed in the building.

All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced. Supply vents with suspected fungal growth should be cleaned. Do not permit dirt, debris, fungal growth, etc. to accumulate in any portion of the HVAC system including the supply and return vents.

BEST AVAILABLE COPY

Section 7.0 Suspect Asbestos Containing Building Materials

No suspect asbestos containing materials (ACM) were observed at the time of this survey.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1128 of 5269

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is a garage area present at this facility. The garage was formerly an FMS Shop but is no longer used for vehicle maintenance. It is a storage area for the recruiting office. There is local exhaust ventilation (LEV) present for vehicle exhaust. It was not apparent that any special clean up activity has been performed since it was converted to a parking/storage area.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1129 of 5269

BEST AVAILABLE COPY

Section 9.0 Ventilation Assessment

The facility heating, ventilation, and air conditioning is provided by boilers and roof top units. At the time of this survey the air-conditioning was off and in need of repair. No other issues were identified with the mechanical system components.

In the garage area the LEV previously used for vehicle exhaust during maintenance was evaluated. The LEV from Bay 1 was severely damaged and could not be evaluated. The LEV in Bay 2 consisted of a flex duct with a 7.5" duct diameter. The flow rate was measured and found to be 536 Cubic Feet per Minute (CFM). This flow rate is less than the recommended parameters of the American Conference of Governmental Industrial Hygienists (ACGIH) Industrial Ventilation Manual; A Manual of Recommended Practice. The ACGIH recommends a total flow rate of 1,480 – 2,200 CFM.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1130 of 5269

BEST AVAILABLE COPY

Section 10.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1131 of 5269

BEST AVAILABLE COPY

Appendix A. Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1132 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1133 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	Towson Ruhl Armory	**Chain Of Custody:**	508092
Address:	301-JH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Towson, MD	**Date Submitted:**	6/15/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	NGB-IHNE	**Date Analyzed:**	6/22/2010 **Report Date:** 6/22/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1053494	1006345-1	Flame	Air	764	N/A	3.9	ug/m³	<3	<3.9	ug/m³	
1053495	1006345-2	Flame	Air	740	N/A	4.1	ug/m³	<3	<4.1	ug/m³	
1053496	1006345-3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1053497	1006345-4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053498	1006345-5	Flame	Wipe	****	0.108	110	ug/ft²	38	360	ug/ft²	
1053499	1006345-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053500	1006345-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053501	1006345-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053502	1006345-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053503	1006345-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053504	1006345-11	Flame	Wipe	****	0.108	110	ug/ft²	12	120	ug/ft²	
1053505	1006345-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053506	1006345-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053507	1006345-14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1053508	1006345-15	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1053509	1006345-16	Flame	Paint Chip	****	N/A	0.01	%Pb		<0.01	%Pb	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1134 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	Towson Ruhl Armory	**Chain Of Custody:**	508092
Address:	301-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Towson, MD	**Date Submitted:**	6/15/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	NGB-HNE	**Date Analyzed:**	6/22/2010

Report Date: 6/22/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: [redacted] Non-Responsive

Technical Manager: [redacted] Non-Responsive

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1135 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) **508092**

PV2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SL State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Towson Ruhl Armory
2. Job Location: Towson, MD
3. Job #: Towson Ruhl Armory P.O. #: ~~W912K6-09-A-0003~~ NGB - IHAC
4. Contact Pers[redacted] @ phone #: (410) 942-0273
5. Submitted by [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☒ 5 Day +	☒ Email: John.[illegible]@amalabtical lab.com
Comments: ____	☐ 3 Day Date Due: Feb 2/10	☐ Fax: shirley.chapman1@us.army.mil
	☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☐ Verbals: ken.forsythe@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify: ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Gray. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PCM__(Qual) PLM__(Qual) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
TEM Water samples ____ °C)

Metals Analysis
- ☒ Pb Paint Chip 1 (QTY)
- ☒ Pb Dust Wipe (wipe type Ghost) 12 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media: ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WIPE/ SWAB OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
100 6345-1	Drill Hall Classr	6/10	764					X		X							Date/Time: Contact: By:
100 6345-2	Old Firing Range	↓	740					X		X							
100 6345-3	Blank	↓	0					X		X							
100 6345-4	HVAC-Supply	6/10		100 in²				X				X					
100 6345-5	HVAC-Return	↓		↓				X				X					Date/Time: Contact: By:
100 6345-6	Assembly Hall	↓		↓				X				X					
100 6345-7	Kitchen-Prep	↓		↓				X				X					
100 6345-8	HVAC-Supply	↓		↓				X				X					
100 6345-9	Firing Range-Fl	↓		↓				X				X					Date/Time: Contact: By:
100 6345-10	Firing Range-Walls	↓		↓				X				X					[redacted]
100 6345-11	Firing Range-Ceiling	↓		↓				X				X					
100 6345-12	Rental Cabinet	↓		↓				X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 6/15/10 @ 1000 Via: CRS By (Print: [redacted]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1136 of 5269

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 508092 P2/2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Towson Ruhl Armory
2. Job Location: Towson, MD
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person: [redacted] @ phone # (410) 942-0273
5. Submitted by: Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☐ 3 Day + Date Due: ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: @ ☐ Fax: shirley.chapman1@us.army.mil ☐ Verbals: ken.forsythe@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 (QTY)
- ☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA (QTY)
- ☐ NIOSH 7402 (QTY)
- ☐ Other (specify) (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate (QTY)
- ☐ EPA Point Count (QTY)
- ☐ NY State Friable 198.1 (QTY)
- ☐ Grav. Reduction ELAP 198.6 (QTY)
- ☐ Other (specify) (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield (QTY)
- ☐ NY State PLM/TEM (QTY)
- ☐ Residual Ash (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 (QTY)
- ☐ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
- ☐ Qual. (pres/abs) (QTY)
- ☐ ELAP 198.2/EPA 100.2 (QTY)
- ☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
- ☐ Pb Paint Chip (QTY)
- ☐ Pb Dust Wipe (wipe type) (QTY)
- ☐ Pb Air (QTY)
- ☐ Pb Soil/Solid (QTY)
- ☐ Pb TCLP (QTY)
- ☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ☐ Spore-Trap (QTY)
- ☐ Surface Swab (QTY)
- ☐ Surface Tape (QTY)
- ☐ Other (Specify) (QTY)
- ☐ Surface Vacuum Dust (QTY)
- ☐ Culturable ID Genus (Media) (QTY)
- ☐ Culturable ID Species (Media) (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WASTE WATER	SOIL/SOLID	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
100163345-13	Rm 204 Desk	6-11		100 cm²				X				X					Date/Time: Contact: By:
100163345-14	Rm 206 Desk	↓		↓				X				X					
100163345-15	Blank	↓		↓				X				X					
100163345-16	Drill Hall Wall	↓						X			X						
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B. Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1137 of 5269

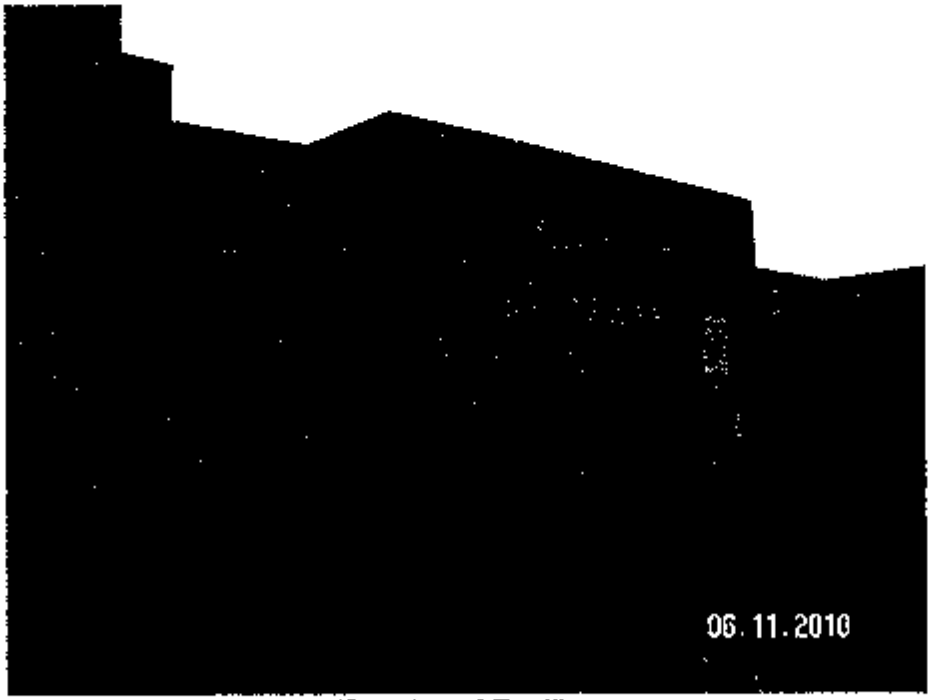

Exterior of Facility.

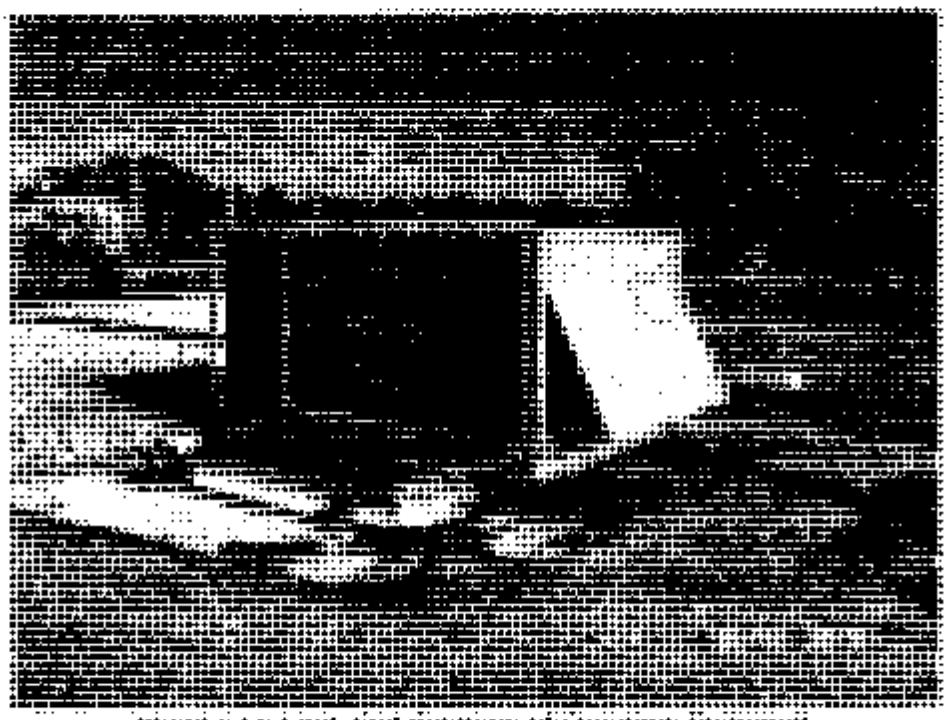

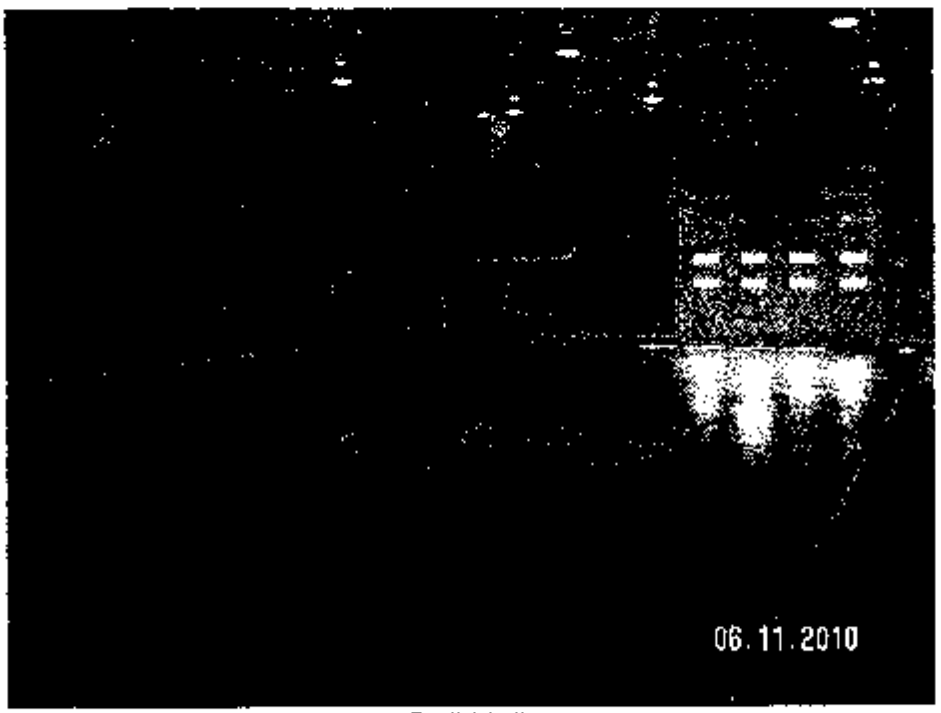

Drill Hall.

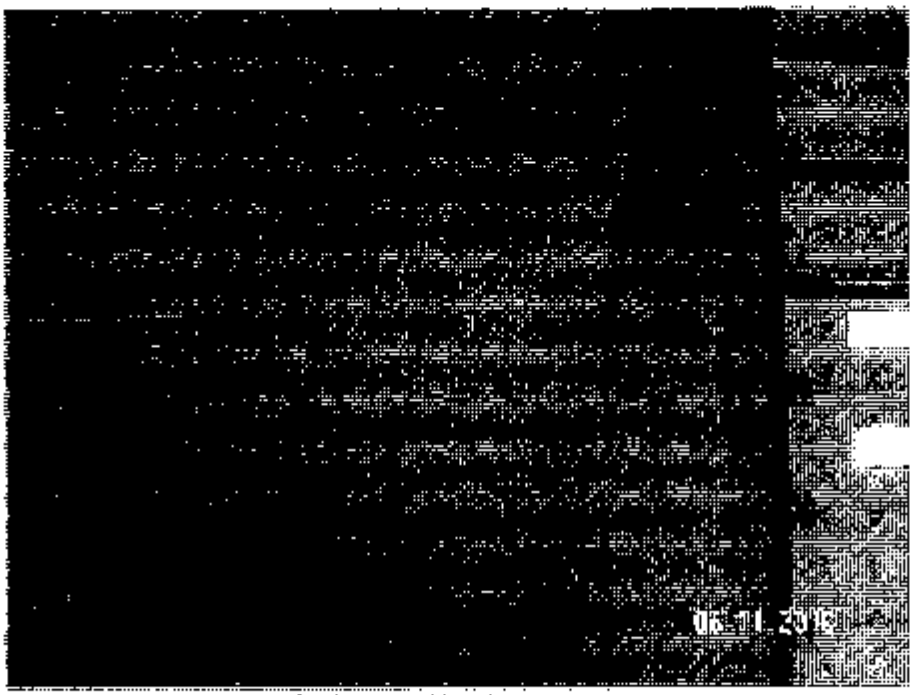

Drill Hall, Peeling Paint.

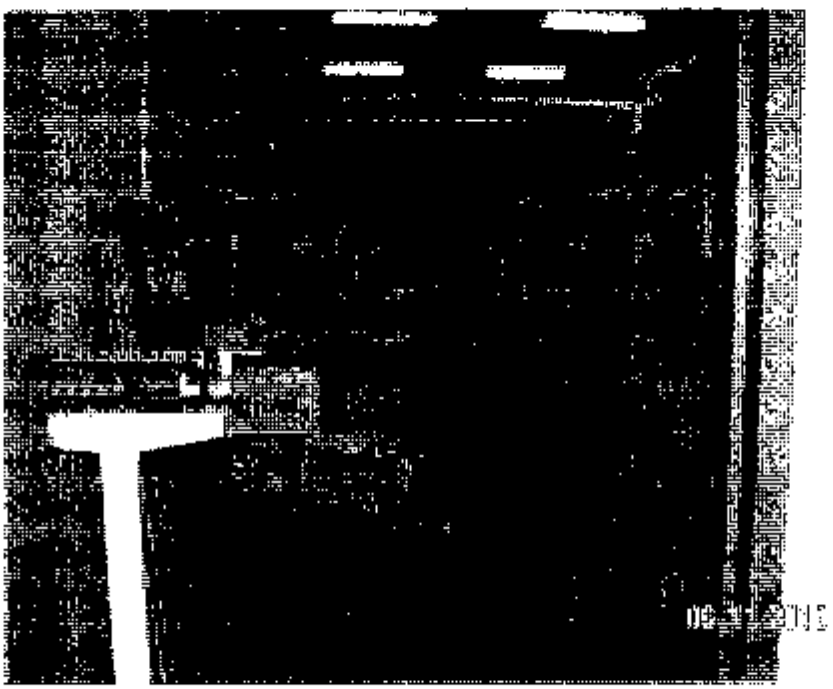

Old Firing Range.

Room 107, Water Damaged Ceiling Tile.

Men's Latrine, Peeling Paint.

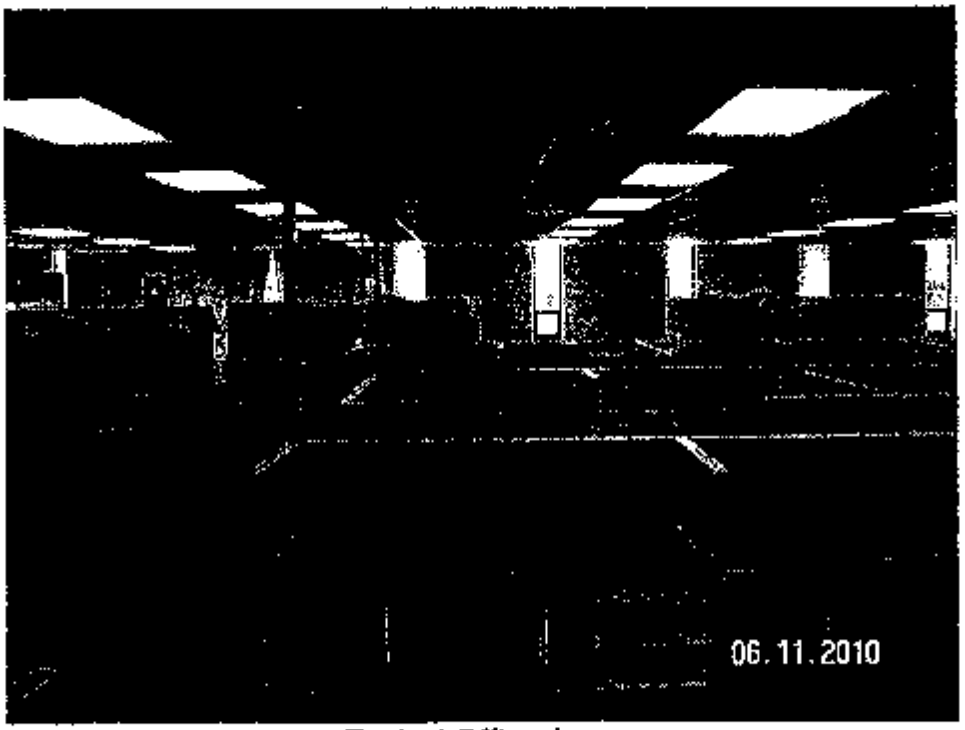

Typical Office Area.

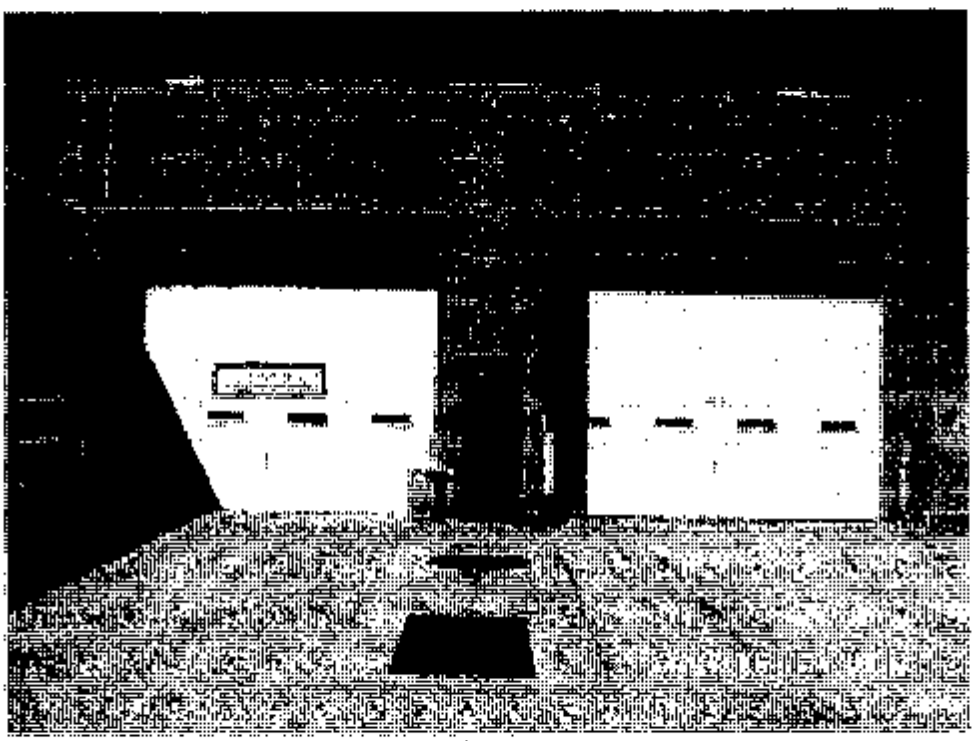

Exterior, Garage Doors.

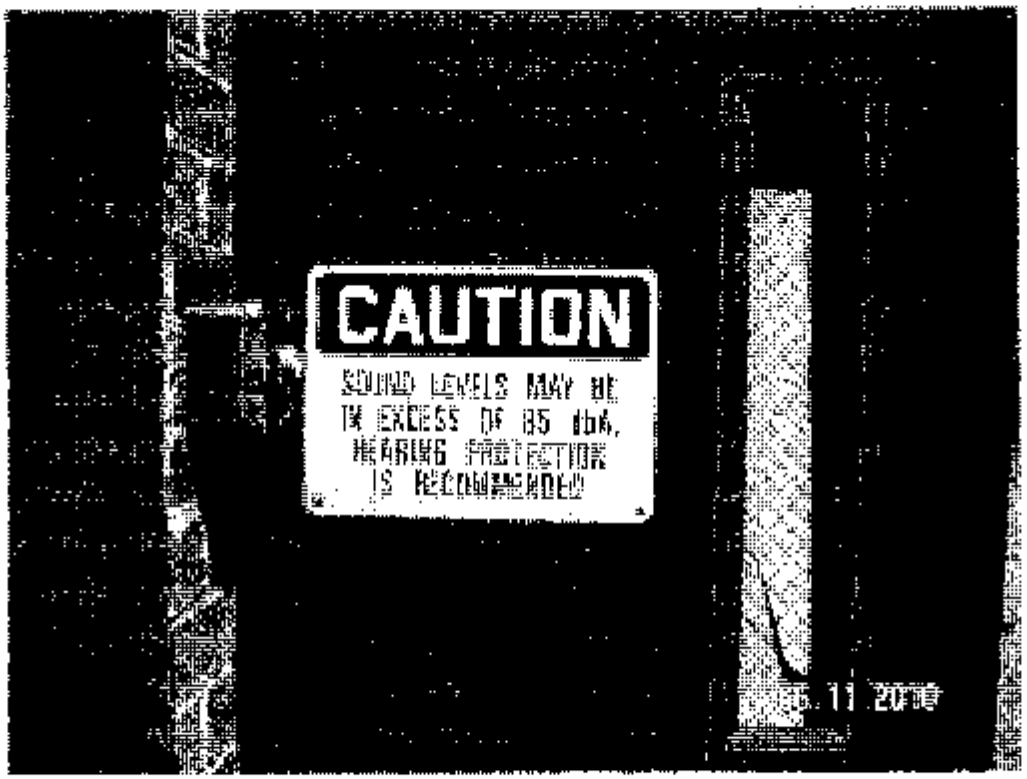

MP Sefine on Garage.

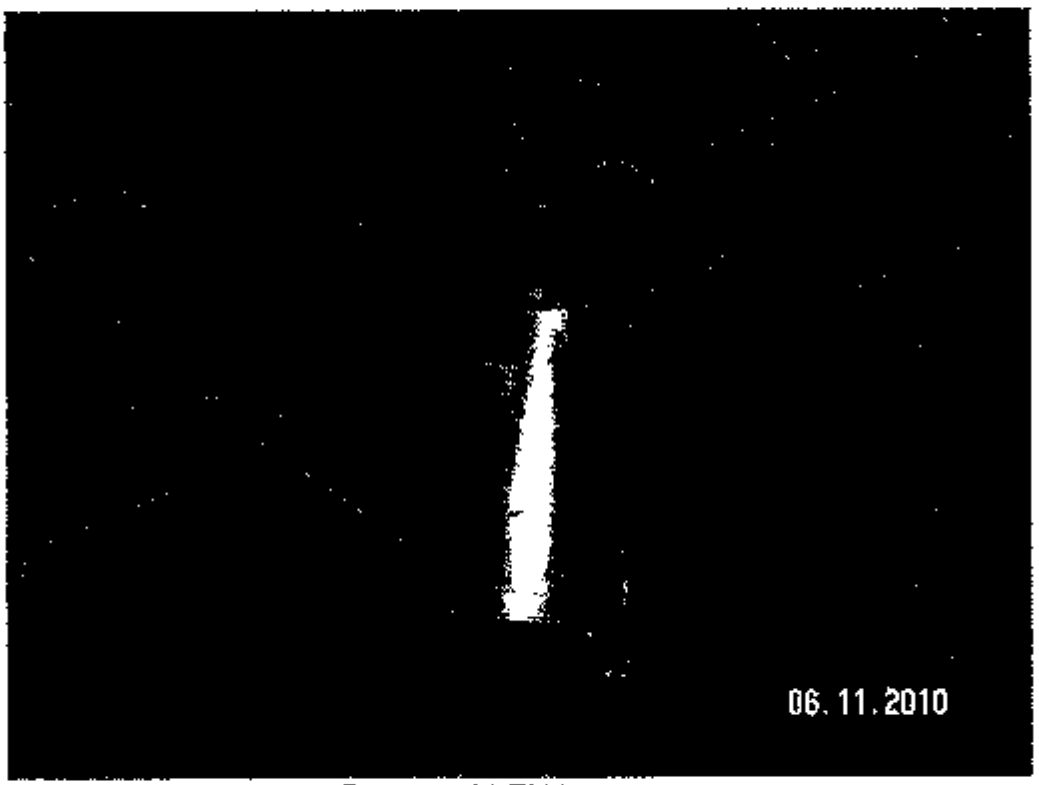

Damaged LEU in garage.

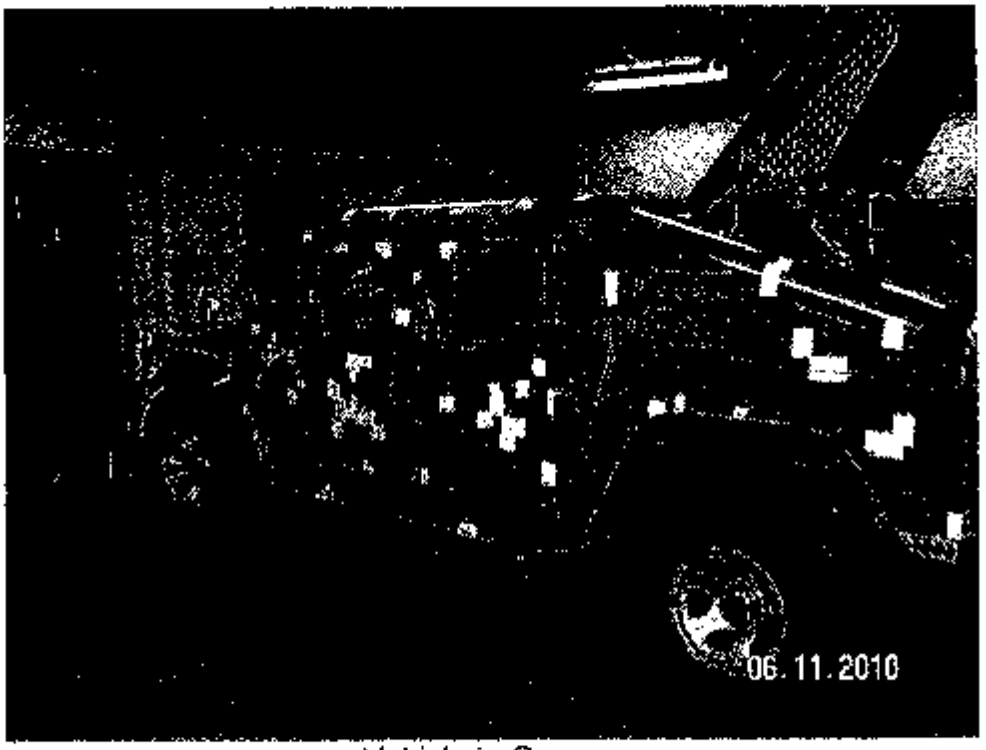

Vehicle in Garage.

BEST AVAILABLE COPY

Appendix C. Floor Plan

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1145 of 5269

BEST AVAILABLE COPY

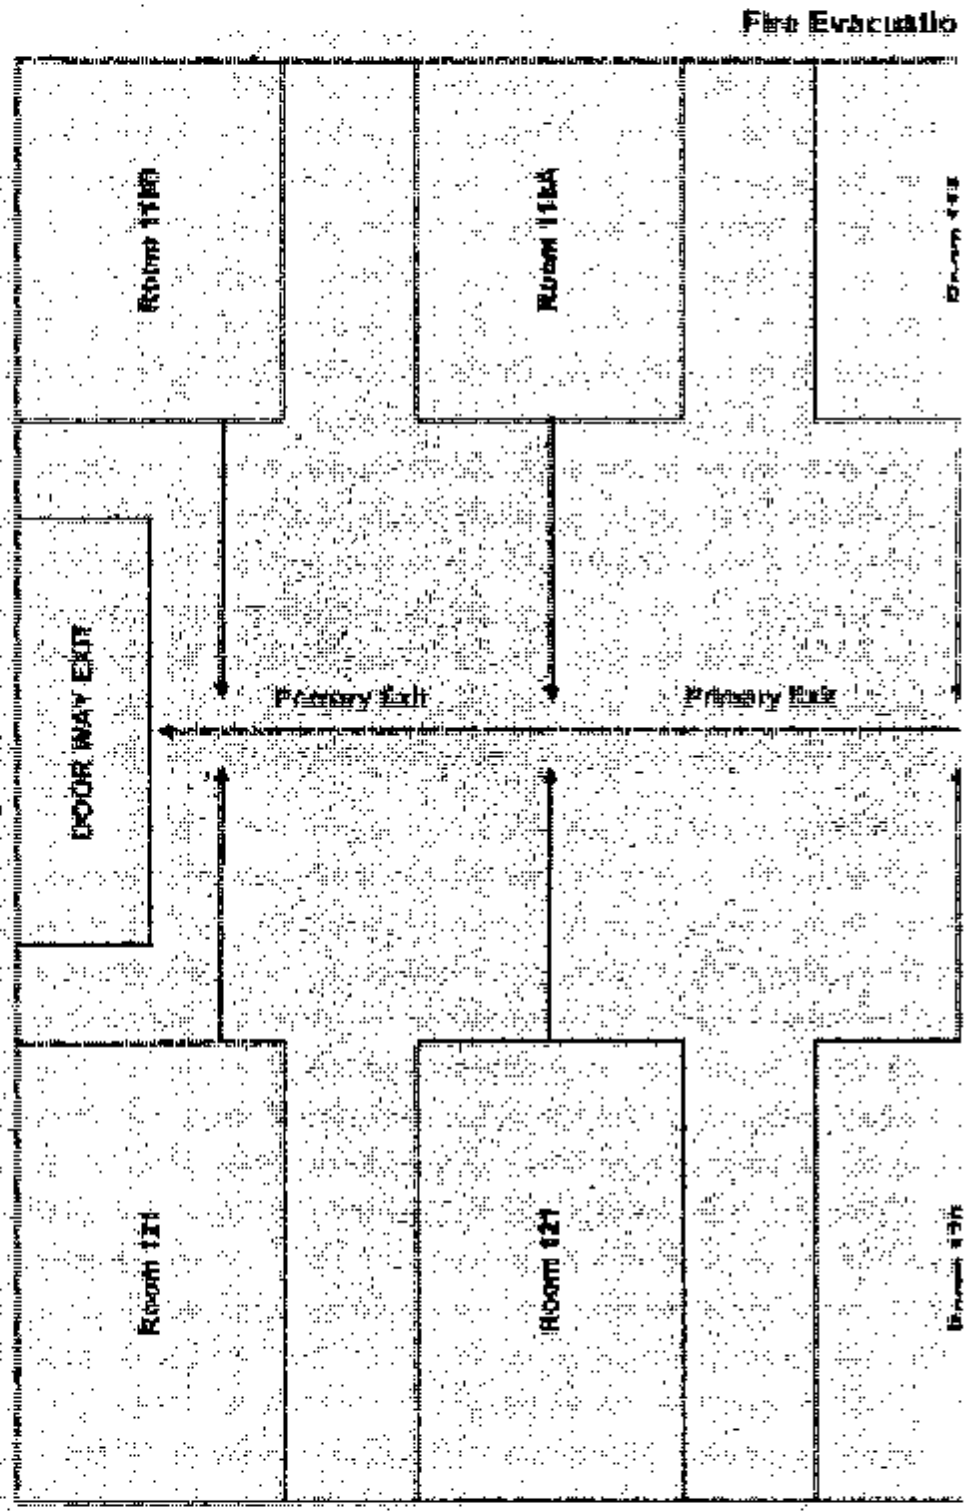

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Fire Evacuation Exit

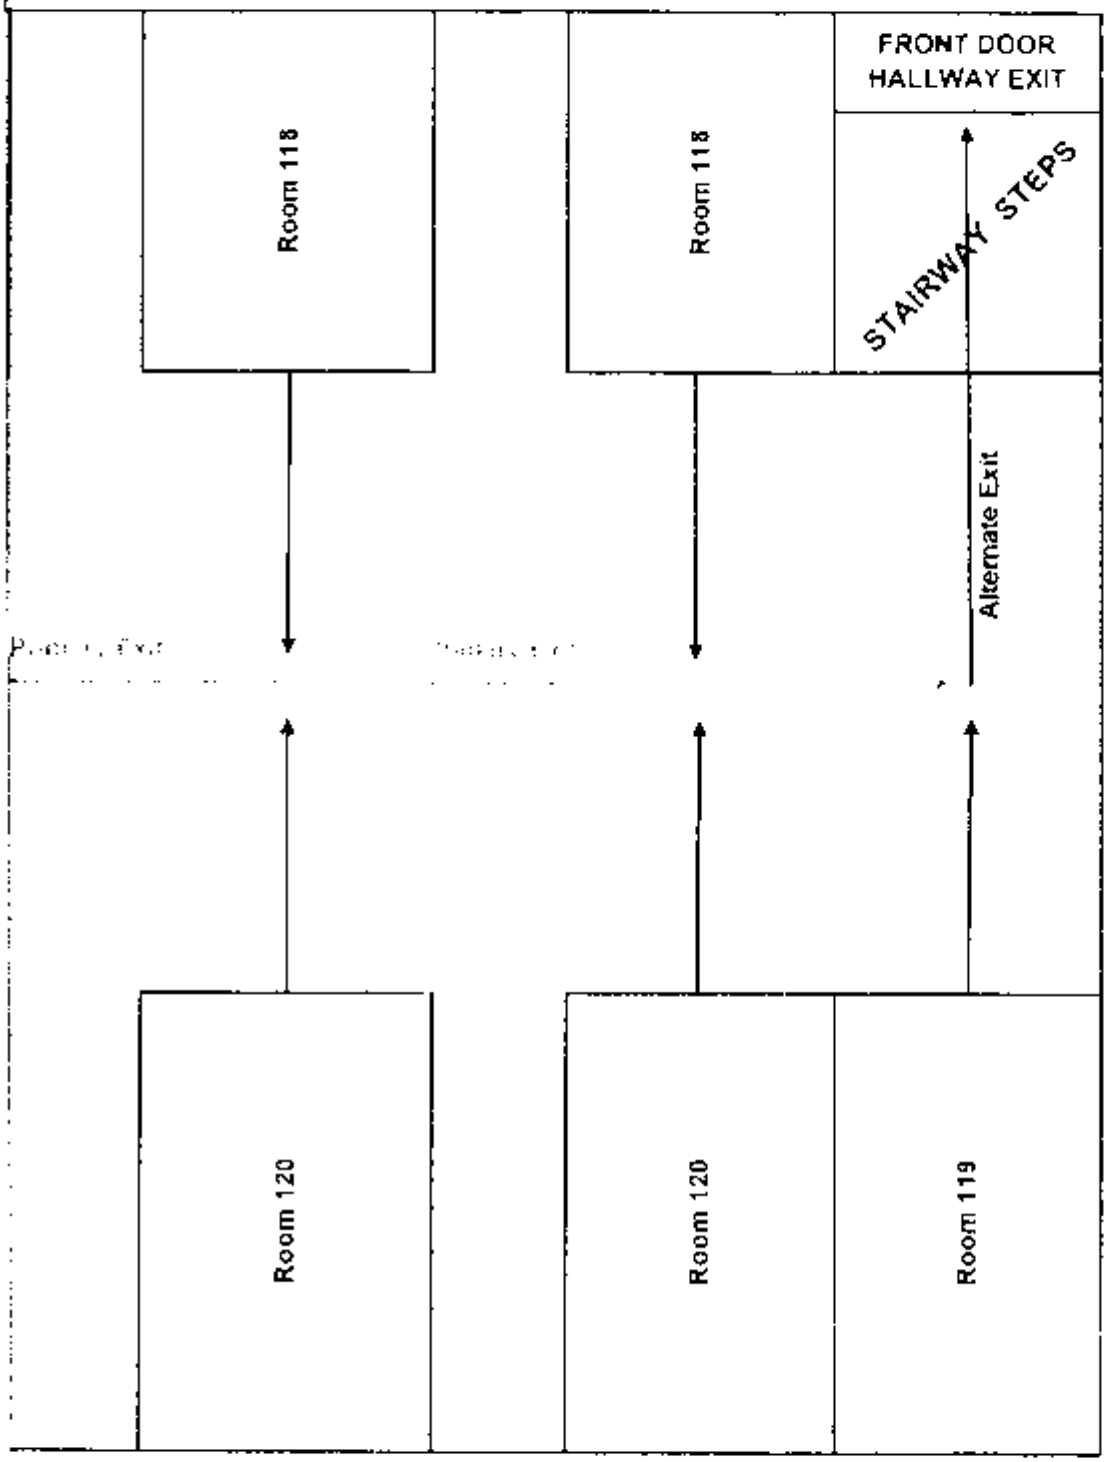

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1148 of 5269

New Wing

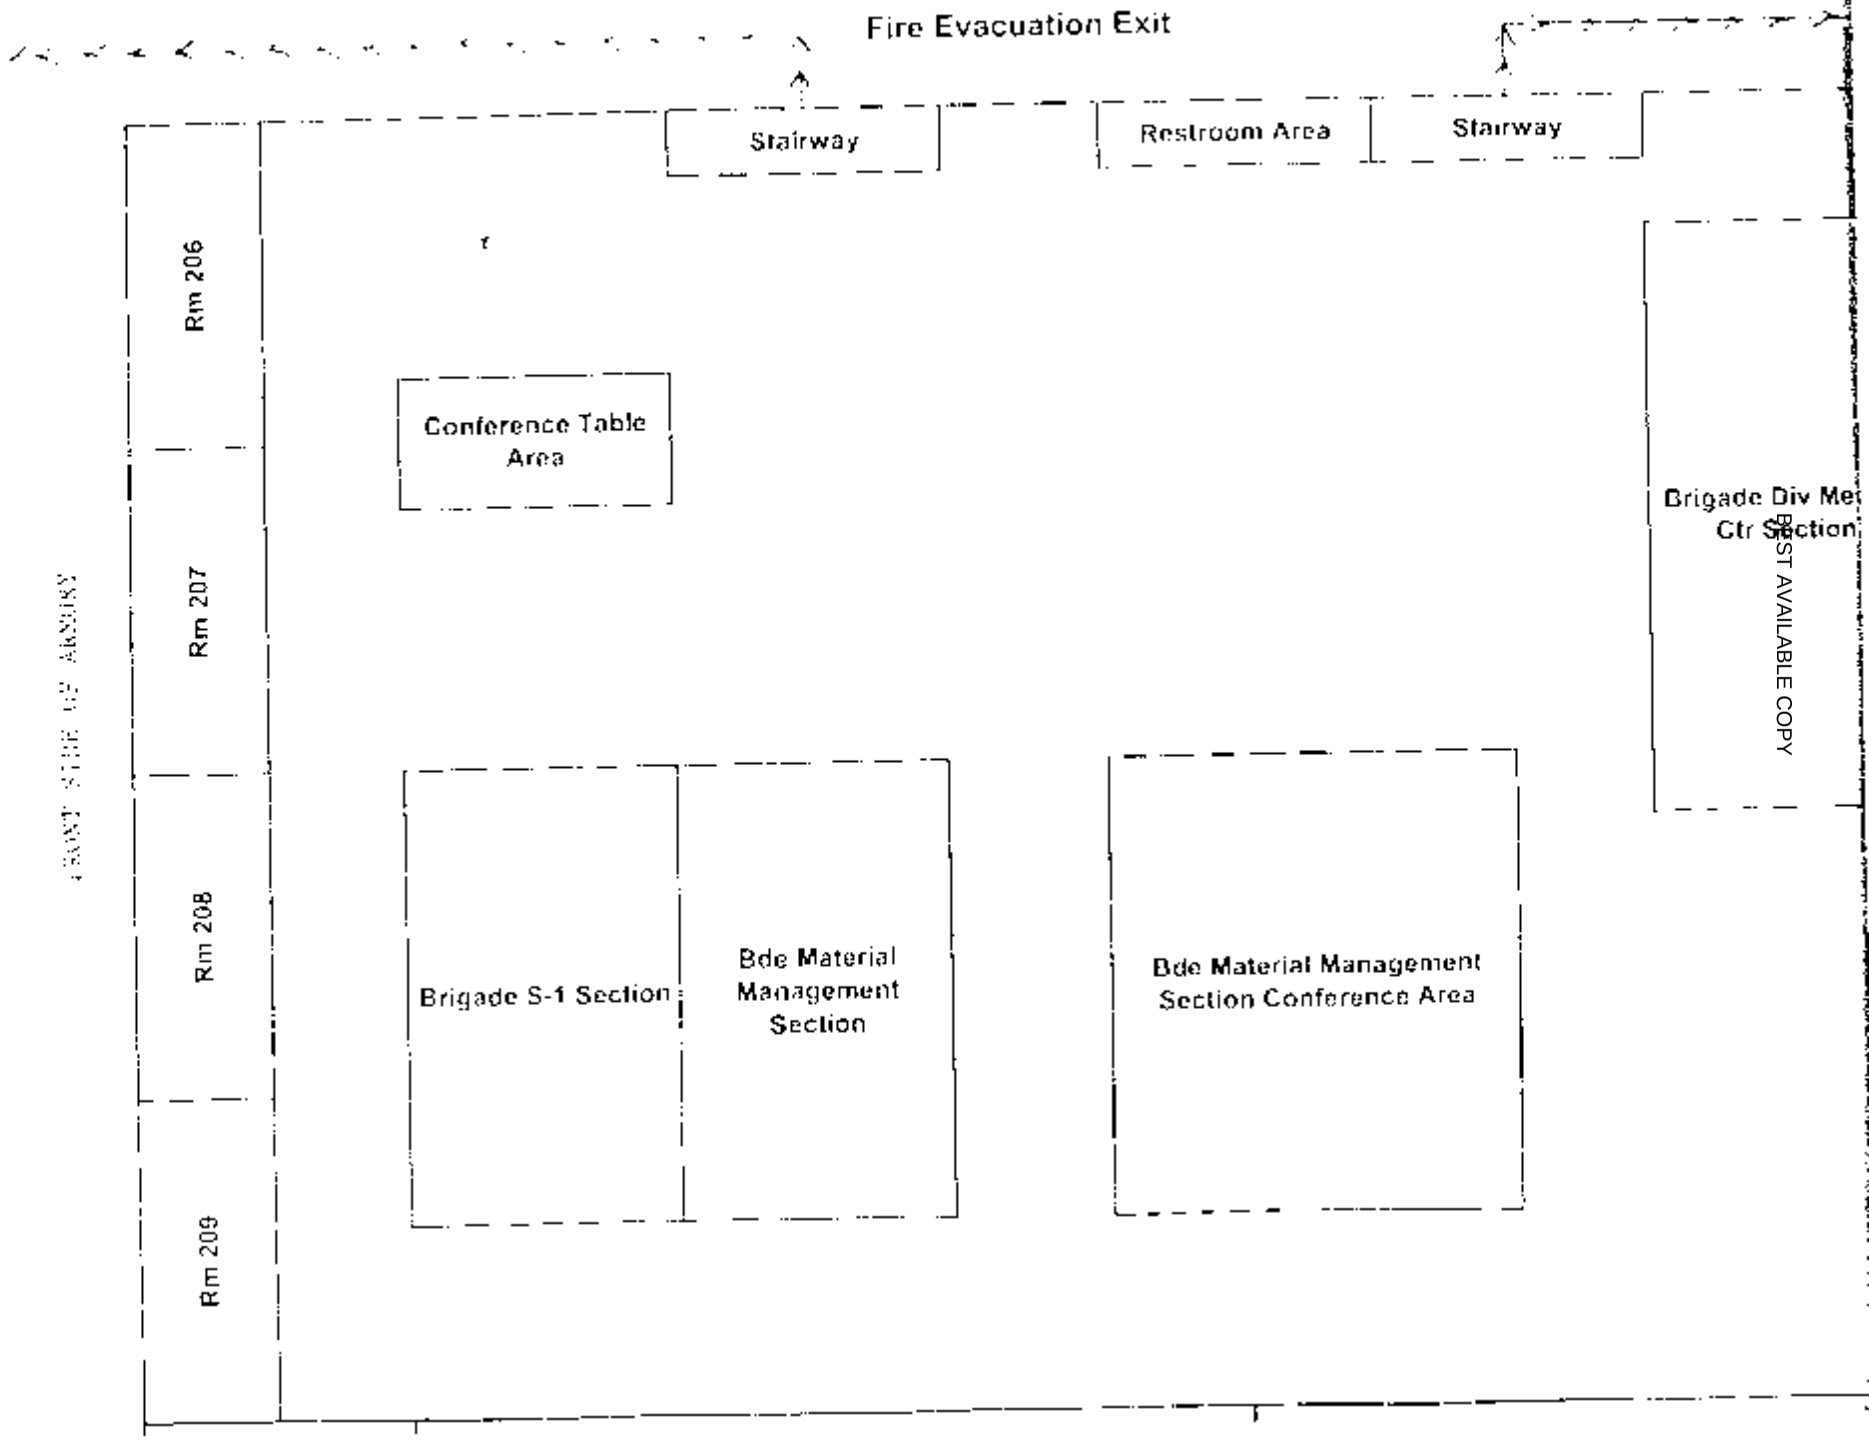

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

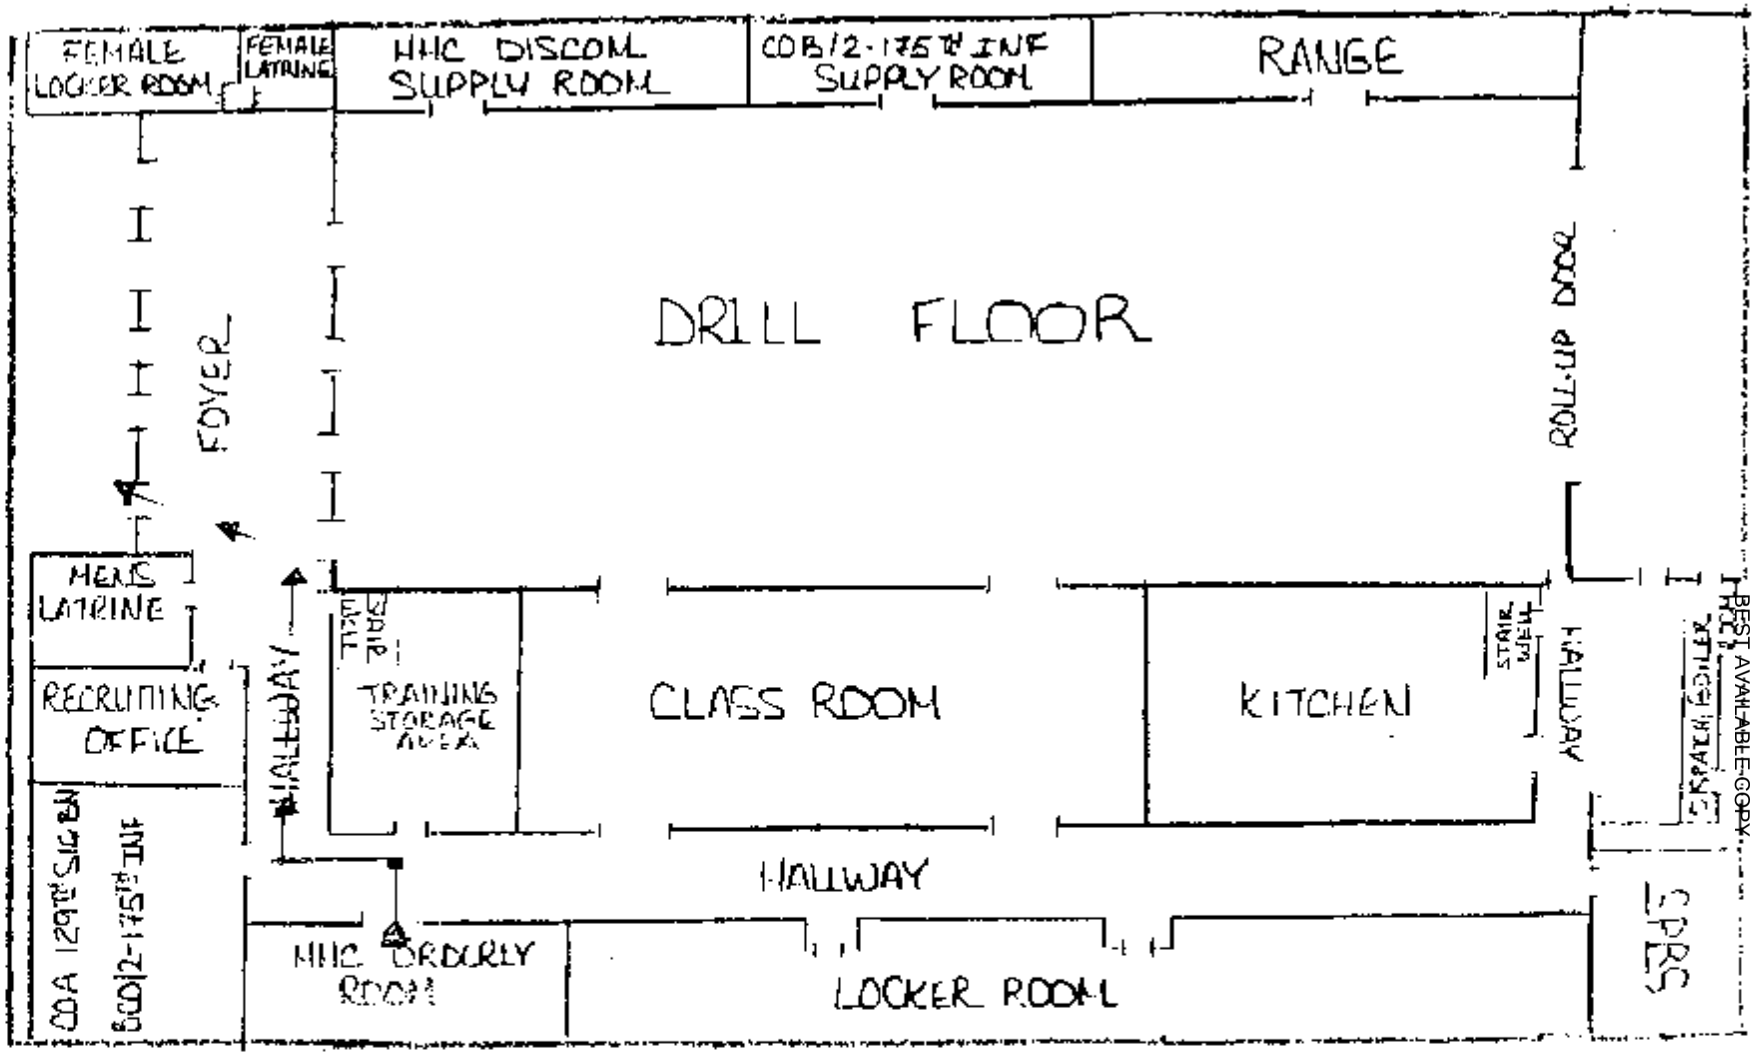

FIRE EVACUATION PLAN
1st FLOOR

FOIA Requested Record #J-15-0085-(MD)
Released by National Guard Bureau
Page 1149 of 5269

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) -- Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1150 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Towson Readiness Center

Prepared For:	**National Guard Bureau Region North** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Towson Readiness Center** **1035 York Road** **Towson, MD 21204**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**December 20, 2012**
Report Date:	**January 28, 2013**

Non-Responsive

[redacted]

Senior Industrial Hygienist

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 9

Section 6.0 Suspect Asbestos Containing Building Materials 12

Section 7.0 Equipment 13

Section 8.0 Limitations 14

Appendix A. Laboratory Analysis Report 15

Appendix B. Photographs 16

Appendix C. Floor Plan 17

Appendix D. References 18

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on December 20, 2012, at the Towson Readiness Center located at 1035 York Road, Towson, MD 21204. The survey was performed by Mr. Non-Responsive.

1. Surface, bulk and air samples for lead were collected. Surface levels of lead exceeded 200 micrograms per square foot (ug/ft^2) in one location. Cleaning procedures should be improved and remedial action should be taken to maintain lead levels below 200 ug/ft^2. See Section 3.0 for sampling results.

2. Lighting levels did not meet the American National Standard Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in the Exercise Room, and the 629th Commander's Office. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters were measured as part of this survey. Relative humidity was less than the recommended guideline in many of the areas. See Section 5.0 for sampling results.

4. Several conditions or factors that could affect indoor air quality were observed at the time of this survey. This includes:

    a. Roof leaks and sources of water infiltration;
    b. Dirty supply and return vents.

Section 2.0 Operation Description & Observations

The Towson Readiness Center is mainly an administrative facility with a drill hall, offices, classrooms, attached garages and storage areas. There were approximately 30 full-time employees stationed at this facility at the time of this survey.

The building is two stories with a brick exterior. The original construction date was not known. There have been some renovations since its construction. The building has a flat rubber roof with stones. The interior walls are concrete block. The floors are concrete with vinyl floor tile or carpet.

The garages are used as vehicle storage areas. No maintenance or repairs are performed in these areas. Access to the garages was restricted.

There is a hot water heating system and five roof top air conditioning units.

The firing range has been converted into a Physical Fitness/Exercise room. No firing range components remain.

There is no child-care facility in the building.

Overall housekeeping practices were adequate.

No ergonomic concerns were reported.

Section 3.0 Lead Testing

Due to the age of the building there is the potential for lead based paint to be present. Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Bulk (%)	Air ug/m^3	Surface ug/ft^2
1	Orderly Room	*	<6.1	*
2	Drill Hall – Center	*	<5.5	*
3	Blank	*	<3	*
4	Drill Hall Floor	*	*	<110
5	Drill Hall Top of HVAC	*	*	160
6	Kitchen – Top of Freezer	*	*	<110
7	S – 1 Offices Supply Vent	*	*	<110
8	Converted Firing Range - Floor	*	*	<110
9	Converted firing Range - Contents	*	*	<110
10	Converted Firing Range – Light Fixture	*	*	**1900**
11	Entrance to Converted Firing Range – Floor	*	*	<110
12	Classrooms Main Hallway	*	*	<110
13	Classroom 120	*	*	<110
14	29th Rear Detachment Conference Room	*	*	<110
15	29th Rear Detachment Office 202C	*	*	<110
16	Command Section 213 Top of Cabinet	*	*	<110
17	Command Section J. Funk Station	*	*	<110
18	Command Section Col. Office	*	*	<110
19	29th Supply Office - Bookshelf	*	*	<110
20	29th Supply Area – Metal Shelf	*	*	<110
21	HHC Storage – Top of Cabinet	*	*	<110
22	HHC Office – Top of Cabinet	*	*	<110
23	629th Office – Desk	*	*	<110
24	Large Room off HHC – Top of Cabinet	*	*	<110
25	Drill Hall – South Wall	<0.01	*	*
-	Criteria	0.5	50	200

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million

3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Source: NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Bulk, surface and air samples for lead were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were at or above the recommended guideline of 200 ug/ft^2 in the: Converted Indoor Firing Range on the Light Fixture

  Cleaning procedures should be improved to maintain lead levels on surfaces below the recommended guideline of 200 ug/ft^2.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3.

- Paint was observed to be peeling in the Drill Hall on the east wall. A bulk sample was collected and determined to contain <0.01% Pb. This is less than the EPA definition of lead based paint = 0.5%. However, all areas of peeling paint should be repaired.

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K98364). The light meter was last calibrated in April 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Food Services-Dining	51	10	Yes
Classroom 120	62	30 – 50	Yes
Classroom 118	60	30 – 50	Yes
Command Section Offices (Open Plan)	52	30 – 50	Yes
Command Section Office 208	80	30 – 50	Yes
Command Section Office 209	70	30 – 50	Yes
Command Section Office 210	114	30 – 50	Yes
Command Section Office 207	56	30 – 50	Yes
Command Section Office 206	81	30 – 50	Yes
Legal Office	35	30 – 50	Yes
Office 101	80	30 – 50	Yes
Food Services - Kitchen	60	50	Yes
Armory/Assembly - Drill Hall	35	10	Yes
29th Supply Office	69	30 – 50	Yes
29th Supply Storage	30	30	Yes
Lobby	50	10	Yes
Physical Fitness/Exercise	15	30	**No**
Women Latrine/Locker Room	18	5	Yes
29th Offices	85	30 – 50	Yes
29th Rear Detachment Office 204A	83	30 – 50	Yes
29th Rear Detachment Conference Room	31	30 – 50	Yes
Conference Room off HHC	71	30 – 50	Yes
HHC Offices (Open Plan)	56	30 – 50	Yes
HHC Storage	33	30	Yes
Command Office	45	30 – 50	Yes
629th Open Offices	35	30 – 50	Yes
629th Commander's Office	15	30 – 50	**No**

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting level did not meet the minimum recommended guideline in the Exercise Room, and the 629th Commander's Office. Lighting should be improved in these areas.

Section 5.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, carbon monoxide and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 8554 (Serial #02041015). The IAQ Meter was last calibrated in August 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	46.6	46.6	303	3.0
Food Services – Dining Area	70.7	**28.8**	591	3.1
Classroom 120	63.7	41.9	534	2.5
Classroom 118	67.1	38.9	558	2.8
Command Section Offices	70.7	**28.1**	654	2.8
Office 208	71.2	**27.5**	672	2.6
Office 209	72.0	**28.6**	675	2.7
Office 210	72.3	**27.0**	675	2.6
Office 207	72.9	**27.5**	637	2.7
Office 206	72.7	**27.8**	663	2.7
Legal Office	72.3	**25.2**	555	2.6
Office 101	72.9	**24.5**	593	2.5
Food Services - Kitchen	71.4	**25.7**	515	2.5
Armory/Assembly-Drill Hall	68.9	**26.4**	490	2.6
29th Supply Office	66.9	37.3	510	2.5
29th Supply Storage	66.9	35.5	528	2.6
Lobby	66.0	**29.8**	488	2.6
Physical Fitness/Exercise Room	65.5	33.0	490	1.5
Women's Latrine	64.4	49.7	497	1.3
29th Offices	69.3	31.9	603	1.2
29th Rear Detachment Office 204A	70.7	30.0	615	1.3
29th Rear Detachment Conference	70.7	30.1	599	1.2

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
HHC Conference Room	68.7	**26.1**	531	1.5
HHC Offices	70.2	**25.1**	601	1.0
HHC Storage	65.8	**28.6**	456	1.5
Command Office	67.6	**25.6**	450	1.1
629th Offices	71.1	**28.8**	710	1.1
629th Commander's Office	61.0	31.7	386	1.1
Outdoors	46.9	46.5	306	1.0
Criteria	**68.0-79.0**	**30-60**	**<1,006**	**<9.0**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **F =** degrees Fahrenheit

Source: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010 & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature was <68°F in some areas (criteria of 68-79°F). However, many areas were not occupied during this survey. For comfort, maintain temperature levels between 68-79°F in occupied areas. Relative humidity was <30% (criteria of 30-60%) in many areas. Low relative humidity can cause the drying of the mucous tissues and an increased susceptibility to respiratory infection. Maintain relative humidity levels between 30-60%.

- Carbon dioxide levels measured did not exceed the recommended ceiling of 1,006 parts per million (ppm). This indicates that outdoor air ventilation is adequate in all areas.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm.

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observations were noted:

    - Numerous roof leaks and associated water damaged ceiling tile were present (e.g. Classroom 118, Physical Fitness/Exercise Room, Lobby, HHC Offices, and 29th Rear Detachment 202A Office). All sources of water infiltration should be identified and repaired. Water stained ceiling tile should be removed and replaced.

- Overall housekeeping was adequate.
- The HVAC supply grills located in some areas were dirty. These should be cleaned. Do not permit dirt, debris, microbial growth, etc. to accumulate in any portion of the HVAC system.

Section 6.0 Suspect Asbestos Containing Building Materials

Because the age of the building was unknown, asbestos-containing materials (ACM) could be present in the facility. The following suspect asbestos-containing material was noted:

1. HVAC duct sealant in the Women's Latrine. This material was in good condition.

All suspect asbestos-containing material was observed to be intact and in good condition. Inaccessible areas such as behind walls or crawlspaces were not inspected. No bulk samples were collected.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI Q-Trak IAQ Meter	02041015	8/2012	NA
Cal Light 400 Light Meter	K98364	4/2012	NA
TSI 4100 Series Calibrator	6275	8/2012	NA
SKC Air Sampling Pump	647631	12/20/2012	1.98 LPM
SKC Air Sampling Pump	648349	12/20/2012	1.69 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	NGB-Towson	**Chain Of Custody:**	514859
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	1035 York Road, Towson, MD	**Date Submitted:**	12/24/2012
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	12/27/2012 **Report Date:** 12/27/2012

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13025542	1	Flame	Air	490	N/A	6.1	ug/m³	<3	<6.1	ug/m³	
13025543	2	Flame	Air	547	N/A	5.5	ug/m³	<3	<5.5	ug/m³	
13025544	3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
13025545	4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025546	5	Flame	Wipe	****	0.108	110	ug/ft²	18	160	ug/ft²	
13025547	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025548	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025549	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025550	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025551	10	Flame	Wipe	****	0.108	110	ug/ft²	210	1900	ug/ft²	
13025552	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025553	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025554	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025555	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025556	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025557	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025558	17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025559	18	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025560	19	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

An AIHA (#100470) and BEST AVAILABLE COPY Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1166 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	NGB-Towson	**Chain Of Custody:**	514859
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	1035 York Road, Towson, MD	**Date Submitted:**	12/24/2012
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	12/27/2012 **Report Date:** 12/28/2012

Attention: Non-Responsive [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13025561	20	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025562	21	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025563	22	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025564	23	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025565	24	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13025566	25	Flame	Paint Chip	****	N/A	0.01	%Pb		<0.01	%Pb	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: Non-Responsive [redacted]

Technical Manager Non-Responsive [redacted]

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10820) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

OWI (410) 247-2024 159202

514859

1 of 3

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: NGB-TOWSON
2. Job Location: 1035 YORK RD TOWSON MD
3. Job #: PO #: W912K6-09-A-0003
4. Contact Perso [redacted]
5. Submitted by: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: 1/2/13 ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: dlarson@compliancepace.com ☐ Fax: shirley.chapman1@us.army.mil ☐ Verbals: ken.forsythe@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☒ Pb Paint Chip 1 (QTY)
- ☒ Pb Dust Wipe (wipe type GHOST wipe) 21 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1.	ORDERLY ROOM	12/20/12	490					X								
2.	DRILL HALL CENTER		547													
3.	BLANK		0													
4.	DRILL HALL FLOOR			100cm²												
5.	DRILL HALL TOP of HVAC															
6.	KITCHEN TOP of Freezer															
7.	S-1 Supply OFFICE															
8.	Conv. Firing RANGE FLOOR															
9.	Content															
10.	Lt. Fixture															
11.	OUTSIDE - FLOOR															
12.	CLASSROOMS MAIN HALL															

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

[redacted]

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 12 / 24 / 12 @0800 Via: FEDEX By (Print [redacted] Sign [redacted]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: 7939 3322 9046

Posted to NGB FOIA Reading Room May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD) Released by National Guard Bureau Page 1168 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 514859

2of3

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: NGB - TOWSON
2. Job Location: 1035 YORK RD TOWSON MD
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] gnature: Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
- ❑ Immediate Date Due:
- ❑ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ❑ Immediate
- ❑ Next Day
- ❑ 2 Day
- ❑ 3 Day
- ☒ 5 Day +
- Date Due:
- ❑ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
- ☒ Includ Non-Responsive ts with Report
- ☒ Email: [redacted] @complianceplace.com
- ❑ Fax: Non-Responsive @us.army.mil
- ❑ Verbals: [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ❑ NIOSH 7400 (QTY)
- ❑ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ❑ AHERA (QTY)
- ❑ NIOSH 7402 (QTY)
- ❑ Other (specify) (QTY)

PLM Bulk
- ❑ EPA 600 – Visual Estimate (QTY)
- ❑ EPA Point Count (QTY)
- ❑ NY State Friable 198.1 (QTY)
- ❑ Grav. Reduction ELAP 198.6 (QTY)
- ❑ Other (specify) (QTY)

MISC
- ❑ Vermiculite
- ❑ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
- ❑ ELAP 198.4/Chatfield (QTY)
- ❑ NY State PLM/TEM (QTY)
- ❑ Residual Ash (QTY)

TEM Dust
- ❑ Qual. (pres/abs) Vacuum/Dust (QTY)
- ❑ Quan. (s/area) Vacuum D5755-95 (QTY)
- ❑ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
- ❑ Qual. (pres/abs) (QTY)
- ❑ ELAP 198.2/EPA 100.2 (QTY)
- ❑ EPA 100.1 (QTY)

❑ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
- ☒ Pb Paint Chip 1 (QTY)
- ☒ Pb Dust Wipe (wipe type GW) 21 (QTY)
- ☒ Pb Air 3 (QTY)
- ❑ Pb Soil/Solid (QTY)
- ❑ Pb TCLP (QTY)
- ❑ Drinking Water ❑ Pb (QTY) ❑ Cu (QTY) ❑ As (QTY)
- ❑ Waste Water ❑ Pb (QTY) ❑ Cu (QTY) ❑ As (QTY)
- ❑ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ❑ Spore-Trap (QTY)
- ❑ Surface Vacuum Dust (QTY)
- ❑ Surface Swab (QTY)
- ❑ Culturable ID Genus (Media) (QTY)
- ❑ Surface Tape (QTY)
- ❑ Culturable ID Species (Media) (QTY)
- ❑ Other (Specify) (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
13. CLASSROOM	120	12/20/12		100cm²				X									Date/Time: Contact: By:
14. REAR DET	Conference Room																
15. REAR DET	OFFICE 202C																
16. Command Section	213 Top CAB																
17. CMD SECTION	J. FUNK STATION																Date/Time: Contact: By:
18. CMD SECTION	Col. OFFICE																
19. 29th Supply	OFFICE BKSHELF																
20. 29th supply	shelf																
21. HHC STORAGE	Top of CAB.																Date/Time: Contact: By:
22. HHC office	Top of CAB.																
23. 629th OFFICE	DESK																
24. Lg. Room - HCC	Top of CAB.																

LABORATORY STAFF ONLY (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 514859

3 of 3

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: NGB TOWSON
2. Job Location: 1035 YORK RD TOWSON MD
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Perso Non-Responsive @
5. Submitted by: [redacted] nature: Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
❑ Immediate Date Due: ____ ❑ 24 Hours Time Due: ____ Comments: ____	❑ Immediate ❑ 3 Day ❑ Next Day ☒ 5 Day + ❑ 2 Day Date Due: ____ ❑ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include Non-Responsive with Report ☒ Email: [redacted] @mpliance place.com ❑ Fax: [redacted] @us.army.mil ❑ Verbals [redacted] @us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
- ❑ NIOSH 7400 ____ (QTY)
- ❑ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ❑ AHERA ____ (QTY)
- ❑ NIOSH 7402 ____ (QTY)
- ❑ Other (specify ____) ____ (QTY)

PLM Bulk
- ❑ EPA 600 – Visual Estimate ____ (QTY)
- ❑ EPA Point Count ____ (QTY)
- ❑ NY State Friable 198.1 ____ (QTY)
- ❑ Grav. Reduction ELAP 198.6 ____ (QTY)
- ❑ Other (specify ____) ____ (QTY)

MISC
- ❑ Vermiculite
- ❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ❑ ELAP 198.4/Chatfield ____ (QTY)
- ❑ NY State PLM/TEM ____ (QTY)
- ❑ Residual Ash ____ (QTY)

TEM Dust
- ❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ❑ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ❑ Qual. (pres/abs) ____ (QTY)
- ❑ ELAP 198.2/EPA 100.2 ____ (QTY)
- ❑ EPA 100.1 ____ (QTY)

❑ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☒ Pb Paint Chip 1 (QTY)
- ☒ Pb Dust Wipe (wipe type GW) 21 (QTY)
- ☒ Pb Air 3 (QTY)
- ❑ Pb Soil/Solid ____ (QTY)
- ❑ Pb TCLP ____ (QTY)
- ❑ Drinking Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
- ❑ Waste Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
- ❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis

Collection Apparatus for Spore Traps/Air Samples: ____

Collection Media ____

- ❑ Spore-Trap ____ (QTY)
- ❑ Surface Vacuum Dust ____ (QTY)
- ❑ Surface Swab ____ (QTY)
- ❑ Culturable ID Genus (Media ____) ____ (QTY)
- ❑ Surface Tape ____ (QTY)
- ❑ Culturable ID Species (Media ____) ____ (QTY)
- ❑ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
25	DRILL HALL SOUTH WALL	12/20/12						X			X						Date/Time: Contact: By:
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY (CUSTODY)

1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room May 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD) Released by National Guard Bureau

Appendix B. Photographs

ARNG Towson Armory Entrance

Drill Hall

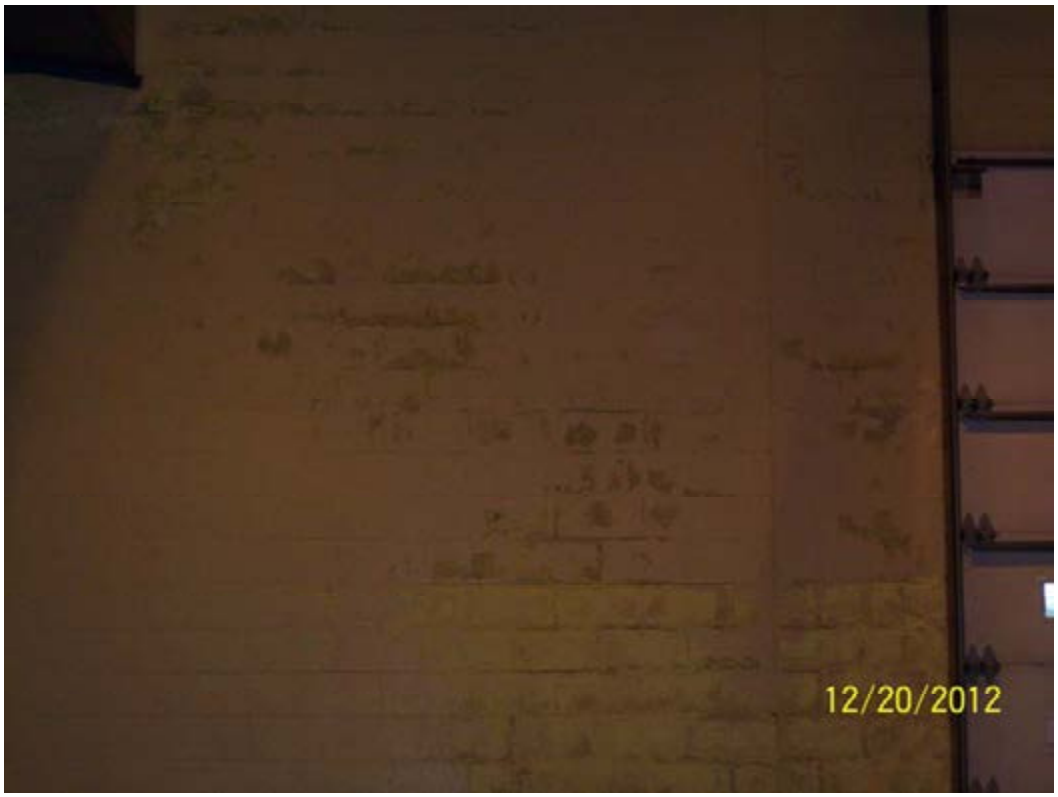

Drill Hall South Wall Water Damage

Command Section Water Damage

Converted Firing Range

Exercise Water Damage

HHC Water Damage

Legal Office Water Damage

Appendix C. Floor Plan

BEST AVAILABLE COPY

Fire Evacuation Plan

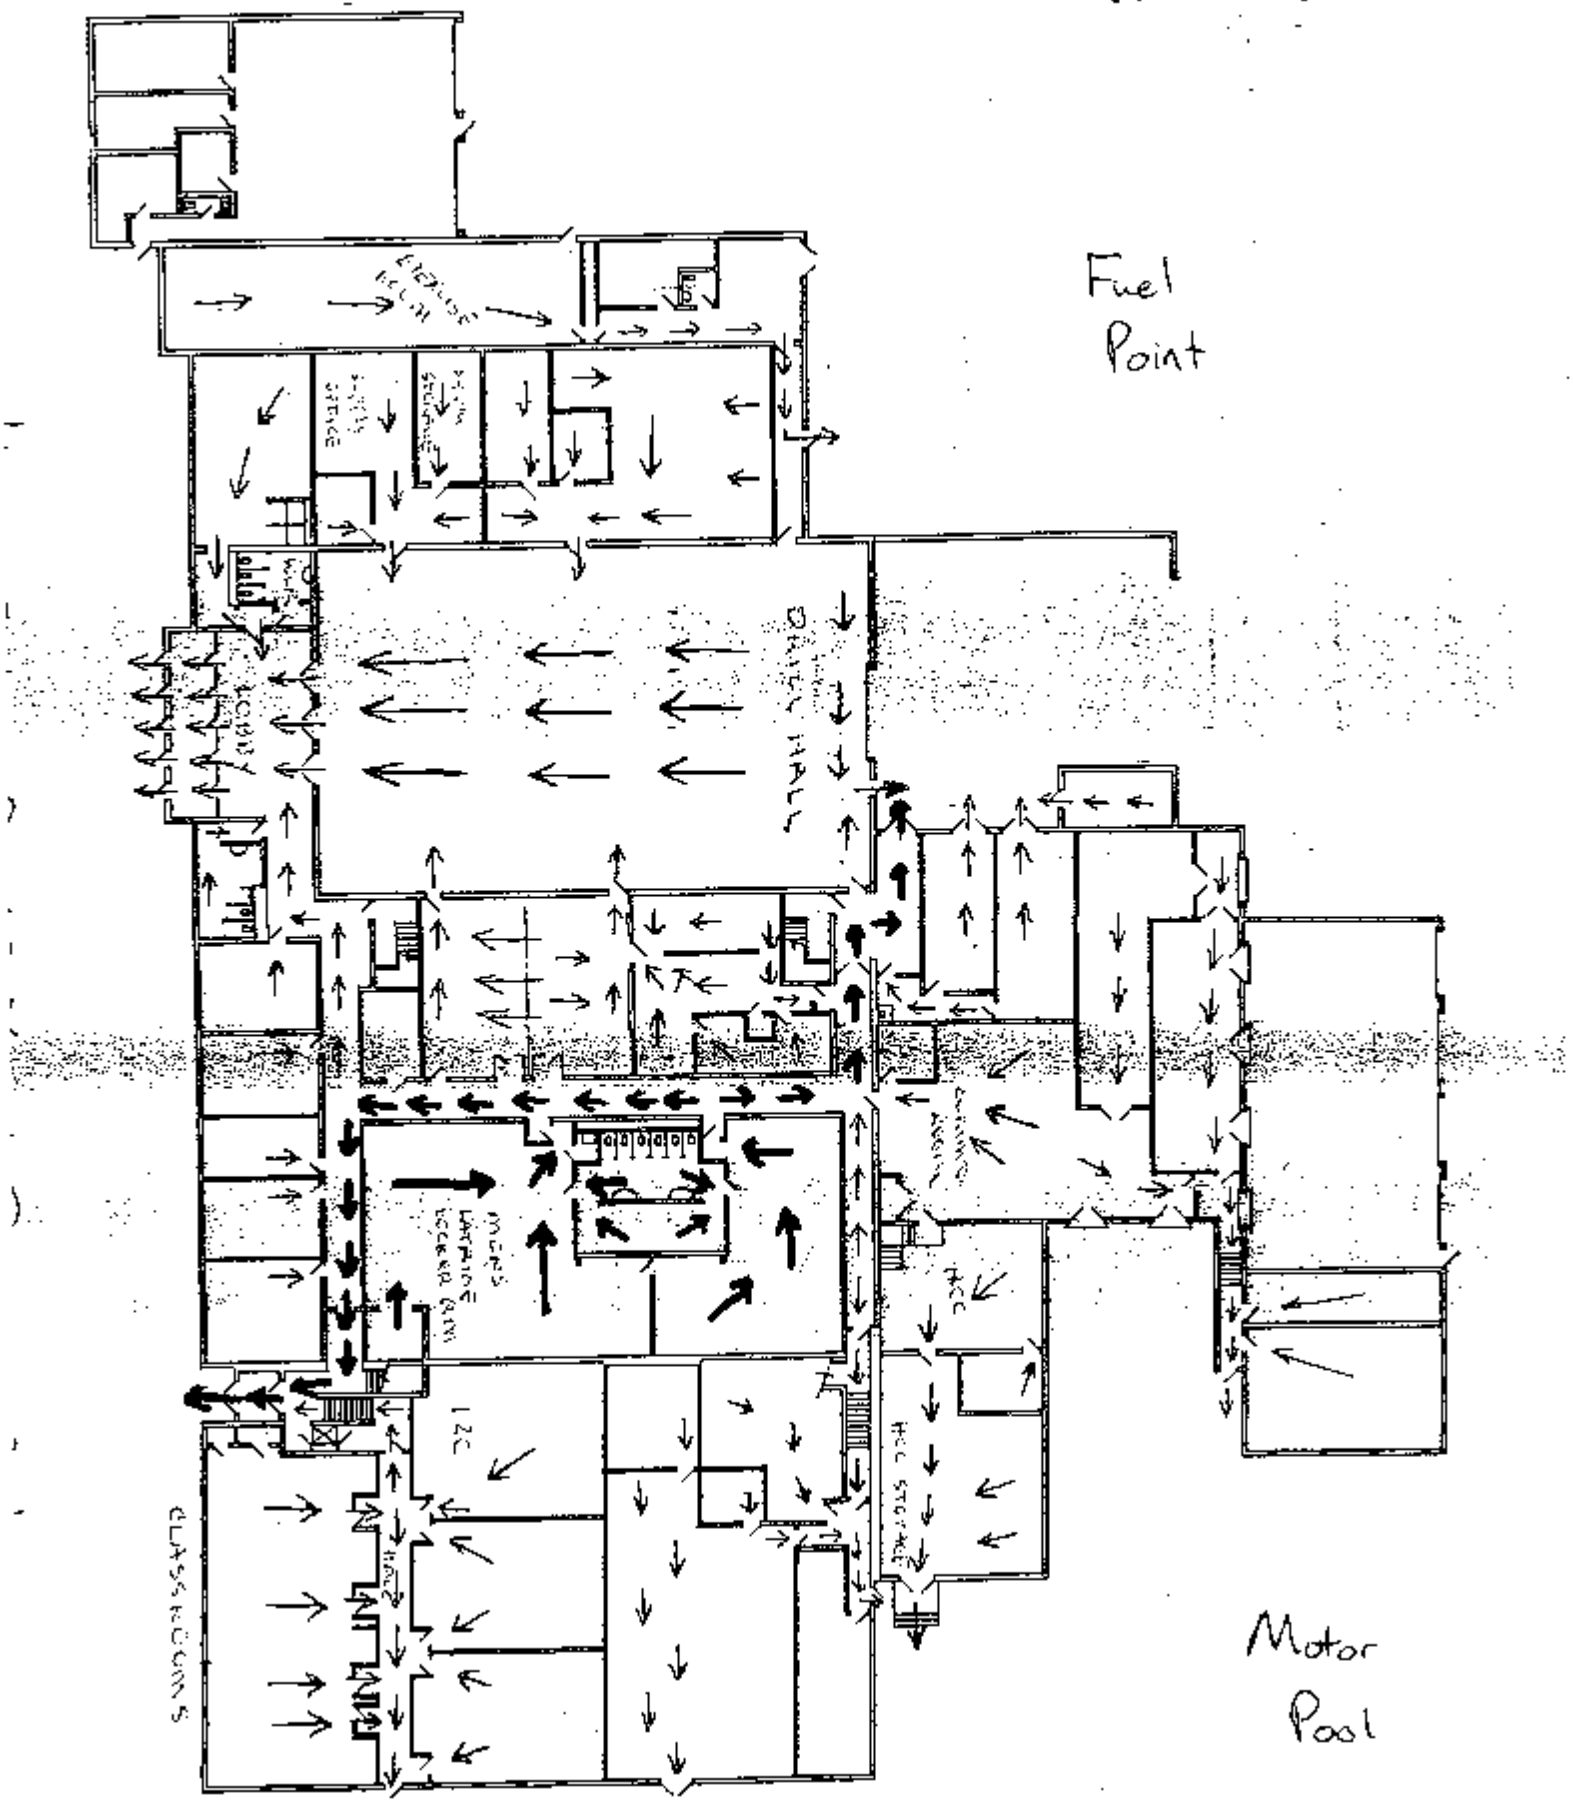

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1177 of 5269

TOWSON RUHL FIRST FLOOR

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/American National Standards Institute (ANSI)

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

11. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 NOV 06.

12. American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

May 2004

MEMORANDUM FOR Army National Guard Bureau (NGB) Region North Industrial Hygiene NGB-AVS-SI-IH/Non-Responsive, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03 LTC E Leslie Medford Armory, Annapolis, MD

1. Enclosed is a copy of subject report and one CD-ROM.

2. Please direct any additional comments or concerns to Ms. Non-Responsive, at DSN 584-5475/3118, commercial (410) 436-5475/3118 or e-mail address at Non-Responsive@apg.amedd.army.mil.

Non-Responsive

ENCL

Industrial Hygienist
Industrial Hygiene Field Services Program

Readiness thru Health

Printed on Recycled Paper

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
LTC E LESLIE MEDFORD ARMORY
ANNAPOLIS, MD
55-ML-01ED-03

Approved for public release; distribution unlimited.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1180 of 5269

BEST AVAILABLE COPY

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03 ***(reverse)***

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES INDUSTRIAL HYGIENE BASELINE SURVEYS, ANNAPOLIS ARMORY
ANNAPOLIS, MD
PROJECT NO. 55-ML-01ED-03

1. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

2. CONCLUSIONS.

a. Lead. All air sample results were below the laboratory analytical detection limit for lead in air of 0.005 to 0.006mg/m³ as well as the Occupational Health and Safety Administration (OSHA) standard of 50µg/m³ for lead in air. All three dust-lead wipe sample results were below the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on frequently contacted surfaces. However, two dust-lead wipe sample results in the locker room (the former indoor firing range) exceeded the EPA lead exposure level for children of 40µg/ft² on floors. There is a potential for personnel using the locker room to track dust-lead out of the area and redistribute it into adjacent rooms in the armory. This can result in lead exposures for children and for the general workforce. One of three deteriorated paint samples is lead-based paint. Deteriorated lead-based paint is hazardous to children. One additional sample was below the Environmental Protection Agency (EPA) definition of lead-based paint, but exceeded the laboratory analytical detection limits of 0.005 %. This sample is referred to as lead-contaminated paint, and is potentially hazardous to children. Army Regulation 420-70 states that the purpose of Army lead hazard management is to protect children from all sources of lead exposure. However, its provisions only control these exposures, and do not eliminate them. Recleaning the areas where dust-lead is present may further prevent exposures for children and for the general workforce.

b. Safety. The sidewalk outside the armory is buckling due to tree root growth. This presents a potential trip hazard for people using the sidewalk.

3. RECOMMENDATIONS. The Department of Defense Risk Assessment Codes (RAC) for Health Hazards enables one to prioritize remedial action for hazards. Risk Assessments Codes range in magnitude from 1 to 5, with 1 being the highest priority.

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

a. The RAC for Lead Exposure in the former indoor firing range is classified as 5. Clean all areas in and adjacent to the former IFR where sampling results showed the presence of dust-lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. If children will continue to use this facility, clean surfaces to the EPA dust-lead standard for young children of 40µg/ft² on floors and clean to 200µg/ft² for dust-lead on all other surfaces. Recleaning may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for children and for the general workforce. Repair and stabilize deteriorated paint. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

b. Safety. Address the problem of the concrete sidewalk buckling due to tree root growth. This presents a potential trip hazard for people using the sidewalk.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1183 of 5269

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys, LTC E. Leslie Medford Armory Annapolis, MD
Project No. 55-ML-01ED-03

TABLE OF CONTENTS

Paragraph Page

1. AUTHORITY 1
2. PURPOSE OF EVALUATION 1
3. BACKGROUND INFORMATION 1
4. SUMMARY OF ACTIONS 1
5. ASSESSMENT CRITERIA FOR LEAD 2
6. SAMPLING RESULTS 2
7. DISCUSSION AND CONCLUSIONS 3
8. RECOMMENDATIONS 4
9. ADDITIONAL ASSISTANCE 4

Enclosure

1. Lead Exposure 5
2. Safety 5

Appendices

A. - ASSESSMENT CRITERIA FOR LEAD A-1
B. - SITE MAPS B-1
C. - PHOTOGRAPHS C-1
D. - SAMPLING SHEETS AND LAB ANALYSES D-1
E. - REFERENCES E-1
F. - LEAD CLEANING GUIDANCE F-1
G. - MOLD GUIDANCE G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1184 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: LTC E. Leslie Medford Armory Annapolis, MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. Reconnaissance. First Squadron, 158th Cavalry Regiment.

b. Date of Construction. Built in 1958. The armory was renovated from 1999-2000.

c. POC. SGM Non-Responsive: (410) 974-7400.

d. Survey Date. 13 August 2003.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe, air, and bulk paint sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Sample results and locations are in Table 1 and in Appendix D.

b. Physical Condition of Facilities.

(1) Paint. Staff Sergeant Non-Responsive, Environmental Compliance Assessment Coordinator for the MD NGB, has records that state that lead has been abated in the armory. However, there is still deteriorated lead-based paint in the former indoor firing range.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1185 of 5269

(2) Asbestos. Staff Sergeant Non-Responsive [redacted] has records that state that all asbestos was abated in this armory.

(3) Mold. No mold was observed.

(4) Safety Hazards. The POC stated that there are no problems in the interior of the building. The concrete sidewalk outside the armory has buckled due to tree root growth. A contractor was hired to fix this problem. The contractor visited the site in the spring of 2003 but has not returned or contacted the armory (Photograph #s 1499 and 1500).

c. Other Building Concerns. None.

d. Safety and Industrial Hygiene Programs. There are no written program records at the armory.

e. Heating, Ventilation, and Air-conditioning System (HVAC). There is a central HVAC system throughout the armory.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting. No lighting measurements were collected.

h. Converted indoor firing range (IFR). The former IFR was converted to a locker room in the early 1990s.

i. Photographs (Appendix C).

j. Site Maps (Appendix B).

k. Facility use by children. The POC stated that the building is often rented for public use and children often use this facility.

5. ASSESSMENT CRITERIA FOR LEAD. (Appendix A).

6. SAMPLING RESULTS. All three dust-lead wipe sample results were below the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on frequently contacted surfaces. However, two dust-lead wipe sample results exceeded the EPA lead exposure level for children of 40µg/ft²on floors. One of three deteriorated paint sample results was 0.5 % lead and is lead-based paint. Deteriorated lead-based paint is hazardous to children.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1186 of 5269

One additional sample was below the definition of lead-based paint, but exceeded the laboratory analytical detection limits of 0.005 %. This sample is referred to as lead-contaminated paint, and is potentially hazardous to children.

All air samples were below the laboratory analytical detection limit for lead in air of 0.005 to 0.006mg/m³ as well as the Occupational Health and Safety Administration (OSHA) standard of 50µg/m³ for lead in air.

See Table 1 for dust-lead wipe and bulk paint sample locations, photograph numbers, and analytical results. All sample results that are equal to or exceed 40µg/ft² of dust lead and 0.5% for bulk samples are highlighted.

Table 1 Sample Locations, Photograph numbers, and Analytical Results

Sample Numbers	Type of Sample	Location	Photo	Result µg/ft²
AP W01	Wipe	Baffle of former IFR (now locker room)	1496	45
AP W02	Wipe	Floor lanes of former IFR	1497	155
AP W03	Wipe	Top of locker in same area	1498	<23
				Result %
AP BULK01	Bulk	Boiler room floor		0.081
AP BULK02	Bulk	Weight room on wall in basement		<0.005
AP BULK03	Bulk	Floor of former IFR		0.5

7. DISCUSSION AND CONCLUSIONS.

a. The building is in good condition. The armory generally observes good housekeeping practices.

b. All air samples were below the laboratory analytical detection limit for lead in air of 0.005 to 0.006mg/m³ as well as the Occupational Health and Safety Administration (OSHA) standard of 50µg/m³ for lead in air.

c. All three dust-lead wipe sample results were below the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on frequently contacted surfaces. However, two dust-lead wipe sample results exceeded the EPA lead exposure level for children of 40µg/ft²on floors. Personnel using the locker room may be tracking lead out of the area and redistributing lead into adjacent rooms in the armory. This can result in lead exposures for children and for the general workforce.

BEST AVAILABLE COPY

d. One of three deteriorated paint sample results was 0.5 % lead and is lead-based paint. Deteriorated lead-based paint is hazardous to children. One additional sample was below the definition of lead-based paint, but exceeded the laboratory analytical detection limits of 0.005 %. This sample is referred to as lead-contaminated paint, and is potentially hazardous to children.

e. Army Regulation 420-70 states that the purpose of Army lead hazard management is to protect children from all sources of lead exposure. However, its provisions only control these exposures, and do not eliminate them. Recleaning the areas that showed dust-lead may further prevent exposures for children and for the general workforce.

f. The sidewalk buckling due to tree root growth presents a potential trip hazard to personnel using the sidewalk.

8. RECOMMENDATIONS. Enclosure.

9. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by e-mail Non-Responsive@apg.amedd.army.mil.

Non-Responsive

INDUSTRIAL HYGIENIST
USACHPPM LEAD AND ASBESTOS TEAM LEADER
Industrial Hygiene Field Services Program
EPA AHERA Asbestos Inspector and Management Planner/
Certification Number MD-070340
EPA Lead Inspector and Lead Risk Assessor/
Certification Number 04-7913

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1188 of 5269

BEST AVAILABLE COPY

ENCLOSURE

ANNAPOLIS ARMORY RECOMMENDATIONS

The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority. The RAC for Lead Exposure in the former indoor firing range is classified as 5.

1. Lead Exposure.

a. Clean all areas in and adjacent to the former IFR where sampling results showed the presence of dust-lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for children and for the general workforce. Address all potential lead hazards before extending this facility to use for children. If children will continue to use this facility, clean surfaces to the EPA dust-lead standard for young children of 40µg/ft² on floors and clean to the USACHPPM decontamination level of 200µg/ft² for dust-lead on all other surfaces.

b. Repair and stabilize deteriorated paint.

c. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62.

d. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

2. Safety. Address the problem of the concrete sidewalk buckling due to tree root growth. This presents a potential trip hazard for people using the sidewalk.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1189 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

Subject: Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 $\mu g/ft^2$. This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e)(8)(viii))are not directly applicable because they are developed for floors (40 $\mu g/ft^2$), windowsills (250 $\mu g/ft^2$) and window troughs (400 $\mu g/ft^2$) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

BEST AVAILABLE COPY

APPENDIX B

SITE MAPS

BEST AVAILABLE COPY

BEST AVAILABLE COPY

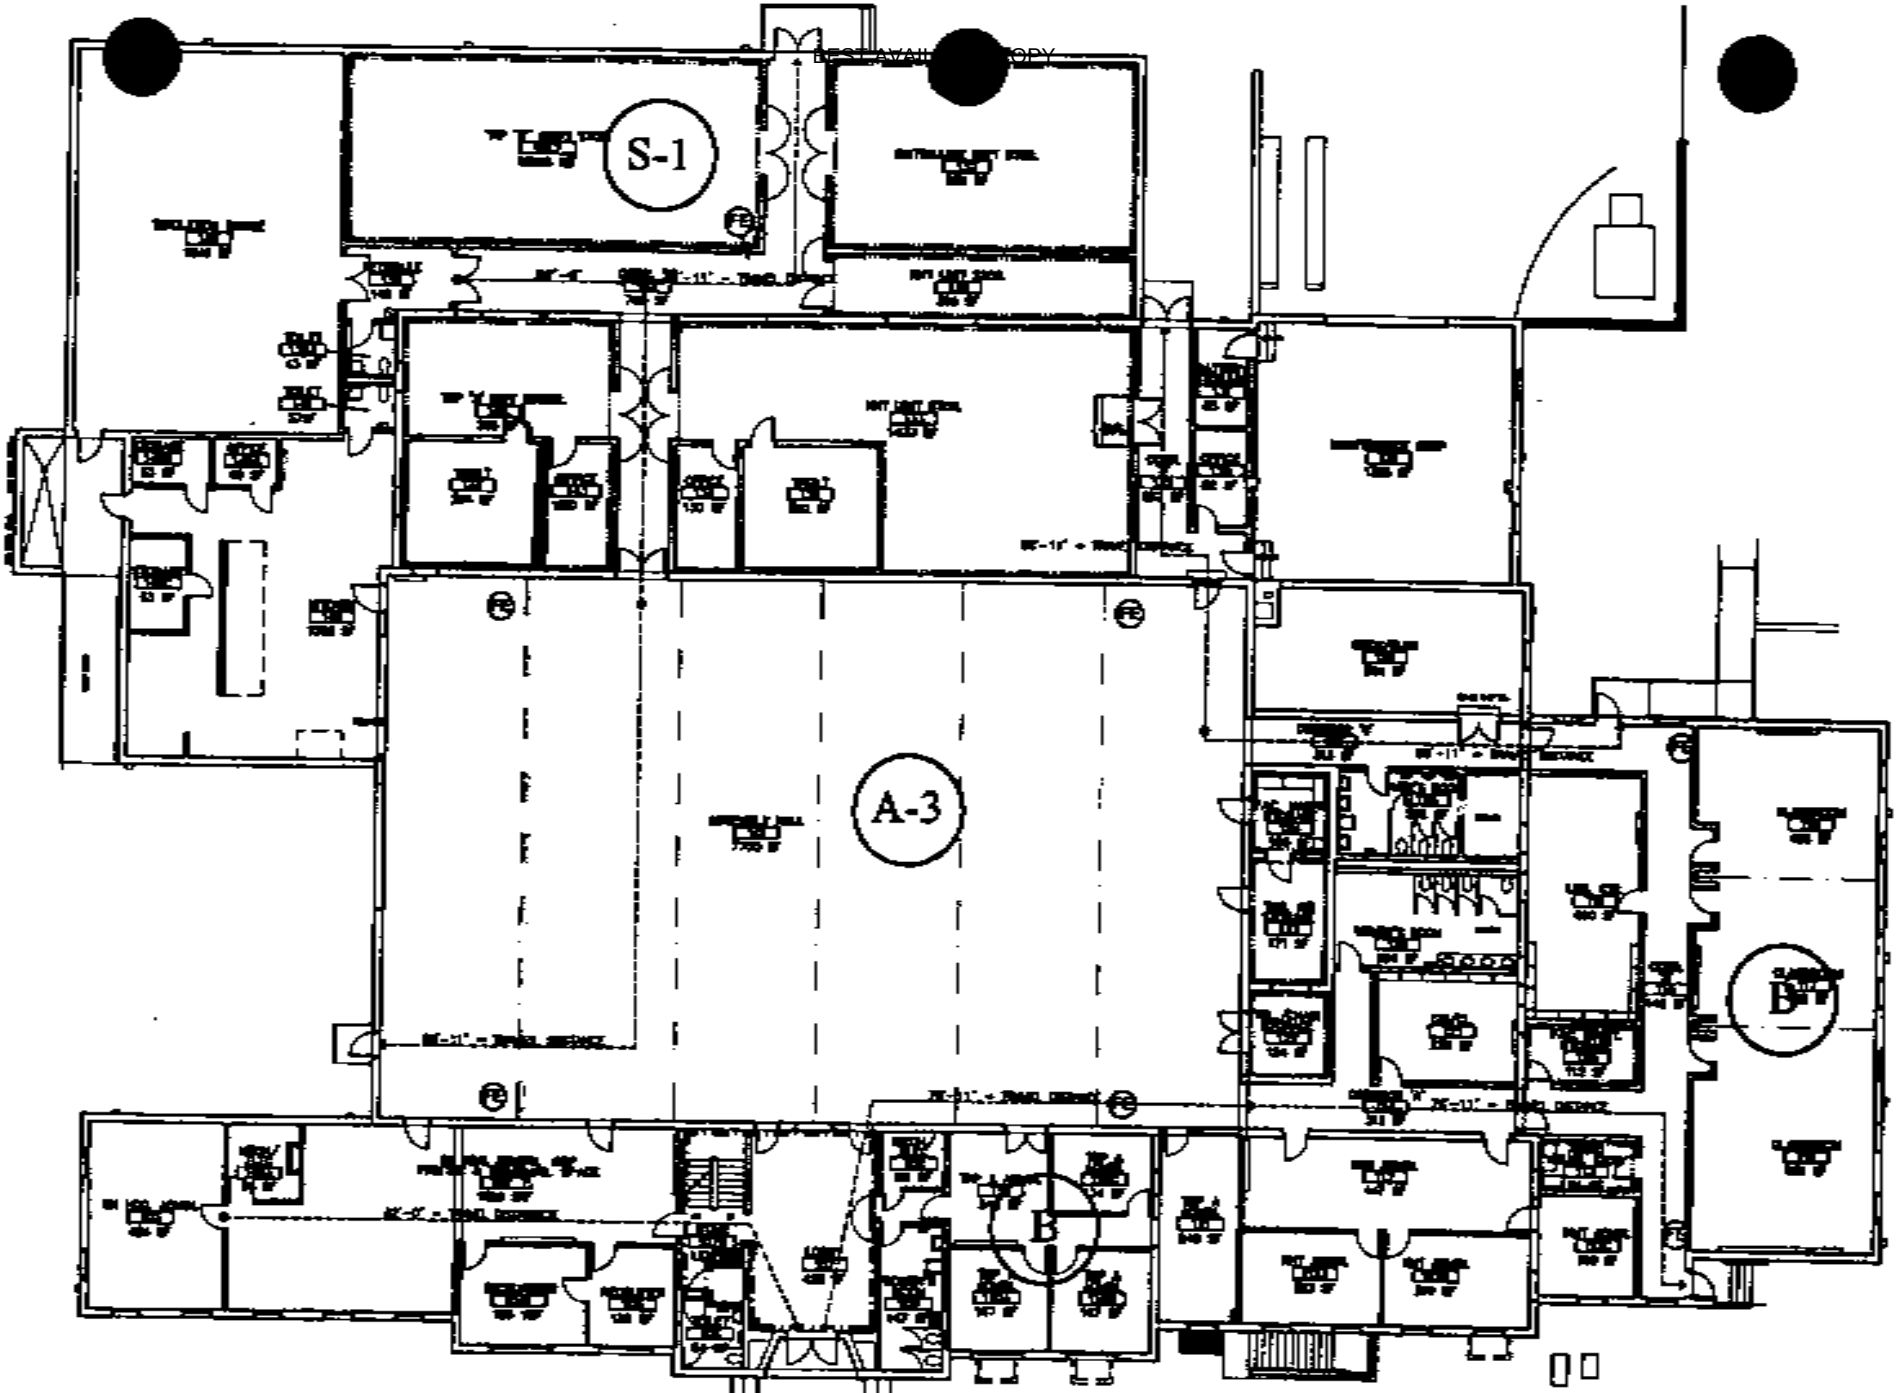

PRIMARY EVACUATION ROUTE

ALTERNATE EVACUATION ROUTE

48
A0.2

FIRST FLOOR LIFE SAFETY PLAN

SCALE: 1/16" = 1'-0"

0 8 16 32

ANNAPOLIS NG ARMORY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

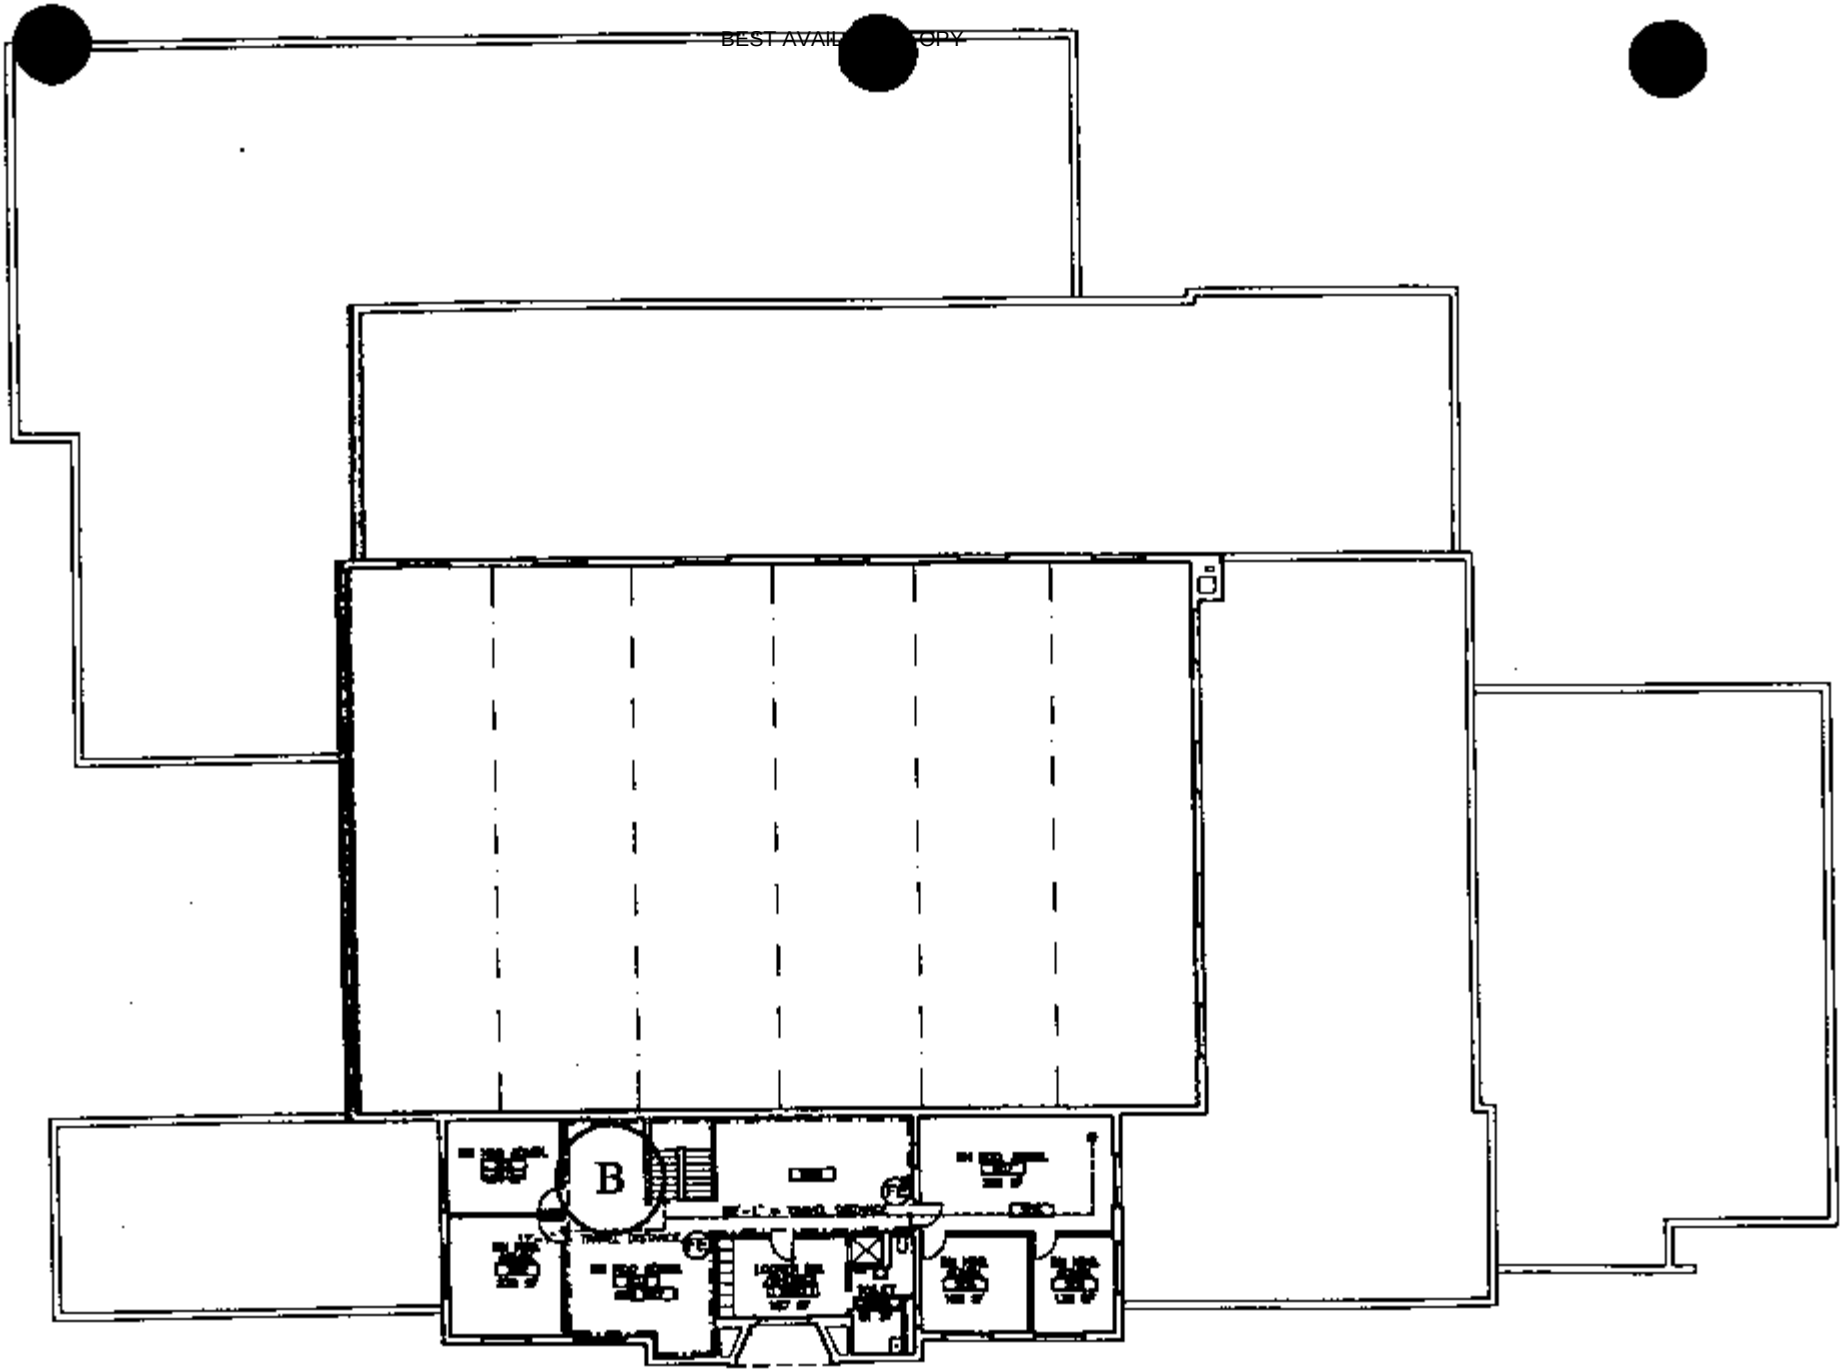

PRIMARY EVACUATION ROUTE

ANNAPOLIS

ALTERNATE EVACUATION ROUTE

4J
AD2

SECOND FLOOR LIFE SAFETY PLAN

SCALE: 1/16" = 1'-0"

0 8 16 32

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J015-0085 (MD)
Released by National Guard Bureau
Page 1194 of 5269

BEST AVAILABLE COPY

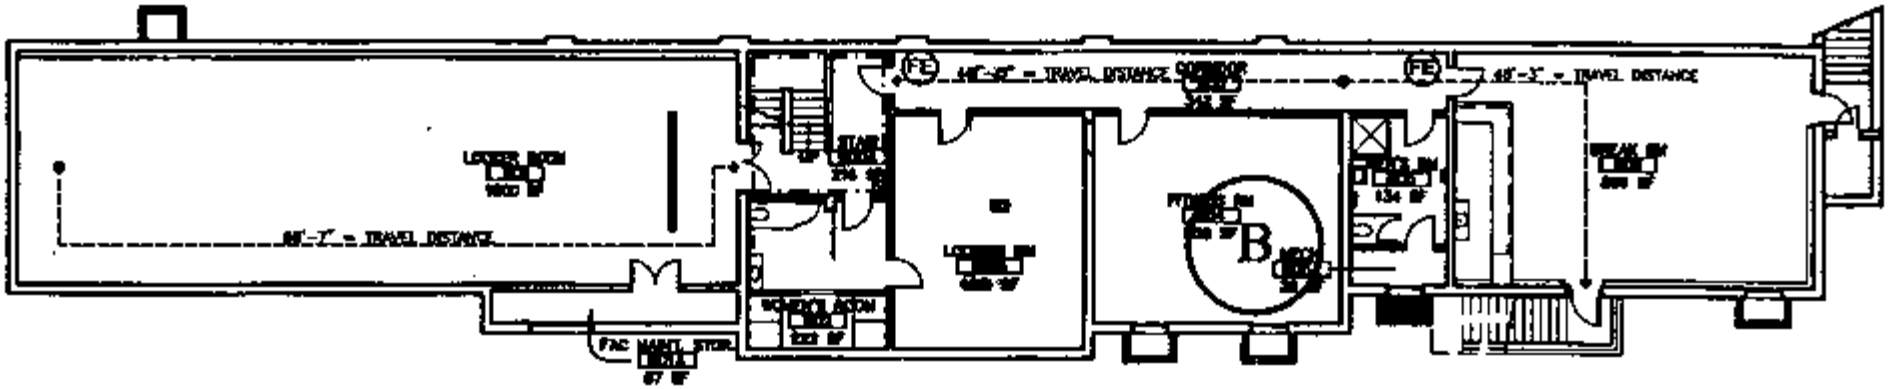

ANNAPOLIS

7B
A0.2

BASEMENT LIFE SAFETY PLAN

SCALE: 1/16" = 1'-0"

0 8 16 32

PRIMARY EVACUATION ROUTE

ALTERNATE EVACUATION ROUTE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

BEST AVAILABLE COPY

ANNAPOLIS ARMORY

Photo Number	Photo Location
1496	Baffle of former IFR (now locker room)
1497	Floor lanes of former IFR
1498	Top of locker in same area
1499/1500	Concrete Sidewalk buckled due to tree roots

BEST AVAILABLE COPY

1496

1497

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

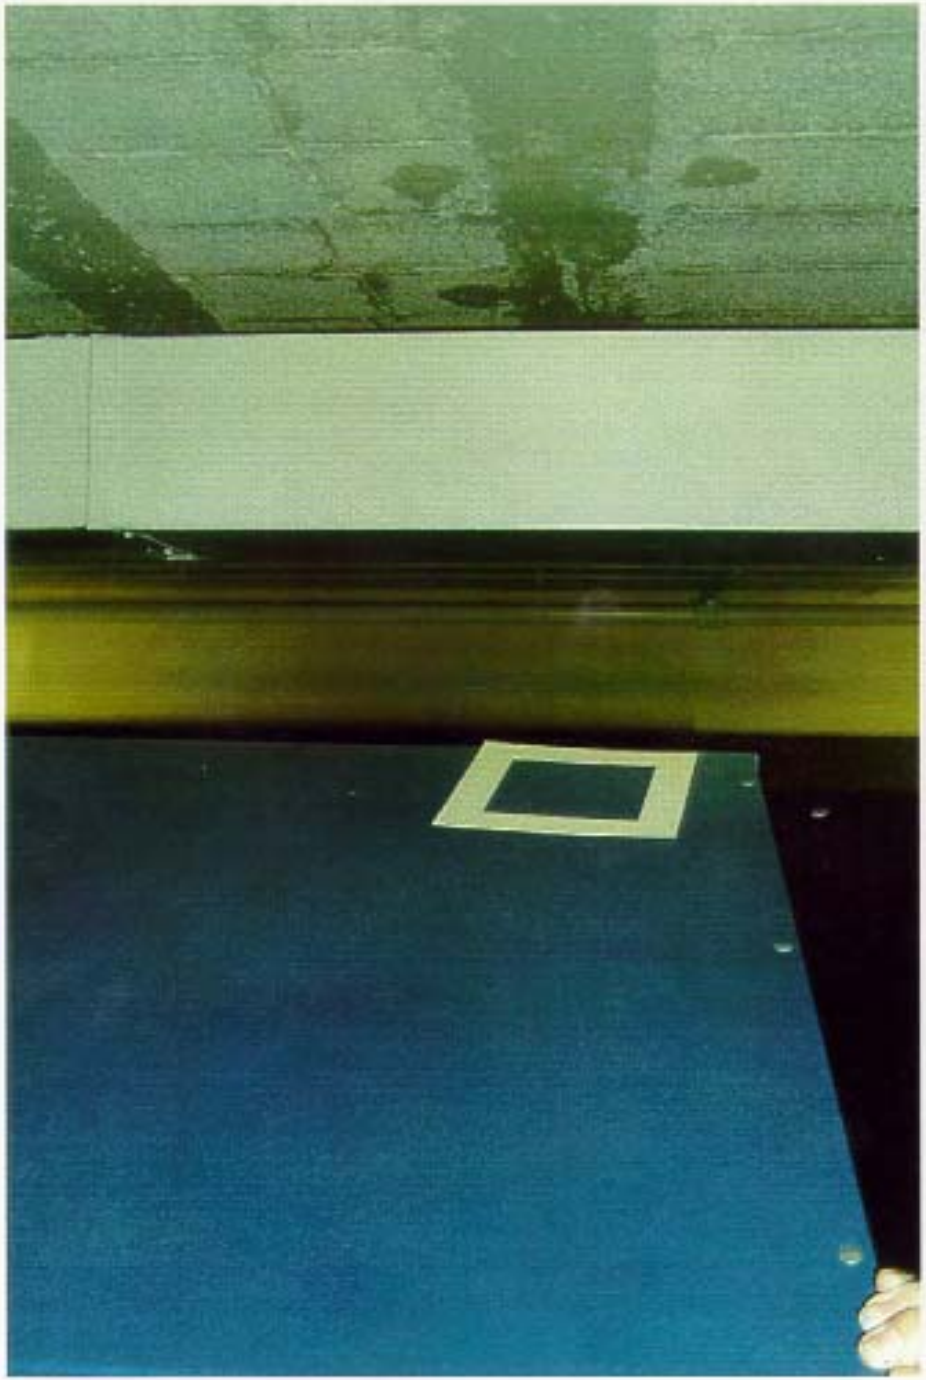

1498

1499

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

1500

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX D

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Wipe Sample #	Armory	City	Indoor Range Info				Location of Samples	Conc. (µg/ft²)
			Active	Inactive	N/A	Cleaned?		
				Yes		Yes		
AP W01	Annapolis	Annapolis					Baffle of former IFR (now locker room)	45
AP W02	Annapolis	Annapolis					Floor lanes of former IFR	155
AP W03	Annapolis	Annapolis					Top of locker in same area	<23

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
Commander, USACHPPM
5158 Blackhawk Road, Attn: MCHB-TS-OFS
APG, MD 21010-5403

Reference Data:	**Lead**
Client Sample No.:	APAS01 through APBlank02
P.O. No.:	Not Available
Sample Location:	Annapolis NG Armory
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-4148
DCL Sample ID No.:	03-25422 through 03-25426
Sample Receipt Date:	8/27/2003
Preparation Date:	08/27/03
Analysis Date:	08/27/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive

Analyst

Non-Responsive

Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1203 of 5269

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m^3
APAS01	03-25422	183.8	ND	<0.005
APAS02	03-25423	173.7	ND	<0.006
APAS03	03-25424	172.9	ND	<0.006
APBlank01	03-25425	0	ND	-
APBlank02	03-25426	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		101.	
RPL			**1.**	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1204 of 5269

BEST AVAILABLE COPY

[redacted] Ms USACHPPM

From: [redacted] [results@resienv.com]
Sent: Tuesday, August 26, 2003 3:26 PM
To: [redacted] apg.amedd.army.mil; [redacted]
Subject: RES 96610-1; Cascade MD and Anapolis MD

Outgoing mail is certified Virus Free.
Checked by AVG anti-virus system (http://www.grisoft.com).
Version: 6.0.512 / Virus Database: 309 - Release Date: 8/19/2003

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1205 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN PAINT

RES Job Number:	**RES 96610-1**
Client:	**Army National Guard IH - West**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**Cascade MD and Anapolis MD**
Date Samples Received:	**August 19, 2003**
Analysis Type:	**USEPA SW846 3050B / AA (7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 22, 2003**

Client ID Number	Lab ID Number	Detection Limit (%)	LEAD CONCENTRATION (%)
APBULK01	EM 806477	0.005	0.081
APBULK02	EM 806478	0.005	BDL
APBULK03	EM 806479	0.005	0.488

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1206 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	RES 96610-1
Client:	Army National Guard III - West
Client Project Number / P.O.:	None Given
Client Project Description:	Cascade MD and Anapolis MD
Date Samples Received:	August 19, 2003
Analysis Type:	USEPA SW846 3050B / AA(7420)
Turnaround:	3-5 Day
Date Samples Analyzed:	August 22, 2003

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
CDBLANK1	EM 806468	0.11	BDL	23	BDL
CDW01	EM 806469	0.11	320.0	23	2909
CDW02	EM 806470	0.11	BDL	23	BDL
CDW03	EM 806471	0.11	BDL	23	BDL
CDW04	EM 806472	0.11	BDL	23	BDL
APBLANK1	EM 806473	0.11	BDL	23	BDL
APW01	EM 806474	0.11	5.0	23	45
APW02	EM 806475	0.11	17.0	23	155
APW03	EM 806476	0.11	BDL	23	BDL

*Calculations Based On A 1 sq.ft. Sample Area Unless Otherwise Noted

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1207 of 5269

BEST AVAILABLE COPY

MDARNG Home

LTC (MD) E. Leslie Medford Armory

18 Willow Street
Annapolis, MD 21401-3113
(Directions)

"The Governor's Guard"
1st Squadron, 158th Cavalry Regiment (RECON)

Call 410-974-7617 for info

Local Recruiter: SFC Non-Responsive

Tenant Units:

- 1st Squadron, 158th Cavalry Regiment (RECON) *"The Governor's Guard"*
  - Headquarters
  - Headquarters and Headquarters Troop
  - Troop A
- Organizational Maintenance Shop #11A

UNDER CONSTRUCTION

Last Update: 17 FEB 99 17:01:40 EST

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1208 of 5269

1st Squadron, 158th Cavalry Regiment
The Governor's Guard

MDARNG Home

The **158th Cavalry Regiment** is a component of the **29th Aviation Brigade, 29th Infantry Division (Light).**

Established: A.D. 1877 at Annapolis, Maryland

Lineage:

- The Governor's Guard
- Company G, 1st Maryland Infantry Regiment (circa A.D. 1886)
- Company M, 1st Maryland Infantry Regiment [Spanish-American War]
- Company M, 115th Infantry Regiment, 29th Infantry Division (circa A.D. 1917) [France]
- Company M, 115th Infantry Regiment, 29th Infantry Division (circa A.D. 1941)
- 29th Quartermaster Company (circa A.D. 1947)
- Comapny A, 229th Supply & Transp[ortation Battalion (circa A.D. 1963)
- Troop B, 1st Squadron, 223rd Cavalry Regiment, 28th Infantry Division *"Keystone Division"*(circa A.D. 1968)
- Troop B, 158th Cavalry Squadron, 58th Infantry Brigade (circa A.D. 1975)
- 1st Squadron, 158th Cavalry Regiment, 29th Infantry Division (Light) (circa A.D. 1985)

Campaigns:

Regimental Honors/Awards:

Mission: Support operations of the 29th Infantry Division (Light) through:

- Reconnaissance and Surveillance
- Security
- Screening Operations
- Intelligence and Electronic-warfare
- Facilitation of Command-and-Control

BEST AVAILABLE COPY

APPENDIX E

REFERENCES

BEST AVAILABLE COPY

APPENDIX E

REGULATIONS AND STANDARDS

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current ed. http://www.osha.gov/comp-links.html.

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf.

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990. http://www.usapa.army.mil/pdffiles/r40_5.pdf.

4. AR 385-10, The Army Safety Program, 29 February 2000. http://www.usapa.army.mil/pdffiles/r385_10.pdf.

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p40_503.pdf.

6. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), American Conference of Governmental Industrial Hygienists (ACGIH), current ed.

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. RP-1-1993, Office Lighting, ANSI/ESNA.

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1213 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1214 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1215 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1216 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1217 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1218 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1219 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1220 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

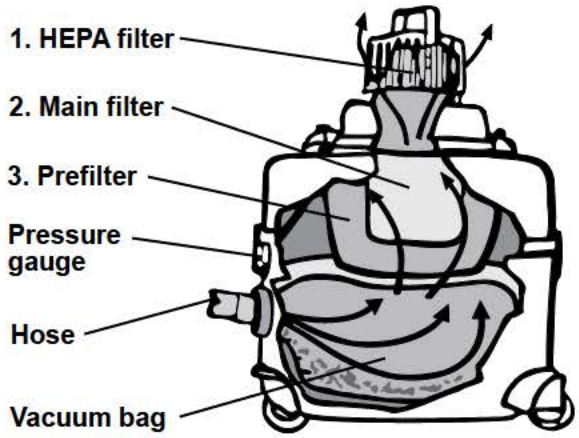

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

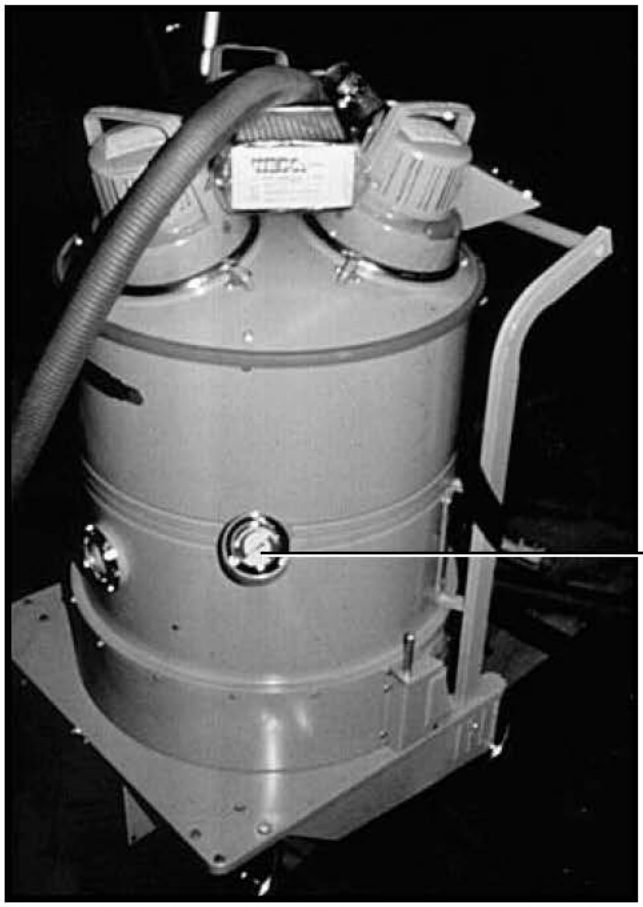

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1221 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

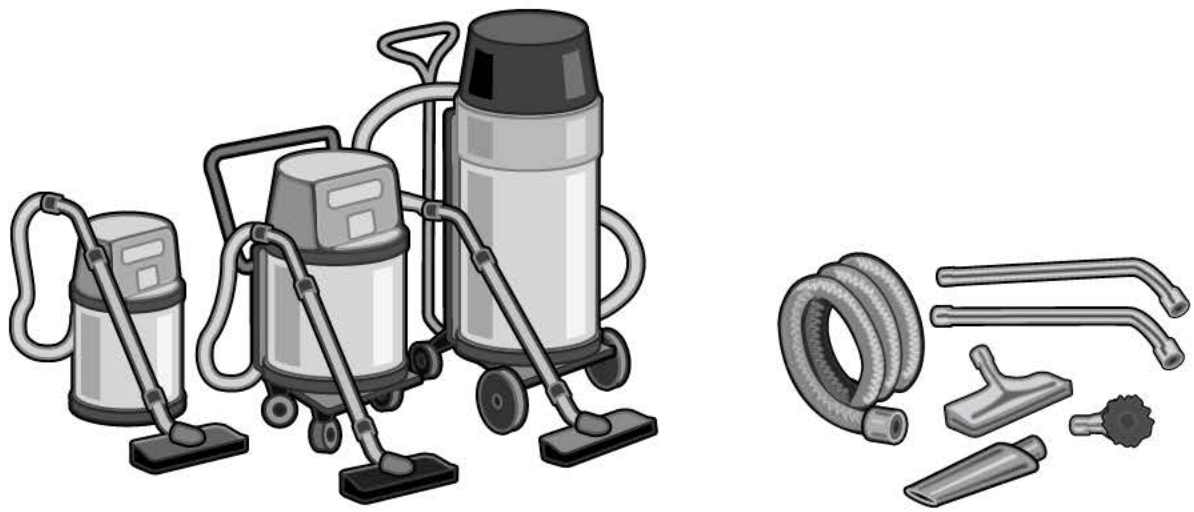

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1222 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

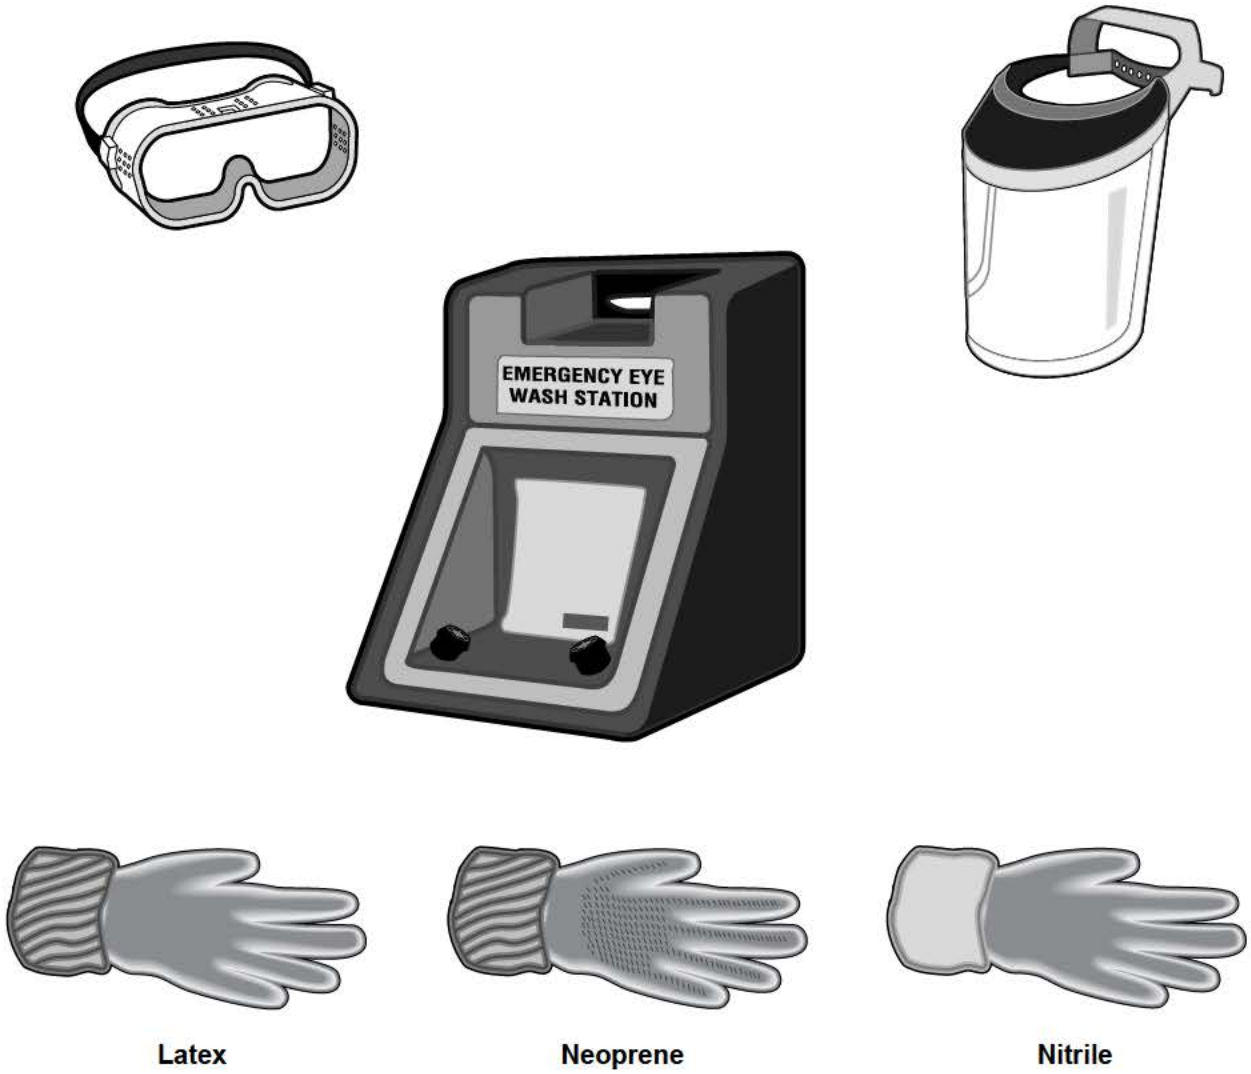

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1223 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

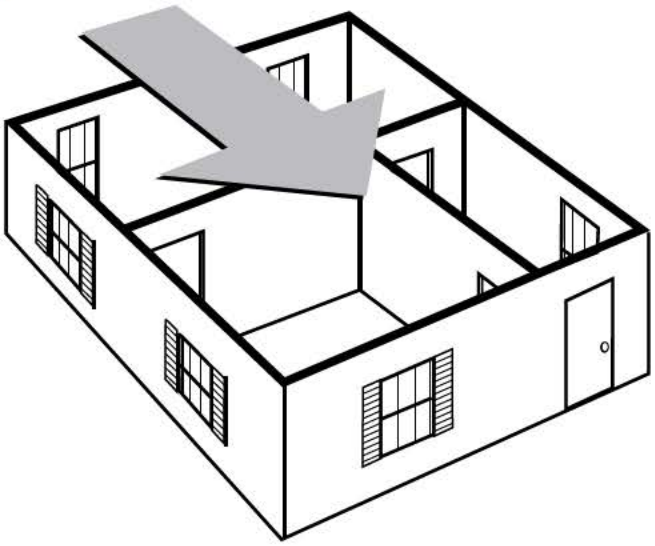

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

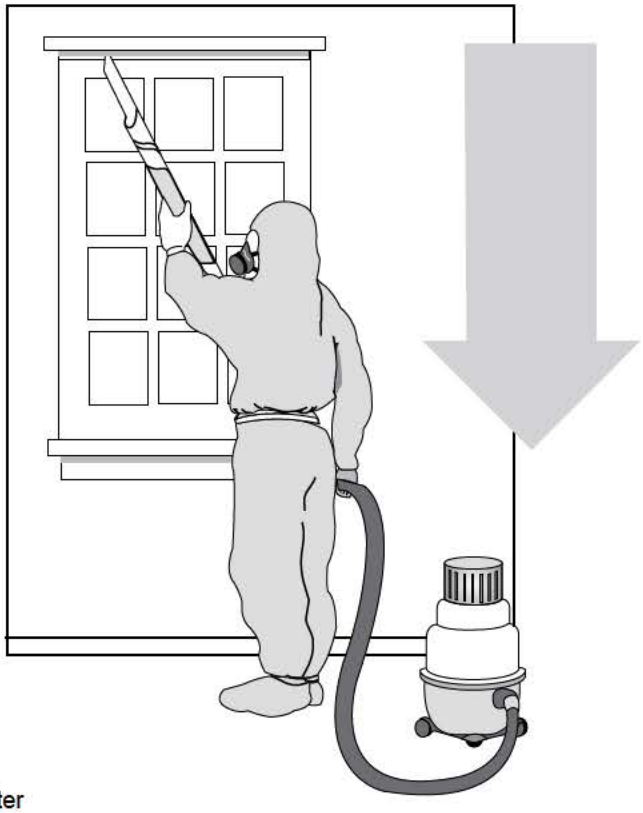

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1224 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1225 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

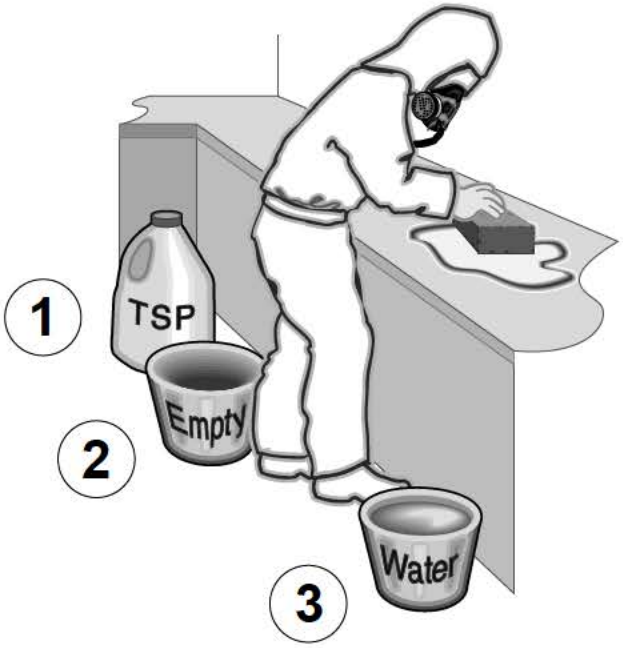

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1226 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

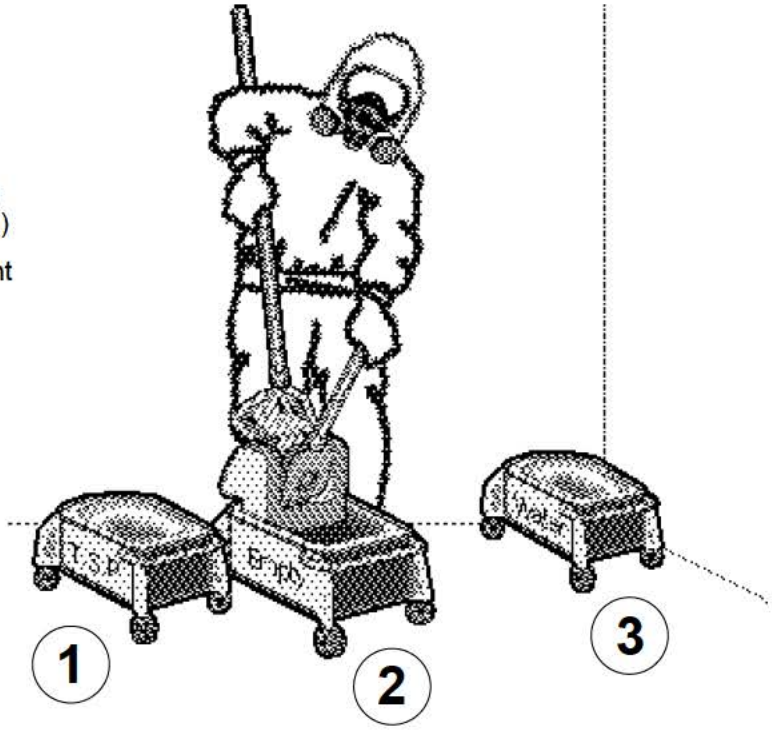

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

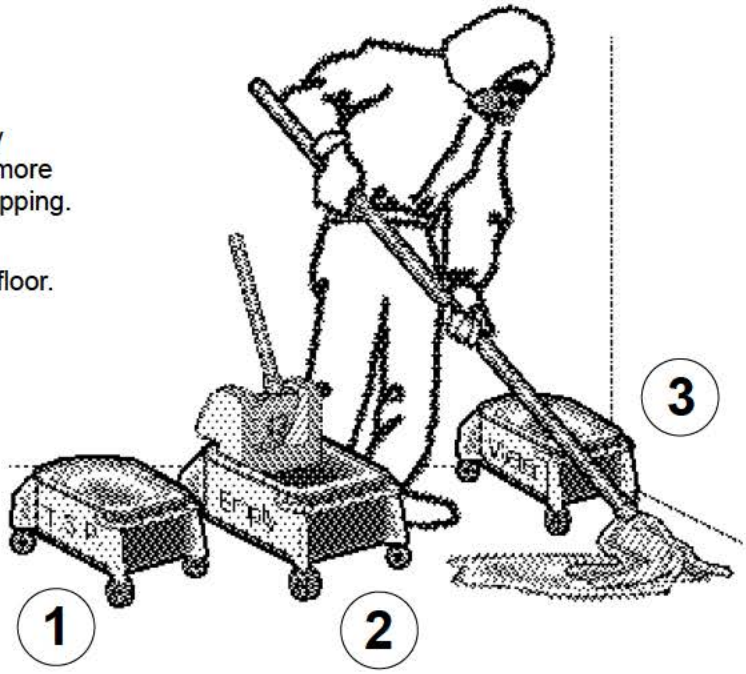

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1227 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

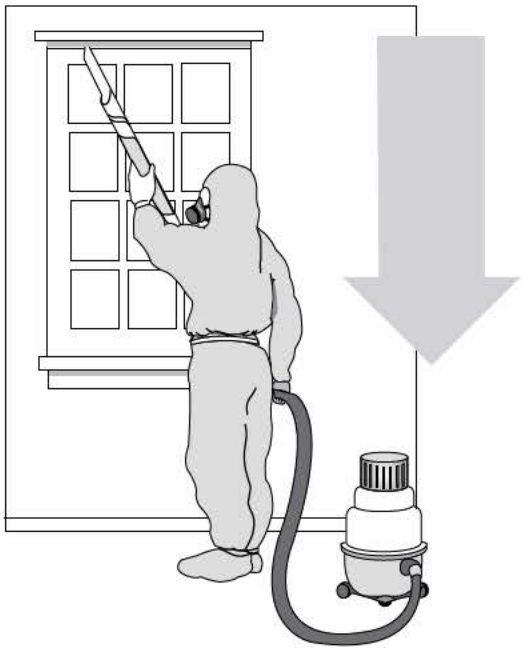

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1228 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1229 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1230 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1231 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1232 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1233 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1234 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1235 of 5269

BEST AVAILABLE COPY

APPENDIX G

MOLD GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1237 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1239 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1240 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet -** e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1241 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1242 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1243 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1244 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1245 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1246 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1247 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1248 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1249 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1250 of 5269

BEST AVAILABLE COPY

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1251 of 5269

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1252 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1253 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1254 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1255 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1256 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1257 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1258 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1259 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1260 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1262 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1263 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1264 of 5269

MOLD INVESTIGATION DECISION LOGIC

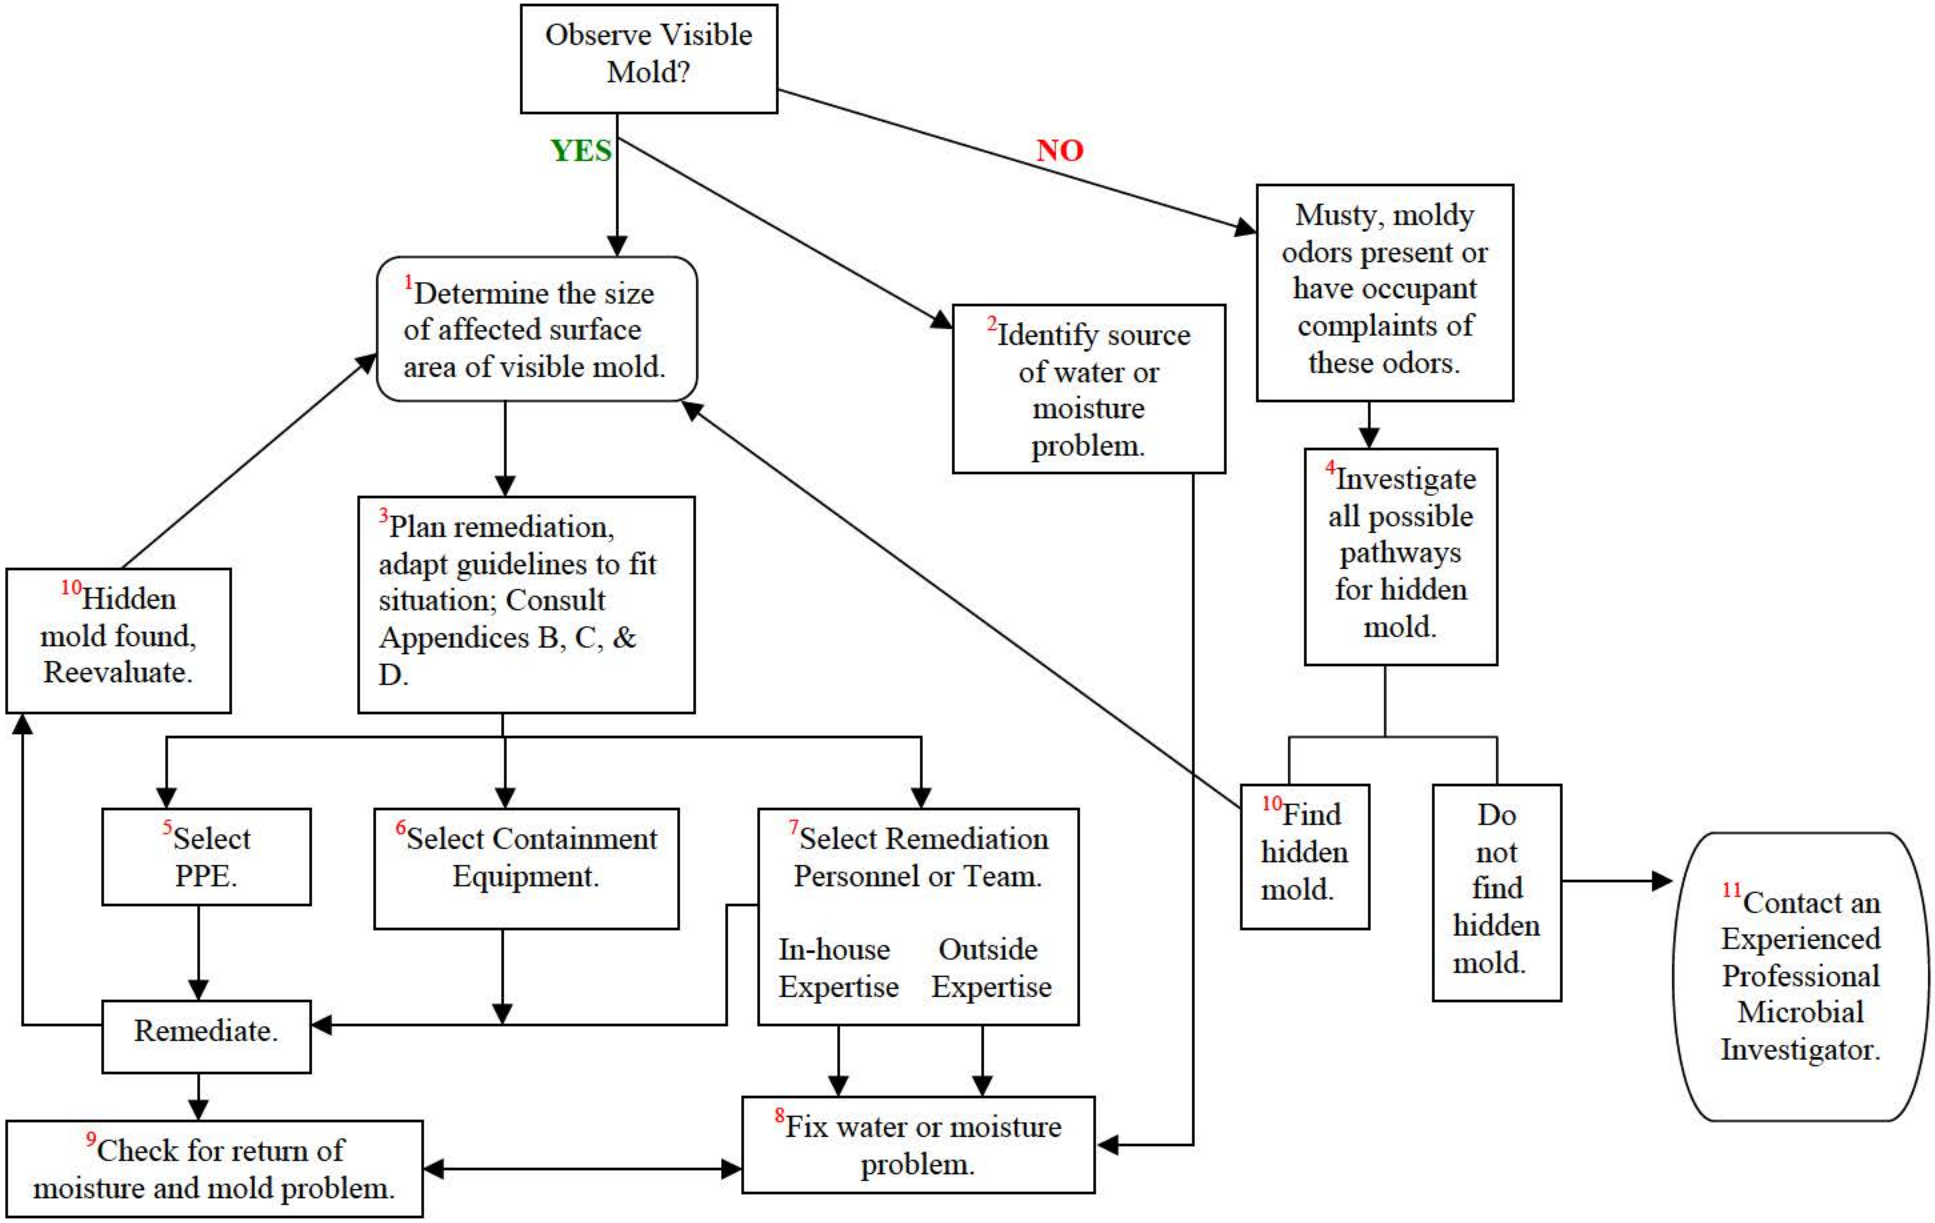

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1266 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1267 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1268 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1269 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1270 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1271 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips

- Always maintain the containment area under negative pressure.
- Exhaust fans to outdoors and ensure that adequate makeup air is provided.
- If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1272 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1273 of 5269

BEST AVAILABLE COPY

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Survey

National Guard Facility
Annapolis Armory
18 Willow Street
Annapolis, MD 21401

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Annapolis Armory** **18 Willow Street** **Annapolis, MD 21401**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**September 30, 2010**
Report Date:	**October 25, 2010**
ALSI Project #:	**1010634**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1275 of 5269

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Suspect Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Limitations 13

Appendix A. Laboratory Analysis Report 14

Appendix B. Photographs 15

Appendix C. Floor Plan 16

Appendix D. References 17

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1276 of 5269

BEST AVAILABLE COPY

Section 1.0
Executive Summary

BEST AVAILABLE COPY

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on September 30, 2010, at the Annapolis Armory located at 18 Willow Street, Annapolis, MD 21401. The survey was performed by Ms. Non-Responsive and Mr. Non-Responsive

1. Lead surface and air samples were collected. All sample results were less than recommended guidelines or regulatory standards.

2. Lighting levels met the minimum recommended guidelines in all but the following areas: 1) Drill Hall 2) Room 148 3) Attached Garage. Lighting should be improved in these areas.

3. Indoor air quality parameters of temperature, relative humidity carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment. Relative humidity exceeded the recommended ceiling of 60% in most locations. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation.

4. Water damaged ceilings and active roof leaks are present. All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

5. Possible fungal growth was observed on the supply and return vents. These should be regularly cleaned. Do not permit dirt, debris, microbial growth, etc. to accumulate in any portion of the HVAC system. Supply and return vents should be cleaned.

6. The overhead vehicle exhaust ventilation system in the garage does not meet the minimum requirements. This system should be inspected to determine if it is operating as designed and meets the minimum requirements as recommended by the American Conference of Governmental Industrial Hygienists (ACGIH) Industrial Ventilation: A Manual of Recommended Practice for Design (27th Edition).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1278 of 5269

BEST AVAILABLE COPY

Section 2.0
Operation Description & Observations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Annapolis Armory is mainly an administrative facility with offices, training and storage areas. There were approximately fourteen full-time employees stationed at this facility at the time of this survey.

The building was initially constructed in 1958. It was renovated in 2000. The exterior is brick. Interior walls are concrete block or drywall. There are concrete floors and some carpeted areas.

There is a central heating, ventilating, and air conditioning (HVAC) system. There are two air-handling units (AHU) present on the roof. These were not accessible for inspection. There is a gas-fired boiler present. Air-conditioning was on during this survey. In addition, many windows and doors were open. Outdoor conditions on the day of survey were cloudy and rain.

There is an old firing range in the building. It was closed in the 1970's and has been fully abated. It is now a gym/exercise area. There is no child-care facility in the building.

Overall housekeeping was good. Areas were clean and well kept.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1280 of 5269

BEST AVAILABLE COPY

Section 3.0
Noise Survey

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels. Therefore, noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1282 of 5269

BEST AVAILABLE COPY

Section 4.0
Lead Testing

BEST AVAILABLE COPY

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. The facility contains a gym area which was once an indoor firing range.

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2	Paint Chip %Pb
1	Drill Hall	<3.4		
2	CPT Perez's Office	<3.6		
3	Drill Hall – Floor (Center)		<110	
4	Drill Hall – Food Serving Counter		<110	
5	Drill Hall – Metal Tabletop		<110	
6	Kitchen – Metal Countertop		<110	
7	Room 148 – Top of Locker		<110	
8	Floor Outside Room 145		<110	
9	Attached Garage – Top of Red Toolbox		<110	
10	Room 117 – Supply Vent		<110	
11	Room 116 – Top of Computer Desk		<110	
12	Room 112 – Top of Filing Cabinet		<110	
13	Admin. Center – Top of Desk		<110	
14	Gym, Converted Firing Range – Floor		<110	
15	Gym, Converted Firing Range – Supply Vent		<110	
16	Gym, Converted Firing Range – Top of Locker		<110	
17	Floor Outside Gym, Converted Firing Range		<110	
18	Club House – Top of Bar		<110	
19	Second Floor Center Desk Area – Top of Metal Table		<110	
20	Second Floor Center Desk Area – Window Sill		<110	
21	Blank		<12 (ug)	
22	Blank	<3 (ug)		
Criteria		**50**	**200**	**0.5**

Key: **Bolded results** exceed listed criteria

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1284 of 5269

Lead surface and air samples were collected. All sample results were less than recommended guidelines or regulatory standards.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for Environmental Chemicals," the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3. In fact, no detectable level of lead was identified in the air samples collected.

Deteriorated paint was observed on ductwork in the Drill Hall and Room 148. Peeling and damaged paint should be repaired and properly remediated.

BEST AVAILABLE COPY

Section 5.0
Lighting

BEST AVAILABLE COPY

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400I. Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Drill Hall	22.4	30-50	No
Kitchen	70.1	50	Yes
Room 143	66.6	30-50	Yes
Room 148	28.2	30-50	No
Room 118	82.2	30-50	Yes
Room 116	141.6	30-50	Yes
Room 112	126.0	30-50	Yes
Room 102	87.7	30-50	Yes
Room 103	148.8	30-50	Yes
Room 207	80.1	30-50	Yes
Second Floor Desk Area	70.4	30-50	Yes
Basement Gym	85.2	30	Yes
B04 Locker Room	41.3	7	Yes
Club House	88.8	30-50	Yes
Attached Garage	31.2	75	No

Lighting levels met the minimum recommended guidelines in all but the following areas: 1) Drill Hall 2) Room 148 3) Attached Garage. Lighting should be improved in these areas.

BEST AVAILABLE COPY

Section 6.0
Indoor Air Quality

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The IAQ Meter was last calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 69.6 to 78.2 degrees F with relative humidity readings ranging from 44.1% to 89.7%. During the survey, carbon dioxide (CO_2) levels ranged from 344 ppm to 601 ppm within the facility compared to an outdoor CO_2 level of 320 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,020 ppm (320 ppm + 700 ppm). Carbon monoxide (CO) ranged from 0.0 – 0.1 ppm.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	77.2	87.6	318	0.1
Drill Hall	77.4	**85.4**	344	0.0
Kitchen	78.2	**84.5**	363	0.0
Room 143	76.9	50.1	593	0.0
Room 148	72.8	55.7	375	0.0
Room 118	75.4	**72.0**	601	0.1
Room 116	75.3	**73.4**	408	0.0
Room 112	74.6	**61.2**	385	0.0
Room 102	71.9	44.1	492	0.1
Room 103	69.6	44.2	441	0.0
Room 207	69.7	**67.0**	433	0.0
Second Floor Desk Area	70.0	**72.2**	366	0.0
Basement Gym	72.3	**89.1**	388	0.0
B04 - Locker Room	73.6	**89.6**	464	0.0
Club House	74.6	**73.4**	408	0.0
Attached Garage	77.7	**89.7**	486	0.0

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1289 of 5269

Location	Temperature (◦F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	76.3	91.1	321	0.0
Criteria	**73.0-79.0**	**30-60**	**<1,020**	**<9.0**

Key: **Bolded** results exceed listed criteria

Relative humidity exceeded the recommended ceiling of 60% in most locations. There is central air conditioning system in the building however, many windows and doors were open at the time of this survey. Outdoor conditions were raining and windy. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation.

Carbon dioxide levels did not exceed the recommended ceiling of 1,020 ppm. This suggests that outdoor air ventilation is adequate in this area. There is a mechanical ventilation system for this facility which provides outdoor air ventilation.

Carbon monoxide levels were less than the recommended ceiling of 9 PPM.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

1. Carpeting is old and stained throughout the facility.

2. Water was observed running down the wall in the Drill Hall due to rain. Paint is peeling and chipping.

3. In the Clubhouse water was running under the door from a nearby stairwell. Carpeting near the door was wet.

4. In Room B04 a small amount of suspected fungal growth was observed on the ductwork.

5. Water damaged ceilings and active roof leaks are present.

6. Supply vents have condensation present. Possible fungal growth was observed on the supply and return vents. Do not permit dirt, debris, microbial growth, etc. to accumulate in any portion of the HVAC system. Supply and return vents should be cleaned.

All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

BEST AVAILABLE COPY

Section 7.0
Suspect Asbestos Containing Building Materials

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 7.0 Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials (ACM) could include sheetrock/joint compound, plaster wall and ceiling systems, floor tiles and associated mastic, and vinyl cove base. Thermal system insulation which is most likely a combination of paper wrapped fiberglass with PVC elbows and well as pre-formed TSI with mudded elbows is a suspect material. No samples were collected. Inaccessible areas were not inspected.

The only suspect ACM noted at the time of this survey was window glazing on the exterior windows of the Drill Hall.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1292 of 5269

BEST AVAILABLE COPY

Section 8.0
Maintenance Bay

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is a garage area at this facility. It is sometimes used for maintenance of vehicles. No maintenance work was being performed on the day of this survey.

A Local Exhaust Ventilation (LEV) system is present to remove vehicle exhaust from the building. The LEV system contains two drops or exhausts. The LEV in each bay consists of a flex duct with an area of 7.5" x 3.5". The following flow rates were measured:

1. Bay 1 – 133 CFM
2. Bay 2 – 144 CFM

The actual flow rate that is required in an overhead vehicle exhaust system varies depending on the engine tail pipe temperature, whether or not the vehicle is "under load" or idling, engine displacement, engine size, etc. As an example, a 15 Liter Engine running at 1,000 rpm with an exhaust gas temperature of 1,300 F (heavy load) would require an exhaust flow of 2,110 CFM. We recommend the overhead vehicle exhaust system be inspected to determine if it is operating as designed and meets the minimum requirements as recommended by the American Conference of Governmental Industrial Hygienists (ACGIH) Industrial Ventilation: A Manual of Recommended Practice for Design (27th Edition).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1294 of 5269

BEST AVAILABLE COPY

Section 9.0
Limitations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1296 of 5269

BEST AVAILABLE COPY

Appendix A
Laboratory Analysis Report

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
LAB #106470
NY ELAP
10920

Client:	National Guard Bureau	Job Name:	Annapolis Armory	Chain Of Custody:	508936
Address:	301-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	Annapolis, MD	Date Submitted:	10/5/2010
	Havre de Grace, Maryland 21078	Job Number:	Not Provided	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	10/11/2010 Report Date: 10/12/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1103042	1010634-1	Flame	Air	879	N/A	3.4	ug/m³	<3	<3.4	ug/m³	
1103043	1010634-2	Flame	Air	842	N/A	3.6	ug/m³	<3	<3.6	ug/m³	
1103044	1010634-3	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103045	1010634-4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103046	1010634-5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103047	1010634-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103048	1010634-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103049	1010634-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103050	1010634-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103051	1010634-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103052	1010634-11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103053	1010634-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103054	1010634-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103055	1010634-14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103056	1010634-15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103057	1010634-16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103058	1010634-17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103059	1010634-18	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103060	1010634-19	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#106470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1298 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1299 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY

LAB #100470

NY ELAP
10920

Client:	National Guard Bureau	Job Name:	Annapolis Armory	Chain Of Custody:	508936
Address:	301-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	Annapolis, MD	Date Submitted:	10/5/2010
	Havre de Grace, Maryland 21078	Job Number:	Not Provided	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	10/11/2010 Report Date: 10/12/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1103061	1010634-20	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1103062	1010634-21	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1103063	1010634-22	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: [redacted] Non-Responsive

Technical Manager: [redacted] Non-Responsive

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample materiel will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NYLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved: AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) **508936**

p.1/2

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Annapolis Armory
2. Job Location: Annapolis, MD
3. Job #:
4. Contact Perso[redacted]
5. Submitted by: [redacted]

P.O. #: W912K6-09-A-0003

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
☐ Immediate Date Due:
☐ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
☐ Immediate ☐ 3 Day
☐ Next Day ☒ 5 Day + 10/12/10 ☒ Results Required By Noon (Every Attempt Will Be Made to Accomodate)
☐ 2 Day Date Due: 10/12/10

REPORT TO:
☒ Inclu[redacted]
☒ Email: [redacted]callab.com
☐ Fax:
☐ Verba[redacted]

Asbestos Analysis
PCM Air – Please indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos-Soil PLM ___ (Qual) PLM ___ (Quant) PLM/TEM ___ (Qual) PLM/TEM ___ (Quant)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (Test Water samples ____ °C)

Metals Analysis
☐ Pb Paint Chip ____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 19 (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)
Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media:
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: FEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	PAINT CHIP	WIPE TYPE	TAPE	SWAB
1010634-1	Drill Hall	9/30	879					X		X						
1010634-2	1PT Perez's Office		842					X		X						
1010634-3	Drill Hall F1			100cm²				X				X				
1010634-4	Drill Hall F1 Counter							X				X				
1010634-5	Drill Hall Metal Tabletop							X				X				
1010634-6	Kitchen Metal Counter Top							X				X				
1010634-7	Rm 145 Top of Locker							X				X				
1010634-8	F1 Outside Rm 145							X				X				
1010634-9	Attic Garage Top of Tool Cabinet							X				X				
1010634-10	Rm 117 Supply Vent							X				X				
1010634-11	Rm 116 Top of Cabinet							X				X				
1010634-12	Rm 116 Top of Cabinet							X				X				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 10/05/10 @ 1000 Via: UPS By (Print): [redacted]
2. Date/Time Analyzed: ____/____/____ @ ____ By (Print): ____
3. Results Reported To: ____ Via: ____ [redacted]
4. Comments:

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1300 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1301 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (11920)
4973 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) 508936 p2/2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Annapolis Armory
2. Job Location: Annapolis, MD
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person: [redacted] @ phone # (410) 942-0273
5. Submitted by: Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email [redacted]s.army.mil ☐ Fax ☐ Verba[redacted]s.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Gray: Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
NOB
☐ Vermiculite
☐ Asbestos Soil PLM__ (Qual) PLM__ (Quant) PLM/TEM__ (Qual) PLM/TEM__ (Quant)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (prep/abs) Vacuum/Dust ____ (QTY)
☐ Quant. (s/area) Vacuum D6755-95 ____ (QTY)
☐ Quant. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (prep/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☐ Pb Paint Chip ____ (QTY)
☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
☐ Pb Air ____ (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)
Fungal Analysis
Collection Apparatus for Spore Trap/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

Converted Firing Range (CFR)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PCM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WIPE/ MATERIAL	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
101061H-13	Admin Outer Hall	9/26		100cm²				X				X					Date/Time: Contact: By:
101061H-14	Gym-Floor							X				X					
101061H-15	Gym Supply Vent							X				X					
101061H-16	Gym-Top of Locker							X				X					
101061H-17	E1 Outside Gym							X				X					Date/Time: Contact: By:
101061H-18	Clubhouse Toilet Can							X				X					
101061H-19	2-H Conference Table							X				X					
101061H-20	2-H Conference Table							X				X					
101061H-21	Blank			Cem²				X				X					Date/Time: Contact: By:
101061H-22	Blank		0					X		X							

LABORATORY STAFF ONLY: (CUSTODY):
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

[redacted]

BEST AVAILABLE COPY

Appendix B
Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

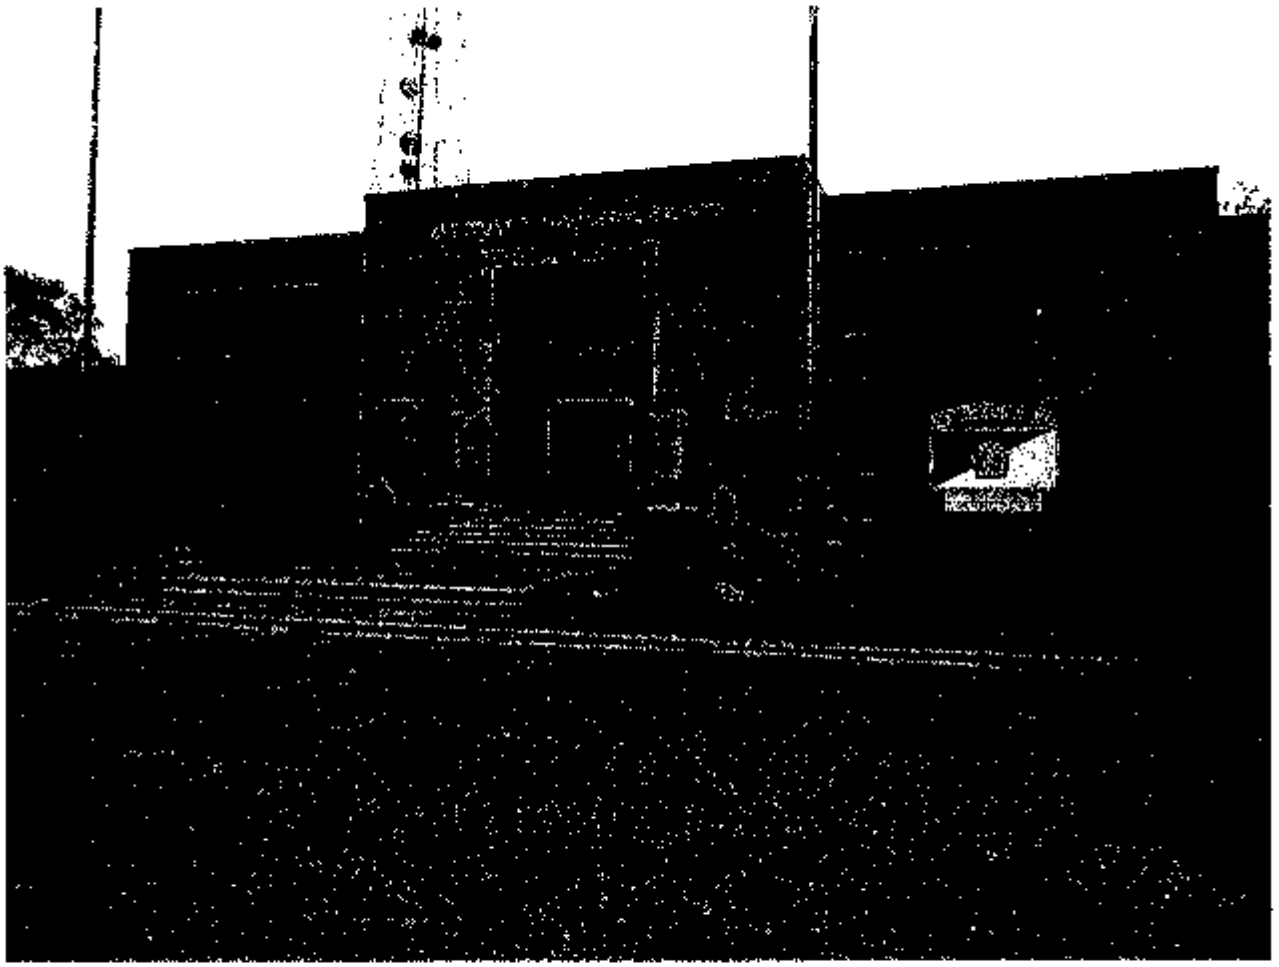

Annapolis MD
Exterior of Building

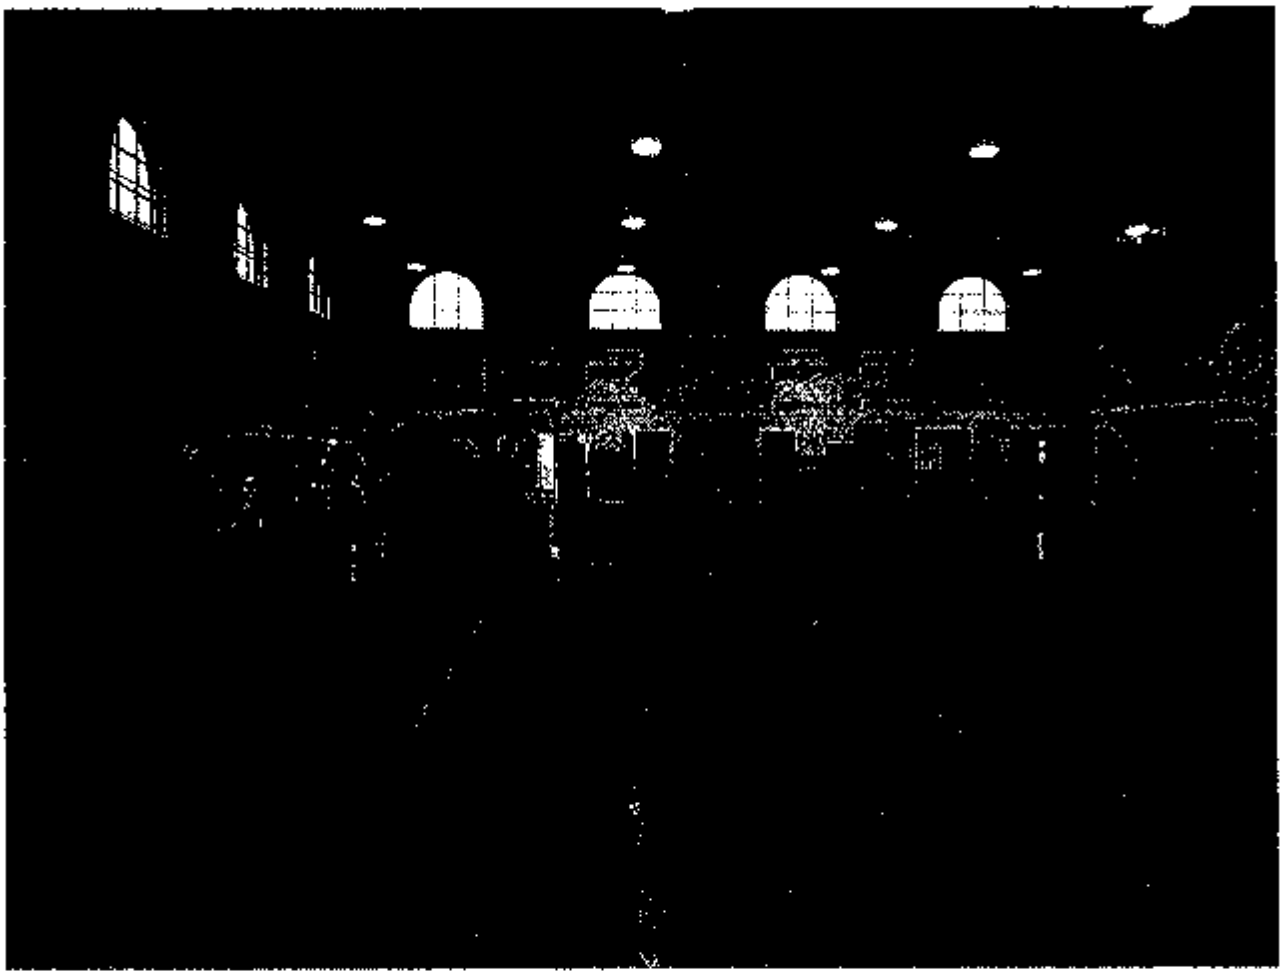

Annapolis MD
Drill Hall

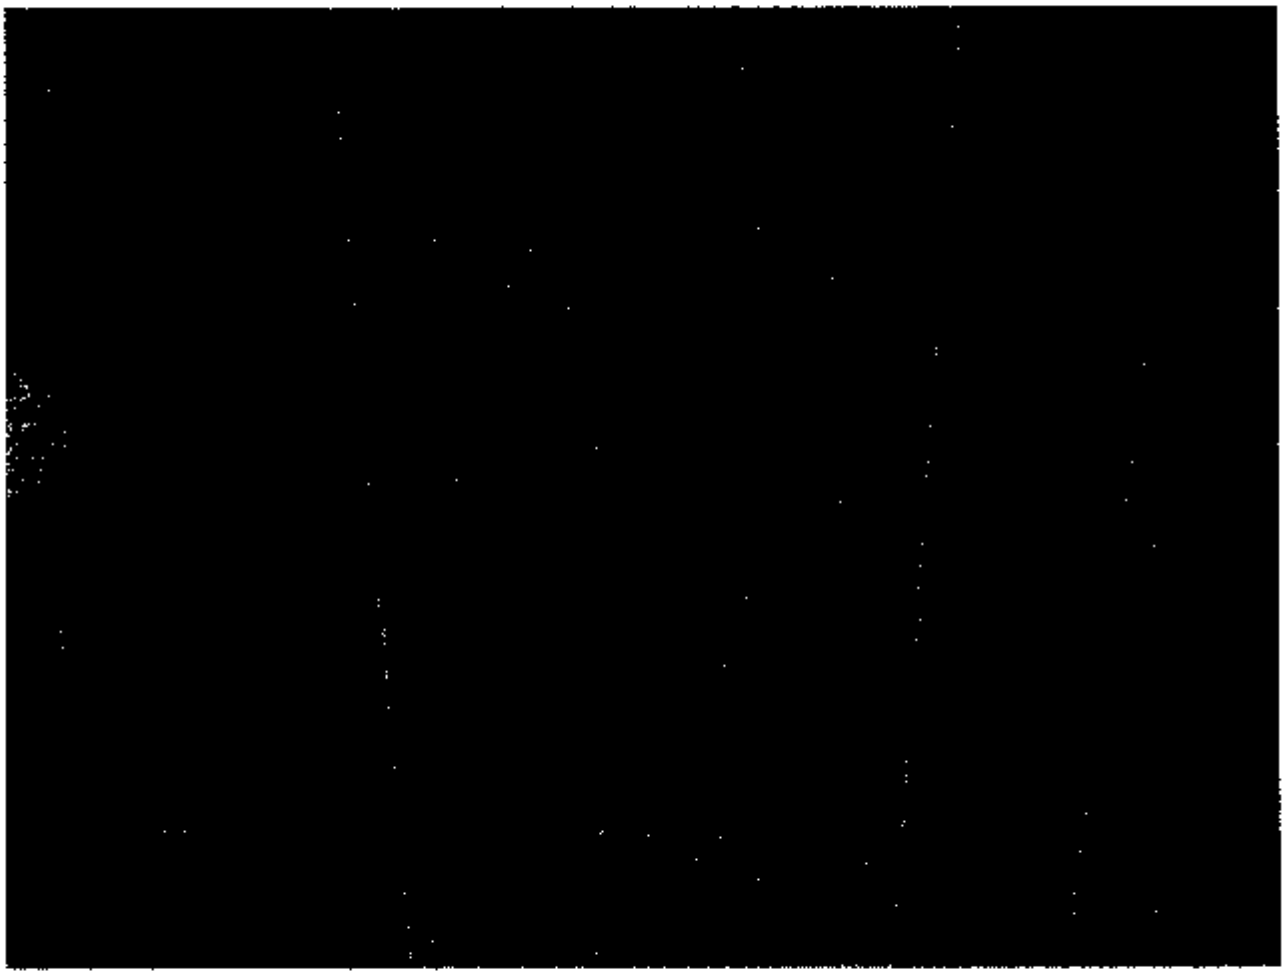

Annapolis MD
Drill Hall - Chipping/Peeling Paint on Ductwork

Annapolis MD
Room 148 – Chipping/Peeling Paint on Ductwork

Annapolis MD
Attached Garage

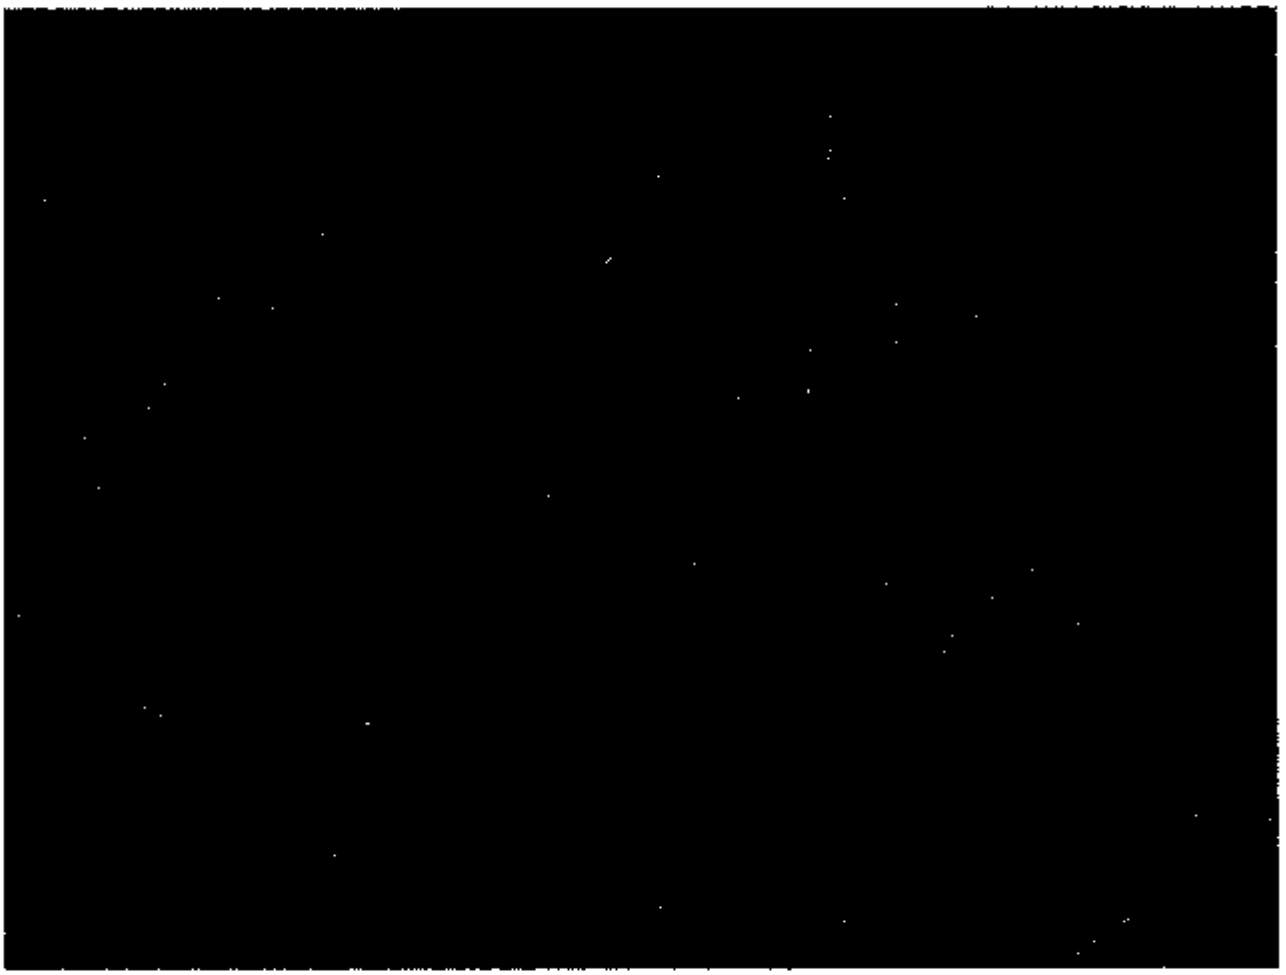

Annapolis MD
Attached Garage – Exhaust Duct

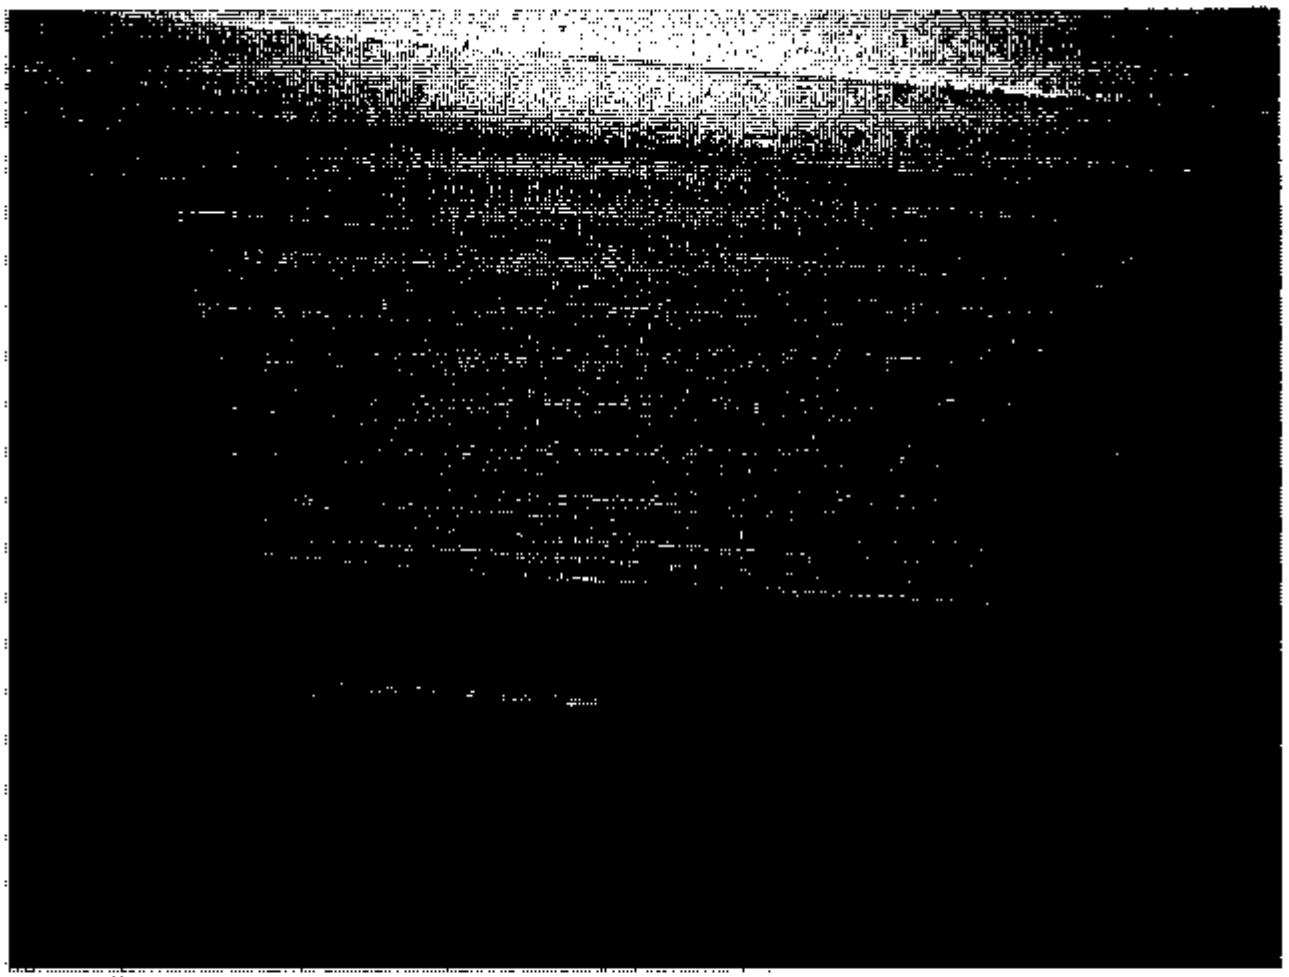

Annapolis MD
Newer Part of Building Hallway · Dirty Return Grill

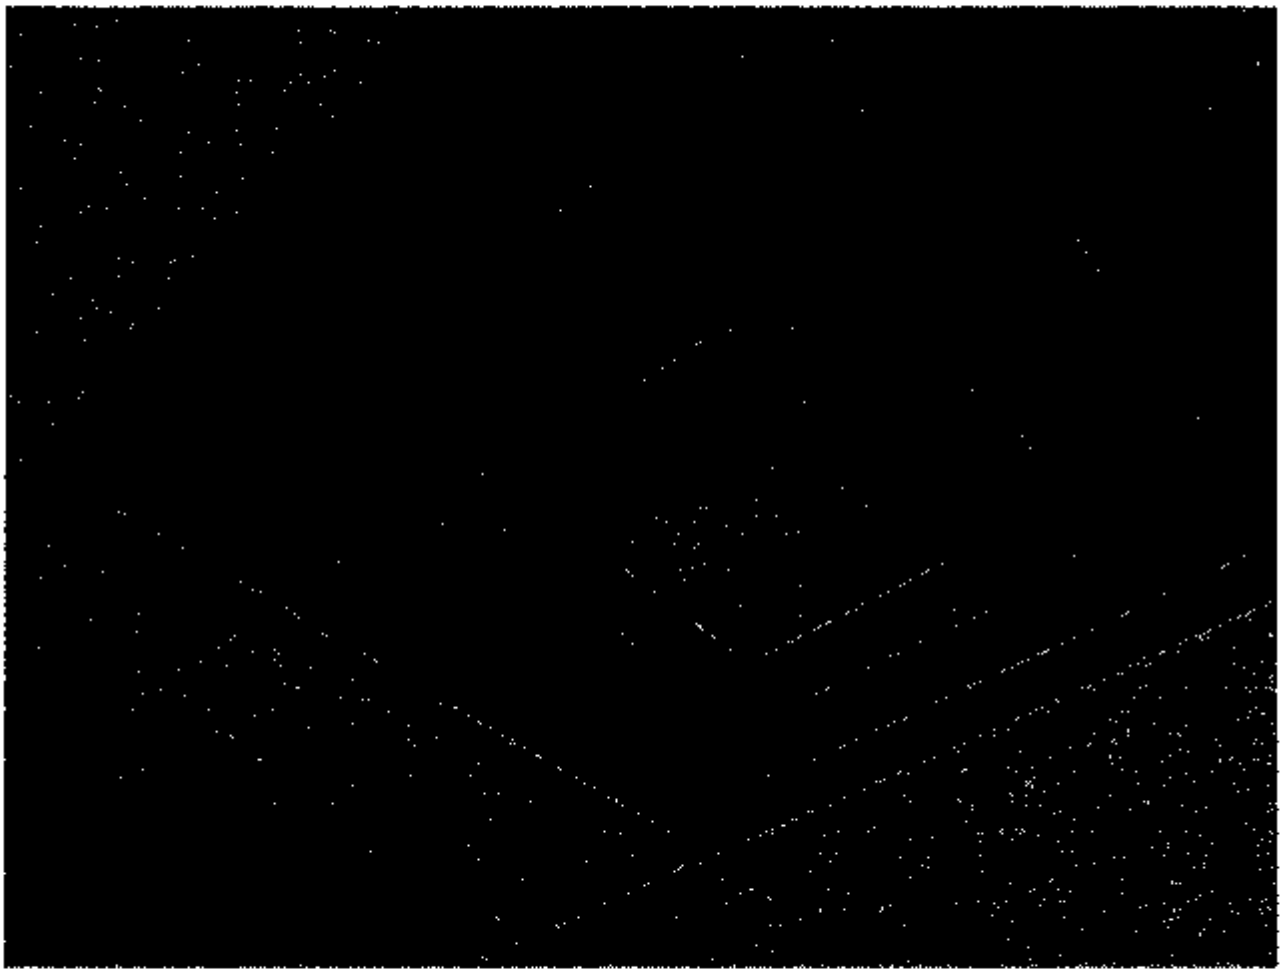

Annapolis MD
Room 112 Condensation on Supply Vent

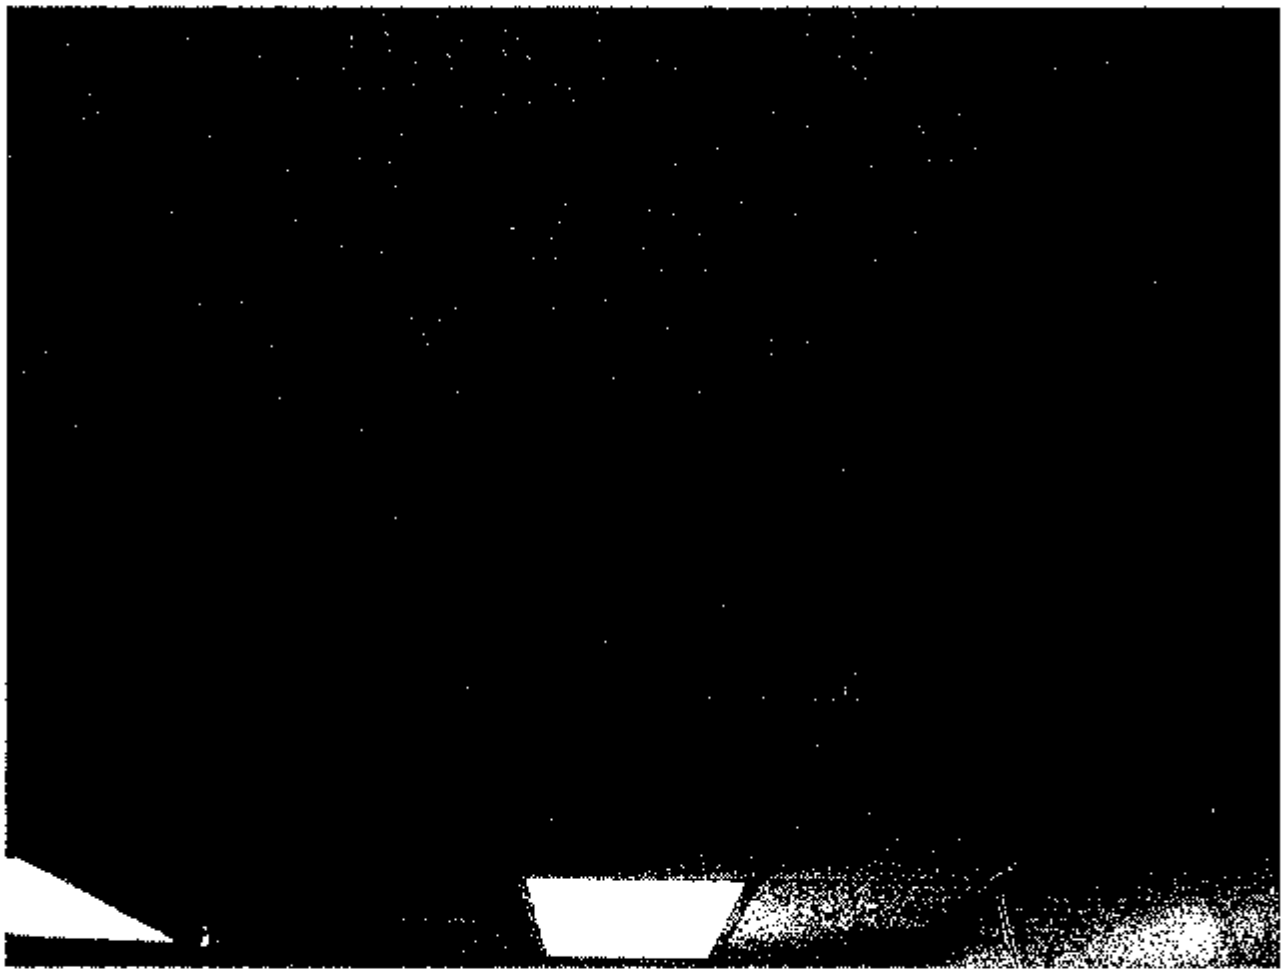

Annapolis MD
Room 112 – Stained and Currently Wet Ceiling Tile

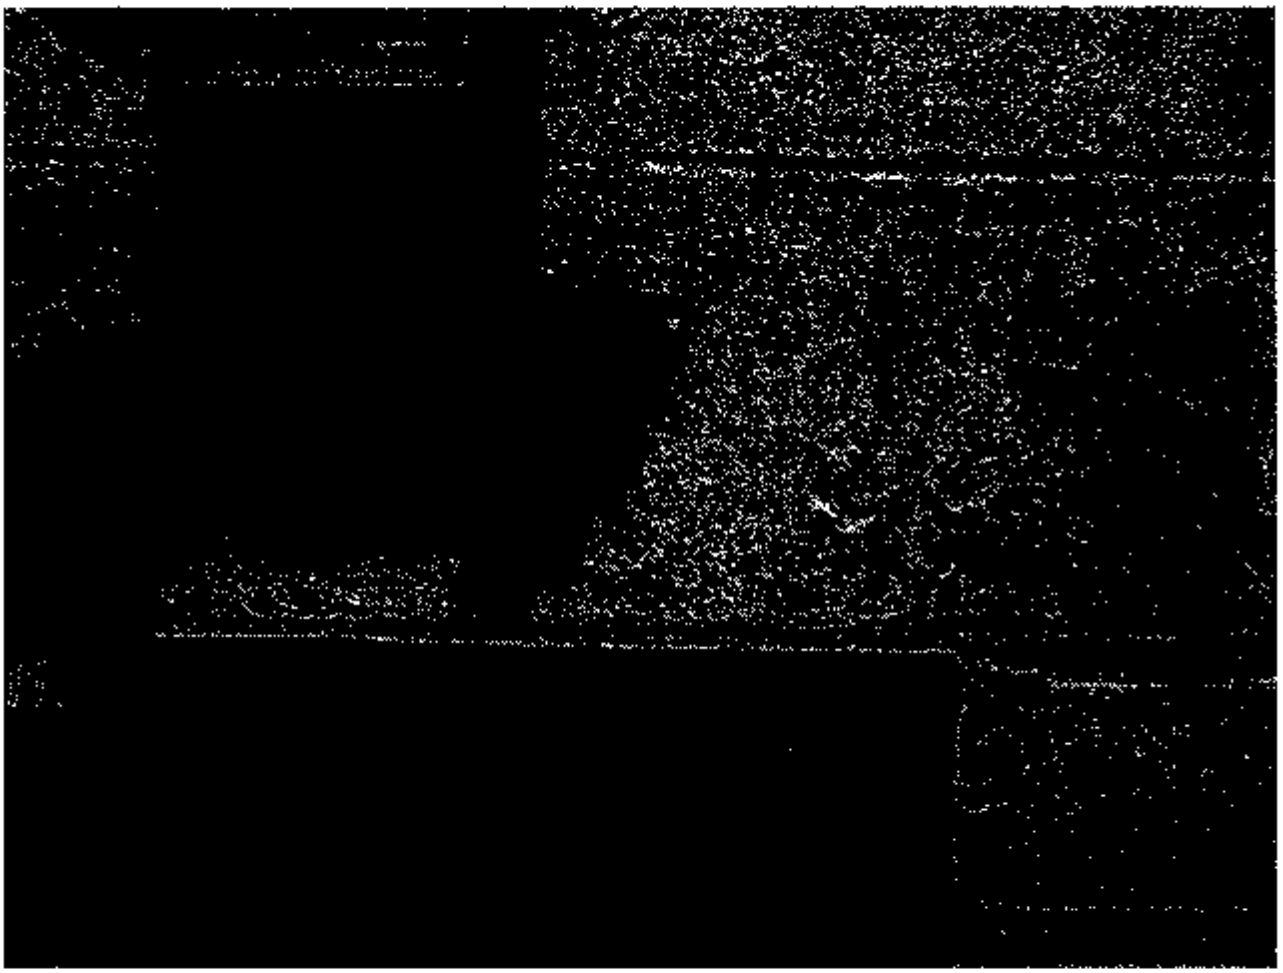

Annapolis MD
Drill Hall – Current Water Infiltration through Cement Block Wall, Chipping/Peeling Paint and Efflorescence

Annapolis MD
Gym Converted Firing Range

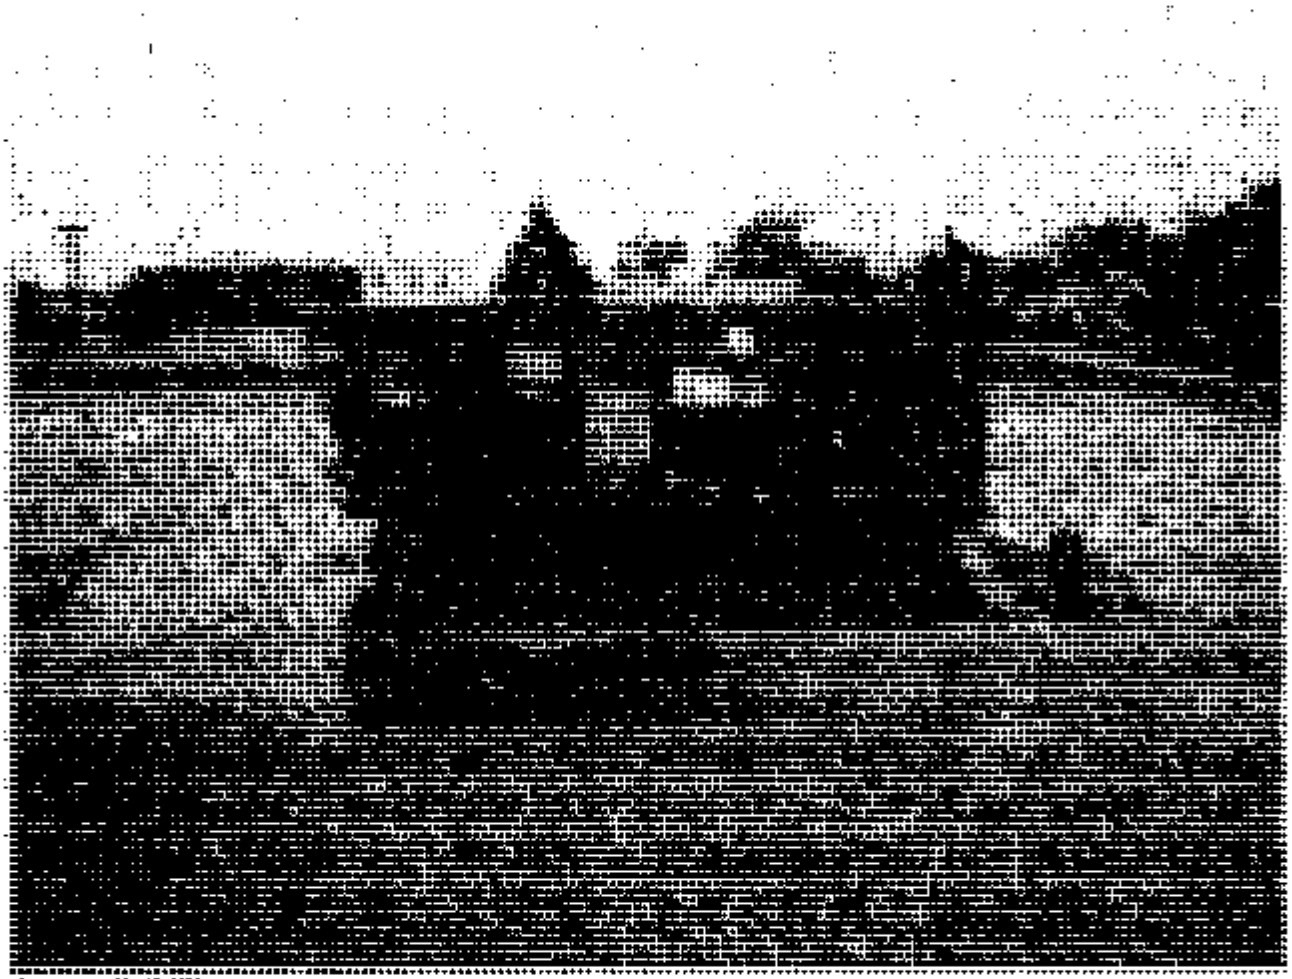

Rooftop Air Handling Unit

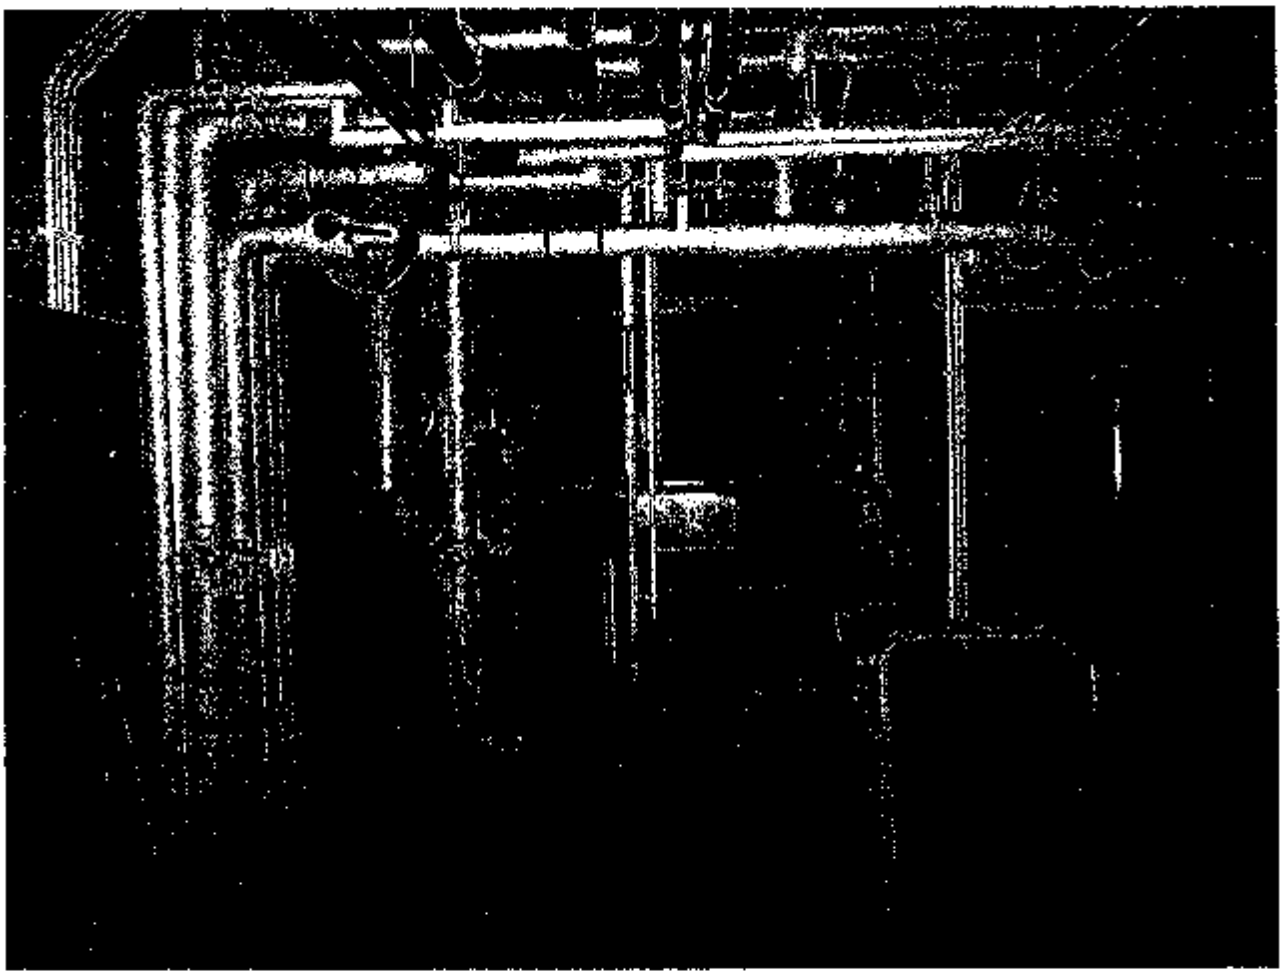

Annapolis MD
Boiler Room

BEST AVAILABLE COPY

Appendix C
Floor Plan

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

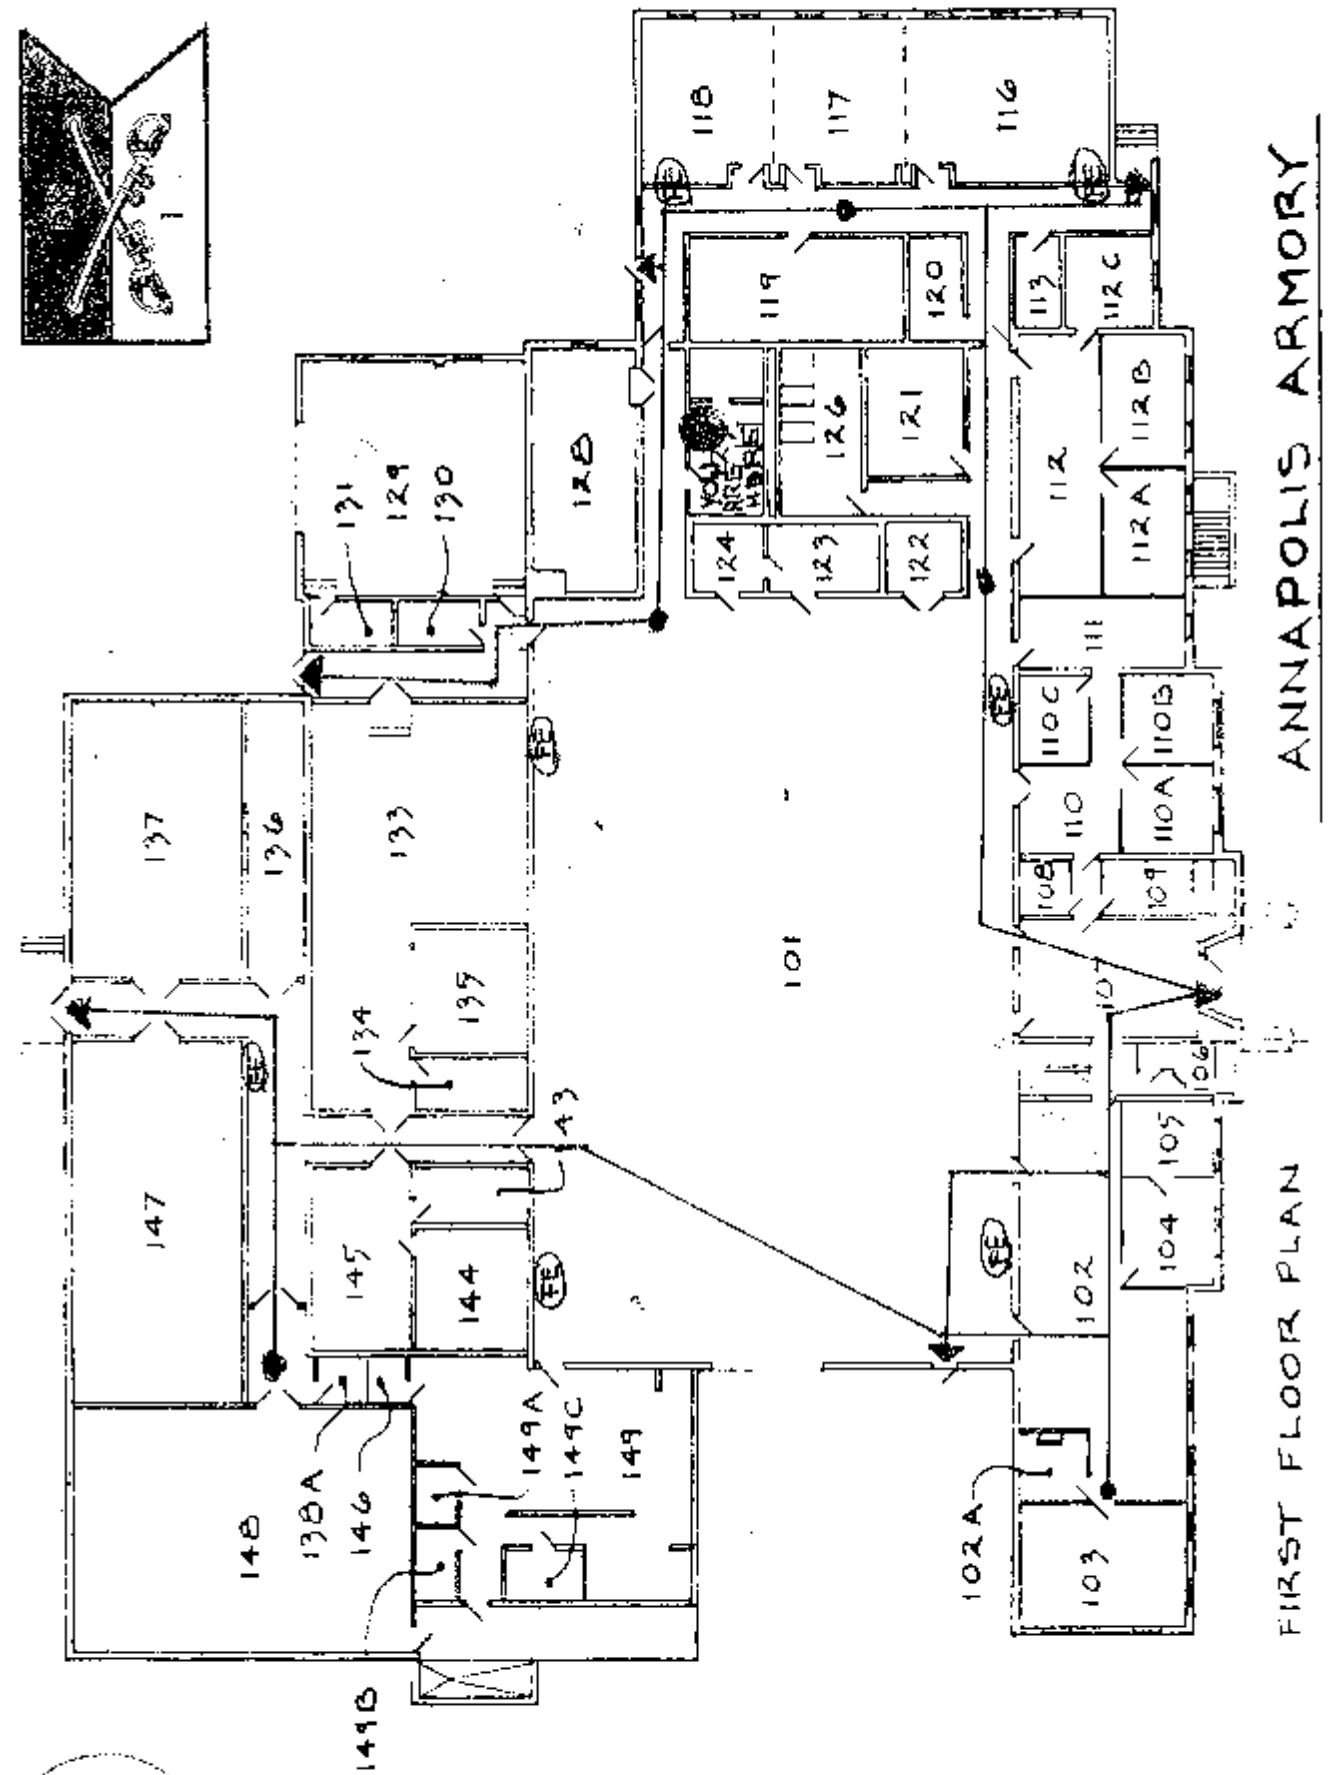
ANNAPOLIS ARMORY
FIRST FLOOR PLAN
YOU ARE HERE
101
102
102A
103
104
105
106
107
108
109
110
110A
110B
110C
111
112
112A
112B
112C
113
116
117
118
119
120
121
122
123
124
125
126
128
129
130
131
133
134
135
137
138
138A
143
144
145
146
147
148
149
149A
149B
149C
FE

BEST AVAILABLE COPY

Appendix D
References

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(b)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1319 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Annapolis Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Annapolis Readiness Center** **18 Willow Street** **Annapolis, MD 21401**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**June 20, 2013**
Report Date:	**July 30, 2013**

Non-Responsive

[redacted]

Manager, Industrial Hygiene Services

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 9

Section 6.0 Suspect Asbestos Containing Building Materials 11

Section 7.0 Ventilation Survey 12

Section 8.0 Equipment 13

Section 9.0 Limitations 14

Appendix A. Laboratory Analysis Report 15

Appendix B. Photographs 16

Appendix C. Floor Plan 17

Appendix D. References 18

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on June 20, 2013, at the Annapolis Readiness Center located 18 Willow Street, Annapolis, MD 21401. The survey was performed by Non-Responsive

1. Lead surface, bulk, and air samples were collected. All sample results were less than regulatory standards and/or recommended guidelines. See Section 3.0 for detailed sampling results.

2. Lighting levels met the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in all locations tested. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in two areas sampled.

    b. The relative humidity level was above the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60% in one occupied area sampled.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 parts per million (ppm).

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2010 recommended guidelines for mechanically ventilated office buildings and commercial settings.

    See Section 5.0 for detailed sampling results.

4. Water-damaged walls were observed in the Drill Hall and Gym. See Section 5.0 for detailed findings.

5. The ground beneath the 2001 addition to the building is subsiding causing structural damage. See Section 5.0 for detailed sampling results.

6. No suspect asbestos containing material (ACM) was observed. See Section 6.0 for detailed sampling results.

7. This facility has a vehicle maintenance shop with an overhead vehicle exhaust system. See Section 7.0 for detailed sampling results.

Section 2.0 Operation Description & Observations

The Annapolis Readiness Center is mainly an administrative facility with a drill hall, offices, classrooms, attached vehicle maintenance shop and a converted firing range area (currently a Distance Learning Center). There were approximately 10 full-time employees stationed at this facility at the time of this survey.

The building is reported to have been built in 1959. It is a two-story structure with a basement. The exterior is brick and block. The interior walls are brick, block, plaster, and paneling with drywall in some of the offices. The floors are concrete, 12”x12” floor tiles and ceramic tile.

The heating system consists of a gas-fired steam generating unit. There is a roof-mounted central air-conditioning system.

There is no child-care facility in the building.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

This facility has a converted firing range (CFR) that is now used as a gym.

This facility has an attached 2-bay vehicle maintenance shop with an over head vehicle exhaust system. The overhead vehicle exhaust system has two connection points, both functional. The only PPE observed were gloves.

The ground beneath the 2001 addition is subsiding causing structural damage to the building walls and floor. It was reported that a local contractor is involved with corrective action.

Chipped and peeling paint was observed in the Drill Hall and Gym. Both areas were sampled for lead content.

Housekeeping seemed adequate.

No suspect asbestos containing material (ACM) was observed.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	**Location**	**Bulk (%)**	**Air ug/m^3**	**Surface ug/ft^2**
1	Drill Hall	*	<5.1	*
2	Office 102	*	<5	*
3	Blank	*	<3 ug	*
4	Blank	*	*	<12 ug
5	Drill Hall Floor Center	*	*	<110
6	Drill Hall Wall Shelf	*	*	<110
7	Kitchen Microwave Top	*	*	<110
8	Kitchen Ice Machine Top	*	*	<110
9	CFR Floor	*	*	130
10	CFR Floor outside Entrance	*	*	<110
11	CFR Locker Top	*	*	<110
12	CFR Duct Top	*	*	<110
13	NCO Club Frig Top	*	*	<110
14	Office 110 Cabinet Top	*	*	<110
15	Office 207 Window Sill	*	*	<110
16	2nd Floor Cabinet Top	*	*	<110
17	Office 104 Bookshelf Top	*	*	<110
18	Office 102 File Cabinet Top	*	*	<110
19	Drill Hall Wall Paint Door 111	0.097	*	*
20	Gym Wall Paint	0.0072	*	*
-	**Criteria**	**0.5**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges

2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface, bulk and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were less than the recommended guideline of <200 ug/ft^2 in all locations sampled.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

- Two paint chip samples were collected. One from the Drill Hall wall above door to Office 111 where there is approximately 40 square feet of peeling paint. Another sample was collected from the Gym wall where there is approximately 30 square feet of damage. Both areas seem to be the result of water intrusion. These sample results was less than the EPA/U.S. Department of Housing and Urban Development (HUD) definition of lead based paint (0.5%). However, all areas of peeling paint should be repaired.

Section 4.0 Lighting

A lighting assessment was conducted in this facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98011EL). The light meter was last calibrated in November 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
158th Corridor	36.2	5	Yes
Women's Latrine	21.9	5	Yes
Lobby	32.2	10	Yes
Recruiting Office	67.0	30-50	Yes
Office 102	51.1	30-50	Yes
Office 104	76.5	30-50	Yes
Office 103A	78.5	30-50	Yes
Office 103B	61.0	30-50	Yes
Men's Latrine 106	34.7	5	Yes
Office 200	31.9	30-50	Yes
Conference 207 (meeting)	54.4	30	Yes
Drill Hall	30.0	10	Yes
Boiler Room 128	32.7	30	Yes
Boiler Room Corridor	27.0	5	Yes
Men's Latrine	41.1	5	Yes
Maintenance Corridor	18.4	5	Yes
Bulk Storage 133	23.5	10	Yes
Storage Corridor	34.1	5	Yes
Locker Room	18.2	7	Yes
Latrine 138A	32.3	5	Yes
Bulk Storage	19.3	10	Yes
Kitchen (prep)	66.0	50	Yes
Kitchen Office 149A	38.6	30-50	Yes
Office 119	37.3	30-50	Yes
Classroom 1	53.5	30-50	Yes
Comm. Room (not repair)	36.6	30-50	Yes
Office 112	33.2	30-50	Yes
Office 112A	55.7	30-50	Yes
Office 112C	63.3	30-50	Yes
Office 202	55.1	30-50	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting levels met the minimum recommended guideline in all areas measured.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	77.5	55.5	365	0.0
Office 102	77.8	57.4	640	0.6
Office 104	77.9	59.1	493	0.2
Office 205	74.9	50.8	455	0.4
NCO Club	74.4	**60.5**	507	0.0
Criteria	**68-79**	**30-60**	**<1,065**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements met the recommended 68-79°F in all occupied areas.

- Relative humidity levels were above the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 177 recommended guideline of 30-60% in one location. Relative humidity should be kept within the recommended guideline.

- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level. For this survey, carbon dioxide levels did not exceed the recommended ceiling of 1,065 ppm (700 ppm + 365 ppm). This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observation were noted:

    1. Water-damaged walls were observed in the Drill Hall and Gym. This is apparently due to water intrusion from roof leaks above the Drill Hall and below-grade water intrusion in the Gym. Sources should be identified and corrected to ensure no further damage occurs.

    2. Structural damage (cracks in walls and floor) has occurred in the 2001 addition. This may provide pathways for air and water intrusion which could affect indoor air quality. A structural engineer or other qualified professional should be retained to identify and provide recommendations for corrective action.

Section 6.0 Suspect Asbestos Containing Building Materials (ACM)

No suspect ACM was noted at the time of this survey.

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Section 7.0 Ventilation Survey

This facility has a 2 bay attached vehicle maintenance shop with an over head vehicle exhaust system. The overhead vehicle exhaust system has two connection points, both were functional. The maintenance shop was reportedly only used occasionally during the winter months for minor vehicle maintenance such as oil changes. The only PPE observed were gloves.

Measurements were conducted at the face of the exhaust using a Velocicalc Plus Model 9555-P. Measurements were compared to the ACGIH Industrial Ventilation Manual requirements for above floor exhaust systems. The table below details measurement findings.

ABOVE FLOOR EXHAUST VENTILATION RATE SUMMARY

Location	Type of Hood	Exhaust Diameter	Measured Flow Rate (CFM)
Exhaust Left	Above Floor	6.0" x 3.5"	131
Exhaust Right	Above Floor	6.0" x 3.5"	125

Reference: Industrial Ventilation, A Manual of Recommended Practice for Design, 27th Edition, ACGIH.

EXAMPLES OF VEHICLE LEV SYSTEM REQUIREMENTS

Vehicle Nomenclature	Tailpipe Temp. (ºF)	Engine Displacement (ft3)	Engine RPM*	Exhaust Flow † (CFM)
M35A2, 2.5 Ton Cargo Truck	300	0.277	2,500	1,192
M1008 CUCV, SUV	267	0.219	3,800	1,370
M923A2, 5 Ton Cargo Truck	300	0.293	1,700	857
M996 HMMWV, All Terrain Vehicle	297	0.219	3,300	1,239

* Revolutions per Minute † Includes 20% Safety Factor

The actual flow rate that is required in an overhead vehicle exhaust system varies depending on the engine tail pipe temperature, whether or not the vehicle is "under load" or idling, engine displacement, engine size, etc. As an example, a 15 Liter Engine running at 1,000 rpm with an exhaust gas temperature of 1,300 F (heavy load) would require an exhaust flow of 2,110 CFM. If vehicle maintenance is performed at this facility we recommend the vehicle exhaust system be utilized. It should be regularly inspected to determine if it is operating as designed and meets the minimum requirements as recommended by the American Conference of Governmental Industrial Hygienists (ACGIH) Industrial Ventilation: A Manual of Recommended Practice for Design (27th Edition).

Section 8.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98082EL	4/2013	NA
Velocicalc Plus	841015	8/12	N/A
SKC Air Sampling Pump	647631	6/17/13	2.47 LPM
SKC Air Sampling Pump	767971	6/17/13	2.48 LPM

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccredited labs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG 4a MD	**Chain Of Custody:**	516192
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Annapolis	**Date Submitted:**	6/25/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/1/2013 **Report Date:** 7/1/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13073160	1	Flame	Air	593	N/A	5.1	ug/m³	<3	<5.1	ug/m³	
13073161	2	Flame	Air	595	N/A	5	ug/m³	<3	<5	ug/m³	
13073162	3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
13073163	4	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
13073164	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073165	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073166	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073167	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073168	9	Flame	Wipe	****	0.108	110	ug/ft²	14	130	ug/ft²	
13073169	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073170	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073171	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073172	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073173	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073174	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073175	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073176	17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073177	18	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073178	19	Flame	Paint Chip	****	N/A	0.01	%Pb		0.097	%Pb	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG 4a MD	**Chain Of Custody:**	516192
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Annapolis	**Date Submitted:**	6/25/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/1/2013 **Report Date:** 7/1/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Total ug	Final Result	Comments
13073179	20	Flame	Paint Chip	****	N/A	0.0072 %Pb		0.011 %Pb	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Non-Responsive

Analyst: [redacted]

Non-Responsive

Technical Manager: [redacted]

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516192

p/of2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG 4a MD
2. Job Location: ANNAPOLIS
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Pers [redacted] @ phone # (410) 942-0273
5. Submitted by [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS		REPORT TO:
❑ Immediate Date Due:	❑ Immediate	❑ 3 Day	☒ Include COC/Field Data Sheets with Report
❑ 24 Hours Time Due:	❑ Next Day	~~❑ 5 Day~~ +	☒ Email: [redacted] compliance place.com
Comments:	❑ 2 Day	Date Due: 7/2/13	❑ Fax: [redacted] us.army.mil
		❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	❑ Verbal: [redacted] us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ❑ NIOSH 7400 ____ (QTY)
- ❑ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ❑ AHERA ____ (QTY)
- ❑ NIOSH 7402 ____ (QTY)
- ❑ Other (specify ____) ____ (QTY)

PLM Bulk
- ❑ EPA 600 – Visual Estimate ____ (QTY)
- ❑ EPA Point Count ____ (QTY)
- ❑ NY State Friable 198.1 ____ (QTY)
- ❑ Grav. Reduction ELAP 198.6 ____ (QTY)
- ❑ Other (specify ____) ____ (QTY)

MISC
- ❑ Vermiculite
- ❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ❑ ELAP 198.4/Chatfield ____ (QTY)
- ❑ NY State PLM/TEM ____ (QTY)
- ❑ Residual Ash ____ (QTY)

TEM Dust
- ❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ❑ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ❑ Qual. (pres/abs) ____ (QTY)
- ❑ ELAP 198.2/EPA 100.2 ____ (QTY)
- ❑ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
- ❑ Pb Paint Chip 2 (QTY)
- ❑ Pb Dust Wipe (wipe type GHOST) 15 (QTY)
- ❑ Pb Air 3 (QTY)
- ❑ Pb Soil/Solid ____ (QTY)
- ❑ Pb TCLP ____ (QTY)
- ❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
- ❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
- ❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ❑ Spore-Trap ____ (QTY)
- ❑ Surface Swab ____ (QTY)
- ❑ Surface Tape ____ (QTY)
- ❑ Other (Specify ____) ____ (QTY)
- ❑ Surface Vacuum Dust ____ (QTY)
- ❑ Culturable ID Genus (Media ____) ____ (QTY)
- ❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1	DRILL HALL	6/20/13	593					✓		✓						
2	OFFICE 102		595					✓		✓						
3	BLANK		—					✓		✓						
4	BLANK			—				✓				✓				
5	DRILL HALL	FLOOR CENTER		100cm²				✓				✓				
6	DRILL HALL	WALL SHELF						✓				✓				
7	KITCHEN	MICROWAVE TOP						✓				✓				
8	KITCHEN	ICE MACHINE TOP						✓				✓				
9	CFR	FLOOR						✓				✓				
10	CFR	FLOOR OUT ENTYANCE						✓				✓				
11	CFR	LOCKER TOP						✓				✓				
12	CFR	DUCT TOP						✓				✓				

LOT 3/23/12
EXP 8/15

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 6 / 25 / 13 @ 940 Via: Fedex By (Print): [redacted] Sign: [redacted]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516192 2 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG 4aMD
2. Job Location: ANNAPOLIS
3. Job #: PO #: W912K6-09-A-0003
4. Contact Perso[redacted] Non-Responsive [redacted]
5. Submitted by [redacted] Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
- ☐ Immediate Date Due:
- ☐ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ☐ Immediate
- ☐ Next Day
- ☐ 2 Day
- ☐ 3 Day
- ☒ 5 Day +
- Date Due:
- ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
- ☒ Includ[redacted] Non-Responsive with Report
- ☒ Email: [redacted] @complianceplace.com
- ☐ Fax: [redacted] @us.army.mil
- ☐ Verbal [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 (QTY)
- ☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA (QTY)
- ☐ NIOSH 7402 (QTY)
- ☐ Other (specify) (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate (QTY)
- ☐ EPA Point Count (QTY)
- ☐ NY State Friable 198.1 (QTY)
- ☐ Grav. Reduction ELAP 198.6 (QTY)
- ☐ Other (specify) (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield (QTY)
- ☐ NY State PLM/TEM (QTY)
- ☐ Residual Ash (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 (QTY)
- ☐ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
- ☐ Qual. (pres/abs) (QTY)
- ☐ ELAP 198.2/EPA 100.2 (QTY)
- ☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
- ☐ Pb Paint Chip 2 (QTY)
- ☐ Pb Dust Wipe (wipe type CotTOST) 15 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid (QTY)
- ☐ Pb TCLP (QTY)
- ☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ☐ Spore-Trap (QTY)
- ☐ Surface Swab (QTY)
- ☐ Surface Tape (QTY)
- ☐ Other (Specify) (QTY)
- ☐ Surface Vacuum Dust (QTY)
- ☐ Culturable ID Genus (Media) (QTY)
- ☐ Culturable ID Species (Media) (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
13	NCO CLUB FRIG TOP	6/20/13		100cm²				✓				✓				
14	OFFICE 110 CAB TOP							✓				✓				
15	OFFICE 207 WINDOW SILL							✓				✓				
16	2ND FLR COMMON CAB TOP							✓				✓				
17	OFFICE 104 Bookshelf TOP							✓				✓				
18	OFFICE 102 FILE CAB TOP							✓				✓				
19	ABOVE DOOR 111							✓			✓					
20	GYM WALL							✓			✓					

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

[redacted] Non-Responsive

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

Appendix B. Photographs

Annapolis RC

Drill Hall Open Garage Door

Chipped Paint above Door 111 in Drill Hall

Chipped Paint on Gym Wall

Damaged Caulking on Front Steps

Vehicle Exhaust System

Structural Damage to Walls of New Addition

More Structural Damage to Walls of New Addition

Structural Damage to New Addition Floor

Appendix C. Floor Plan

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1346 of 5269

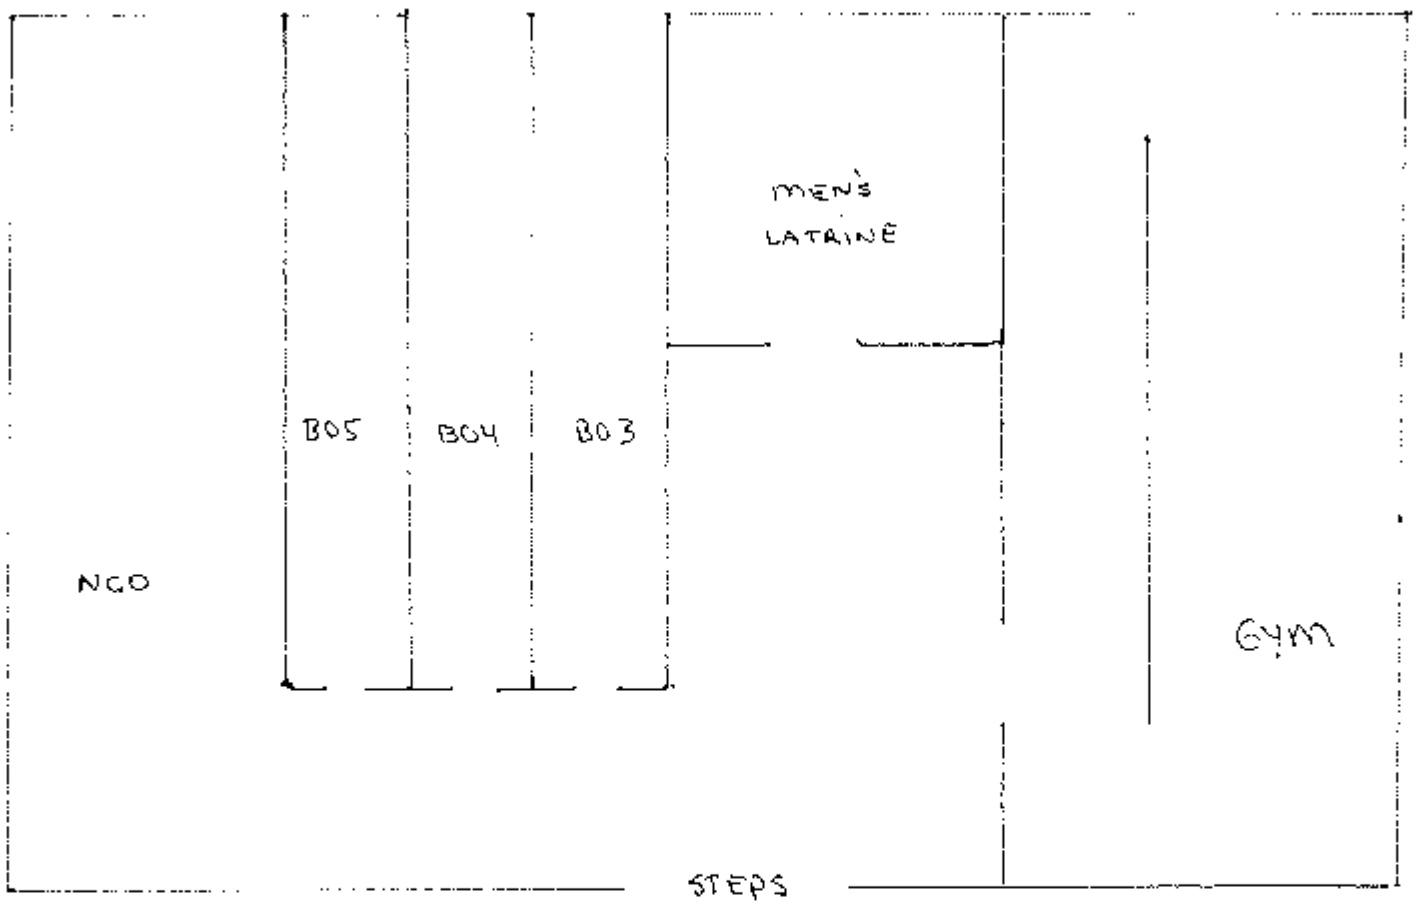

BASEMENT

BEST AVAILABLE COPY

ANNAPOLIS RC
djh 10/20/13

BEST AVAILABLE COPY

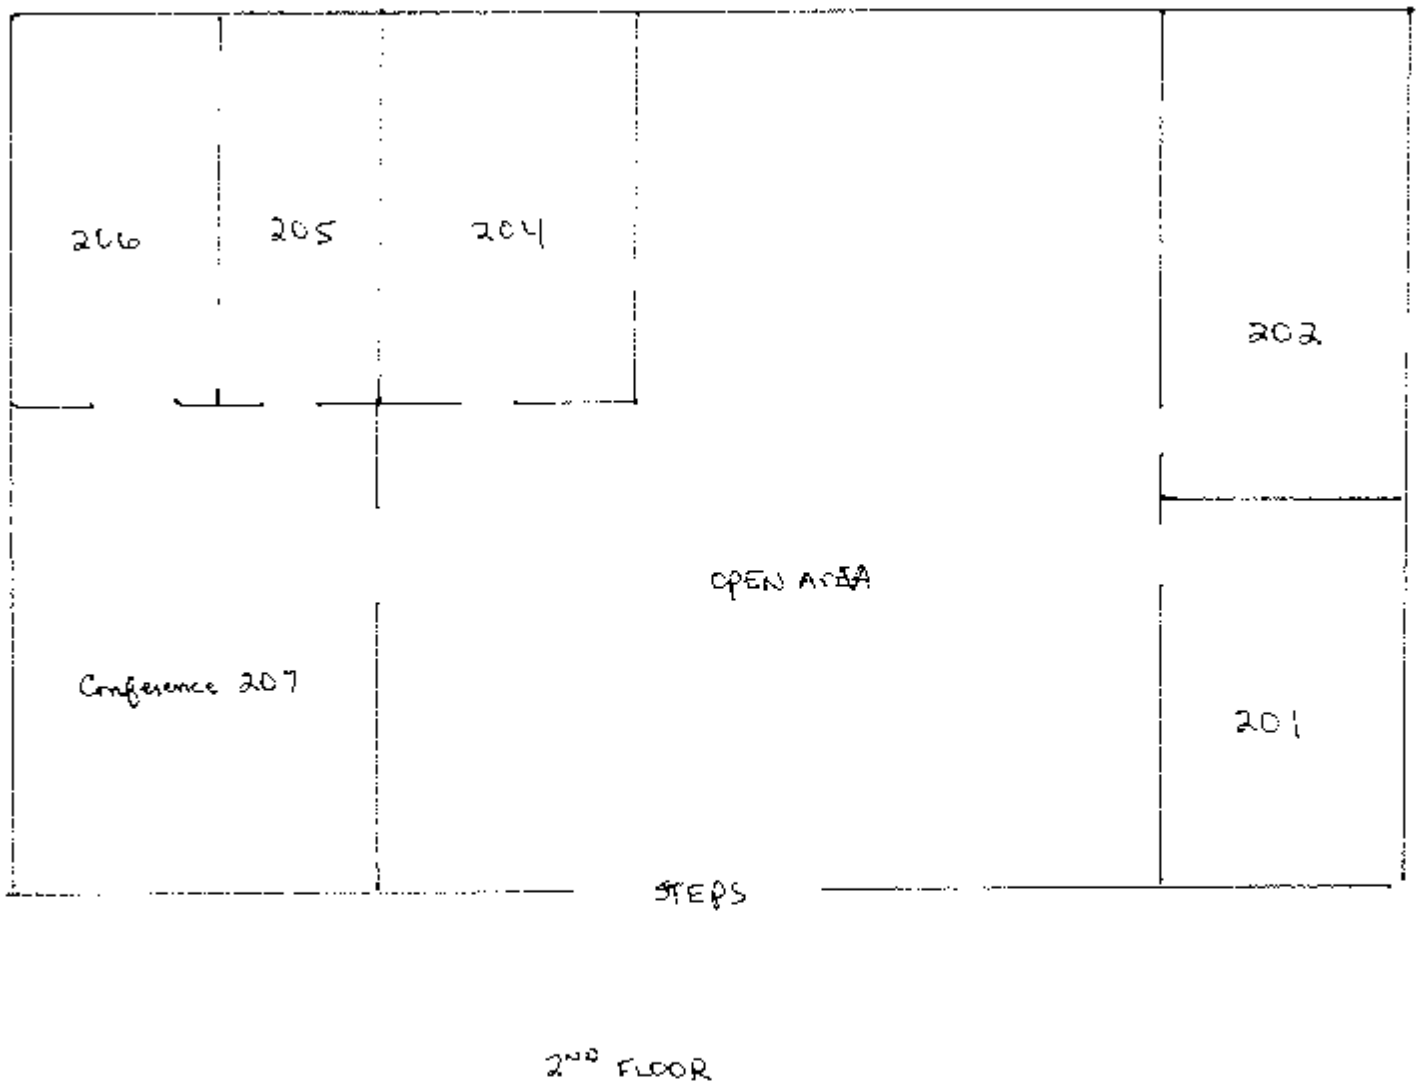

Annapolis RC
djh 6/20/13

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

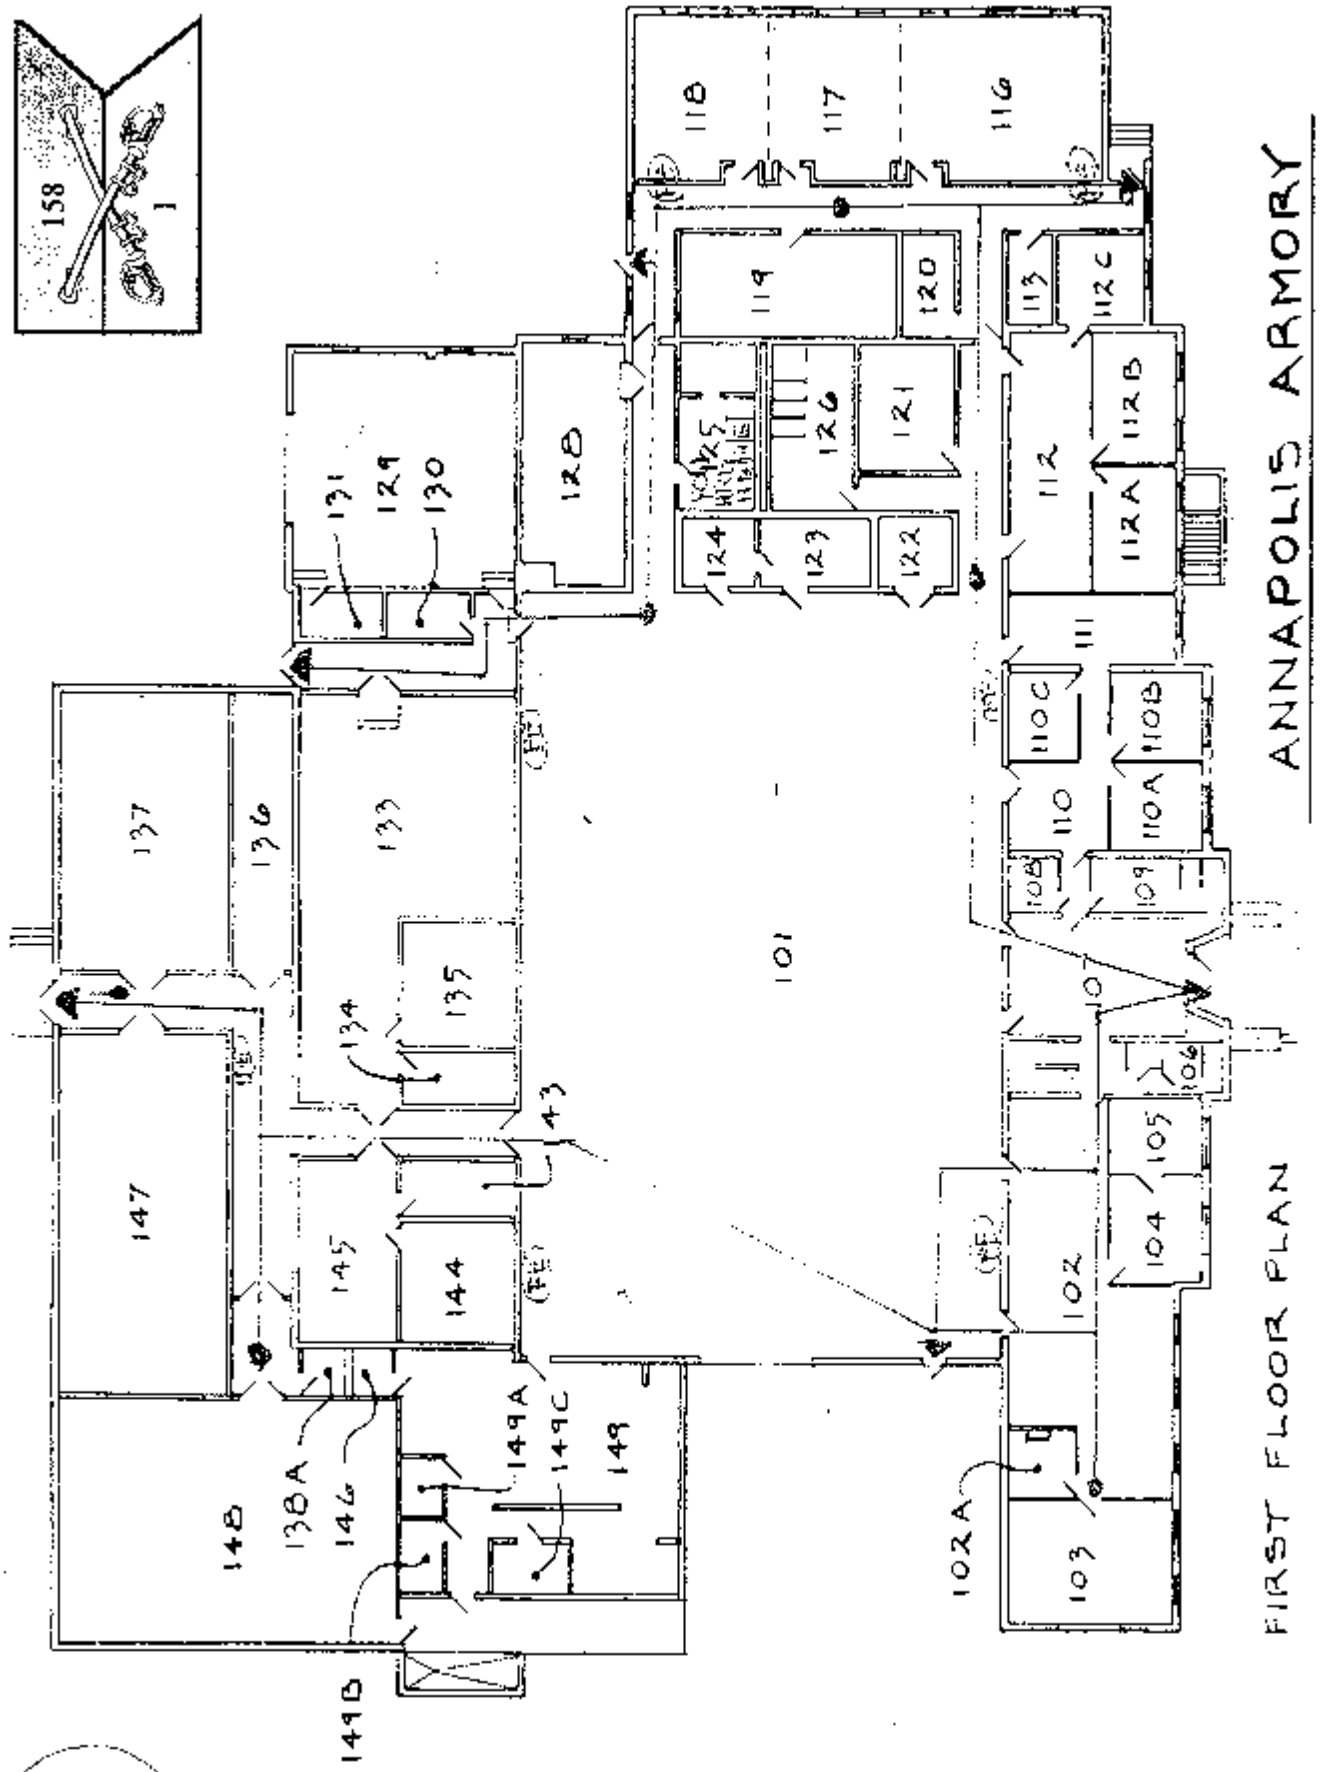
ANNAPOLIS ARMORY
FIRST FLOOR PLAN
101
102
102A
103
104
105
106
108
109
110
110A
110B
110C
111
112
112A
112B
112C
113
116
117
118
119
120
121
122
123
124
125
126
128
129
130
131
133
134
135
136
137
143
144
145
146
147
148
149
149A
149B
149C
138A
158

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. American National Standards Institute (ANSI) /American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227 (h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MEMORANDUM FOR Region North Industrial Hygiene Office (NGB-AVS-SI-IH/ Ms. Non-Responsive, Army National Guard Bureau, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, MG Boyd M Cook Armory, Cascade, MD, Project No. 55-ML-01ED-03/05

1. Enclosed is the final copy of the subject report and two CD-ROMs.

2. The project number for this service reflects the current fiscal year of dispatch and the actual field work which was completed for fiscal year 2003. The State of Maryland Army National Guard occupational health nurse was immediately notified in writing of findings necessitating immediate corrective action in Maryland armories. In addition, the National Guard Bureau Region North Industrial Hygiene Office has been notified of all the results of lead in dust sampling conducted in all facilities. Draft reports were reviewed by you or other members of the National Guard and members of this Center, including our editorial staff, during drafting stages in report preparation leading up to the final report.

3. Our point of contact is Ms. Non-Responsive at commercial 410-436-5475/3118, DSN 584-5475/3118, or electronic mail: Non-Responsive@us.army.mil

FOR THE COMMANDER:

Non-Responsive

Encl

Director, Occupational Health Sciences

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
MG BOYD M. COOK ARMORY, FORT RITCHIE
CASCADE, MD
PROJECT NO. 55-ML-01ED-03/05
12 AUGUST 2003

Approved for public release; distribution unlimited

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1351 of 5269

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03 ***(reverse)***

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
MG BOYD M. COOK ARMORY,
CASCADE, MD
PROJECT NO. 55-ML-01ED-03/05
12 AUGUST 2003

1. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee for the Defense Occupational and Environmental Health Readiness System.

2. CONCLUSIONS.

a. Lead in Dust. Levels of lead in dust that exceeded safe limits for children and adults were found in the armory. These levels may result in health hazards to employees and to children visiting the armory.

b. Safety Hazards. The leaking roof has caused damage to ceiling tiles. Employees are exposed to potential hazards from falling ceiling tiles or a collapsing ceiling, and to slip hazards from water on the floor.

c. Mold Exposure. Excessive moisture in the armory has caused mold growth. Mold exposure may cause illness in armory employees.

d. Ventilation. The exhaust fans were not working in the latrines and the locker rooms, and some exhaust fans may have never been installed. The ventilation may cause indoor air quality complaints.

3. RECOMMENDATIONS. The Department of Defense Instruction 6055.1 provides Risk Assessment Codes (RACs) for health hazards, a procedure which allows assessment of the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and

Printed on Recycled Paper
BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

combines the hazard severity and accident probability into a single number. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead Exposure. Health Hazard RAC 3 for adults. Health Hazard RAC 2 for children.

(1) Develop and implement a Lead Hazard Management Plan for the facility. Sample rooms adjacent to Indoor Firing Range (IFR) bullet trap area. Personnel working in the former IFR area were tracking lead out of the area and redistributing lead into adjacent rooms in the armory

(2) Restrict access to the former IFR (current storage room) by keeping it locked, until the facility can be cleaned. Post a sign warning against use of this room for storage or entry except in an emergency.

(3) If access to the storage room is not restricted, wear disposable gloves and coveralls as extra protection when working in areas identified as having elevated levels of lead.

(4) Discontinue advertising this facility for use by young children. Address all potential lead hazards before continuing to extend use of this facility to children. Clean the floor (s) in areas used by children to the Environmental Protection Agency lead in dust standards for young children, and clean other horizontal surfaces in areas used by children to the National Guard Bureau (NGB) Region North and U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) decontamination level for lead in dust on frequently contacted surfaces. Clean the administrative area horizontal surfaces that have elevated lead levels to the NGB Region North and USACHPPM recommended safe limit for floors and frequently contacted surfaces. See Appendix E for Lead cleaning guidance.

(5) Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements.

b. Safety Hazards. Safety Hazard RAC 3. Repair the roof leak and replace damaged ceiling tiles. The leaks should be inspected and repaired by a professional roofing contractor.

c. Mold Exposure. Health Hazard RAC 4. Remove and replace ceiling tiles with mold growth. Abate all areas of visible mold. For additional guidance on moisture control and mold remediation in the armory refer to USACHPPM TG 278, Industrial Hygiene/Preventive Medicine Mold Assessment Guides, and USACHPPM TG 277, Army Facilities Management Information Document on Mold Remediation Issues in Appendix F.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1354 of 5269

BEST AVAILABLE COPY

d. Ventilation. Health Hazard RAC 4. Investigate operating problems with air handling systems. Consider resurveying indoor air conditions in hot weather with system fully operational.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1355 of 5269

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys MG Boyd M. Cook Armory, Cascade, MD, Project No. 55-ML-01ED-03/05

TABLE OF CONTENTS

Paragraph Page

1. REFERENCES 1
2. PURPOSE OF EVALUATION 1
3. AUTHORITY 1
4. BACKGROUND INFORMATION 1
5. PHOTOGRAPHS 2
6. FACILITY EVALUATION 2
7. ASSESSMENT CRITERIA FOR LEAD 3
8. SAMPLING RESULTS, DISCUSSION AND CONCLUSIONS 3
9. RECOMMENDATIONS 4
10. ADDITIONAL ASSISTANCE 6

Appendices

A. REFERENCES A-1
B. PHOTOGRAPHS B-1
C. SAMPLING LOCATIONS AND LAB RESULTS C-1
D. ASSESSMENT CRITERIA FOR LEAD D-1
E. LEAD CLEANING GUIDANCE.....E-1
F. MOLD GUIDANCE.....F-1

Table

TABLE LEAD IN SURFACE DUST WIPE LOCATIONS AND ANALYTICAL RESULTS.....4

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1356 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
MG BOYD M. COOK ARMORY
CASCADE, MD
PROJECT NO. 55-ML-01ED-03/05
12 AUGUST 2003

1. REFERENCES. See Appendix A.

2. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee for the Defense Occupational and Environmental Health Readiness System.

3. AUTHORITY. Fax, National Guard Bureau (NGB) Region North Industrial Hygiene Office (NGB-AVS-SI-IH/Ms. Non-Responsive), 28 February 2003, subject: SAB.

4. BACKGROUND INFORMATION.

a. Armory Mission and Units. The armory mission is long range surveillance. The resident units include the Detachment 1, Company B, 129th Signal Battalion; Detachment 1, Company B, 1st Battalion, 115th Infantry Regiment; Company E, 629th Military Intelligence Battalion; and 129th Infantry Detachment.

b. Date of Construction. The date of construction of the building is 1994.

c. Armory Use by Children. The points of contact (POCs) stated that children occupy the armory during family support group activities, including Christmas dinners. The Maryland Military Department is currently advertising MG Boyd M. Cook Armory as available for rental for activities that include young children.

d. POCs. SFC Non-Responsive and SFC Non-Responsive MG Boyd M. Cook Armory, 13817 Ritchie Road, Cascade, MD 21719.

Printed on Recycled Paper
BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

5. PHOTOGRAPHS. See Appendix B.

6. FACILITY EVALUATION.

a. Sampling Locations and Results. Samples were collected for lead on surfaces, (wipe samples), to determine the presence of lead hazards. Lead sample results and locations are shown in Appendix C.

b. Paint. A POC stated that there was no lead-based paint in the facility. The age of the buildings indicated that the presence of lead-based paint was unlikely.

c. Asbestos. A POC stated that there was no asbestos in the facility. The age of the building indicated that the use of asbestos-containing building material was unlikely.

d. Building Physical Condition. There was structural damage on the wall in Room 111 due to the building settling. SFC Agnew said that building engineers and facility managers had evaluated the facility and stated that the building was still settling and this damage did not pose a safety hazard. The armory roof was flat, and a POC reported that it leaked when it rained. At the time of the survey there was leaking water around all the roof drains.

e. Safety Hazards. The facility was aging and the roof had leaked for several years.

f. Mold and Moisture Problems (Photographs 1488 and 1493, Appendix B). There was mold growth on ceiling tiles due to a leaking roof. There were also water damaged ceiling tiles in the office area and hallway near Room 110.

g. Indoor Firing Range. The indoor firing range (IFR) had been converted to a parachute storage room. Lead contamination was reported to have been abated.

h. Safety and Occupational Health Programs. There were no safety or occupational health program documents available in the armory.

i. Heating, Ventilation, and Air-Conditioning Systems. There was central heating and air-conditioning. The building was heated with steam heat. At the time of the survey the air conditioning was not working. The exhaust fans in the male and female latrines and the locker rooms were not working. Ventilation measurements were not in the scope of the survey.

j. Indoor Firing Range. The IFR had been closed, all lead abated, and cleaned.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1358 of 5269

k. Noise Dosimetry. No operations with the potential to generate hazardous noise levels were identified.

l. Lighting. All areas were visually judged to be adequately lit.

7. ASSESSMENT CRITERIA FOR LEAD. See Appendix D for details.

a. Lead in Air. The Army complies with the Occupational Safety and Health Administration 8-hour time-weighted average Permissible Exposure Limit of 50 micrograms of lead per cubic meter ($\mu g/m^3$) of air.

b. Lead in Dust. The Environmental Protection Agency (EPA) and State of Maryland limits for lead in dust are 40 micrograms per square foot ($\mu g/ft^2$) on floors, 250 $\mu g/ft^2$ on window sills, and 400 $\mu g/ft^2$ in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The NGB Region North concurs with the U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended safe limit of 200 $\mu g/ft^2$ on floors and frequently contacted surfaces, which is more stringent for window sills than the EPA/State standards.

c. Lead in Paint. Paint containing lead levels of 0.5 percent or more by weight in dried solid (also reported as 5000 milligrams per kilogram) is considered to be lead-based paint according to regulations. Paint containing lead levels of more than 0.7 milligrams per square centimeter is considered to be lead-based paint according to Maryland State Regulations. In Army Regulation 420-70, Buildings and Structures, lead-contaminated paint is defined as any paint containing detectable amounts of lead. The Army considers lead-contaminated paint to be potentially hazardous to children if it is disturbed or deteriorating.

d. Lead Carcinogenicity. The Department of Health and Human Services National Toxicology Program (NTP) released the Report on Carcinogens, Eleventh Edition in February 2005. The NTP report lists “lead and lead compounds” as “reasonably anticipated to be human carcinogens”.

8. SAMPLING RESULTS, DISCUSSION, AND CONCLUSIONS.

a. Paint. The paint was intact and in good condition.

b. Lead in Dust. Lead in dust sample locations and analytical results are shown in the report Table below. Levels of lead in dust that exceeded safe limits for children and adults were identified in the former IFR bullet trap. One lead in dust wipe sample result had extremely high levels of lead and exceeded the NGB Region North and USACHPPM recommended decontamination levels and the EPA lead exposure level for children, indicating that the IFR had

BEST AVAILABLE COPY

not been completely cleaned. Personnel in this room are potentially exposed to lead, and are tracking lead out of the area and redistributing lead into adjacent rooms in the armory. This can result in lead exposures for children visiting this facility and for the general workforce.

TABLE. Lead in Surface Dust Wipe Locations and Analytical Results.

Wipe Sample #	Locations of Samples	Conc. (µg/ft²)
CDW01	Former IFR bullet trap area	2909
CDW02	Former IFR midway on floor near sleeping area	<23
CDW03	Floor near exit door to outside	<23
CDW04	Floor about one foot from entrance door to new tile floor	<23

9. RECOMMENDATIONS. The Department of Defense Instruction 6055.1 provides Risk Assessment Codes (RACs) for health hazards, a procedure which allows assessment of the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single number. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead Exposure. Health Hazard RAC 3 for adults. Health Hazard RAC 2 for children.

(1) Develop and implement a Lead Hazard Management Plan for the facility. Sample areas adjacent to the IFR bullet trap area.

(2) Restrict access to the former IFR (current storage room) by keeping it locked, until the facility can be cleaned. Post a sign warning against use of this room for storage or entry except in an emergency.

(3) If access to the storage room is not restricted, wear disposable gloves and coveralls as extra protection when working in areas identified as having elevated levels of lead.

(4) Discontinue advertising this facility for use by young children. Address all potential lead hazards before continuing to extend use of this facility to children. Clean the floor (s) in areas used by children to the EPA lead in dust standards for young children, and clean other horizontal surfaces in areas used by children to the NGB Region North and USACHPPM decontamination level for lead in dust on frequently contacted surfaces. Clean the administrative area horizontal surfaces that have elevated lead levels to the NGB Region North and

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1360 of 5269

BEST AVAILABLE COPY

USACHPPM recommended safe limit for floors and frequently contacted surfaces. See Appendix E for Lead cleaning guidance.

(5) Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements.

b. Safety Hazards. Safety Hazard RAC 3. Repair the roof leak and replace damaged ceiling tiles. The leaks should be inspected and repaired by a professional roofing contractor.

c. Mold Exposure. Health Hazard RAC 4. Remove and replace ceiling tiles with mold growth. Abate all areas of visible mold. For additional guidance on moisture control and mold remediation in the armory refer to USACHPPM TG 278, Industrial Hygiene/Preventive Medicine Mold Assessment Guides, and USACHPPM TG 277, Army Facilities Management Information Document on Mold Remediation Issues in Appendix F.

d. Ventilation. Health Hazard RAC 4. Investigate operating problems with air handling systems. Consider resurveying indoor air conditions in hot weather with systems fully operational.

10. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by Electronic to: Non-Responsive@us.army.mil

Non-Responsive

Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive

Technical Program Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1361 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1362 of 5269

APPENDIX A

REFERENCES

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current edition.
http://www.osha.gov/comp-links.html

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998.
http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990.
http://www.usapa.army.mil/pdffiles/r40_5.pdf

4. AR 385-10, The Army Safety Program, 29 February 2000.
http://www.usapa.army.mil/pdffiles/r385_10.pdf

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000.
http://www.usapa.army.mil/pdffiles/p40_503.pdf

6. American Conference of Governmental Industrial Hygienists (ACGIH), Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), ACGIH Cincinnati, OH, 2005.
http://www.acgih.org/TLV/

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. Illuminating Engineering (February 1, 1993) RP-1-1993, American National Standard Practice for Office Lighting, ANSI/IES RP-1-1993.

9. USACHPPM Interim Report No. 39-EJ-1157-99, Derivation of Wipe Surface Screening Levels for Environmental Chemicals, 1999.

10. OSHA Instruction, CPL 02-02-058 - CPL 2-2.58 - 29 CFR 1926.62, Lead Exposure In Construction; Interim Final Rule-- Inspection and Compliance, Procedures, 1993.
http://www.osha.gov/pls/oshaweb/owadisp.show_document?p_table=DIRECTIVES&p_id=1570

11. U.S. Department of Housing and Urban Development (HUD), Technical Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing 1998.
http://www.hud.gov/offices/lead/guidelines/hudguidelines/index.cfm

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1363 of 5269

BEST AVAILABLE COPY

APPENDIX B

PHOTOGRAPHS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1364 of 5269

MG Boyd M. Cook Armory, Cascade, MD Armory Photographs

Photograph Number	Location
1488	Mold growth on ceiling tile
1489	Former IFR bullet trap/Lead in dust sampling/ high levels of lead
1490	Former IFR midway on floor near sleeping area/ Lead in dust sampling
1491	Exit door floor area/ Lead in dust sampling
1492	Floor one foot from entrance door to new tile floor/ Lead in dust sampling
1493	Dining area/ Mold on ceiling
1494	Room 11 structural damage
1495	Water damaged tiles in office area and hallway near Room 110

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1365 of 5269

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1370 of 5269

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1373 of 5269

BEST AVAILABLE COPY

APPENDIX C

SAMPLING SHEETS AND LAB ANALYSES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1374 of 5269

Lead Sample Results for Cascade

			Indoor Range Info					
Wipe Sample #	Armory	City	Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
			No			Yes		
CDW01	Cascade	Ft. Ritchie					Former IFR baffle	2909
CDW02	Cascade	Ft. Ritchie					Former IFR midway on floor near sleeping area	<23
CDW03	Cascade	Ft. Ritchie					Floor near Exit Door to outside	<23
CDW04	Cascade	Ft. Ritchie					Floor about one foot from entrance door to new tile floor	<23

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1375 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

August 25, 2003

Laboratory Code:	**RES**
Subcontract Number:	**NA**
Laboratory Report:	**RES 96610-1**
Project Description:	**None Given Cascade MD and Anapolis MD**

Non-Responsive

Army National Guard IH - West
3401 Quebec Street, Suite 7200
Denver CO 80207

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the American Industrial Hygiene Association, Lab ID 101533 - Accreditation Certificate #480. The laboratory is currently proficient in both PAT & ELPAT programs respectively.

Reservoirs has analyzed the following sample(s) using Atomic Emission Spectroscopy - Inductively Coupled Plasma (AES-ICP) per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the analysis table. Results have been sent to your office.

RES 96610-1 is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those authorized by the client. Samples will be disposed of after sixty days unless longer storage is requested. If you should have any questions about this report, please feel free to call me at 303-964-1986.

Sincerely,

Non-Responsive

President

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1376 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	**RES 96610-1**
Client:	**Army National Guard IH - West**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**Cascade MD and Anapolis MD**
Date Samples Received:	**August 19, 2003**
Analysis Type:	**USEPA SW846 3050B / AA(7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 22, 2003**

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
CDBLANK1	EM 806468	0.11	BDL	23	BDL
CDW01	EM 806469	0.11	320.0	23	2909
CDW02	EM 806470	0.11	BDL	23	BDL
CDW03	EM 806471	0.11	BDL	23	BDL
CDW04	EM 806472	0.11	BDL	23	BDL
APBLANK1	EM 806473	0.11	BDL	23	BDL
APW01	EM 806474	0.11	5.0	23	45
APW02	EM 806475	0.11	17.0	23	155
APW03	EM 806476	0.11	BDL	23	BDL

***Calculations Based On A 1 sq.ft. Sample Area Unless Otherwise Noted**

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1377 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

August 25, 2003

Laboratory Code:	**RES**
Subcontract Number:	**NA**
Laboratory Report:	**RES 96610-1**
Project Description:	**None Given Cascade MD and Anapolis MD**

Non-Responsive

Army National Guard IH - West
3401 Quebec Street, Suite 7200
Denver CO 80207

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the American Industrial Hygiene Association, Lab ID 101533 - Accreditation Certificate #480. The laboratory is currently proficient in both PAT & ELPAT programs respectively.

Reservoirs has analyzed the following sample(s) using Atomic Emission Spectroscopy - Inductively Coupled Plasma (AES-ICP) per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the analysis table. Results have been sent to your office.

RES 96610-1 is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those authorized by the client. Samples will be disposed of after sixty days unless longer storage is requested. If you should have any questions about this report, please feel free to call me at 303-964-1986.

Sincerely,

Non-Responsive

President

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1378 of 5269

BEST AVAILABLE COPY

APPENDIX D

NATIONAL GUARD BUREAU REGION NORTH INDUSTRIAL HYGIENE OFFICE

ASSESSMENT CRITERIA FOR LEAD

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1379 of 5269

SUBJECT: National Guard Bureau Region North Industrial Hygiene Office
Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 µg/ft². This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. The EPA standards (40 CFR 745.227(e) (8) (viii)) and State of Maryland standards are not directly applicable because they are developed for floors (40 µg/ft²), windowsills (250 µg/ft²)and window troughs (400 µg/ft²) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. The OSHA has no specific requirement for work area surfaces. The OSHA lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. The OSHA cites a level of 200 µg/ft² in OSHA Instruction CPL 2-2.58 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 µg/ft² is a safe surface contamination level for adult exposures. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels higher than those recommended above do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All States will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 50 µg/m³ averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1380 of 5269

BEST AVAILABLE COPY

APPENDIX E

LEAD CLEANING GUIDANCE

HUD TECHNICAL GUIDELINES FOR THE EVALUATION AND CONTROL OF LEAD-BASED PAINT HAZARDS IN HOUSING 1998

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1381 of 5269

BEST AVAILABLE COPY

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1382 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1383 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1384 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1385 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1386 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1387 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1388 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1389 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

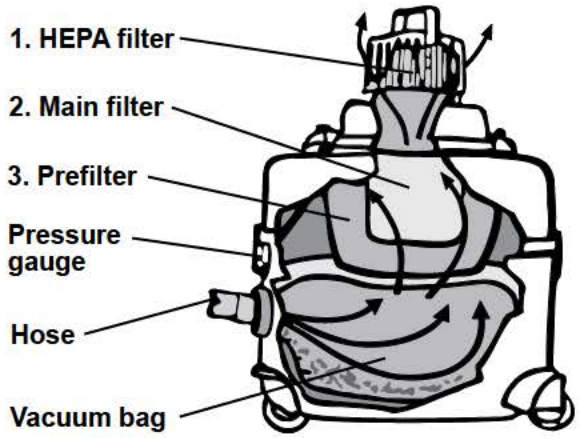

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

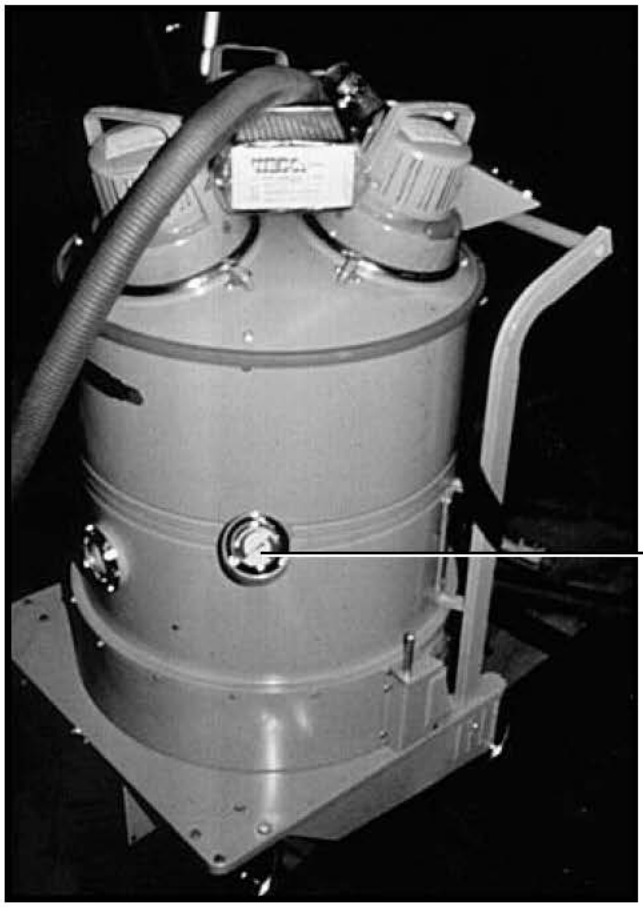

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1390 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

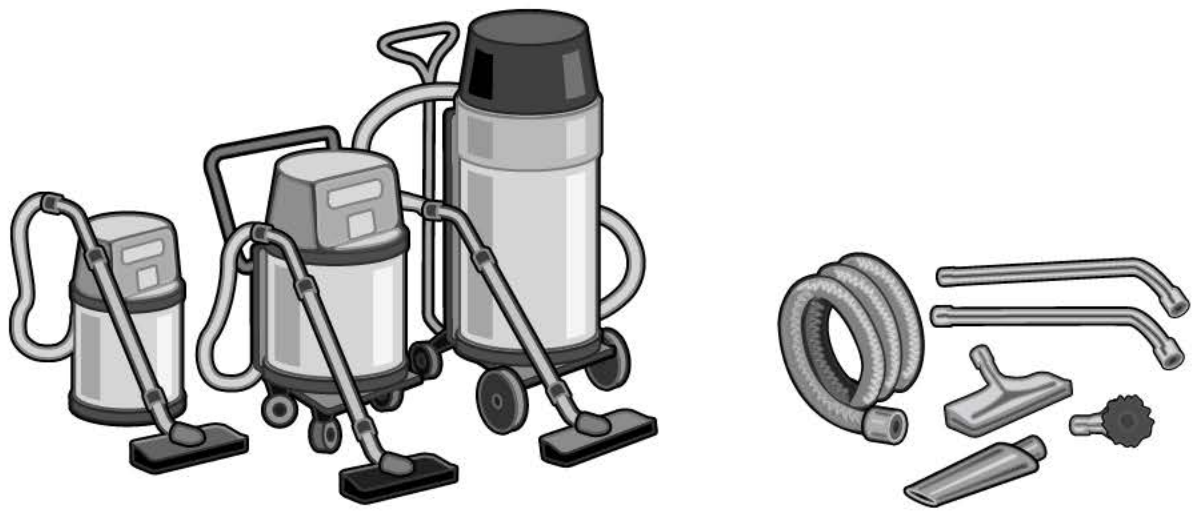

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1391 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

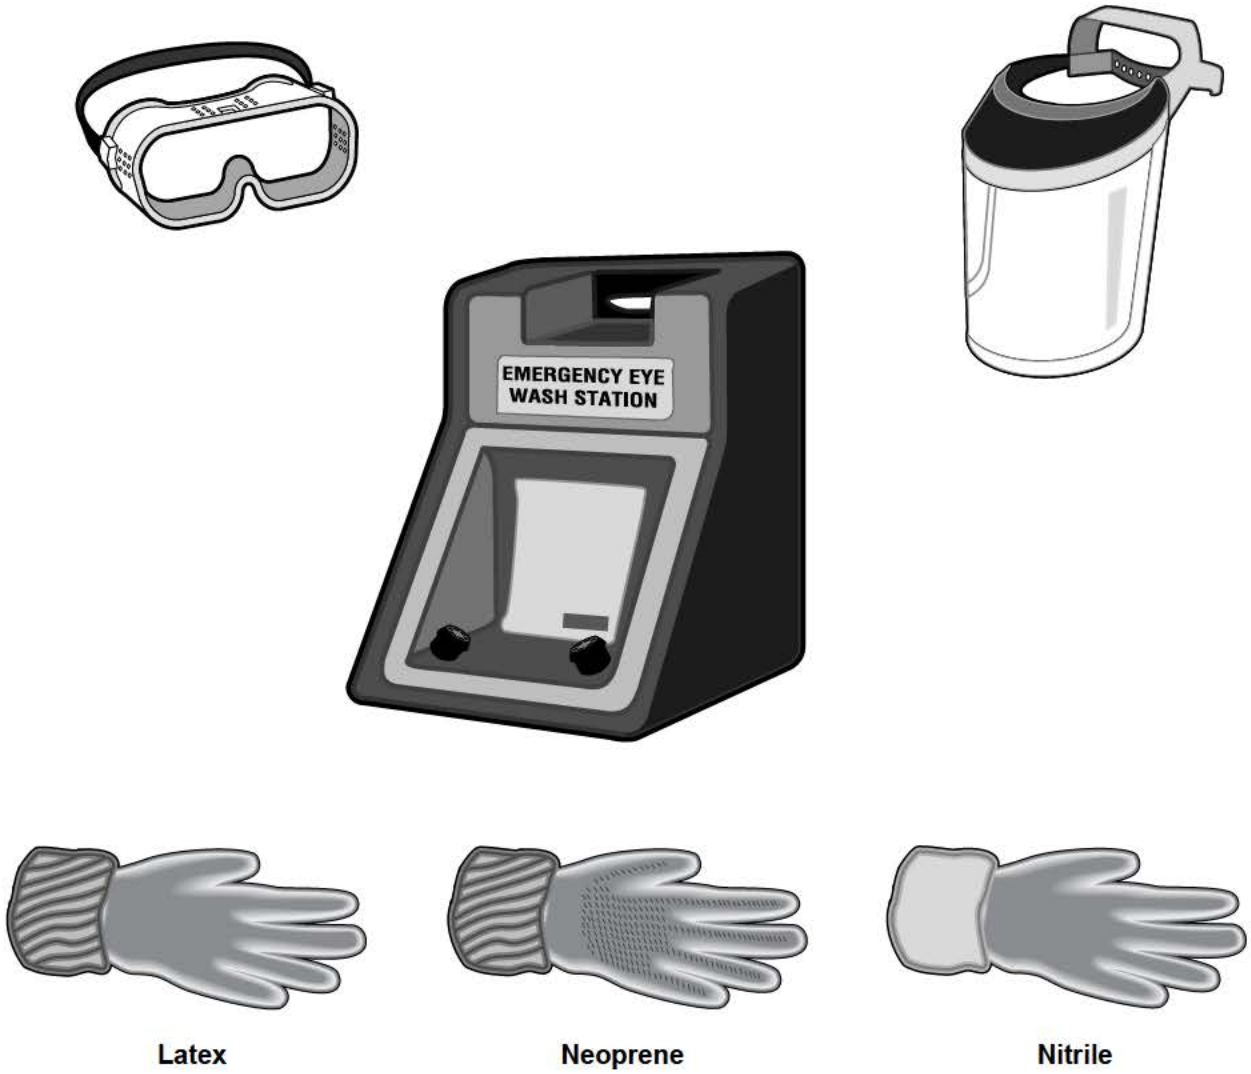

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1392 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

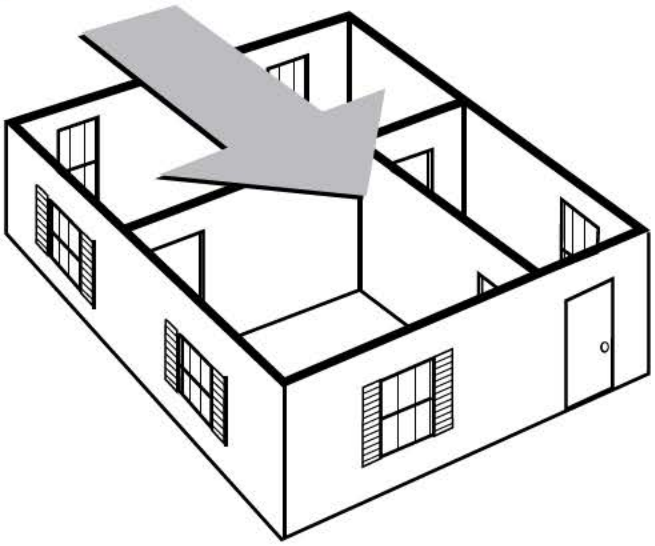

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

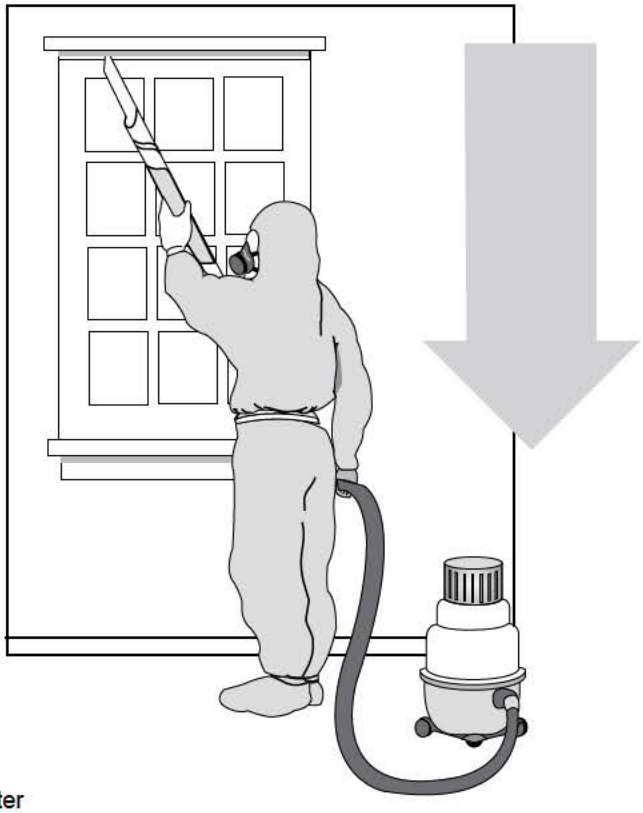

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1393 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1394 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

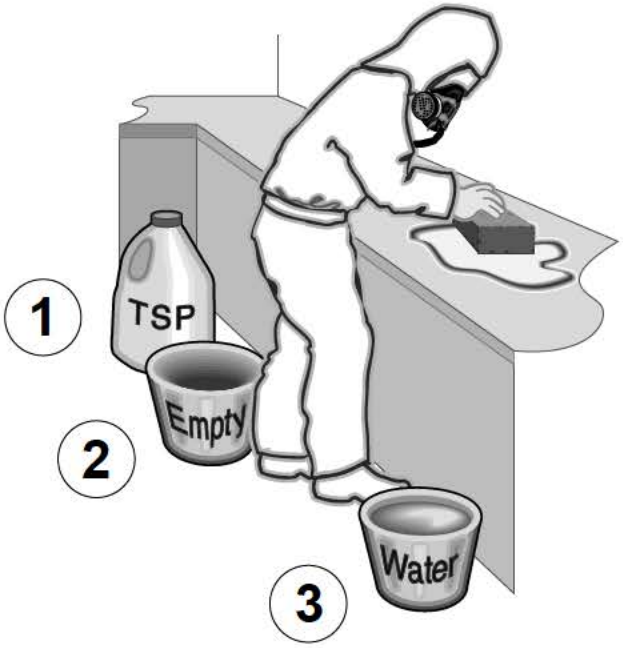

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1395 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

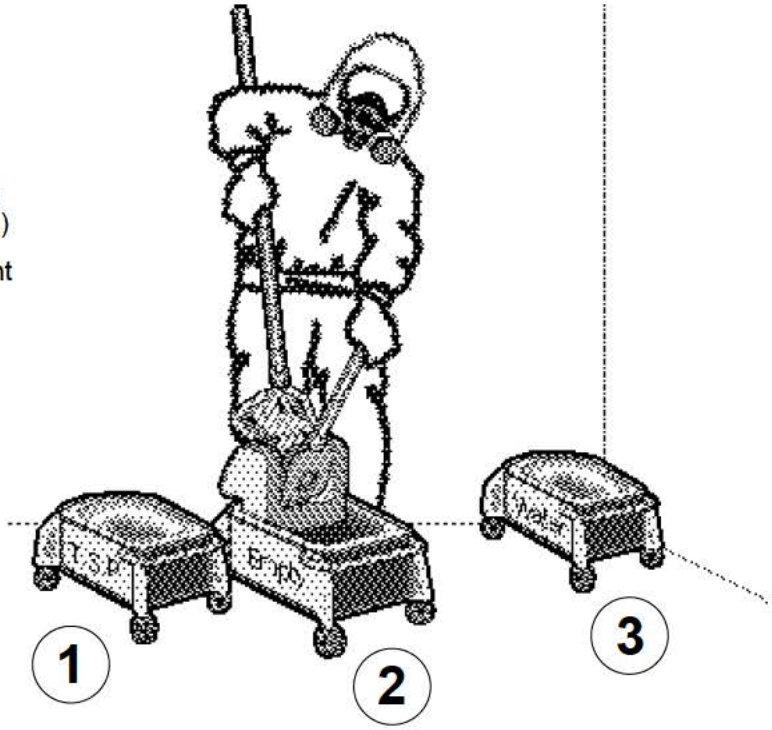

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

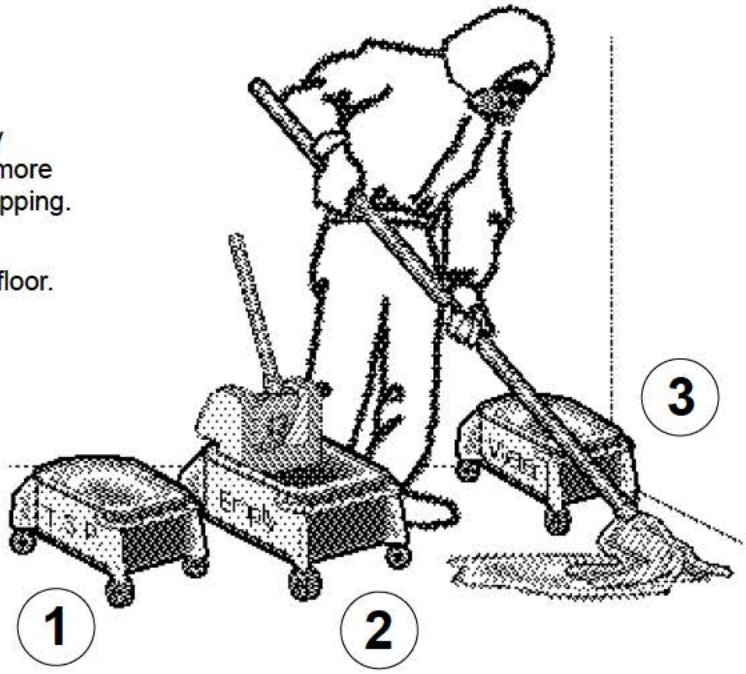

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1396 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

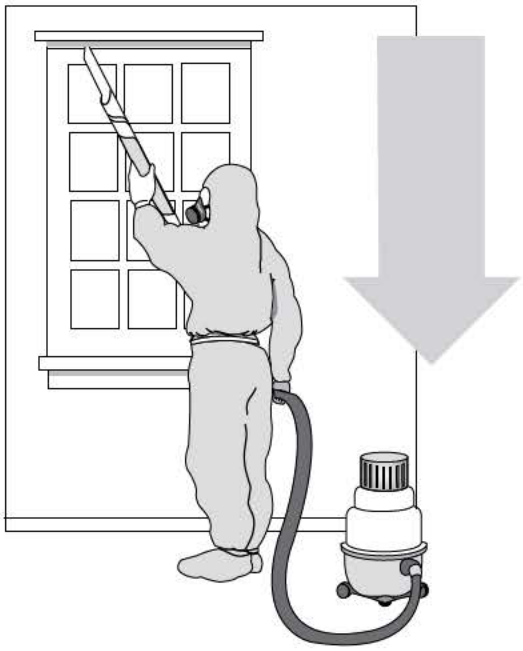

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1397 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1398 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1399 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1400 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1401 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1402 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1403 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1404 of 5269

BEST AVAILABLE COPY

APPENDIX F

MOLD GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1405 of 5269

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1406 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1408 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1409 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet** - e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1410 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1411 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1412 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1413 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1414 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1415 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1416 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1417 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1418 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1419 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1420 of 5269

BEST AVAILABLE COPY

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1421 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1422 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1423 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1424 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1425 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1426 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1427 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1428 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1429 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1431 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1432 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1433 of 5269

MOLD INVESTIGATION DECISION LOGIC

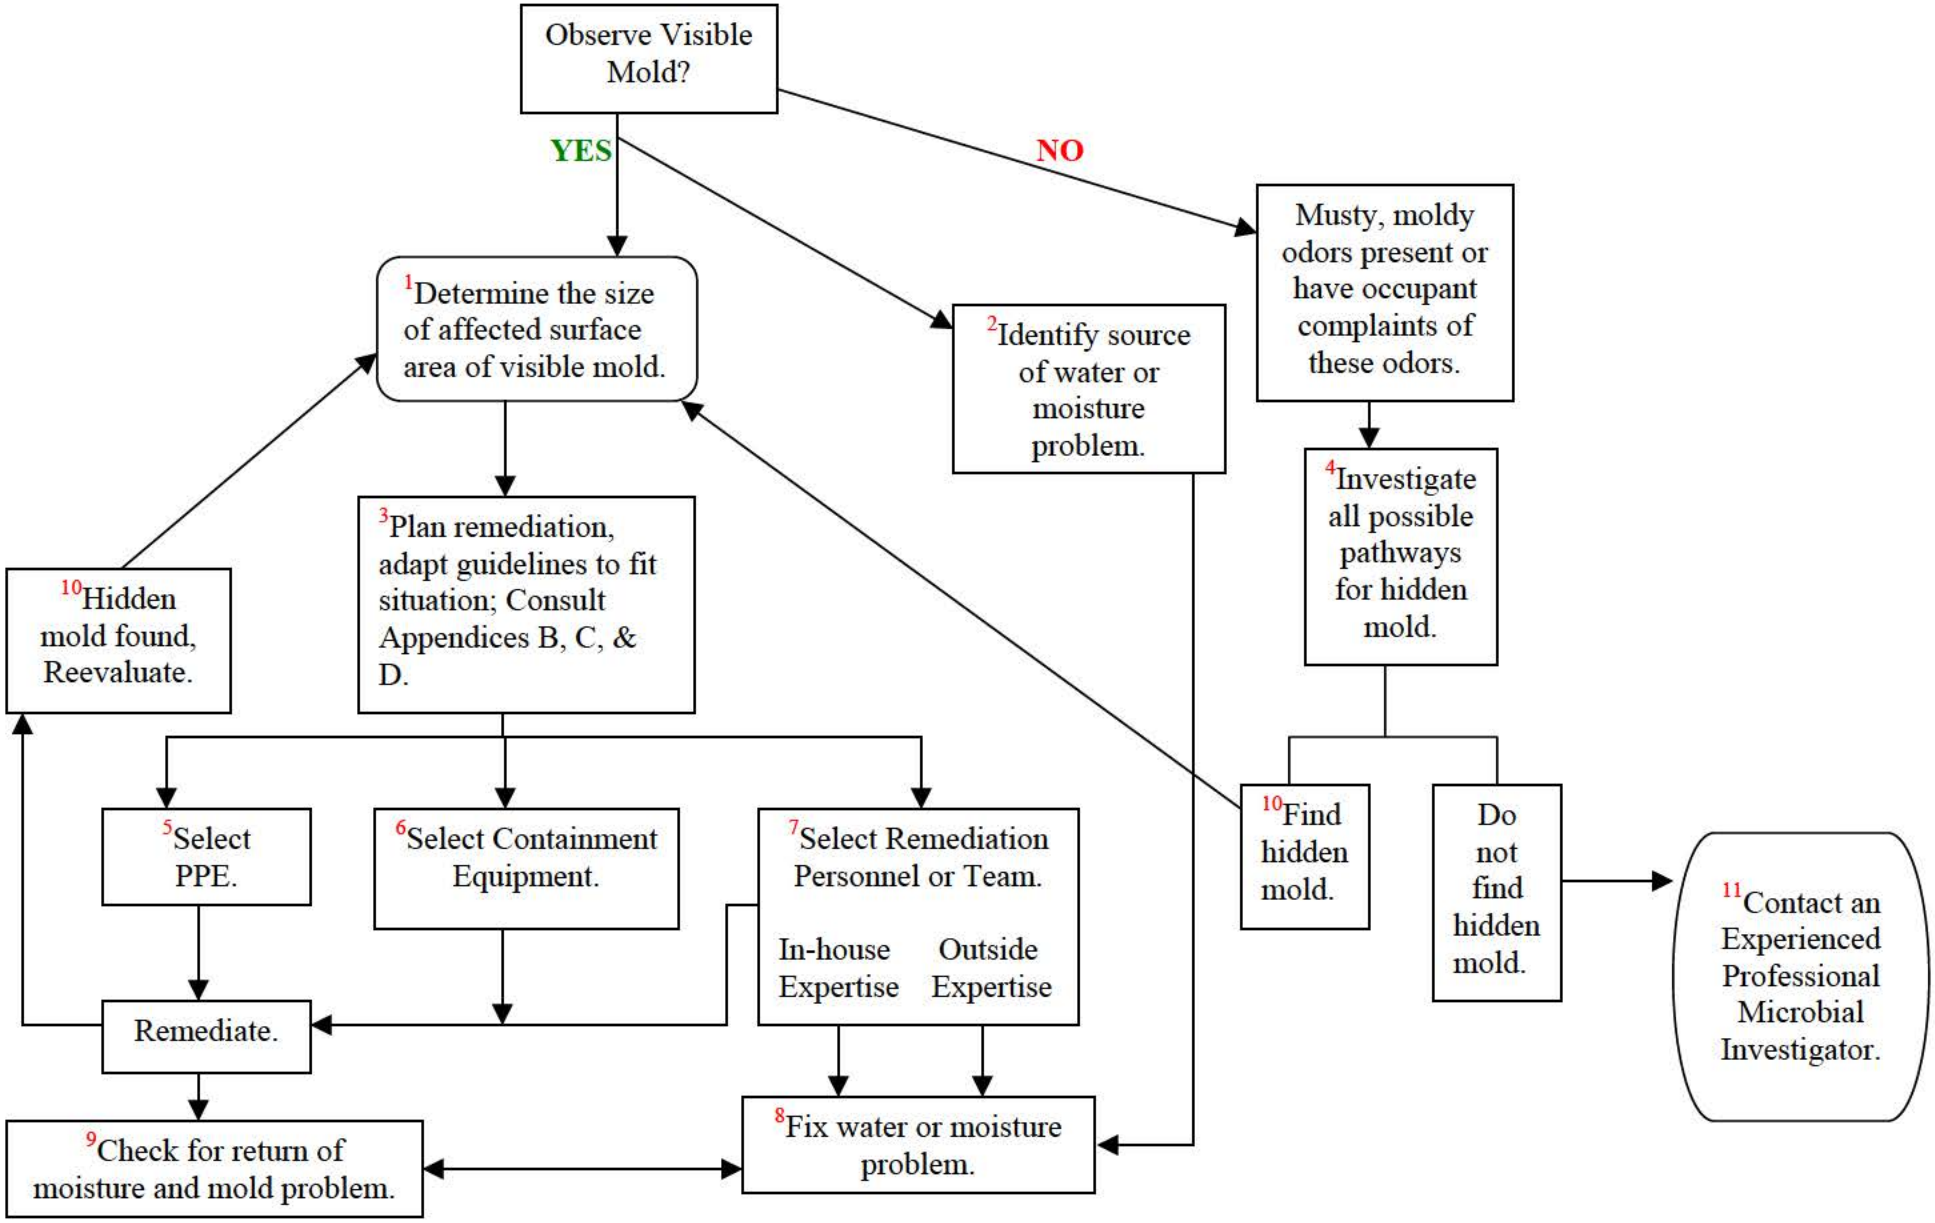

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1435 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1436 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1437 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1438 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1439 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1440 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1441 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1442 of 5269

BEST AVAILABLE COPY

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Cascade City Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Cascade Readiness Center** **13817 Ritchie Road** **Cascade, MD 21719**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**June 21, 2013**
Report Date:	**July 31, 2013**

[redacted]

Manager, Industrial Hygiene Services

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on June 21, 2013, at the Cascade Readiness Center located at 13817 Ritchie Road, Cascade, MD 21719. The survey was performed by Mr. Non-Responsive

1. Lead surface and air samples were collected. Sample results were below recommended guidelines and/or regulator standards. See Section 3.0 for detailed sampling results.

2. Lighting levels did not meet the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in two locations measured. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in two areas sampled.

    b. The relative humidity levels did not meet the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60% in any occupied areas sampled.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 ppm.

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2010 recommended guidelines for mechanically ventilated office buildings and commercial settings.

    See Section 5.0 for detailed sampling results.

4. Drill Hall doors were propped open during the survey. See Section 5.0 for detailed findings.

5. No suspect asbestos containing materials (ACM) were observed. See Section 6.0 for detailed sampling results.

Section 2.0 Operation Description & Observations

The Cascade Readiness Center is mainly an administrative facility with a drill hall, offices, classrooms, and a converted firing range area (currently the Parachute Packing Room). There were approximately 5 full-time employees stationed at this facility at the time of this survey. There is no maintenance personnel assigned to the building.

The 18,400 square foot building is reported to have been built in 1994. It is a single story structure. The exterior is brick and block. The interior walls are block and drywall. The floors are concrete, 12”x12” floor tiles, and carpet.

The heating system is a switchable (oil/gas) forced hot water unit. There appears to be two air conditioning (A/C) systems employed: three roof-top units and room unit ventilators.

There is no child-care facility in the building.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

This facility has a converted firing range (CFR) that is now used as the Parachute Packing Room. There was no access to the room at the time of this survey.

No suspect asbestos containing material (ACM) was observed.

No chipped or peeling paint were observed.

Housekeeping is adequate.

It was reported that the building has a history of roof leaks.

Several water-stained ceiling tiles were observed in four areas: Kitchen Corridor, Administration Corridor, Drill Hall Entranceway, and the Dining Room (fungal growth was observed on these tiles).

Several areas of chipped floor tiles were observed in the Kitchen Corridor.

During this survey, the Drill Hall doors were propped open allowing warm, moist air to enter the building.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Drill Hall	<6.8	*
2	Orderly Room	<6.7	*
3	Blank	<3 ug	*
4	Blank	*	<12 ug
5	Drill Hall Floor Center	*	<110
6	Drill Hall Cabinet Top	*	<110
7	Drill Hall Electrical Panel Top	*	<110
8	Kitchen Microwave Top	*	<110
9	Kitchen Floor	*	<110
10	Dining Area Window Sill	*	<110
11	Storage 106 Cabinet Top	*	<110
12	Lobby Floor	*	<110
13	Office 113 Window Sill	*	<110
14	Office 111 Window Sill	*	<110
15	Office 108 Cabinet Top	*	<110
16	Office 141 Window Sill	*	<110
-	**Criteria**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges
2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in

NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels for lead were less than the recommended guideline of 200 ug/ft^2 in all locations sampled.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98082EL). The light meter was last calibrated in April 2013. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Drill Hall	30.8	10	Yes
Bulk Storage 106	21.3	10	Yes
Supply Room	**22.2**	**30**	**No**
Office 113	92.5	30-50	Yes
Office 111	130.1	30-50	Yes
Office 112	78.9	30-50	Yes
Office 115	82.1	30-50	Yes
Administrative Corridor	19.8	5	Yes
Classroom 108	64.8	30-50	Yes
Lobby	32.1	10	Yes
Kitchen Corridor	24.7	5	Yes
Mechanical Room	46.1	30	Yes
Latrine	42.2	5	Yes
CFR Corridor	27.5	5	Yes
Kitchen (prep)	148.4	50	Yes
Dining Room/Classroom	30.3	30-50	Yes
Men's Latrine 123	48.2	5	Yes
Women's Latrine	49.7	5	Yes
Gym	39.1	30	Yes
Office 118	**16.5**	**30-50**	**No**
Office 139	49.8	30-50	Yes
Office 141	53.7	30-50	Yes
Office 105	69.3	30-50	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting levels did not meet the minimum recommended guideline in Office 118 and the Supply Room.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	73.2	48.4	342	0.0
Office 111	72.8	53.5	448	0.0
Criteria	**68-79**	**30-60**	**<1,042**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements met the recommended 68-79°F in all sampled areas.
- Relative humidity levels met the recommended guideline of 30 – 60 % in all sampled areas.
- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level. For this survey, carbon dioxide levels did not exceed the recommended ceiling of

1,042 ppm (700 ppm + 342 ppm). This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observation were noted:

  1. Structural damage to walls in Office 111 was observed. This type of damage can be the source of water intrusion and elevated humidity.

  2. Water-stained ceiling tiles were observed in the Kitchen Corridor, Administration Corridor, Drill Hall Entrance, and Dining Room. Visible growth was observed on the water-stained tiles in the Dining Room.

  3. Drill Hall doors were propped open during the site survey allowing warm, moist air to infiltrate the facility. This practice allows warm moist air and potentially degraded air (mower exhaust, dust, etc.) to enter the building.

  4. It was reported that the roof leaks in several places.

  5. Several floor tiles in the Kitchen Corridor are cracked and loose. These should be repaired.

Section 6.0 Suspect Asbestos Containing Building Materials (ACM)

No suspect (ACM) (asbestos containing material) was noted at the time of this survey:

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98002EL	4/2013	NA
SKC Air Sampling Pump	647631	6/21/13	2.46 LPM
SKC Air Sampling Pump	767926	6/21/13	2.47 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG 4a MD	**Chain Of Custody:**	516189
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cascade	**Date Submitted:**	6/25/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/2/2013 **Report Date:** 7/2/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13073125	1	Flame	Air	443	N/A	6.8	ug/m³	<3	<6.8	ug/m³	
13073126	2	Flame	Air	445	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13073127	3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
13073128	4	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
13073129	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073130	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073131	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073132	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073133	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073134	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073135	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073136	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073137	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073138	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073139	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13073140	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG 4a MD	**Chain Of Custody:**	516189
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cascade	**Date Submitted:**	6/25/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/2/2013 **Report Date:** 7/2/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: Nida McGarvey

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516189

1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG 4a MD
2. Job Location: CASCADE
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Perso Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] nature: Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ ~~5 Day~~ + Date Due: 7/2/13 ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: dlarson@compliance place.com ☐ Fax: shirley.chapman1@us.army.mil ☐ Verbals: ken.forsythe@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type GOHOST) 13 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb____(QTY) ☐ Cu____(QTY) ☐ As____(QTY)
- ☐ Waste Water ☐ Pb____(QTY) ☐ Cu____(QTY) ☐ As____(QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY) Date/Time: Contact: By:
1 DRILL HALL		6/21/13	443					✓		✓							
2 ORDERLY RM			445					✓		✓							
3 BLANK			—					✓		✓							
4 BLANK				—				✓				✓					
5 DRILL HALL	FLOOR CENTER			100cm²				✓				✓					Date/Time: Contact: By:
6 DRILL HALL	Cabinet TOP							✓				✓					
7 DRILL HALL	Elect. Panel TOP							✓				✓					
8 KITCHEN	MICROWAVE TOP							✓				✓					
9 KITCHEN	FLOOR							✓				✓					Date/Time: Contact: By:
10 DINING AREA	Window Sill							✓				✓					
11 STOR 106	File CABINET TOP							✓				✓					
12 LOBBY	FLOOR											✓					

LOT 3/23/12
EXP 9/15

LABORATORY STAFF ONLY:
1. Date/Time RCVD: 6 / 25 / 13 @ 940 Via: Fedex By (Print): [illegible] Sign: [illegible]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

(CUSTODY)

BEST AVAILABLE COPY

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) S16189 2 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG 4aMD
2. Job Location: CASCADE
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Perso[redacted] @ phone #: (410) 942-0273
5. Submitted by [redacted]gnatur[redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: dlarson @complianceplace.com ☐ Fax: shirley.chapman1@us.army.mil ☐ Verbals: ken.forsythe@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type Cotton) 13 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY) Date/Time: Contact: By:
13	OFFICE 113	6/21/13		100cm²				✓				✓					
14	OFFICE 5/UM.							✓				✓					
15	OFFICE 108							✓				✓					
16	OFFICE 141							✓				✓					
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY:
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Appendix B. Photographs

Cascade RC

Structural Wall Damage in Office 111

Water Stained Ceiling Tile

Ceiling Tile Visible Fungal Growth

Drill Hall Open Door

Boiler Room

No Access to Converted Firing Range

Damaged Floor Tiles in Corridor

Appendix C. Floor Plan

EVACUATION PLAN

BEST AVAILABLE COPY

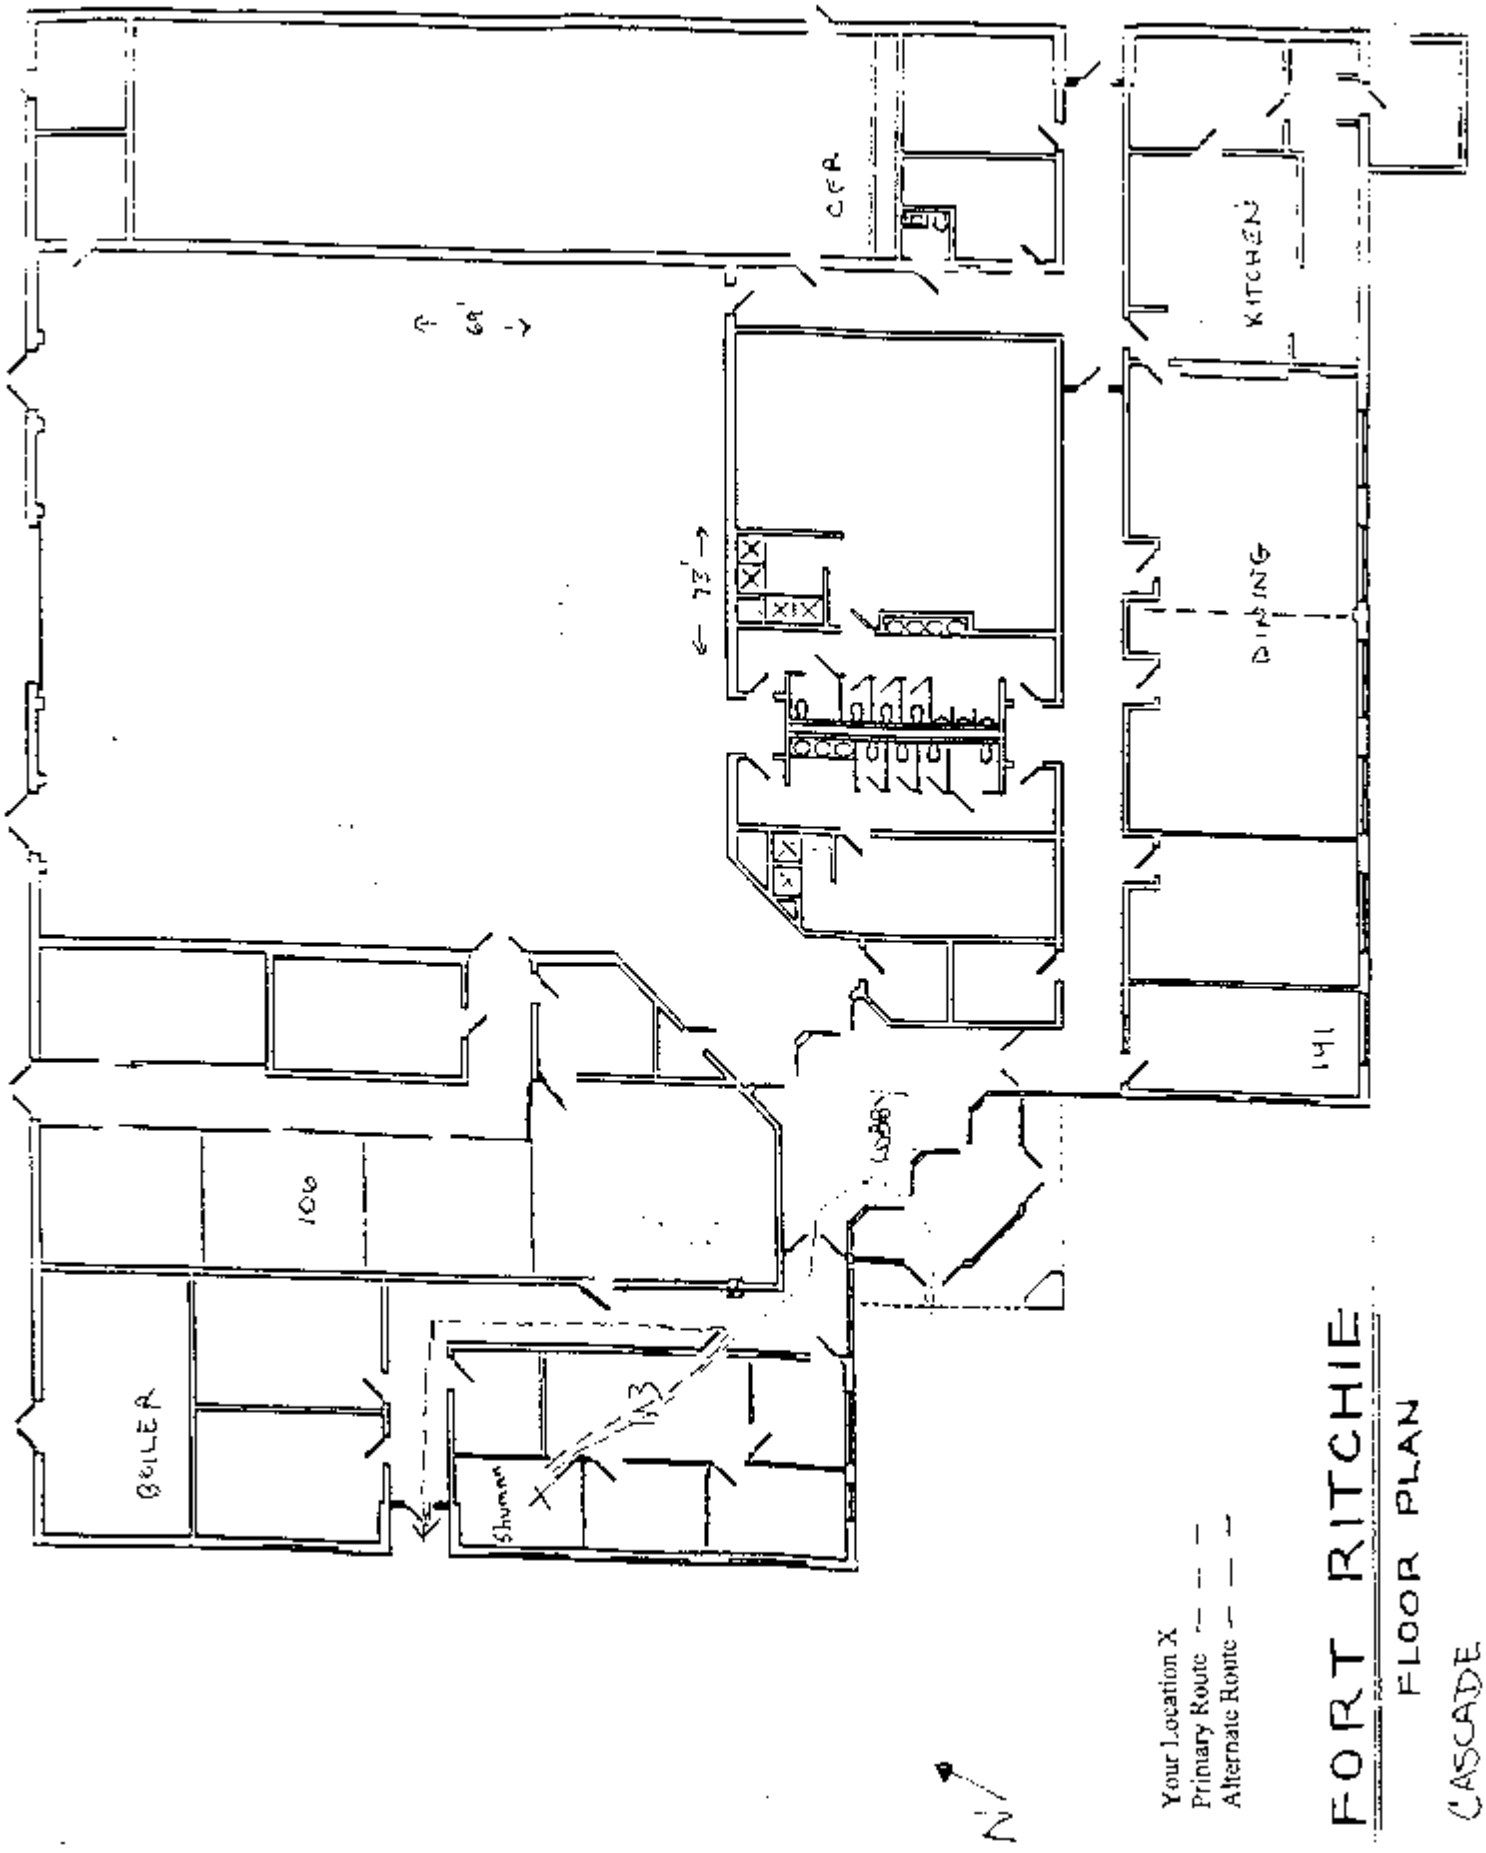

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. American National Standards Institute (ANSI)/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227 (h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MAY 1 1 2007

MEMORANDUM FOR National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Non-Responsive), 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities, Industrial Hygiene Baseline Survey, MG William J. Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

1. Enclosed is the final copy of the subject report and two CD-ROMs.

2. Our point of contact is Ms. Non-Responsive, at commercial (410) 436-5475/3118, DSN 584-5475/3118 or electronic mail: Non-Responsive@us.army.mil

FOR THE COMMANDER:

Non-Responsive

Encl

Director, Occupational Health Sciences

CF: (wo/CD ROMs)
USACHPPM-NORTH (MCHB-AN-IH/MR. Non-Responsive)

Readiness thru Health

Printed on Recycled Paper
BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/07
MG WILLIAM J. WITTE ARMORY
CATONSVILLE, MD
24 JULY 2003

Distribution limited to U.S. Government agencies only. Requests for this document must be referred to the National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Vanessa Franchere), 301-IH Old Bay Lane, Havre de Grace, MD 21078

[redacted]

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

DESTRUCTION NOTICE - Destroy by any method that will prevent disclosure of contents or reconstruction of the document.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1470 of 5269

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/07
MG WILLIAM J. WITTE ARMORY
CATONSVILLE, MD
24 JULY 2003

1. PURPOSE. To perform an industrial hygiene survey to identify and measure the existence and extent of potentially hazardous operations or conditions at the Maryland Army National Guard MG William J. Witte Armory, Catonsville, MD. This survey will serve as an update to the baseline so that an occupational exposure history can be compiled for each civilian or military employee.

2. CONCLUSIONS. Significant health and safety concerns were: high levels of lead in dust in several areas; the lack of a site Asbestos Management Plan (AMP); a leaking roof creating safety hazards and supporting mold growth; a non-operational heating, ventilation, and air conditioning system; and the lack of a written Hazard Communication (HAZCOM) Program.

3. RECOMMENDATIONS.

a. Lead Exposure. Health Risk Assessment Codes (RAC) 3 for adults. Health RAC 2 for children.

(1) Develop and implement a written Lead Hazard Management Plan for the Armory. Ensure that the Armory complies with the Occupational Safety and Health Assessment Lead Standard, Title 29 Code of Federal Regulation (CFR) 1910.1025, and the Occupational Safety and Health Administration Lead in Construction Standard, Title 29 CFR 1926.62.

(2) Repair and stabilize deteriorated paint.

(3) Address all potential lead hazards before continuing to extend the use of this facility to children.

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

(4) Clean horizontal surfaces in all areas that children may visit to the Environmental Protection Agency and State of MD lead in dust standard for children. Clean horizontal surfaces in the administrative areas to the National Guard Bureau Region North Industrial Hygiene Office and United States Army Center for Health Promotion and Preventive Medicine recommended levels. Clean all areas where sampling results showed elevated levels of lead. At a minimum, if only adults use this facility, clean to the recommended maximum levels for adults. Follow the comprehensive guidelines for cleaning in Appendix E and the decontamination requirements for the former Indoor Firing Range (IFR) provided in National Guard Pamphlet 420-15. Consult with the Maryland Armory Environmental Coordinator concerning disposal requirements after cleanup.

(5) Pending cleanup, restrict access to the former IFR (current storage room and classroom) by keeping it locked. Post a sign warning against entry into the room except in an emergency, and against storing any material. Ensure that personnel wear disposable gloves, disposable coveralls, and booties to prevent tracking lead to other areas of the Armory when cleaning the former IFR.

b. Asbestos Exposure. Health RAC 3. Continue the asbestos abatement in the Armory in accordance with Federal, state, and local regulations. Develop and implement an AMP.

c. Safety Hazards. Safety RAC 4. Continue to repair roof leaks and damaged building materials. Replace loose ceiling tiles.

d. Mold Exposure. Health RAC 4. Repair the Orderly Room roof leak. Remove and replace ceiling tiles contaminated with mold growth after determining whether they contain asbestos. Abate all areas of visible mold. For additional guidance on moisture control and mold remediation refer to Appendix F.

e. Heating, Ventilation, and Air Conditioning Systems. No RAC can be assigned. Repair heating system problems. Purchase and install more air conditioning units.

f. Occupational Safety and Health Programs. Health RAC 3. Develop and implement a written HAZCOM Program for the facility. Maintain HAZCOM documentation and file it in an accessible area.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1473 of 5269

BEST AVAILABLE COPY

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

CONTENTS

Paragraph Page

1. REFERENCES 1

2. PURPOSE 1

3. AUTHORITY 1

4. GENERAL 1

5. METHODOLOGY 2

6. FINDINGS AND DISCUSSION 2

7. CONCLUSIONS 4

8. RECOMMENDATIONS 4

9. ADDITIONAL ASSISTANCE 6

APPENDICES

A. REFERENCES A-1

B. LABORATORY REPORT B-1

C. PHOTOGRAPHS C-1

D. ASSESMENT CRITERIA FOR LEAD D-1

E. LEAD CLEANING GUIDANCE E-1

F. MOLD CLEANING GUIDANCE F-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1474 of 5269

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/07
MG WILLIAM J. WITTE ARMORY
CATONSVILLE MD
24 JULY 2003

1. REFERENCES. See Appendix A.

2. PURPOSE. To identify and measure the existence and extent of potentially hazardous operations or conditions at the Maryland Army National Guard MG William J. Witte Armory, Catonsville, MD. This survey will serve as an update to the baseline so that an occupational exposure history can be compiled for each civilian or military employee.

3. AUTHORITY. Fax, National Guard Bureau (NGB) Region North, Industrial Hygiene Office, (NGB-ARS-IHNE/Ms. Non-Responsive), 28 February 2003.

4. GENERAL.

a. Personnel Contacted. Staff Sergeant (SSG) Non-Responsive, Manager, (410) 788-7080. SSG Non-Responsive, Environmental Compliance Assessment Coordinator for the MD Environmental Office, provided additional information.

b. Survey Personnel. This survey was conducted on 23 July 2003 by Ms. Non-Responsive, Industrial Hygienist, United States Army Center for Health Promotion and Preventive Medicine (USACHPPM).

c. Risk Assessment Codes (RACs). The Department of Defense Instruction (DODI) 6055.1 provides a method for assigning RACs to health hazards that are based on the magnitude of exposures to physical, chemical, and biological agents and the possible medical effects. The DODI 6055.1 also provides RACs for safety and ergonomic hazards. A RAC is an expression of the risk associated with a hazard that combines the hazard severity and accident probability into a single numeral. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

d. Background. The MG William J. Witte Armory was located at 130 Mellor Avenue, Catonsville, MD 21228-5142. The Armory was built in 1940 and rehabilitated at a later date. Its mission was administration. It was being offered for rental, so could host activities that include children. No floor plan could be located for this report.

Use of trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

BEST AVAILABLE COPY

5. METHODOLOGY.

a. Assessment Criteria. Army Regulation 40-5 contains the requirement that airborne chemical exposures in Army facilities must comply with the lower of the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit or the American Conference of Governmental Industrial Hygienists Threshold Limit Value®. The NGB Region North Industrial Hygiene Office criterion for lead in surface dust is discussed in Appendix B.

b. Calibration. All instruments were calibrated in accordance with manufacturers' instructions using National Institute of Standards and Testing traceable method.

c. Methodology. The survey consisted of the collection of indoor air quality and ventilation measurements, sampling surface dust and air for lead, observation of work practices and procedures, and employee interviews.

6. FINDINGS AND DISCUSSION.

a. Description of Operations. The Armory had a drill hall, classroom spaces, weapons vaults, and offices. There were no industrial operations.

b. Occupational Safety and Health Programs. No written Hazard Communication (HAZCOM) Program was found. The OSHA requires employers to provide information to their employees concerning hazardous chemicals to which they are exposed. This is accomplished by establishing a HAZCOM Program for Armory employees. Program elements include the use of labels and other forms of warning, Material Safety Data Sheets and information and training addressing protective measures for employees.

c. Building Condition.

(1) Safety Hazards. The roof was leaking, damaging ceiling tiles in the Orderly Room. There was a potential hazard of tiles falling and of slips and falls on wet floor surfaces. As discussed below, there were several areas with deteriorating paint.

(2) Indoor Firing Range (IFR). The former IFR was being used as a storage room and a classroom. There were no records of cleaning or lead abatement ever having occurred in the IFR.

d. Indoor Environmental Quality.

(1) Heating, Ventilation, and Air Conditioning Systems. The building was heated with steam. The heat was reportedly working on only one side of the building. Cooling was provided

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1476 of 5269

BEST AVAILABLE COPY

by several window-type air conditioners mounted in regularly used offices, and by the manual operation of windows. The Armory management had requested more air conditioning units.

(2) Temperature, Humidity Control, and Air Exchange Rate. Measurements could not be located for this report.

(3) Mold and Moisture Problems. The Orderly Room roof leak had caused mold growth on a portion of the ceiling. Water may have damaged the insulation and may have resulted in further mold growth. Mold exposure may cause illness in Armory employees.

e. Water Quality. There were no concerns expressed by Armory personnel about water quality. No samples were collected.

f. Lead Hazards. The age of the building indicated that the presence of lead-based paint was likely. Some rooms in the Armory had extensive areas of deteriorated paint. SSG McCuen stated that there were no records of any lead abatement ever having occurred in this facility. No Lead Hazard Management Plan (LHMP) was found.

(1) Criteria for lead in dust. The Environmental Protection Agency (EPA) and State of MD limits for lead in dust are 40 micrograms per square foot ($\mu g/ft^2$) on floors, 250 $\mu g/ft^2$ on windowsills, and 400 $\mu g/ft^2$ in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The NGB Region North Industrial Hygiene Office concurs with the USACHPPM recommended maximum level of 200 $\mu g/ft^2$ on floors and frequently contacted surfaces, which is more stringent for windowsills than the EPA and State of MD standards. This level was adopted from OSHA Compliance Letter 02-02-58. Further information is provided in Appendix D.

(2) Results for lead in dust. Sampling locations are shown in Appendix C. Laboratory reports are in Appendix B. Samples were collected in 10 locations. Results are shown in the Table. Results exceeding any of the criteria are highlighted. The results confirm that the former IFR was never adequately decontaminated. The high levels in the arms vaults could have been produced either by tracking from the former IFR or weapons cleaning. There was a risk of tracking lead to other areas of the Armory.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1477 of 5269

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

TABLE Lead Levels in Dust.

Wipe Sample #	Location of Samples	Result, µg/ft²
CAW01	Vault 119, munitions area on floor	350
CAW02	Kitchen 106, floor near stove	<23
CAW03	Room B-2 (Basement) (SFC Non-Responsive [redacted] on window sill	<23
CAW04	Room B-3 (Basement), floor at corner	<23
CAW05	Former IFR, floor at bullet trap location	9,200
CAW06	Former IFR, floor behind firing line	240
CAW07	Corridor, floor one foot from door to former IFR	59
CAW08	Room 122, window sill	41
CAW09	Vault 120, arms area	150
CAW10	Room 112 (Recruiter's Office) wall near door to other offices	<23

g. Asbestos. SSG Non-Responsive [redacted] stated that asbestos abatement was ongoing and was nearly complete at the time of the site visit. A site Asbestos Management Plan (AMP) was not found. If there were still asbestos in the facility and damage occurred in the future, the asbestos could become friable and asbestos fibers could be released. Army policy requires the Armory to establish and execute an AMP for all asbestos in the facility, and to take immediate corrective action where a possible asbestos hazard has been identified.

h. Noise Hazards. No operations with the potential to generate hazardous noise levels were identified.

7. CONCLUSIONS. Significant health and safety concerns were: high levels of lead in dust in several areas; the lack of a site AMP; a leaking roof creating safety hazards and supporting mold growth; a nonoperational Heating Ventilating and Air Conditioning system; and the lack of a written HAZCOM Program.

8. RECOMMENDATIONS.

a. Lead Exposure. Health RAC 3 for adults. Health RAC 2 for children.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1478 of 5269

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

(1) Develop and implement a written LHMP for the Armory. Ensure that the Armory complies with the OSHA Lead Standard, Title 29 Code of Federal Regulations (CFR) 1910.1025, and the OSHA Lead in Construction Standard, Title 29 CFR 1926.62.

(2) Repair and stabilize deteriorated paint.

(3) Address all potential lead hazards before continuing to extend the use of this facility to children.

(4) Clean horizontal surfaces in all areas that children may visit to the EPA and State of MD lead in dust standard for children. Clean horizontal surfaces in the administrative areas to the NGB Region North Industrial Hygiene Office and USACHPPM recommended levels. Clean all areas where sampling results showed elevated levels of lead. At a minimum, if only adults use this facility, clean to the recommended maximum levels for adults. Follow the comprehensive guidelines for cleaning in Appendix E and the decontamination requirements for the former IFR provided in National Guard Pamphlet 420-15. Consult with the Maryland Armory Environmental Coordinator concerning disposal requirements after cleanup.

(5) Pending cleanup, restrict access to the former IFR (current storage room and classroom) by keeping it locked. Post a sign warning against entry into the room except in an emergency, and against storing any material. Ensure that personnel wear disposable gloves, disposable coveralls, and booties to prevent tracking lead to other areas of the Armory when cleaning the former IFR.

b. Asbestos Exposure. Health RAC 3. Continue the asbestos abatement in the Armory in accordance with Federal, state, and local regulations. Develop and implement an AMP.

c. Safety Hazards. Safety RAC 4. Continue to repair roof leaks and damaged building materials. Replace loose ceiling tiles.

d. Mold Exposure. Health RAC 4. Repair the Orderly Room roof leak. Remove and replace ceiling tiles contaminated with mold growth, after determining whether they contain asbestos. Abate all areas of visible mold. For additional guidance on moisture control and mold remediation refer to Appendix F.

e. Heating, Ventilation, and Air Conditioning Systems. No RAC can be assigned. Repair heating system problems. Purchase and install more air conditioning units.

f. Occupational Safety and Health Programs. Health RAC 3. Develop and implement a written HAZCOM Program for the facility. Maintain HAZCOM documentation and file it in an accessible area.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1479 of 5269

BEST AVAILABLE COPY

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

9. ADDITIONAL ASSISTANCE. For additional assistance or questions concerning this report, please contact the undersigned at commercial (410) 436-3118/5475, DSN 584-5475/3118 or electronic mail Non-Responsive it@us.army.mil

Non-Responsive
Industrial Hygienist
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive
MAJ, MS
Program Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1480 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

1. Occupational Safety and Health Administration, Title 29 Code of Federal Regulations (CFR) Part 1910, current ed. http://www.osha.gov/comp-links.html

2. DA PAM 40-501, Medical Services, Hearing Conservation Program, 10 December 1998. http://www.usapaarmy.mil/pdffiles/p40_501.pdf

3. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p4C_503.pdf

4. American Conference of Governmental Industrial Hygienists (ACGIH), Threshold Limit Values and Biological Exposure Indices, ACGIH, Cincinnati, OH, 2005. http://www.acgih.org/TLV/

5. American Society of Heating, Refrigerating and Air Conditioning Engineers, Inc. (ASHRAE) 62.1-2004, Ventilation for Acceptable Indoor Air Quality. http://www.ashrae.org

6. Illuminating Engineering Society of North America, ANSI/IESNA, RP-1-2004, Office Lighting.

7. ACGIH, Industrial Ventilation: A Manual of Recommended Practices, 25th ed., ACGIH, Cincinnati, OH, 2004.

8. U.S. Army National Guard Bureau, Design Guide 415-2, Design Guide for Logistics Facilities, May 2005.

9. Environmental Protection Agency, Title 40 CFR Part 745, Lead; Identification of Dangerous Levels of Lead; Final Rule, 5 Jan 2001.

10. NG Pam 420-15, Facilities Engineering, Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

11. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, 19 August 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1481 of 5269

APPENDIX B

LABORATORY REPORT

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	**RES 96062-1**
Client:	**Army National Guard IH - West**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**None Given**
Date Samples Received:	**August 7, 2003**
Analysis Type:	**USEPA SW846 3050B / AA(7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 4, 2003**

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
CA Blank 01	EM 800617	0.11	BDL	23	BDL
CA W01	EM 800618	0.11	38.0	23	345
CA W02	EM 800619	0.11	BDL	23	BDL
CA W03	EM 800620	0.11	BDL	23	BDL
CA W04	EM 800621	0.11	BDL	23	BDL
CA W05	EM 800622	0.11	1011.0	23	9191
CA Blank 02	EM 800623	0.11	BDL	23	BDL
CA W06	EM 800624	0.11	26.4	23	240
CA W07	EM 800625	0.11	6.5	23	59
CA W08	EM 800626	0.11	4.5	23	41
CA W09	EM 800627	0.11	16.1	23	146
CA W10	EM 800629	0.11	BDL	23	BDL
CA Blank 03	EM 800630	0.11	BDL	23	BDL

***Calculations Based On A 1 sq.ft. Sample Area Unless Otherwise Noted**

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

APPENDIX C
PHOTOGRAPHS

TABLE D-1. Photographs.

Photo No.	Location
1	Vault 119, floor in munitions area (Wipe sample)
2	Kitchen 1206, floor near stove (Wipe sample)
3	Kitchen Storage Area (Deteriorated paint)
4	Room B-2 (Basement) (SFC [redacted]), window sill (Wipe sample)
5	Room B-2, baseboard (Deteriorated paint)
6	Room B-3 (Basement), floor in corner (Wipe sample and deteriorated paint)
7	Former IFR, floor at bullet trap location (Wipe sample)
8	Former IFR wall (Deteriorated paint)
9	Former IFR, floor near firing line (Wipe sample)
10	Corridor, floor one foot outside former IFR (Wipe sample)
11	Room 122, window sill (Wipe sample)
12	Vault 120, arms area (Wipe sample)
13	Room 112 (Recruiter's Office), wall near door to other offices (Wipe sample)
14	Room 112 wall (Deteriorated paint)
15	Room 110, ceiling near light fixture (Deteriorated paint)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1484 of 5269

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

Photograph 1

Photograph 2

Photograph 3

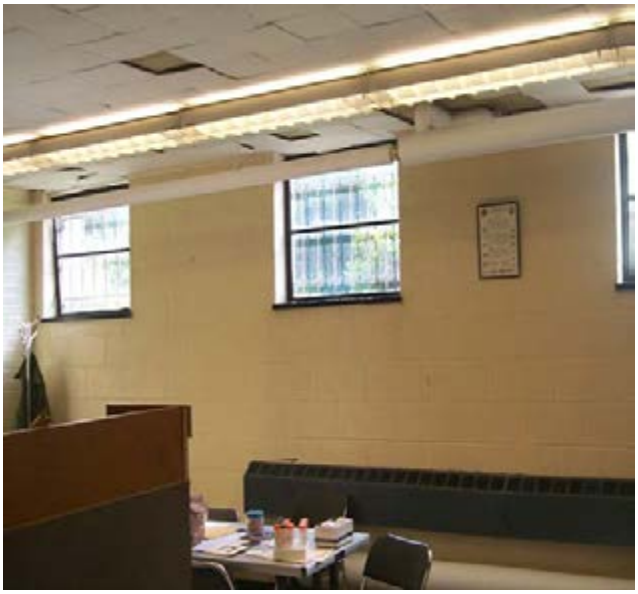

Photograph 4

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1485 of 5269

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

Photograph 5

Photograph 6

Photograph 7

Photograph 8

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1486 of 5269

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

Photograph 9

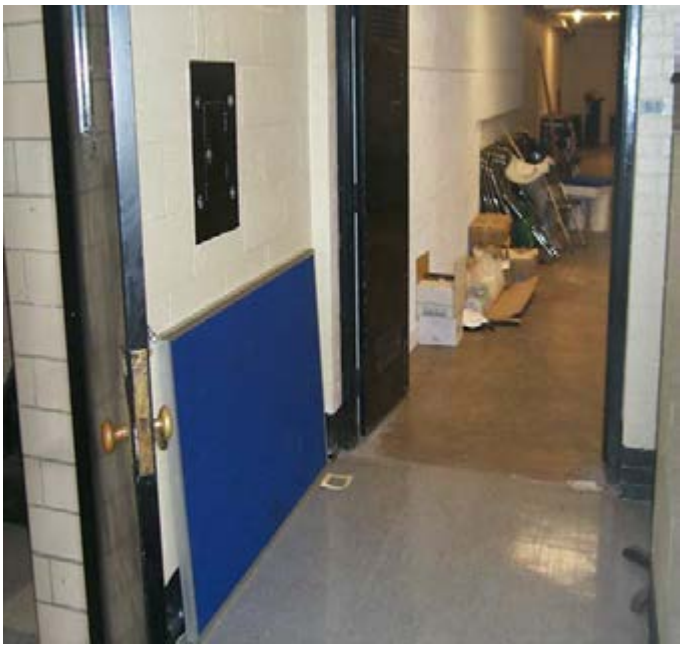

Photograph 10

Photograph 11

Photograph 12

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1487 of 5269

MDARNG Facilities, Industrial Hygiene Baseline Survey, MG William Witte Armory, Catonsville, MD, Report No. 55-ML-01ED-03/07, 24 July 2003

Photograph 13

Photograph 14

Photograph 15

BEST AVAILABLE COPY

APPENDIX D

NATIONAL GUARD BUREAU REGION NORTH INDUSTRIAL HYGIENE OFFICE

ASSESSMENT CRITERIA FOR LEAD

Subject: Recommendations for Surface Lead Dust in Armories

1. In armories that do not contain childcare facilities, the National Guard Bureau (NGB) Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 micrograms per square foot ($\mu g/ft^2$). If a special function will be held in which children will be present in this facility, consider thoroughly cleaning the areas that will be accessible to children prior to the function. This guidance is based on professional judgment, risk assessments, adaptation of Occupational Safety and Health Administration (OSHA) guidance, and feasibility of cleaning to a certain level.

a. Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3)) are not directly applicable because they are criteria for dust-lead hazards developed for floors (40 $\mu g/ft^2$) and windowsills (250 $\mu g/ft^2$) in residential dwellings and child occupied facilities. A child occupied facility is defined as a building, or portion of a building, constructed prior to 1978, visited regularly by the same child, 6 years of age or under, on at least two different days within any week (Sunday through Saturday period), provided that each day's visit lasts at least 3 hours and the combined weekly visit lasts at least 6 hours, and the combined annual visits last at least 60 hours. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. The OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead dust. In workplaces where lead dust is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. The OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1489 of 5269

precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed. In the interim, we recommend the following actions:

a. Clean all areas that will be accessible to children to the EPA dust-lead standard for children 6 years of age or under (40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ on windowsills).

b. Refer to the local authorities' regulations since they can be more stringent than Federal regulations.

c. Post signs in the area to inform people of the presence of lead dust and its effects.

d. If Soldiers clean weapons in the facility, change the policy so that they cannot clean their weapons in the facility, or if they are allowed to clean their weapons indoors, they must clean the area by wet wiping and mopping the area when they are done.

e. If the paint is peeling, contact the state Environmental Office to test for lead content and provide recommendations.

3. Air samples collected on individuals in the Armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead dust in this building.

BEST AVAILABLE COPY

APPENDIX E

LEAD CLEANING GUIDANCE

HUD TECHNICAL GUIDELINES FOR THE EVALUATION AND CONTROL OF LEAD-BASED PAINT HAZARDS IN HOUSING 1998

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1491 of 5269

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1492 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1493 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1494 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1495 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1496 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1497 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1498 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1499 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

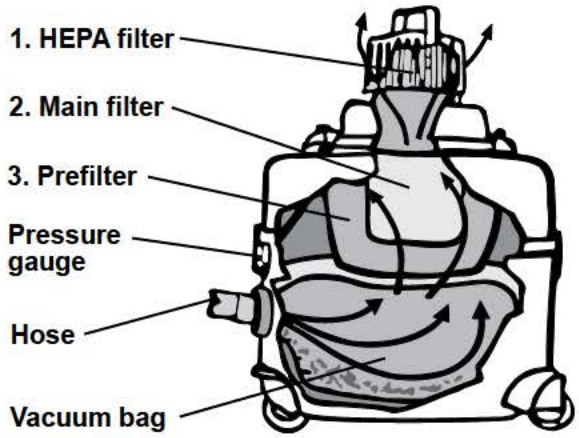

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

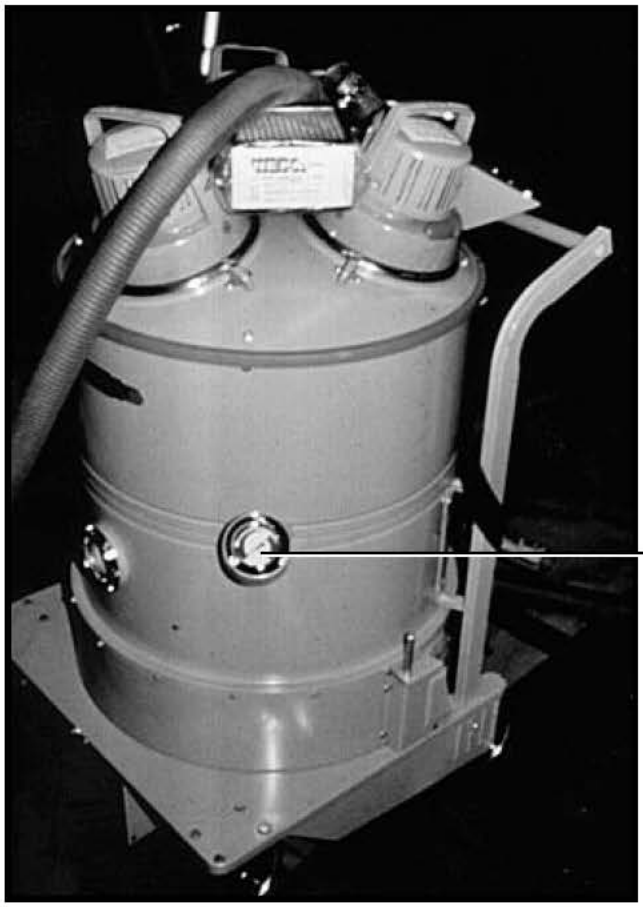

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1500 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

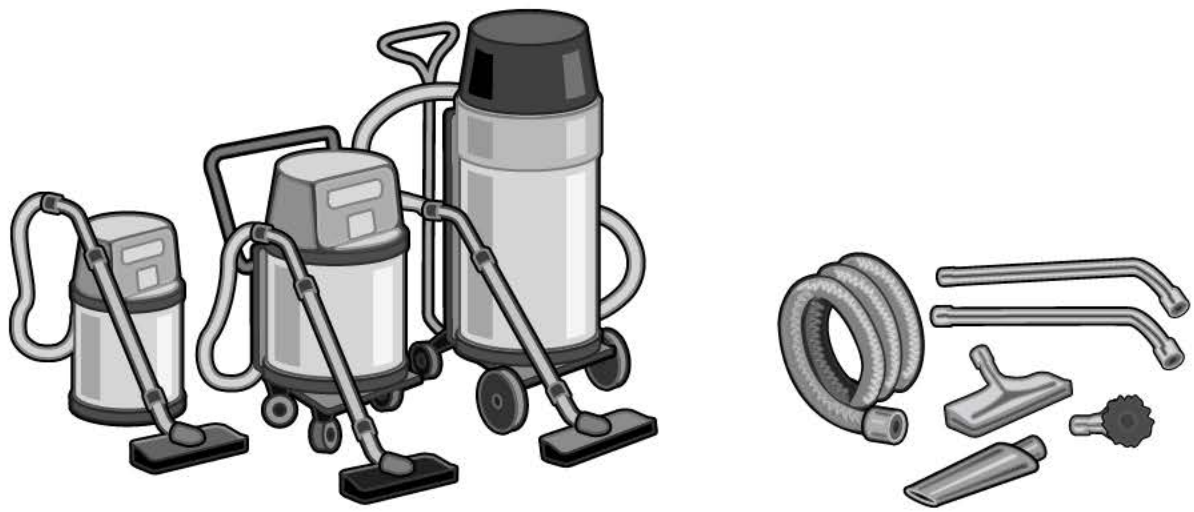

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1501 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

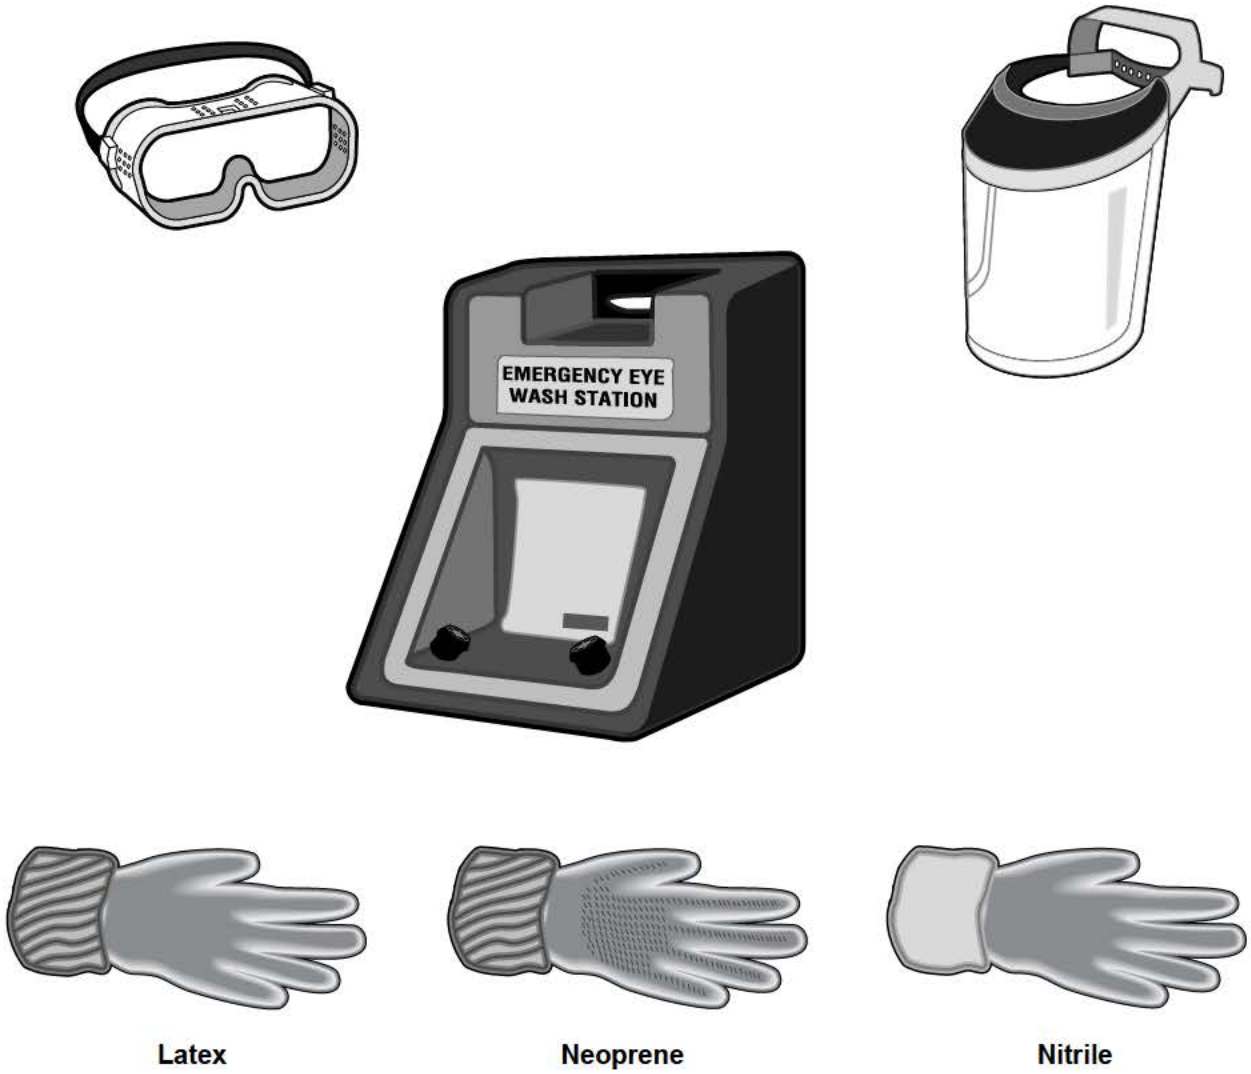

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1502 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

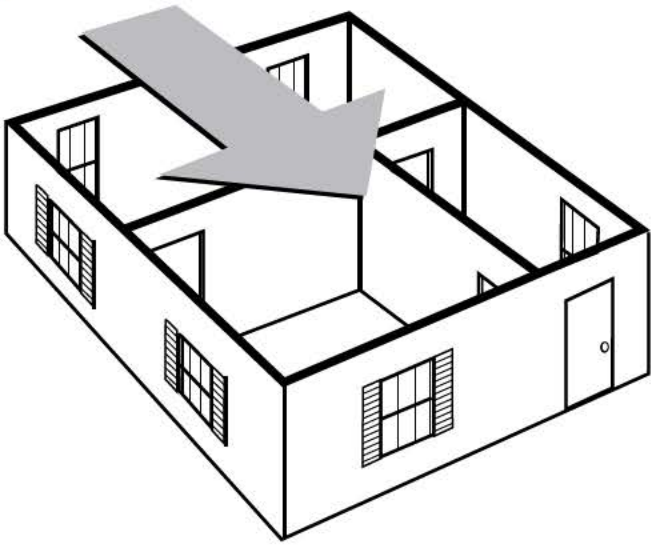

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

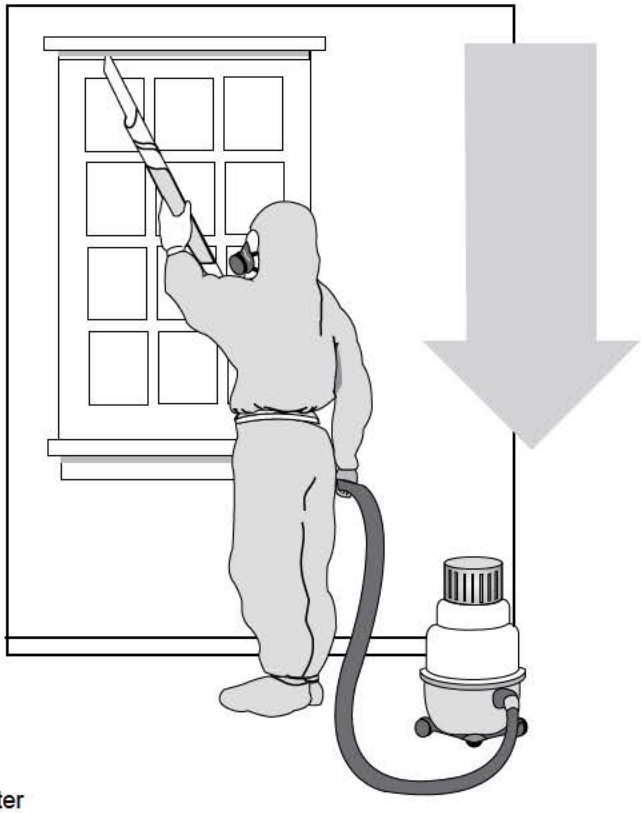

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1503 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1504 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

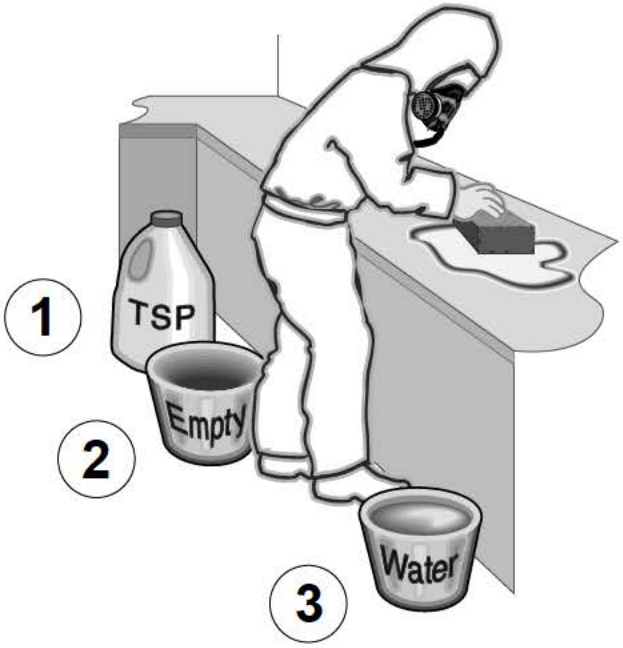

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1505 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

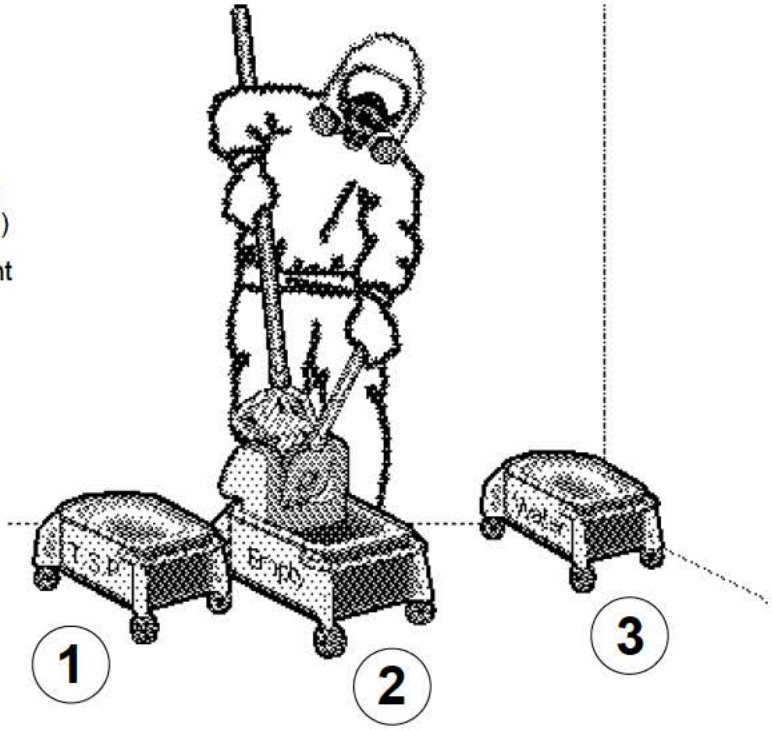

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

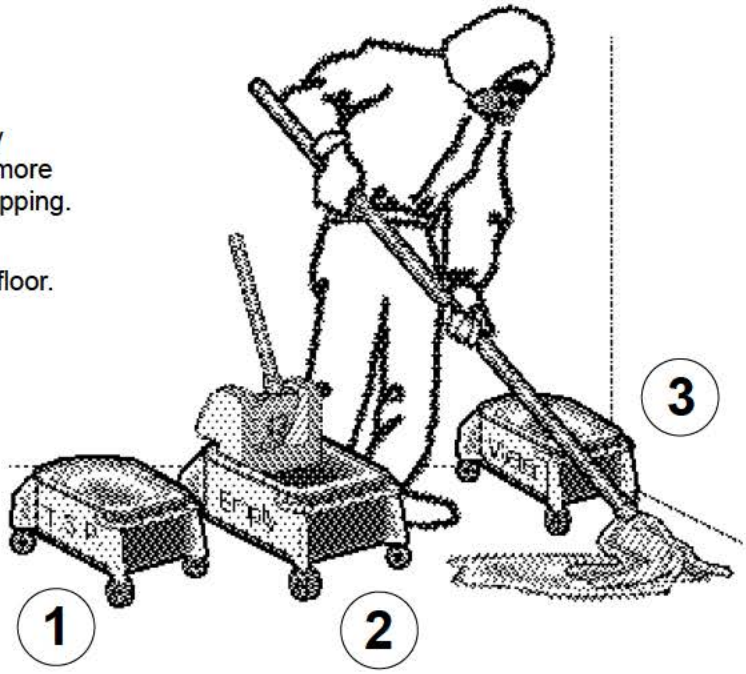

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1506 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

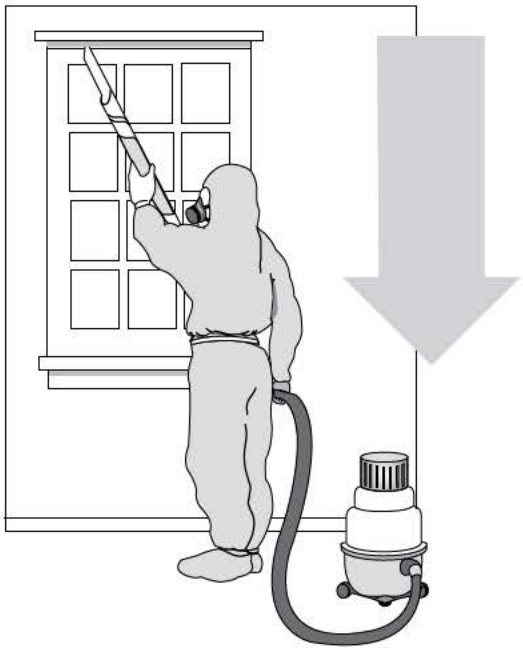

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1507 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1508 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1509 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1510 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1511 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1512 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1513 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1514 of 5269

BEST AVAILABLE COPY

APPENDIX F

MOLD CLEANING GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1515 of 5269

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1516 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1518 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1519 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet -** e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1520 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1521 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1522 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1523 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1524 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1525 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1526 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1527 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1528 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1529 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1531 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1532 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1533 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1534 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1535 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1536 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1537 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1538 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1539 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1541 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1542 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1543 of 5269

MOLD INVESTIGATION DECISION LOGIC

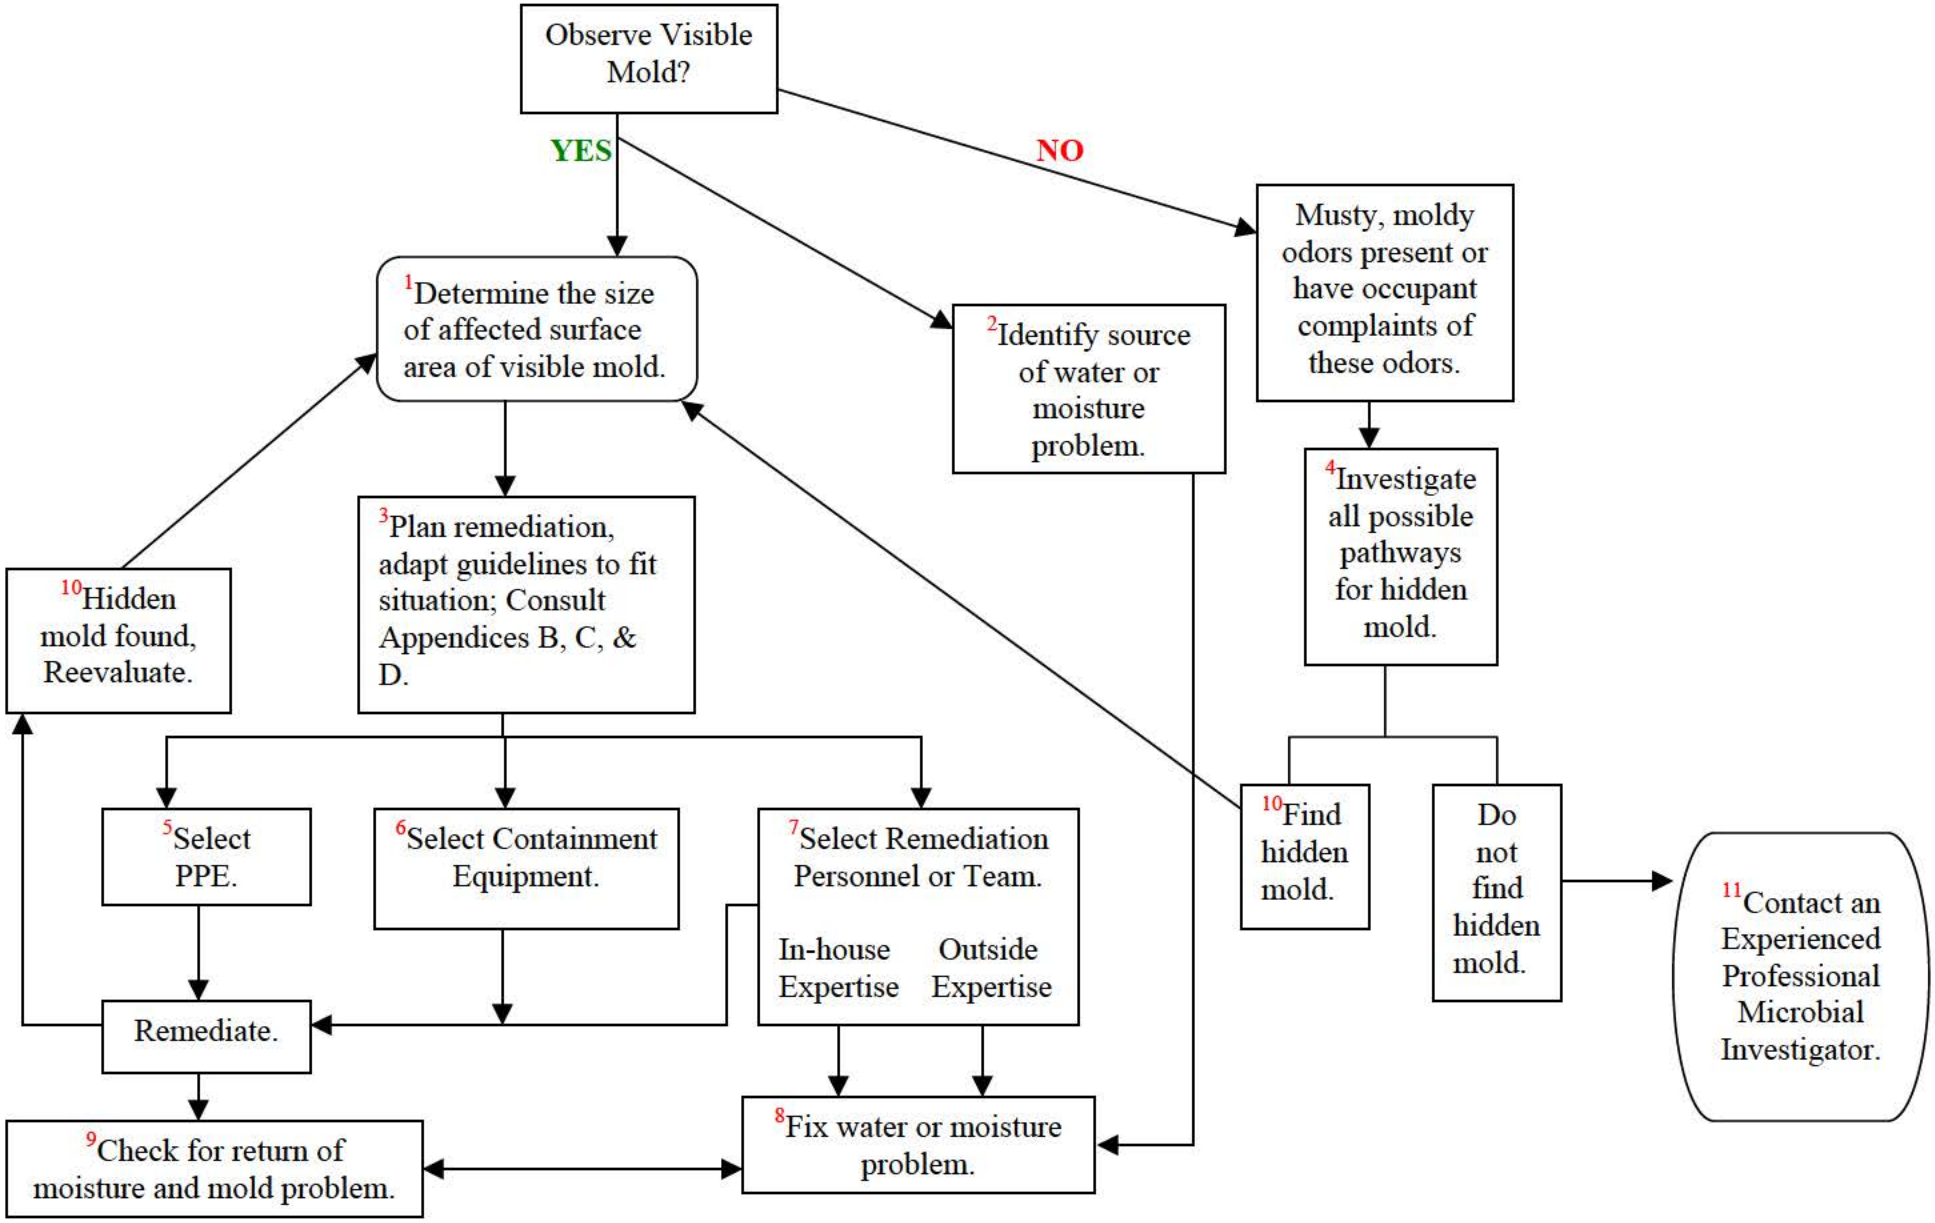

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1545 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1546 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1547 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1548 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1549 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips

- Always maintain the containment area under negative pressure.
- Exhaust fans to outdoors and ensure that adequate makeup air is provided.
- If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1551 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1552 of 5269

BEST AVAILABLE COPY

TG 278

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1553 of 5269

BEST AVAILABLE COPY

Industrial Hygiene Study

National Guard Facility
Catonsville Readiness Center
130 Mellor Avenue
Catonsville, MD
21228

Prepared for:

National Guard Bureau Region North IH Office
301-IH Old Bay Lane
Havre de Grace, Maryland
21078

Prepared by:

The EI Group, Inc.
2101 Gateway Centre Blvd.
Morrisville, North Carolina
27560

Report Date: December 30, 2008

Project ID: IHMO080101.03

Non-Responsive [redacted] _____

Manager, Charlotte Operations

Non-Responsive [redacted] _____

Senior Industrial Hygienist

BEST AVAILABLE COPY

TABLE OF CONTENTS

Executive Summary	3
Operation Description	4
Noise	4
Lead Testing	4
Lighting	6
Indoor Air Quality	6
Suspect ACBM	8
Maintenance Bay	8
Ventilation Assessment	8
Limitations	9
References	9

List of Appendices

Appendix A: Photographs

Appendix B: Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1555 of 5269

EXECUTIVE SUMMARY

An industrial hygiene survey was conducted July 31, 2008 at the Readiness Center Facility located in Catonsville, Maryland. The study was performed by Mr. Non-Responsive [redacted], CIH.

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lighting within the facility was also evaluated. Lighting was found to be within applicable recommended levels.

Various surfaces within the HVAC system and throughout the facility were screened for lead. The screening was completed using surface/wipe and air samples. None of the air samples collected were found to have detectable levels of the respective lead contaminant, and five (5) of the six (6) surface samples collected were found to have detectable levels of lead.

Indoor air quality parameters were also evaluated during the assessment. Indoor air quality was found to be within those parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE). The firing range is inactive, having been converted into a gym, but could have contributed to lead exposure to building occupants. If not addressed, these may provide sources of poor indoor air quality.

During the assessment, written programs for Health and Safety, NESHAP Operations and Maintenance Asbestos Survey, and the Hazard Communication Program were requested for review, however, the onsite personnel was not able to locate the documents.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1556 of 5269

Operation Description

The Catonsville Readiness Center primarily serves as an equipment storage facility and is equipped to conduct light vehicle maintenance. The facility consists of a single story response center that contains a maintenance bay, office spaces, classrooms, a kitchen area, an assembly hall, boiler room, lower level exercise room, and unit storage areas.

The exterior walls of the building were constructed of a concrete block system (CBS) finished with red brick. The interior walls were composed of concrete block and in some areas were finished with drywall. The roof of the facility consisted of a flat rubber membrane roof system covered with stone. The heating, ventilating, and air conditioning system (HVAC) consisted of a split direct-expansion (DX) system and a radiator heating system. The floors were composed of a poured concrete slab and in some areas were finished with vinyl floor tiles. The ceilings were generally composed of metal corrugated roof deck and in some areas were finished with a suspended drop ceiling system.

Site personnel at the time of the site assessment consisted of three (3) administrative maintenance personnel. The employees on site were conducting general administrative work.

Noise Survey

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lead Testing

At the time of the assessment, no activities were observed which may lead to lead exposure other than ammunition handling. The facility contains an indoor firing range that was converted to a gym area. An unused kitchen will be renovated in 2009 was found to have damaged and sloughing paint which was found to be lead containing. Reportedly, a fire in the kitchen occurred several years ago. Elevated lead concentrations were also identified on a wall mounted exhaust fan (fan blades).

Various surfaces within the facility were screened for lead using surface/wipe samples and the collection of air samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 µm MCE cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, MD for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix B.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1557 of 5269

Lead Testing Results Summary

Location	Air ug/m^3	Surface ug/ft^2	Bulk	Chip %Pb
Range	ND			
Office	ND			
Blank	ND			
Room B1 Closet Wall				ND
Room 106 Kit Wall				0.34%
Room 105 Storage Wall				0.021 %
Drill Hall @ Room 119 Floor		160		
Room 106 Top of Refrigerator		**2600**		
Room B1 Closet Wall		ND		
Room 111 Cabinet Top		110		
Room B2A Cabinet Top		11		
Room B1 Range Exhaust Fan		**33000**		
Blank		ND		
Criteria	**50**	**200**	**5,000**	**0.5**

Key: ND – None Detected
PB – Lead

Deteriorated paint was identified in the kitchen, inside a closet located in the basement level gym and storage room 105 located adjacent to the vehicle maintenance bay. Surface lead was detected in the exhaust fan of the gym/firing range, Drill Hall floor outside of Arms vault 119, Office 111 cabinet and kitchen. The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying contaminated surfaces. In the" Derivation of Wipe Surface Screening Levels for Environmental Chemicals", the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, HUD levels of 40 µg/ft^2 on floors and 250 µg/ft^2 on windowsills should be observed.

No detectable levels of lead were identified in those air samples collected. Currently, OSHA observed an 8-hour time weighted average of 50 ug/m^3.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1558 of 5269

Lighting

A lighting assessment was conducted throughout the facility. The survey was conducted with large bay doors closed. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. 98047EL). The light meter was last calibrated on February 22, 2008. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Kitchen Room 106	45-68	50	Yes
Restroom Room 107	33-50	5	Yes
Lounge 108	78-96	30	Yes
Office Room 110	83-106	30-50	Yes
Office Room 111	81-109	30-50	Yes
Office Room 112	58-117	30-50	Yes
Office Room 112A	58-73	30-50	Yes
Class Room 116	95-120	30-50	Yes
Storage Room 117	32-51	30-50	Yes
Latrine Room 118	82-111	5	Yes
Locker Room 118A	41-52	7	Yes
Locker Room 121	10-35	7	Yes
Storage Room 122	45-50	30	Yes
Storage Room 124	89-103	30	Yes
Gym Room B1	119-135	30	Yes
Office Room B2	76-105	30-50	Yes
Office Room B2A	10-109	30-50	Yes
Drill Hall 101	33-42	30-50	Yes

Lighting was found to be sufficient throughout the facility.

Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTrak IAQ Meter, Model 8550 (Serial No. 11050). The IAQ Meter was last calibrated in January 2008.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information

Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 74.3°F to 84.2°F with relative humidity readings ranging from 41.1% to 79.2%. The results of the testing for relative humidity exceeded the US Army guidelines in ten (10) of the sixteen (16) locations tested.

During the survey, CO_2 levels ranged from 373 ppm to 931 ppm within the facility compared to an outdoor CO_2 level of 395 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,095 ppm (395 ppm + 700 ppm). The results of the testing met the ASHRAE guidelines.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Restroom 107	84.2	59.2	497	0
Office 110	76.1	46.6	682	0
Lounge 108	84.2	59.2	580	0
Office 112	77.9	**62.5**	470	0
Office 112A	74.3	58.6	505	0
Latrine 115	78.8	**61.4**	439	0
Office 116	77.0	48.1	378	0
Office 117	79.7	**68.0**	513	0
Locker Room 118A	78.8	**69.7**	497	0
Latrine 118	78.8	**79.2**	435	0
Locker Room 121	77.0	**74.8**	373	0
Storage Room 122	76.1	**73.0**	931	0
Office 124	78.8	**65.7**	584	0
Kitchen 106	84.2	**60.7**	430	0
Gym B1	77.9	**69.5**	450	0
Office B2A	77.0	**71.6**	421	0
Criteria	**73.0-79.0**	**30-50**	**<1,095**	**<9.0**

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspected was conducted to assess sources or pathways of IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

The kitchen has incurred damage, reportedly by fire. Damaged paint is located on the refrigerator top and floor of adjacent storage room.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1560 of 5269

Elevated humidity levels due to absence of exhaust fans have produced condensation/elevated humidity conditions throughout both first floor latrines/locker rooms. Elevated humidity in other areas of the building due to a combination of insufficient exhaust in locker rooms as well as open windows for control of comfort parameters rather than use of window unit air conditioning.

The sub-grade wall located in the closet of Room B1 (Gym) contains significant efflorescence.

Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials include sheetrock/joint compound, plaster wall and ceiling systems, floor tiles and associated mastic, and vinyl covebase. Thermal system insulation was found to be a combination of paper wrapped fiberglass with PVC elbows as well as some canvas wrapped fiberglass TSI in the mechanical room.

Room 122 was found to contain of 9”x9” floor tile in poor condition.

No Management Plan was identified.

Maintenance Bay

The maintenance bay/garage was not found to contain a local exhaust ventilation system. The Maintenance Bay is used for vehicle storage and facility storage.

The maintenance bay was found to contain custodial items, tools, waste motor oil, ladders and flammable storage cabinet. The flammable storage cabinet contained various paints and cleaning solvents.

No PPE was identified in the Maintenance Bay

Items for the kitchen renovation are currently stored throughout the bay.

Ventilation System Assessment

The facility was found to contain a direct expansion package servicing the drill floor. Filters, supply side and interior components were found to contain dust loading.

Individual offices and classrooms were found to have window unit air conditioners and radiator heating. Individual units were found to be clean.

No LEV system was present in the garage.

Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicated within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and The EI Group, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

References

Title 29 Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration.

Lead - (29 CFR 1910.1025(h))

American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2008 Edition

Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

Georgia Army National Guard: Standard Army Safety and Occupational Health Inspection Checklist; 1 October 1999 Edition

ANSI Z358.1 – 2004, Emergency Eye Wash and Shower Equipment

American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007.

RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

National Emission Standard Hazardous Air Pollutants (NESHAP) - The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3))

Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1563 of 5269

Appendix A

Photographs

Exterior view of facility

Water intrusion through subgrade wall (Room B1)

9” x 9” Floor tile located in Room 123 and 123A

Deteriorated paint in kitchen area

View of basement level gym (B1). Formerly firing range.

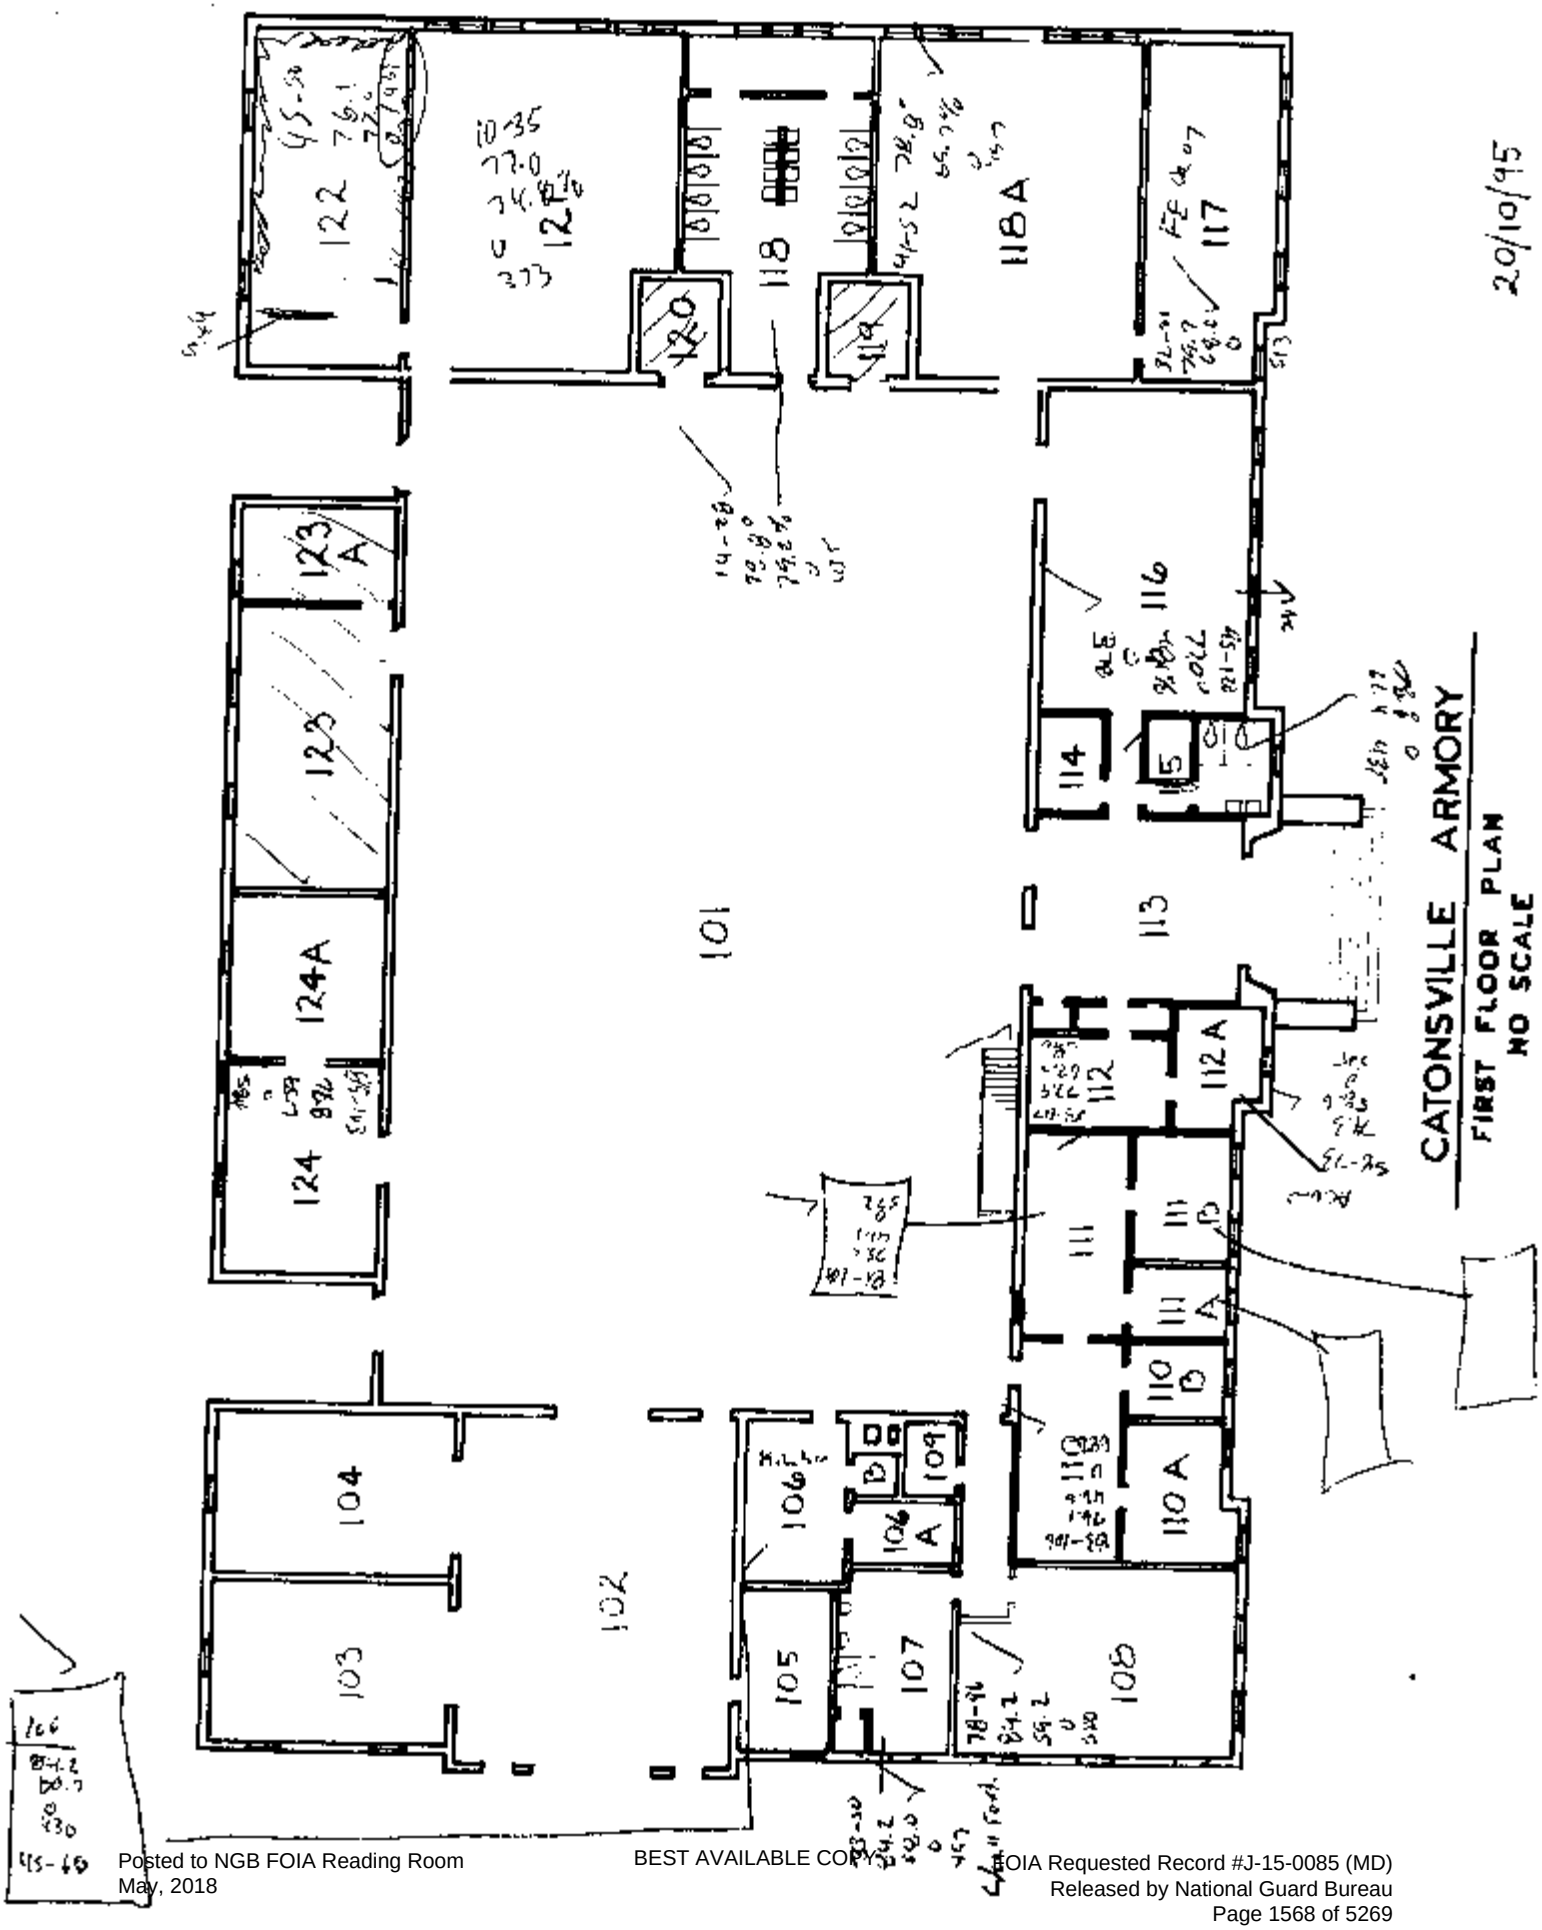
CATONSVILLE ARMORY
FIRST FLOOR PLAN
NO SCALE
20/10/95
101
102
104
103
105
106
107
108
109
110
110 A
110 B
111
111 A
111 B
112
112 A
113
114
116
117
118
118 A
120
122
123
123 A
124
124A

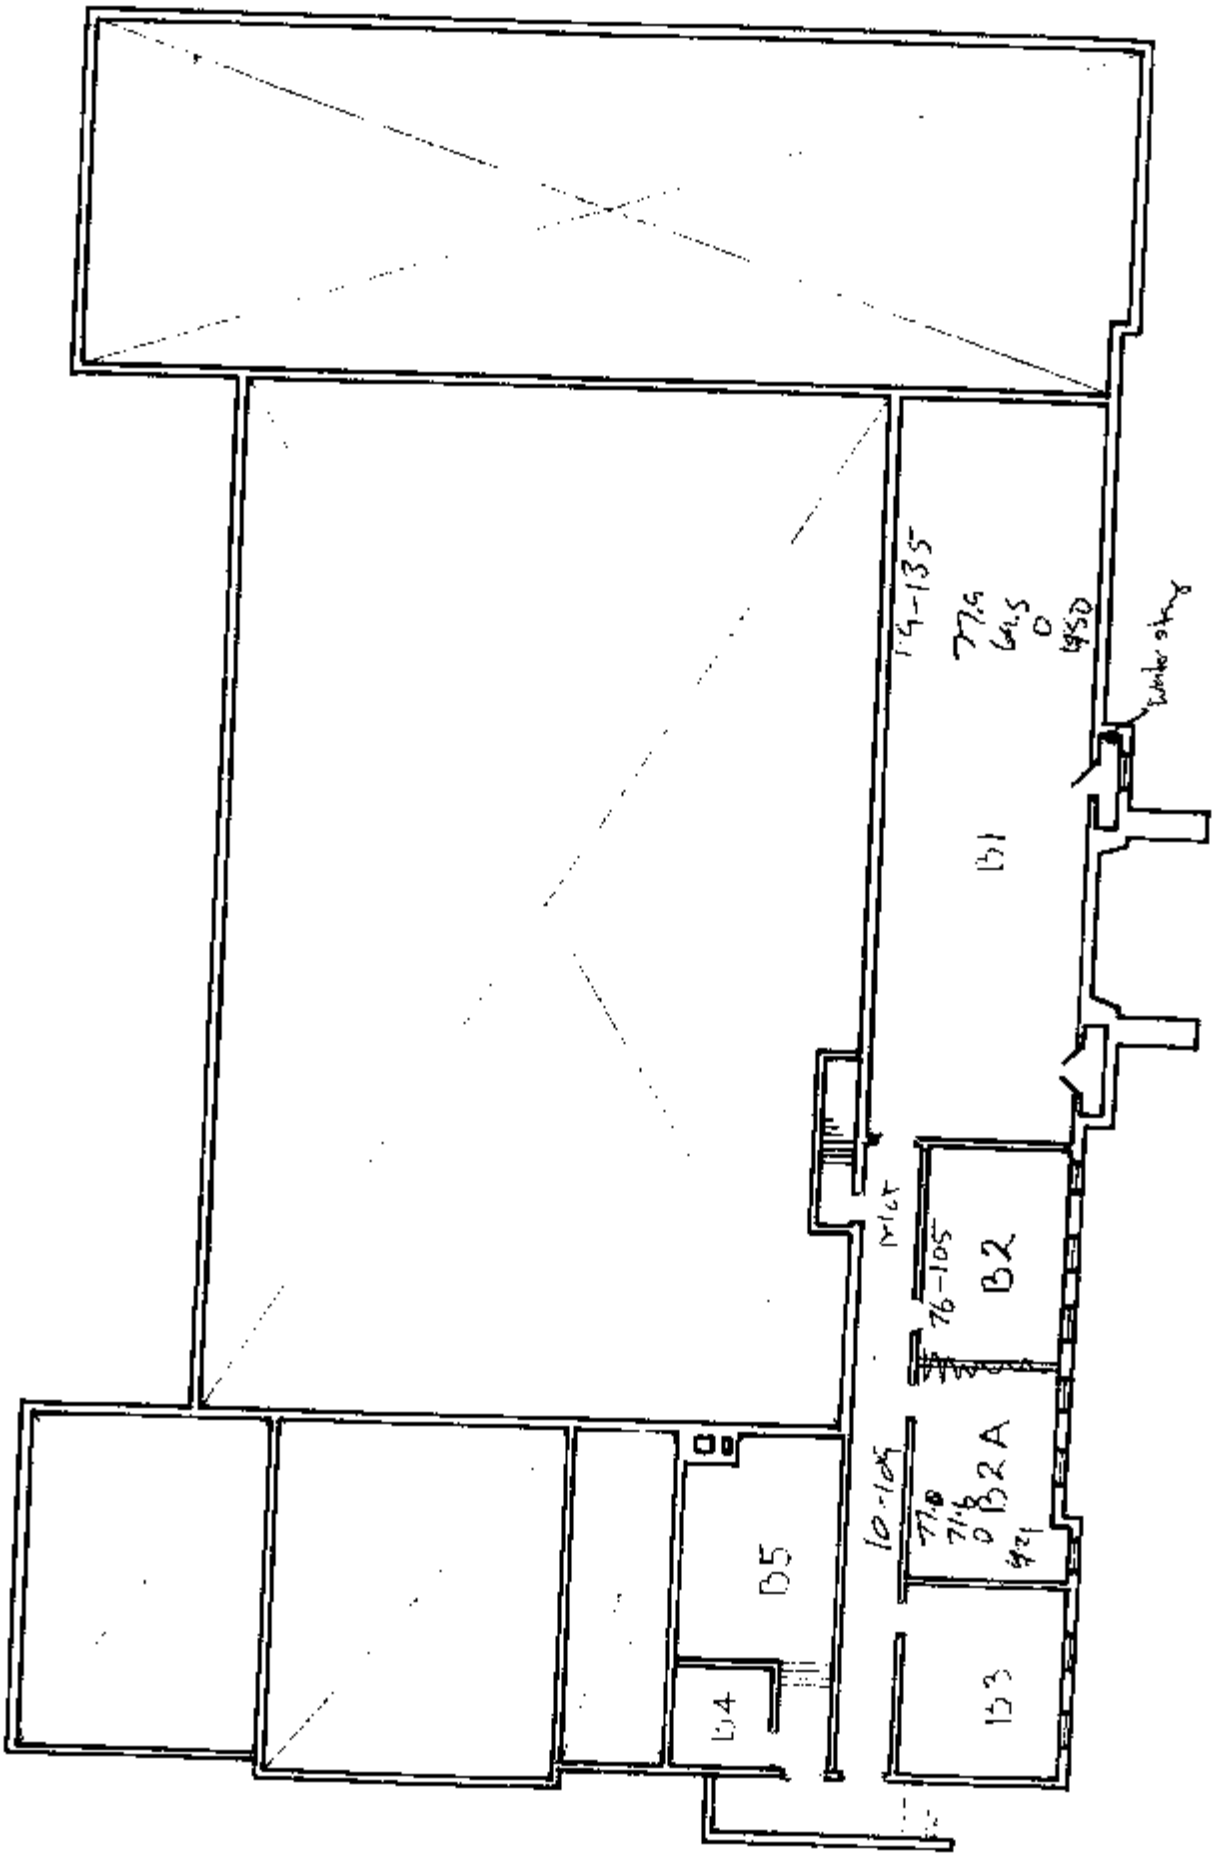

CATONSVILLE ARMORY
BASEMENT FLOOR PLAN
NO SCALE

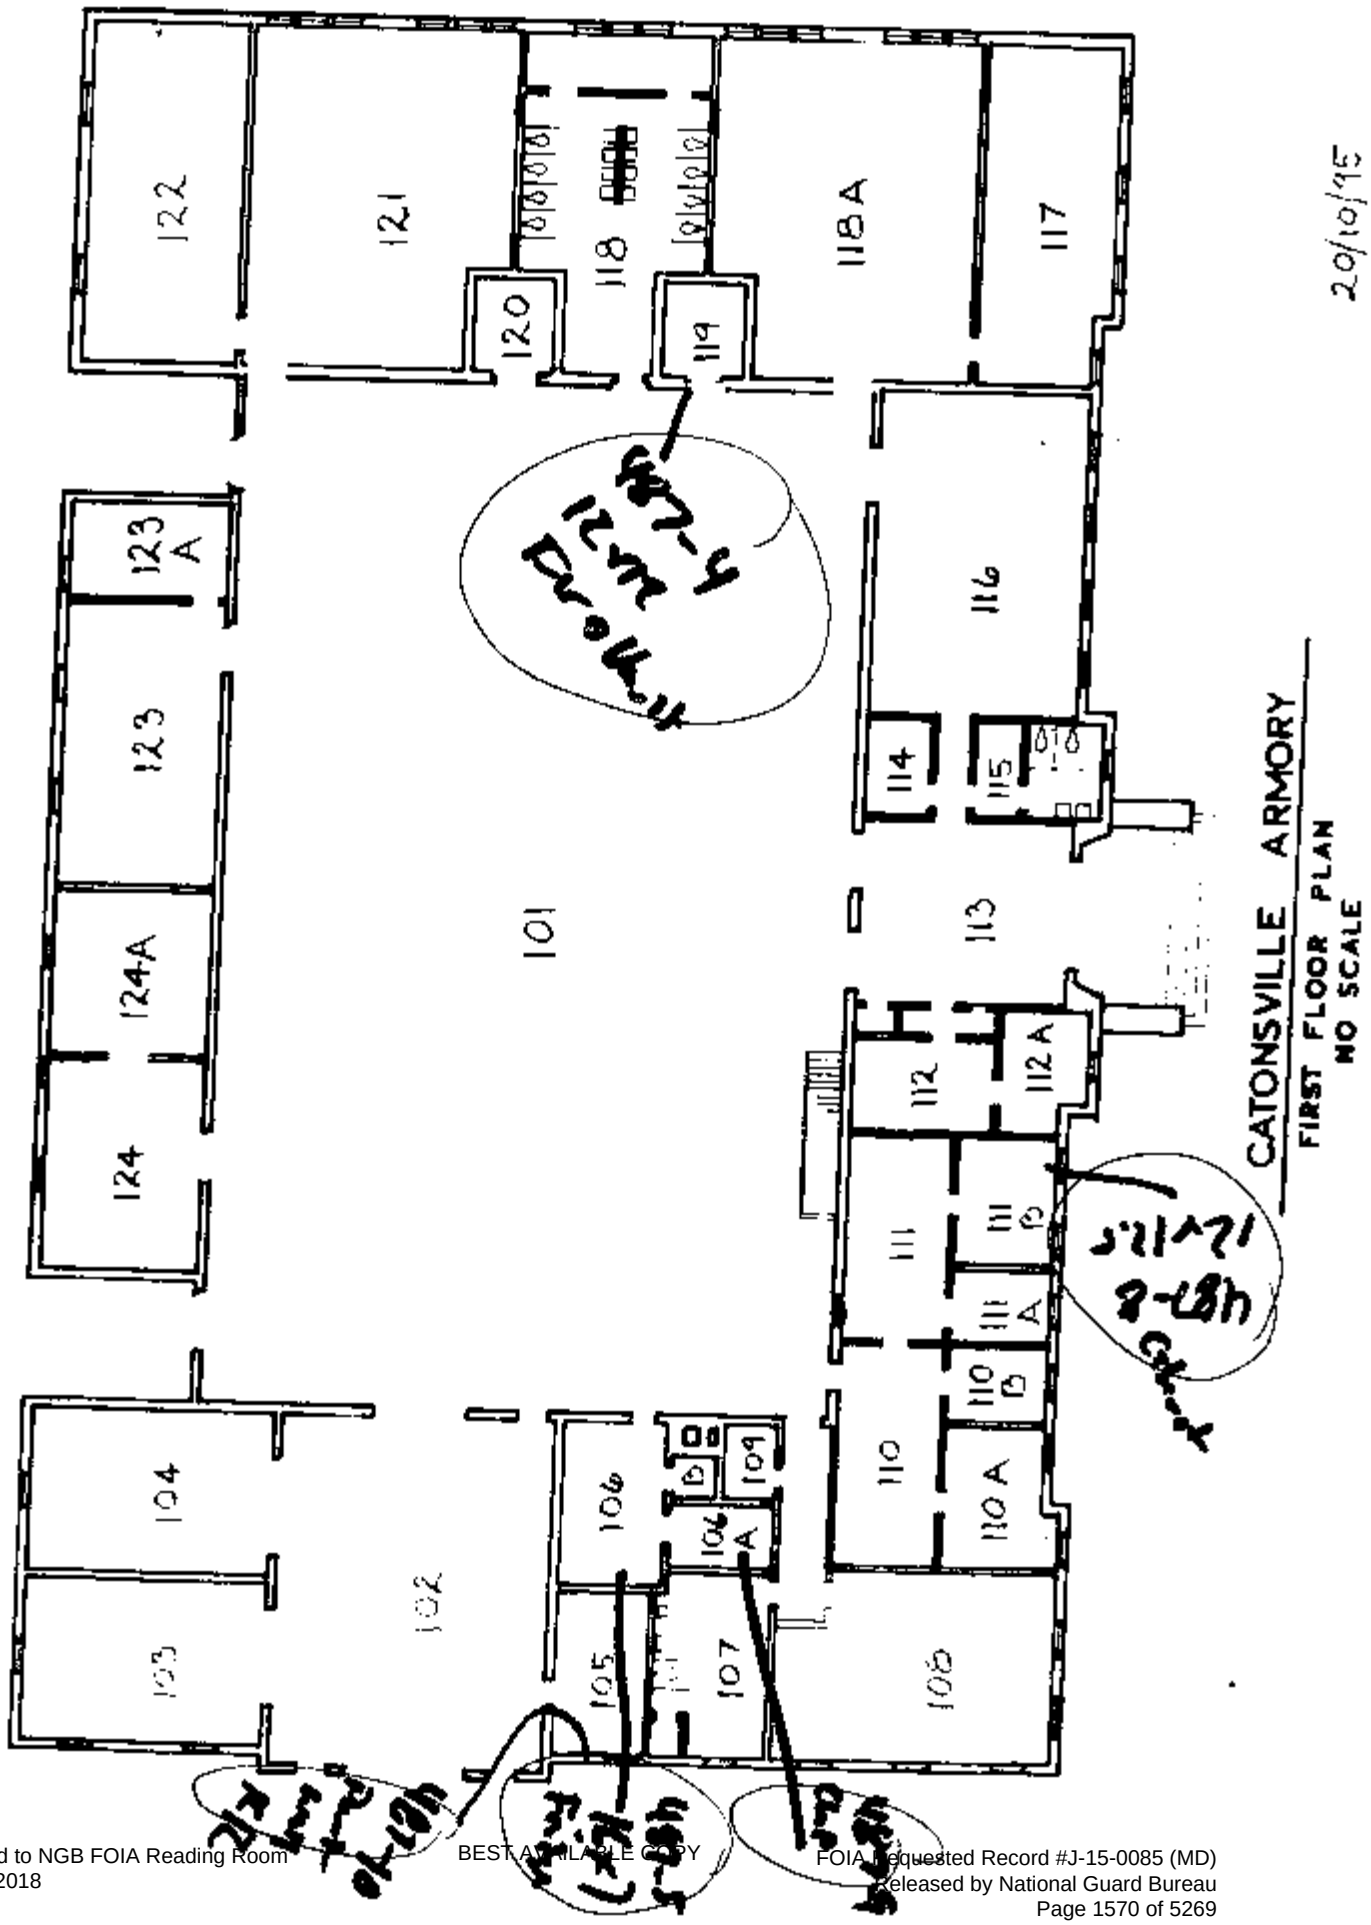
CATONSVILLE ARMORY
FIRST FLOOR PLAN
NO SCALE
101
102
103
104
104 A
105
106
107
108
109
110
110 A
110 B
111
111 A
111 B
112
112 A
113
114
115
116
117
118
118 A
119
120
121
122
123
123 A
124
124A

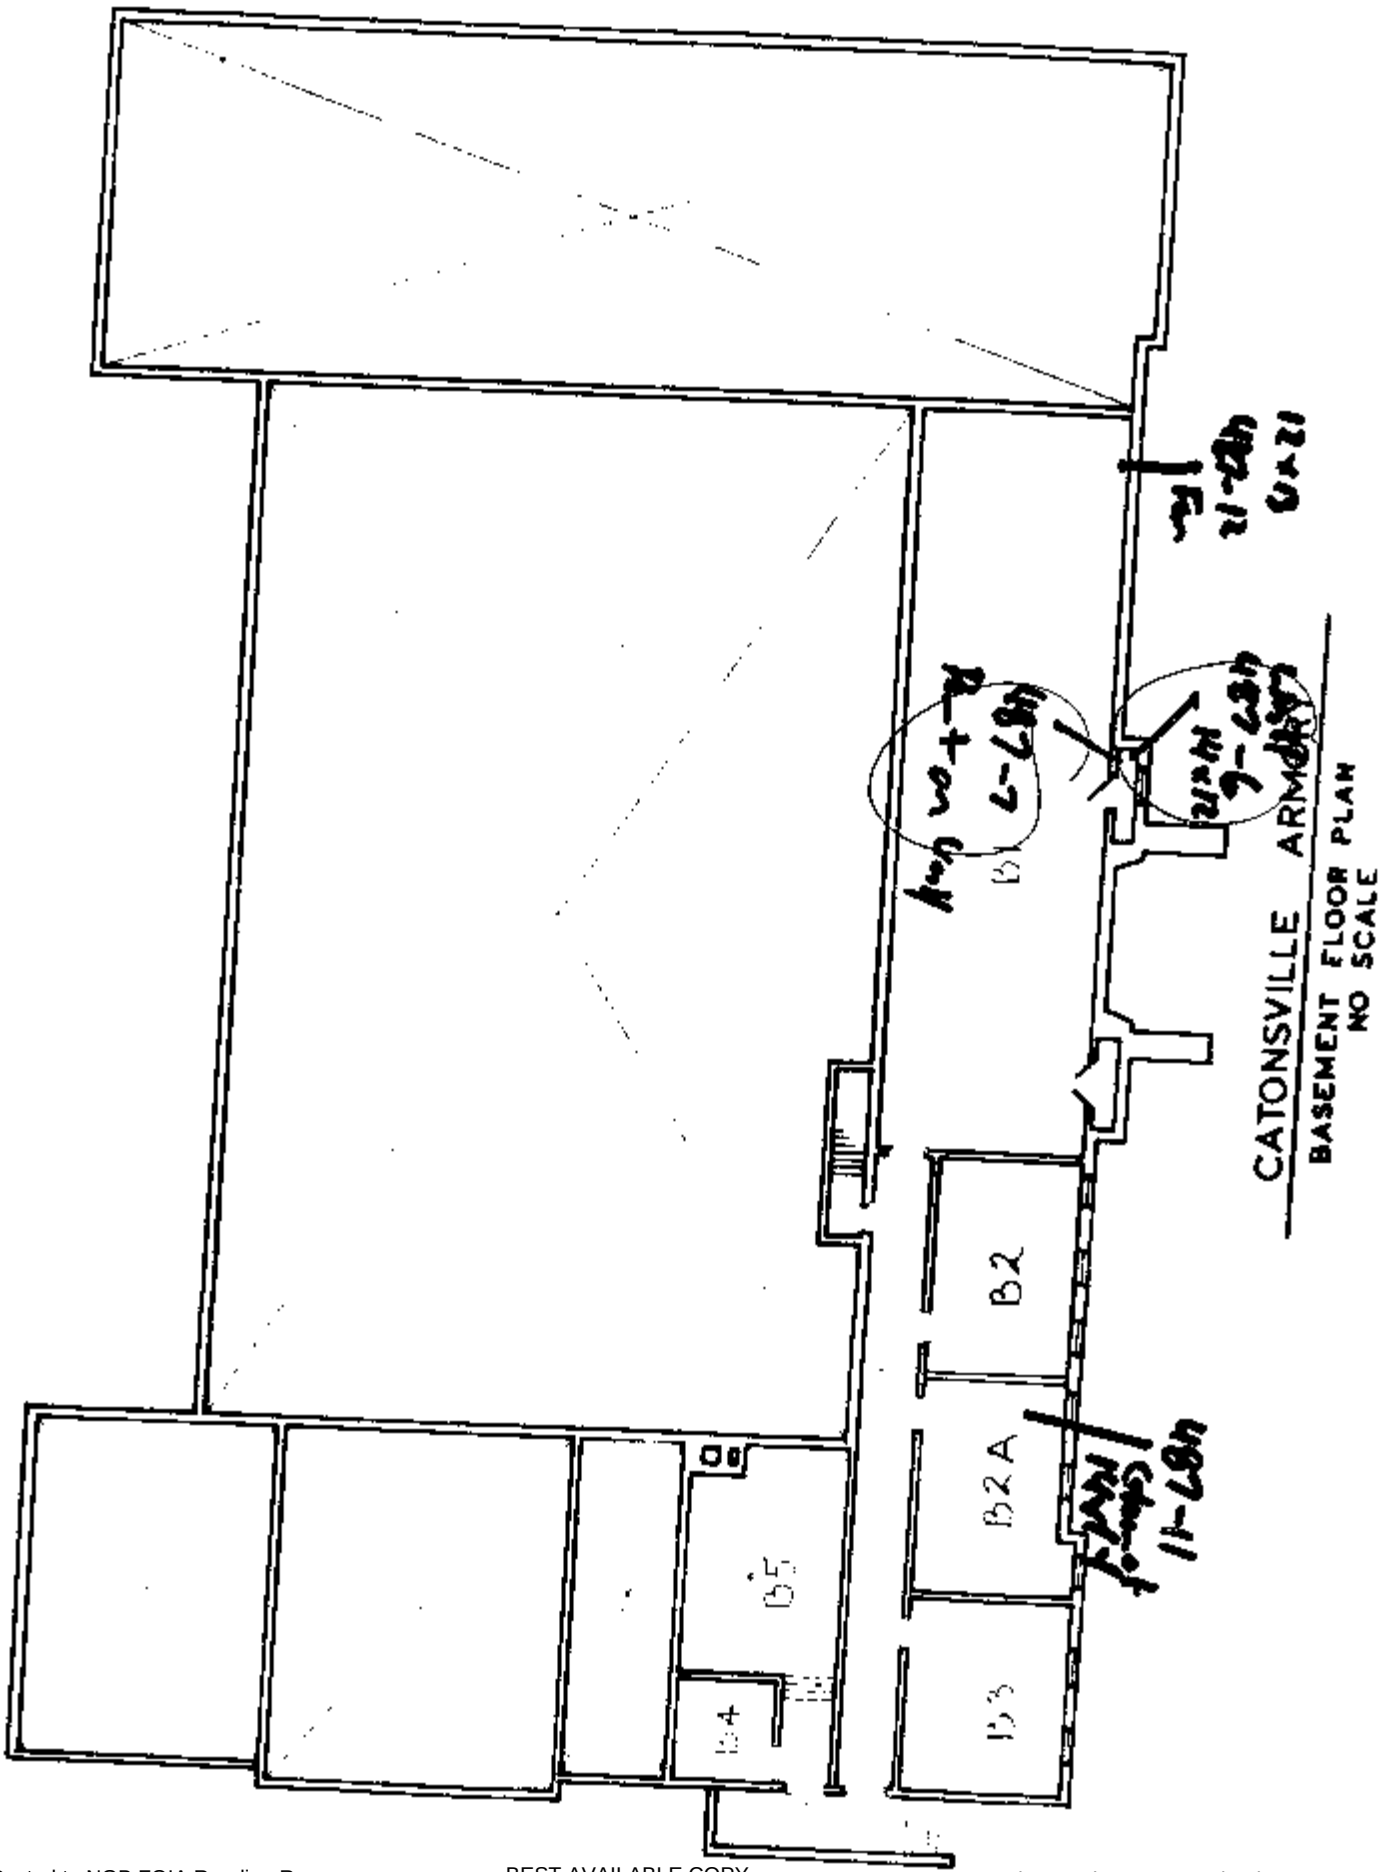
CATONSVILLE ARMORY
BASEMENT FLOOR PLAN
NO SCALE
B2
B2A
B3
B4
B5

Appendix B

Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Invoice: 95261

Client:	National Guard Bureau	**Job Name:**	RC 487 Catonsville, MD	**Chain Of Custody:**	181404
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	State Military Reservation	**Job Number:**	Not Provided	**Date Analyzed:**	9/9/2008
	Havre de Grace, Maryland	**P.O. Number:**	Not Provided	**Date Invoiced:**	9/9/2008
	21078			**Person Submitting:**	Non-Responsive

Attention: Non-Responsive

AMA Sample #	Client Sample #	Analysis and Sample Type	Turn Around	Cost	Additional Analysis and Sample Type *	Turn Around *	Additional Cost *	Total Cost
0882232	487-1	AA Lead Air	5 Day +	$8.00				$8.00
0882233	487-2	AA Lead Air	5 Day +	$8.00				$8.00
0882234	487-3	AA Lead Air	5 Day +	$8.00				$8.00
0882235	487-7	AA Lead Paint	5 Day +	$9.00				$9.00
0882236	487-9	AA Lead Paint	5 Day +	$9.00				$9.00
0882237	487-10	AA Lead Paint	5 Day +	$9.00				$9.00
0882238	487-4	AA Lead Wipe	5 Day +	$8.00				$8.00
0882239	487-5	AA Lead Wipe	5 Day +	$8.00				$8.00
0882240	487-6	AA Lead Wipe	5 Day +	$8.00				$8.00
0882241	487-8	AA Lead Wipe	5 Day +	$8.00				$8.00
0882242	487-11	AA Lead Wipe	5 Day +	$8.00				$8.00
0882243	487-12	AA Lead Wipe	5 Day +	$8.00				$8.00
0882244	487-13	AA Lead Wipe	5 Day +	$8.00				$8.00

Sub-Total:	$107.00
Additional Charge:	$0.00
Total:	$107.00

Note: Payment Due Upon Receipt.

Note: All Accounts over 30 days are subject to a 1½% per month service charge.

* Only apply if additional analysis was performed on the sample(s)

Account Code: NATLG

Remit to: P.O. Box 646, Hanover, Maryland 21076, 410-684-3327

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	RC 487 Catonsville, MD	**Chain Of Custody:**	181404		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008	**Report Date:**	9/9/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0882232	487-1	Flame	Air	1055	N/A	2.84	ug/m³	<	2.8	ug/m³	
0882233	487-2	Flame	Air	1027	N/A	2.92	ug/m³	<	2.9	ug/m³	
0882234	487-3	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0882235	487-7	Flame	Paint Chip	****	N/A	0.01	%Pb	<	0.011	%Pb	
0882236	487-9	Flame	Paint Chip	****	N/A	0.01	%Pb		0.34	%Pb	
0882237	487-10	Flame	Paint Chip	****	N/A	0.01	%Pb		0.021	%Pb	
0882238	487-4	Flame	Wipe	****	1.000	12.00	ug/ft²		160	ug/ft²	
0882239	487-5	Flame	Wipe	****	0.108	111.52	ug/ft²		2600	ug/ft²	
0882240	487-6	Flame	Wipe	****	1.167	10.29	ug/ft²	<	10	ug/ft²	
0882241	487-8	Flame	Wipe	****	1.042	11.52	ug/ft²		110	ug/ft²	
0882242	487-11	Flame	Wipe	****	1.361	8.82	ug/ft²		11	ug/ft²	
0882243	487-12	Flame	Wipe	****	1.083	11.08	ug/ft²		33000	ug/ft²	
0882244	487-13	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-10085 (MD)
Released by National Guard Bureau
Page 1574 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	RC 487 Catonsville, MD	**Chain Of Custody:**	181404
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008 **Report Date:** 9/9/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson **Technical Manager:** G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1575 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16547

Analysis Type:	Flame
Sample Type:	Air
Analysis Date:	9/8/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.103	ppm			Acceptable
Report Limit Verification Sample		0.2194	ppm	87.8%		Acceptable
Expected Spike Level (ppm)	0.25					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				106.15%		Acceptable
Spike Duplicate				104.70%	1.38%	Acceptable
Laboratory Control Sample 1		110.689	µg	105.18%		Acceptable
Laboratory Control Sample 2		113.155	µg	103.75%	1.36%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.99991

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
180767	82077	N0276-01
180767	82078	N0276-02

SDG Number: 16547

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1576 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
180767	82079	N0276-03
181402	82217	NGA-01-A
181402	82218	NGA-02-A
181402	82219	NGA-03-A
181404	82232	487-1
181404	82233	487-2
181404	82234	487-3
181417	82245	492-2
181417	82246	492-1
181417	82247	492-3
503172	82261	9408LBP-1
503172	82262	9408LBP-2
503173	82263	9208LBP-1
503173	82264	9208LBP-2
503174	82265	9508LBP-1
503174	82266	9508LBP-2
503175	82267	9308LBP-1
503175	82268	9308LBP-2

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1577 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16552

Analysis Type:	Flame
Sample Type:	Paint Chip
Analysis Date:	9/8/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.031	ppm			Acceptable
Report Limit Verification Sample		0.3418	ppm	102.6%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1		9723	mg/Kg			
Duplicate Sample 2		8821	mg/Kg		9.73%	Acceptable
Matrix Spike Analysis						
Spiked Sample				92.45%		Acceptable
Spike Duplicate				94.00%	1.66%	Acceptable
Laboratory Control Sample 1		528.377	µg	110.78%		Acceptable
Laboratory Control Sample 2		429.110	µg	94.52%	15.84%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999853

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181397	81909	486-11
181397	81910	486-12

SDG Number: 16552

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1578 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181397	81911	486-13
181397	81912	486-14
181430	82200	495-L-4
181430	82201	495-L-6
181430	82202	495-L-7
181430	82203	495-L-10
181430	82204	495-L-11
181404	82235	487-7
181404	82236	487-9
181404	82237	487-10
181417	82254	C1
181417	82255	C2
176586	82328	CBC080908-10
176586	82329	CBC080908-11

SDG Number: 16552

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1579 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16554

Analysis Type: Flame
Sample Type: Wipe
Analysis Date: 9/9/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.041	ppm			Acceptable
Report Limit Verification Sample		0.2835	ppm	85.1%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				98.87%		Acceptable
Spike Duplicate						Acceptable
Laboratory Control Sample 1		286.769	µg	102.00%		Acceptable
Laboratory Control Sample 2		315.385	µg	102.18%	0.18%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999874

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181404	82238	487-4
181404	82239	487-5

SDG Number: 16554

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1580 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181404	82240	487-6
181404	82241	487-8
181404	82242	487-11
181404	82243	487-12
181404	82244	487-13
182423	82288	DE080818-01
182423	82289	DE080818-02
182423	82290	DE080819-01
182423	82291	DE080819-02
182423	82292	DE080820-07
182423	82293	DE080826-01
182423	82294	DE080826-02
182423	82295	DE080826-03
182423	82296	DE080826-04
182423	82297	DE080826-05

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1581 of 5269

BEST AVAILABLE COPY

EI

SAMPLE CHAIN OF CUSTODY

DATE SHIPPED	# OF SAMPLES	SAMPLE MEDIA TYPE	PROJECT NAME
	13		Catonsville 181400

CONTACT	TELEPHONE NUMBER

SAMPLE # OR AREA	SAMPLE DATE	SAMPLE VOLUME	ANALYSIS REQUESTED
487-1	7/31/08	1055.36	Lead-Air
487-2		1027.53	
487-3		0	
487-7		—	Lead-Chip
487-9		—	
487-10		—	
487-4		144 in²	Lead-wipe
487-5		100 cm²	
487-6		168 in²	
487-8		150 in²	
487-11		196 in²	
487-12		156 in²	
487-13		0	
~~487~~			

Samples Relinquished By:	Signature	Date 8/01/08
Samples Received By:	Signature	Date
Samples Analyzed By:	Signature	Date

Catonsville

AMA Analytical Services, Inc.
Focused on Results
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 181404

Mailing/Billing Information:
1. Client Name: National Guard Bureau NE
2. Address 1: 301-1H Old Bay Lane
3. Address 2: Havre de Grace, MD 21078
4. Address 3:
5. Phone #: 336 455 2558 Fax #: 704 593 1650

Submittal Information:
1. Job Name: RC 487 Catonsville, MD
2. Job Location:
3. Job #: [redacted] P.O. #:
4. Contact Person [redacted] @ phone/# 336 455 2558
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: 9/11/08 ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Include COC/Field Data Sheets with Report ☒ Email: vmaisto @ ei2.com ☐ Fax: ☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
☒ Paint Chip 3 (QTY)
☒ Dust Wipe (wipe type ____) 7 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Collection Apparatus for Spore Traps:
☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:

See Attached

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 9 / 4 / 08 @ 800 Via: UPS By (Print): M. Sampson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments:

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1583 of 5269
Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

National Guard Region North

National Guard Readiness Center
Industrial Hygiene Evaluation
Catonsville Army National Guard Armory
Catonsville, MD 21228-5142

Prepared for:

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078

Attn: Non-Responsive

Prepared by:

Bonus Environmental, LLC
P.O. Box 121
Mt. Pleasant, Michigan 48804

Project No. 1061-03
August 4, 2010

Bonus Environmental, LLC

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

TABLE OF CONTENTS

1. EXECUTIVE SUMMARY 1

2. LEAD SAMPLING 2
- *2.1 Lead Wipe Sampling 2*
- *2.2 Lead Air Sampling 3*

3. PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERS 4
- *3.1 Lead Based Paint 4*
- *3.2 Presumed Asbestos Containing Materials 4*
- *3.3 Water Damage/Mold Growth 4*
- *3.4 Housekeeping 4*
- *3.5 Employee Interviews 4*
- *3.6 Indoor Air Quality 4*

4. LIGHTING SURVEY 6

5. CONCLUSION 7

BEST AVAILABLE COPY

APPENDICES

Appendix A *Shop Diagram*

Appendix B *Lead Sample Results*

Appendix C *Photographs*

Appendix D *References*

BEST AVAILABLE COPY

BEST AVAILABLE COPY

August 4, 2010
Project No. 1061-03

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078-4003

Attn: Non-Responsive

Project: Army National Guard Readiness Center, Industrial Hygiene Evaluation
Catonsville Army National Guard Armory

1.0 - EXECUTIVE SUMMARY

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Catonsville Army National Guard Readiness Center located at 130 Mellor Avenue in Catonsville, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. The following industrial hygiene and safety programs were evaluated during this industrial hygiene evaluation performed by Bonus Environmental, LLC representative Non-Responsive on May 14, 2010:

- Indoor Air Quality
- Use of items on the Hazardous Materials List
- Vehicle maintenance activities
- Lead Wipe & Air Sampling
- Illumination
- Ergonomics
- Evaluation of the physical condition of the facility in regards to peeling paint, asbestos containing materials, water damage or mold problems, and housekeeping practices.

The Catonsville Readiness Center is an Army National Guard armory comprised of offices, a drill hall, a kitchen, a classroom, locker rooms, storage rooms, and a fitness room. The point of contact for this facility was SFC David Dubois. Four (4) full-time administrative personnel are employed in the approximately 25,900 ft² facility. A shop diagram depicting the locations of the operations identified during this industrial hygiene evaluation is attached to this report as Appendix A.

The National Guard Bureau Region North Industrial Hygiene Office provided governmental furnished equipment and sampling media required to perform the industrial hygiene evaluation. Chain of custody forms for laboratories approved by the National Guard Bureau Region North Industrial Hygiene Office were provided with the sampling media. All samples collected during this industrial hygiene evaluation were sent to the National Guard Bureau Region North Industrial Hygiene Office approved laboratories for analysis.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

2.0 – LEAD SAMPLING

2.1 – Lead Wipe Sampling

Lead wipe sampling was performed according to the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame). Seventeen (17) wipe samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. The National Guard Bureau Region North Industrial Hygiene Office has established/interpreted a threshold of 200 µg/ft² of lead concentration for surface cleanliness. The following table outlines the locations and analytical results for the lead wipe samples collected during this project

Army National Guard – Catonsville Readiness Center ***Lead Wipe Sample Results***				
Sample #	***Sample Date***	***Sample Location***	***Sample Area (ft^2)***	***Sample Result ($\mu g/ft^2$)***
CV-W-1	5-14-10	Field Blank	---	< 12
CV-W-2	5-14-10	Drill hall, SE corner, on podium outside of room 111	0.111	< 110
CV-W-3	5-14-10	Drill hall, east wall, top of drinking fountain	0.111	< 110
CV-W-4	5-14-10	Drill hall, north wall, top of basketball hoop retractor box	0.111	< 110
CV-W-5	5-14-10	Drill hall, floor, north "free throw" line	0.111	< 110
CV-W-6	5-14-10	Drill hall, floor, south "free throw" line	0.111	< 110
CV-W-7	5-14-10	Kitchen room 106, east wall, top of "Panel F" control box	0.111	< 110
CV-W-8	5-14-10	Room B3, SW corner, desk surface	0.111	< 110
CV-W-9	5-14-10	Room B1 (Fitness room, former indoor firing range), NE corner, east wall, exhaust ventilation fan blade	0.111	10,000
CV-W-10	5-14-10	Room B1 (Fitness room, former indoor firing range), west side-center of room, on light fixture	0.111	< 110
CV-W-11	5-14-10	Room B1 (Fitness room, former indoor firing range), south side, top of "speed bag" fixture	0.111	< 110
CV-W-12	5-14-10	Room B1 (Fitness room, former indoor firing range), center of room, floor	0.111	< 110
CV-W-13	5-14-10	Hallway outside of room B1, NW corner of hallway, top of "Panel B" box	0.111	< 110
CV-W-14	5-14-10	Room 108, west side, on bar counter top	0.111	< 110
CV-W-15	5-14-10	Lobby area 113, NE corner, NE corner, top of heating register	0.111	< 110
CV-W-16	5-14-10	Room 118A, west side, top of locker 176	0.111	140
CV-W-17	5-14-10	Room 121, along north wall, desk surface	0.111	< 110
CV-W-18	5-14-10	Room 102, SW corner, top of "Diesel pump" circuit breaker box	0.111	560

Surface cleanliness threshold = < 200 µg/ft²

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1588 of 5269

BEST AVAILABLE COPY

2.2 – Lead Air Sampling

The purpose of lead air monitoring was to document task-specific activities and corresponding exposures to lead. Occupational Safety and Health Administration (OSHA) 29 CFR 1926.62 requires employers whose employees are exposed to lead in the work place, in any quantity, make a determination whether any employee's exposure exceeds the action level (AL) of 30 µg/m^3 or the maximum permissible exposure limit (PEL) of 50 µg/m^3 as 8-hour time weighted averages (TWAs). If employee exposures are less than 30 µg/m^3, training is required under the Hazard Communication 29 CFR 1926.59. Exposures that exceed the AL or PEL require the employer to comply with additional requirements, including air monitoring, additional training, and restricted work practices as outlined in OSHA 29 CFR 1926.62.

Representative fixed area sampling was conducted for potential airborne concentrations of lead in accordance with accepted Industrial Hygiene methods recognized by the National Institute for Occupational Safety and Health (NIOSH) and OSHA.

Lead exposure monitoring was performed in accordance with the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame) with SKC personal air sampling pumps calibrated to 2.0 liters per minute. All samples were collected on 37 mm diameter cassettes with mixed-cellulose ester filters. All sampling pumps were calibrated before and after each use to ensure volume accuracy. Two (2) samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. Analytical results of the lead wipe and air samples are attached to this report as Appendix B.

Army National Guard – Catonsville Readiness Center
Lead Air Sample Results

Sample #	Sample Type	Sample Location	Flow Rate	Start	Stop	Vol.	Reprt. Limit (µg/m³)	Results (µg/m³)	8 hr TWA (µg/m³)
May 14, 2010									
CV-A-1	FB	Field Blank	---	---	---	0	3	< 3	N/A
CV-A-2	IWA	Drill hall, SE corner, outside of room 110	2.0	0853	1538	810	3.7	< 3.7	N/A
CV-A-3	IWA	Room B1 (Fitness room, former indoor firing range), north end, east side along wall	2.0	0854	1539	810	3.7	< 3.7	N/A

PS = Personal sample, **IWA** = Inside work area, **N/A** = Not Applicable
Note: The OSHA PEL of 50 µg/m³ is averaged over an 8 hr work shift

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1589 of 5269

BEST AVAILABLE COPY

3.0 - PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERNS

3.1 - Lead Based Paint

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC performed a visual inspection of the facility in regards to lead based paint. Bonus Environmental, LLC identified no areas of peeling paint which could potentially pose a lead exposure hazard.

3.2 – Presumed Asbestos Containing Materials

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC performed a visual inspection to identify presumed asbestos containing materials (PACM) and, if found, to note their condition. Bonus Environmental, LLC did not identify any PACM that was considered to be in poor or damaged condition.

3.3 - Water Damage/Mold Growth

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC performed a visual inspection to report the location and perform an evaluation of any water damaged or visible mold problems. Bonus Environmental, LLC identified no water-damaged and/or moldy building materials during the survey.

3.4 - Housekeeping

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC performed an evaluation of the housekeeping practices. Bonus Environmental, LLC found the housekeeping to be in good order.

3.5 – Employee Interviews

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC performed interviews and made observations to determine if the work activities being performed possessed any ergonomic concerns. Following the interviews and observations, no concerns or employee complaints were identified.

3.6 – Indoor Air Quality

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC measured temperature, relative humidity, carbon monoxide (CO), and carbon dioxide (CO_2) throughout the facility. A calibrated TSI Q-Trak Model 7565 Indoor Air Quality Monitor equipped with a Q-Trak Probe 982 was utilized to record indoor air quality measurements.

Carbon dioxide is a natural component of air and the amount of CO_2 in a given air sample is commonly expressed as parts per million (ppm). The outdoor air in most locations contains about 380 ppm carbon dioxide. Higher outdoor CO_2 concentrations can be found near vehicle traffic areas, industry and sources of combustion. The concentrations of CO_2 found in most offices are well below the OSHA Permissible Exposure Limit (PEL) of 5,000 ppm when averaged over an 8-hour time period for an industrial workplace. While levels below 5,000 ppm are considered to pose no serious health threat, studies have indicated that individuals in offices with elevated CO_2 concentrations tend to report drowsiness, lethargy and a general sense that the air is stale. Ventilation rates for office spaces are

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1590 of 5269

BEST AVAILABLE COPY

defined by various codes and standards. The most widely accepted standard is the American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE) Standard 62. According to ASHRAE Standard 62.1-2007, CO_2 concentrations below 700 ppm above the outdoor level are considered to indicate adequate ventilation and provide human comfort. The CO_2 measurements collected during this industrial hygiene evaluation ranged from 406 ppm to 679 ppm and indicate adequate ventilation within the facility.

Carbon monoxide, also known as the "silent killer," is a colorless, odorless, poisonous gas that results from the incomplete burning of common fuels such as natural or liquefied petroleum gas, oil, wood or coal. When carbon monoxide is inhaled, it enters the blood stream and reduces the ability of the blood to carry oxygen to vital organs, such as the heart and brain. Because it is impossible to see, taste or smell the toxic fumes, CO can harm you before you are aware it is in your work area. At lower levels of exposure, CO causes mild effects that are often mistaken for the flu. These symptoms include headaches, dizziness, disorientation, nausea and fatigue. The effects of CO exposure can vary greatly from person to person depending on age, overall health and the concentration and length of exposure. The OSHA has established a PEL of 50 ppm. OSHA standards prohibit worker exposure to more than 50 parts of the gas per million parts of air averaged during an 8-hour time period. The peak CO level for employees is 200 ppm. The CO measurements collected during this industrial hygiene evaluation ranged from 0.9 ppm to 1.6 ppm. CO levels were well below the OSHA PEL during this industrial hygiene evaluation.

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC collected temperature measurements. Temperature measurements throughout the facility ranged from 65.7ºF to 71.5ºF and are considered to be within an acceptable range.

During the industrial hygiene evaluation of the Army National Guard Catonsville Readiness Center, Bonus Environmental, LLC collected relative humidity measurements. Relative humidity measurements throughout the facility ranged from 58.6% to 78.7% and are considered to be within an acceptable range. Indoor air quality measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard – Catonsville Readiness Center
Indoor Air Quality Measurements

Location	*CO_2 (ppm)*	*CO (ppm)*	*Relative Humidity (%)*	*Temperature (ºF)*
Outdoors, east side of building	388	1.8	80.5	65.5
Lobby area 113	416	1.5	78.7	66.8
Boiler room B5	415	1.6	72.8	71.5
Fitness room B1	439	0.9	58.6	68.1
Room 108	430	1.2	65.6	67.9
Room 110	679	1.1	60.7	68.6
Drill hall room 101	417	1.3	69.8	68.1
Room 116	414	1.4	70.5	67.8
Room 121	428	1.2	63.2	66.4

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1591 of 5269

BEST AVAILABLE COPY

Army National Guard – Catonsville Readiness Center Indoor Air Quality Measurements				
Location	*CO_2 (ppm)*	*CO (ppm)*	*Relative Humidity (%)*	*Temperature (ºF)*
Room 104	406	1.2	71.3	65.7
Kitchen room 106	461	1.3	74.8	66.4

Required/Recommended Values
CO_2 *- OSHA PEL = 5,000 ppm and ASHRAE Standard 62.1-2007 = no greater than 700 ppm above outdoor*
CO *- OSHA PEL = 50 ppm and OSHA Ceiling Limit = 200 ppm*
Temperature *- ASHRAE Standard 55-2004 = between approximately 67 and 82 °F.*
RH *– ANSI/ASHRAE Standard 62.1-2007 = <65%*

4.0 – LIGHTING

Utilizing a properly calibrated Cooke Corporation cal-Light 400 light meter, Bonus Environmental, LLC collected illumination readings throughout the facility. Illumination measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard – Catonsville Readiness Center Lighting Survey			
Location	*Measurement in Foot Candles*	*Requirement in Foot Candles*	*Requirement Met?*
Room B5 – Boiler room	23.1	30	NO
Room B4 – Storage	7.6	30	NO
Room B3 – Lounge	44.9	10	YES
Room B2A – Lounge	152.4	10	YES
Room B2 – Lounge	122.6	10	YES
Room B1 – Fitness room	110.4	30	YES
Room 103 – Office	16.3	50	NO
Room 104 – Storage	8.5	30	NO
Room 102 – Storage	5.9	30	NO
Room 105/106 – Kitchen	61.7	10	YES
Room 106A – Storage	108.0	30	YES
Room 109 – Storage	24.8	30	NO
Room 107 – Restroom	15.9	5	YES
Room 108 – Lounge	69.4	10	YES
Room 110 – Office	100.8	50	YES
Room 110A – Office	52.2	50	YES
Room 110B – Office	49.5	50	NO
Room 111 – Office	116.4	50	YES
Room 111A – Office	46.1	50	NO
Room 111B – Office	153.1	50	YES
Room 112 – Recruiter's office	61.4	50	YES
Room 112A – Recruiter's office	54.9	50	YES
Room 113 – Lobby	27.7	5	YES
Room 114 – Storage	5.9	30	NO
Room 115 – Restroom	35.1	5	YES
Room 116 – Classroom	130.9	30	YES

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1592 of 5269

BEST AVAILABLE COPY

Army National Guard – Catonsville Readiness Center Lighting Survey			
Location	*Measurement in Foot Candles*	*Requirement in Foot Candles*	*Requirement Met?*
Room 117 – Storage	96.6	30	YES
Room 118A – Locker room	7.8	7	YES
Room 119 & 120 – Vaults	Inaccessible		
Room 118 – Restroom	12.8	5	YES
Room 122 – Storage	10.8	30	NO
Room 121 – Storage	29.7	30	NO
Room 123A – Storage	55.0	30	YES
Room 123 – Storage	18.1	30	NO
Room 124/124A – Storage	67.6	30	YES
Room 101 – Drill hall	28.4	30	NO

Lighting levels were compared to the levels outlined within the ANSI/IESNA RP-1-04 Office Lighting Handbook, and the ANSI/IESI RP-7-01 Lighting Industrial Facilities Handbook. Areas within the facility which did not meet the foot candle requirements are identified with a "NO" within the Requirement Met? column. It is recommended that illumination be improved in all the areas that did not meet the requirements. Improving illumination can be achieved by replacing burned-out lamps/bulbs, cleaning fixtures, relocating detailed work activities to more illuminated areas, and using supplemental task lighting.

5.0 - CONCLUSION

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Catonsville Army National Guard Readiness Center located at 130 Mellor Avenue in Catonsville, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. An industrial hygiene evaluation of the facility was performed by Bonus Environmental, LLC representative Non-Responsive on May 14, 2010.

Bonus Environmental, LLC recommends that any areas of concerns outlined within this report be evaluated to ensure the necessary actions are made. Following the completion of the industrial hygiene evaluation, Bonus Environmental, LLC found the following safety and/or indoor air quality conditions of the facility to be within acceptable levels/condition in regards to the following:

- Carbon Dioxide
- Carbon Monoxide
- Presumed Asbestos-Containing Materials
- Housekeeping
- Lead Air Samples
- Ergonomics
- Temperature
- Relative Humidity

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1593 of 5269

BEST AVAILABLE COPY

It has been a pleasure to be of assistance to you. Please contact us if you have any questions concerning this report or if we can be of any further assistance in any other environmental or occupational health matter.

Sincerely,

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Bonus Environmental, LLC ***P.O. Box 121*** ***Mt. Pleasant, MI 48804***
Work 989-779-7686 ***Fax 989-779-7689*** ***www.bonusenvironmental.com***

BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1594 of 5269

Appendix A

Shop Diagram

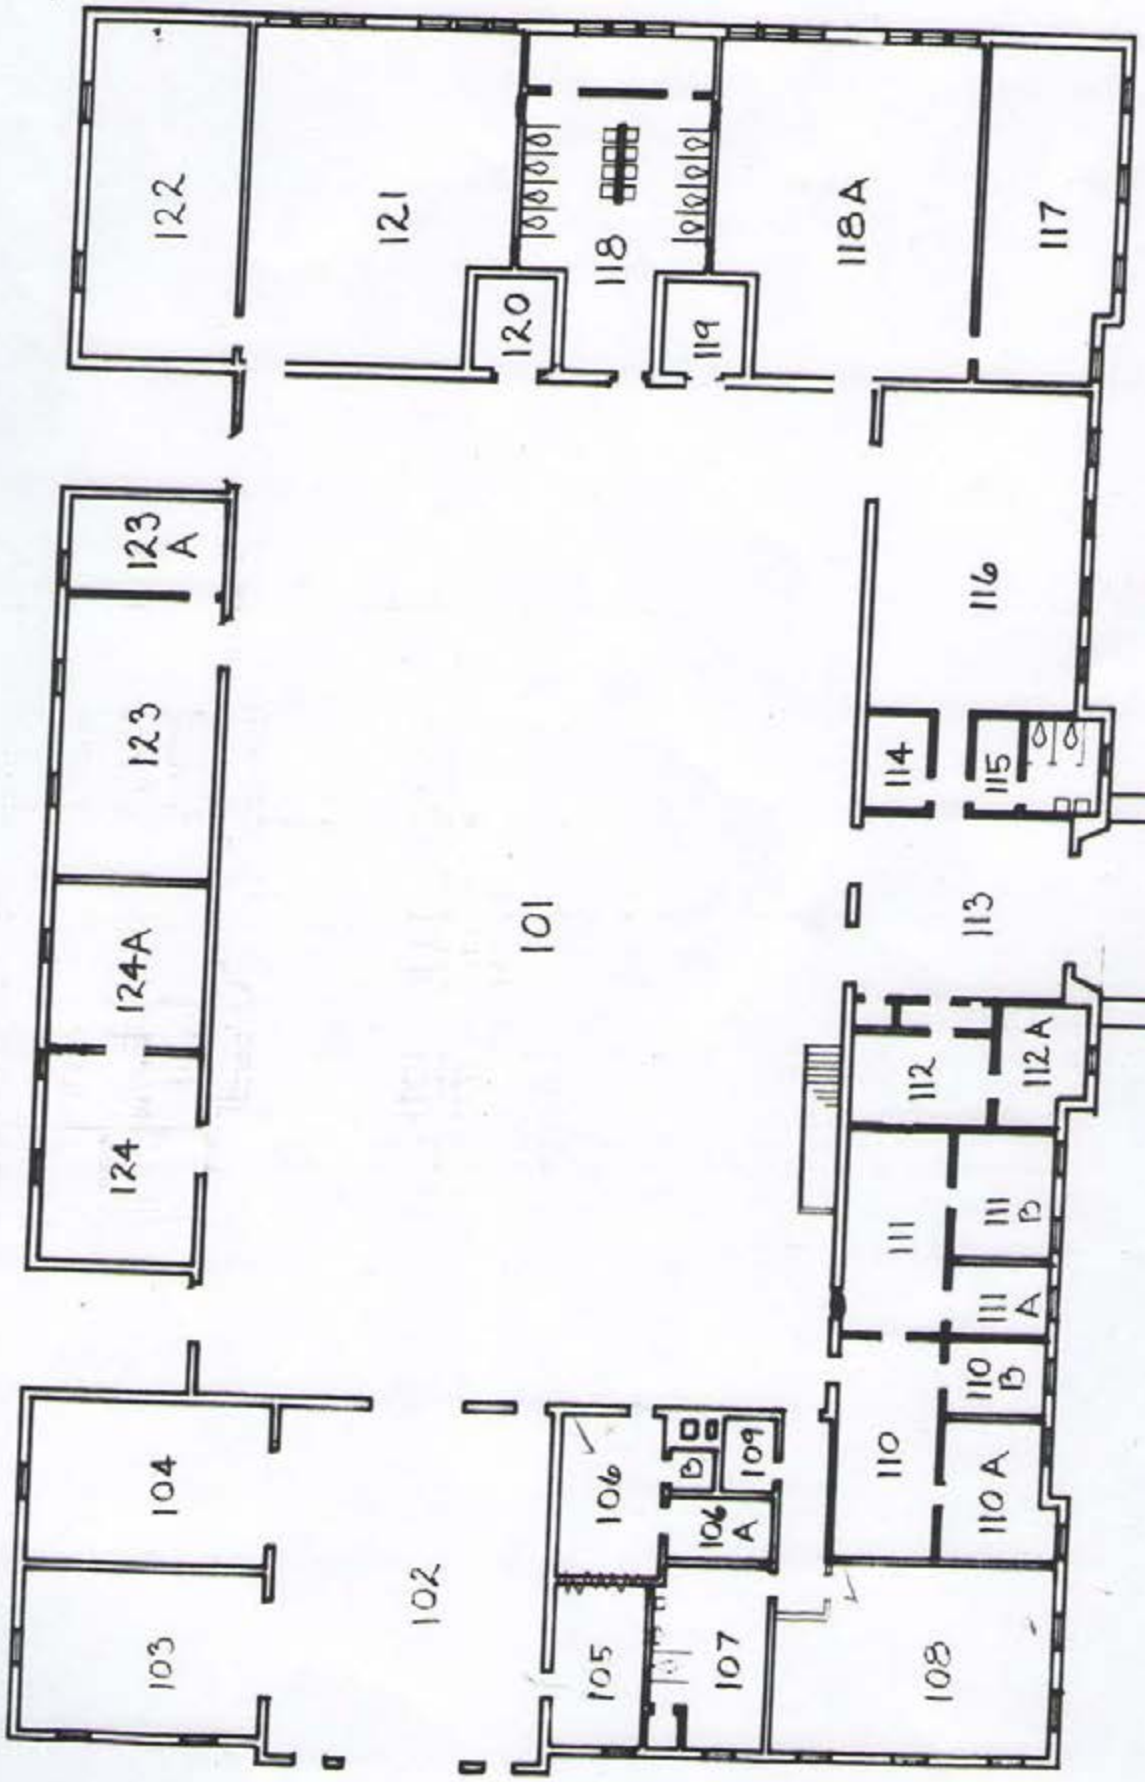

CATONSVILLE ARMORY
FIRST FLOOR PLAN
NO SCALE

20/10/95

BEST AVAILABLE COPY

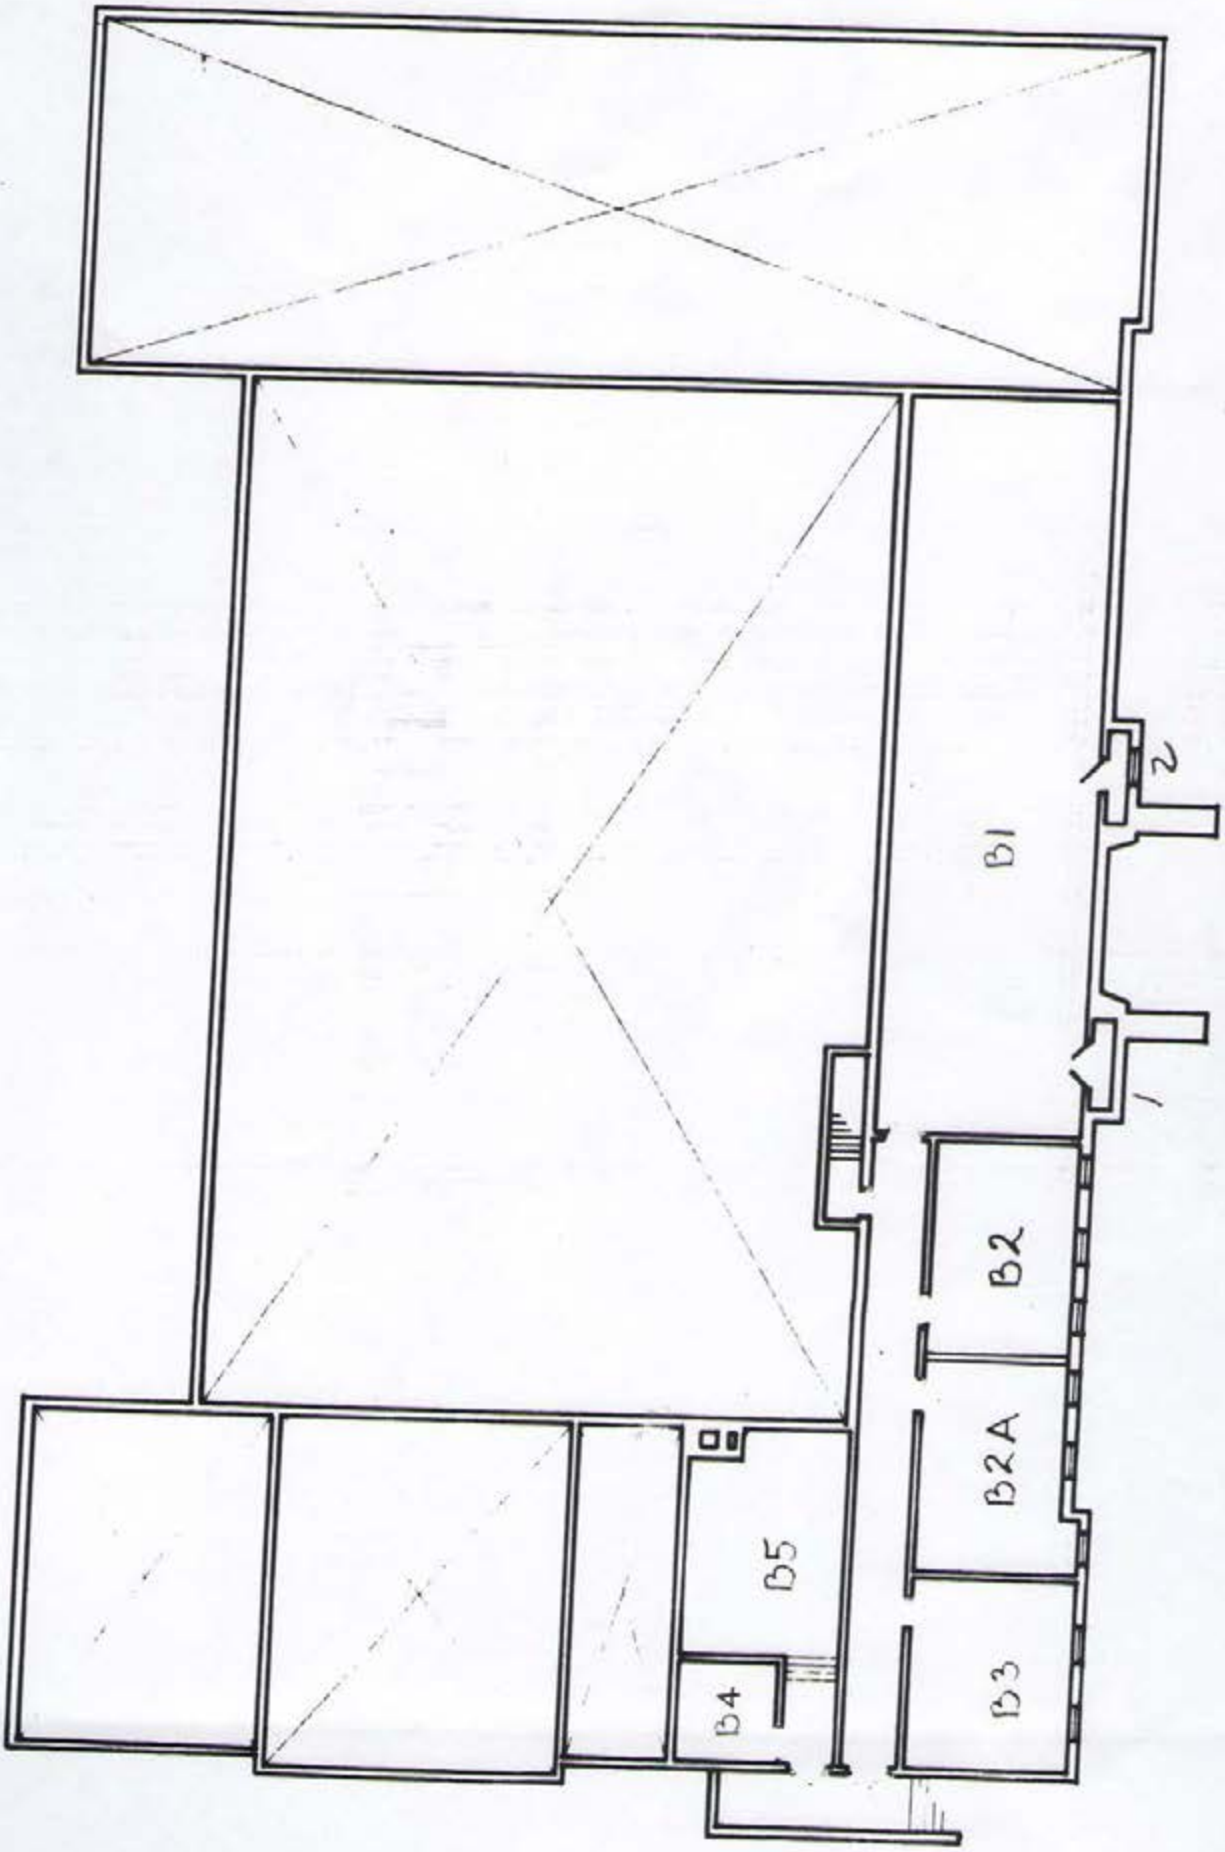

CATONSVILLE ARMORY
BASEMENT FLOOR PLAN
NO SCALE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B

Lead Sample Results

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

RECEIVED JUN 14 2010

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client: National Guard Bureau

Address: 301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation

Havre de Grace, Maryland 21078

Attention: [redacted]

Job Name: Catonsville Armory

Job Location: Catonsville,MD

Job Number: Catonsville Armory

P.O. Number: W912K6-09-A-0003

Chain Of Custody: 507187

Date Submitted: 5/21/2010

Person Submitting: [redacted]

Date Analyzed: 5/28/2010 **Report Date:** 6/1/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047824	CV-A-1	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1047825	CV-A-2	Flame	Air	810	N/A	3.7	ug/m³	<3	<3.7	ug/m³	
1047826	CV-A-3	Flame	Air	810	N/A	3.7	ug/m³	<3	<3.7	ug/m³	
1047827	CV-W-1	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1047828	CV-W-2	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047829	CV-W-3	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047830	CV-W-4	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047831	CV-W-5	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047832	CV-W-6	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047833	CV-W-7	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047834	CV-W-8	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047835	CV-W-9	Flame	Wipe	****	0.111	110	ug/ft²	1200	10000	ug/ft²	
1047836	CV-W-10	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047837	CV-W-11	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047838	CV-W-12	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047839	CV-W-13	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047840	CV-W-14	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047841	CV-W-15	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047842	CV-W-16	Flame	Wipe	****	0.111	110	ug/ft²	15	140	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1599 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client: National Guard Bureau

Address: 301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation
Havre de Grace, Maryland 21078

Attention: [redacted]

Job Name: Catonsville Armory

Job Location: Catonsville,MD

Job Number: Catonsville Armory

P.O. Number: W912K6-09-A-0003

Chain Of Custody: 507187

Date Submitted: 5/21/2010

Person Submitting: [redacted]

Date Analyzed: 5/28/2010 **Report Date:** 6/1/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047843	CV-W-17	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047844	CV-W-18	Flame	Wipe	****	0.111	110	ug/ft²	62	560	ug/ft²	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: Nida McGarvey

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1600 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 19394

Analysis Type: Flame
Sample Type: Wipe
Analysis Date: 5/28/2010

		Result		Percent Recovery	RPD	Comment
Preparation Blank		0.037	ppm			Acceptable
Report Limit Verification Sample		0.317	ppm	95.1%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1			mg/Kg			
Duplicate Sample 2			mg/Kg			Acceptable
Matrix Spike Analysis						
Spiked Sample						Acceptable
Spike Duplicate						Acceptable
Laboratory Control Sample 1		259.328	µg	103.33%		Acceptable
Laboratory Control Sample 2		222.761	µg	102.94%	0.38%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999698

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507188	47799	FR-W-21
507186	47823	JI-W-21

SDG Number: 19394

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1601 of 5269

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507187	47827	CV-W-1
507187	47828	CV-W-2
507187	47829	CV-W-3
507187	47830	CV-W-4
507187	47831	CV-W-5
507187	47832	CV-W-6
507187	47833	CV-W-7
507187	47834	CV-W-8
507187	47835	CV-W-9
507187	47836	CV-W-10
507187	47837	CV-W-11
507187	47838	CV-W-12
507187	47839	CV-W-13
507187	47840	CV-W-14
507187	47841	CV-W-15
507187	47842	CV-W-16
507187	47843	CV-W-17
507187	47844	CV-W-18

SDG Number: 19394

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Focused on Results!!

NVLAP 101143-0

NY ELAP 10920

AIHA Environmental Lead & Industrial Hygiene — AIHA Environmental Microbiology 100470

Submitting Samples for National Guard Jobs

1) All samples shall be submitted to AMA Analytical Services, Attn: Sample Receiving, utilizing the enclosed Chain-of-Custody Form. The highlighted areas must be completed by the Subcontractor, however, the Sample Information/Analysis/Matrix section will not need to be completed if field date sheets are submitted with the samples. Please be sure to include a contact phone number for the person submitting the samples.
2) Results shall be reported via email to the following persons:
   a. National Guard Subcontractor [redacted] @bonusenvironmental.com
   b. [redacted] CIV NGB: [redacted] @us.army.mil
   c. [redacted] CIV NGB [redacted] .army.mil
3) Hard Copy Reports & Invoices shall be handled in the following manner:
   a. Original Invoices and Copies of Reports shall be sent to the National Guard
      National Guard Bureau
      Attn: [redacted]
      301-IH Old Bay Lane
      Attn: NGB-AVN-SI, State Military Reservation
      Havre de Grace, Maryland 21078
   b. Original Reports shall be sent the National Guard Subcontractor

      Attn: [redacted]
      office: 989-779-7686
      cell: 989-621-3862
4) All Pb Wipes shall be handled in the following manner:
   a. All samples shall be analyzed utilizing FLAA procedures
   b. Samples whose results are reported as less than the reporting limit, and the reporting limit is greater than 40ug/ft2 shall be re-analyzed utilizing GFAA procedures.
5) All other samples – Pb Paints, Soils, & Airs, PCM Airs, PLM Bulks, TEM Airs, & TEM Bulks shall be analyzed utilizing standard analytical procedures

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1603 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1604 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) Sheet 1 of 2

507187

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Catonsville Armory
2. Job Location: Catonsville, MD
3. Job #: Catonsville Armory PO #: W912K6-09-A-0003
4. Contact Perso[redacted] @ phone # (410) 942-0273
5. Submitted By: [redacted] Signature: [redacted]

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due: ____
❑ 24 Hours Time Due: ____
Comments: ____

Reporting Information (Results will be provided as soon as technically feasible):

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day + Date Due: 5-28-10
❑ 2 Day
❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
☒ Incl[redacted]th Report
☒ [redacted] bonusenvironmental.com
❑ Fax: [redacted] us.army.mil
❑ Verba[redacted] us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)

TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

☑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
❑ Pb Paint Chip ____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 18 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
❑ Waste Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
CV-A-1	Field Blank	5-14	0	—												
CV-A-2	Drill Hall		810	—				X		X						
CV-A-3	Rm B1		810	—				X		X						
CV-W-1	Field Blank		—	—				X		X						
CV-W-2	Drill Hall		—	4"x4"				X				X				
CV-W-3	Drill Hall		—					X				X				
CV-W-4	Drill Hall		—					X				X				
CV-W-5	Drill Hall		—					X				X				
CV-W-6	Drill Hall		—					X				X				
CV-W-7	Kitchen		—					X				X				
CV-W-8	Rm B3		—					X				X				
CV-W-9	Rm B1		—					X				X				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 21 / 10 @ 9:45 Via: FedEx By (Print): Sarat Watson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: MMI Date: 6 / 1 / 10 Time: 19 05 Initials: NM
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) Sheet 2 of 2

507187

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SL State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Catonsville Armory
2. Job Location: Catonsville, MD
3. Job #: Catonsville Armory
4. Contact Perso[redacted] PO #: W912K6-09-A-0003
5. Submitted by: [redacted] @ phone # (410) 942-0270
[redacted]

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due: ____
❑ 24 Hours Time Due: ____
Comments: ____

Reporting Information (Results will be provided as soon as technically feasible):

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day +
❑ 2 Day Date Due: ____
❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
☒ Inc[redacted] with Report
☒ Em[redacted] bonu/environmental.com
❑ Fa[redacted] us.army.mil
❑ Ver[redacted] us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)

TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

❑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
❑ Pb Paint Chip ____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 18 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
CV-W-10	Rm B1	5-14	—	4"x4"				*				*				
CV-W-11	Rm B1		—					*				*				
CV-W-12	Rm B1		—					*				*				
CV-W-13	Basement Hallway		—					*				*				
CV-W-14	Rm 108		—					*				*				
CV-W-15	Rm 113		—					*				*				
CV-W-16	Rm 118 A		—					*				*				
CV-W-17	Rm 121		—					*				*				
CV-W-18	Rm 102		—					*				*				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1605 of 5269

Appendix C

Photographs

BEST AVAILABLE COPY

Building exterior, east side entrance

Rm. B1, current fitness room, former indoor firing range

Drill Hall

Rm. 104 Storage of chemicals

Rm. 102, PPE board

Building exterior, SW of building

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1607 of 5269

BEST AVAILABLE COPY

Boiler room

Inside of P.O.L. building

Exterior of P.O.L. building

Rm. 102, flammable cabinet

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1608 of 5269

BEST AVAILABLE COPY

Appendix D

References

BEST AVAILABLE COPY

BEST AVAILABLE COPY

1. Department of Defense Instruction (0001) 6055.1, Department of Defense Occupational Safety and Health (OS H) Program, August 19, 1998.

2. Army Regulation (AR) 11-34, The Army Respiratory Protection Program, February 15, 1990.

3. DA PAM 40-503, Medical Service, Industrial Hygiene Program, October 30, 2000.

4. Technical Manual (T.M) 5-810-1, Mechanical Design, Heating, Ventilation, and Air Conditioning, June 1991.

5. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEls), American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

6. Industrial Ventilation - A Manual of Recommended Practices, American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

7. UFC 3-410-01 FA Heating, Ventilating, and Air Conditioning, 15 May 2003

8. Occupational Safety and Health Administration (OSHA) Lead in Construction Standard, 29 CFR 1926.62

9. OSHA Lead Standard 29 CFR 1910.1025

10. OSHA Respiratory Protection Standard 29 CFR 1910.134

11. Army Regulation (AR) 385-10, The Army Safety Program, August 23, 2007.

12. RP-1-2004, Office Lighting, Illuminating Engineering Society of North America (IESNA)/ANSI.

13. RP-7-2001, Industrial Lighting, (IESNA)/ANSI.

14. The American Society of Heating, Refrigerating, and Air-Conditioning Engineers (ASHRAE), Standard 62.1-2007, "Ventilation for Acceptable Indoor Air Quality".

15. ASHRAE Standard 55-2004 – “Thermal Environmental Conditions for Human Occupancy”

16. Title 24, CFR, Part 35, Subpart B, Sections 35.110, Definitions of Lead-Based Paint, Housing and Urban Development, U.S. Department of Housing.

17. OSHA Personal Protective Equipment 29 CFR 1910.132

18. OSHA Permissible Exposure Limit (PEL) for General Industry 29 CFR 1910.1000 Z-1 Table

19. Guidelines on Assessment and Remediation of Fungi in Indoor Environments, New York City Department of Health and Mental Hygiene, November 2008.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1610 of 5269

BEST AVAILABLE COPY

20. Mold Remediation in Schools and Commercial Buildings, U.S. Environmental Protection Agency, March 2001

21. Army Facilities Management Information Document on Mold Remediation Issues TG277, February 2002

22. OSHA Welding, Cutting, Brazing 29 CFR 1910.252

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1611 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Catonsville Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Catonsville Readiness Center** **130 Mellor Avenue** **Catonsville, MD 21228**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**July 26, 2013**
Report Date:	**September 3, 2013**

Non-Responsive

[redacted]

Senior Industrial Hygienist

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials (ACM) 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on July 26, 2013, at the Catonsville Readiness Center located at 130 Mellor Avenue, Catonsville, MD 21228. The survey was performed by Mr. Non-Responsive [redacted].

1. Lead surface and air samples were collected. Two sample results were above recommended guidelines and/or regulator standards and lead was detected in a third sample. See Section 3.0 for detailed sampling results.

2. Lighting levels did not meet the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in one location measured. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in all areas sampled.

    b. The relative humidity levels exceeded the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60% in two locations.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 parts per million (ppm).

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2010 recommended guidelines for mechanically ventilated office buildings and commercial settings.

    See Section 5.0 for detailed sampling results.

4. Suspect asbestos containing materials (ACM) floor tile and black mastic was observed to be intact and in good condition.

Section 2.0 Operation Description & Observations

The Catonsville Readiness Center is mainly an administrative facility with a drill hall, offices, classrooms, and a converted firing range area (currently the weight room). There were approximately 3 full-time employees stationed at this facility at the time of this survey. There are no maintenance personnel assigned to the building.

The 25,900 square foot building is reported to have been built in 1952. It is a single story structure with a basement. The exterior is brick and block. The interior walls are block, wood paneling, plaster and drywall. The floors are concrete, wood, 9”X9” and 12”x12” floor tiles.

The heating system is oil forced hot water unit. There are window air conditioners present in the facility.

Room 122 NBC storage room has a significant fungal growth problem. There is visible fungal growth on the ceiling and contents in this room total more than 100 square feet of fungal growth. A strong fungal odor is present. It was reported that there is a roof leak in the caged storage area in this room. Relative humidity in this room was 79.8%.

There is an attached garage at this facility however no over head vehicle exhaust system is present. It was reported that no vehicle maintenance is preformed at this facility. One vehicle was parked in the garage at the time of the survey.

There is no child-care facility in the building.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

This facility has a converted firing range (CFR) that is now used as a weight room.

Suspect asbestos containing material (ACM) 9”X9” floor tile and black mastic was observed to be intact and in good condition.

No chipped or peeling paint were observed.

Housekeeping is adequate.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 micrometer (um) mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Drill Hall	<17	*
2	Converted Firing Range/Weight Room	<17	*
3	Drill Hall – Floor	*	<110
4	Drill Hall – Top of Coke Machine	*	<110
5	Drill Hall – Top of Wall Locker	*	<110
6	Kitchen – Top of Wall Locker	*	<110
7	Kitchen – Top of Metal Table	*	<110
8	Hallway – Floor Outside of Converted Firing Range/Weight Room	*	<110
9	Converted Firing Range/Gym - Floor	*	<110
10	**Converted Firing Range/Gym – Top of Light Fixture**	*	**1500**
11	Converted Firing Range/Gym – Top of Table	*	150
12	**Garage – Top of Electrical Panel**	*	**390**
13	Office 116 – Top of Desk	*	<110
14	Office 111 – Top of Wall Locker	*	<110
15	Room 108 – Top of Book Shelf	*	<110
16	Office B-02 – Top of Wall Locker	*	<110
17	Office B-03 – Top of Desk	*	<110
18	Blank - Wipe	*	<12
19	Blank - Air	<3	*
-	**Criteria**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges
2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Two of the sample locations exceed the recommended limit of 200 ug/ft^2. Lead was also found at one other sample location. Cleaning procedures should be improved to maintain lead levels on surfaces below the analytical detection limit.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98082EL). The light meter was last calibrated in April 2013. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
NBC Storage Room 122	54.1	30	Yes
Office 116	92.5	30-50	Yes
Attached Garage	**43.2**	**75**	**NO**
Room 121 Wall Locker Storage	37.2	10	Yes
Room 118-A Wall Locker Storage	35.1	10	Yes
Room 117 Supply Room	68.1	30	Yes
Office 111	88.9	30-50	Yes
Office 111-A	95.4	30-50	Yes
Office 110	106.1	30-50	Yes
Classroom 108	92.3	30-50	Yes
Kitchen	222.3	50	Yes
Converted Firing Range/Gym	145.8	30	Yes
Office B-02	101.3	30-50	Yes
Office B-03	70.1	30-50	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting levels did not meet the minimum recommended guideline in the garage.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	84.5	45.6	360	0.0
Room 122 NBC Storage	74.3	**79.8**	682	0.0
Room 116	72.7	56.0	417	0.0
Attached Garage	75.0	**61.0**	360	0.0
Criteria	**68-79**	**30-60**	**<1,060**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements met the recommended 68-79°F in all sampled areas.
- Relative humidity levels exceeded the recommended guideline of 30 – 60 % in room 122 NBC storage area and the attached garage.
- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is

obtained by adding 700 ppm to the measured outdoor carbon dioxide level. For this survey, carbon dioxide levels did not exceed the recommended ceiling of 1,060 ppm (700 ppm + 360 ppm). This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observation were noted:

1. Room 122 NBC storage room has a significant fugal growth problem. There is visible fungal growth on the ceiling and contents in this room > 100 square feet. A strong fungal odor is present. It was reported that there is a roof leak in the caged storage area in this room. Relative humidity in this room was 79.8%.

Section 6.0 Suspect Asbestos Containing Building Materials (ACM)

Suspect (ACM) (asbestos containing material) was noted at the time of this survey:

9”X9” floor tile and black mastic was observed to be intact and in good condition. Exposed black mastic should be covered over.

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98002EL	4/2013	NA
SKC Air Sampling Pump	LVP06	7/26/13	2.50 LPM
SKC Air Sampling Pump	767926	7/26/13	2.50 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG-MD	**Chain Of Custody:**	516446		
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Catonsville-RC	**Date Submitted:**	7/29/2013		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive		
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/30/2013	**Report Date:**	7/31/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13080956	1	Flame	Air	180	N/A	17	ug/m³	<3	<17	ug/m³	
13080957	2	Flame	Air	180	N/A	17	ug/m³	<3	<17	ug/m³	
13080958	3	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080959	4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080960	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080961	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080962	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080963	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080964	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080965	10	Flame	Wipe	****	0.108	110	ug/ft²	160	1500	ug/ft²	
13080966	11	Flame	Wipe	****	0.108	110	ug/ft²	16	150	ug/ft²	
13080967	12	Flame	Wipe	****	0.108	110	ug/ft²	42	390	ug/ft²	
13080968	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080969	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080970	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080971	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080972	17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13080973	18	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
13080974	19	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG-MD	**Chain Of Custody:**	516446		
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Catonsville-RC	**Date Submitted:**	7/29/2013		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]		
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/30/2013	**Report Date:**	7/31/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: Nida McGarvey / Kim Shipe

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516446

Page 1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG-MD
2. Job Location: Catonsville - RC
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Pers[redacted] @ phone # (410) 942-0273
5. Submitted b[redacted]gnature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: 8/5/13 ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ [redacted] compliance@ngb.com ☐ [redacted]@us.army.mil ☐ [redacted]@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☒ Pb Dust Wipe (wipe type Schol) 17 (QTY) 16
- ☒ Pb Air 23 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb____(QTY) ☐ Cu____(QTY) ☐ As____(QTY)
- ☐ Waste Water ☐ Pb____(QTY) ☐ Cu____(QTY) ☐ As____(QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1	Drill Hall	7.26	180					X		X						
2	Range		180					X		X						
3	Drill Hall - floor			100 cm²				X				X				
4	Drill Hall - Coke machine							X				X				
5	Drill Hall wall locker							X				X				
6	Kitchen - wall locker							X				X				
7	Kitchen - metal table							X				X				
8	Hall floor outside Range							X				X				
9	Range - floor							X				X				
10	Range - light fixture							X				X				
11	Range - Table							X				X				
12	Garage - Elec. Panel											X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY (CUSTODY)
1. Date/Time RCVD: 7 / 29 / 13 @ 0900 Via: Tracks By (Print): [illegible] Sign: [illegible]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: 2995 2491 4350

Posted to NGB FOIA Reading Room May 2018
BEST AVAILABLE COPY
FOIA Requested Record # L-15-0085 (MD) Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 5164416 (page 2 of 2)

2 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG MD
2. Job Location: Catonsville - RC
3. Job #: [redacted] PO #: W912K6-09-A-0003
4. Contact Per[redacted] @ ph[redacted]273
5. Submitted b[redacted]gnature: [redacted]

Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☐ 5 Day + Date Due: ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Incl[redacted]ith Report ☒ Em[redacted] Caroline.place.co[redacted]us.army.mil ☐ Fax[redacted] ☐ Ver[redacted]us.army.mil

Non-Responsive

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☒ Pb Dust Wipe (wipe type Gloves) 17 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
13	Office 116	Desk	7.22	100 cm²				X				X					Date/Time: Contact: By:
14	Office 111	locker						X				X					
15	Room 105	Book shelf						X				X					
16	Office B-02	locker						X				X					
17	Office B-03	Desk						X				X					Date/Time: Contact: By:
18	Blank			0				X				X					
19	Blank		0					X		X							
																	Date/Time: Contact: By:

LABORATORY (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018

FOIA Requested Record # I-15-0085 (MD)
Released by National Guard Bureau

Appendix B. Photographs

Exterior of facility

Drill Hall

Garage area

PPE station

N95 Respirator

Right-to-know station

Spill station

Room 122 visible fungal growth on ceiling this room has a strong mold odor

Converted firing range/weight room

Suspect asbestos floor tile in good condition

Appendix C. Floor Plan

EVACUATION PLAN

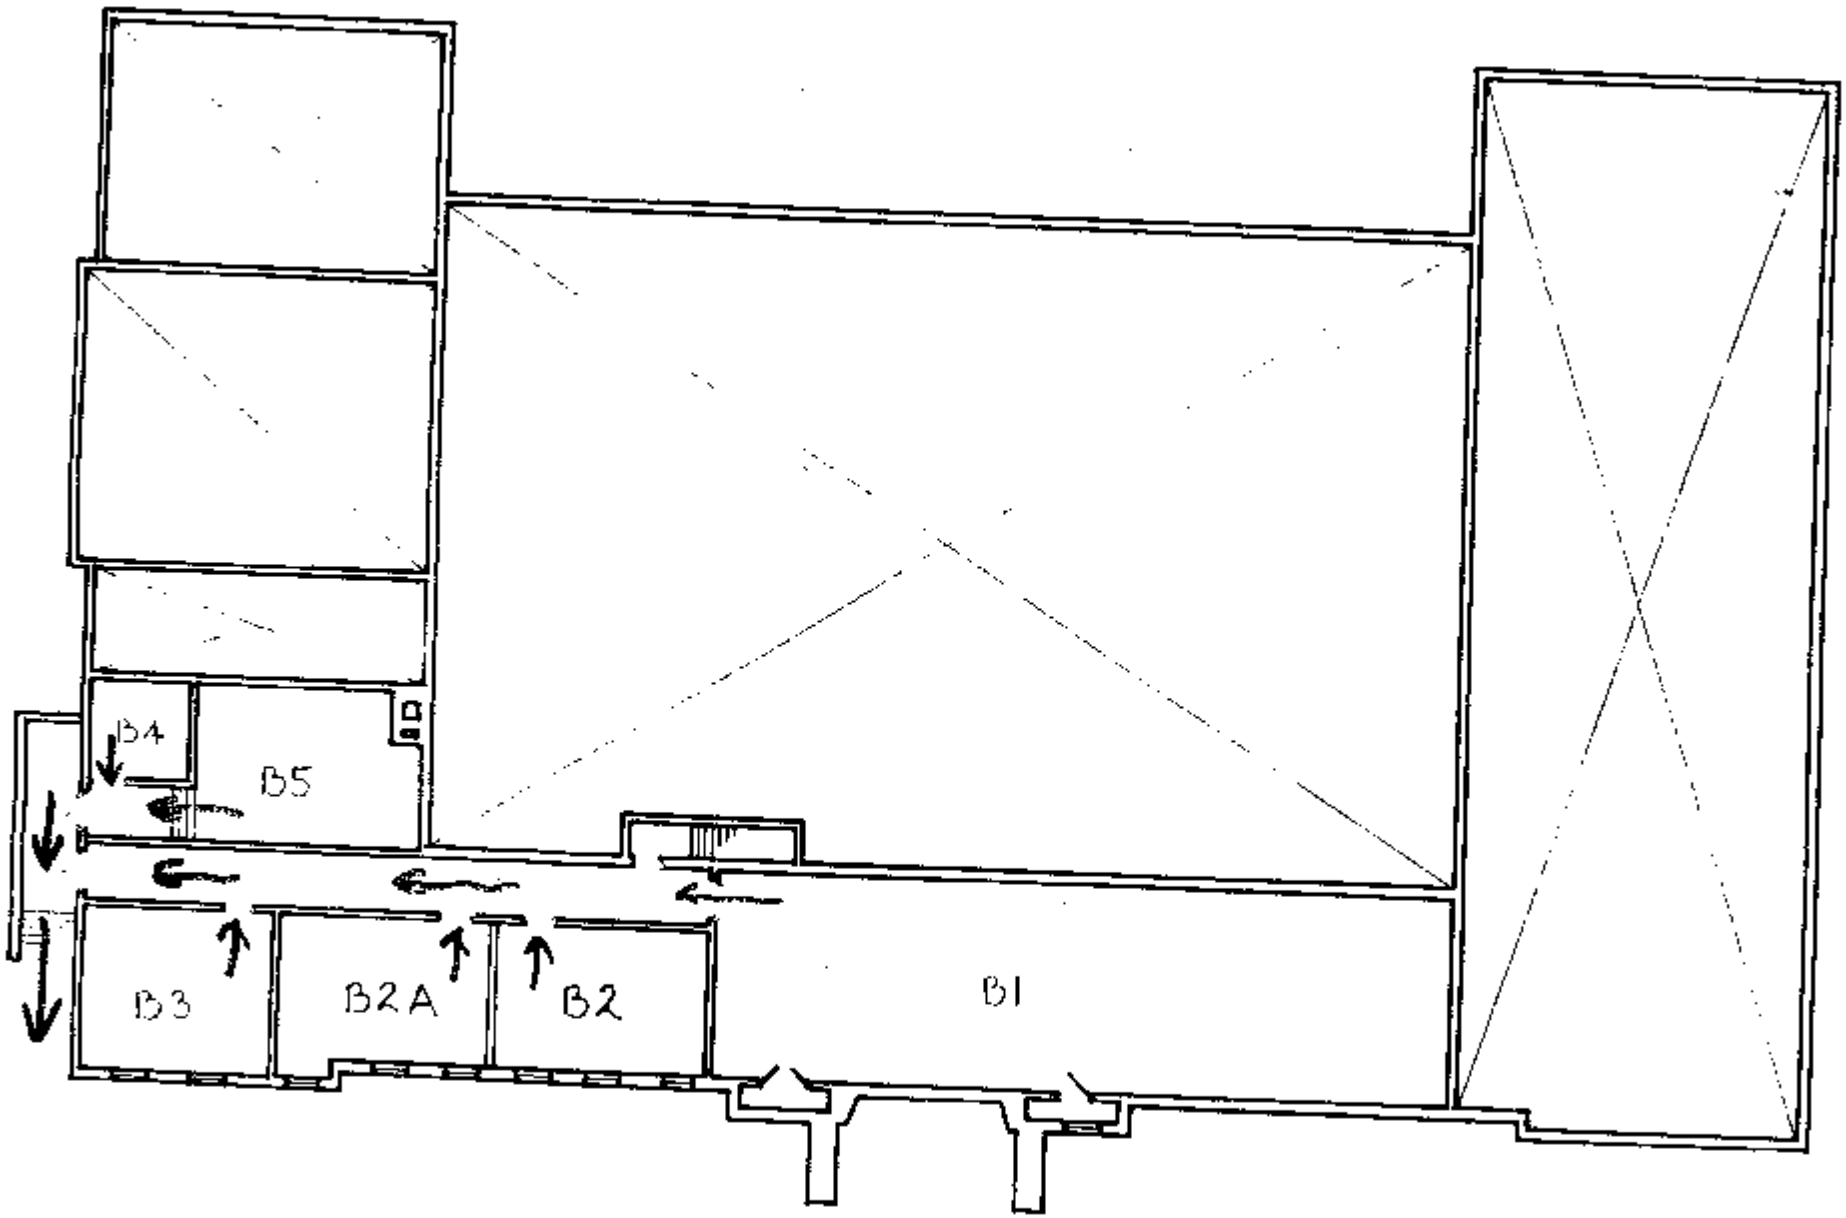

CATONSVILLE ARMORY

BASEMENT FLOOR PLAN
NO SCALE

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1636 of 5269
Posted to NGB FOIA Reading Room
May, 2018

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. American National Standards Institute (ANSI)/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227 (h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MAY 1 1 2007

MEMORANDUM FOR National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Non-Responsive), 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities, Industrial Hygiene Baseline Survey, Congressman Steny Hoyer Armory & Field Maintenance Shop #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August and 30 September 2003

1. Enclosed is the final copy of the subject report and two CD-ROMs.

2. Our point of contact is Ms. Non-Responsive at commercial (410) 436-5475/3118, DSN 584-5475/3118, or electronic mail: Non-Responsive [redacted]@us.army.mil.

FOR THE COMMANDER:

Non-Responsive

Encl

Director, Occupational Health Sciences

CF: (wo/CD-ROMs)
USACHPPM-NORTH (MCHB-AN-IH/MR. Non-Responsive)

Readiness thru Health

Printed on Recycled Paper
BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/07
CONGRESSMAN STENY HOYER ARMORY &
FIELD MAINTENANCE SHOP #8A
CHELTENHAM, MD
21 AUGUST & 30 SEPTEMBER 2003

Distribution limited to U.S. Government agencies only. Requests for this document must be referred to the National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/ Ms. [redacted]), 301-IH Old Bay Lane, Havre de Grace, MD 21078

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

DESTRUCTION NOTICE - Destroy by any method that will prevent disclosure of contents or reconstruction of the document.

BEST AVAILABLE COPY

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/07
CONGRESSMAN STENY HOYER ARMORY & FIELD MAINTENANCE SHOP #8A
CHELTENHAM, MD
21 AUGUST & 30 SEPTEMBER 2003

1. PURPOSE OF EVALUATION. To conduct an industrial hygiene survey at the Maryland Army National Guard (MDARNG) Congressman Steny Hoyer Armory and Field Maintenance Shop (FMS) #8A, Cheltenham, MD, to identify and measure the existence and extent of potentially hazardous operations or conditions at MDARNG facilities. The survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee.

2. CONCLUSIONS.

a. Lead Hazards. The former IFR (indoor firing rang) had been used but not completely decontaminated. Very high levels of lead in surface dust were found inside an enclosure around the bullet trap. These could lead to an inadvertent spread of lead contamination to other parts of the Armory.

b. Occupational Safety and Health Programs. Written Hazard Communication and Hearing Conservation Programs should be provided and implemented. Records of training, audiograms and other activities must be maintained.

c. Ventilation Deficiencies. The rooftop heating and ventilation units serving both buildings were unreliable. The washroom fan in the FMS #8A was not operating. The Vehicle Bay had severe air stratification in cold weather. The vehicle tailpipe and Battery Room exhaust systems had inadequate airflows, and the fan for the former was excessively noisy. One tailpipe hose was torn.

d. Other Deficiencies. The FMS #8A Vehicle Bay and Tool Crib desktop were inadequately lit. There were two active rain leaks in the FMS #8A. Ergonomic and noise hazards needed to be evaluated and mitigated. The CO (carbon monoxide) monitor in the Vehicle Bay was broken.

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

3. RECOMMENDATIONS.

a. Lead Exposure. Health RAC (Risk Assessment Codes) 4.

(1) Restrict access to the bullet trap enclosure in the former IFR by keeping it locked. Post a sign warning against use of the enclosure for entry except in an emergency, or for storing of any material.

(2) If the enclosure area is renovated, clean all surfaces to the maximum level recommended by the National Guard Bureau Region North Industrial Hygiene Office and United States Army Center for Health Promotion and Preventive Medicine. Comprehensive guidelines are in Appendix E. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area after decontaminating the enclosure.

b. Occupational Safety and Health Programs. Health RAC 4. Develop and implement written Hazard Communication and Hearing Conservation Programs. Maintain records of training, audiograms, and other activities.

c. General Heating, Ventilating and Air Conditioning Systems. Health RAC 4. Investigate rooftop unit operating problems and repair or replace units as necessary. In FMS #8A Vehicle Bay 151, at minimum, install ceiling fans to reduce stratification. Investigate the potential replacement of the existing system by an infrared radiant system. Repair or replace the FMS #8A washroom fan.

d. Vehicle Tailpipe Exhaust System. Health RAC 3. Repair or disconnect the leaking hose. Modify or upgrade the system to provide at least 1,500 cubic feet per minute (cfm) per drop. One possibility is to reduce the number of connection points. Investigate the excessive fan noise and repair as needed.

e. Battery Room Exhaust System. Safety RAC 4. Adjust or replace the fan to provide at least 2 cfm per square foot of floor area.

f. Building Physical Condition. Health RAC 4. Repair the two active roof leaks in the FMS #8A and replace any damaged building materials.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1642 of 5269

BEST AVAILABLE COPY

g. Lighting. Health RAC 4. Provide additional task lighting in FMS #8A Vehicle Bay 151 and Tool Crib to meet illumination standards.

h. Noise Hazards. No RAC can be assigned. Assess noise hazards and implement control measures as appropriate.

i. Other Hazards. Safety RAC 3. Ensure that the CO monitor in FMS #8A Vehicle Bay 151 is repaired and calibrated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1643 of 5269

BEST AVAILABLE COPY

MDARNG IH Baseline Survey, Report No. 55-ML-01ED-03/07, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, 21 August & 30 September 2003

CONTENTS

Paragraph Page

1. REFERENCES 1

2. PURPOSE 1

3. AUTHORITY 1

4. GENERAL 1

5. METHODOLOGY 2

6. FINDINGS AND DISCUSSION 2

7. CONCLUSIONS 10

8. RECOMMENDATIONS 10

9. ADDITIONAL ASSISTANCE 11

APPENDICES

A. REFERENCES A-1

B. PROPOSED LEAD CRITERIA B-1

C. PHOTOGRAPHS C-1

D. LABORATORY REPORTS D-1

E. LEAD CLEANING GUIDANCE E-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1644 of 5269

INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/07
MARYLAND ARMY NATIONAL GUARD FACILITIES
CONGRESSMAN STENY HOYER ARMORY
FIELD MAINTENANCE SHOP (FMS) #8A
CHELTENHAM, MD
21 AUGUST AND 30 SEPTEMBER 2003

1. REFERENCES. See Appendix A.

2. PURPOSE. To conduct an industrial hygiene survey at the Maryland Army National Guard (MDARNG) Congressman Steny Hoyer Armory and Field Maintenance Shop (FMS) #8A, Cheltenham, MD, to identify and measure the existence and extent of potentially hazardous operations or conditions at MDARNG facilities. The survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee.

3. AUTHORITY. E-mail, National Guard Bureau Region North Industrial Hygiene Office (NGB-ARS-IHNE/Ms. Non-Responsive), 28 February 2003, subject: SAB.

4. GENERAL.

a. Personnel Contacted. SSG Non-Responsive, Environmental Compliance Assessment Coordinator for the MDARNG, 410-576-6132.

b. Survey Personnel. This survey was conducted on 21 August and 30 September 2003 by Mr. Non-Responsive, Industrial Hygienist, United States Army Center for Health Promotion and Preventive Medicine (USACHPPM).

c. Risk Assessment Codes (RACs). The Department of Defense Instruction (DODI) 6055.1 provides a method for assigning RACs to health hazards that are based on the magnitude of exposures to physical, chemical, and biological agents and the possible medical effects. The DODI 6055.1 also provides RACs for safety and ergonomic hazards. A RAC is an expression of the risk associated with a hazard that combines the hazard severity and accident probability into a single numeral. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

d. Background. The Armory and FMS #8A were built in approximately 1995. Floor plans could not be located for this report. The facilities supported Company A, 129th Signal Battalion. The indoor firing range (IFR) had reportedly never been used for its intended purpose. The bullet trap and a short section of the floor in front of it had been enclosed by a partition accessible through a door from the main floor area. Nothing was observed to be stored inside this enclosure. The main floor area was reportedly used for storage, although a multiple-exercise weight machine was set up in the room.

Use of trademarked name(s) does not imply endorsement by the US Army but is intended only to assist in the identification of a specific product.

BEST AVAILABLE COPY

5. METHODOLOGY.

a. Assessment Criteria. Army Regulation 40-5 contains the requirement that airborne chemical exposures in Army facilities must comply with the lower of the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit (PEL) or the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Value®. The National Guard Bureau (NGB) criterion for lead in surface dust is discussed in Appendix B. The ACGIH provides criteria for industrial ventilation systems. The American Society of Heating, Refrigeration, and Air-conditioning Engineers (ASHRAE) publishes criteria for indoor air quality. The National Fire Protection Association National Fire Codes provides standards for fire and life safety. The Illumination Engineering Society – North America (IESNA) provides standards for minimum light levels.

b. Calibration. All instruments were calibrated in accordance with manufacturers' instructions using National Institute of Standards and Testing-traceable methods.

c. Methodology. The survey consisted of the collection of indoor air quality (IAQ) and ventilation measurements, sampling surface dust and air for lead, observation of work practices and procedures, and employee interviews.

6. FINDINGS AND DISCUSSION.

a. Description of Operations. The Armory contained a Drill Hall, classrooms, offices, and storage space. The FMS #8A had one vehicle bay, offices, and small shops.

b. Occupational Safety and Health Programs. There was no written Hazard Communication Program on site. The FMS #8A had a Material Safety Data Sheet binder that was being reorganized at the time of the site visit. There were no written Hearing Conservation Program or records on site, although the foreman reported that personnel were provided audiograms annually.

c. Building Condition.

(1) Physical Condition. The buildings were in good physical condition with the exception of two active rain leaks in the FMS #8A, discussed below.

(2) Housekeeping. The standard of housekeeping was very high.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1646 of 5269

BEST AVAILABLE COPY

d. Indoor Environmental Quality.

(1) Heating, Ventilation, and Air-Conditioning Systems .

(a) Armory. The Armory building had two roof-mounted heating and ventilating units, one serving the Drill Hall and the other serving the rest of the building. These were reported to be unreliable. The ventilation system for the former IFR was reportedly still operable.

(b) The FMS #8A. The FMS #8A was served by two rooftop heating and ventilating units, one serving the Vehicle Bay 151 and the other serving the rest of the building. The FMS #8A personnel reported that both units had a history of failing to start. They also reported that the bay experienced severe stratification in the winter when the air handling unit (AHU) was running. The Shop Office 152, Electronics Room 153, and Lunch Room 154 were also served by through-wall cooling units. There was no exhaust flow from the washrooms, indicating that the washroom exhaust fan was not working.

(2) IAQ parameters. The IAQ quality measurements were collected during the initial site visit of 21 August 03. The results are shown in Table 1. The range of outdoor conditions at nearby Andrews Air Force Base during IAQ measurements was 86-89 degrees Fahrenheit (º F) dry-bulb temperature with a 70-73º F dewpoint temperature and a clear sky. The approximate relative humidity (RH) was 54-65 percent. These conditions are not expected to be exceeded more than approximately 2 percent of the year.

TABLE 1. Indoor Air Quality Measurements.

Building	Location	Time	Dry bulb temp, º F	Relative humidity, %	CO_2, ppm	Note
Armory	Drill Hall 103	1007	80.5	68	344	Vehicle door open
	Orderly Room 108	1012	80.2	59	418	2 occupants, several windows open, AC unit running
FMS #8A	Vehicle Bay 151	1155	84.2	69	NR	All vehicle doors open
	Shop Office 152	1353	77	50	390	Occupied occasionally

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1647 of 5269

BEST AVAILABLE COPY

(3) Temperature and Humidity Control. The ASHRAE recommends a dry-bulb temperature between 71º and 81º F in the summer at 50 percent RH, and a RH maintained in the range of 30 to 60 percent. The RH exceeded the ASHRAE recommended range in the Drill Hall and Vehicle Bay, and the temperature exceeded the recommended range in the Vehicle Bay. This was to be expected given the open doors and the weather. The reported severe winter temperature stratification is typical of high bays that are supplied with air from the ceiling level. These systems must attempt to force heated air down against its natural buoyancy. Operation of the bay doors exacerbates the problem by injecting large masses of cold outside air near the floor which persist there under the layer of hot air near the roof. A minimal solution would be the installation of ceiling fans, although the unreliable operation of the rooftop unit would also have to be addressed. The best solution for occupant comfort is the replacement of the existing system by an infrared radiant system. These can be designed for either oil or gas. They offer potential energy savings to offset their cost by providing comfort at a lower air temperature than is required for a forced-air vehicle garage heating system because they heat personnel and surfaces directly without heating the air.

(4) Air Exchange Rate. To provide adequate fresh air ventilation, ASHRAE recommends an air exchange rate that prevents the Carbon Dioxide (CO_2) concentration in the room from exceeding 700 parts per million (ppm) more than the outdoor ambient concentration, which is generally about 380 ppm. Indoor CO_2 levels were well within the guidelines in all locations.

(5) Mold. No mold or water damage was observed or reported in the Armory building. A substantial leak was reported in the corner of FMS #8A Tool Crib 160 at the back corner of the wall to Vehicle Bay 151. A small rain leak from the roof-mounted AHU in the same bay was also reported. No mold or major surface damage was observed. However, insulation was probably becoming soaked, and the leaks could result in future mold growth.

e. Water Quality. No concerns were expressed about water quality. No samples were collected.

f. Lead Hazards. The age of the buildings indicated that the presence of lead-based paint was unlikely. No significant deterioration of paint was observed.

(1) Lead Criteria.

(a) Lead in air. The Army has adopted the OSHA 8-hour time-weighted average PEL of 50 milligrams per cubic meter (µg/m³).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1648 of 5269

BEST AVAILABLE COPY

(b) Lead in surface dust. The Environmental Protection Agency (EPA) and State of Maryland limits for lead in dust are 40 micrograms per square foot (µg/ft^2) on floors, 250 µg/ft^2 on windowsills, and 400 µg/ft^2 in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The NGB Region North Industrial Hygiene Office concurs with the USACHPPM recommended maximum level of 200 µg/ft^2 on floors and frequently contacted surfaces, which is more stringent for windowsills than the EPA/State standards. This level was adopted from OSHA Compliance Letter 02-02-58. Further information is provided in Appendix B.

(2) Lead Results.

(a) Lead in air. All air samples were below the laboratory analytical detection limit for lead in air of 3.0 to 15.0 µg/m^3 as well as the exposure limit.

(b) Lead in surface dust. Samples were collected in the Armory building. Lead dust wipes sample locations, photograph numbers, and analytical results are shown in Table 2. All sample results that were equal to or exceeded 40 µg/ft^2 for floors or 200 µg/ft^2 for other surfaces are highlighted. Two sample results from the bullet trap enclosure in the former IFR exceeded the recommended maximum level of 200 µg/ft^2 for lead dust on frequently contacted surfaces (the maximum was 290,000 µg/ft^2). A result from the top of a ceiling baffle above the main IFR floor area was 73 µg/ft^2. Results from other floor surfaces in the former IFR were slightly elevated compared to those in the rest of the Armory building, but not above any of the criteria. The results inside the trap enclosure show that, unknown to the building occupants, the IFR was indeed used for firing at some time. The presence of these high levels appeared not to have produced hazardous levels in the rest of the IFR or in other parts of the building. However, it is possible that occupants who are unaware of the contamination could inadvertently spread it and create hazardous levels elsewhere by cleaning this enclosure using improper methods, using it for storage, and/or tracking the lead to other parts of the building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1649 of 5269

TABLE 2. Dust-Lead Wipe Locations, Photograph Numbers, and Analytical Results.

Sample No.	Type of Sample	Location	Photo No.	Result, µg/ft²
CH W01	Wipe	Drill Hall 103 floor at center	0006	29
CH W02	Wipe	Drill Hall 103 floor near doors to Rooms 130 and 132	0007	8.6
CH W03	Wipe	Drill Hall 103 floor along wall to Arms Room 104	0008	12
CH W04	Wipe	Drill Hall 103 floor at entrance to Latrines 135-136	0009	<2.8
CH W05	Wipe	Drill Hall 103 floor between center and wall to Latrine 136	0010	6.9
CH W06	Wipe	Former IFR 126 floor behind bullet trap (inside enclosure)	0011	290,000
CH W07	Wipe	Former IFR 126 floor in front of bullet trap (inside enclosure)	0012	2,200
CH W08	Wipe	Former IFR 126 top of table along exterior wall	0013	5.6
CH W09	Wipe	Former IFR 126 floor behind firing line	0014	34
CH W10	Wipe	Former IFR 126 floor in front of firing line	0015	33
CH W11	Wipe	Former IFR 126 floor at midpoint near wall to Corridor 127	0016	9.6
CH W12	Wipe	Corridor 127 floor at door to Former IFR 126	0017	5.2
CH W13	Wipe	Former IFR 126 seat of multi gym machine	0018	5.2
CH W14	Wipe	Former IFR 126 top of baffle near bullet trap	0019	73
CH W15	Wipe	Classroom 117 floor near wall to Corridor 128	0020	3.5
CH W16	Wipe	Lobby 101 floor at center	0021	3.8

g. Other Chemical Hazards.

(1) Asbestos. The site Asbestos Management Program listed ceiling tiles in the Armory building as asbestos-containing materials. The ceiling tiles that were observed in the Armory were intact. The FMS #8A performed asbestos brake shoe and clutch work. SSG Non-Responsive [redacted] was reported to have the FMS #8A personnel training records for this task. Personnel reported using a wet method for this work. They had turned in the respirators originally supplied for this work after being advised that they were not necessary.

BEST AVAILABLE COPY

(2) Carbon Monoxide (CO). The wall-mounted CO monitor in FMS #8A Vehicle Bay 151 was reportedly not working, and a work order had been submitted.

h. Vehicle Tailpipe Exhaust System. A single fan served four drops in the Vehicle Bay. Calculated airflows and hose velocities are shown in Table 3. The system should provide at least 1,500 cubic feet per minute (cfm) exhaust at each drop in accordance with the ACGIH Industrial Ventilation Manual recommendation for 9 liter displacement turbocharged diesel engines run at 1,000 revolutions per minute. This exhaust rate is intended to accommodate large turbocharged diesel engines that are, or may be, maintained at this FMS #8A. None of the drops met the ACGIH criterion.

TABLE 3. Vehicle Tailpipe Exhaust System Performance.

Location	Airflow, cfm	Velocity in hose, ft/min	Note
VE-1	430	2,200	
VE-2	420	2,100	
VE-3	330	1,700	Tear in hose
VE-4	350	1,800	

i. Battery Shop Exhaust System. The Battery Shop fan belt was discovered to be off its pulleys during the initial visit, unknown to shop personnel. The belt was replaced and a total airflow of 200 cfm was measured. The NGB Design Guide 415-2 specifies a minimum airflow of 2 cfm per square foot (ft^2) floor area; other design criteria require an estimate of the maximum number and capacity of batteries present, which was not available. The room was considerably larger than 100 ft^2, so the airflow was less than required.

j. Kitchen Ventilation System, Armory Room 109. The kitchen was equipped with three hoods over a grill surface, a dishwasher, and a sink. The grill hood had a horizontal surface area of 32 ft^2 and was enclosed at the back and one side. Measured airflow was 3,800 cfm, which exceeded the International Conference of Building Officials (ICBO) International Building Code 2000 criterion of 100 times the surface area for kitchen hoods enclosed on one or more sides that serves medium-temperature cooking equipment. The dishwasher hood had a horizontal surface area of 15.8 ft^2 and was enclosed at the back. Measured airflow was 1,400 cfm, which exceeded the ICBO criterion of 50 times the surface area for kitchen hoods enclosed on one or more sides that serve low-temperature cooking equipment. The sink hood had a horizontal surface area of 14 ft^2 and a measured airflow of 1,420 cfm, which also exceeded the criterion. The kitchen was supplied with 2,470 cfm of makeup air and also drew air from the adjoining cafeteria and corridor. The system did not produce an excessive negative pressure that would make door operation difficult and unsafe.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1651 of 5269

BEST AVAILABLE COPY

k. Noise Hazards. The FMS #8A performed vehicle repair operations, such as the use of air tools to remove truck wheels that could exceed occupational exposure limits.

(1) Noise Criteria. The Army-adopted criterion for steady-state noise is an 8-hour time-weighted average of 85 decibels A-weighted, with a 3 dBA exchange rate.

(2) Noise Measurements. Dosimetry was performed while air-powered tools were used to replace truck tires, but the readings were subsequently lost when the dosimeters were accidentally reset. Personnel in the shop were observed to use protective earmuffs while performing this operation.

l. Lighting. Illumination levels were measured in frequently-used offices, Drill Floor 103, FMS #8A Vehicle Bay 151, Armory Supply Room 106, and FMS #8A Tool Crib 160. The results are shown in Table 4. The IESNA recommends a minimum illumination level of 11 to 30 foot-candles (fc) for occasional visual tasks (such as locating tools and supplies), 31 to 50 fc for performing large-scale tasks (such as major vehicle repair operations), and 51 to100 fc for tasks of medium contrast and small size (such as general office work). Lighting levels in the rear of FMS #8A Vehicle Bay 151 did not meet the 31 to 50 fc criterion, even with the sun shining in the open front door. In inclement weather or at night, similarly low levels could be expected throughout much of the bay. The desktop in FMS #8A Tool Crib 160 was also inadequately lit.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1652 of 5269

TABLE 4. Illumination Levels.

Building	Room	Location	Illumination, fc	Note
Armory	Drill Floor 103	Rear corner next to Room 133	40	Vehicle door open, sunny
	Drill Floor 103	Rear center	27	Vehicle door open
	Drill Floor 103	Rear corner near Foyer 101	12	Vehicle door open
	Orderly Room 108	Desktop	54	
	Orderly Room 108	Desktop	78	
	Orderly Room 108	Work table	57	
	Supply Room 106	Corridor between shelves	12	
	Supply Room 106	Corridor between shelves	20	
	Classroom 117	Chair near window	85	
	Classroom 117	Chair in center	72	
	Classroom 117	Chair near door	44	
	Classroom 117	Desktop in center	54	
	Kitchen 120	Grill surface	25	
	Kitchen 120	Work table	92	
	Pantry 119	Counter by window	59	
FMS #8A	Vehicle Bay 151	Rear (north)	23-27	South vehicle doors open, bright sun shining in
		4th row of columns from front	26-36	Ditto
		3rd row of columns from front	49-76	Ditto
		2nd row of columns from front	101-147	Ditto
		1st row of columns from front	280-330	Ditto
	Shop Office 152	Desktop	211	
	Tool Crib 160	Shelves	13-20	
		Desktop	26	

m. Safety Observations. The vehicle tailpipe exhaust system was extremely noisy, posing a potential accident hazard by limiting communication. No other hazards were observed.

7. CONCLUSIONS.

a. Lead Hazards. The former IFR had been used but not completely decontaminated. Very high levels of lead in surface dust were found inside an enclosure around the bullet trap. These could lead to an inadvertent spread of lead contamination to other parts of the Armory.

b. Occupational Safety and Health Programs. Written Hazard Communication and Hearing Conservation Programs should be provided and implemented. Records of training, audiograms and other activities must be maintained.

c. Ventilation Deficiencies. The rooftop heating and ventilation units serving both buildings were unreliable. The washroom fan in the FMS #8A was not operating. The Vehicle Bay had severe air stratification in cold weather. The vehicle tailpipe and Battery Room exhaust systems had inadequate airflows, and the fan for the former was excessively noisy. One tailpipe hose was torn.

d. Other Deficiencies. The FMS #8A Vehicle Bay and Tool Crib desktop were inadequately lit. There were two active rain leaks in the FMS #8A. Ergonomic and noise hazards needed to be evaluated and mitigated. The CO monitor in the Vehicle Bay was broken.

8. RECOMMENDATIONS.

a. Lead Exposure. Health RAC 4.

(1) Restrict access to the bullet trap enclosure in the former IFR by keeping it locked. Post a sign warning against use of the enclosure for entry except in an emergency, or for storing of any material.

(2) If the enclosure area is renovated, clean all surfaces to the maximum level recommended by the NGB Region North Industrial Hygiene Office and USACHPPM. Comprehensive guidelines are in Appendix E. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area after decontaminating the enclosure.

b. Occupational Safety and Health Programs. Health RAC 4. Develop and implement written Hazard Communication and Hearing Conservation Programs. Maintain records of training, audiograms, and other activities.

c. General HVAC Systems. Health RAC 4. Investigate rooftop unit operating problems and repair or replace units as necessary. In FMS #8A Vehicle Bay 151, at minimum, install ceiling

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1654 of 5269

BEST AVAILABLE COPY

fans to reduce stratification. Investigate the potential replacement of the existing system by an infrared radiant system. Repair or replace the FMS #8A washroom fan.

d. Vehicle Tailpipe Exhaust System. Health RAC 3. Repair or disconnect the leaking hose. Modify or upgrade the system to provide at least 1,500 cfm per drop. One possibility is to reduce the number of connection points. Investigate the excessive fan noise and repair as needed.

e. Battery Room Exhaust System. Safety RAC 4. Adjust or replace the fan to provide at least 2 cfm per square foot of floor area.

f. Building Physical Condition. Health RAC 4. Repair the two active roof leaks in the FMS #8A and replace any damaged building materials.

g. Lighting. Health RAC 4. Provide additional task lighting in FMS #8A Vehicle Bay 151 and Tool Crib to meet illumination standards.

h. Noise Hazards. No RAC can be assigned. Assess noise hazards and implement control measures as appropriate.

i. Other Hazards. Safety RAC 3. Ensure that the CO monitor in FMS #8A Vehicle Bay 151 is repaired and calibrated.

9. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at commercial 410-436-3118, DSN 584-3118, or by e-mail: Non-Responsive @us.army.mil.

Non-Responsive

Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive

Program Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1655 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

1. Occupational Safety and Health Administration, Title 29, Code of Federal Regulations (CFR), Part 1910, current ed. 1910.1025 (Lead). http://www.osha.gov/comp-links.html

2. Occupational Safety and Health Administration, Title 29, Code of Federal Regulations (CFR), Part 1910 for General Industry and current ed. 1910.1200 (Hazard Communication). http://www.osha.gov/comp-links.html

3 American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62.1-2004, Ventilation for Acceptable Indoor Air Quality. http://www.ashrae.org

4. DA PAM 40-501, Medical Services, Hearing Conservation Program, 10 December 1998. http://www.usapaarmy.mil/pdffiles/p40-501.pdf

5. Illuminating Engineering Society of North America, ANSI/IESNA RP-1-04, Office Lighting.

6. IESNA RP-7-01, Lighting Industrial Facilities.

7. EPA 40 CFR Part 745, Lead; Identification of Dangerous Levels of Lead; Final Rule, 5 Jan 2001.

8. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, 19 August 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1656 of 5269

BEST AVAILABLE COPY

APPENDIX B

PROPOSED LEAD CRITERIA

Subject: Recommendations for Surface Lead Dust in Armories

1. In armories that do not contain childcare facilities, the National Guard Bureau (NGB) Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 micrograms per square foot ($\mu g/ft^2$). If a special function will be held in which children will be present in this facility, consider thoroughly cleaning the areas that will be accessible to children prior to the function. This guidance is based on professional judgment, risk assessments, adaptation of Occupational Safety and Health Administration (OSHA) guidance, and feasibility of cleaning to a certain level.

a. Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3)) are not directly applicable because they are criteria for dust-lead hazards developed for floors (40 $\mu g/ft^2$) and windowsills (250 $\mu g/ft^2$) in residential dwellings and child occupied facilities. A child occupied facility is defined as a building, or portion of a building, constructed prior to 1978, visited regularly by the same child, 6 years of age or under, on at least two different days within any week (Sunday through Saturday period), provided that each day's visit lasts at least 3 hours and the combined weekly visit lasts at least 6 hours, and the combined annual visits last at least 60 hours. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead dust. In workplaces where lead dust is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1657 of 5269

BEST AVAILABLE COPY

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed. In the interim, we recommend the following actions:

a. Clean all areas that will be accessible to children to the EPA dust-lead standard for children 6 years of age or under (40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ on windowsills).

b. Refer to the local authorities' regulations since they can be more stringent than Federal regulations.

c. Post signs in the area to inform people of the presence of lead dust and its effects.

d. If Soldiers clean weapons in the facility change the policy so that they cannot clean their weapons in the facility, or if they are allowed to clean their weapons indoors, they must clean the area by wet wiping and mopping the area when they are done.

e. If the paint is peeling, contact the state Environmental Office to test for lead content and provide recommendations.1

3. Air samples collected on individuals in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead dust in this building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1658 of 5269

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

Photograph No.	Sample Location
1	Drill Hall 103, floor at center
2	Drill Hall 103, floor near doors to Rooms #8A 130 and 132
3	Drill Hall 103, floor along wall to Arms Room 104
4	Drill Hall 103, floor at entrance to Latrines 135-136
5	Drill Hall 103, floor between center and wall to Latrine 136
6	Former IFR 126, floor behind bullet trap (inside enclosure)
7	Former IFR 126, floor in front of bullet trap (inside enclosure)
8	Former IFR 126, top of table along exterior wall
9	Former IFR 126, floor behind firing line
10	Former IFR 126, floor in front of firing line
11	Former IFR 126, floor at midpoint near wall to Corridor 127
12	Corridor 127, floor at door to Former IFR 126
13	Former IFR 126, seat of multi gym machine
14	Former IFR 126, top of baffle near bullet trap
15	Classroom,117 floor near wall to Corridor 128
16	Lobby 101, floor at center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1659 of 5269

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

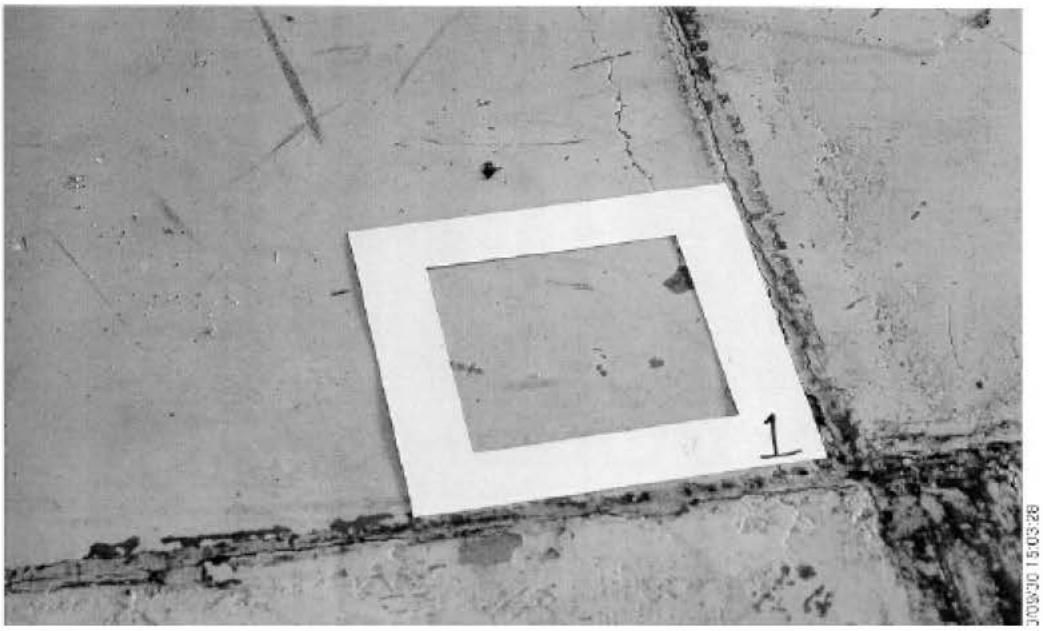

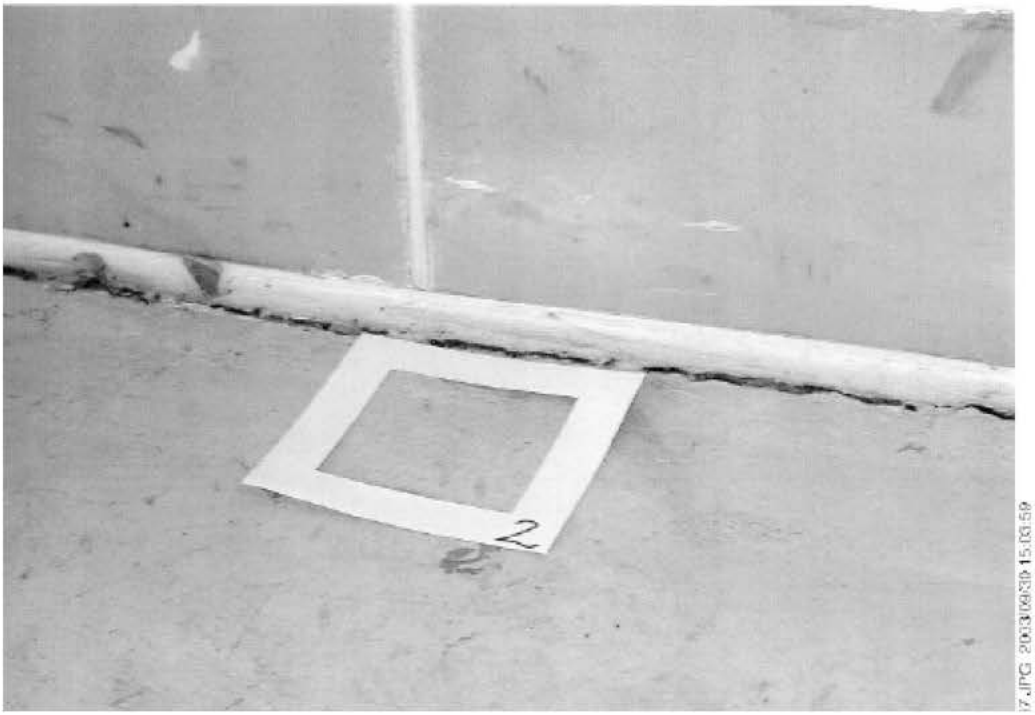

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1660 of 5269

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

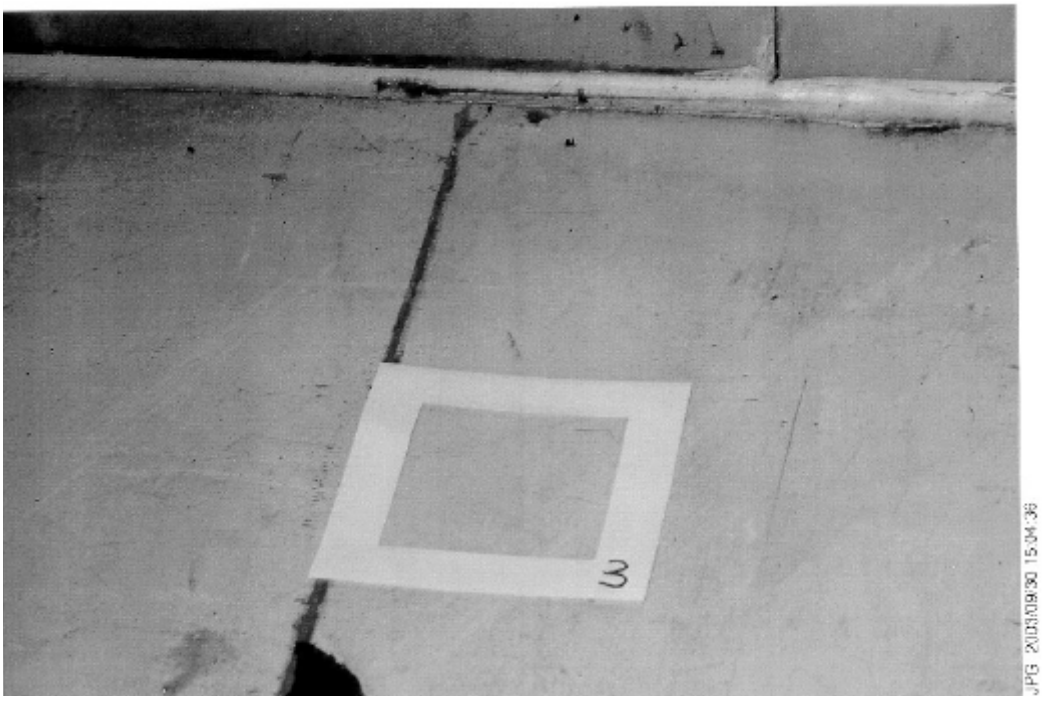

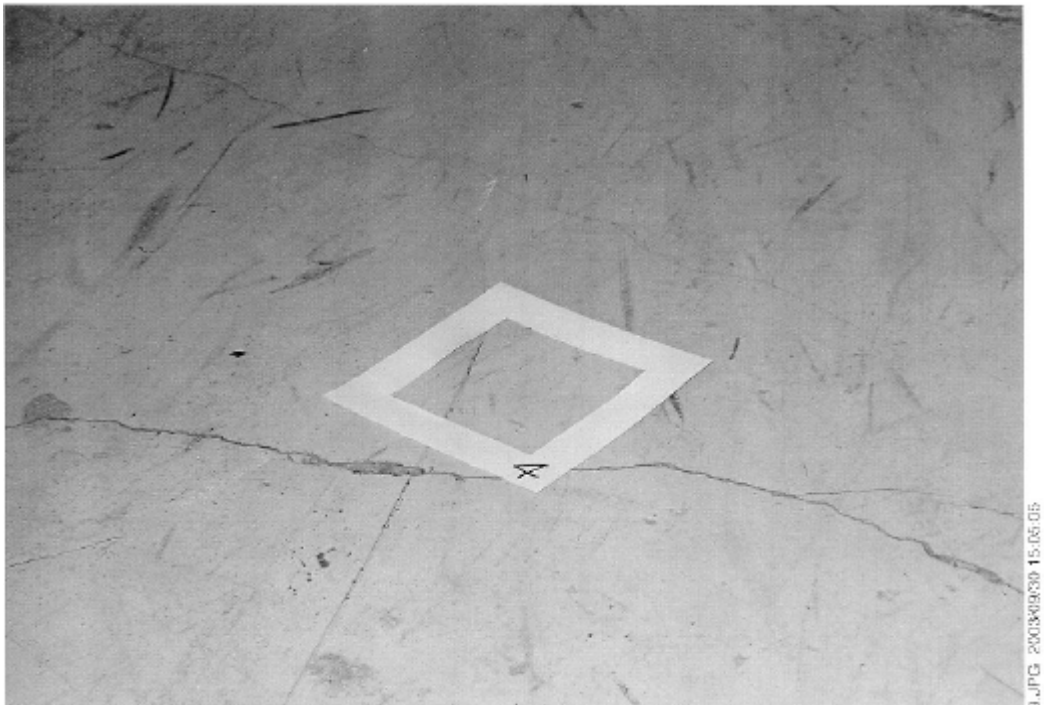

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

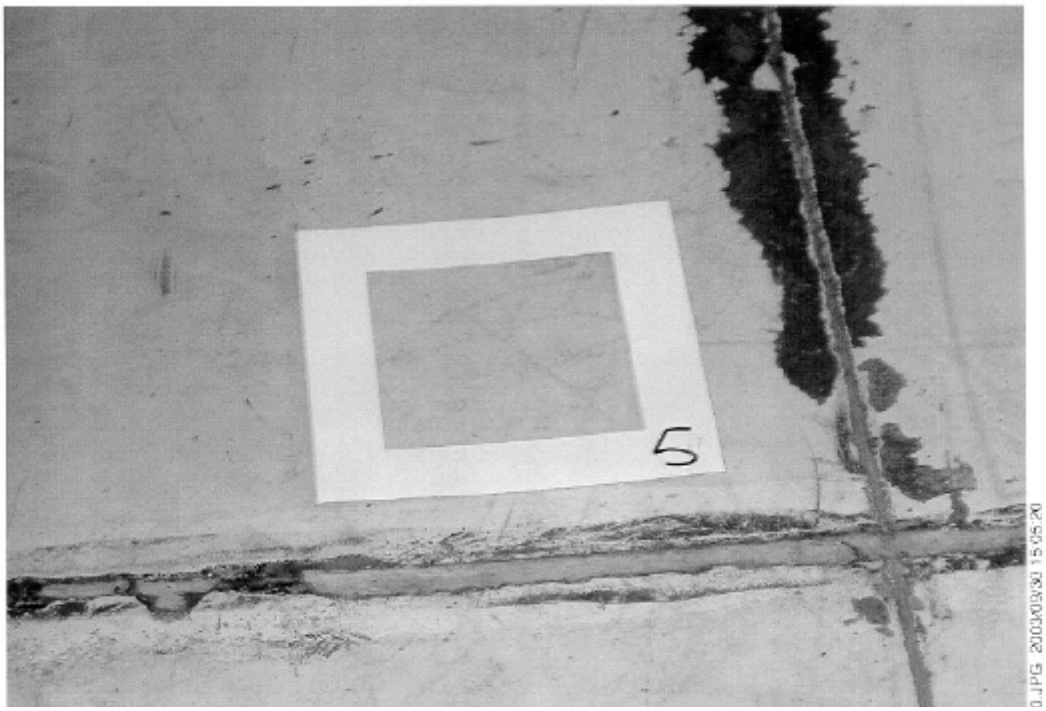

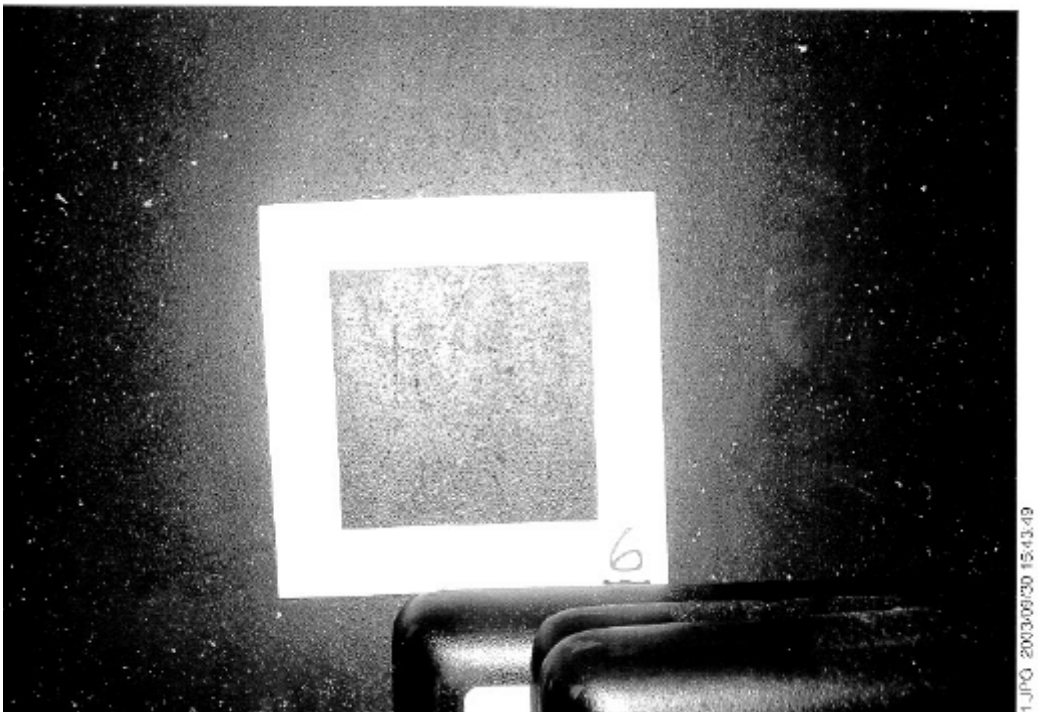

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

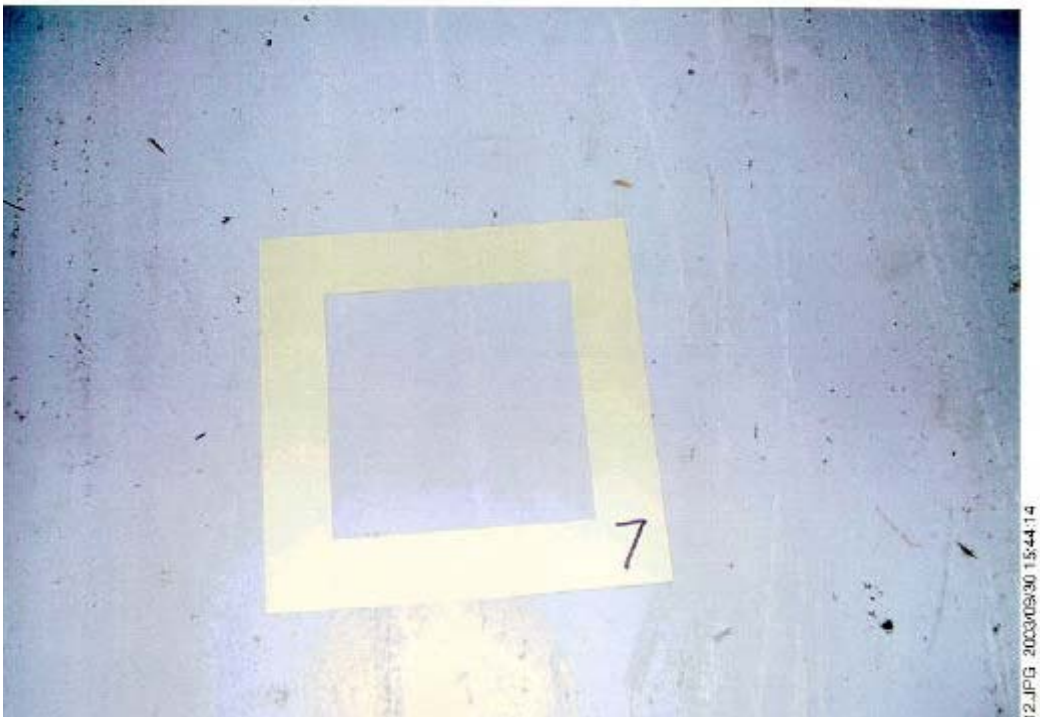

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

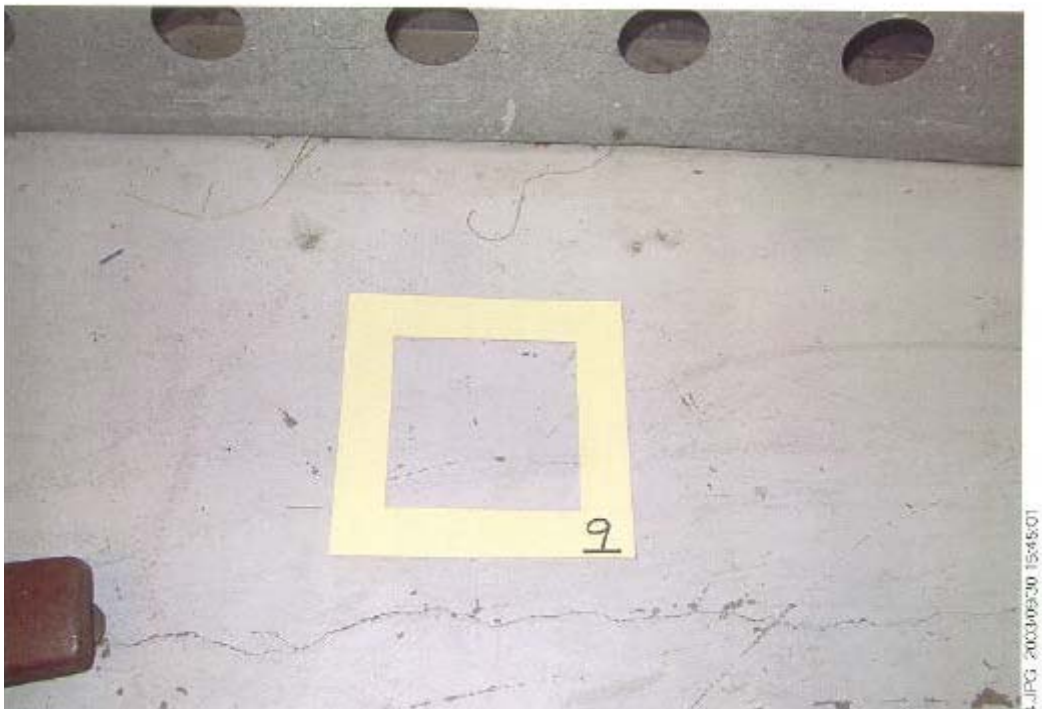

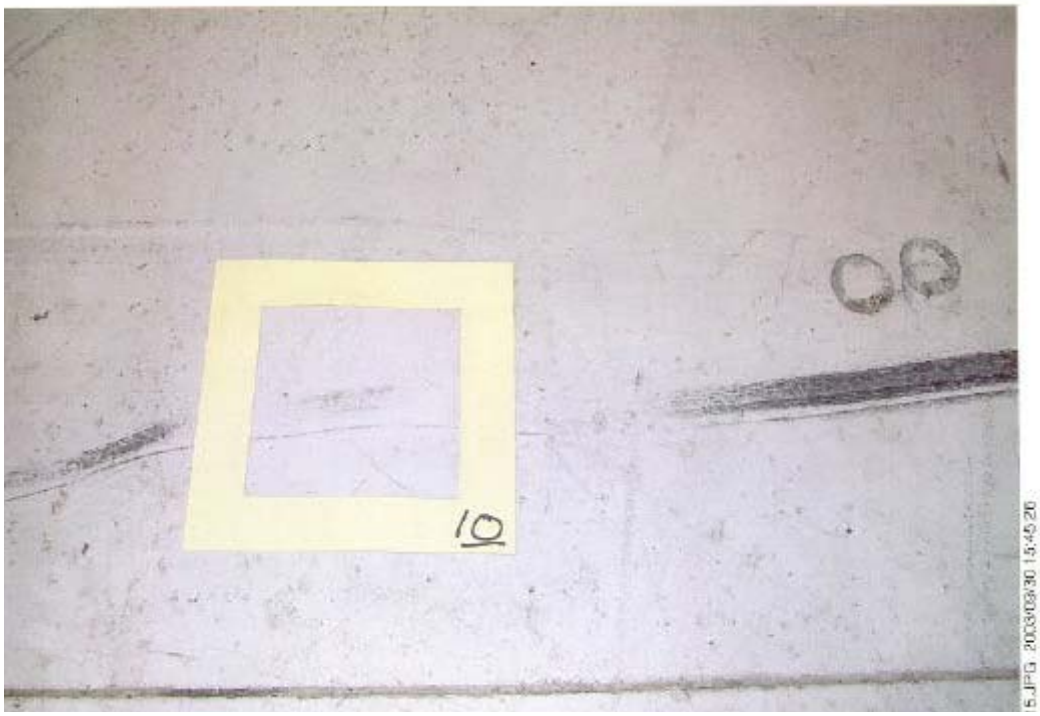

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

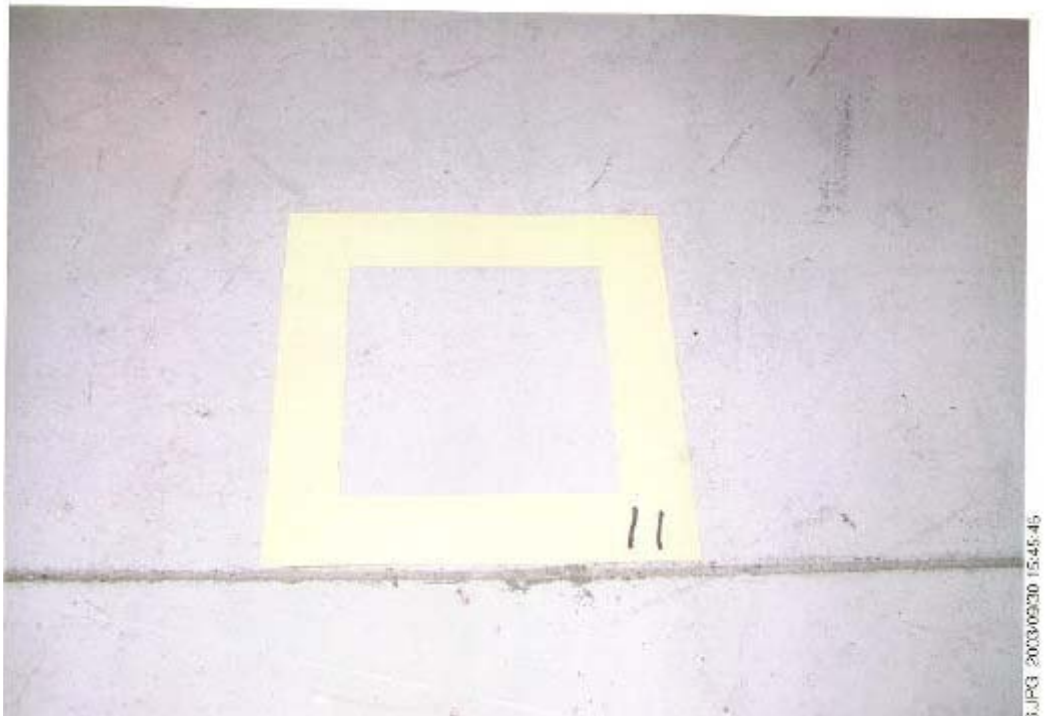

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

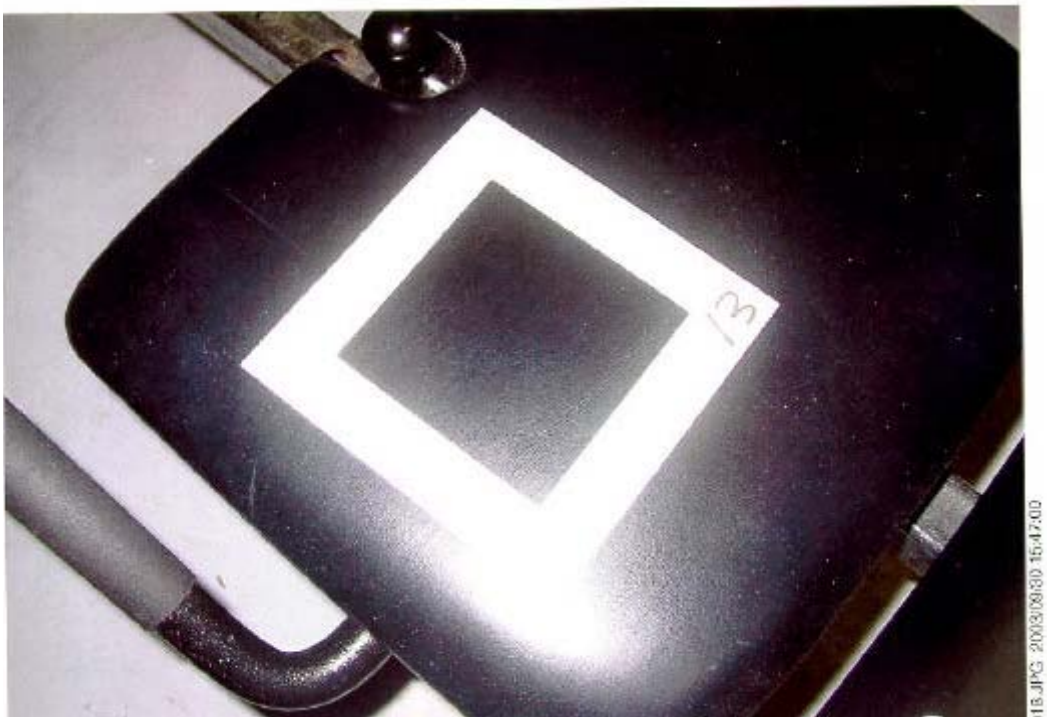

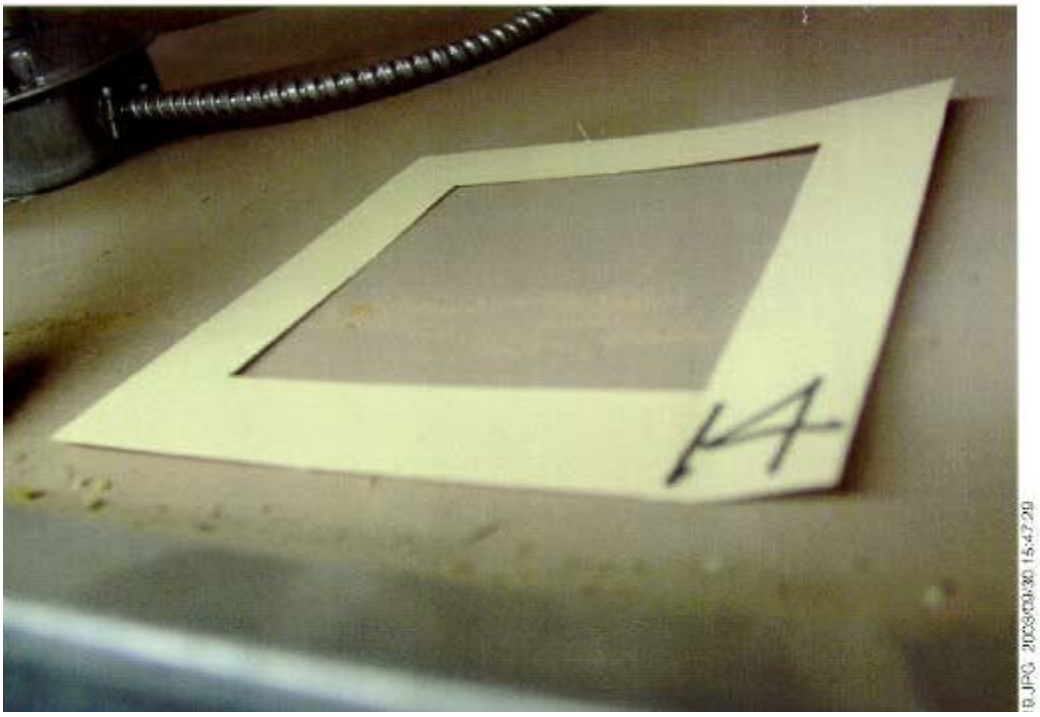

MDARNG IH Baseline Survey, Congressman Steny Hoyer Armory & FMS #8A, Cheltenham, MD, Report No. 55-ML-01ED-03/07, 21 August & 30 September 2003

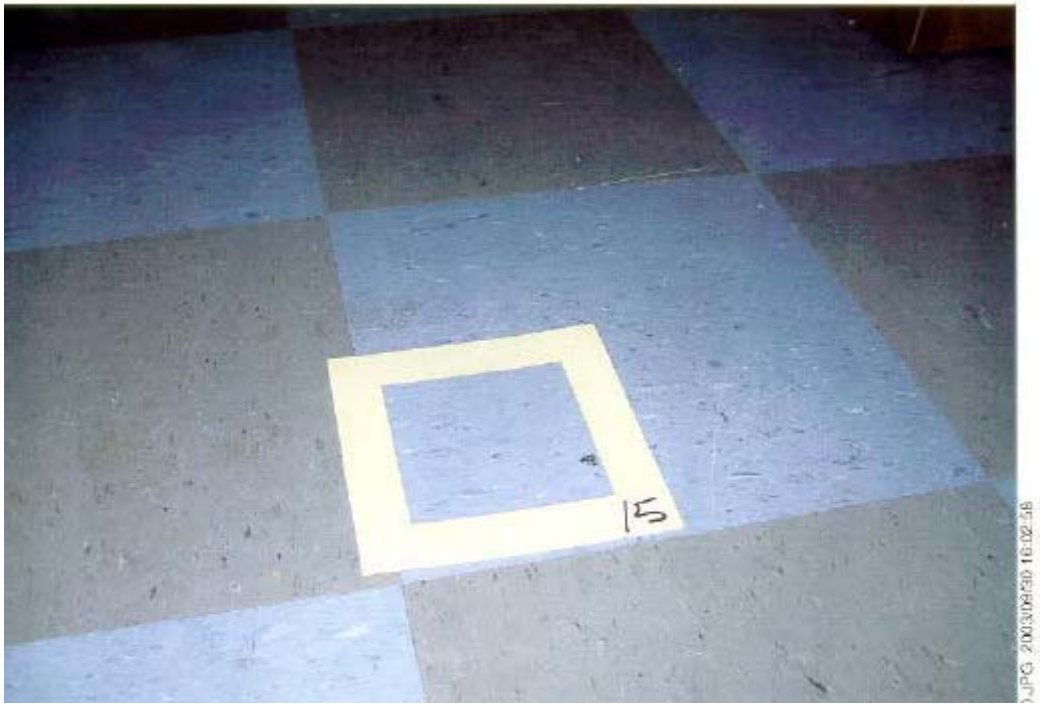

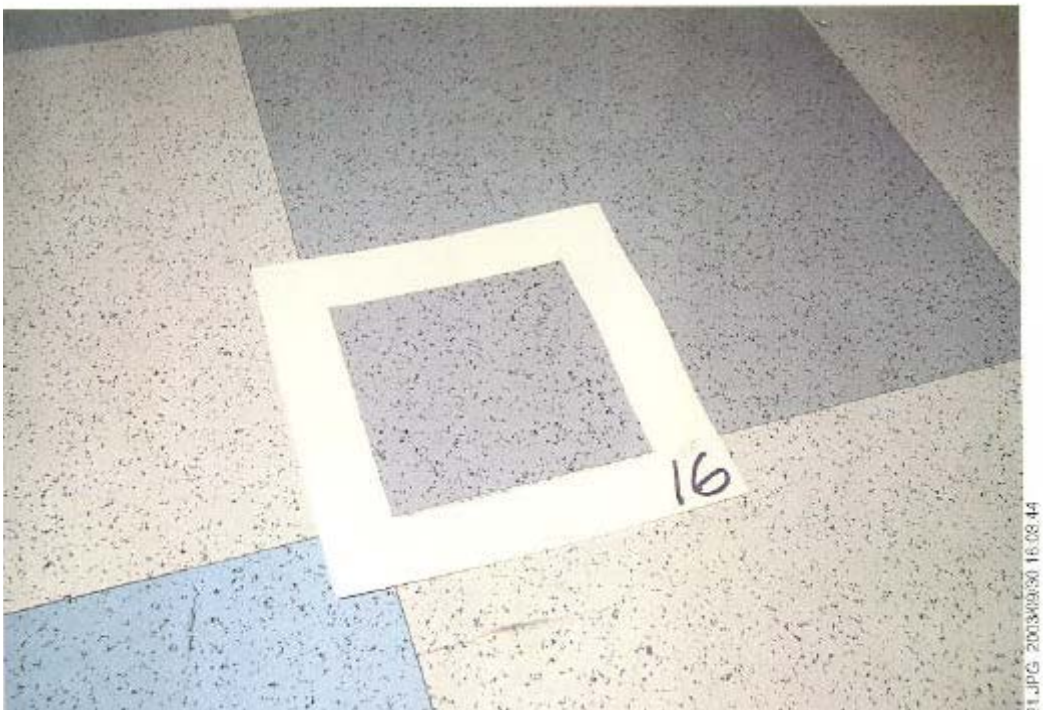

BEST AVAILABLE COPY

APPENDIX D

LABORATORY REPORTS

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1668 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	Nationa Guard	**Chain Of Custody:**	116954
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road Aberdeen Proving Grounds, Maryland 21010-5403	**Job Location:**	Cheltenham & Oleny Armories	**Date Analyzed:**	
		Job Number:	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Report Date:**	09-Oct-03
Attention:	[redacted]				

Page 1 of 1

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0401849	OLAIRBlank 01	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0401850	OLAIR 01	Flame	Air	263	N/A	11.41	ug/m³	<	11	ug/m³	
0401851	OLAIR 02	Flame	Air	249	N/A	12.05	ug/m³	<	12	ug/m³	
0401852	CHAIRBlank 01	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0401853	CHAIR 01	Flame	Air	300	N/A	10.00	ug/m³	<	10	ug/m³	
0401854	CHAIR 02	Flame	Air	272	N/A	11.03	ug/m³	<	11	ug/m³	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analyst: Daniel P. Swanson **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1669 of 5269
Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1670 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	National Guard	**Chain Of Custody:**	116958
Address:	Attn: MCHB-TS-OES, 5158 Blackhawk Road	**Job Location:**	Cheltenham Armory	**Date Analyzed:**	10 13 2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Report Date:**	13-Oct-03
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0401873	CHWBlank 01	Furnace	Wipe Blank	****	N/A	0.30	ug	<	0.3	ug	
0401874	CHW 01	Furnace	Wipe	****	0.108	2.79	ug/ft²		29	ug/ft²	
0401875	CHW 02	Furnace	Wipe	****	0.108	2.79	ug/ft²		8.6	ug/ft²	
0401876	CHW 03	Furnace	Wipe	****	0.108	2.79	ug/ft²		12	ug/ft²	
0401877	CHW 04	Furnace	Wipe	****	0.108	2.79	ug/ft²	<	2.8	ug/ft²	
0401878	CHW 05	Furnace	Wipe	****	0.108	2.79	ug/ft²		6.9	ug/ft²	
0401879	CHWBlank 02	Furnace	Wipe Blank	****	0.108	2.79	ug/ft²	<	2.8	ug/ft²	
0401880	CHW 06	Furnace	Wipe	****	0.108	174256.51	ug/ft²		290000	ug/ft²	
0401881	CHW 07	Furnace	Wipe	****	0.108	1394.05	ug/ft²		2200	ug/ft²	
0401882	CHW 08	Furnace	Wipe	****	0.108	2.79	ug/ft²		5.6	ug/ft²	
0401883	CHW 09	Furnace	Wipe	****	0.108	5.58	ug/ft²		34	ug/ft²	
0401884	CHW 10	Furnace	Wipe	****	0.108	5.58	ug/ft²		33	ug/ft²	
0401885	CHWBlank 03	Furnace	Wipe Blank	****	N/A	0.30	ug	<	0.3	ug	
0401886	CHW 11	Furnace	Wipe	****	0.108	2.79	ug/ft²		9.6	ug/ft²	
0401887	CHW 12	Furnace	Wipe	****	0.108	2.79	ug/ft²		5.2	ug/ft²	
0401888	CHW 13	Furnace	Wipe	****	0.108	2.79	ug/ft²		5.2	ug/ft²	
0401889	CHW 14	Furnace	Wipe	****	0.108	13.94	ug/ft²		73	ug/ft²	
0401890	CHW 15	Furnace	Wipe	****	0.108	2.79	ug/ft²		3.5	ug/ft²	
0401891	CHWBlank 04	Furnace	Wipe Blank	****	0.108	2.79	ug/ft²	<	2.8	ug/ft²	
0401892	CHW 16	Furnace	Wipe	****	0.108	2.79	ug/ft²		3.8	ug/ft²	

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (88863), NVLAP (# 101143), & New York ELAP (#10926) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

APPENDIX E
LEAD CLEANING GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1671 of 5269

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1672 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1673 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1674 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1675 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1676 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1677 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1678 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1679 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

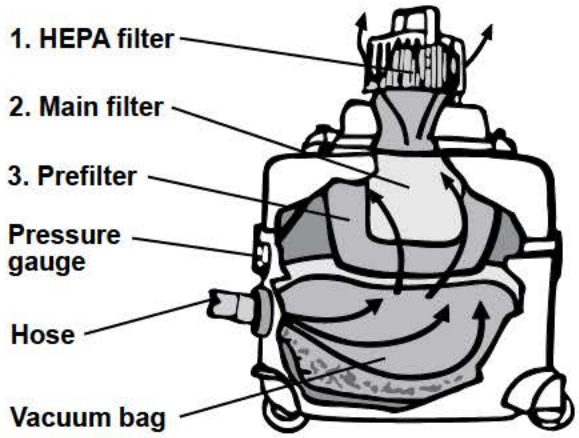

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

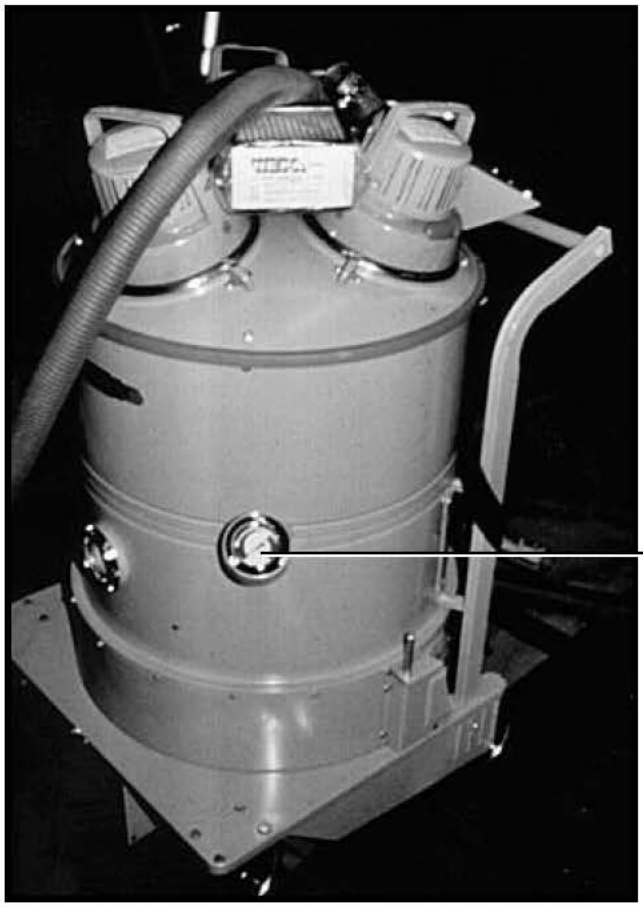

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1680 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

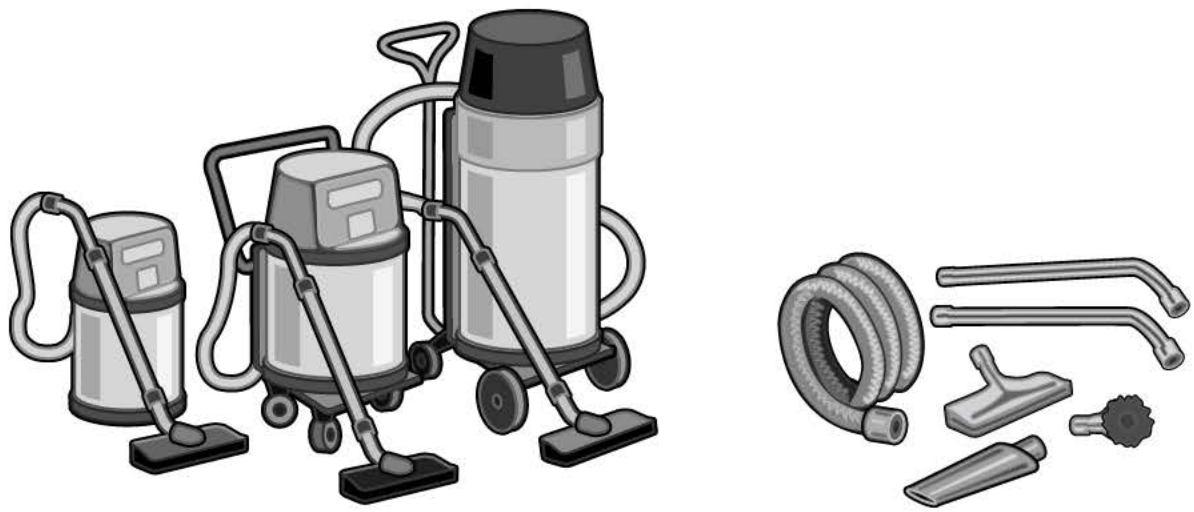

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1681 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

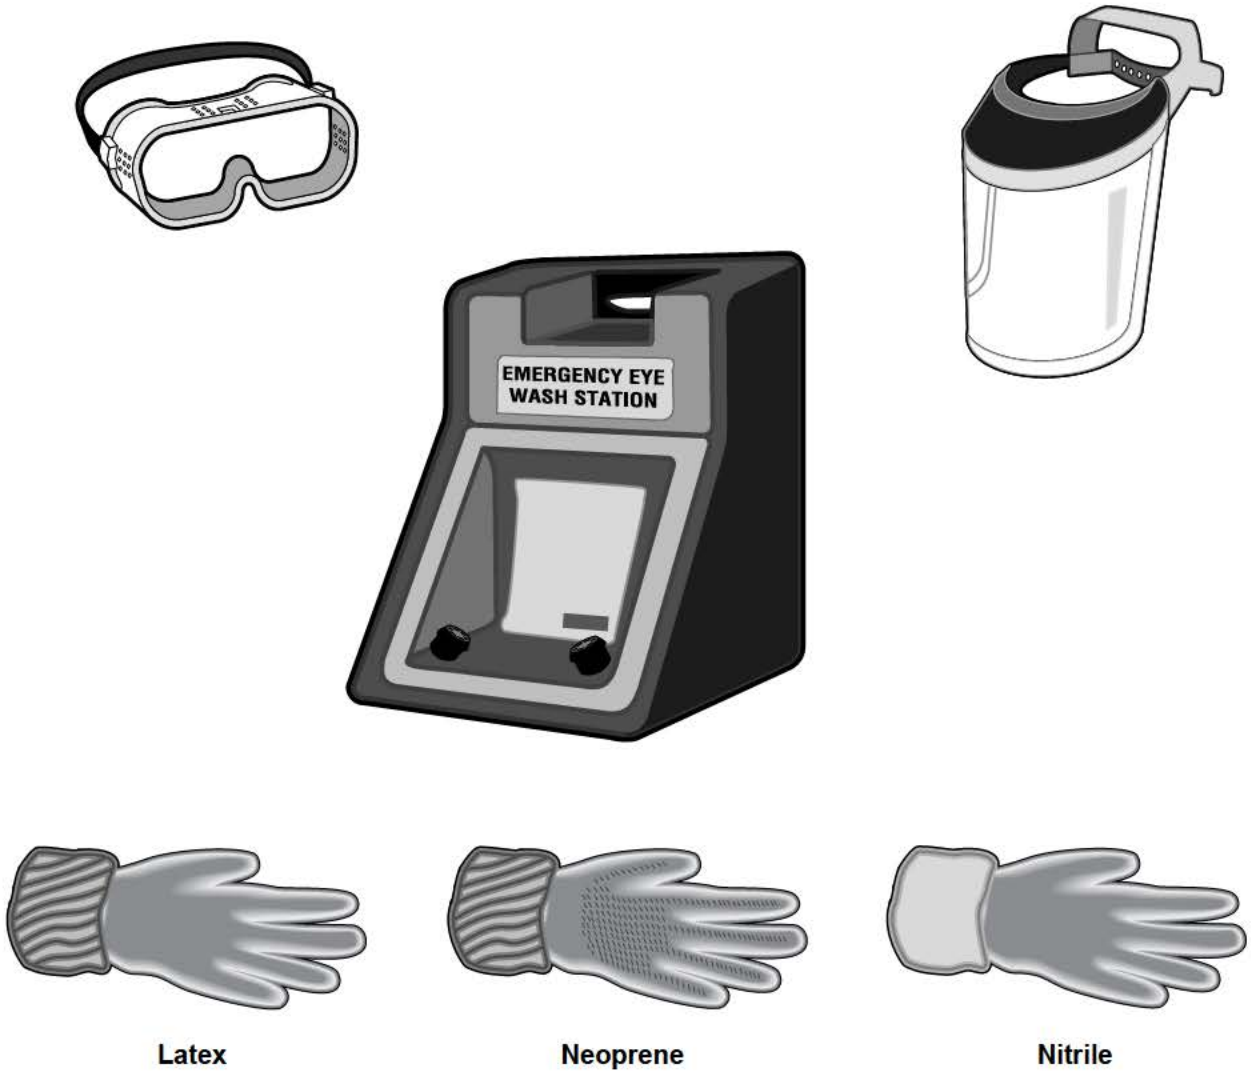

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1682 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

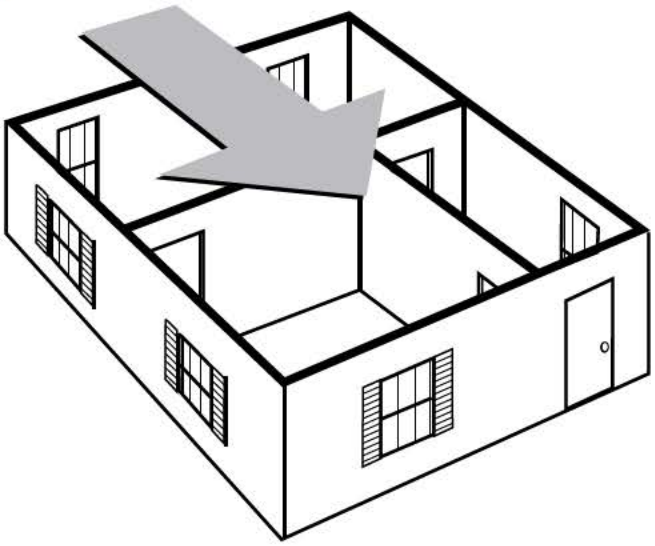

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

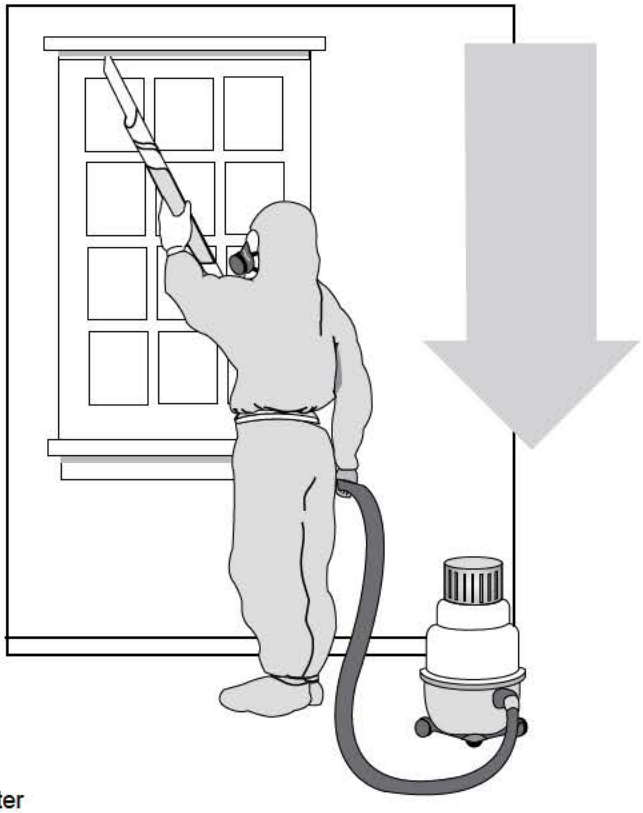

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1683 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1684 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

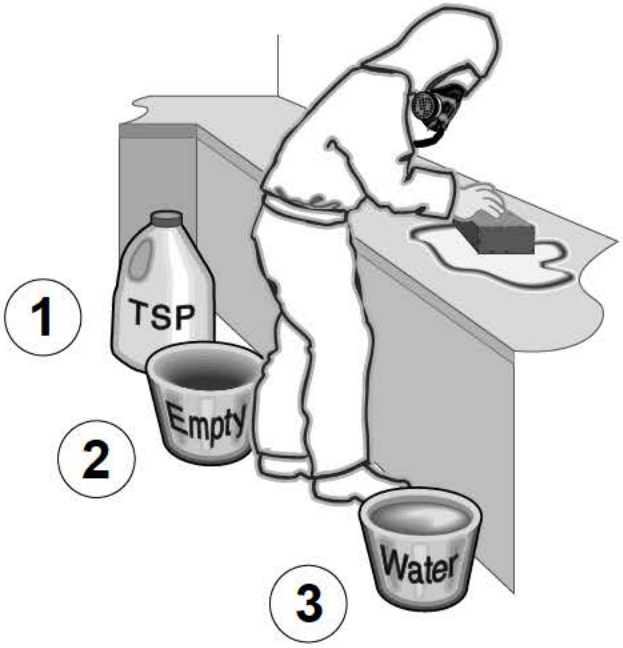

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1685 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

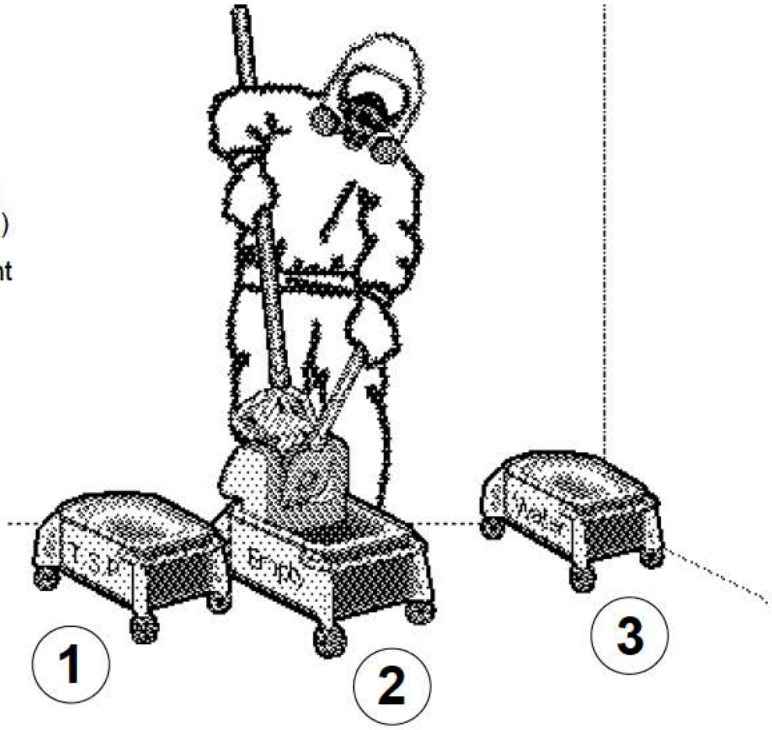

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

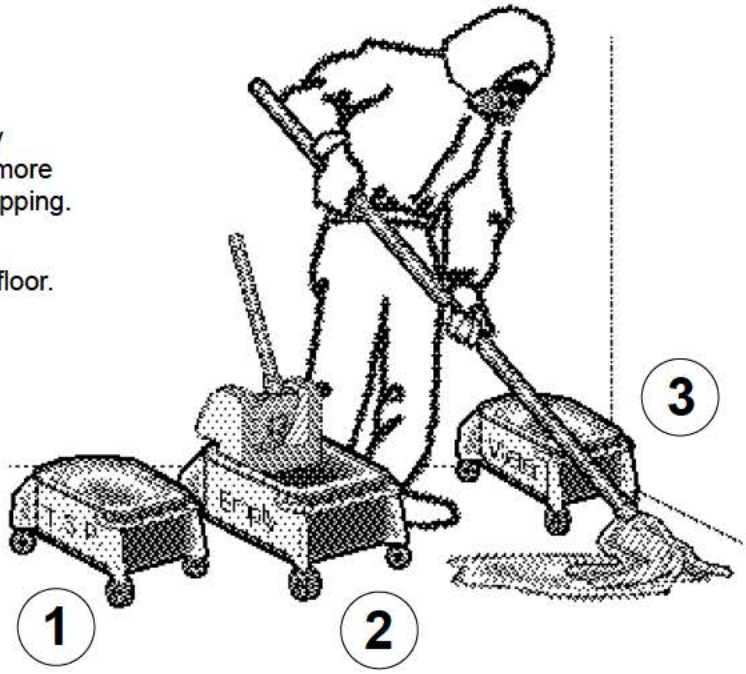

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1686 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

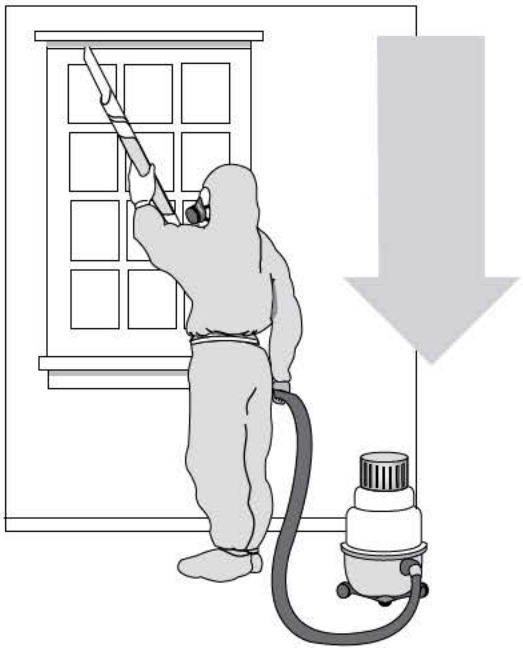

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1687 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1688 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1689 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1690 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1691 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1692 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1693 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1694 of 5269

BEST AVAILABLE COPY

1720 Walton Road Blue Bell, PA 19422 610-828-3078 Fax 610-828-7842

February 9, 2009

E-MAIL
Ms. [redacted]
NGB Regional Industrial Hygienist
Army National Guard
ATTN: NGB-ARS-IHNE
301-IH Old Bay Lane
Havre de Grace, MD 21078

Subject: Draft Industrial Hygiene Assessment Report
Cheltenham Readiness Center, Cheltenham, Maryland 20623
IES Project No. EHS08794.02

Dear Shirley:

IES Engineers (IES) is pleased to enclose the final report of the Industrial Hygiene assessment conducted at the Army National Guard Readiness Center facility located in Cheltenham, Maryland. Thank you for the opportunity to perform this assessment. Should you have any questions, please contact [redacted] or me.

Sincerely,

[redacted] e/
[redacted], CIH
Senior Manager, Health, Safety
& Industrial Hygiene Services

cc: [redacted], ARNG
[redacted], IES
[redacted], IES

Posted to NGB FOIA Reading Room
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ENGINEERS

NATIONAL GUARD BUREAU
REGION NORTH INDUSTRIAL HYGIENE OFFICE
HAVRE DE GRACE, MARYLAND

FINAL
INDUSTRIAL HYGIENE ASSESSMENT
CHELTENHAM READINESS CENTER
9900 SURRATTS ROAD, CHELTENHAM, MD 20623
SURVEY DATE: JULY 25, 2008

IES PROJECT NO. EHS08794.02
REPORT DATE: FEBRUARY 9, 2009

Prepared and submitted by:

Non-Responsive [redacted]
[redacted]
Industrial Hygienist

Certified Industrial Hygienist review by:

[redacted]
[redacted] CIH
Senior Manager, Health, Safety & Industrial Hygiene Services

BEST AVAILABLE COPY

TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
	1.1 Introduction	1
	1.2 Facility Description	1
	1.3 Findings and Conclusions	2
	1.4 Recommendations	3
2.0	OPERATION DESCRIPTION	4
3.0	SAMPLE RESULTS AND MEASUREMENTS	5
	3.1 Air Sampling	5
	3.1.1 Indoor Air Quality	5
	3.1.2 Airborne Lead Sampling	6
	3.2 Lead Dust Sampling	7
	3.3 Illuminance Survey	8
4.0	ONSITE OBSERVATIONS	9
	4.1 Physical Conditions of RC	9
	4.2 Housekeeping	9
5.0	EQUIPMENT AND CALIBRATION DATA	10
	5.1 Sampling Equipment List	10
	5.2 Sampling Equipment Calibration Data	10
6.0	REFERENCES	11

TABLES

Table 1 – Air Temperature, Relative Humidity, CO_2 and CO Measurements	5
Table 2 – Airborne Lead Sampling Results Summary	7
Table 3 – Wipe Sample Results Summary	8
Table 4 – Illuminance Readings Summary	9
Table 5 –Sampling Equipment List	10

BEST AVAILABLE COPY

Table 6 - Sampling Equipment Calibration Data 10

APPENDIX

Appendix A – Readiness Center Photographs

Appendix B –Indoor Air Quality Sample Location Map

Appendix C – Air and Wipe Sampling Results

Appendix D – Lead Wipe Sample Location Map

Appendix E – Illuminance Readings Map

BEST AVAILABLE COPY

1.0 EXECUTIVE SUMMARY

1.1 Introduction

Assessment Date: July 25, 2008

Purpose: The National Guard Bureau (NGB) retained IES Engineers (IES) to assist it in performing an Industrial Hygiene assessment at the Army National Guard (ARNG) Readiness Center (RC) located at 9900 Surratt Road in Cheltenham, Maryland. The purpose of the Industrial Hygiene survey was to identify and measure the existence and extent of potentially hazardous operations or conditions at the ARNG facility. Mr. [redacted], Industrial Hygienist, of IES, performed the assessment under the direction of Mr [redacted], CIH, Senior Manager, Health, Safety & Industrial Hygiene Services, of IES. The assessment included: evaluations of operations, including engineering, work practice, administrative, and/or personal protective equipment (PPE) controls; ventilation system evaluations, including visual observations of airflow and quantitative assessments of general ventilation systems; illumination measurements and observations of the facility and conditions.

Conferred With: SFC [redacted], Supervisor, Cheltenham Readiness Center

1.2 Facility Description

Cheltenham Armory/RC, located at 9900 Surratts Road, Cheltenham, Maryland is a 6,600-square foot training facility constructed of an exterior of brick and block masonry on a concrete slab. The interior construction is mostly painted block wall. The facility has a built up roof top atop corrugated metal decking. The facility contains offices, training rooms, a drill hall, kitchen and a former Indoor Firing Range (IFR) that was converted into a fitness center. Photographs of the facility are located in Appendix A of this report.

The RC is a one story training facility that was built around 1995. The interior walls of the multi-room facility are of block construction. A majority of ceilings within the facility are drop ceilings. The facility is not ventilated through a single system, but a majority of the offices have floor-mounted units to cool the space in the warmer months of the year. Normal working hours for the four full time personnel are generally Tuesday through Friday from 0630 to 1700. Training at the facility occurs once a month for a weekend in duration. On the day of the IH assessment, the shop was maintained by one administration personnel and one maintenance personnel.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1699 of 5269

1.3 Findings and Conclusions

The main findings and conclusions of the assessment are:

- On the day of the assessment there were two on-site personnel, who work directly with the Readiness Center. During a normal 10-hour day, the supervisors performed logistical work. Care of the facility is maintained by an outside contractor.

- Airborne lead was not detected in either of the two general area air samples collected on the day of the assessment. The airborne lead concentrations in each of the air samples were reported at less than 4.6 micrograms of lead per cubic meter of air ($\mu g/m^3$), which is well below the OSHA Action Level of 40 $\mu g/m^3$ for lead over a 10-hour workday.

- Wipe samples for lead that were collected from various horizontal surfaces throughout the Readiness Center indicated that the surface lead concentrations in certain areas exceeded the recommended precautionary level of 200 micrograms of lead per square foot of surface sampled ($\mu g/ft^2$). Additional cleaning using HEPA filtered vacuum systems and/or wet methods is recommended for these areas to help further reduce the potential for personnel exposure to lead.

- The air temperatures within the facility ranged from 78.6°F to 81.5°F, as compared to an outdoor temperature of 79.3°F. A majority of the temperatures collected inside the building exceeded what is considered comfortable, as recommended by the American Society of Heating, Refrigerating and Air Conditioning Engineers (ASHRAE). These areas were occupied sporadically throughout the day of the assessment. All occupied areas assessed were ventilated by floor-mounted air condtioning units that condition outdoor air. IES was informed that the facility has a roof-top air-handling unit, but it has not worked for six years. Indoor relative humidity ranged from 42.9% to 51.4% in the facility, as compared to an outdoor level of 51.5%. These levels are within the recognized comfort range of 30 to 60%.

- The average illuminance levels in several areas throughout the facility were below the recommended values. Although the lower-than-recommended lighting levels are not expected to present an imminent hazard, safety and ergonomic improvements could result from enhanced lighting in these areas.

- All building materials present within the RC were in good condition on the day of the Industrial Hygiene Assessment. IES observed all presumed asbestos-containing materials (PACM) and facility paint were in good condition. IES did not observe any mold growth, nor were there indications of mold and bacteria growth. No building materials samples were collected on the day of the survey.

- Various health and safety items were identified during the comprehensive survey. These violations included:

- Numerous fire extinguishers throughout the facility were blocked
- Emergency lights did not work when tested

1.4 Recommendations

IES' recommendations resulting from this assessment are included in a separate document entitled, are included in a separate document entitled, "Cheltenham_RC_08_Recommendations."

BEST AVAILABLE COPY

2.0 OPERATION DESCRIPTION

INSTALLATION: RC Army National Guard
BUILDING: 9900 Surratts Road, Cheltenham, Maryland 20623
LOCATION: Site wide

OPERATION DESCRIPTION: On the day of the assessment, IES witnessed routine operations for the RC. Supervisors were preparing for a recruitment activity that occurred later that day at an off-site location. Training at the RC occurs once a month, a weekend at a time.

CHEMICAL AND PHYSICAL AGENTS SAMPLED: Personal and area sampling for lead was performed on the day of the assessment during what is considered routine operations when training is not taking place at the facility. General IAQ measurements were made throughout the facility to evaluate ambient conditions on the day of the assessment.

LIGHTING: The average illuminance levels in several areas throughout the shop were below the recommended values. Refer to Section 3.3 of this report for a summary of the lighting measurements.

INTERPRETATION OF RESULTS: The personal and general area lead sample results suggest that the likelihood of personnel exposure to airborne lead dust is low. Wipe samples for lead that were collected from various horizontal surfaces throughout the Readiness Center indicated that the surface lead concentrations in certain areas exceeded the recommended precautionary level of 200 $\mu g/ft^2$. Although there is limited correlation between surface lead contamination and airborne lead exposures, it is recommended that the affected areas be thoroughly cleaned using HEPA filtered vacuum systems and/or wet methods. The average illuminance levels in several areas throughout the facility were below the recommended values. Although the lower-than-recommended lighting levels are not expected to present an imminent hazard, safety and ergonomic improvements could result from enhanced lighting in these areas. A majority of temperatures within the facility exceeded the comfort levels set forth by ASHRAE. All building materials present within the RC were in good condition on the day of the Industrial Hygiene Assessment. IES observed all presumed asbestos-containing materials (PACM) and facility paint were in good condition. IES did not observe any mold growth, nor were there indications of mold and bacteria growth.

Posted to NGB FOIA Reading Room BEST AVAILABLE COPY FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1702 of 5269

ENGINEERS

3.0 SAMPLE RESULTS AND MEASUREMENTS

3.1 Air Sampling

3.1.1 Indoor Air Quality

Measurements of air temperature, relative humidity, and CO_2 and CO concentrations were made using a calibrated direct reading hand-held TSI Q-Trak Indoor Air Quality instrument. The carbon monoxide sample results were compared with the Threshold Limit Values (TLVs) for exposure assessment purposes. TLVs are established by the American Conference of Governmental Industrial Hygienists (ACGIH) and are published annually in ACGIH's *TLVs and BEIs*. They refer to airborne exposure concentrations and represent conditions under which it is believed that nearly all workers may be repeatedly exposed day after day without adverse health effects. However, because of wide variations in individual susceptibility, a small percentage of workers may experience discomfort from or be affected by some substances at concentrations below the recommended threshold limit.[1]

Table 1 details the air temperature, relative humidity, CO_2, and CO measurements collected throughout the building during the assessment. Refer to the Indoor Air Quality maps in Appendix B for the IAQ measurements at each location throughout the facility.

TABLE 1
AIR TEMPERATURE, RELATIVE HUMIDITY, CO_2, AND CO MEASUREMENTS

Date of Assessment: July 25, 2008
Location: National Guard RC, Cheltenham, Maryland
Analyte(s): CO_2, CO, Temperature, and Relative Humidity
Exposure Guidelines: CO_2: Indoor CO_2 concentrations should be maintained at less than 700 ppm above outdoor air levels (ASHRAE 62.1-2007)[2]
CO: 25 ppm (ACGIH TLV-TWA)
Temperature: 68 ºF to 79 ºF (ASHRAE 55-2004)[3]
Relative Humidity: 30% to 60% (ASHRAE 55-2004)[3]

Sample ID	Sample Description	Start - End Time (hh:mm)	Sample Time	CO_2 (ppm)	CO (ppm)	Measured Temperature (°F)	Measured Relative Humidity (%)
A	**Outdoor** - Area Sample (AS) – Approximately four feet above the ground outside of the RC.	1015 – 1019	4 Min.	**350**	**0**	**79.3**	**51.5**
B	**Assembly Hall** – AS – Approximately four feet above the floor at the center of the Assembly Hall.	1019 – 1023	4 Min.	**436**	**0**	**79.8**	**51.4**
C	**Orderly Office** – AS – Approximately four feet above the floor at the center the Orderly Office.	1023 – 1027	4 Min.	**761**	**0**	**81.5**	**44.5**
D	[redacted] **Office** – AS – Approximately four feet above the floor at the center of [redacted] Office.	1027 – 1031	4 Min.	**755**	**0**	**81.4**	**42.9**

Sample ID	Sample Description	Start - End Time (hh:mm)	Sample Time	CO_2 (ppm)	CO (ppm)	Measured Temperature (°F)	Measured Relative Humidity (%)
E	Non-Responsive **Office** – AS – Approximately four feet above the floor at the center of Non-Responsive Office.	1031 – 1035	4 Min.	**713**	**0**	**81.4**	**42.9**
F	**Kitchen** – AS – Approximately four feet above the floor at the center of kitchen.	1035 – 1039	4 Min.	**802**	**0**	**78.9**	**43.3**
G	**Hallway** – AS – Approximately four feet above the floor in the middle of Hallway 127.	1039 – 1043	4 Min.	**792**	**0**	**80.2**	**43.3**
H	**Hallway** – AS – Approximately four feet above the floor in the middle of Hallway 128.	1043 – 1047	4 Min.	**788**	**0**	**80.4**	**43.1**
I	**Hallway** – AS – Approximately four feet above the floor in the middle of Hallway 129.	1047 - 1051	4 Min.	**822**	**0**	**78.6**	**43.1**
J	**Fitness Center** - AS – Approximately four feet above the floor in the center of the Fitness Center	1051 – 1055	4 Min.	**809**	**0**	**78.7**	**43.2**

Note: - All airborne CO_2 and CO concentrations are expressed in parts of contaminant per million parts of air (ppm)

Refer to Section 6.0, Equipment and Calibration Data, for the calibration data for the equipment used to perform the IAQ survey.

3.1.2 Airborne Lead Sampling

Air samples for lead were collected with personal air sampling pumps on 0.8 µm mixed cellulose ester (MCE) filters. All sampling pumps were calibrated before and after the sampling period with a primary gas flow standard. Area samples were collected as a part of this assessment. Following the assessment, the air samples and an appropriate number of field blanks were shipped via overnight courier to AMA Analytical (AMA) in Lanham, Maryland, which is accredited by the American Industrial Hygiene Association (AIHA) for analysis and participates in the Environmental Lead Accreditation Program (ELAP). The air samples were analyzed for lead using the EPA 600/R-93/200 Flame Atomic Absorption Spectroscopy (FAAS) method. All air sample results were reported in micrograms of lead cubic per meters of air sample ($\mu g/m^3$) for the purposes of this assessment.

Air sample results for lead were compared to the Action Level and Permissible Exposure Limits (PELs) published in OSHA 1910.1025, the expanded health standard for lead. Action Levels and PELs are promulgated through the OSHA rule-making process and act as legal limits for exposure in the work place. They are intended to provide protection to employees who are potentially exposed to airborne contaminants. The Action Level for lead is expressed in terms of an 8-hour time-weighted average (TWA) contaminant concentration. The PELs for lead are expressed in terms of 8-hour TWAs. Copies of the OSHA regulations are available through the local OSHA Area Office, in the Federal Register, or on the OSHA website at *www.osha.gov*.[4]

This report's findings are based on the lead samples collected during the assessment, which are summarized in Table 2. Refer to Appendix C for the complete laboratory air sample analysis results. Worksite Sampling Data Records are included in a separate document entitled, "Cheltenham_RC_08_Medical."

TABLE 2
AIRBORNE LEAD SAMPLING RESULTS SUMMARY

Date of Monitoring: July 25, 2008
Location: Army National Guard RC, Cheltenham, Maryland
Analyte(s): Lead
Occupational Exposure Limits: Lead: OSHA PEL-TWA = 50 $\mu g/m^3$
OSHA Action Level (TWA) = 30 $\mu g/m^3$

Sample ID	Equipment ID	Sample Description	Start Time	End Time	Sample Time (Min.)	Flow Rate (lpm)	Air Volume (l)	Measured Airborne Contaminant Concentration
072508-A001	103	**SGT** [redacted] – Personal Sample - Operator Breathing Zone (PS-OBH) – During normal operations within the Cheltenham Armory.	0705	1230	325	2.01	653.3	<4.6 $\mu g/m^3$
072508-A002	104	**SGT** [redacted] **Office** – Area Sample - Operator Breathing Zone (AS-OBH) – During normal operations within in the Readiness Center.	0705	1230	325	1.99	646.8	<4.6 $\mu g/m^3$

Note: - Sample results for lead are expressed as micrograms of contaminant per cubic meter of air ($\mu g/m^3$)
- PEL-TWA = OSHA Permissible Exposure Level, 8-Hour TWA

3.2 Lead Dust Sampling

IES performed wipe sampling in the Drill Hall, converted IFR and in select areas throughout the facility. All wipe sampling was performed in accordance with: best Industrial Hygiene practices and the guidelines published in Section II: Chapter 2, Sampling for Surface Contamination, of the OSHA Technical Manual. The wipe samples were collected over 100 square centimeter areas using pre-wetted Ghost Wipes. The wipe samples collected as a part of this assessment, along with appropriate field blanks, were shipped to AMA for analysis and were analyzed using the NIOSH 7082 flame atomic absorption spectrophotometer (FAAS) method. All wipe sample results were reported in micrograms of lead per square foot of surface sampled ($\mu g/ft^2$) for the purposes of this assessment.

This report's findings are based on the lead samples collected during the assessment, which are summarized in Table 3. Refer to Appendix D for sample locations and Appendix C for the complete laboratory wipe sample analysis results. Worksite Sampling Data Records are included in a separate document entitled, "Cheltenham_RC_08_Medical."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #U-15-0085 (MD)
Released by National Guard Bureau
Page 1705 of 5269

ENGINEERS

TABLE 3 – WIPE SAMPLE RESULTS SUMMARY

Date of Monitoring: July 25, 2008
Location: Army National Guard RC, Cheltenham, Maryland
Analyte(s): Lead
Occupational Exposure Limits: ARNG Recommended Cleaning Level = 200 $\mu g/ft^2$

Sample ID	Sample ID	Location	Area of Surface Sampled	Measured Lead Surface Contamination ($\mu g/cm^2$)
A	072508-SW001	**Drill Hall** -Wipe Sample (WS)- Horizontal surface of Coke Machine	100 cm^2	<110
B	072508-SW002	**Drill Hall** -WS- Horizontal surface of storage cabinet	100 cm^2	<110
C	072508-SW003	**Drill Hall** -WS- Center of Drill Hall floor surface	100 cm^2	<110
D	072508-SW004	**Kitchen** -WS-Top of Continental Refrigerator	100 cm^2	<110
E	072508-SW005	Non-Responsive **Office** -WS-Surface of file cabinet	100 cm^2	<110
F	072508-SW006	**Converted Rifle Range** -WS-Surface ventilation exhaust at entrance	100 cm^2	<110
G	072508-SW007	**Converted Rifle Range** -WS-Surface ventilation exhaust at back	100 cm^2	<110
H	072508-SW008	**Converted Rifle Range** -WS-Surface of floor at side entrance	100 cm^2	300
I	072508-SW009	**Converted Rifle Range** -WS-Surface of floor at rear stage	100 cm^2	980
J	072508-SW010	**Converted Rifle Range** -WS-Surface of hallway floor outside of range	100 cm^2	<110
K	072508-SW011	**Orderly Office** -WS-Surface of Retention file cabinet	100 cm^2	<110
L	072508-SW012	**Orderly Office** -WS-Surface of CPT Non-Respor desk	100 cm^2	<110
M	072508-SW013	**Orderly Office** -WS-Surface of refrigerator	100 cm^2	<110
N	072508-SW014	**Orderly Office** -WS-Surface of desk in SGT Non-Responsive office	100 cm^2	<110
O	072508-SW015	**Orderly Office** -WS-Surface of hallway floor outside of Orderly Office	100 cm^2	<110
P	072508-SW016	Non-Responsive **Office** -WS-Top surface of desk	100 cm^2	<110

3.3 Illuminance Survey

The illumination survey was performed pursuant to best Industrial Hygiene practices and the guidelines found in the ARNG document entitled, "Evaluation of Lighting Standing Operating Procedure (SOP) and Illumination Requirements for Existing Facilities," dated November 17, 2007.[5] All measurements were made in slow response mode and were expressed in foot candles (fc). The measurements were used to calculate average illuminance levels for each workspace. Based on the activities conducted in each workspace, the calculated average illuminance level was compared to the ARNG recommended illuminance values. This report's findings are based on the illuminance readings collected during the survey, which are summarized in Table 4. The data reported in this table represent the average illuminance readings from the accessible locations of the commonly occupied work areas of the facility. Refer to the Illuminance Readings maps in Appendix F for sample locations.

BEST AVAILABLE COPY

ENGINEERS

TABLE 4
ILLUMINANCE READINGS SUMMARY

Survey Dates: July 25, 2008
Location: Army National Guard RC, Cheltenham, Maryland

Sample ID	Sample Description	Average Illuminance Measurements (fc)	ARNG Recommended Illuminance Value (fc)
A	Assembly Hall – Center of Hall	16.2	50
B	Hallway – Center of Hallway 127	25.2	50
C	Fitness Center – Center of Center	21.0	30
D	Men's Locker Room – Center of Locker Room	15.6	7
E	Kitchen – Center of kitchen	60.1	50
F	Class Room – Center of Room	80.8	75
G	Hallway – Center of Hallway 128	25.8	30
H	Latrine – Center of latrine	23.8	7
I	Lobby – Center of Lobby	47.1	10
J	Orderly Offices – Center of Offices	48.3	50
K	SGT Non-Respon Office – Center of Office	56.8	50
L	Non-Responsive – Center of Office	57.2	50
M	Hallway – Center of Hallway 129	34.5	30

Notes: - All illuminance measurements and recommended values are expressed in foot candles (fc)

Refer to Section 6.0, Equipment and Calibration Data, for the calibration data for the equipment used during the illumination survey.

4.0 ONSITE OBSERVATIONS

A copy of IES' field notes from this assessment is included in a separate document entitled, "Cheltenham_RC_08_Field_Notes."

4.1 Physical Condition of RC

All building materials present within the RC were in good condition on the day of the Industrial Hygiene Assessment. IES observed all presumed asbestos-containing materials (PACM) and facility paint were in good condition. IES did not observe any mold growth, nor were there indications of mold and bacteria growth. No building materials samples were collected on the day of the survey.

4.2 Housekeeping

Housekeeping within the facility was generally good. IES observed no imminent slip, trip and fall hazards on the day of the assessment. All furniture within the offices and training areas were properly maintained within the rooms.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #U-15-0085 (MD)
Released by National Guard Bureau
Page 1707 of 5269

ENGINEERS

5.0 EQUIPMENT AND CALIBRATION DATA

5.1 Sampling Equipment List

Table 5 lists the sampling equipment that was used as a part of the assessment.

TABLE 5
SAMPLING EQUIPMENT LIST

Equipment Type	Make/Model	Equipment/Serial Number	Equipment Identification
Personal Sampling Pump	MSA Escort ELF	103	103
Personal Sampling Pump	MSA Escort ELF	104	104
Primary Gas Flow Calibrator (Electronic Frictionless Piston)	Bios DryCal DC-Lite Model DCL-HM; S/N 101785	DryCal-ML	DryCal-ML
Light Meter	Extech Light Meter	401025	401025
Indoor Air Quality Monitor	TSI Model 8551 Q-Trak	51885	Q-Trak

5.2 Sampling Equipment Calibration Data

Table 6 details the calibration data for each piece of sampling equipment used during the assessment.

TABLE 6
SAMPLING EQUIPMENT CALIBRATION DATA

Equipment ID	Calibrator Used	Date of Pre-Sampling Calibration	Pre-Sampling Calibration Value (lpm)	Date of Post-Sampling Calibration	Post-Sampling Calibration Value (lpm)	Average Calibration Value (lpm)
103	DryCal-ML	7/25/08	2.01	7/25/08	2.00	2.01
104	DryCal-ML	7/25/08	1.99	7/25/08	1.99	1.99
DryCal-ML	Bench Calibrated 02/07/08	N/A	N/A	N/A	N/A	N/A
401025	NA	NA	NA	NA	NA	NA
Q-Trak	Zero Gas/ Span Gas	7/25/08	Zero Gas: 0 ppm CO_2; 0 ppm CO Span Gas 1,000 ppm CO_2; 35 ppm CO	7/25/08	Zero Gas: 0 ppm CO_2; 0 ppm CO Span Gas 1,000 ppm CO_2; 35 ppm CO	Zero Gas: 0 ppm CO_2; 0 ppm CO Span Gas 1,000 ppm CO_2; 35 ppm CO

BEST AVAILABLE COPY

6.0 REFERENCES

1. ACGIH, *2008 TLVs and BEIs*.
2. American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE), Standard 62.1-2007, "Ventilation for Acceptable Indoor Air Quality," ASHRAE, Atlanta, Georgia, 2004.
3. American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE), Standard 55-2004, "Thermal Environmental Conditions for Human Occupancy," ASHRAE, Atlanta, Georgia, 2004.
4. Occupational Safety and Health Administration, 29 CFR 1910.1025, Lead.
5. "Evaluation of Lighting Standing Operating Procedure (SOP) and Illumination Requirements for Existing Facilities," ARNG, 17 November 2007.

Posted to NGB FOIA Reading Room
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX A

FACILITY PHOTOGRAPHS

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Photograph #1 – RC Exterior

Photograph #2 – Readiness Center Drill Hall

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Photograph #3 – Converted Rifle Range

BEST AVAILABLE COPY

APPENDIX B

INDOOR AIR QUALITY SAMPLE LOCATION MAP

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

CHELTENHAM READINESS CENTER
IAQ SURVEY MAP

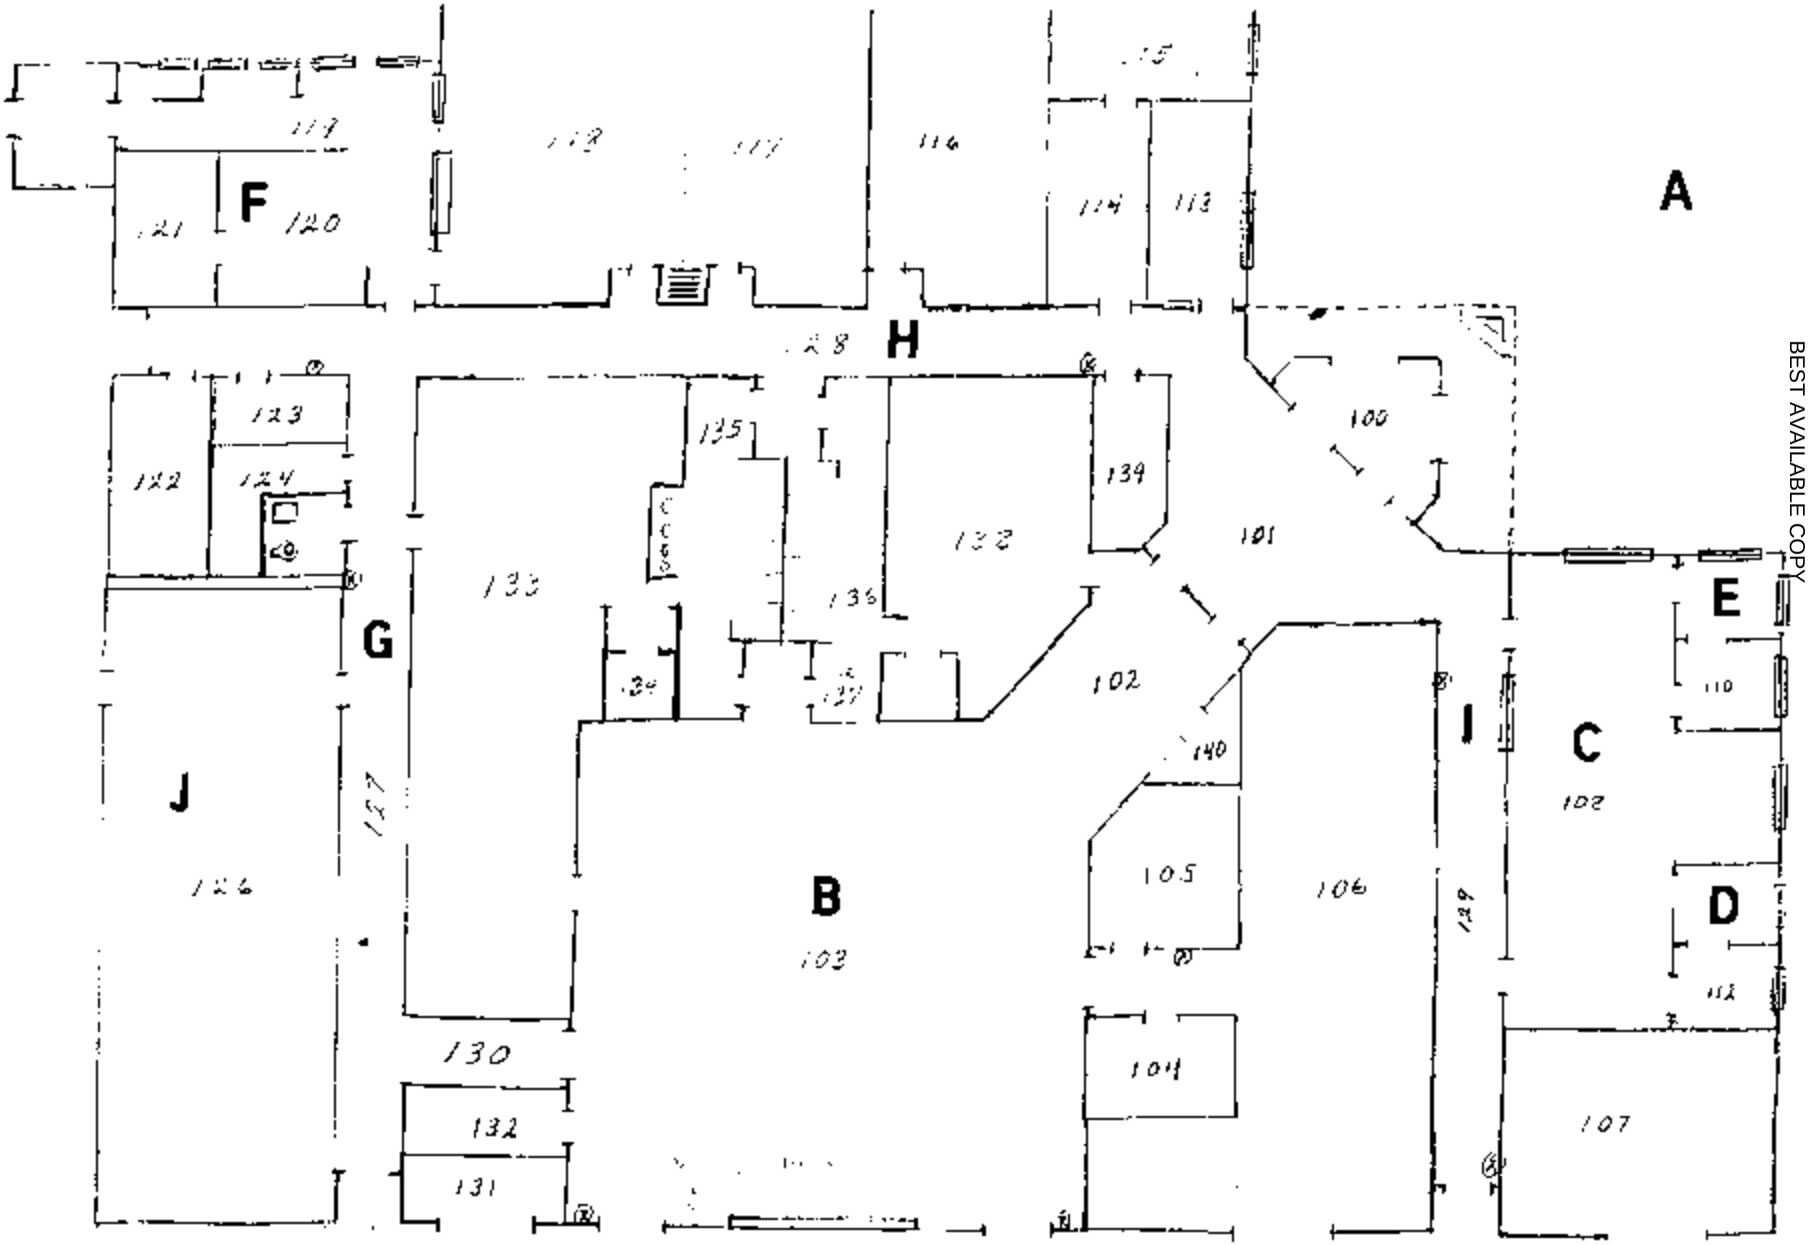

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1714 of 5269

BEST AVAILABLE COPY

APPENDIX C

AIR AND WIPE SAMPLING RESULTS

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaloap.org for details 100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	Not Provided	**Chain Of Custody:**	503006		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Cheltenham, MD	**Date Submitted:**	7/29/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	EH508749.02	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	8/1/2008	**Report Date:**	8/1/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0874024	022508-SW001	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874025	022508-SW002	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874026	022508-SW003	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874027	022508-SW004	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874028	022508-SW005	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874029	022508-SW006	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874030	022508-SW007	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874031	022508-SW008	Flame	Wipe	****	0.108	111.52	ug/ft²		300	ug/ft²	
0874032	022508-SW009	Flame	Wipe	****	0.108	111.52	ug/ft²		980	ug/ft²	
0874033	022508-SW010	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874034	022508-SW011	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874035	022508-SW012	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874036	022508-SW013	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874037	022508-SW014	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874038	022508-SW015	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874039	022508-SW016	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874040	022508-SW017	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0874041	022508-SW018	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0874042	072508-A01	Flame	Air	653	N/A	4.59	ug/m³	<	4.6	ug/m³	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #: 10085 (MD)
Released by National Guard Bureau
Page 1716 of 5269

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	Not Provided	**Chain Of Custody:**	503006		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Cheltenham, MD	**Date Submitted:**	7/29/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	EH508749.02	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	8/1/2008	**Report Date:**	8/1/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result		
0874043	022508-A02	Flame	Air	649	N/A	4.62	ug/m³	<	4.6	ug/m³
0874044	022508-A03	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson

Technical Manager: G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #: 15-0085 (MD)
Released by National Guard Bureau
Page 1717 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

* Bill the National Guard Region North 1st Office Directly

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) **503006**

1/2

Mailing/Billing Information:
1. Client Name: IES Engineers
2. Address 1: 1720 Walton Rd
3. Address 2: Blue Bell, PA 19422
4. Address 3:
5. Phone #: 610 828 3078 Fax #: 610 828 7842

Submittal Information:
1. Job Name:
2. Job Location: Cheltenham, MD
3. Job #: EH508749.02 P.O. #:
4. Contact Person: [redacted] Phone #: 610 828 3078
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS		REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day		☒ Email: [redacted] @iesengineers.com
Comments:	☐ 2 Day Date Due: 8/05/08		☐ Fax:
			☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Lead Analysis
☐ Paint Chip ____ (QTY)
☒ Dust Wipe (wipe type ghost wipe) 18 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
072508-SW001		7/25/08		100 in²				X				X				
072508-SW002								X				X				
072508-SW003								X				X				
072508-SW004								X				X				
072508-SW005								X				X				
072508-SW006								X				X				
072508-SW007								X				X				
072508-SW008								X				X				
072508-SW009								X				X				
072508-SW010								X				X				
072508-SW011								X				X				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 7/29/08 @ 0930 Via: Fed Ex By (Print): Chris Nicodemus Sign: Chris Nicodemus
2. Date/Time Analyzed: ___/___/___ @ ___ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ___/___/___ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1718 of 5269
Posted to NGB FOIA Reading Room
May, 2018

* Bill the National Guard Region North 1H office Directly

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 50506 2/2

Mailing/Billing Information:
1. Client Name: IES Engineers
2. Address 1: 1720 Walton Rd
3. Address 2: Blue Bell, PA 19422
4. Address 3:
5. Phone #: 610 828 3078 Fax #: 610 828 7842

Submittal Information:
1. Job Name:
2. Job Location: Cheltenham, MD
3. Job #: EHS08749.02 P.O. #:
4. Contact Person: [redacted] @ Phone #: 610 828 3078
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day ☐ Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Include [redacted] with Report ☒ Email: [redacted] @iesengineers.com ☐ Fax: ☐ Verbals:

Asbestos Analysis
PCM Air - Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air - Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 - Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
☐ Paint Chip ____ (QTY)
☒ Dust Wipe (wipe type chestnuts) 18 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	WIPE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
072508-SW012		7/25/08		100m²				X				X					Date/Time: Contact: By:
072508-SW013								X				X					
072508-SW014								X				X					
072508-SW015								X				X					
072508-SW016								X				X					Date/Time: Contact: By:
072508-SW017				—				X				X					
072508-SW018				—				X				X					
072508-A01			6533					X		X							
072508-A02			6468					X		X							Date/Time: Contact: By:
072508-A03			—					X		X							

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments:

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1719 of 5269
Posted to NGB FOIA Reading Room
May, 2018

* Bill the National Guard Region North 1H office Directly

SC3006 copy 1/2

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:
1. Client Name: KES Engineers
2. Address 1: 1720 Walton Rd
3. Address 2: Blue Bell, PA 19422
4. Address 3:
5. Phone #: 610 828 3078 Fax #: 610 828 7842

Submittal Information:
1. Job Name:
2. Job Location: Cheltenham, MD
3. Job #: EHS08749.02 P.O. #:
4. Contact Person: [redacted] Phone #: 610 828 3078
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☐ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☒ 5 Day +	☒ Email: [redacted] @kesengineers.com
Comments:	☐ 2 Day Date Due: ____	☐ Fax:
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
☐ Paint Chip ____ (QTY)
☒ Dust Wipe (wipe type chemical wipes) 18 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	WIPE TAPE	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
072508-SW001		7/25/08		100in²				X				X					Date/Time: Contact: By:
072508-SW002								X				X					
072508-SW003								X				X					
072508-SW004								X				X					
072508-SW005								X				X					Date/Time: Contact: By:
072508-SW006								X				X					
072508-SW007								X				X					
072508-SW008								X				X					
072508-SW009								X				X					Date/Time: Contact: By:
072508-SW010								X				X					
072508-SW011								X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1720 of 5269
Posted to NGB FOIA Reading Room
May, 2018

* Bill the National Guard Region North 1st Office Directly

503006
copy
2/2

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:
1. Client Name: IES Engineers
2. Address 1: 1720 Walton Rd
3. Address 2: Blue Bell, PA 19422
4. Address 3:
5. Phone #: 610 828 3078 Fax #: 610 828 7842

Submittal Information:
1. Job Name:
2. Job Location: Cheltenham, MD
3. Job #: EHS08749.02 P.O. #:
4. Contact Person: [redacted] @ phone # 610 828 3078
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Include COC/Field Data Sheets with Report ☒ Email: [redacted] @iesengineers.com ☐ Fax: ☐ Verbals:

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)

TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Lead Analysis
☐ Paint Chip ____ (QTY)
☒ Dust Wipe (wipe type) gnest wipes 18 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
072508-SW012		7/25/08		100m²				X				X				
072508-SW013								X				X				
072508-SW014								X				X				
072508-SW015								X				X				
072508-SW016								X				X				
072508-SW017				—				X				X				
072508-SW018				—				X				X				
072508-A01			653.3					X		X						
072508-A02			646.8					X		X						
072508-A03			—					X		X						

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1721 of 5269
Posted to NGB FOIA Reading Room
May, 2018

APPENDIX D

WIPE SAMPLING LOCATION MAP

CHELTENHAM READINESS CENTER
LEAD WIPE SAMPLE MAP

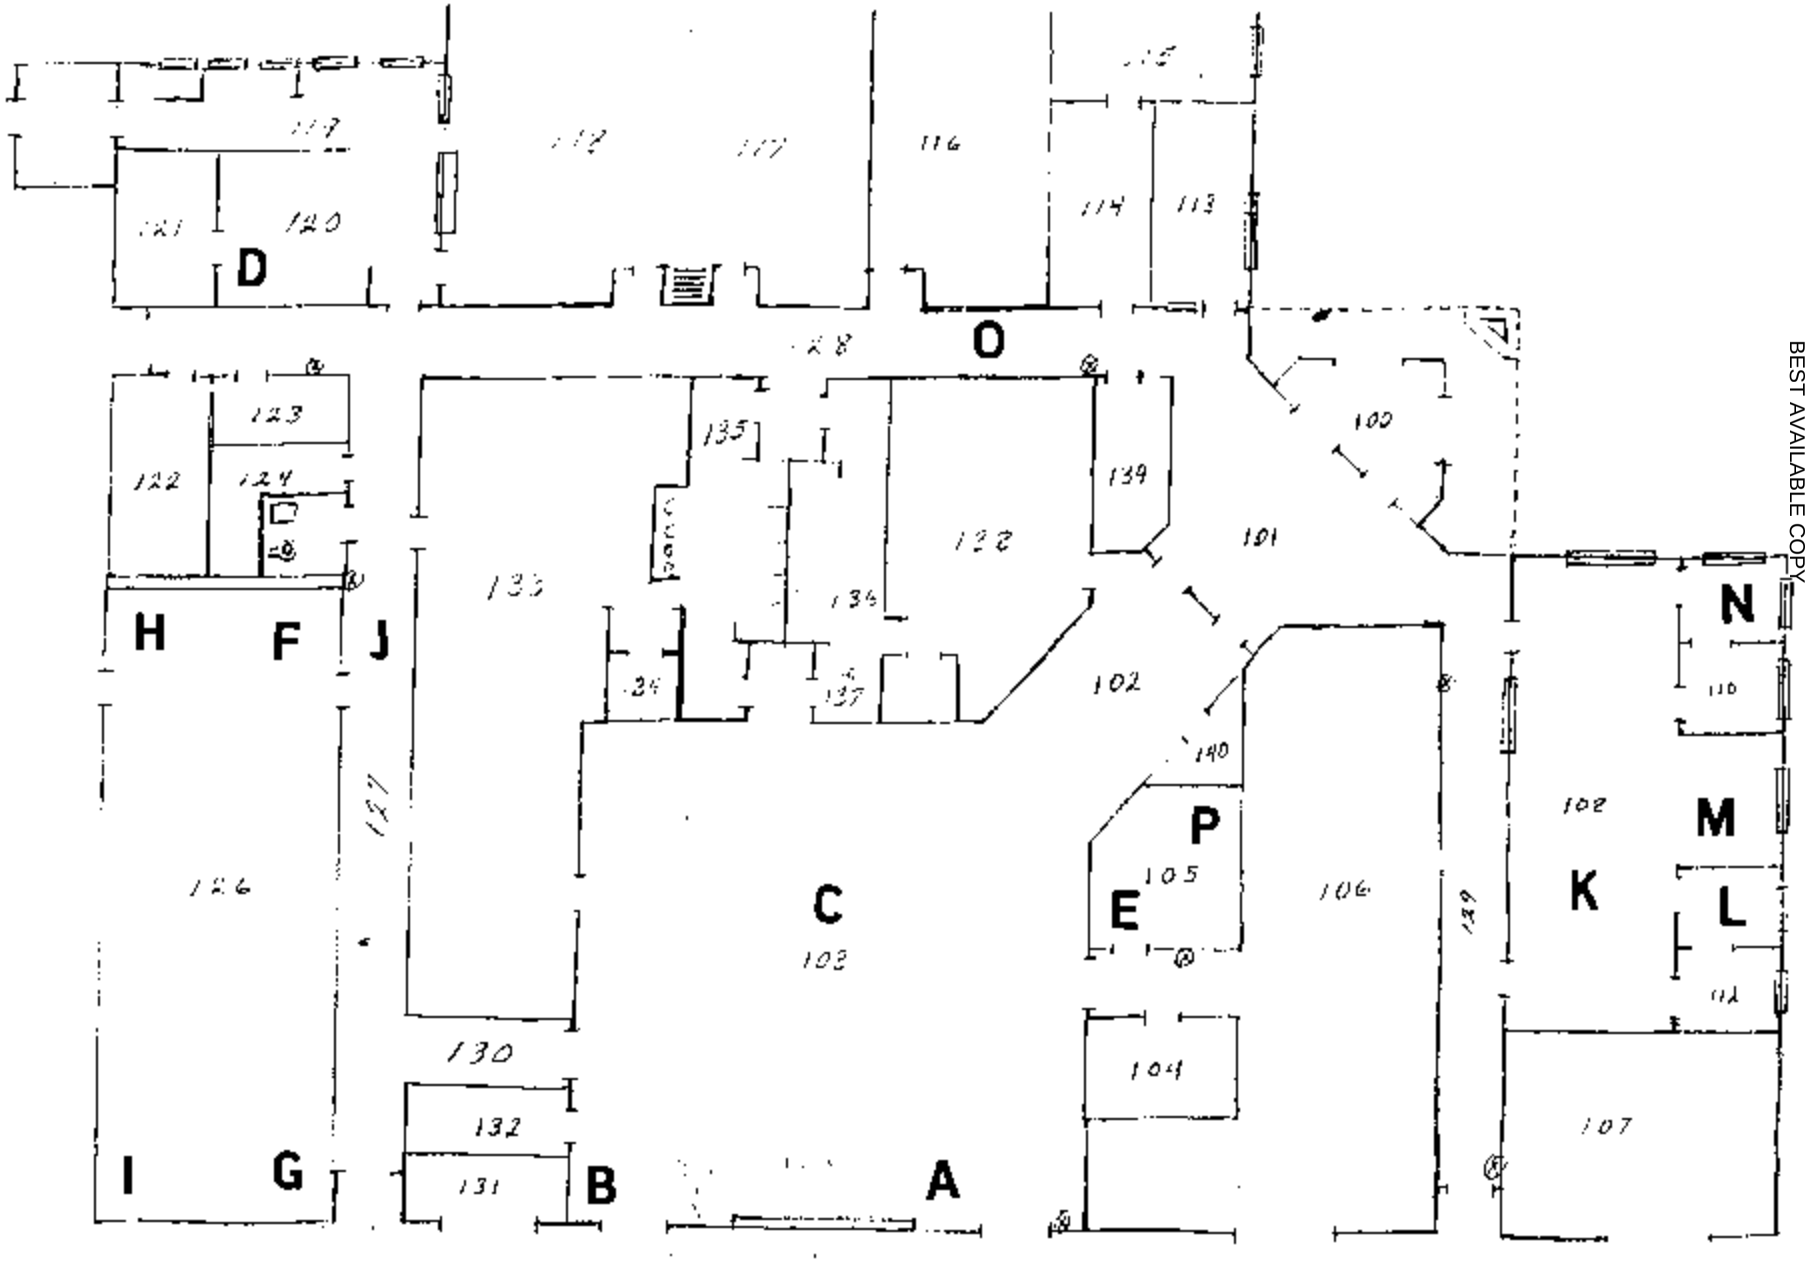

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

APPENDIX E

ILLUMINATION SURVEY MAP

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

CHELTENHAM READINESS CENTER
ILLUMINATION SURVEY MAP

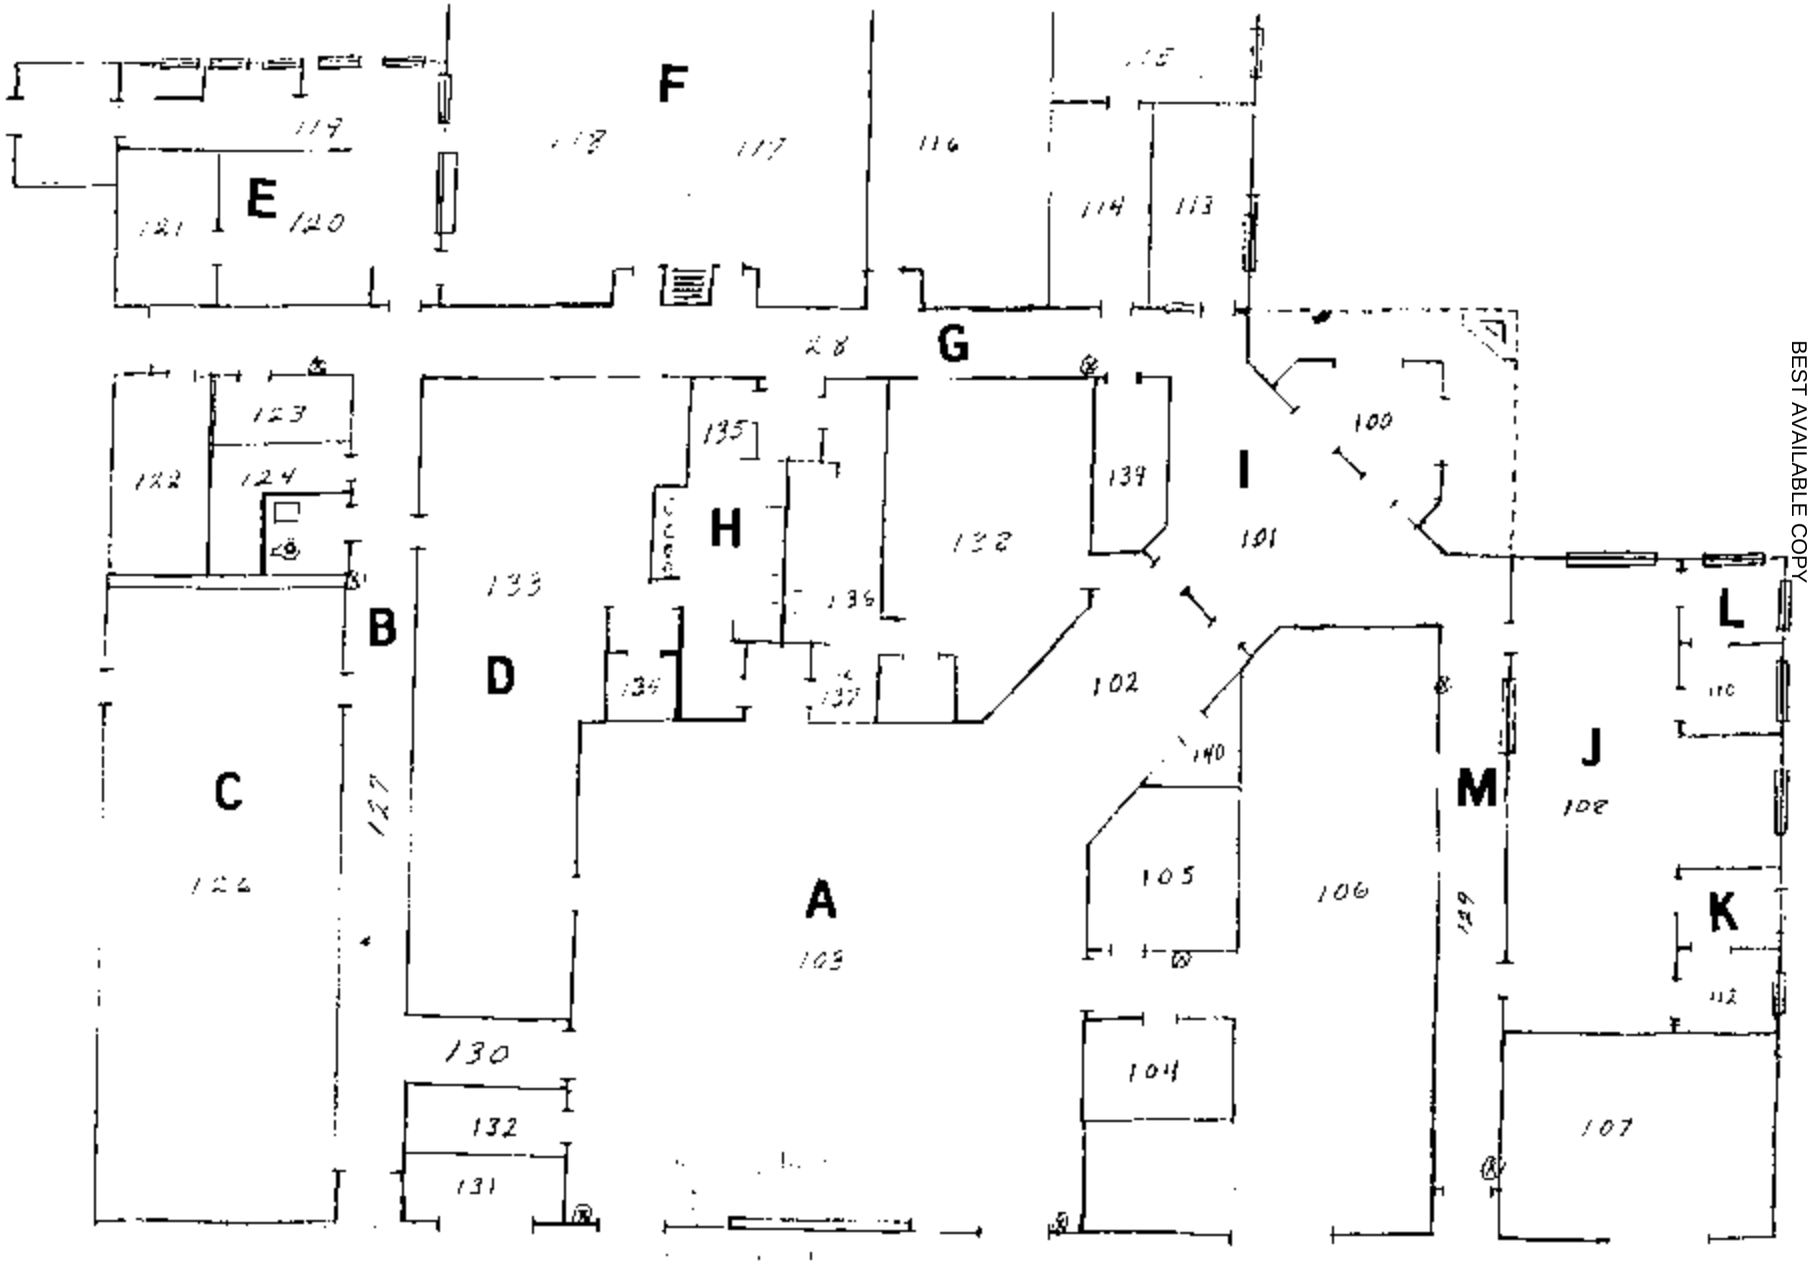

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Survey

National Guard Facility
Cheltenham Armory
9900 Surratts Road
Cheltenham, MD 20623

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Cheltenham Armory** **9900 Surratts Road** **Cheltenham, MD 20623**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**October 7, 2010**
Report Date:	**November 8, 2010**
ALSI Project #:	**1010666**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

3544 North Progress Avenue ✦ Suite 100 ✦ Harrisburg, PA 17110
TEL: 717-540-3424 ✦ FAX: 717-540-3428

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1726 of 5269

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Suspect Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Limitations 13

Appendix A. Laboratory Analysis Report 14

Appendix B. Photographs 15

Appendix C. Floor Plan 16

Appendix D. References 17

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1727 of 5269

BEST AVAILABLE COPY

Section 1.0
Executive Summary

BEST AVAILABLE COPY

Section 1.0 Executive Summary

On October 7, 2010, Analytical Laboratory Services, Inc. (ALSI) personnel Ms. [redacted] Non-Responsive and Mr. Non-Responsive performed an industrial hygiene survey at the Cheltenham Armory located at 9900 Surratts Road, Cheltenham, MD 20623

1. Surface levels of lead exceeded 200 ug/ft^2 in the Men's Locker Room. Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2. Peeling and damaged paint should be repaired and properly remediated.

2. Lighting within the facility was evaluated. Lighting levels met the minimum recommended guidelines in all areas but the Drill Hall. Lighting should be improved in this area.

3. Temperature levels were slightly lower than the recommended guideline in a few locations. Individual comfort due to temperature varies greatly within a population. Relative humidity, carbon dioxide (ventilation) and carbon monoxide levels were within recommended guidelines.

4. Active water leaks are present in a few areas. All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

5. Return vents were dirty with some areas of possible fungal growth. Do not permit dirt, debris, microbial growth, etc. to accumulate in any portion of the HVAC system including the supply and return vents. Supply and return vents should be properly cleaned.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1729 of 5269

BEST AVAILABLE COPY

Section 2.0
Operation Description & Observations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Cheltenham Armory serves primarily as an office setting and equipment storage facility. The facility consists of offices, a drill hall, and storage areas. There is no garage area.

The building was initially constructed in 1996. There are eight employees. The interior walls are primarily concrete block with finished drywall in some areas. The floors were composed of a poured concrete slab with floor tile and carpeting. The ceilings were generally composed of a roof deck with a suspended drop ceiling system in some areas.

There is a central heating, ventilating, and air conditioning system (HVAC) present. At the time of this survey it was in operation but facility staff stated that it was not working properly and inaccessible for inspection. Doors and windows were open. There are unit ventilators in the offices.

There is an old firing range in the building. It has been fully abated. It is now used for gym facility.

Overall housekeeping was good.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1731 of 5269

BEST AVAILABLE COPY

Section 3.0
Noise Survey

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels. Therefore, noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1733 of 5269

BEST AVAILABLE COPY

Section 4.0
Lead Testing

BEST AVAILABLE COPY

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. At one time the facility contained an indoor firing range. It is now a gym area.

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m³	Surface ug/ft²
1	Dill Hall	7.1	
2	Room 108	<6.8	
3	Blank	<3 (ug)	
4	Drill Hall Floor (Center)		<110
5	Drill Hall – Top of Soda Machine		<110
6	Drill Hall - Tabletop		<110
7	Room 106 - Supply Room Floor		<110
8	Room 108 - UV Grill		<110
9	Room 111 Top of Filing Cabinet		<110
10	Room 113 - Widow Sill		<110
11	Hallway Floor Outside Room 117		<110
12	Room 120 Kitchen – Top of Ceramic Wall		<110
13	Gym, Converted Firing Range – Floor		<110
14	Gym, Converted Firing Range – Exhaust Vent Fin		<110
15	Gym, Converted Firing Range - Exercise Seat		<110
16	Floor Outside Gym, Converted Firing Range		<110
17	Room 133 Men's Locker Room – Floor		**400**
18	Blank		<12 (ug)
Criteria		**50**	**200**

Key: **Bolded** results exceed listed criteria

Source: Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1735 of 5269

Surface levels of lead exceeded 200 ug/ft^2 in the Men's Locker Room. Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2. Peeling and damaged paint should be repaired and properly remediated.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for Environmental Chemicals," the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1736 of 5269

BEST AVAILABLE COPY

Section 5.0
Lighting

BEST AVAILABLE COPY

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Room 108	122.2	30-50	Yes
Room 111	93.3	30-50	Yes
Room 113	74.0	30-50	Yes
Room 117/118	133.5	30-50	Yes
Room 120 Kitchen	111.4	50	Yes
Room 133 Men's Locker Room	63.2	7	Yes
Room 129 Gym. Converted Firing Range	75.1	30	Yes
Drill Hall	17.9	30-50	No
Room 105	75.5	30-50	Yes

Lighting levels met the minimum recommended guidelines in all but the Drill Hall. Lighting should be improved in this area.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1738 of 5269

BEST AVAILABLE COPY

Section 6.0
Indoor Air Quality

BEST AVAILABLE COPY

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The IAQ Meter was last calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 70.1 to 73.3 degrees F with relative humidity readings ranging from 46.6% to 52.3%. During the survey, carbon dioxide (CO_2) levels ranged from 356 ppm to 750 ppm within the facility compared to an outdoor CO_2 level of 326 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,026 ppm (326 ppm + 700 ppm). The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	64.5	55.3	328	0.0
Room 108	**71.2**	52.1	513	0.0
Room 111	72.8	51.0	750	0.1
Room 113	73.3	50.8	481	0.0
Room 117/118	73.0	49.3	396	0.0
Room 120 Kitchen	72.5	49.4	374	0.0
Room 133 Men's Locker Room	72.8	52.3	368	0.0
Room 129 Gym, Converted Firing Range	72.7	46.9	413	0.1
Drill Hall	**70.1**	46.6	356	0.0
Room 105	**71.1**	50.7	728	0.0
Outdoors	65.1	49.7	324	0.1
Criteria	**73.0-79.0**	**30-60**	**<1,026**	**<9.0**

Key: **Bolded** results were outside listed criteria

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1740 of 5269

Temperature levels were slightly lower than the recommended guideline in a few locations. Individual comfort due to temperature varies greatly within a population. Relative humidity, carbon dioxide (ventilation) and carbon monoxide levels were within recommended guidelines.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

1. Room 132 – Efflorescence on the block wall. This is an indication of water infiltration.

2. Kitchen:
    - Return vents were dirty
    - Small area of chipping and peeling paint.

3. Room 117/118:
    - Missing and water stained ceiling tile.
    - Water leak present under the unit ventilator.

4. Room 105 – Current roof leak. Suspected fungal growth on ceiling tile where roof leak was present.

5. Hallway – Floor tile are loose and popping up.

BEST AVAILABLE COPY

Section 7.0
Suspect Asbestos Contain Building Materials

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 7.0 Suspect Asbestos Containing Building Materials

No suspect asbestos containing materials (ACM) were identified. Hidden or inaccessible areas were not inspected. No samples were collected.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1743 of 5269

BEST AVAILABLE COPY

Section 8.0
Maintenance Bay

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is no garage or maintenance area at this facility.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1745 of 5269

BEST AVAILABLE COPY

Section 9.0
Limitations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1747 of 5269

BEST AVAILABLE COPY

Appendix A
Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY

LAB #100470

NY ELAP
10920

Client:	National Guard Bureau	Job Name:	Cheltenham Armory	Chain Of Custody:	508983
Address:	301-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	Cheltenham, MD	Date Submitted:	10/12/2010
	Havre de Grace, Maryland 21078	Job Number:	Not Provided	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	10/19/2010
Attention:	[redacted]			Report Date:	10/19/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1104377	1010666-1	Flame	Air	428	N/A	7	ug/m³	3.1	7.1	ug/m³	
1104378	1010666-2	Flame	Air	442	N/A	6.8	ug/m³	<3	<6.8	ug/m³	
1104379	1010666-3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1104380	1010666-4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104381	1010666-5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104382	1010666-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104383	1010666-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104384	1010666-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104385	1010666-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104386	1010666-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104387	1010666-11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104388	1010666-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104389	1010666-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104390	1010666-14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104391	1010666-15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104392	1010666-16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1104393	1010666-17	Flame	Wipe	****	0.108	110	ug/ft²	43	400	ug/ft²	
1104394	1010666-18	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY

LAB #100479

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	Cheltenham Armory	**Chain Of Custody:**	508983
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Cheltenham, MD	**Date Submitted:**	10/12/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	10/19/2010 **Report Date:** 10/19/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: Nida McCarvey **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100479), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-8961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1751 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100476) NVLAP (#101143-0) NY ELAP (11920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) **508983**

p. 1/2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Cheltenham Armory
2. Job Location: Cheltenham, MD
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person [redacted] Phone #: (410) 942-0273
5. Submitted by: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____ ☐ 24 Hours Time Due: ____ Comments: ____	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day Date Due: 10/19/10 ☐ Results Required By Noon (Every Attempt Will Be Made To Accomodate)	☒ Include [redacted] s with Report ☒ Email [redacted] @analyticallab.com ☐ Fax: [redacted] l@us.army.mil ☐ Verb [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify: ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify: ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM ___ (Qual) PLM ___ (Quan) PLM/TEM ___ (Qual) PLM/TEM ___ (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State TLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☒ Pb Dust Wipe (wipe type: Ghost) 15 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	NVLAP	AIR	BULK	DUST	WATER AND OTHER	SOIL TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
101010-1	Drill Hall	10/7	488					X		X							Date/Time: Contact: By:
101010-2	Rm 108		442					X		X							
101010-3	Blank		0					X		X							
101010-4	Drill Hall - F1			100cm²				X				X					
101010-5	Drill Hall - Seat							X				X					Date/Time: Contact: By:
101010-6	Drill Hall - Tabletop							X				X					
101010-7	Rm 106 - F1							X				X					
101010-8	Rm 108 - UV Grill							X				X					
101010-9	Rm 111 - Bldg Cabinet							X				X					Date/Time: Contact: By:
101010-10	Rm 113 - Window Sill							X				X					
101010-11	Hallway F1 Outside Rm 117							X				X					
101010-12	Rm 120 - Top of Crown Wall							X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 10 / 12 / 10 @ 1130 Via: UPS By (Print): Nicole Maxwell Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

DM (410) 947-2024 #59202 210 REV. 6.09

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 508983 p. 2/2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0264

Submittal Information:
1. Job Name: Cheltenham Armory
2. Job Location:
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Pers[redacted] @ phone # (410) 942-0273
5. Submitted by: Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☐ 5 Day + Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Inclu[redacted]s with Report ☒ Email[redacted] @ ☐ Fax: [redacted]l@us.army.mil ☐ Verba[redacted]e@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate (QTY)
☐ EPA Point Count (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D3755-95 (QTY)
☐ Quan. (s/area) Dust D6480-99 (QTY)
TEM Water
☐ Qual. (pres/abs) (QTY)
☐ ELAP 198.2/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
☐ Pb Paint Chip (QTY)
☐ Pb Dust Wipe (wipe type:) (QTY)
☐ Pb Air (QTY)
☐ Pb Soil/Solid (QTY)
☐ Pb TCLP (QTY)
☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Pb Furnace (Media) (QTY)
Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media:
☐ Spore-Trap (QTY) ☐ Surface Vacuum Dust (QTY)
☐ Surface Swab (QTY) ☐ Culturable ID Genus (Media) (QTY)
☐ Surface Tape (QTY) ☐ Culturable ID Species (Media) (QTY)
☐ Other (Specify:) (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1010dddo-13	Gym-CFR-F1	10/7		100cm²				X				X				
1010dddo-14	Gym CFR Exhaust Vent	↓		↓				X				X				
1010dddo-15	Gym CFR Exercise Equip	↓		↓				X				X				
1010dddo-16	F1 Outside Gym CFR	↓		↓				X				X				
1010dddo-17	Rm 133-F1	↓		↓				X				X				
1010dddo-18	Blank	↓		0cm²				X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

* CFR = Converted Firing Range

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1752 of 5269

BEST AVAILABLE COPY

Appendix B
Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Exterior

Drill Hall

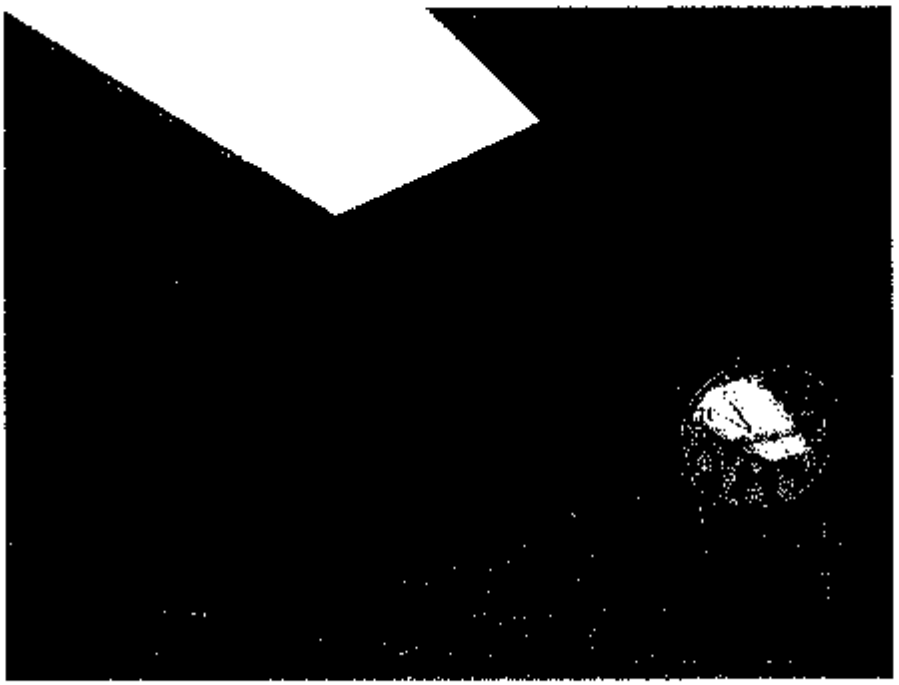

Room 105 current roof leak.

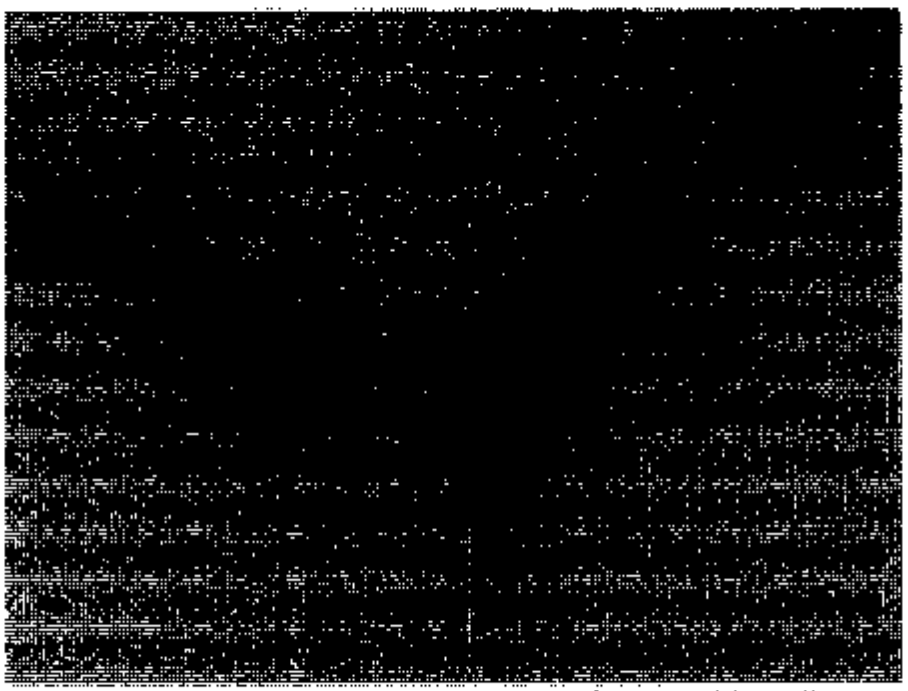

Room 105 possible fungal growth on ceiling tile.

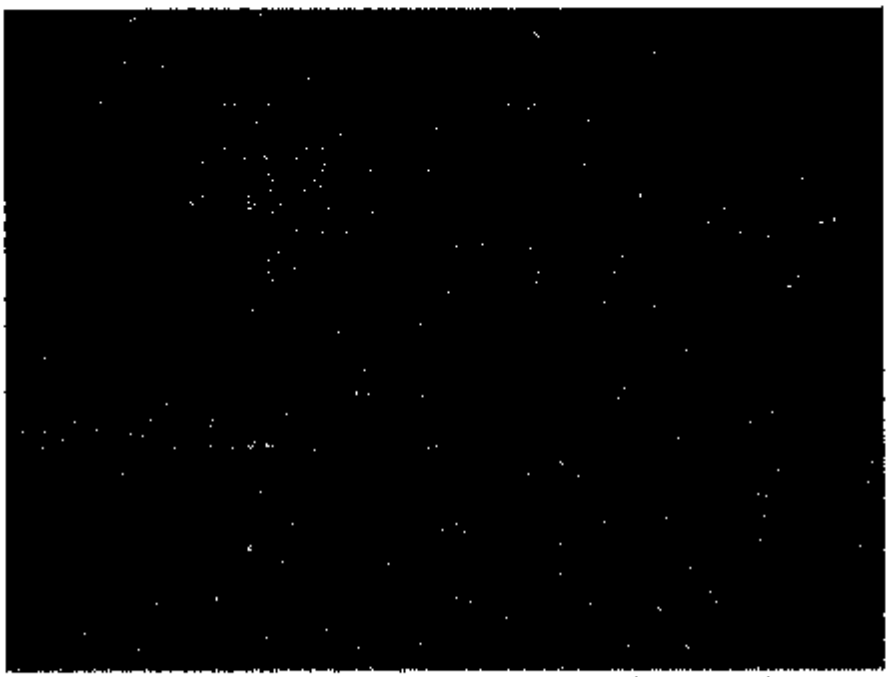

Effloresces on block wall in drill hall, from moisture.

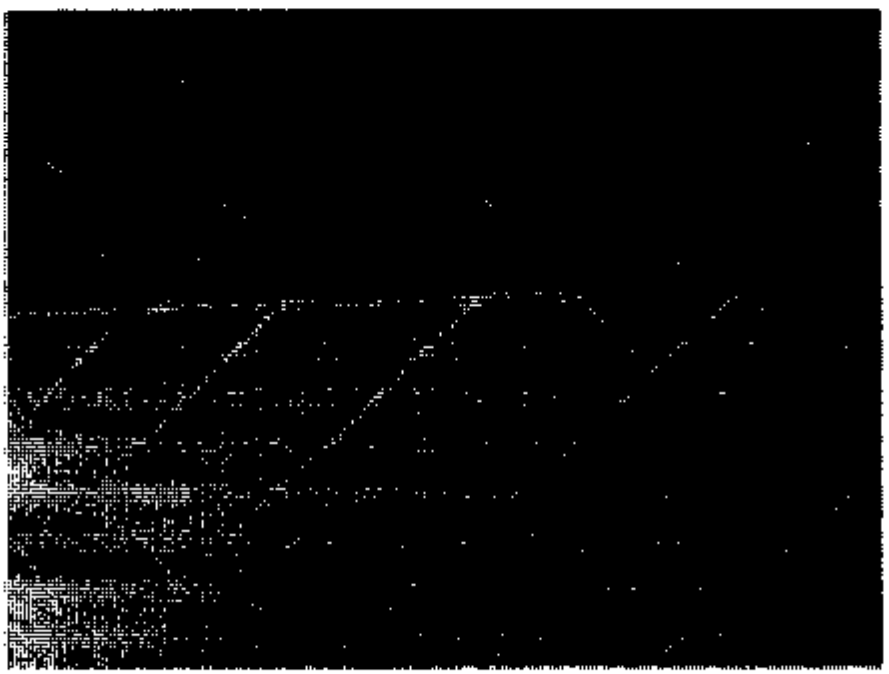

Loose floor tile in hallway from moisture.

Converted firing range.

Kitchen ceiling, peeling paint from moisture.

Room 17 and 18, moisture under floor tile a large area of floor tiles are loose with water underneath them. The source of moisture is believed to be the unit ventilator.

Boiler Room.

BEST AVAILABLE COPY

Appendix C
Floor Plan

BEST AVAILABLE COPY

BEST AVAILABLE COPY

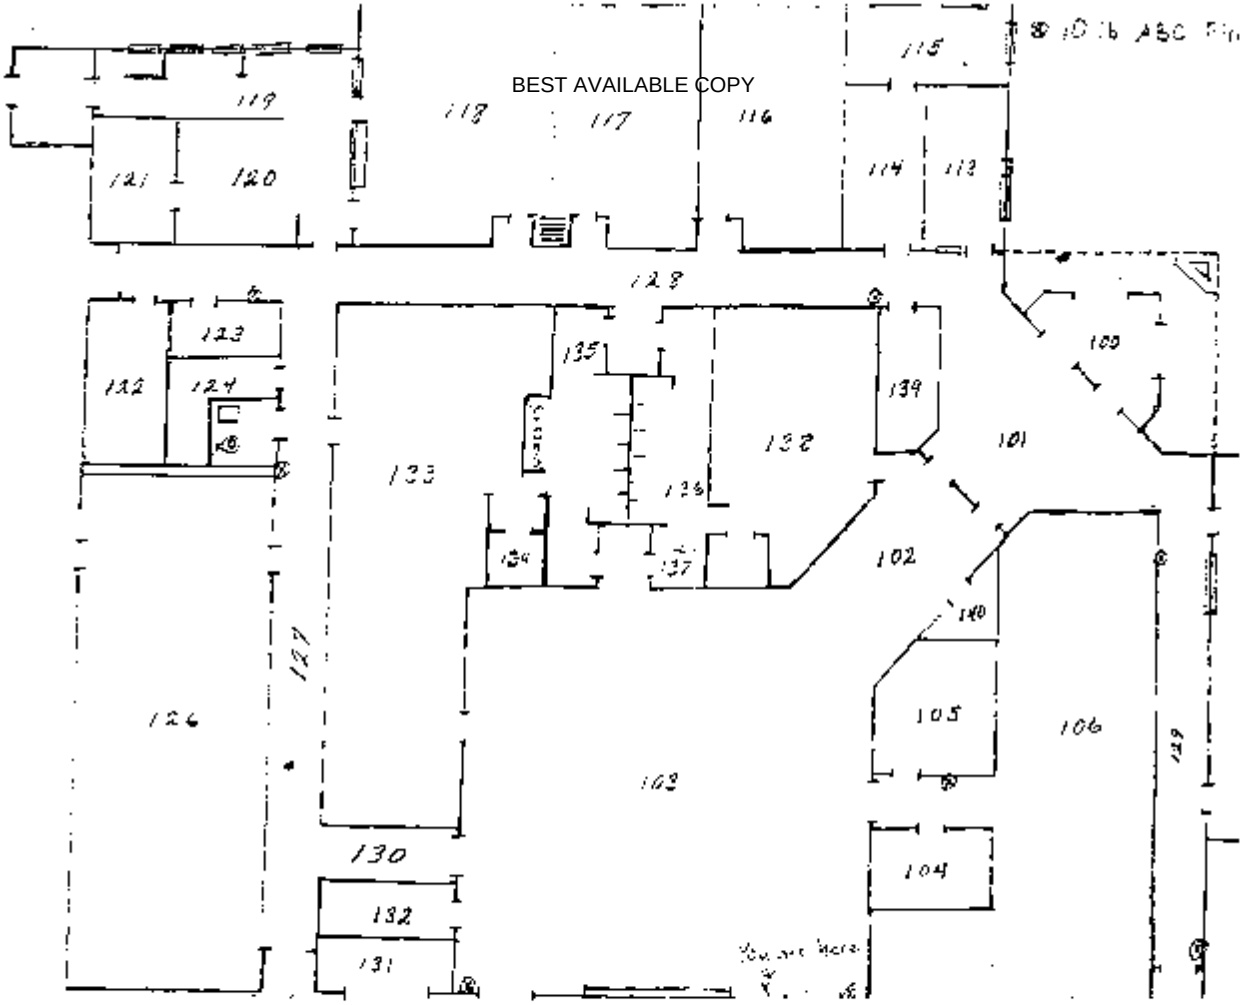

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix D
References

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration. Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Thermal Environmental Conditions for Human Occupancy, 55-2004

6. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

8. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1762 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Cheltenham Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Cheltenham Readiness Center** **9900 Surratts Road** **Cheltenham, MD 20623**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**October 2, 2013**
Report Date:	**November 20, 2013**

Non-Responsive

[redacted]

Manager, Industrial Hygiene Services

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1764 of 5269

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on October 2, 2013, at the Cheltenham Readiness Center located at 9900 Surratts Road, Cheltenham, MD 20623. The survey was performed by Mr. Non-Responsive [redacted].

1. Lead was found in the sample collected from the top of the amnesty box in the Drill Hall. See Section 3.0 for detailed sampling results.

2. Lighting levels met the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in areas sampled.

    b. The relative humidity levels met the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60%.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 parts per million (ppm).

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2013 recommended guidelines for mechanically ventilated office buildings and commercial settings.

    See Section 5.0 for detailed sampling results.

4. Water stained ceiling tiles were observed at a few locations.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1765 of 5269

Section 2.0 Operation Description & Observations

The Cheltenham Readiness Center is mainly an administrative facility with a drill hall, offices, and classrooms. There were 3 full-time employees stationed at this facility at the time of this survey.

The building is reported to have been built in 1987. It is a single story structure. The exterior is brick. The interior walls are block, brick, and drywall. The floors are concrete, 12”x12” floor tiles, and carpet.

The heating system is an oil-fired hot water unit. The facility has wall mounted unit ventilators for air-conditioning.

There is no child-care facility in the building.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

This facility contains a converted firing range currently being used as a weight room and simulated firing range.

No suspect asbestos containing material (ACM) was observed at the time of this survey.

No chipped and peeling paint were observed at the time of the survey.

Housekeeping is adequate.

A few water stained ceiling tiles were observed but no current roof leaks were reported.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1766 of 5269

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 micrometer (um) mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	**Location**	**Air ug/m^3**	**Surface ug/ft^2**
1	Drill Hall	<6.4	*
2	Converted Range/Weight Room	<6.4	*
3	Blank	<3	*
4	Drill Hall – Floor	*	<110
5	Drill Hall – Top of Amnesty Box	*	130
6	Drill Hall – Top of Computer	*	<110
7	Kitchen – Top of Food Mixer	*	<110
8	Kitchen – Top of Microwave	*	<110
9	Hallway Outside of Converted Range/Weight Room – Floor	*	<110
10	Converted Range/Weight Room - Floor	*	<110
11	Converted Range/Weight Room – Top of Exercise Equipment	*	<110
12	Dining Hall – Top of Table	*	<110
13	Room 116 Classroom – Top of TV	*	<110
14	Room 108 Office – Top of Desk	*	<110
15	Blank - Wipe	*	<12
-	**Criteria**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges
2. OSHA 29CFR1910.1025 Lead Standard

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1767 of 5269

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on window sills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Lead was found in the sample collected from the top of the amnesty box in the Drill Hall.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1768 of 5269

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98082EL). The light meter was last calibrated in March 2013. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Drill Hall	16.7	10	YES
Room 132 Office	38.0	30-50	YES
Converted Range/Weight Room	70.3	30	YES
Kitchen	65.8	50	YES
Dining Room	87.4	10	YES
Room 116 Classroom	46.2	30-50	YES
Room 114 Office	99.1	30-50	YES
Room 115 Office	70.4	30-50	YES
Room 113 Office	50.1	30-50	YES
Room 108 Office	57.3	30-50	YES
Room 110 Office	163.1	30-50	YES
Room 112 Office	113.8	30-50	YES

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting levels met the minimum recommended guideline in all of the areas tested.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #7575X1228014). The IAQ Meter was last calibrated in May 2013.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2013). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Room 110 Office	76.8	46.8	522	0.0
Room 114 Office	76.2	59.1	524	0.0
Outdoors	83.6	48.3	419	0.0
Criteria	**68-79**	**30-60**	**<1,119**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2013, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements met the recommended 68-79°F in all occupied areas.
- Relative humidity levels met the recommended guideline of 30 – 60 % in all areas sampled.
- Carbon dioxide levels were measured to evaluate building ventilation or the introduction of outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level. For this survey, carbon dioxide levels did not exceed the recommended ceiling of

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1770 of 5269

1,119 ppm (700 ppm + 419 ppm). This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observation were noted:

  1. Water-damaged ceiling tiles were observed in the facility. Areas above the water stain should be investigated for the source of water infiltration.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1771 of 5269

Section 6.0 Suspect Asbestos Containing Building Materials (ACM)

There was no suspect asbestos containing material (ACM) noted at the time of this survey.

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1772 of 5269

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228014	3/2013	NA
Cal Light 400 Light Meter	98082EL	3/2013	NA
SKC Air Sampling Pump	767926	10/2/13	2.6 LPM
SKC Air Sampling Pump	798129	10/2/13	2.6 LPM

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1773 of 5269

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1775 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG MD	**Chain Of Custody:**	516883
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cheltenham RC	**Date Submitted:**	10/7/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	10/25/2013 **Report Date:** 10/28/2013
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
14001612	1	Flame	Air	468	N/A	6.4	ug/m³	<3	<6.4	ug/m³	
14001613	2	Flame	Air	468	N/A	6.4	ug/m³	<3	<6.4	ug/m³	
14001614	3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
14001615	4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001616	5	Flame	Wipe	****	0.108	110	ug/ft²	14	130	ug/ft²	
14001617	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001618	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001619	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001620	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001621	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001622	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001623	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001624	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001625	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
14001626	15	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

An AIHA (#100470) and [illegible] Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG MD	**Chain Of Custody:**	516883
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cheltenham RC	**Date Submitted:**	10/7/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	10/25/2013 **Report Date:** 10/28/2013

Attention: Non-Responsive [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Non-responsive [redacted]

Analyst: [redacted]

Non-responsive [redacted]

Technical Manager: [redacted]

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and [redacted] Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516883

1/2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG. MD
2. Job Location: Cheltenham. RE
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Signature: Non-Responsive [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
☐ Immediate Date Due:
☐ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
☐ Immediate ☐ 3 Day
☐ Next Day ☒ 5 Day + Date Due: 10/14/13
☐ 2 Day
☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
☒ Include COC/Field Data Sheets with Report
☒ Email: Non-Responsive [redacted] @complianceplace.com
☐ Fax: [redacted] @us.army.mil
☐ Verbal [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate (QTY)
☐ EPA Point Count (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D5755-95 (QTY)
☐ Quan. (s/area)Dust D6480-99 (QTY)
TEM Water
☐ Qual. (pres/abs) (QTY)
☐ ELAP 198.2/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples °C)

Metals Analysis
☐ Pb Paint Chip (QTY)
☒ Pb Dust Wipe (wipe type Cloth) 12 (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid (QTY)
☐ Pb TCLP (QTY)
☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
☐ Spore-Trap (QTY) ☐ Surface Vacuum Dust (QTY)
☐ Surface Swab (QTY) ☐ Culturable ID Genus (Media) (QTY)
☐ Surface Tape (QTY) ☐ Culturable ID Species (Media) (QTY)
☐ Other (Specify) (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1	Drill Hall	10/2	468					X		X						
2	Converted Range		468					X		X						
3	BLANK		0					X		X						
4	Drill Hall - floor			100 cm²				X				X				
5	Drill Hall Ammo Box							X				X				
6	Drill Hall - computer							X				X				
7	Kitchen - food mixer							X				X				
8	Kitchen - microwave							X				X				
9	Hallway outside Range							X				X				
10	Range - floor							X				X				
11	Range - Exercise Equip							X				X				
12	Dining - Hall - Table							X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

1. Date/Time RCVD: 10 / 7 / 13 @ 880 Via: FedEx By (Print): MRM Sign:

LABORATORY STAFF ONLY: (CUSTODY)
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room May, 2018

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516883

2/2

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: ARNG - MD
2. Job Location: Reisterstown - RC
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person: [redacted] Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Signature: [redacted] Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: [redacted] Non-Responsive @Compliance-plus.com ☐ Fax: [redacted] @us.army.mil ☐ Verb [redacted] @us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☒ Pb Dust Wipe (wipe type Ghost) 12 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis

Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
13 Rm. 116	TV	10-23		100 cm²				X				X					Date/Time: Contact: By:
14 Rm 108	Desk	↓		↓				X				X					
15 Blank		↓		0				X				X					
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)

1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____
4. Comments: ____

Initials: ____

Posted to NGB FOIA Reading Room May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Appendix B. Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1780 of 5269

Exterior of facility

Drill Hall

Converted firing range/weight room

Appendix C. Floor Plan

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1783 of 5269

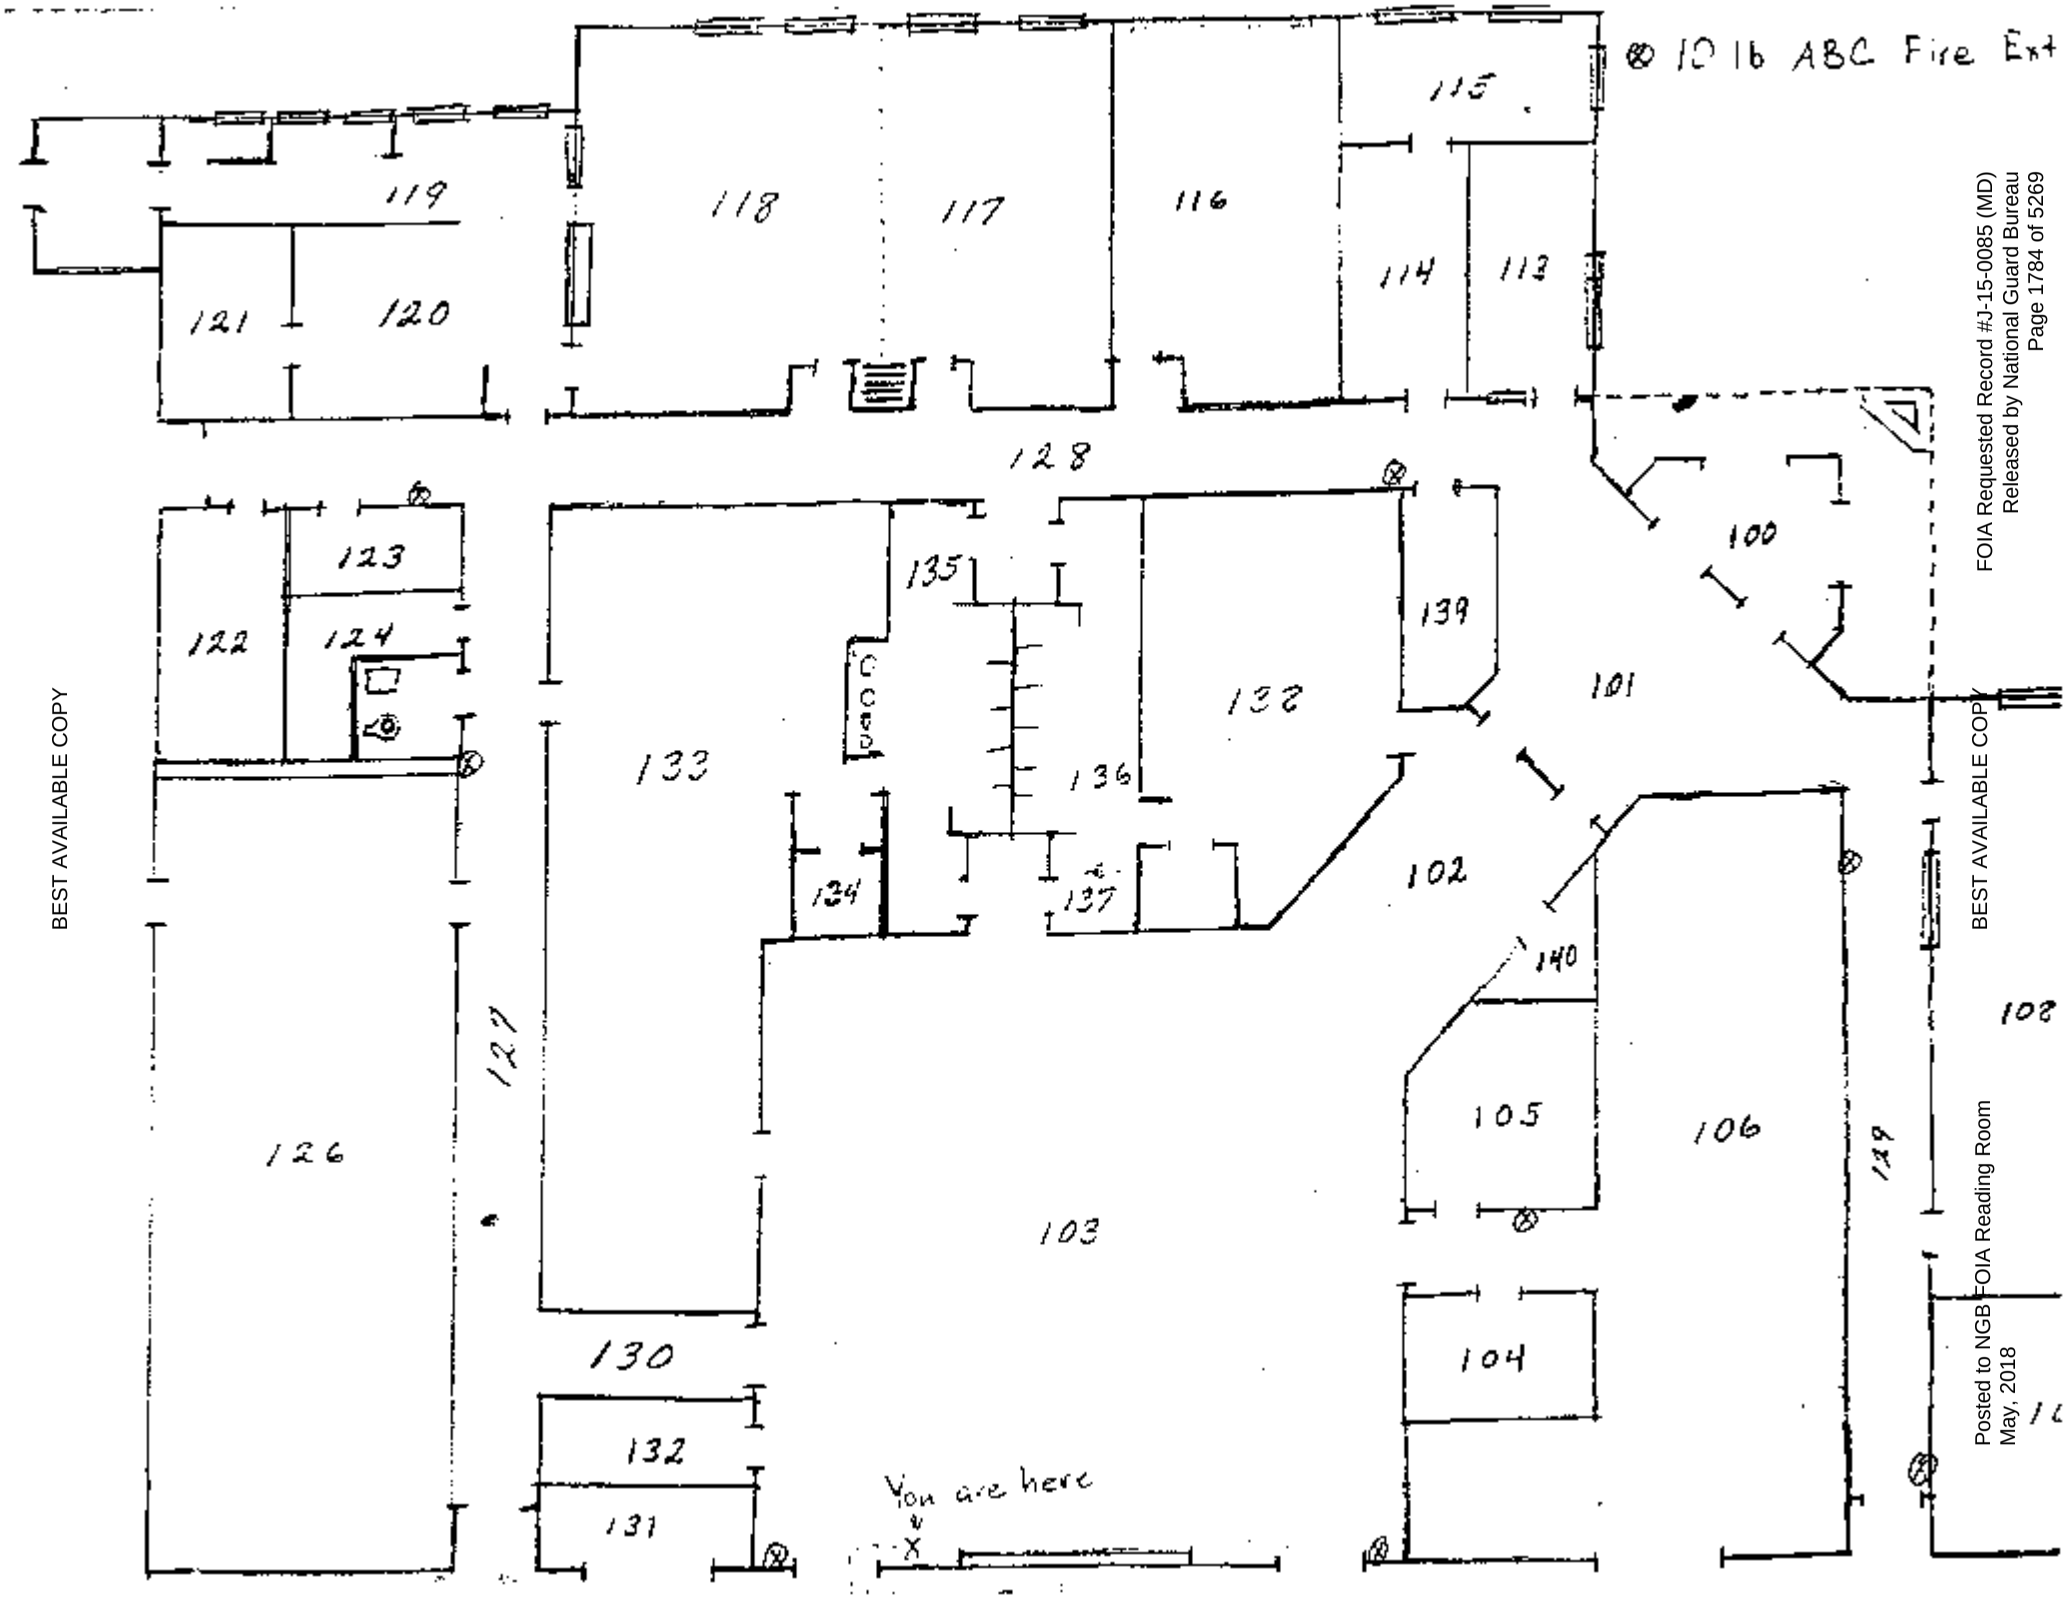

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1784 of 5269
Posted to NGB FOIA Reading Room
May, 2018

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2013 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 28th Edition.

4. American National Standards Institute (ANSI)/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2013.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227 (h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1786 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS May 2004

MEMORANDUM FOR Army National Guard Bureau (NGB) Region North Industrial Hygiene NGB-AVS-SI-[redacted], 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03 SGT. MG (MD) Maurice D. Tawes Armory, Crisfield, MD

1. Enclosed is a copy of subject report and one CD-ROM.

2. Please direct any additional comments or concerns to Ms. [redacted], at DSN 584-5475/3118, commercial (410) 436-5475/3118 or e-mail address at [redacted]t@apg.amedd.army.mil.

ENCL

[redacted]
Industrial Hygienist
Industrial Hygiene Field Services Program

Readiness thru Health
Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
MG (MD) MAURICE D TAWES ARMORY
CRISFIELD, MD
55-ML-01ED-03

Approved for public release; distribution unlimited.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1788 of 5269

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES INDUSTRIAL HYGIENE BASELINE SURVEYS, MG (MD) MAURICE D. TAWES ARMORY
CRISFIELD, MD
PROJECT NO. 55-ML-01ED-03

1. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

2. CONCLUSIONS.

a. Indoor Air Quality. The building meets the American Society of Heating, Refrigerating, and Air-Conditioning Engineers, Inc. (ASHRAE) recommended guidelines for air quality for relative humidity. To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room should not exceed 700 parts per million (ppm) more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm. The indoor temperature of 84.9 degrees Fahrenheit exceeded the recommended ASHRAE indoor air quality guidelines for an acceptable thermal environment.

b. Illumination. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting. The lighting met the Illumination Engineering Society of North America Guidelines.

c. Lead. All air sample results were below the laboratory analytical detection limits for lead in air and the Occupational Safety and Health Administration (OSHA) standard. All dust-lead wipe sample results were below both the USACHPPM recommended decontamination level for dust-lead on frequently contacted surfaces, as well as the EPA exposure standards for children.

d. Water Damage. The Armory has water damage from a leaking roof. The damage is located in the mechanical room where it has been cleaned up and the roof temporarily repaired. Two rooms located over the stage in the drill hall are closed off and can not be used until the leak in the roof is repaired.

e. Industrial Hygiene and Safety Programs. There are no HAZCOM or Respiratory Protection Programs for the full time state workers who oversee the armory.

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

3. RECOMMENDATIONS.

The Department of Defense Risk Assessment Codes (RAC) for Health Hazards enables one to prioritize remedial action for hazards. Risk Assessments Codes range in magnitude from1 to 5, with 1 being the highest priority.

a. Indoor Air Quality. The RACs for Indoor Air Quality (Thermal Environmental Conditions) is classified as 5. Install more air conditioning units or fans to cool the armory to between 73-79 degrees Fahrenheit in the summer. The temperature in the winter should be between 68-74.5 degrees Fahrenheit. To alleviate occupant discomfort and odor control ASHRAE guidelines recommend that the carbon dioxide concentration in the room should not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm. Check the ventilation system and ensure that the proper level of outdoor air is supplied.

b. The RAC for this armory for Lead Exposure is classified as 5. Clean all areas in and adjacent to the locker room (old IFR) where sampling results showed some lead residue. Apply a sealant to the area. Comprehensive guidelines are in Appendix F. This action should be accomplished before allowing children into the area. Test drinking water from water fountains and faucets for lead.

c. Water Damage. Fix the leaking roof.

d. Industrial Hygiene and Safety Programs. Provide HAZCOM and Respiratory Protection Programs for the full time state workers who oversee the armory.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1791 of 5269

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys MG (MD) Maurice D Tawes Armory, Crisfield, MD
Project No. 55-ML-01ED-03

TABLE OF CONTENTS

Paragraph Page

1. AUTHORITY 1
2. PURPOSE OF EVALUATION 1
3. BACKGROUND INFORMATION 1
4. SUMMARY OF ACTIONS 1
5. ASSESSMENT CRITERIA FOR LEAD 3
6. SAMPLING RESULTS 3
7. DISCUSSION AND CONCLUSIONS 6
8. RECOMMENDATIONS 7
9. ADDITIONAL ASSISTANCE 7

Enclosure

1. Lead Exposure 8
2. Indoor Air Quality - Thermal Comfort (Temperature) 8
3. Water Damage 9
4. Additional Recommendations 9

Appendices

A. - ASSESSMENT CRITERIA FOR LEAD A-1
B. - SITE MAPS B-1
C. - PHOTOGRAPHS C-1
D. - SAMPLING SHEETS AND LAB ANALYSES D-1
E. - REFERENCES E-1
F. - LEAD CLEANING GUIDANCE F-1
G. - MOLD GUIDANCE G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1792 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: MG (MD) Maurice D. Tawes Armory, Crisfield, MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. Engineering Support to the 229th Transportation Company.

b. Date of Construction. 1928. The armory was rehabilitated in 1979.

c. POC. Mr. Non-Responsive (410-968-0378).

d. Survey Date. 4 September 2003.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe and lead in air sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Carbon dioxide, temperature, and humidity measurements were collected to determine indoor air quality. Lighting conditions were measured. Sample results are in Appendix D.

b. Physical Condition of Facilities.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1793 of 5269

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: MG (MD) Maurice D. Tawes Armory, Crisfield, MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. Engineering Support to the 229th Transportation Company.

b. Date of Construction. 1928. The armory was rehabilitated in 1979.

c. POC. Mr Non-Responsive (410-968-0378).

d. Survey Date. 4 September 2003.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe and lead in air sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Carbon dioxide, temperature, and humidity measurements were collected to determine indoor air quality. Lighting conditions were measured. Sample results are in Appendix D.

b. Physical Condition of Facilities.

BEST AVAILABLE COPY

(1) Paint. The paint condition is intact. Sergeant Ruth McCuen, Environmental Compliance Assessment Coordinator for the MD NGB, stated that there are no records of lead-based paint abatement.

(2) Asbestos. Staff Sergeant McCuen stated that there are no records of an asbestos abatement. No asbestos was observed.

(3) Mold. No mold was observed.

(4) Safety Hazards. No safety hazards were observed.

c. Other Building Issues.

In general the building is in good repair and the paint is intact. The Armory does have some water damage from a leaking roof. The damage is located in the mechanical room where it has been cleaned up and the roof temporarily repaired. Two rooms located over the stage in the drill hall are closed off and can not be used until the leak in the roof is repaired.

d. Safety and Industrial Hygiene Programs. There are no written program records at the armory. There is no HAZCOM Program for the full time state workers who oversee the armory. They do have PPE but no PPE program.

e. Heating, Ventilation, and Air-conditioning System. The armory has a forced air heating system. The system was not operating during this survey. Ventilation is normally provided by window-mounted air conditioning units and the manual operation of windows when the building is not being heated.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. Lighting was measured in fourteen locations. All lighting measurements were taken during storm conditions so there was limited outdoor lighting. Some measurements were taken with the lights off, because the rooms are normally used with the lights off.

h. Converted indoor firing range (IFR). Staff Sergeant [redacted] Environmental Compliance Assessment Coordinator for the MD NGB, stated there are no records of lead having been abated from the indoor firing range during its conversion. The IFR was converted to a locker room and gym as a self-help project about 13 years ago.

i. Photographs (Appendix C).

j. Site Maps. (Appendix B).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1795 of 5269

BEST AVAILABLE COPY

k. Facility use by children. The POC stated that the armory is currently used only by the units family support groups which includes children (the unit is deployed overseas) but it has been used extensively by the community and has wide-ranging use by children.

5. ASSESSMENT CRITERIA FOR LEAD. (Appendix A).

6. SAMPLING RESULTS.

a. Lead. Lead in air, surface dust-lead wipe, and indoor air quality sample results are in Appendix D. All air sample results were below the laboratory analytical detection limits of 3.0 to 15.0 µ/m³ lead in air. This is well below the standard of 50 µg/m³ lead in air. All dust-lead wipe sample results were below the laboratory analytical detection limits of 0.3 µg/ft², below the standards of 40-200 µg/ft².

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1796 of 5269

MDARNG Facilities IH Baseline Surveys MG (MD) Maurice D Tawes Armory, Crisfield, MD
Project No. 55-ML-01ED-03

Table 1 Lead Dust Wipe and Air Sample Results

Sample Numbers	Type of Sample	Location	Floor	Photos	Results
CR W01	Wipe	Locker room (former firing range), floor by cage (trap area)	Basement	0993	31 µg/ft²
CR W02	Wipe	Locker Room, floor, middle of room	Basement	0994	13 µg/ft²
CR W03	Wipe	Locker Room, floor, gym area	Basement	0996	5.6 µg/ft²
CR W04	Wipe	Supply Office, shelves, wall	Basement	0997	4.1 µg/ft²
CR W05	Wipe	Kitchen, table top, near far wall	Basement	0998	9.2 µg/ft²
CR W06	Wipe	Mechanical Room, floor near back wall	Second	0999	10 µg/ft²
CR W07	Wipe	State's Office, desk top	Second	1000	4.6 µg/ft²
CR W08	Wipe	Commander's Office, windowsill, middle of front wall.	Second	1002	17 µg/ft²
CR W09	Wipe	Recruiter's Office, floor, near window wall	Second	1003	7.9 µg/ft²
CR W10	Wipe	Ops/Readiness Office, desk top	First	1004	3.8 µg/ft²
CR W11	Wipe	Personnel Office, table top near window wall	First	1005	3.3 µg/ft²
CR W12	Wipe	Personnel Office, floor, near Ops wall	First	1006	6.9 µg/ft²
CR W13	Wipe	Copy/break room, desk top	First	1007	17 µg/ft²
CR W14	Wipe	Drill Hall, floor, center court	First	1008	7.6 µg/ft²
CR W15	Wipe	Drill Hall, floor of stage	First	1009	4.3 µg/ft²
40903RR10	Air	State's Office	Second	1001	< 15 mg/m³
40903RR11	Air	Locker/Gym Room	Basement	0996	< 15 mg/m³

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1797 of 5269

b. Indoor Air Quality. The relative humidity was within normal ranges. The indoor temperature of 84.9 degrees Fahrenheit exceeded the recommended ASHRAE indoor air quality guidelines for an acceptable thermal environment. Install more air conditioning units or fans in occupied rooms to cool the armory to between 73-79 degrees Fahrenheit in the summer. The temperature in the winter should be between 68-74.5 degrees Fahrenheit.

The indoor carbon dioxide levels ranged from 410- 2353 ppm. (See Table 2). To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room should not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm.

Table 2. Indoor Air Quality

Class room	Basement	1060 parts per million (ppm) CO_2
Maintenance shop (lawn equipments)	Basement	2353 ppm
Pump Room	Basement	931 ppm
Locker Room and Gym	Basement	736 ppm
Supply Office	Basement	584 ppm
Library Room	Basement	410 ppm
Kitchen	Basement	394 ppm
Drill Floor	First	687 ppm
Copy and Break Room	First	432 ppm
Lounge	First	547 ppm
Personnel Office	First	547 ppm
Ops/Readiness Office	First	534 ppm
State’s Office	Second	708 ppm
Commander’s Office	Second	711 ppm
Mechanical Room	Second	508 ppm
Outdoor		350 ppm

c. Illumination. All lighting measurements were taken during storm conditions so there was limited outdoor lighting. Some measurements were taken with the lights off, because the rooms are normally used with the lights off. Even with the lights off, most measurements were within or near the ASHRAE Guidelines.

Table 3 Lighting Measurements

Location	Floor	Measurement	Guidelines
Locker/Gym Room	Basement	7.30 Foot Candles (FC)	10FC
Supply Office	Basement	46.5 FC	20-50 FC
Kitchen	Basement	35.0 FC	50 FC
Class Room	Basement	19.6 FC	50 FC
Mechanical Room	Second	20.0 FC	20-50 FC
State's Office	Second	86.3 FC	20-50 FC
Commander's Office	Second	86.3 FC	20-50 FC
Recruiter's Office	Second	16.4 FC (no over head lights)	20-50 FC
Ops/Readiness Office	First	37.7 FC	50 FC
Personnel Office	First	39.5 FC	20-50 FC
Copy/Break Room	First	29.0 FC	20 FC
Drill Floor	First	1.64 FC (no lights)	10 FC
Drill Floor Stage	First	1.28 FC (no lights)	10 FC
Lounge	First	25.5 FC	10-20 FC

7. DISCUSSION AND CONCLUSIONS.

a. Indoor Air Quality. The armory relative humidity of 68.5% was within the ASHRAE recommended guidelines for air quality. The indoor temperature of 84.9 degrees Fahrenheit exceeds the recommended ASHRAE guidelines. ASHRAE standards for an acceptable thermal environment are between 73-79 degrees Fahrenheit in the summer and between 68-74.5 degrees Fahrenheit in the winter. The indoor carbon dioxide levels ranged from 410- 2353 ppm. To alleviate occupant discomfort and odor control ASHRAE recommends that the carbon dioxide concentration in a room not exceed 700 ppm more than the outdoor carbon dioxide concentration.

b. Illumination. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting. The lighting met the Illumination Engineering Society of North America Guidelines.

c. Building Issues. The Armory has water damage from a leaking roof. The damage is located in the mechanical room where it has been cleaned up and the roof temporarily repaired. Two rooms located over the stage in the drill hall are closed off and can not be used until the leak in the roof is repaired.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1799 of 5269

BEST AVAILABLE COPY

d. Lead. All air sample results are below the laboratory analytical detection limit for lead in air of 3.0 to 15.0 μg/m³. This is below the Occupational Health and Safety Administration (OSHA) standard of 50 μg/m³. All dust-lead wipe sample results were below the USACHPPM recommended decontamination level of 200 μg/ft² for dust-lead on frequently contacted surfaces. These wipe samples did not exceed the EPA lead exposure levels for children. However, the sample taken in the locker room (former firing range) floor by the cage (trap area) in the basement showed a level of 31 μg/ft², close to the EPA exposure standard of 40 μg/ft² for children for dust-lead on floors. AR 420-70 states that the purpose of Army lead hazard management is to protect children from all sources of lead exposure. However, its provisions only control these exposures, and do not eliminate them. Although this facility complies with EPA and Army regulations, recleaning and sealing the locker room may further prevent exposures for children under six and for the general workforce.

8. RECOMMENDATIONS. Enclosure.

9. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by e-mai[redacted]@apg.amedd.army.mil.

[redacted]

INDUSTRIAL HYGIENIST
USACHPPM LEAD AND ASBESTOS TEAM LEADER
Industrial Hygiene Field Services Program
EPA AHERA Asbestos Inspector and Management Planner/
Certification Number MD-070340
EPA Lead Inspector and Lead Risk Assessor/
Certification Number 04-7913

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1800 of 5269

BEST AVAILABLE COPY

ENCLOSURE

CRISFIELD ARMORY RECOMMENDATIONS

The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority. The RAC for this armory for Lead Exposure is classified as 5. The RAC for Indoor Air Quality is 5.

1. Lead Exposure.

a. Clean all areas in and adjacent to the former firing range rooms where sampling results showed some lead residue. Apply a sealant to the area. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. This action should be accomplished before allowing children into the area. RAC 5.

b. Test drinking water from water fountains and faucets for lead. It could not be determined if this has been done.

2. Indoor Air Quality. Thermal Comfort (Temperature).

a. Install more air conditioning units or fans to cool the armory to between 73-79 degrees Fahrenheit in the summer. The temperature in the winter should be between 68-74.5 degrees Fahrenheit. The indoor temperature of 84.9 degrees Fahrenheit exceeds the ASHRAE recommended guidelines for an acceptable thermal environment.

b. Check the ventilation system and ensure that the proper level of outdoor air is supplied. The indoor carbon dioxide levels ranged from 410- 2353 ppm. To alleviate occupant discomfort and to dilute odors and other pollutants ASHRAE recommends that the carbon dioxide concentration in the room should not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm. RAC 5.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1801 of 5269

BEST AVAILABLE COPY

3. Water Damage.

Repair the leaking roof. The Armory has water damage from a leaking roof. The damage is located in the mechanical room where it has been cleaned up and the roof temporarily repaired. Two rooms located over the stage in the drill hall are closed off and can not be used until the leak in the roof is repaired. RAC 5.

4. Additional Recommendations. Provide HAZCOM and Respiratory Protection Programs for the full time state workers who oversee the armory.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1802 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

Subject: Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 $\mu g/ft^2$. This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e)(8)(viii))are not directly applicable because they are developed for floors (40 $\mu g/ft^2$), windowsills (250 $\mu g/ft^2$) and window troughs (400 $\mu g/ft^2$) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

BEST AVAILABLE COPY

APPENDIX B

SITE MAPS

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

BEST AVAILABLE COPY

Photo Location	Room Number	Photo Number
Locker room (former firing range), floor by cage (trap area)	Basement	0993
Locker Room, floor, middle of room	Basement	0994
Locker Room, floor, gym area	Basement	0996
Supply Office, shelves, wall	Basement	0997
Kitchen, table top, near far wall	Basement	0998
Mechanical Room, floor near back wall	Second	0999
State's Office, desk top	Second	1000
Commander's Office, windowsill, middle of front wall.	Second	1002
Recruiter's Office, floor, near window wall	Second	1003
Ops/Readiness Office, desk top	First	1004
Personnel Office, table top near window wall	First	1005
Personnel Office, floor, near Ops wall	First	1006
Copy/break room, desk top	First	1007
Drill Hall, floor, center court	First	1008
Drill Hall, floor of stage	First	1009
State's Office	Second	1001
Locker/Gym Room	Basement	0996

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1808 of 5269

DCP_0992.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_0993.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_0994.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1811 of 5269

DCP_0995.JPG Unknown

BEST AVAILABLE COPY

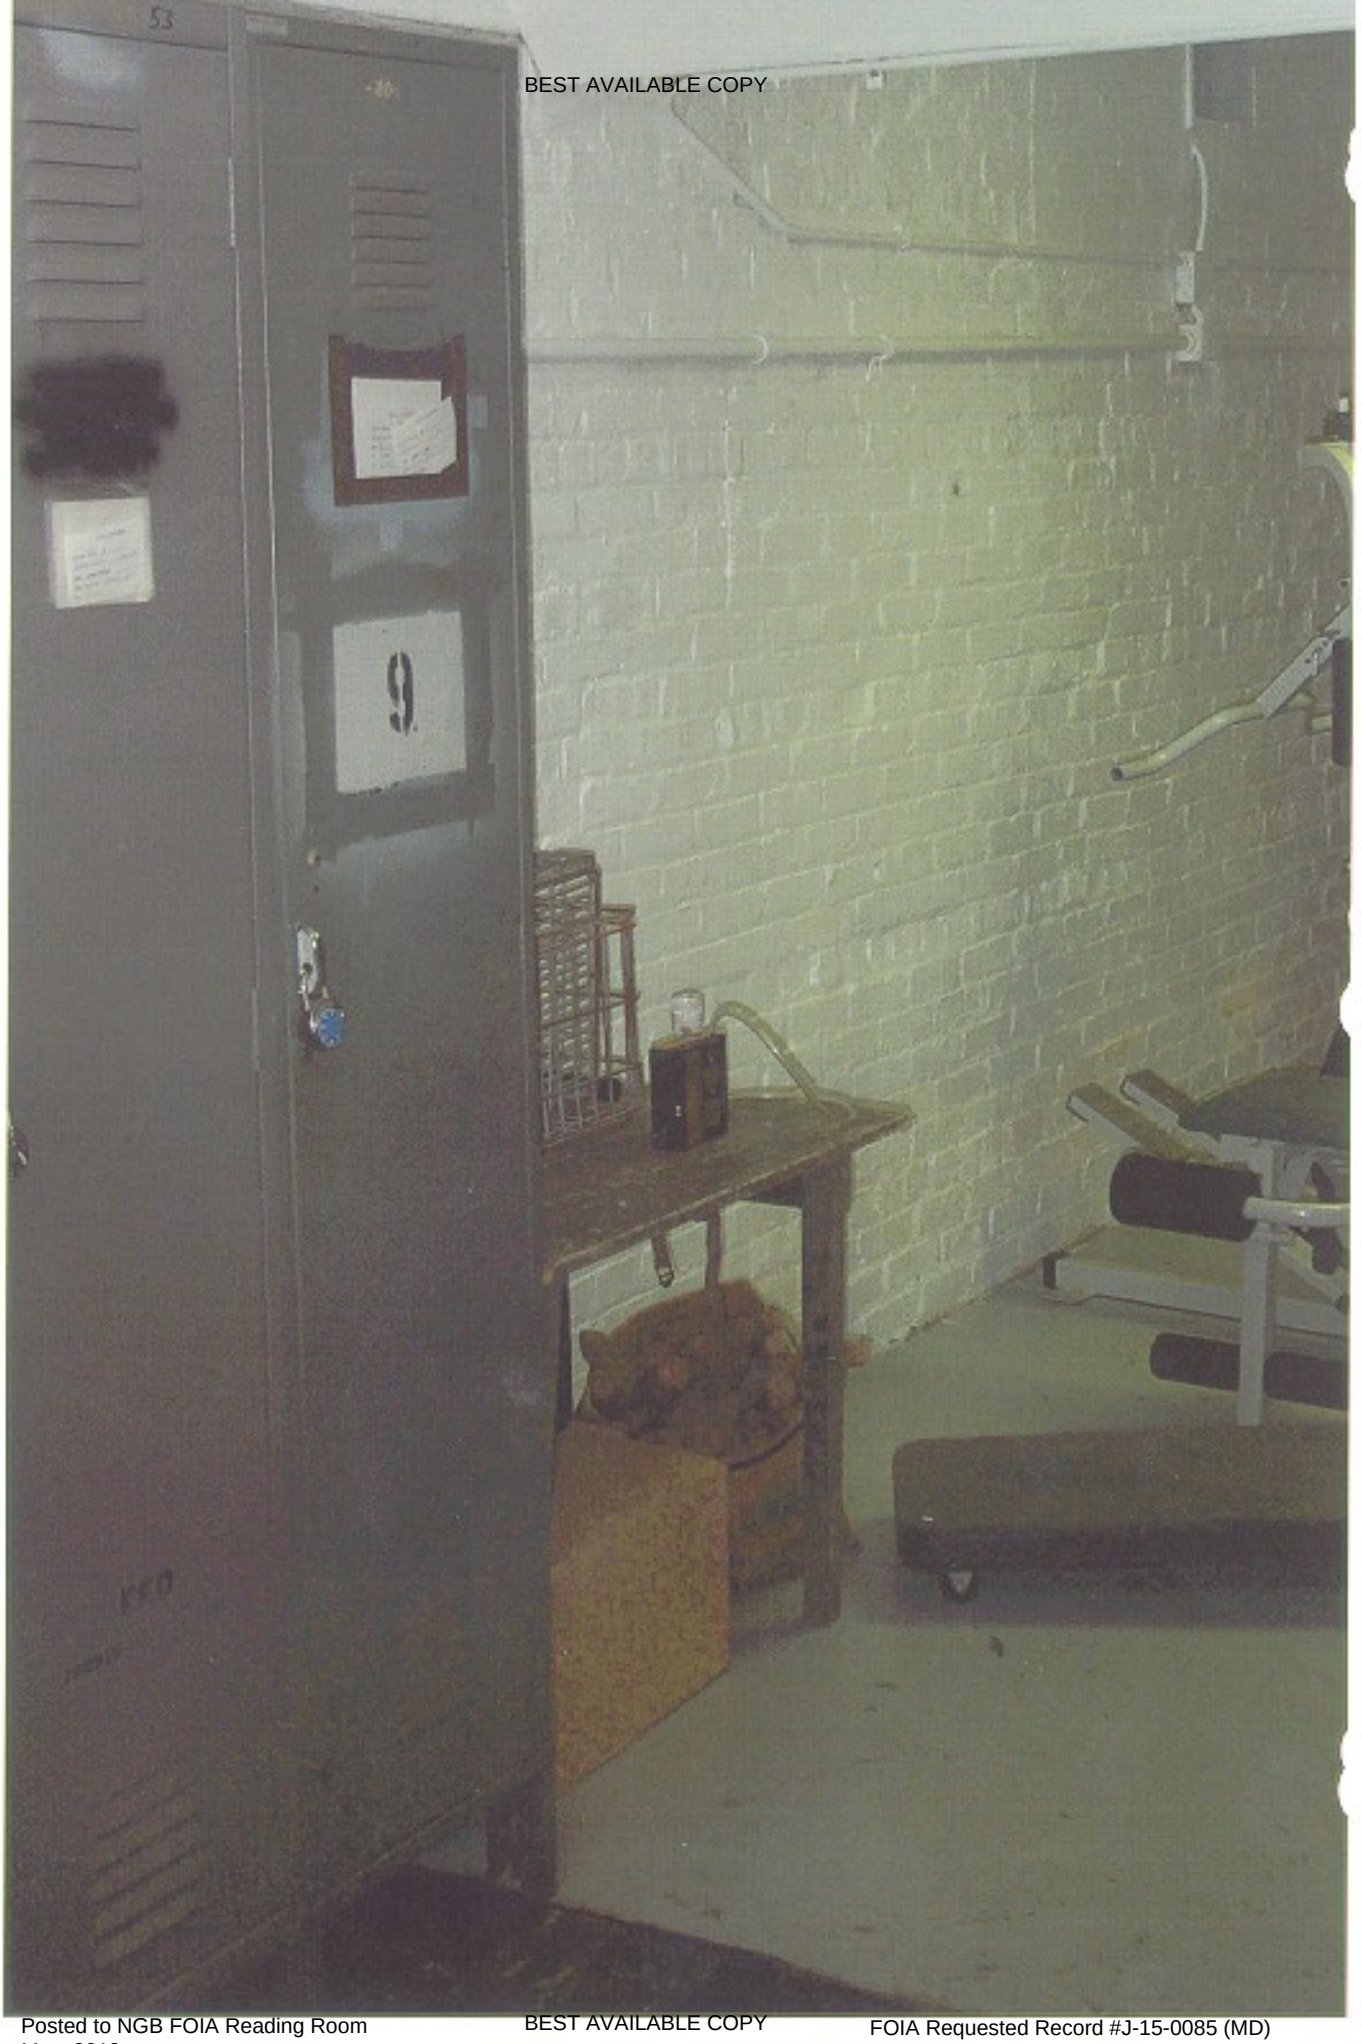

BEST AVAILABLE COPY

BEST AVAILABLE COPY

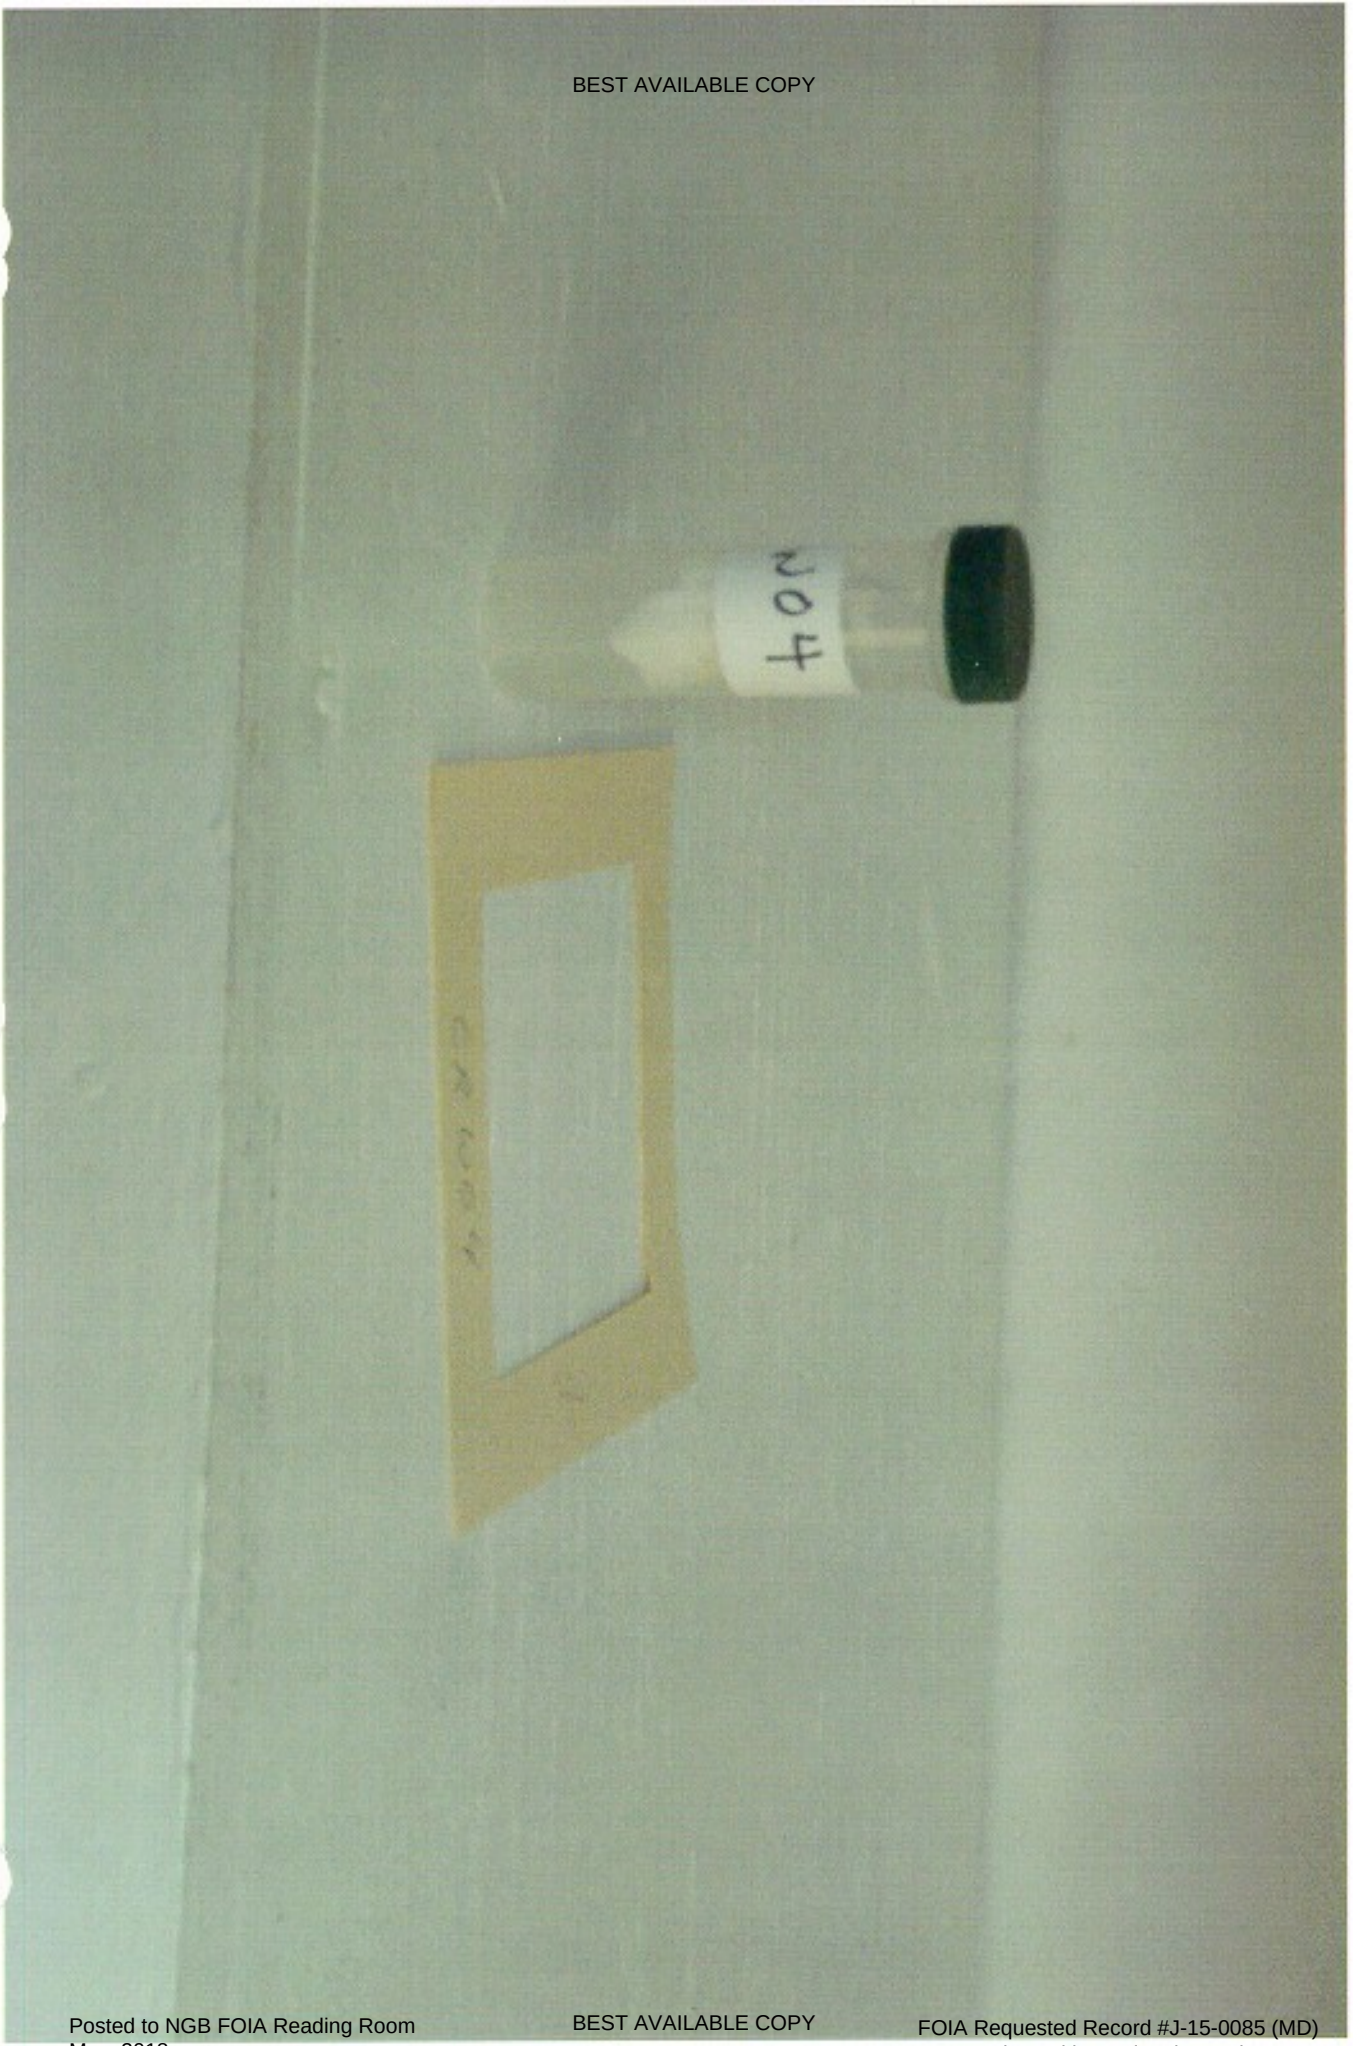

Posted to NGB FOIA Reading Room
May, 2018
DCP_0997.JPG Unknown
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018

DCP_0998.JPG Unknown

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

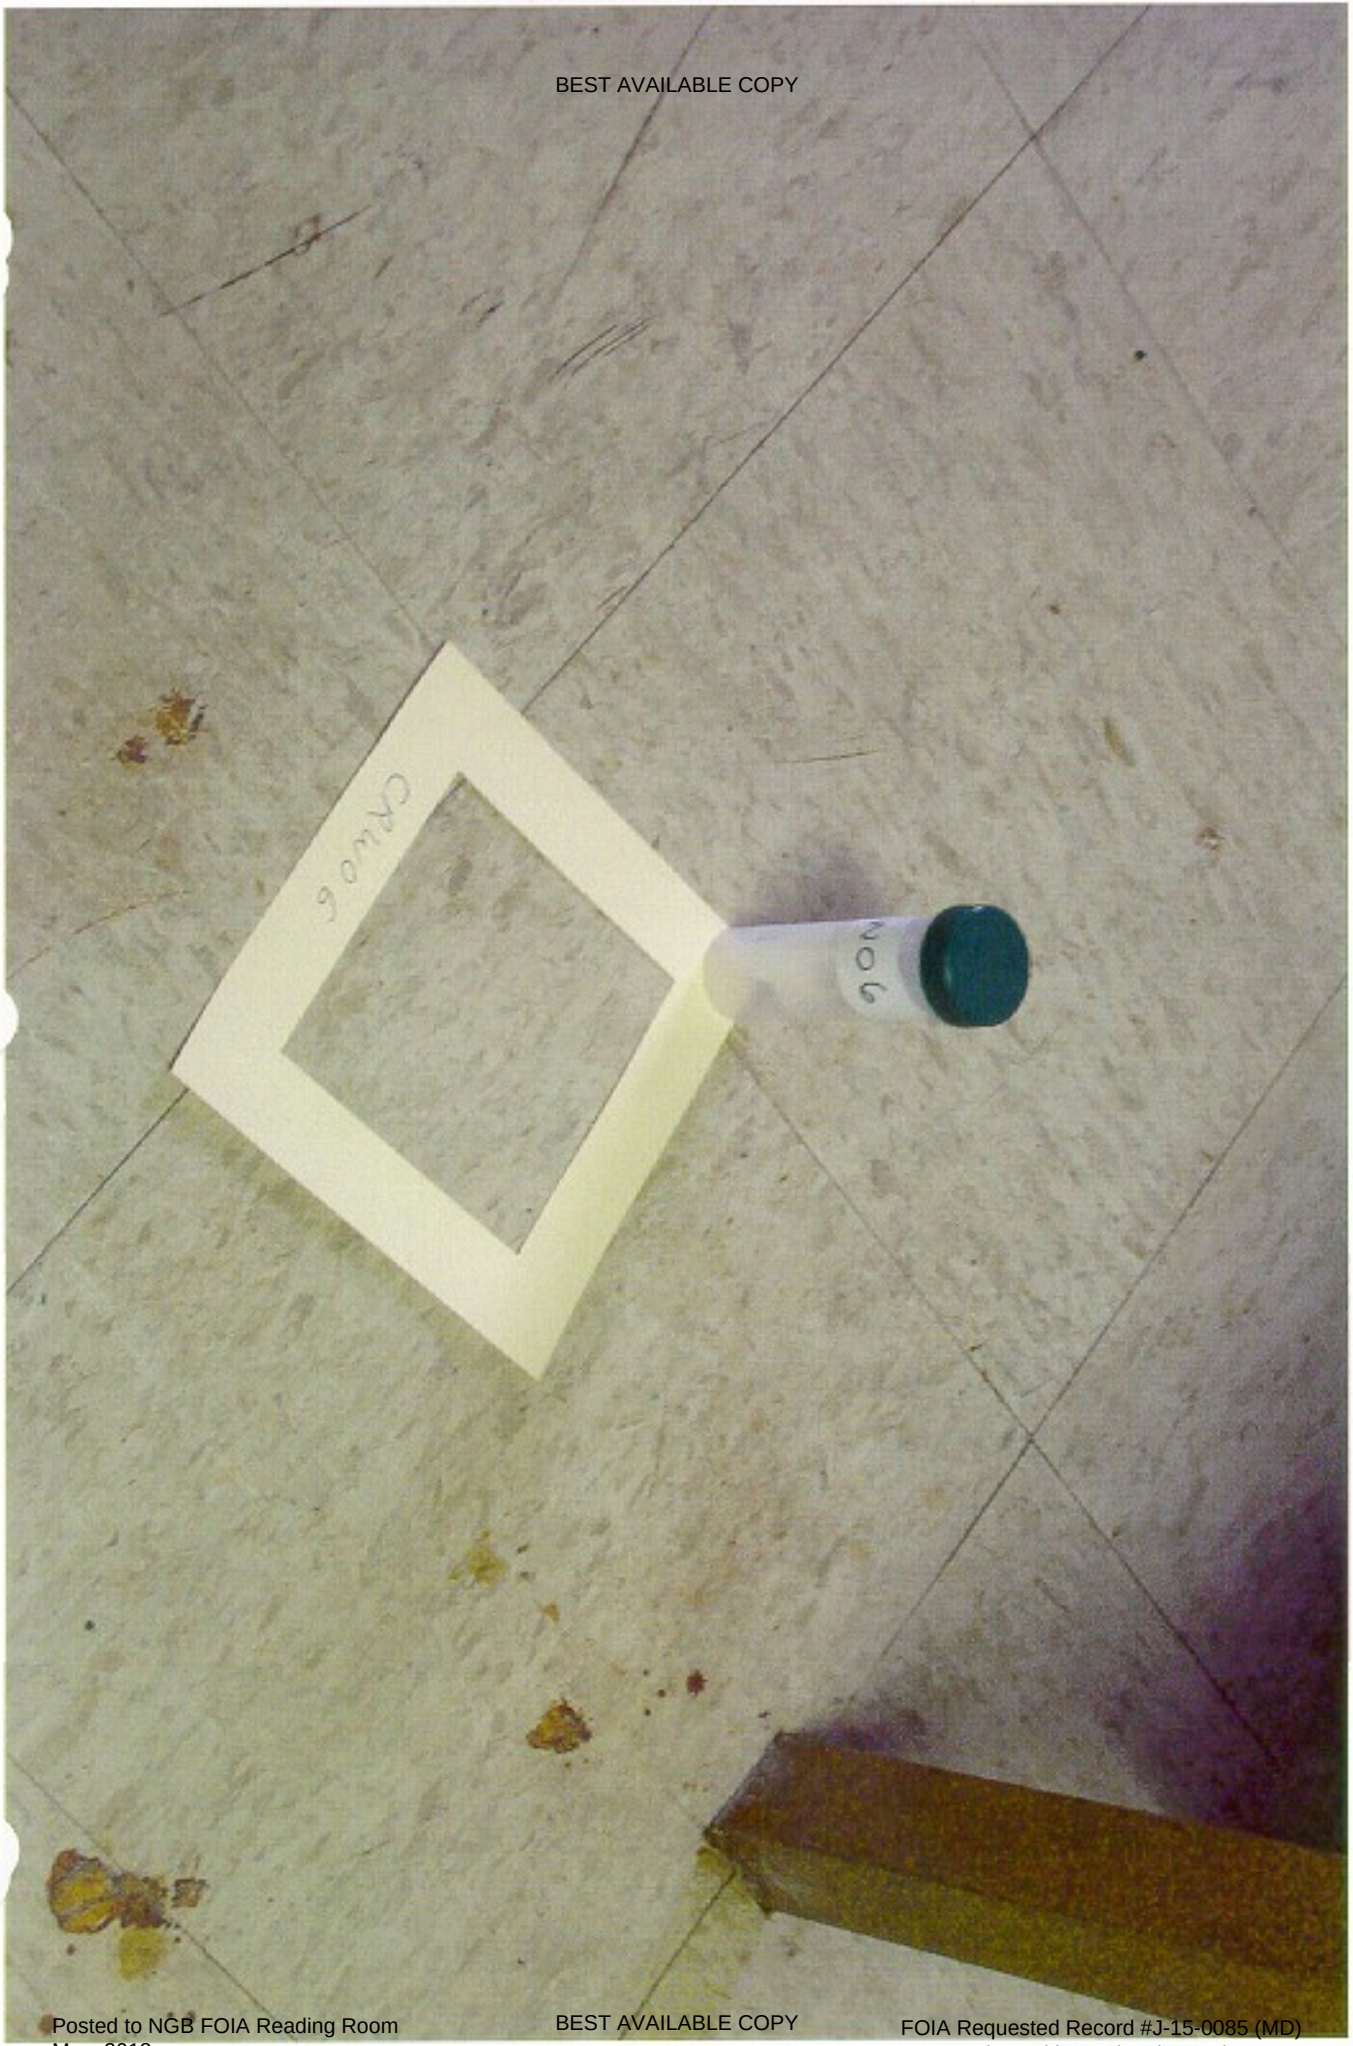

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_0999.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1000.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1001.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1002.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1819 of 5269

DCP_1003.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1820 of 5269

DCP_1004.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1005.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
DCP_1006.JPG Unknown
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

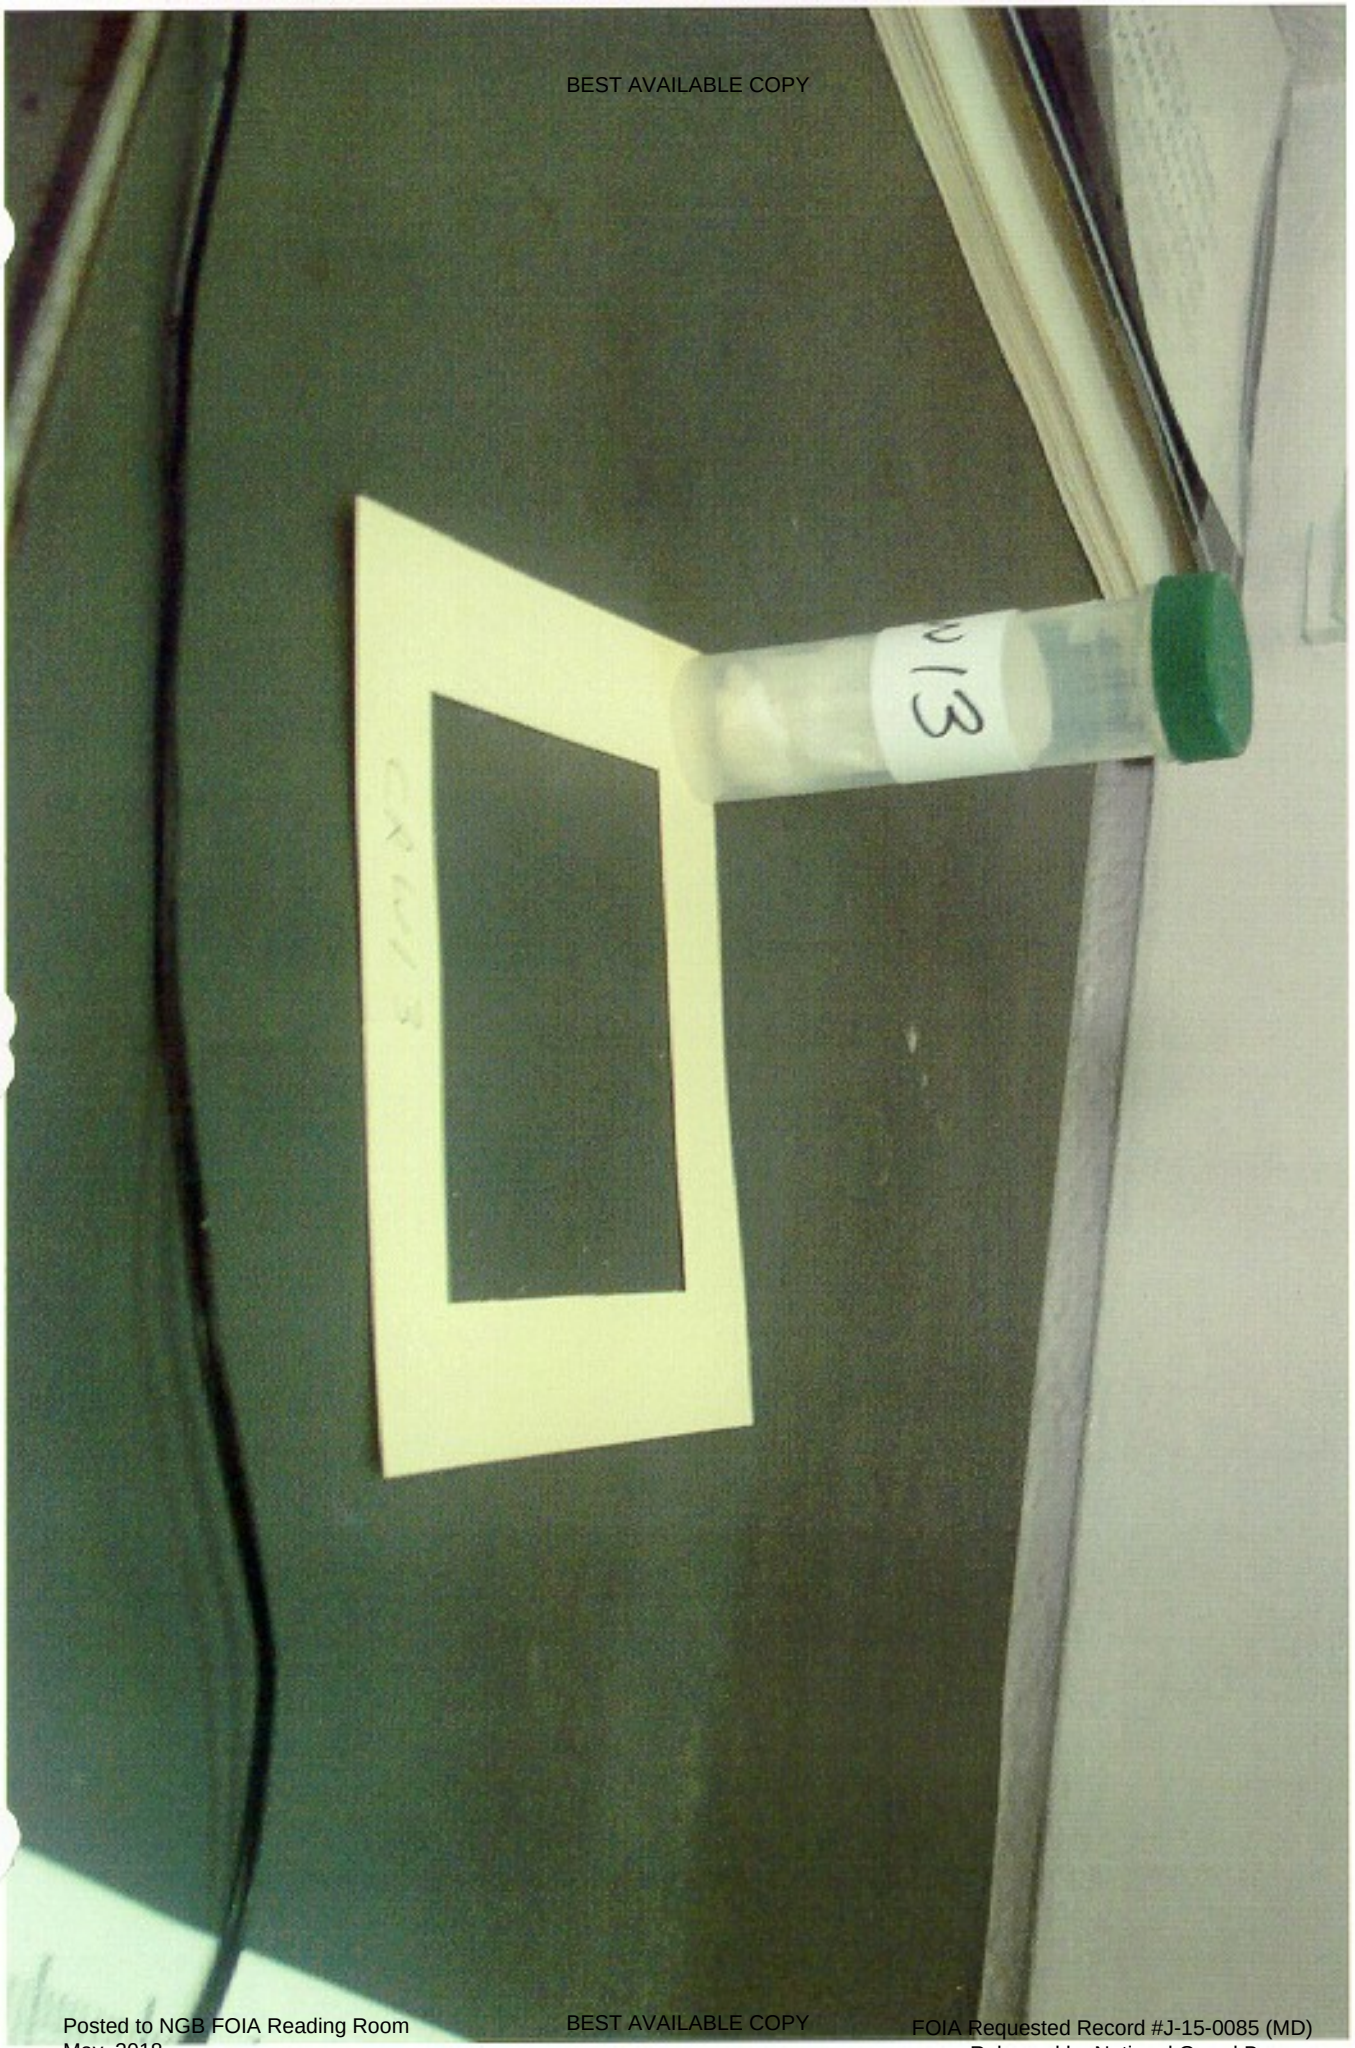

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

DCP_1007.JPG Unknown

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

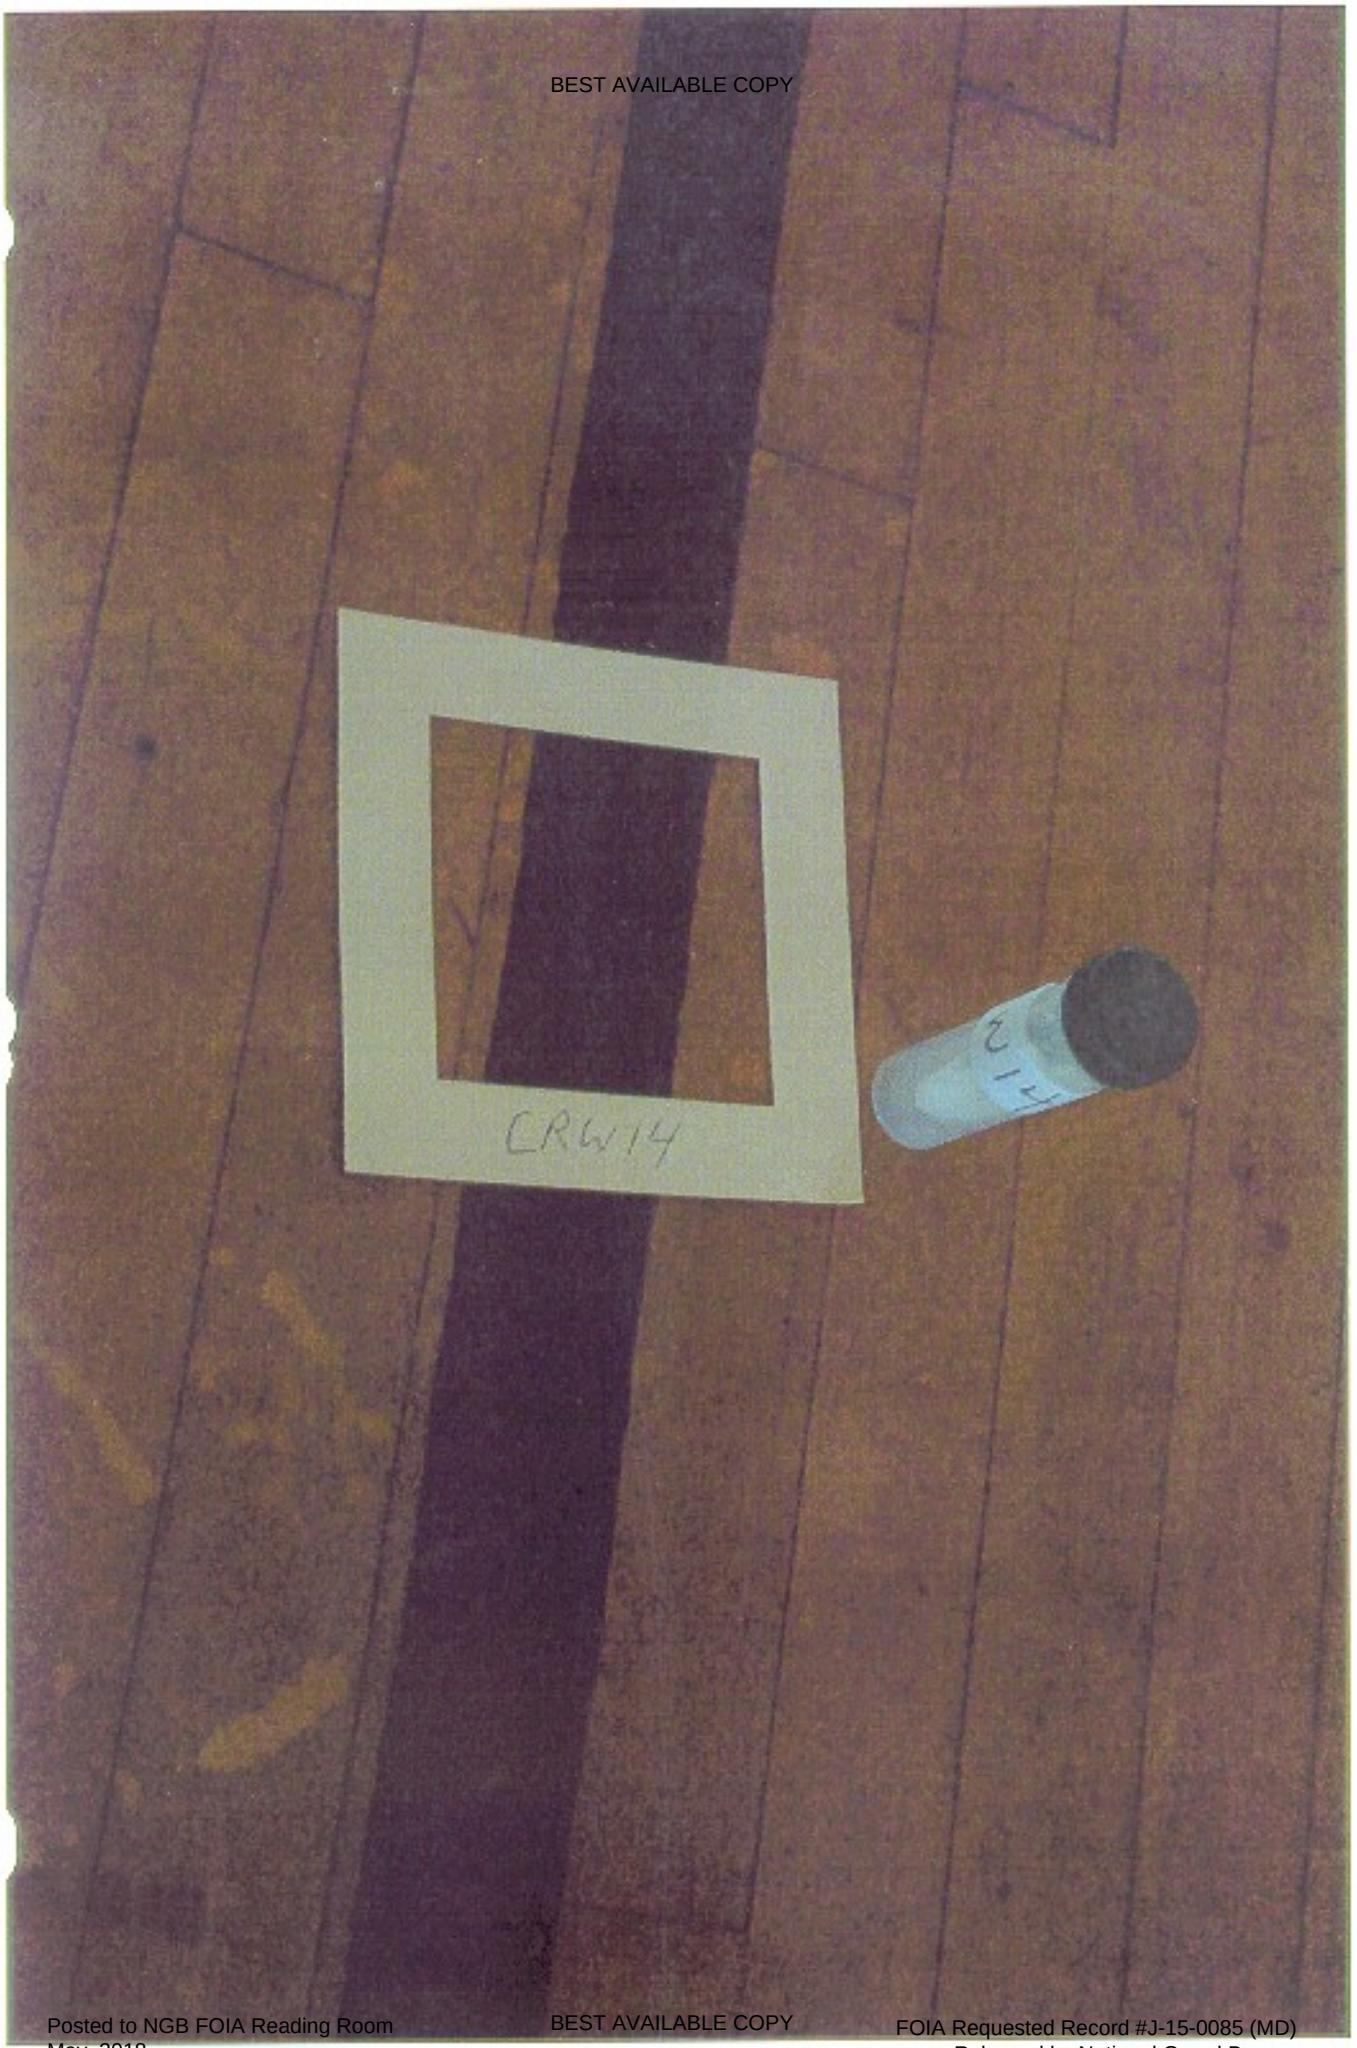

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1008.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1009.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1010.JPG Unknown

BEST AVAILABLE COPY

APPENDIX D

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Wipe Sample #	Armory	City	Indoor Range Info: Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
CR W01	Crisfield	Crisfield		Yes		No	Locker room (former firing range), floor by cage (trap area)	31 µg/ft²
CR W02	Crisfield	Crisfield					Locker Room, floor, middle of room	13 µg/ft²
CR W03	Crisfield	Crisfield					Locker Room, floor, gym area	5.6 µg/ft²
CR W04	Crisfield	Crisfield					Supply Office, shelves, wall	4.1 µg/ft²
CR W05	Crisfield	Crisfield					Kitchen, table top, near far wall	9.2 µg/ft²
CR W06	Crisfield	Crisfield					Mechanical Room, floor near back wall	10 µg/ft²
CR W07	Crisfield	Crisfield					State's Office, desk top	4.6 µg/ft²
CR W08	Crisfield	Crisfield					Commander's Office, windowsill, middle of front wall.	17 µg/ft²
CR W09	Crisfield	Crisfield					Recruiter's Office, floor, near window wall	7.9 µg/ft²
CR W10	Crisfield	Crisfield					Ops/Readiness Office, desk top	3.8 µg/ft²
CR W11	Crisfield	Crisfield					Personnel Office, table top near window wall	3.3 µg/ft²
CR W12	Crisfield	Crisfield					Personnel Office, floor, near Ops wall	6.9 µg/ft²
CR W13	Crisfield	Crisfield					Copy/break room, desk top	17 µg/ft²
CR W14	Crisfield	Crisfield					Drill Hall, floor, center court	7.6 µg/ft²
CR W15	Crisfield	Crisfield					Drill Hall, floor of stage	4.3 µg/ft²

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	Salisbury/Crisfield	**Chain Of Custody:**	117739
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road	**Job Location:**	Not Provided	**Date Analyzed:**	09/17/2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	17-Sep-03

Attention: [redacted] Non-Resp

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0367996	40903RR07	Flame	Air	260	N/A	11.54	ug/m³	<	12	ug/m³	
0367997	40903RR08	Flame	Air	254	N/A	11.81	ug/m³	<	12	ug/m³	
0367998	40903RR09 B1	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0367999	40903RA10	Flame	Air	202	N/A	14.85	ug/m³	<	15	ug/m³	
0368000	40903RR11	Flame	Air	196	N/A	15.31	ug/m³	<	15	ug/m³	
0368001	40903RR12BL	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Non-responsive

Analy [redacted] **Technical Manager:** Non-responsive [redacted]

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	MD Arng/Crisfield	**Chain Of Custody:**	117744
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road	**Job Location:**	Not Provided	**Date Analyzed:**	9/18/2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	[redacted] Non-Resp
		P.O. Number:	Not Provided	**Report Date:**	18-Sep-03
Attention:	Non-Responsive				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0368082	CR Blank 1	Furnace	Wipe Blank	****	N/A	0.30	ug	<	0.3	ug	
0368083	CR W01	Furnace	Wipe	****	0.108	6.97	ug/ft²		31	ug/ft²	
0368084	CR W02	Furnace	Wipe	****	0.108	2.79	ug/ft²		13	ug/ft²	
0368085	CR W03	Furnace	Wipe	****	0.108	2.79	ug/ft²		5.6	ug/ft²	
0368086	CR W04	Furnace	Wipe	****	0.108	2.79	ug/ft²		4.1	ug/ft²	
0368087	CR W05	Furnace	Wipe	****	0.108	2.79	ug/ft²		9.2	ug/ft²	
0368088	CR Blank 2	Furnace	Wipe Blank	****	N/A	0.30	ug	<	0.3	ug	
0368089	CR W06	Furnace	Wipe	****	0.108	2.79	ug/ft²		10	ug/ft²	
0368090	CR W07	Furnace	Wipe	****	0.108	2.79	ug/ft²		4.6	ug/ft²	
0368091	CR W08	Furnace	Wipe	****	0.108	2.79	ug/ft²		17	ug/ft²	
0368092	CR W09	Furnace	Wipe	****	0.108	2.79	ug/ft²		7.9	ug/ft²	
0368093	CR W10	Furnace	Wipe	****	0.108	2.79	ug/ft²		3.8	ug/ft²	
0368094	CR Blank 3	Furnace	Wipe Blank	****	N/A	0.30	ug	<	0.3	ug	
0368095	CR W11	Furnace	Wipe	****	0.108	2.79	ug/ft²		3.3	ug/ft²	
0368096	CR W12	Furnace	Wipe	****	0.108	2.79	ug/ft²		6.9	ug/ft²	
0368097	CR W13	Furnace	Wipe	****	0.108	2.79	ug/ft²		17	ug/ft²	
0368098	CR W14	Furnace	Wipe	****	0.108	2.79	ug/ft²		7.6	ug/ft²	
0368099	CR W15	Furnace	Wipe	****	0.108	2.79	ug/ft²		4.3	ug/ft²	
0368100	CR Blank 4	Furnace	Wipe Blank	****	N/A	0.30	ug	<	0.3	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	MD Arng/Crisfield	**Chain Of Custody:**	117744
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road	**Job Location:**	Not Provided	**Date Analyzed:**	9/18/2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	18-Sep-03
Attention:	[redacted] Non-Resp				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analys Non-responsive [redacted] Technical Manager: Non-responsive [redacted]

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX E

REFERENCES

BEST AVAILABLE COPY

APPENDIX E

REGULATIONS AND STANDARDS

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current ed. http://www.osha.gov/comp-links.html.

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf.

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990. http://www.usapa.army.mil/pdffiles/r40_5.pdf.

4. AR 385-10, The Army Safety Program, 29 February 2000. http://www.usapa.army.mil/pdffiles/r385_10.pdf.

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p40_503.pdf.

6. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), American Conference of Governmental Industrial Hygienists (ACGIH), current ed.

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. RP-1-1993, Office Lighting, ANSI/ESNA.

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1835 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1836 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1837 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1838 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1839 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1840 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1841 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1842 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

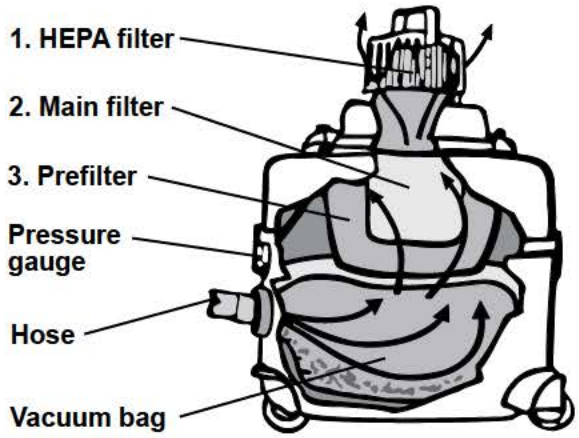

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

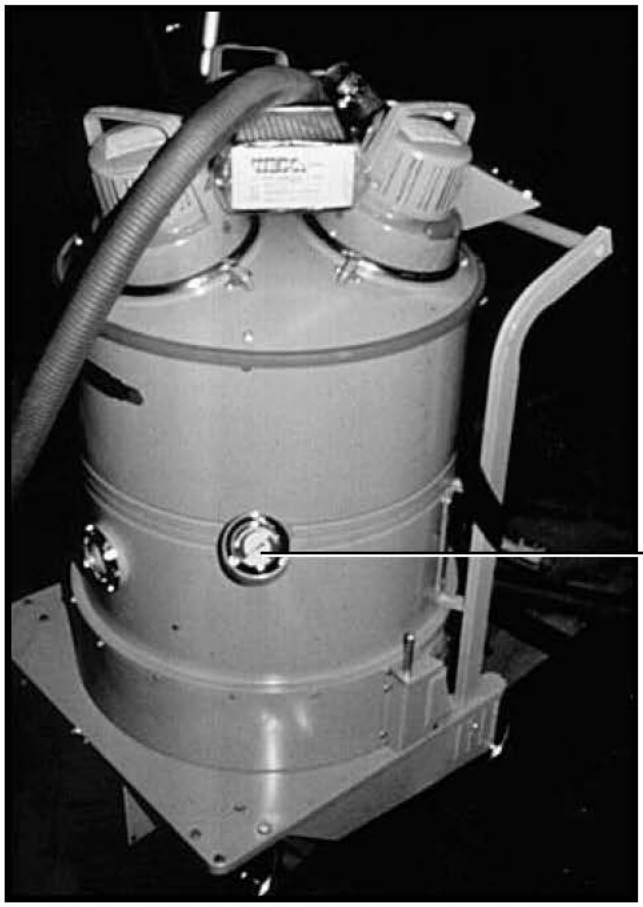

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1843 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

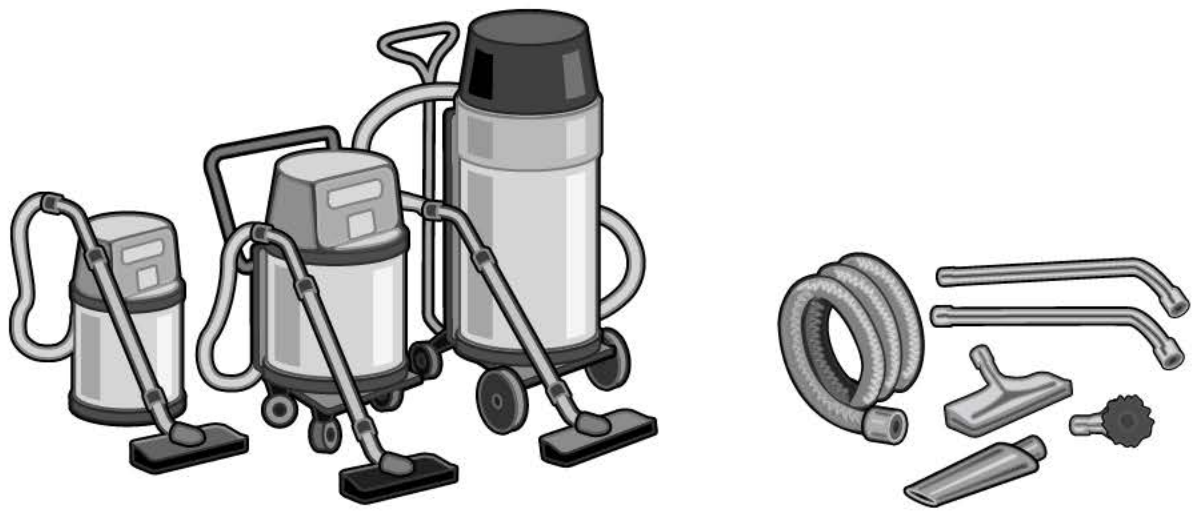

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1844 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

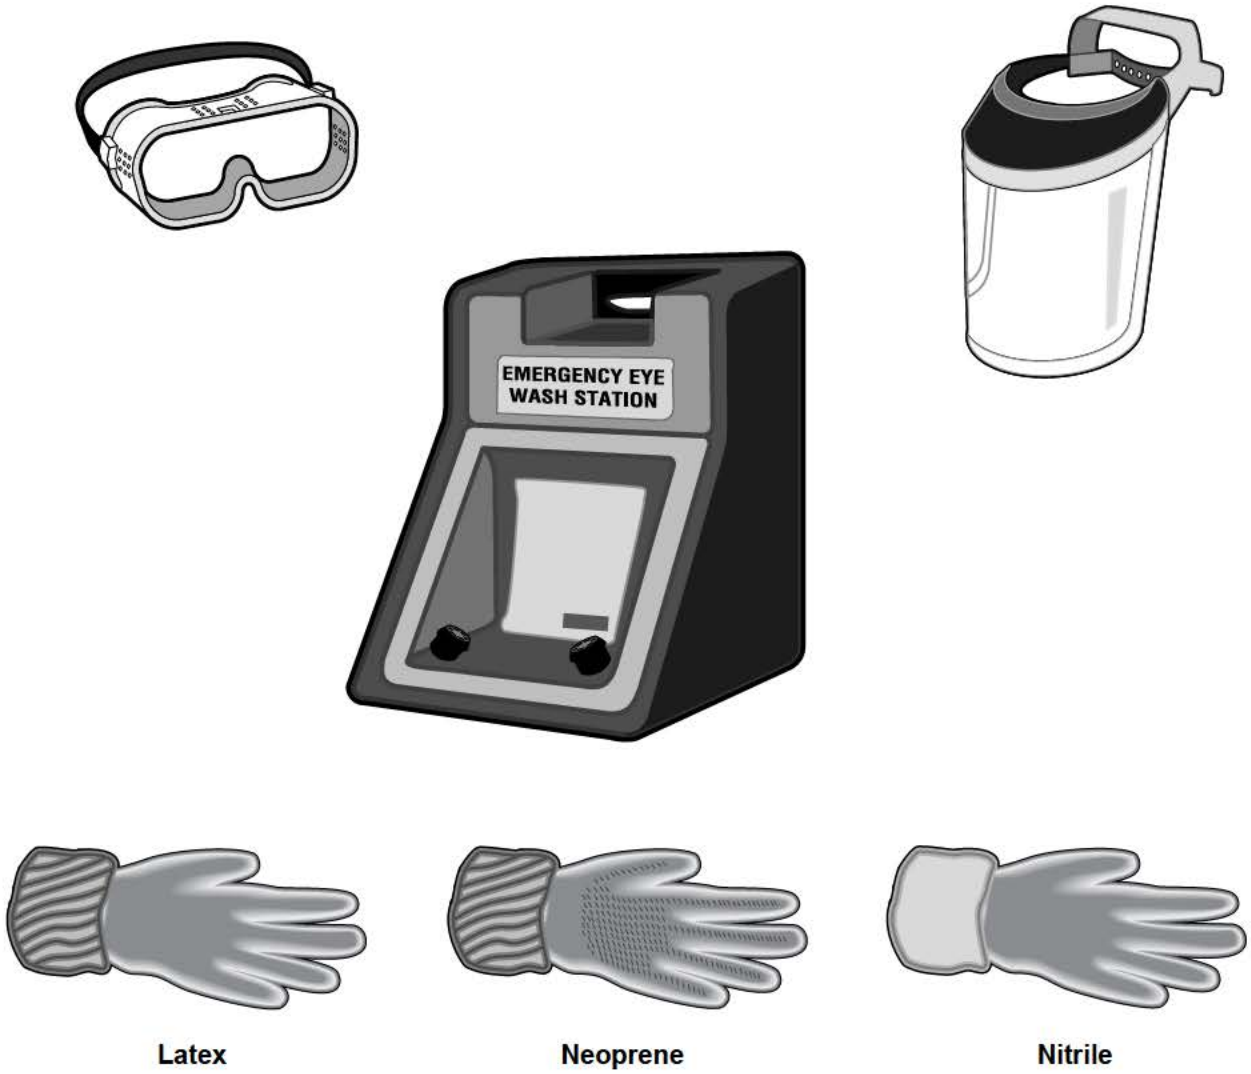

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1845 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

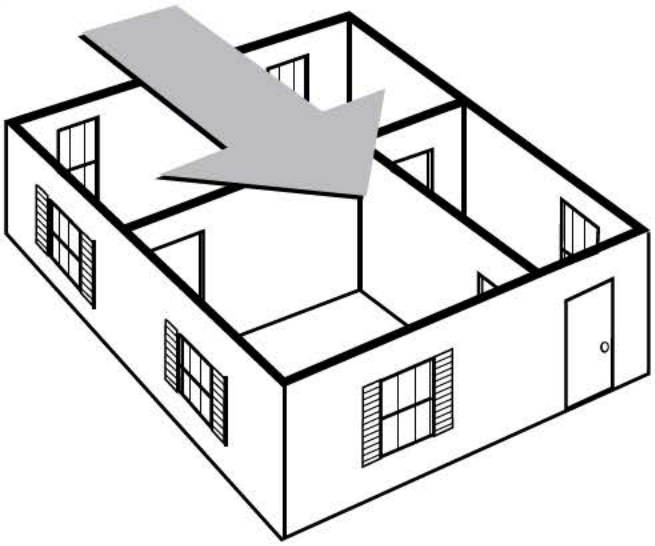

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

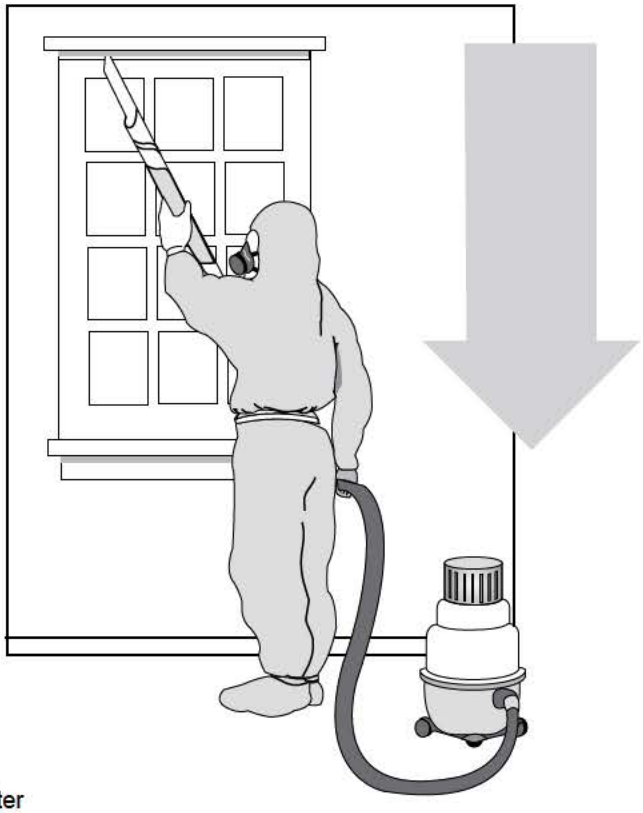

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1846 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

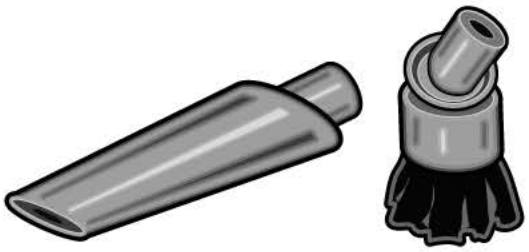

Rubber Cone **Dust Brush**

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1847 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

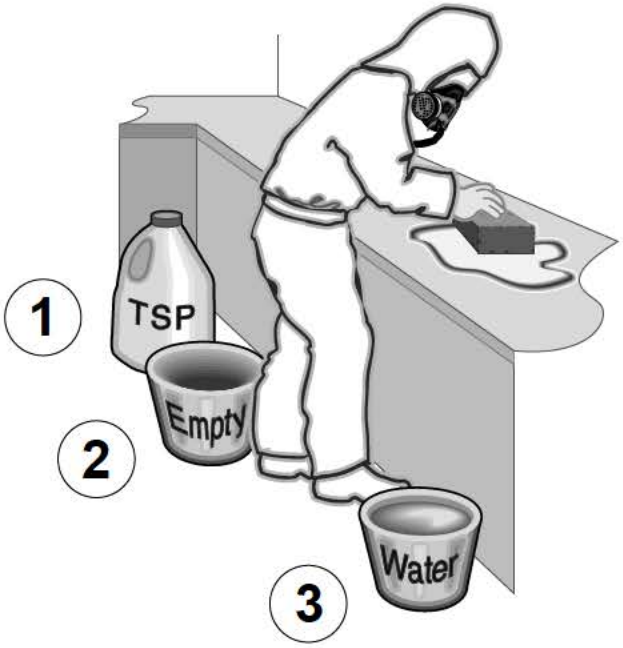

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1848 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

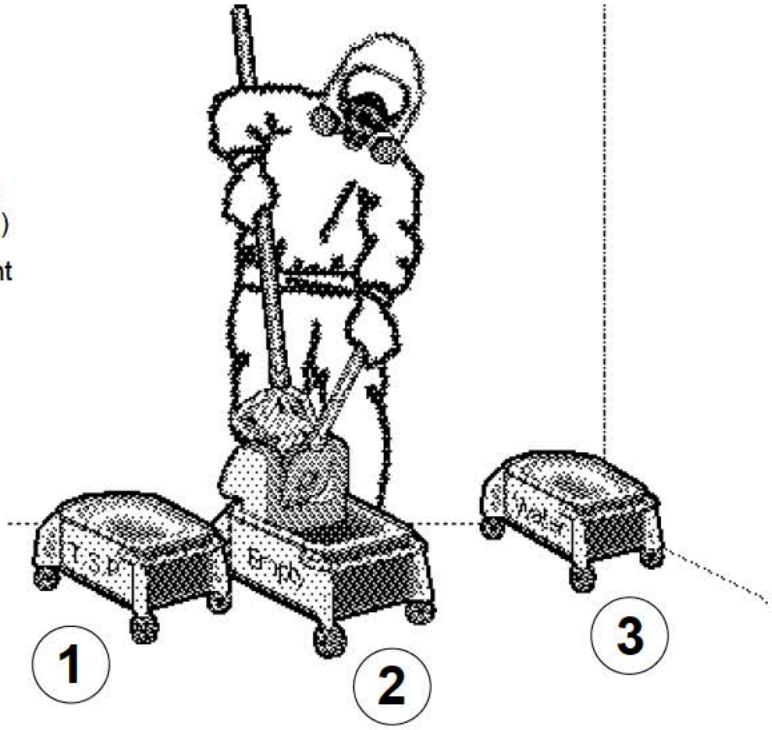

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

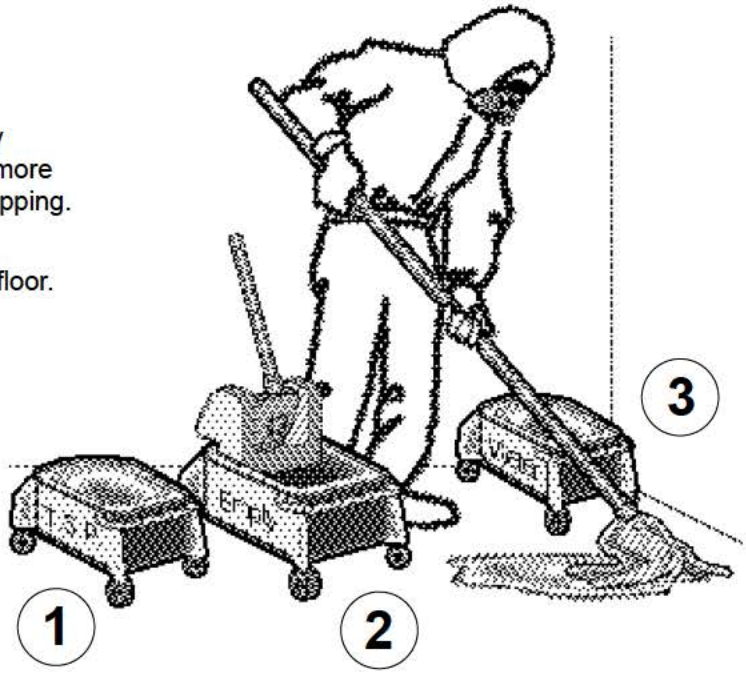

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1849 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

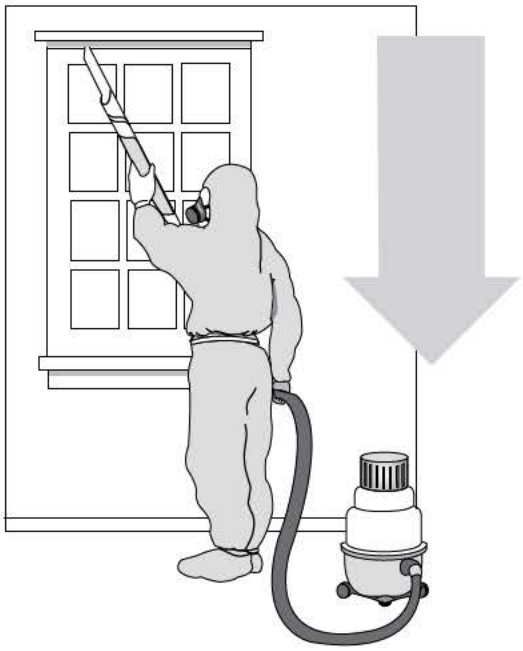

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1850 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1851 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1852 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1853 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1854 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1855 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1856 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1857 of 5269

BEST AVAILABLE COPY

APPENDIX G

MOLD GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1859 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1861 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1862 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet -** e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1863 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1864 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1865 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1866 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1867 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1868 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1869 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1870 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1871 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1872 of 5269

BEST AVAILABLE COPY

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1873 of 5269

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1874 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1875 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1876 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1877 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1878 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1879 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1880 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1881 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1882 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1884 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1885 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1886 of 5269

MOLD INVESTIGATION DECISION LOGIC

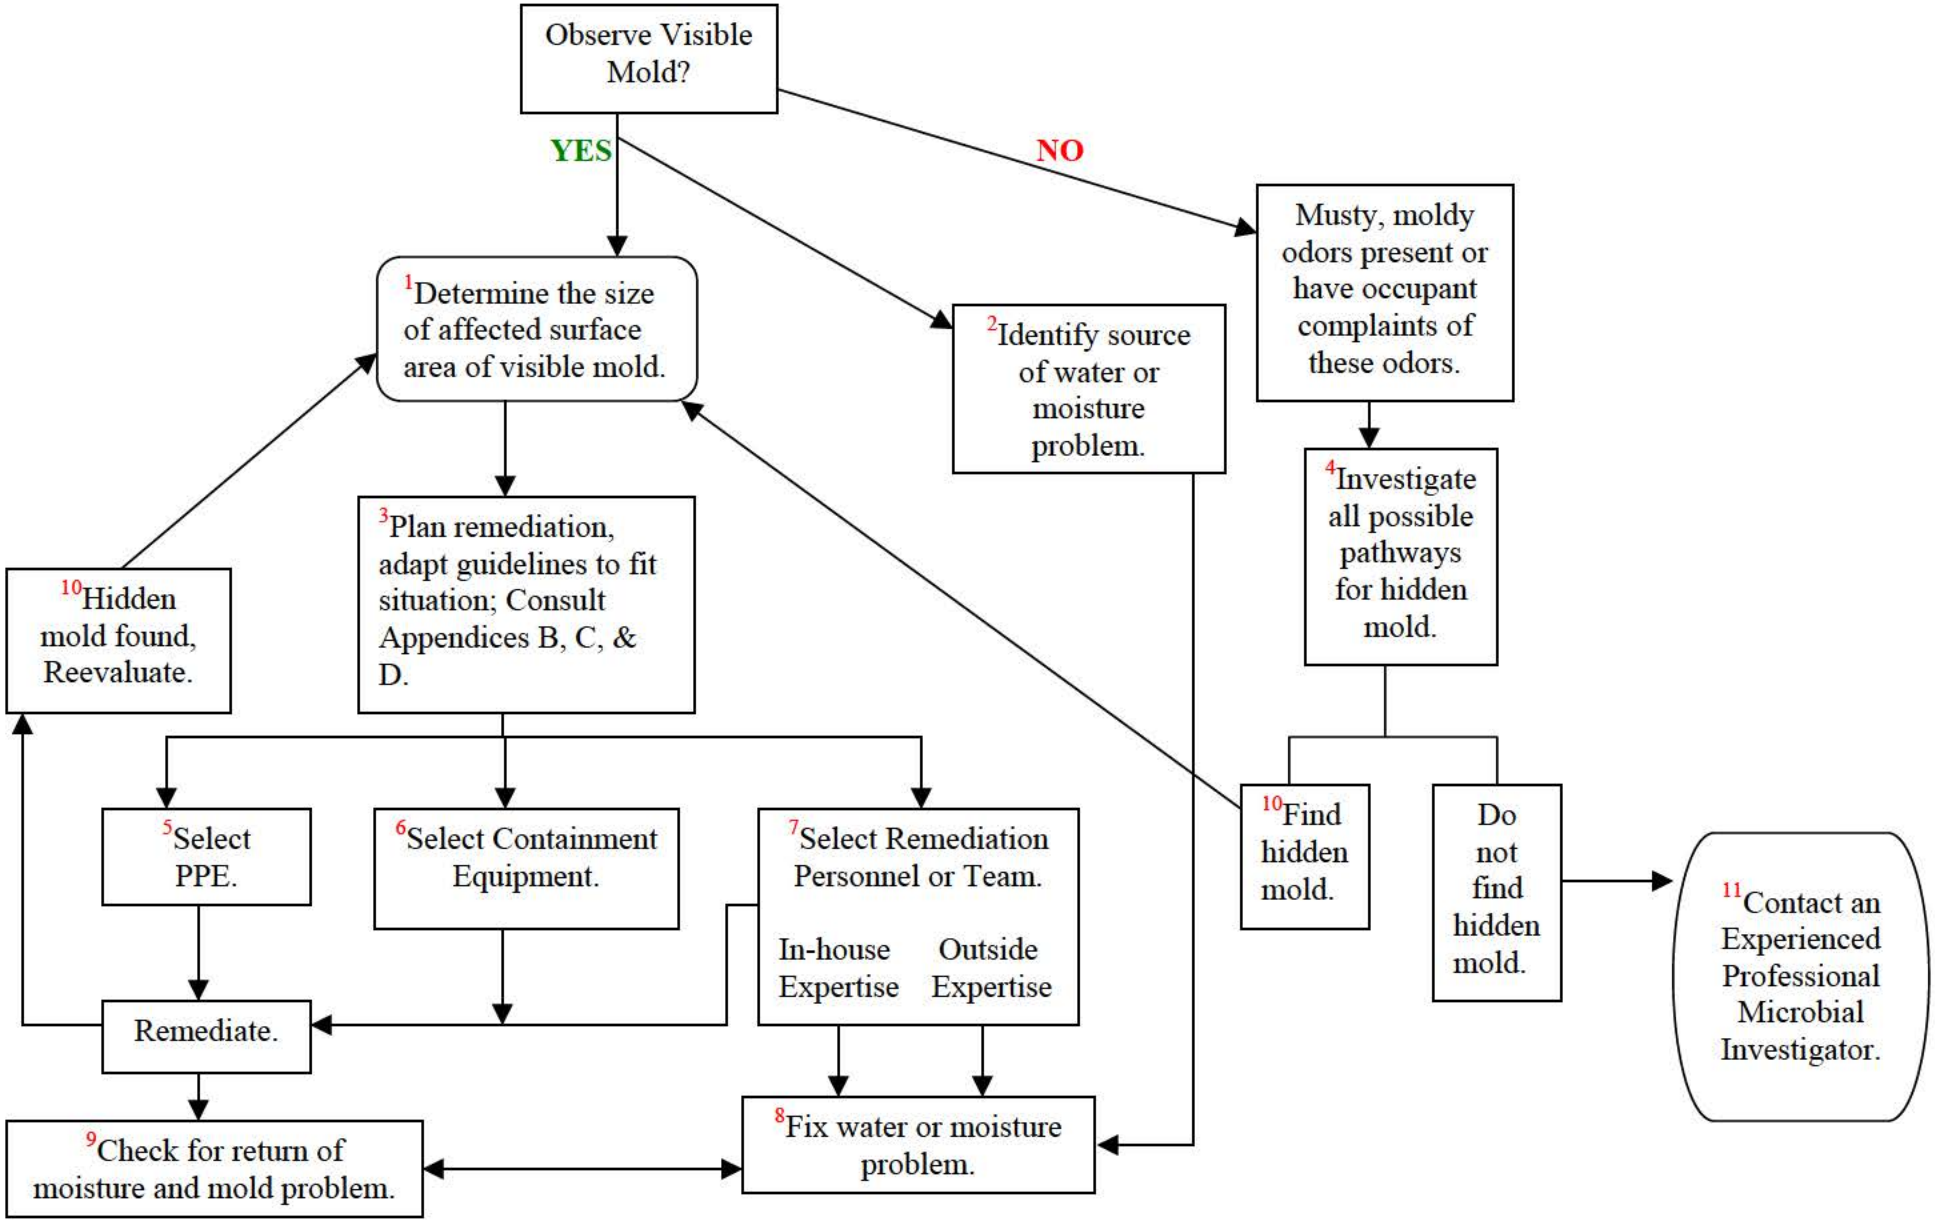

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1888 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1889 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1890 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1891 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1892 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1893 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1894 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1895 of 5269

BEST AVAILABLE COPY

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO
ATTENTION OF

MCHB-TS-OFS

May 2004

MEMORANDUM FOR Army National Guard Bureau (NGB) Region North Industrial Hygiene NGB-AVS-SI-IH, Non-Responsive, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03 CAPT. Thomas Price Armory and Organization Maintenance Shop, Cumberland, MD

1. Enclosed is a copy of subject report and one CD-ROM.

2. Please direct any additional comments or concerns to Ms Non-Responsive at DSN 584-5475/3118, commercial (410) 436-5475/3118 or e-mail address at Non-Responsive@apg.amedd.army.mil.

Non-Responsive

ENCL

Industrial Hygienist
Industrial Hygiene Field Services Program

Readiness thru Health

Printed on Recycled Paper

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1897 of 5269

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
CPT THOMAS PRICE ARMORY
CUMBERLAND, MD
55-ML-01ED-03

Approved for public release; distribution unlimited.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1898 of 5269

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES INDUSTRIAL HYGIENE BASELINE SURVEYS, CPT. THOMAS PRICE ARMORY
CUMBERLAND, MD
PROJECT NO. 55-ML-01ED-03

1. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

2. CONCLUSIONS.

a. Indoor Air Quality.

(1) The building meets the American Society of Heating, Refrigerating, and Air-Conditioning Engineers, Inc. (ASHRAE) standards for air quality for relative humidity and carbon dioxide levels.

(2) The temperature in one room exceeds the ASHRAE standard for an acceptable thermal environment.

b. Asbestos. There is a potential hazard from asbestos tiles throughout the armory that are damaged. Damaged asbestos tiles may become friable and asbestos fibers may be released.

c. Lead. Workers involved in renovation and abatement activities may be occupationally exposed to lead and asbestos. All air samples are below the laboratory analytical detection limits for lead in air. The air is not believed to be an exposure pathway for lead in this facility. There are surface dust-lead samples above the USACHPPM recommended decontamination levels. The elevated dust-lead in and adjacent to the converted indoor firing range when contacted may be hazardous to the general workforce and to children. These surface dust-lead samples also greatly exceeded the EPA lead exposure levels for children under six.

d. Safety. There is no door to exit the shop area. Garage doors are the only means of exit and they are electronically driven.

e. Illumination. All areas within the armory appear to be adequately lit. However, part of the back of the OMS does not have lighting installed.

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

f. Ventilation. The exhaust system is not working in one of the maintenance bays. One part of the bay does not have an exhaust system.

3. RECOMMENDATIONS. The Department of Defense Risk Assessment Codes (RAC) for Health Hazards enables one to prioritize remedial action for hazards. Risk Assessments Codes range in magnitude from 1 to 5, with 1 being the highest priority.

a. Indoor Air Quality. The RAC for Thermal Environmental Conditions is 5. The temperature in Room 115 exceeds the ASHRAE standard for an acceptable thermal environment. Install more air conditioning units or fans to cool this room to between 73 and 79 degrees Fahrenheit in the summer. Maintain the temperature in the winter between 68 and 74.5 degrees Fahrenheit.

b. Asbestos. The RAC for Asbestos Exposure is classified as 5. Provide a written asbestos hazard management plan for all remaining asbestos in this facility. Remove and replace the damaged asbestos tiles.

c. Lead. The RAC for this armory for Lead Exposure is classified as 4. To minimize lead exposure, clean all areas in and adjacent to the converted indoor firing range where sampling results show elevated levels of lead. Comprehensive guidelines for cleaning are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. There is a potential for taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead. Address all potential lead hazards before extending this facility to use for children. If children will be using this facility, clean surfaces to the EPA dust-lead standards for young children of 40µg/ft² on floors and 100µg/ft² for dust-lead on window sills. Test drinking water from water fountains and faucets for lead.

d. Safety. The RAC for Safety Hazards is classified as 5. There is no door to exit the shop area. Garage doors are the only means of exit and they are electrically driven. Ensure that the armory complies with all provisions of section 39.2.42 of The National Fire Protection Association (NFPA) 101 Life Safety Code 2003. This section addresses the number and distance requirements for exits. Install lighting in the area of the OMS that does not have adequate lighting installed. The exhaust system is not working in one of the maintenance bays. One part of the bay does not have an exhaust system. Install one vehicle tailpipe exhaust outlet per work bay per guidance provided in the Army National Guard Bureau Design Guide for Logistics Facilities (DG 415-2) (1990). This issue is currently being addressed by USACHPPM.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1901 of 5269

BEST AVAILABLE COPY

e. Illumination. Install lighting in the area of the OMS that does not have adequate lighting installed.

f. Ventilation. The exhaust system is not working in one of the maintenance bays. One part of the bay does not have an exhaust system. Install one vehicle tailpipe exhaust outlet per work bay per guidance provided in the Army National Guard Bureau Design Guide for Logistics Facilities (DG 415-2) (1990).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1902 of 5269

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys CPT Thomas Price Armory, Cumberland, MD
Project No. 55-ML-01ED-03

TABLE OF CONTENTS

Paragraph Page

1. AUTHORITY 1
2. PURPOSE OF EVALUATION 1
3. BACKGROUND INFORMATION 1
4. SUMMARY OF ACTIONS 1
5. ASSESSMENT CRITERIA FOR LEAD 3
6. SAMPLING RESULTS 3
7. DISCUSSION 3
8. CONCLUSIONS 4
9. RECOMMENDATIONS 5
10. ADDITIONAL ASSISTANCE 5

Enclosure

1. Lead Exposure 6
2. Asbestos Exposure 6
3. Thermal Conditions 7
4. Safety Hazards 7
5. Additional Recommendations 7

Appendices

A. - ASSESSMENT CRITERIA FOR LEAD A-1
B. - SITE MAPS B-1
C. - PHOTOGRAPHS C-1
D. - SAMPLING SHEETS AND LAB ANALYSES D-1
E. - REFERENCES E-1
F. - LEAD CLEANING GUIDANCE F-1
G. - MOLD GUIDANCE G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1903 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: CAPT. Thomas Price Armory and Organization Maintenance Shop, Cumberland, MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. 121st Engineering Battalion Mechanized.

a. Date of Construction. 1959.

c. Survey Date. 20 August 2003.

d. POC. SGM Non-Responsive (301) 678-6912 and SGT Non-Responsive (410) 702-9772; (410) 446-2972.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe and air sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Sample locations are in Appendix D. Temperature, carbon dioxide, and relative humidity measurements were collected to determine indoor air quality.

b. Physical Condition of Facilities.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1904 of 5269

MDARNG Facilities IH Baseline Surveys, CAPT. Thomas Price Armory and Organization Maintenance Shop, Cumberland, MD Project No. 55-ML-01ED-03

(1) Paint. Sergeant[redacted], Environmental Compliance Assessment Coordinator for the MD NGB, stated that all asbestos and lead-based paint has been abated.

(2) Asbestos. Staff Sergeant [redacted] stated that all asbestos has been abated. However, we did see tiles suspected of containing asbestos throughout the armory that were damaged and cracked. Some of the tiles were loose and felt "squishy" when they were stepped on. We observed that asbestos has been removed from the pipes.

(3) Mold. No mold was observed.

(4) Safety Hazards. No safety hazards were observed.

c. Other Building Issues.

(1) The exhaust system is not working in one of the maintenance bays. One part of the bay does not have an exhaust system.

(2) There is no door to exit the shop area. Garage doors are the only means of exit and they are electrically driven.

d. Safety and Industrial Hygiene Programs.

(1) There are no written program records at the armory.

(2) Personal protective equipment is worn at all times in the OMS.

e. Heating, Ventilation, and Air-conditioning System. The armory and the Organization Maintenance Shop (OMS) is heated with natural gas. Ventilation and air are provided by window-mounted air conditioning units and the manual operation of windows.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. All areas within the armory appeared to be adequately lit and occupants reported no areas of deficient lighting. Part of the back of the OMS does not have lighting installed

h. Converted indoor firing range (IFR). Staff Sergeant[redacted], Environmental Compliance Assessment Coordinator for the MD NGB, stated that all lead in the converted indoor firing range had been abated during its conversion. The IFR was converted to a locker room.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1905 of 5269

BEST AVAILABLE COPY

i. Photographs (Appendix C).

j. Site Maps (Appendix B).

k. Facility use by children. The POC stated that children use this facility occasionally.

5. ASSESSMENT CRITERIA. (Appendix A).

6. SAMPLING RESULTS.

a. Indoor Air Quality. The relative humidity and carbon dioxide levels were all within normal ranges. One indoor room exceeded the ASHRAE indoor air quality standard for temperature. Outside the temperature was 77.7 degrees F, the relative humidity was 63.1 %, and the carbon dioxide level was 285 ppm. In Room 106, the temperature was 79.0 degrees F, the relative humidity was 59.3%, and the carbon dioxide level was 305 ppm. In Room 115 the temperature was 81.0 degrees F, the relative humidity was 56.4 %, and the carbon dioxide level was 338 ppm. In the OMS office the temperature was 79.4 degrees F, the relative humidity was 37.1 %, and the carbon dioxide level was 625 ppm.

b. Lead in air and surface dust-lead wipe sample results are shown in Appendix D. All air sample results were below the laboratory analytical detection limits of 0.004 mg/m^3 and 0.005 mg/m^3 lead in air. Three of 14 dust-lead surface wipes exceeded the USACHPPM recommended decontamination level of 200 $\mu g/ft^2$ for floors and other frequently-contacted surfaces. These samples also exceeded the EPA lead exposure levels for children under six.

7. DISCUSSION AND CONCLUSIONS.

a. Indoor Air Quality. The relative humidity and carbon dioxide levels were within ASHRAE standards for air quality. The temperature in one room exceeded ASHRAE standards.

b. Asbestos. There were asbestos tiles throughout the armory that were damaged and cracked. Some of the tiles were loose and felt “squishy” when they were stepped on. Damaged asbestos tiles may become friable and asbestos fibers may be released. There is a potential hazard from these damaged asbestos tiles. Army policy requires the armory to establish and execute an asbestos hazard management plan for all asbestos in the facility, and to take immediate corrective action where a possible asbestos-related health hazard has been identified. We did observe that asbestos has been removed from the pipes.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1906 of 5269

BEST AVAILABLE COPY

c. Lead.

(1) Air samples. All air samples are below the laboratory analytical detection limit for lead in air of 0.004 to 0.005 mg/m³.

(2) Dust-lead. One of the surface wipe samples exceeding USACHPPM decontamination guidance was collected in the area where the baffle used to be in the old IFR (1552). One was collected from the floor midpoint of the IFR lanes (1553). The other one was collected on the floor in the supply office Room 122 (1555).

(3) Child exposure to dust lead. These surface dust-lead wipe samples also greatly exceeded the EPA lead exposure levels for children. EPA regulations define dust-lead standards for young children in child-occupied facilities. The EPA standard for dust-lead on floors is 40µg/ft², and 100µg/ft² for dust-lead on window sills. These levels were developed for children under 6 spending at least 60 hours per year in pre-1978 facilities. Although this armory does not meet the EPA definition of child-occupied facility's minimum time requirement for child use, USACHPPM believes that there is a potential hazard for children using this facility. AR 420-70 states that the purpose of Army lead hazard management is to protect children from all sources of lead exposure. However, its provisions only control these exposures, and do not eliminate them. Although this facility may comply with EPA and Army regulations, exposures for children under six may exceed those that the regulations are intended to prevent.

(4) Occupational Exposure. Elevated levels of dust-lead exist on surfaces that may be contacted by the general workforce. Workers involved in renovation and abatement activities may be occupationally exposed to lead.

d. Safety. There is no door to exit the shop area. Garage doors are the only means of exit and they are electrically driven.

e. Illumination. Part of the back of the OMS does not have lighting installed. There is no door to exit the shop area. Garage doors are the only means of exit and they are electrically driven.

f. Ventilation. The exhaust system is not working in one of the maintenance bays. One part of the bay does not have an exhaust system.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1907 of 5269

MDARNG Facilities IH Baseline Surveys, CAPT. Thomas Price Armory and Organization Maintenance Shop, Cumberland, MD Project No. 55-ML-01ED-03

9. RECOMMENDATIONS. Enclosure.

10. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by e-mail Non-Responsive@apg.amedd.army.mil.

Non-Responsive

INDUSTRIAL HYGIENIST
USACHPPM LEAD AND ASBESTOS TEAM LEADER
Industrial Hygiene Field Services Program
EPA AHERA Asbestos Inspector and Management Planner/
Certification Number MD-070340
EPA Lead Inspector and Lead Risk Assessor/
Certification Number 04-7913

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1908 of 5269

MDARNG Facilities IH Baseline Surveys, CAPT. Thomas Price Armory and Organization Maintenance Shop, Cumberland, MD Project No. 55-ML-01ED-03

ENCLOSURE

CUMBERLAND ARMORY RECOMMENDATIONS

The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority. The RAC for this armory for Lead Exposure is classified as 4. The RAC for Asbestos Exposure is 3. The RAC for Thermal Conditions is 5. DODI 6055.1 also provides RACs for Safety and Ergonomic Hazards. The RAC for Safety Hazards is classified as 5.

1. RAC # 1. Lead Exposure.

a. Clean all areas in and adjacent to the old IFR where sampling results showed elevated levels of lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup.

b. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62.

c. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

d. Test drinking water from water fountains and faucets for lead. It could not be determined if this has been done.

e. Address all potential lead hazards before extending this facility to use for children. If children will be using this facility, clean surfaces to the EPA dust-lead standards for young children of 40 $\mu g/ft^2$ on floors and 100$\mu g/ft^2$ for dust-lead on window sills.

2. RAC # 2. Asbestos Exposure. Provide a written asbestos hazard management plan for all remaining asbestos in the facility. Army regulation 200-1 (Environmental Protection and Enhancement) requires the armory to establish and execute an asbestos hazard management plan for all asbestos in the facility, and to take immediate

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1909 of 5269

BEST AVAILABLE COPY

corrective action where a possible asbestos-related health hazard has been identified. Damaged asbestos tiles may become friable and asbestos fibers may be released. Remove and replace the damaged asbestos tiles.

3. RAC # 3. Thermal Conditions. The armory relative humidity and carbon dioxide levels meet ASHRAE standards for air quality. The temperature in Room 115 exceeds the ASHRAE standard for an acceptable thermal environment. Install more air conditioning units or fans to cool Room 115 to between 73-79 degrees Fahrenheit in the summer. The temperature in the winter should be between 68-74.5 degrees Fahrenheit.

4. RAC # 4. Safety Hazards.

a. There is no door to exit the shop area. Garage doors are the only means of exit and they are electrically driven. Ensure that the armory complies with all provisions of section 39.2.42 of The National Fire Protection Association (NFPA) 101 Life Safety Code 2003. This section addresses the number and distance requirements for exits.

b. Install lighting in the area of the OMS that does not have adequate lighting installed.

5. Additional Recommendations. The exhaust system is not working in one of the maintenance bays. One part of the bay does not have an exhaust system. Install one vehicle tailpipe exhaust outlet per work bay per guidance provided in the Army National Guard Bureau Design Guide for Logistics Facilities (DG 415-2) (1990). (This issue is currently being addressed by USACHPPM. Additional information will be provided when it becomes available).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1910 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

Subject: Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 $\mu g/ft^2$. This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e)(8)(viii))are not directly applicable because they are developed for floors (40 $\mu g/ft^2$), windowsills (250 $\mu g/ft^2$) and window troughs (400 $\mu g/ft^2$) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

BEST AVAILABLE COPY

APPENDIX B

SITE MAPS

BEST AVAILABLE COPY

BEST AVAILABLE COPY

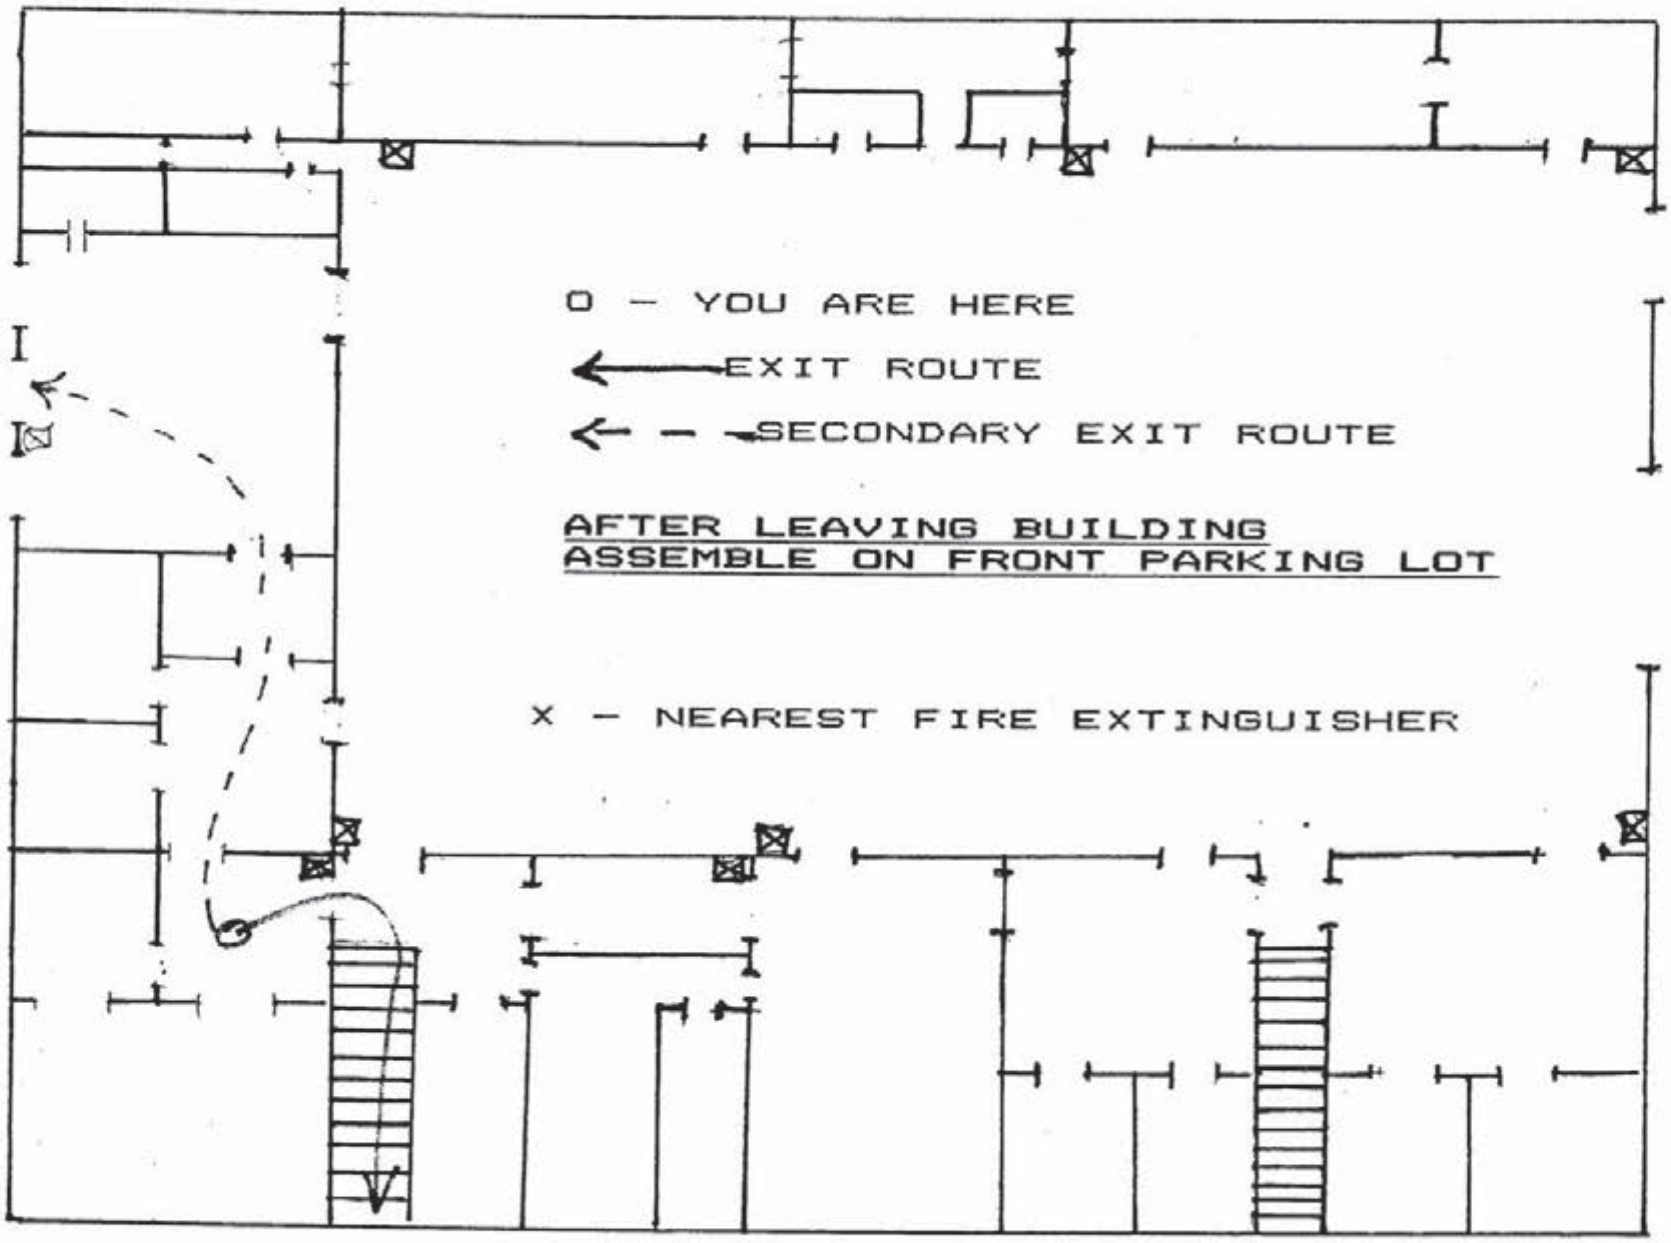

FIRE PLAN LEARNING CENTER OFFICE

CUMBERLAND NG ARMORY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

O – YOU ARE HERE

EXIT ROUTE

SECONDARY EXIT ROUTE

AFTER LEAVING BUILDING
ASSEMBLE ON FRONT PARKING LOT

X – NEAREST FIRE EXTINGUISHER

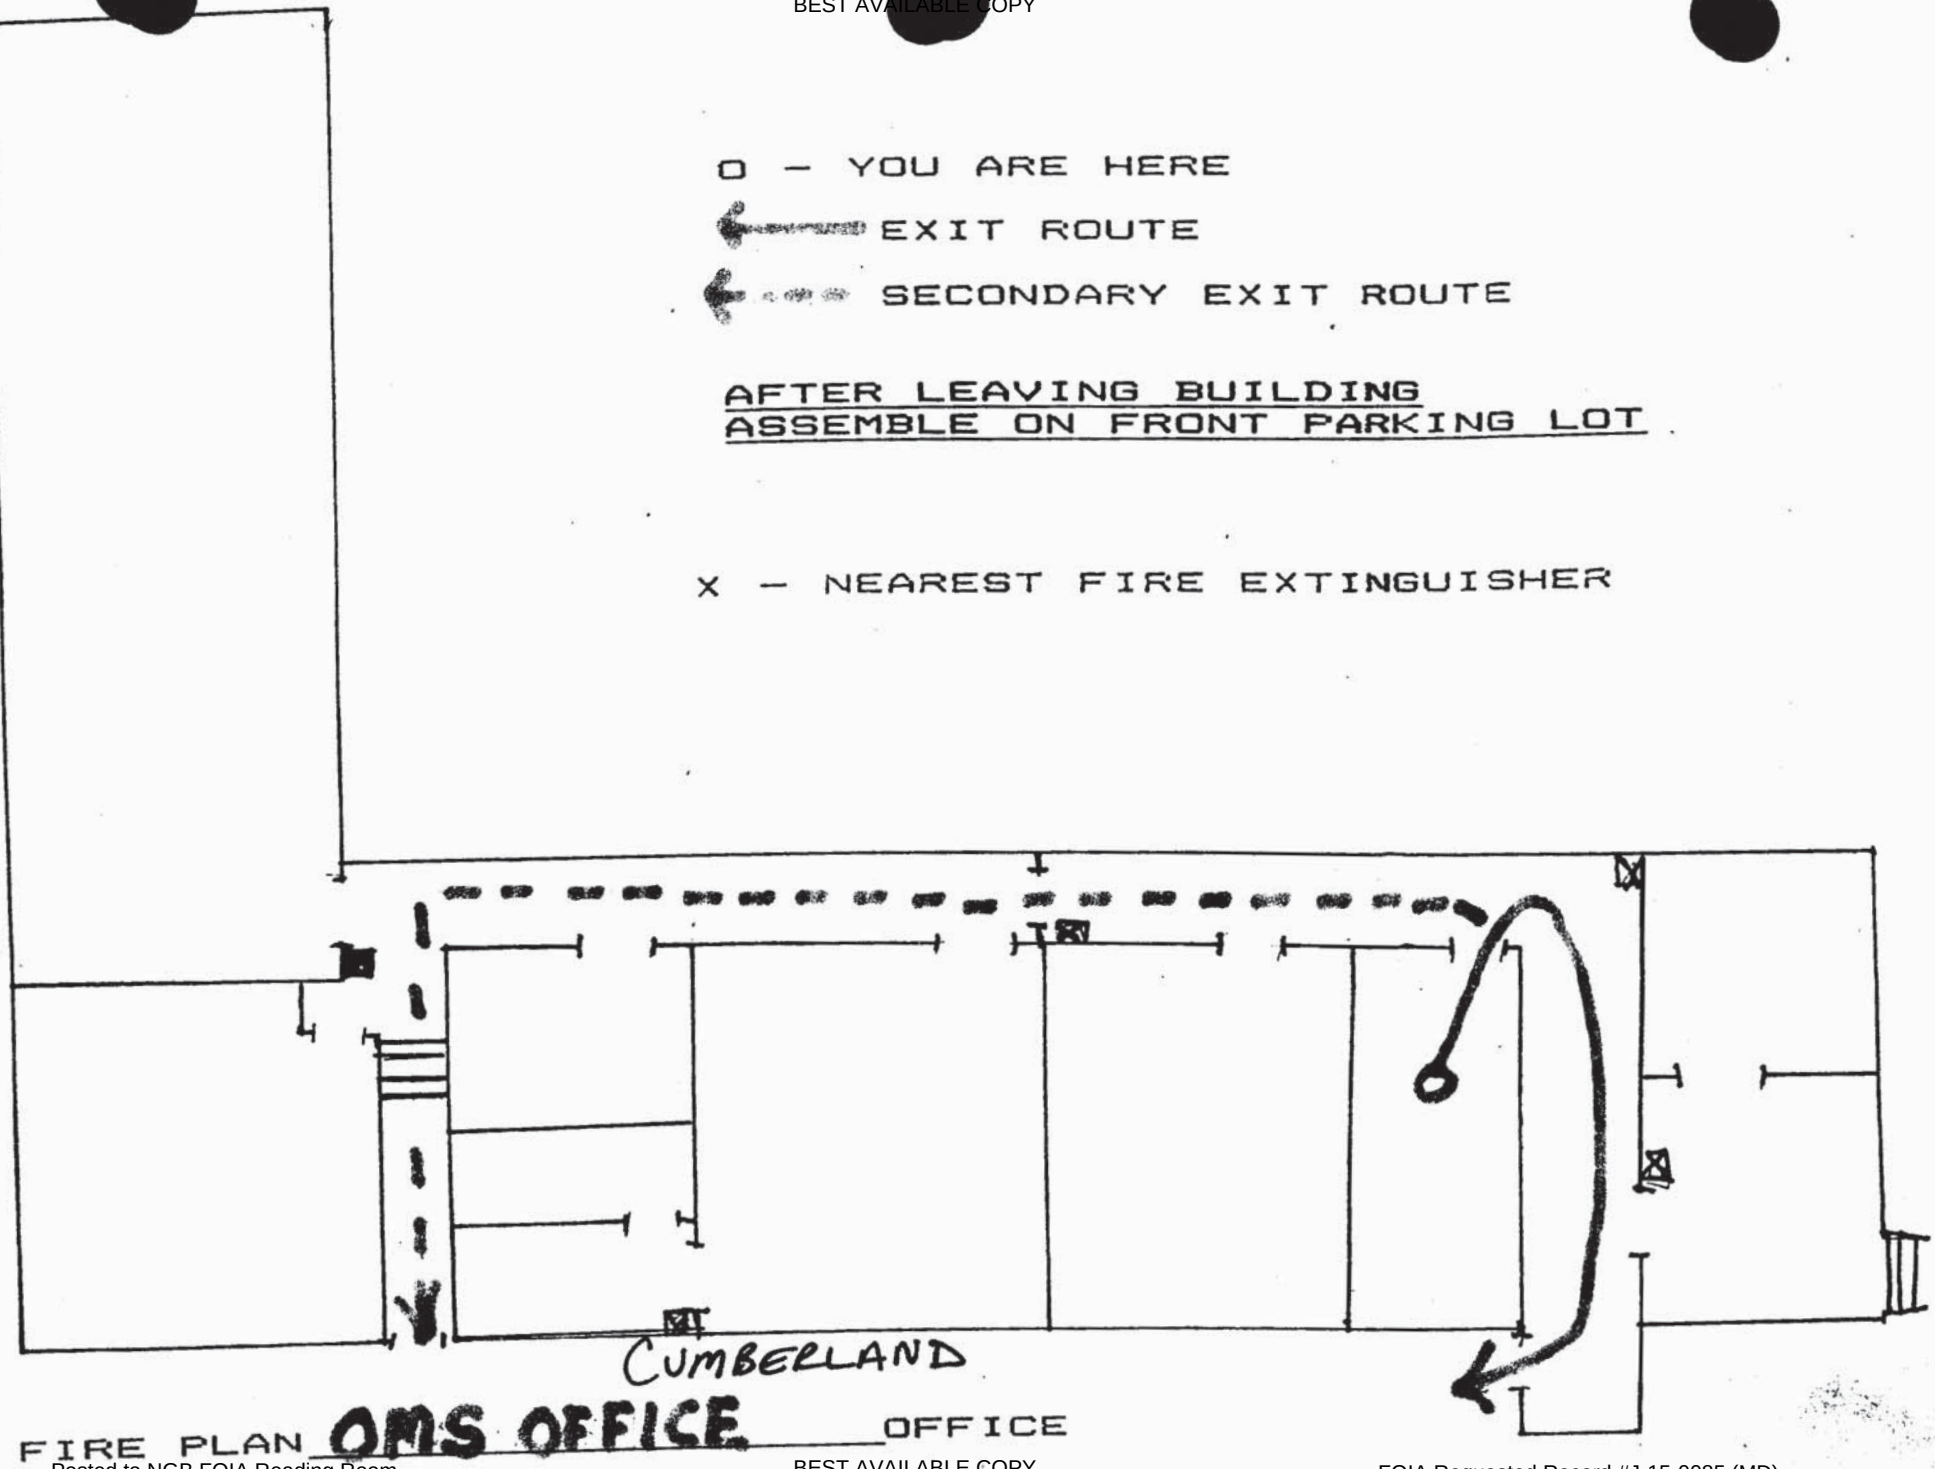

FIRE PLAN _____ OFFICE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1915 of 5269

OMS # 10 FIRE EXTINGUISHER LOG

BEST AVAILABLE COPY

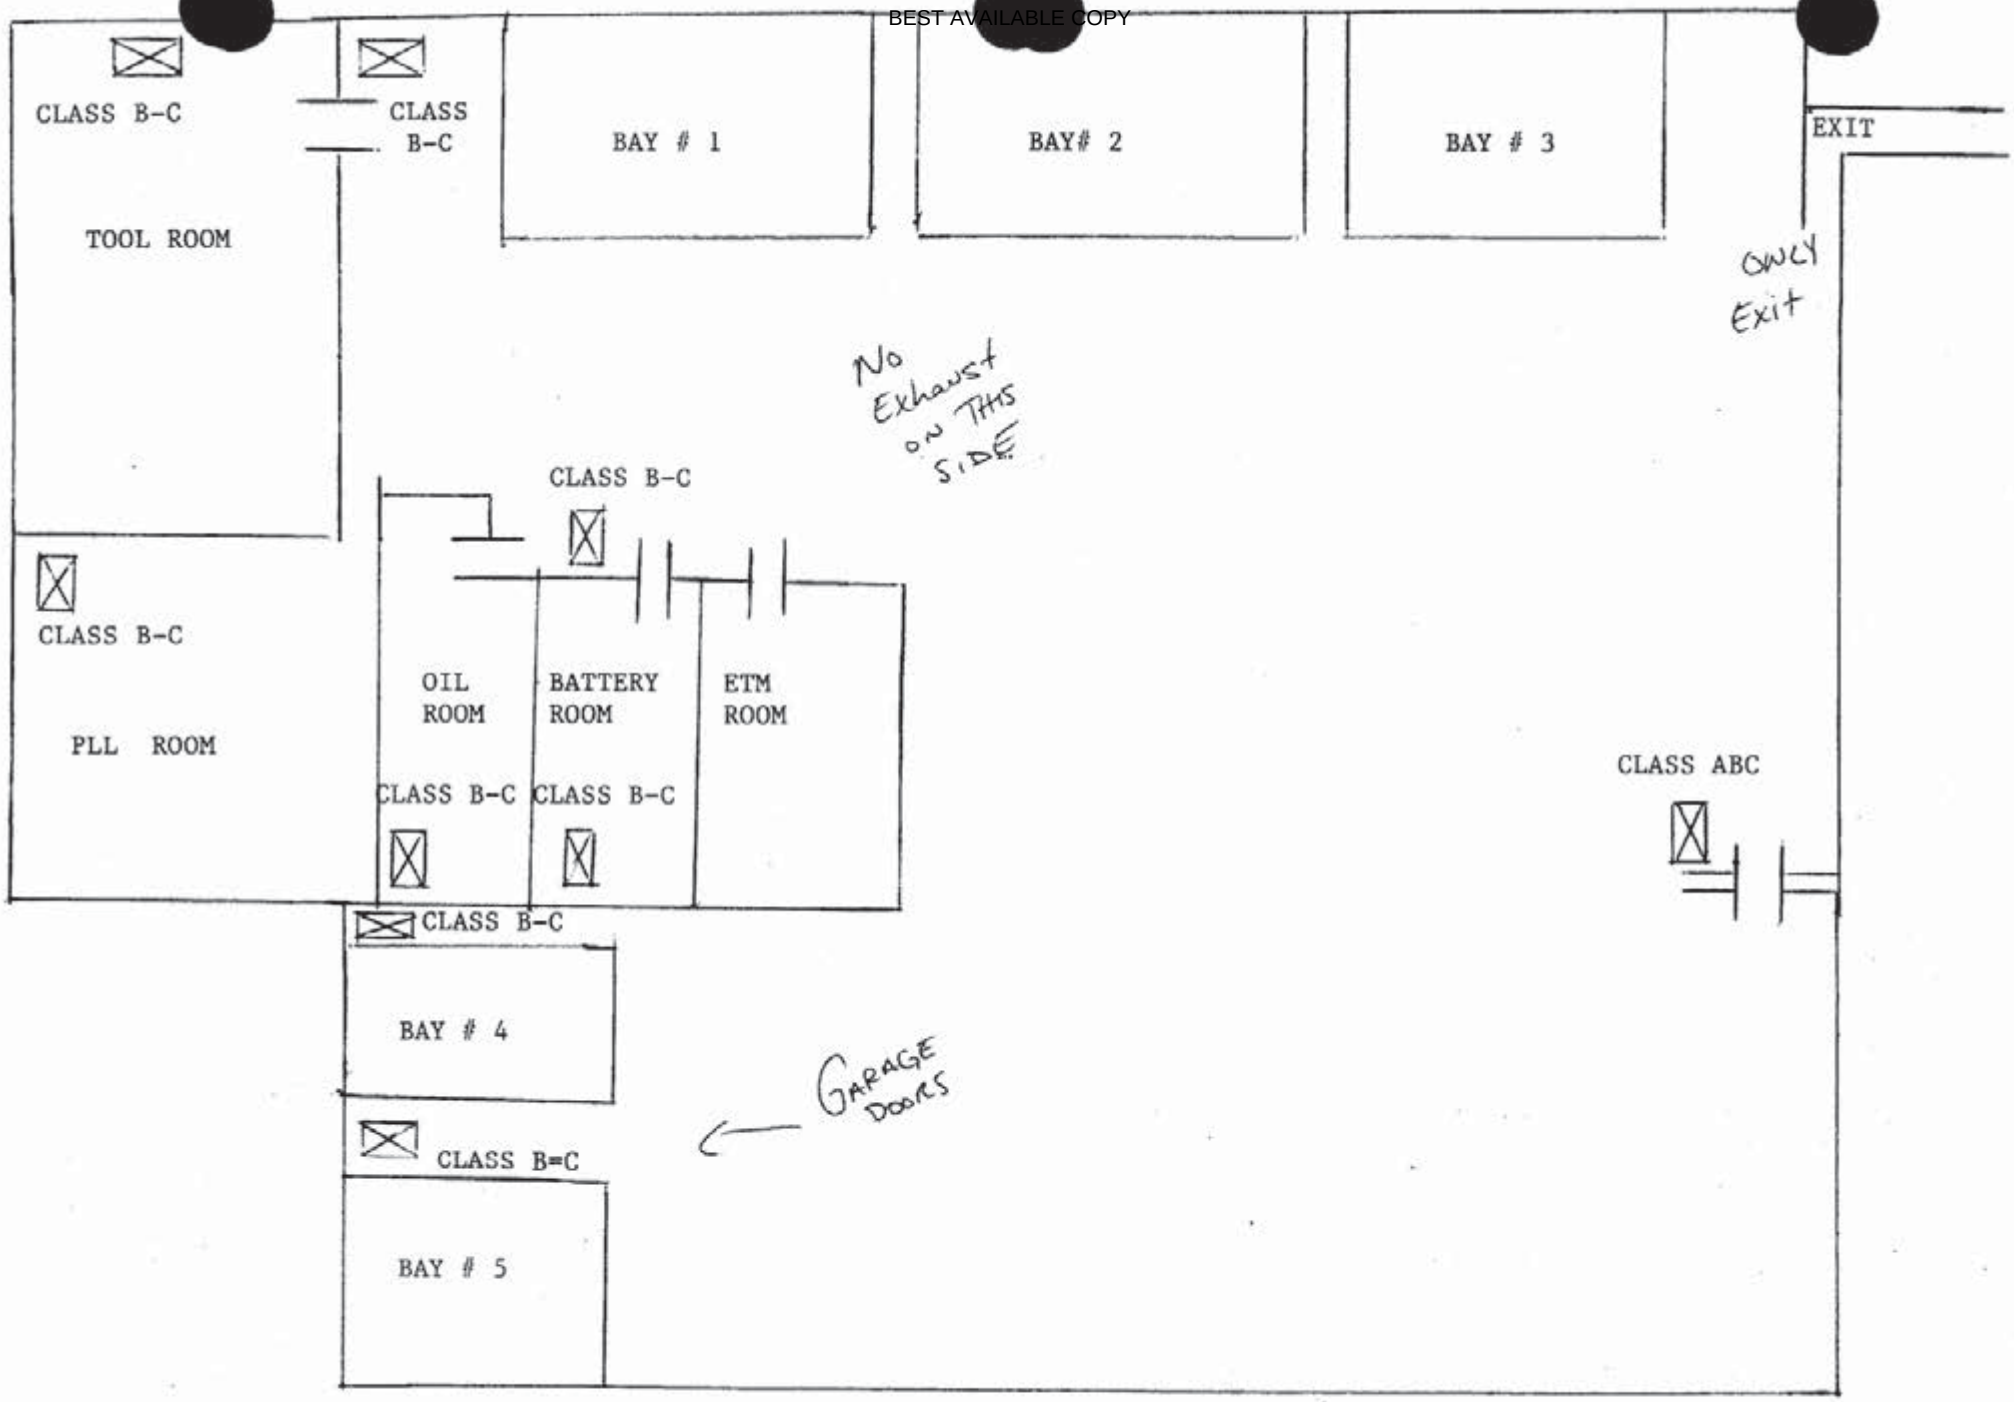

NOTE: ☒ = EXTINGUISHER

CUMBERLAND OMS

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

BEST AVAILABLE COPY

Photograph Number	Photograph Location
1546	Drill area near Room 113 and near water fountain
1549	Counter into kitchen area from drill area
1550	SFC Non-Responsive Office- Window sill under AC unit
1551	Desktop in SFC Non-Responsive s Office
1552	Floor where baffle used to be in former IFR
1553	Floor midpoint of IFR lanes
1554	Desk in front of former IFR
1555	Supply office Room 122 desk
1556	Supply office Room 122 refrigerator top
1557	Supply Office Room 122 floor
1558	OMS office window sill under AC unit
1559	OMS office floor
1560	Maintenance area of OMS
1561	OMS area near lift On top of wall (1/2 wall)

1549

1546

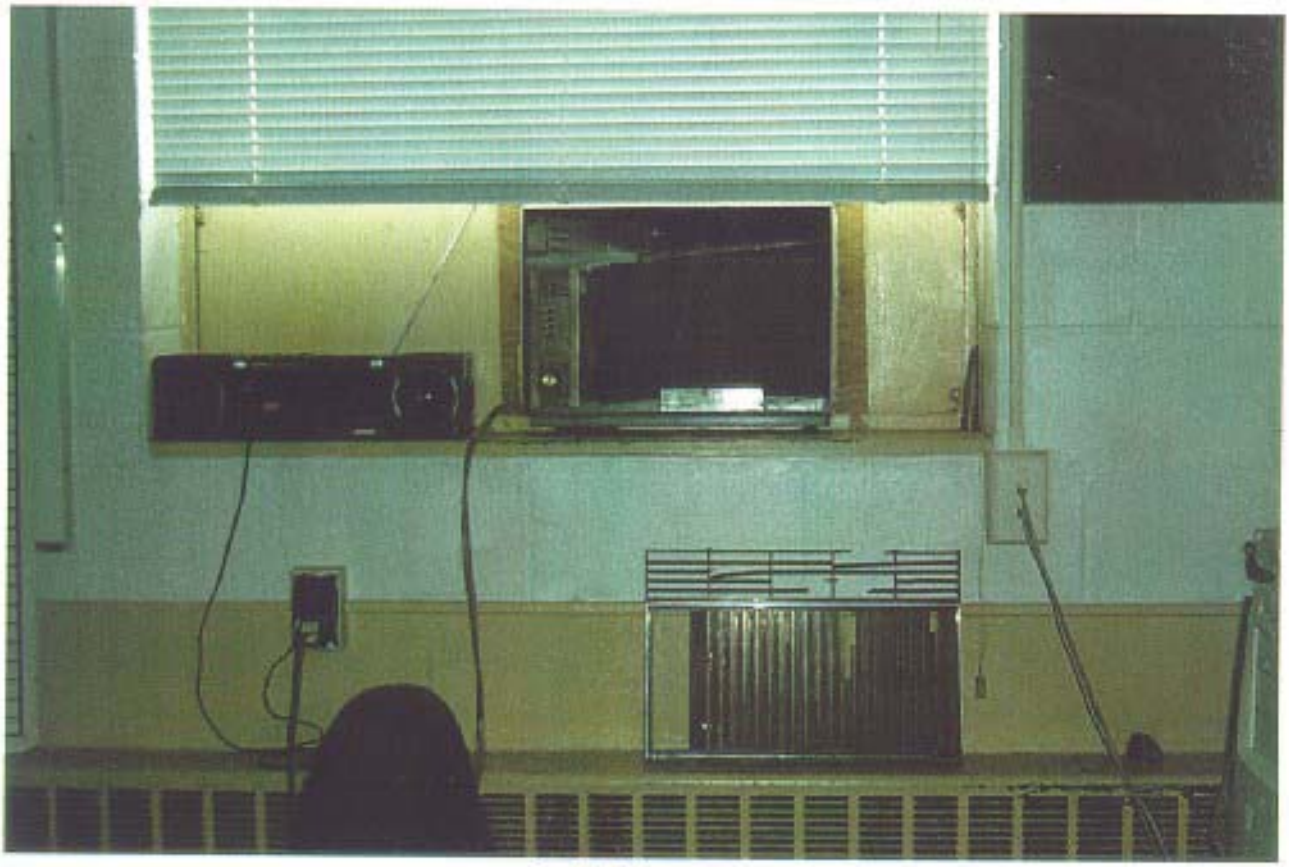

1550

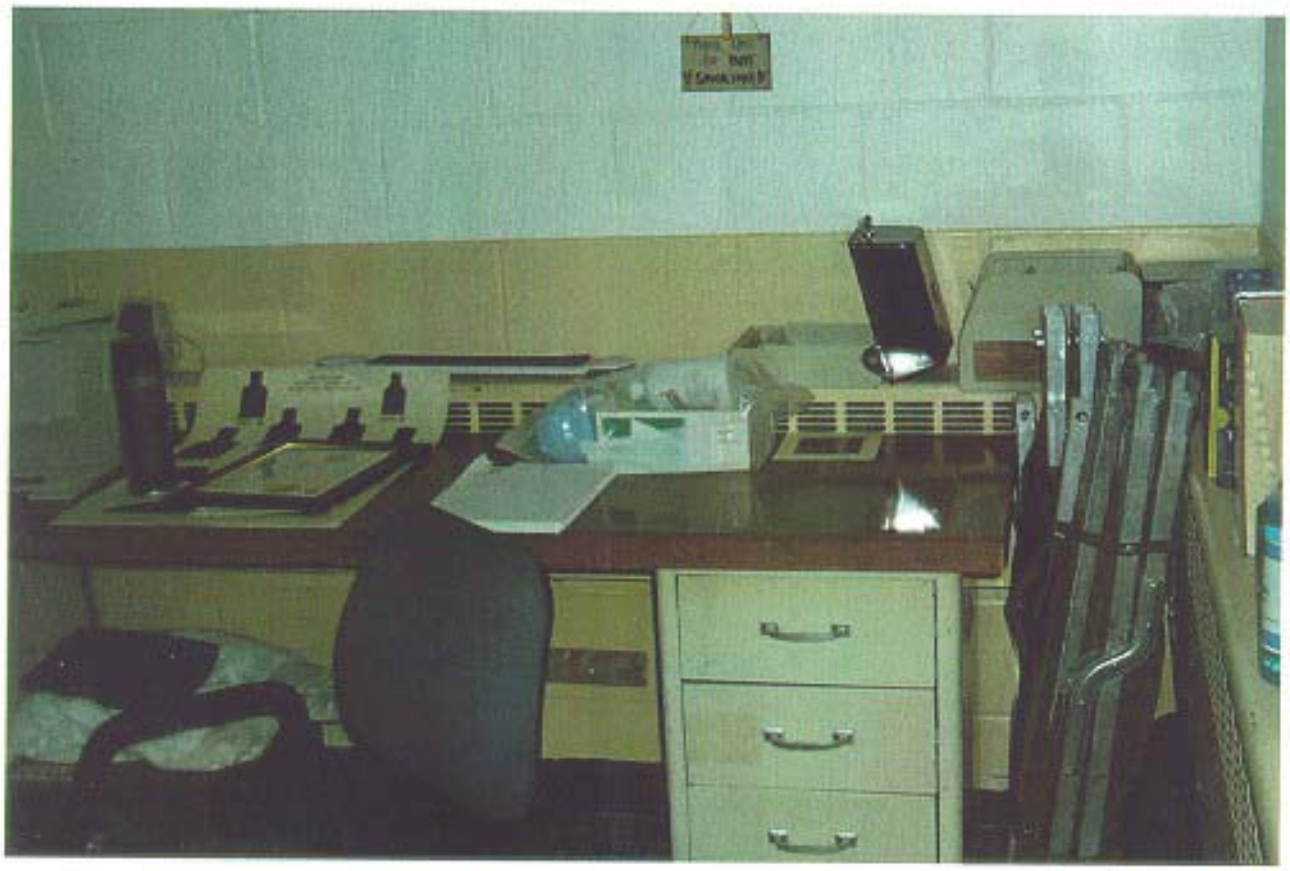

1551

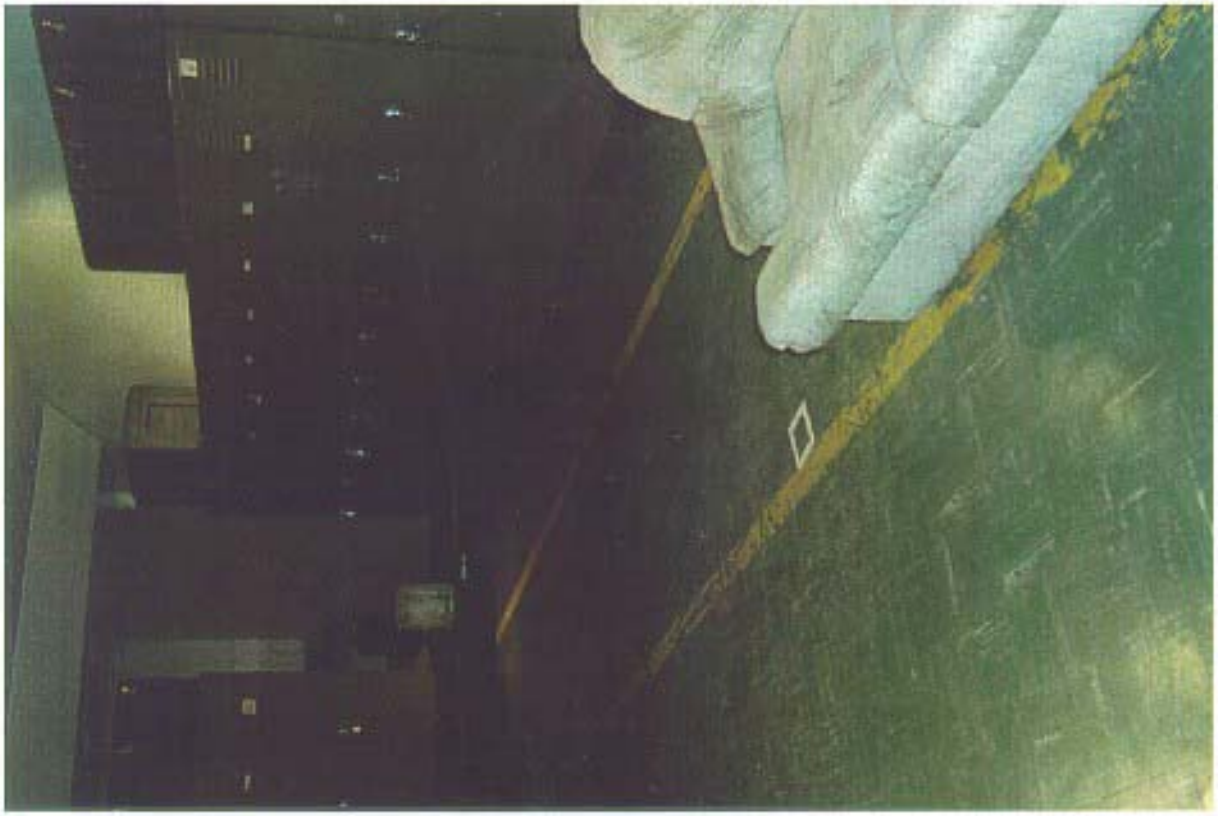

1553

1552

1555

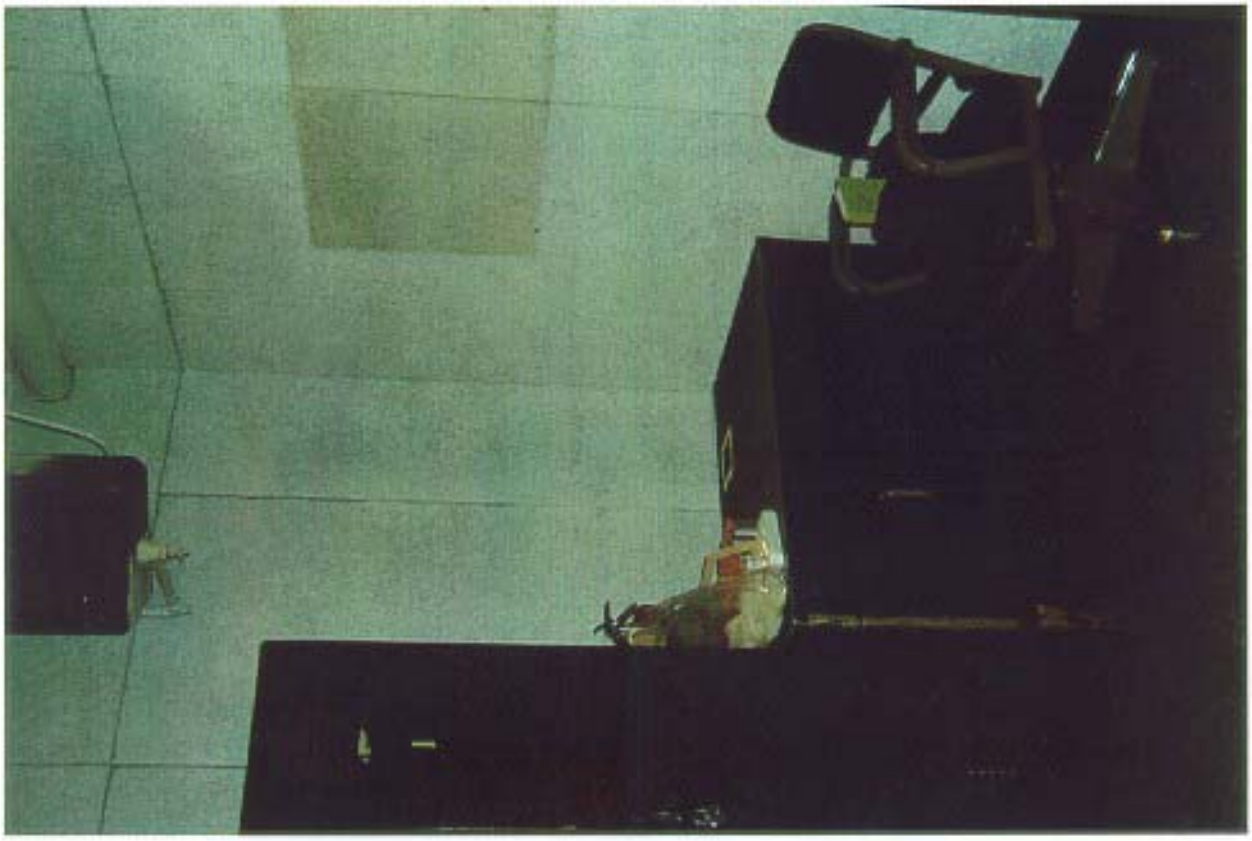

1554

1557

1556

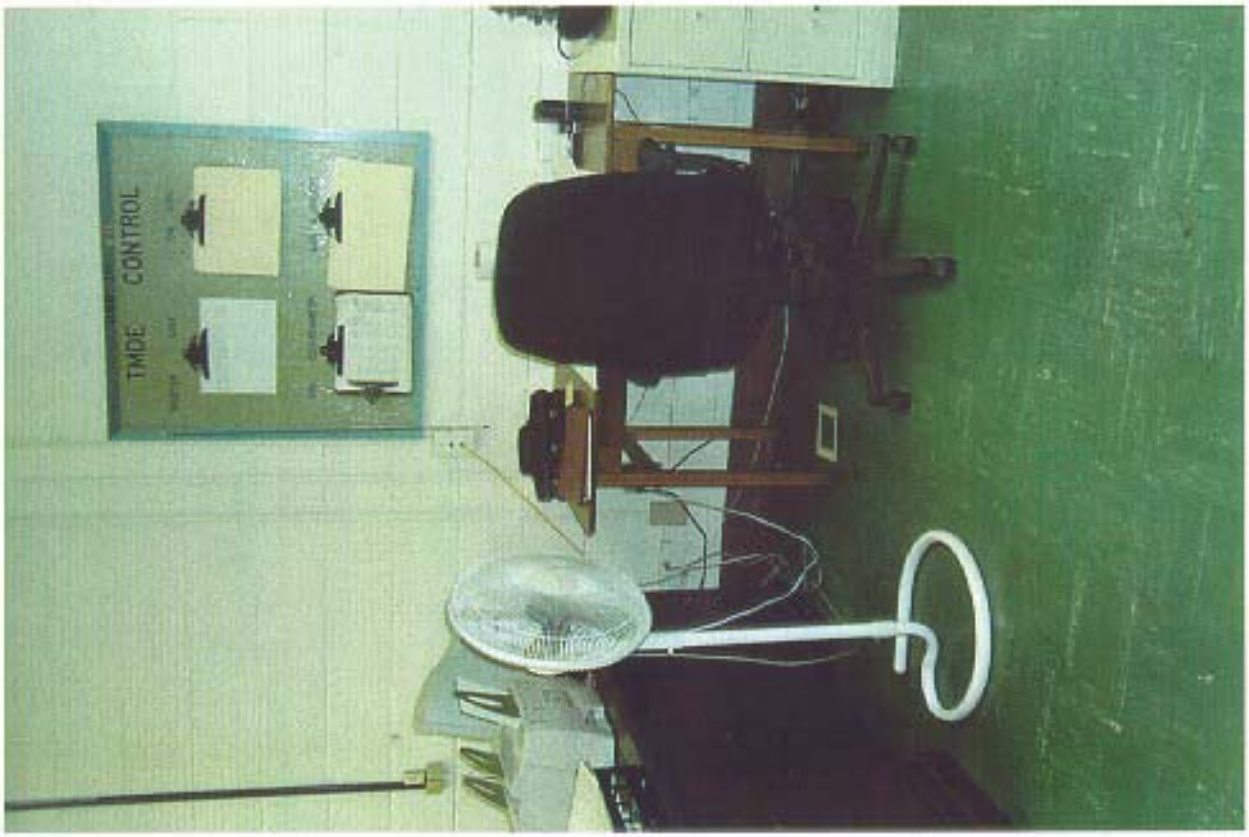

1559

1558

1561

1560

BEST AVAILABLE COPY

APPENDIX D

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

Wipe Sample #	Armory	City	Indoor Range Info: Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
	Cumberland	Cumberland		Yes		Unknown		
CUW01	Cumberland	Cumberland					On wall in drill area near Room 113; near water fountain	<12
CUW02	Cumberland	Cumberland					On counter for kitchen area onto drill area	<110
CUW03	Cumberland	Cumberland					On window sill under AC unit in SFC [redacted] office	<110
CUW04	Cumberland	Cumberland					On desktop in SFC [redacted]s office	<110
CUW05	Cumberland	Cumberland					On floor in former IFR baffle area	<110
CUW06	Cumberland	Cumberland					On floor midpoint of IFR lanes	3,500
CUW07	Cumberland	Cumberland					On desk in front of old IFR	<110
CUW08	Cumberland	Cumberland					Room 122 on desk of supply SGT's office	<110
CUW09	Cumberland	Cumberland					Room 122 on top of refrigerator in supply office	<110
CUW10	Cumberland	Cumberland					Room 122 on floor in supply office	<110
CUW11	Cumberland	Cumberland					On window sill in OMS office under AC unit	<110
CUW12	Cumberland	Cumberland					On floor in OMS office	<110
CUW13	Cumberland	Cumberland					On desktop in maintainence area of OMS	<110
CUW14	Cumberland	Cumberland					On top of wall in OMS area near lift	<110

BEST AVAILABLE COPY
BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1927 of 5269

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	National Guard Bureau	**Job Name:**	Cumberland National Guard Armory	**Chain Of Custody:**	116955
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	08/28/2003
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Report Date:**	29-Aug-03

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0365493	CU Blank 01	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0365494	CU W01	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365495	CU W02	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365496	CU W03	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365497	CU W04	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365498	CU W05	Flame	Wipe	****	0.108	111.52	ug/ft²		2000	ug/ft²	
0365499	CU Blank 02	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0365500	CU W06	Flame	Wipe	****	0.108	111.52	ug/ft²		3500	ug/ft²	
0365501	CU W07	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365502	CU W08	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365503	CU W09	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365504	CU W10	Flame	Wipe	****	0.108	111.52	ug/ft²		990	ug/ft²	
0365505	CU W11	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365506	CU W12	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365507	CU W13	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365508	CU W14	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	National Guard Bureau	**Job Name:**	Cumberland National Guard Armory	**Chain Of Custody:**	116955
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	08/28/2003
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Report Date:**	29-Aug-03

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analyst: Daniel P. Swanson **Technical Manager:** G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1929 of 5269

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
Commander, USACHPPM
5158 Blackhawk Road, Attn: MCHB-TS-OFS
APG, MD 21010-5403

Reference Data:	**Lead**
Client Sample No.:	CUAS01 through CUBlank02
P.O. No.:	Not Available
Sample Location:	Cumberland NG Armory
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-4146
DCL Sample ID No.:	03-25409 through 03-25414
Sample Receipt Date:	8/27/2003
Preparation Date:	08/27/03
Analysis Date:	08/27/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive

Analyst

Non-Responsive

Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m^3
CUAS01	03-25409	209.0	ND	<0.005
CUAS02	03-25410	221.1	ND	<0.005
CUAS03	03-25411	215.8	ND	<0.005
CUAS04	03-25412	233.2	ND	<0.004
CUBlank01	03-25413	0	ND	-
CUBlank02	03-25414	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		101.	
RPL			**1.**	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1931 of 5269

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

ANALYTICAL REQUEST FORM

☐ **REGULAR** Status (5 working days from receipt)

☑ **RUSH** Status Required - ADDITIONAL CHARGE
RESULTS REQUIRED BY 27 AUGUST 2003 (DATE)
CONTACT DATACHEM LABS PRIOR TO SENDING SAMPLES

Date _____ Purchase Order No. _____

Company Name _____

Address COMMANDER, USACHPPM
ATTN: MCHB-TS-OFS
5158 BLACKHAWK ROAD
APG, MD 21010-5403

City

Person to Contact [redacted]

Telephone (410) 436-5475

Fax Telephone (410) 436-5471

Billing Address (if different from above)

Quote No. _____

Sample Collection

Sampling Site Cumberland NG Armory

Industrial Process NGB Armory

Date of Collection 20 Aug 03

Time Collected _____

Date of Shipment _____

QC Requirements ☐ Standard ☐ Other _____

Collector's [redacted]

Signature [redacted]

REQUEST FOR ANALYSES 03-S-4146

Laboratory Use Only	Client Sample Number	Media Type*	Sample Volume (Liters)	ANALYSES REQUESTED - Use Method Number if Known
25409	CUAS01		209.0	LEAD NIOSH 7300
25410	CUAS02		221.1	LEAD NIOSH 7300
25411	CUAS03		215.8	LEAD NIOSH 7300
25412	CUAS04		233.2	LEAD NIOSH 7300
25413	CUBLANK01			
25414	CUBLANK02			

CHAIN OF CUSTODY

Re[redacted] (Si[redacted]	Date / Time 22 AUG 03	Received by: (Signature) [illegible]	Date / Time 8/27/03 10:10
Re[redacted] (Si[redacted]	Date / Time	Received by: (Signature)	Date / Time

4388 Glendale Milford Road / Cincinnati, OH 45242 • 800-458-1493 or 513-733-5336 / Fax: 513-733-5347

DISTRIBUTION: WHITE – LABORATORY COPY CANARY – CUSTOMER COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1933 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	National Guard Bureau	**Job Name:**	Cumberland National Guard Armory	**Chain Of Custody:**	116955
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	08/28/2003
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Report Date:**	28-Aug-03

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0365493	CU Blank 01	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0365494	CU W01	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365495	CU W02	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365496	CU W03	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365497	CU W04	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365498	CU W05	Flame	Wipe	****	0.108	111.52	ug/ft²		2000	ug/ft²	
0365499	CU Blank 02	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0365500	CU W06	Flame	Wipe	****	0.108	111.52	ug/ft²		3500	ug/ft²	
0365501	CU W07	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365502	CU W08	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365503	CU W09	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365504	CU W10	Flame	Wipe	****	0.108	111.52	ug/ft²		990	ug/ft²	
0365505	CU W11	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365506	CU W12	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365507	CU W13	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0365508	CU W14	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	

BEST AVAILABLE COPY

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1934 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	National Guard Bureau	**Job Name:**	Cumberland National Guard Armory	**Chain Of Custody:**	116955
Address:	301-lH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	08/28/2003
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Report Date:**	28-Aug-03
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Daniel P. Swanson

Analyst: Daniel P. Swanson **Technical Manager:** G Edward Carney

BEST AVAILABLE COPY

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
Commander, USACHPPM
5158 Blackhawk Road, Attn: MCHB-TS-OFS
APG, MD 21010-5403

Reference Data:	**Lead**
Client Sample No.:	CUAS01 through CUBlank02
P.O. No.:	Not Available
Sample Location:	Cumberland NG Armory
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-4146
DCL Sample ID No.:	03-25409 through 03-25414
Sample Receipt Date:	8/27/2003
Preparation Date:	08/27/03
Analysis Date:	08/27/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m³
CUAS01	03-25409	209.0	ND	<0.005
CUAS02	03-25410	221.1	ND	<0.005
CUAS03	03-25411	215.8	ND	<0.005
CUAS04	03-25412	233.2	ND	<0.004
CUBlank01	03-25413	0	ND	-
CUBlank02	03-25414	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		101.	
RPL			1.	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1936 of 5269

DATA CHEM LABORATORIES, INC.

ANALYTICAL REQUEST FORM

☐ REGULAR Status (5 working days from receipt)

☒ RUSH Status Required - ADDITIONAL CHARGE
RESULTS REQUIRED BY 27 AUGUST 2003
DATE
CONTACT DATACHEM LABS PRIOR TO SENDING SAMPLES

Date _____ Purchase Order No. _____

Company N[illegible]

Address _ COMMANDER, USACHPPM ATTN: MCHB-TS-OFS 5158 BLACKHAWK ROAD APG, MD 21010-5403

City _____ State _____ Zip _____

Person to Contact Non-Responsive [redacted]

Telephone (410) 436-5475

Fax Telephone (410) 436-5471

Billing Address (if different from above)

Quote No. _____

Sample Collection

Sampling Site Cumberland NG Armory

Industrial Process NGB ARMORY

Date of Collection 20 Aug 03

Time Collected _____

Date of Shipment _____

QC Requirements ☐ Standard ☐ Other _____

Collector's Non-Responsive [redacted]

Signature _____

REQUEST FOR ANALYSES 03-S-4146

03-

Laboratory Use Only	Client Sample Number	Media Type*	Sample Volume (Liters)	ANALYSES REQUESTED - Use Method Number if Known
25409	CUAS01		209.0	LEAD NIOSH 7300
25410	CUAS02		221.1	LEAD NIOSH 7300
25411	CUAS03		215.8	LEAD NIOSH 7300
25412	CUAS04		233.2	LEAD NIOSH 7300
25413	CUBLANK01			
25414	CUBLANK02			

CHAIN OF CUSTODY

Relinq[illegible] (Signa[illegible] Non-Responsive [redacted]	Date / Time 22 AUG 03	Received by: (Signature) [illegible]	Date / Time 8/27/03 10:10
Relinq[illegible] (Signature)	Date / Time	Received by: (Signature)	Date / Time

4388 Glendale Milford Road / Cincinnati, OH 45242 • 800-458-1493 or 513-733-5336 / Fax: 513-733-5347

DISTRIBUTION: WHITE – LABORATORY COPY CANARY – CUSTOMER COPY

BEST AVAILABLE COPY

APPENDIX E

REFERENCES

BEST AVAILABLE COPY

APPENDIX E

REGULATIONS AND STANDARDS

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current ed. http://www.osha.gov/comp-links.html.

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf.

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990. http://www.usapa.army.mil/pdffiles/r40_5.pdf.

4. AR 385-10, The Army Safety Program, 29 February 2000. http://www.usapa.army.mil/pdffiles/r385_10.pdf.

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p40_503.pdf.

6. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), American Conference of Governmental Industrial Hygienists (ACGIH), current ed.

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. RP-1-1993, Office Lighting, ANSI/ESNA.

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

CHAPTER 14: CLEANING

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1941 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20

VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21

VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1942 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1943 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.
17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.
18. Cleaning equipment list:
    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1944 of 5269

BEST AVAILABLE COPY

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1945 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1946 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1947 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1948 of 5269

BEST AVAILABLE COPY

1720 Walton Road Blue Bell, PA 19422 610-828-3078 Fax 610-828-7842

February 16, 2009

E-MAIL
Ms. [redacted]
Army National Guard
ATTN: NGB-ARS-IHNE
301-IH Old Bay Lane
Havre de Grace, MD 21078

Subject: Industrial Hygiene Assessment Report
Cumberland Readiness Center, Cumberland, Maryland 21502
IES Project No. EHS08794.02

Dear [redacted]

IES Engineers (IES) is pleased to enclose the final report of the Industrial Hygiene assessment conducted at the Army National Guard Readiness Center facility located in Cumberland, Maryland. Thank you for the opportunity to perform this assessment. Should you have any questions, please contact [redacted] or me.

Sincerely,

[redacted] /e/
[redacted], CIH
Senior Manager, Health, Safety
& Industrial Hygiene Services

cc: [redacted], IES

Posted to NGB FOIA Reading Room
May, 2016
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1949 of 5269

BEST AVAILABLE COPY

NATIONAL GUARD BUREAU
REGION NORTH INDUSTRIAL HYGIENE OFFICE
HAVRE DE GRACE, MARYLAND

FINAL
INDUSTRIAL HYGIENE ASSESSMENT
CUMBERLAND READINESS CENTER
1100 BROWN AVENUE, CUMBERLAND, MARYLAND, 21502
SURVEY DATE: JULY 24, 2008

IES PROJECT NO. EHS08794.02
REPORT DATE: FEBRUARY 16, 2009

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
1.1	Introduction	1
1.2	Facility Description	2
1.3	Key Findings and Conclusions	3
1.4	Recommendations	5
2.0	OPERATION DESCRIPTION & CONDITION	6
2.1	General Operations	6
2.2	Specific Site Survey & Conditions	6
3.0	SAMPLE RESULTS AND MEASUREMENTS	8
3.1	Indoor Air Quality	8
3.2	Lead Dust Sampling	10
3.3	Lead Paint Chip Sampling	11
3.4	Asbestos Bulk Sampling	12
3.5	Illuminance Survey	12
4.0	SAMPLING EQUIPMENT	13
5.0	REFERENCES	14

TABLES

Table 1 – Air Temperature, Relative Humidity, CO_2 and CO Measurements	9
Table 2 – Wipe Sampling Results Summary (Lead)	10
Table 3 – Paint Chip Sampling Results Summary (Lead)	11
Table 4 – Asbestos Bulk Sampling Results Summary	12
Table 5 – Illuminance Readings Summary	13
Table 6 – Sampling Equipment List	14

BEST AVAILABLE COPY

TABLE OF CONTENTS (Cont'd)

APPENDICES

Appendix A – Readiness Center Photographs

Appendix B – Indoor Air Quality Map

Appendix C – Laboratory Analysis Results

Appendix D – Illuminance Readings Map

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1952 of 5269

BEST AVAILABLE COPY

1.0 EXECUTIVE SUMMARY

1.1 Introduction

Assessment Date: July 24, 2008

Purpose: The National Guard Bureau (NGB) retained IES Engineers (IES) to assist in performing an Industrial Hygiene assessment at the Army National Guard (ARNG) Readiness Center (RC) located at 1100 Brown Avenue in Cumberland, Maryland (Captain Thomas Price Armory). The purpose of the Industrial Hygiene survey was to identify and measure the existence and extent of potentially hazardous operations or conditions at the ARNG Cumberland RC facility. Mr. [redacted], CIH, Senior Project Manager of IES, performed the assessment. Assessment activities were conducted with reference to the Statement of Work – Industrial Hygiene Services for National Guard Bureau Industrial Hygiene Region North Baseline Surveys for Readiness Centers and Administrative Buildings, May 2008, and included:

1) Dust sampling and analysis for lead surface contamination,
2) Air sampling and analysis for lead (to determine administrative personnel exposure to airborne lead),
3) Bulk sampling of suspected asbestos-containing building materials, or lead-containing paint (where advised),
4) Physical (visual) site inspection of all internal building areas to note condition of materials, particularly those suspected to be lead or asbestos-containing, as well as potential water-damaged materials, housekeeping conditions and related safety hazards, ergonomic considerations, and indicators of indoor air quality.
5) Measurements of relative humidity, carbon dioxide and temperature in occupied areas of each floor, as well as lighting supporting evaluation with respect to indoor environmental standards,
6) Visual inspection and/or measurement of ventilation systems within the readiness center (general and local exhaust), as pertinent, supporting evaluation of indoor air quality and maintenance procedures,
7) Evaluation of attached garages, within the scope of readiness center operations, with respect to visual examination, hazards present, and observation/documentation of controls utilized including administrative, personal protective equipment and ventilation controls, and associated impact upon readiness center operations.

Conferred With: SFC David Myers, Administrative Supervisor, Cumberland RC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #115-0085 (MD)
Released by National Guard Bureau
Page 1953 of 5269

1.2 Facility Description

The Cumberland RC is located at 1100 Brown Avenue, Cumberland, Maryland, and is primarily designed and operated as a 25,922 square foot training facility, which includes an upstairs section (19,162 square feet), basement (4,480 square feet), and basement garage (2,280 square feet). The Cumberland RC principally houses the 243rd Engineers Company, 729th Support Batallion. Readiness Center Operations provides training, training support and administrative support to the Army National Guard. Predominant construction features of the facility include interior and exterior block masonry walls on concrete slab with brick exterior cladding, and insulated metal pan roof structure. Interior finishes included 12 inch square (12” x 12”) floor tile, 9 inch square (9” x 9”) floor tile, or masonry tile floors, suspended fiber acoustic ceiling tile (2’x2’), and painted drywall partitions.

The RC includes: lobby, supply room and storage, men’s and women’s locker rooms, men’s and women’s restrooms, fitness center, kitchen, administrative office block, meeting room, computer learning center, distance learning center, platoon, NCO and old signal command offices. The basement floor includes: co-ed locker facility, restrooms, lounge area, recruiter office, Field Maintenance Support (FMS) offices, and separate attached garage facility (managed wholly by FMS unit), and boiler room/caretaker’s office-storage area.

The facility is heated, ventilated, and/or air-conditioned by varied systems. Air-conditioning is supplied through portable units positioned at windows. Separate localized exhaust ventilators are located in the drill room exterior walls. Gas-fired heating units serve the drill room. Each restroom and locker area is local-exhaust ventilated. A boiler/circulating hot water heating system is used for heating throughout most of the facility, whether via localized heaters/fan coil units, or wall mounted registers. Certain gas/oil-fired radiant heaters are located in the maintenance (garage) bays.

The facility is occupied by 12 full-time personnel. The full-time complement includes: two active guard reserve, two recruiters, and one administrative support. Three state workers include a full-time caretaker, part-time caretaker, and one person serving the computer lab. In addition, there are six personnel assigned to the FMS #9 unit. Normal scheduled work operations occur Tuesday through Friday, between the hours 0630 to 1700. Training at the facility occurs monthly on weekends. On the day of the IH assessment, the facility was fully occupied by assigned personnel.

<u>Field Maintenance Shop (FMS #9)</u>
A maintenance/garage section is incorporated into this facility, connected to the basement. The FMS #9 is a separately operated Unit, located at the Cumberland RC facility.

Please refer to Appendix A of this report for current photographs of facility areas/conditions. Refer to subsequent report sections 1.3 – Key Findings and Conclusions, and 2.0 – Operation Description and Condition for further information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #115-0085 (MD)
Released by National Guard Bureau
Page 1954 of 5269

1.3 Key Findings and Conclusions

Several key findings and conclusions were noted as follows:

HVAC/Ventilation-Related Service

- Men's Locker Room/Restroom exhaust fan system was not operational during the survey. A noticeable musty odor was present.
- An abandoned HVAC ventilation ductwork was found in the basement. However, RC personnel do not know the source of this duct, since there are no central HVAC currently operational.
- Women's Restroom exhaust fans were not operational during the survey.
- The boiler/hot water heating valve-distribution system is no longer functional. Localized temperature control is presently limited. Circulating water pumps are presently being re-built.
- The Cumberland RC recently purchased several "drainless" portable air-conditioning units. The units are installed in the room space with vents to outdoors. They reportedly operate without condensate drainage from cooling coils. These units should be carefully monitored, and the design process further reviewed to verify no unforeseen hazards may arise from operation.

Other Ventilation

- Kitchen vent hoods serving stove and automatic dishwashing equipment were found operational. The kitchen is not routinely operated. Some water leakage was noticed on the floor beneath a refrigerator.
- Retractable vehicle exhaust ventilation ducts and hoods are located in the long maintenance service (garage) bays, and were found operational.

Facility Condition

- New windows have been installed throughout the armory; windows may be opened for natural ventilation.
- The supply storage areas were found with materials stacked on floors in area, with some potential housekeeping/safety hazards.
- The boiler chemical treatment program was found managed by off-site personnel.
- The boiler room was found with some delaminating paint from floor and hot water system valves. All boiler breeching insulation appeared intact, and in good condition.
- Excessive items were found stored in the caretaker's office/storage area. A flammable storage cabinet was found blocked by boxes and articles.
- Nine inch square floor tile was found throughout the facility (estimated to cover approximately two-thirds of facility floors, except basement renovated areas, and drill hall). This floor tile type is commonly known to contain asbestos, and should be treated as presumed asbestos-containing material. Asbestos-containing floor tile should be managed according to an Operations and Maintenance Plan. Certain floor areas are reportedly cleaned with hot water but not waxed. This condition is not anticipated to properly protect the floor tile from degradation, or limit minor fiber release.
- Twelve inch square floor tile (in good condition) was found to replace 9 x 9 square inch floor tile in basement areas, reportedly renovated in conjunction with removal of the old firing range.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #115-0085 (MD)
Released by National Guard Bureau
Page 1955 of 5269

BEST AVAILABLE COPY

- Thermal system insulation was reportedly replaced with fiberglass insulation materials. Currently visible materials appear to be fiberglass, in good condition.
- Some minor paint delamination at kitchen and boiler room floors was observed.
- Ceiling plaster was found slightly delaminated at the Women's restroom (near supply storage), due to apparent water leak. The area was found dry, and has reportedly been repaired. The plaster was sampled and reported with "no asbestos detected".
- A kitchen fire extinguisher was found out of inspection (last inspected May 2007).

Sampling Results

- A ceiling plaster sample collected from damaged plaster (finish layer) in women's restroom and subsequently analyzed and reported with "no asbestos detected".
- Surface dust samples were collected throughout various locations of the facility, with certain surface dust concentrations found to exceed the 200 $\mu g/ft^2$ OSHA guideline for maintenance of surface cleanliness. The extent of the low level contamination should be further determined, followed by appropriate clean-up action, where necessary.
- Bulk paint samples were collected in the kitchen (floor paint), and boiler room (floor and valve paint). All samples were reported by the analyzing laboratory with lead content less than the lead-containing threshold (0.5%). Standard maintenance practices are advised.

Water Leaks

- No water leaks were evident during the survey, except for the ceiling leak previously noted in the women's restroom.

EH&S Compliance & Support

- Caretaker is required to order cleaning and chemical products through the Pikesville Armory, "Garage 13". Product delivery may not be timely, in limited quantities; therefore, localized purchasing may occur. Material safety data sheets are not secured during these purchases.
- Current, up-to-date MSDS were not found on-site for all chemical products in Caretaker's storage. Caretaker utilizes personal protection only to extent that such protection is voluntarily used (i.e. hearing protectors or glove protection may be used during chemical use, though no particular glove types were reported to be specified for certain jobs.
- Flammable and combustible storage cabinets were found in main garage bay. Flammable and combustible contents may be interchangeably stored in the respective cabinets.
- An outdoor portable truck wash/recycling system was observed on-site, in addition to other hazardous material storage (clean and separate waste oil, clean and waste anti-freeze, etc). System maintenance is managed by FMS 9 personnel, and is not monitored or used by readiness center personnel.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau
Page 1956 of 5269

Illuminance Levels

- The average illuminance levels in several areas throughout the facility were found less than the Army National Guard recommended values. Although the lower-than-recommended lighting levels found are not expected to present an imminent hazard, proper lighting levels promote safe work and may reduce ergonomic stressors.

1.4 Recommendations

IES' recommendations resulting from this assessment, including the determination of the Risk Assessment Code (RAC) for occupational exposures, are included in a separate document entitled, "Cumberland_RC_08_Recommendations."

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #115-0085 (MD)
Released by National Guard Bureau
Page 1957 of 5269

2.0 OPERATION DESCRIPTION & CONDITION

INSTALLATION: RC Army National Guard
BUILDING: 1100 Brown Avenue, Cumberland, Maryland, 21502
LOCATION: Facility-wide

2.1 General Description & Condition

OPERATION DESCRIPTION: On the day of the assessment, IES observed routine operations in progress. Unit operations at the Cumberland RC facility include:
1) 243rd Engineers Company (EC) – Routine operations include administration, planning, supply, training preparation and associated training support and recruiting. The 243rd EC operation does not utilize the garage/vehicle maintenance facilities at this site. These are managed and operated by FMS #9. The Caretaker provides minor maintenance and custodial support for this facility. This includes cleaning interior facilities, floors and windows, minor repairs, changing light bulbs, minor floor maintenance, and outdoor grounds-keeping.
2) Distance Learning Center – Support for professional training and troop development.
3) FMS# 9 – Provides vehicle maintenance support for the region.

NOTE: Survey assessment activities were focused primarily on Readiness Center operations. General information was collected for FMS 9 operations, since these operations are separately managed, and not part of Cumberland Readiness Center operations.

GENERAL FACILITY CONDITION: The general facility condition was found to be in fair to good condition, also reflecting the earlier construction for the facility.

2.2 Specific Site Survey & Conditions

The site survey was conducted by Mr. Non-Responsive, CIH, Senior Project Manager of IES, as coordinated by SFC Non-Responsive, of the Hagerstown RC.

CHEMICAL AND PHYSICAL AGENTS SAMPLED:
Air Sampling and Analysis of Lead – Air sampling and analysis of lead was not completed due to inavailability of sample media at time of sampling (i.e., sample media shipped from the laboratory did not arrive on the date requested). LTC Non-Responsive was notified on the survey date. LTC Non-Responsive indicated that sampling and analysis will be conducted by the NGB at a later upcoming scheduled date.

Surface Lead Wipe Sampling and Analysis – 19 surface wipe samples were collected throughout the facility, at specified or randomly selected areas. Certain surface dust sample results were reported with lead concentration exceeding the OSHA guideline of 200 micrograms per square foot ($\mu g/ft^2$) for lead surface contamination in the workplace. This level was established to support housekeeping cleanliness in facilities required to establish written OSHA lead compliance programs, and may also

be referenced as a threshold for general work area cleanliness. Horizontal surface dust sample results were found to exceed the 200 µg/ft^2 guideline for samples collected from the kitchen (heater vent fins), administrative office, library, supply storage room, men's locker room (exhaust vent surfaces), and stairwell near basement Maintenance office. Surface dust contamination at these locations was found to range between 210 – 530 µg/ft^2. These findings may reflect salient conditions; however, further surface dust sampling and analysis is advised, and follow-up cleaning as necessary. Surface cleaning should be conducted using wet-wiping and/or HEPA cleaning methods.

Bulk Sample Analysis (Lead Paint) – Facility paint was generally found in good condition. Bulk samples (paint chips) were collected from boiler room floor, and a boiler system valve for subsequent lead analysis. Sample results were reported as 0.079% lead (floor), and 0.02% (valve), and both samples indicate lead content less than 0.5% by weight, the criteria used to define "lead-based paint" by USEPA regulation.

Bulk Sample Analysis (Asbestos) – A ceiling plaster sample was collected from the women's restroom, in proximity to plaster damage due to a water leak. The sample was subsequently analyzed for asbestos content with reported results of "No Asbestos Detected."

Indoor Air Quality Measurement – General IAQ measurements (relative humidity, carbon dioxide, carbon monoxide and temperature) were made throughout the RC facility at 19 point locations, including maintenance/garage areas, supporting indoor air quality assessment.

Refer to report sections 1.3 – Key Findings and Conclusions, and 3.0 – Sample Results and Measurements for details, and to the document entitled: "Cumberland_RC_08_Recommendations" for further action.

VENTILATION/ HEATING, VENTILATING & AIR-CONDITIONING (HVAC) SYSTEMS: Ventilating systems were found as follows:

- Within the men's locker, and women's restroom, exhaust ventilation was found non-operational.
- The fitness center was found without mechanical exhaust ventilation.
- Several office areas were found with portable air-conditioning units, ducted to outdoors through modified window manifold (DeLonghi Pinquino - 11,000 BTU).
- The kitchen is equipped with an outdoor, ambient make-up air vent, to permit make-up air introduction when the kitchen door is closed. This duct system was found open and operational. The kitchen stove and dishwasher are local exhaust-ventilated to outdoors, and were found operational, with significantly noticeable airflow.
- The Caretaker, nor others at the facility have periodic HVAC inspection/service responsibility, and could not provide service records for review. No annual HVAC service records were available on-site, and the HVAC servicer, assigned at Pikesville Unit "Garage 13" is not readily accessible.

Posted to NGB FOIA Reading Room
BEST AVAILABLE COPY
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau
Page 1959 of 5269

LIGHTING: The average luminance levels were collected throughout the facility, with certain locations found with illuminance levels less than ARNG recommended standards.

WATER DAMAGE: The facility was principally free of visible water damage. Water damage was evident in the women's restroom (near supply storage). The area was found dry, and has reportedly been repaired.

HOUSEKEEPING: In general housekeeping was found acceptable at the facility; however, the supply room/storage areas, and caretaker's storage area were found with considerable floor-stacked items. A flammable storage cabinet located in the caretaker's storage was blocked by stored articles. Excess stored materials should be removed from passageways to alleviate slip/trip/fall hazards, and to reduce potential fire hazards.

ERGONOMICS: No inherent ergonomic hazards were noted during the survey.

FMS 9/ATTACHED GARAGE: A detailed review of this operation was not completed, since this operation is not part of routine readiness center operations. The FMS 9 reportedly receives several periodic inspections and audits during the year by regulatory and other internal environmental, health and safety organizations.

A copy of IES' field notes from this assessment is included in a separate document entitled, "Cumberland_RC_08_Field_Notes." Please also refer to the determination of the Risk Assessment Code (RAC) for occupational exposures, included in the separate document entitled, "Cumberland_RC_08_Recommendations."

3.0 SAMPLE RESULTS AND MEASUREMENTS

3.1 Indoor Air Quality

Measurements of air temperature, relative humidity, carbon dioxide (CO_2), and carbon monoxide (CO) concentrations were collected using a calibrated direct reading hand-held TSI Q-Trak indoor air quality monitoring instrument. Sample results for CO were compared with the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Values (TLVs) for exposure assessment purposes. TLVs are established through a peer review process, and are published annually in ACGIH's *TLVs and BEIs* booklet. The TLV's represent airborne exposure concentrations and conditions under which it is believed that nearly all workers may be repeatedly exposed day after day without adverse health effects. Due to wide variations in individual susceptibility, a small percentage of workers may experience discomfort or be affected by certain substances at concentrations below the recommended threshold limit.[1]

Posted to NGB FOIA Reading Room
BEST AVAILABLE COPY
FOIA Requested Record #115-0085 (MD)
Released by National Guard Bureau
Page 1960 of 5269

BEST AVAILABLE COPY

Generally, measured levels of carbon dioxide (CO_2), carbon monoxide (CO), relative humidity (%RH), and temperature (F), were found within guidelines established by the American Society of Heating, Refrigerating and Air-Conditioning Engineers, throughout building locations surveyed.

Refer to Table 1 – Air Temperature, Relative Humidity, CO_2 and CO Measurements for details of measured air temperature, relative humidity, CO_2, and CO collected throughout the building during the assessment.

Refer to Appendix B - Indoor Air Quality Sample Location Map detailing the IAQ measurement locations throughout the facility.

TABLE 1
AIR TEMPERATURE, RELATIVE HUMIDITY, CO_2, AND CO MEASUREMENTS

Location: Cumberland National Guard RC, Cumberland, Maryland
Date: July 24, 2008

Sample Location ID	Sample Location/Description	Nearest Sample Time	CO_2* (ppm)	CO (ppm)	Temperature (°F)	Relative Humidity (%RH)
Q1	Main Office	09:10	456	1.1	52	78
Q2	Library	09:15	467	1.9	54	79
Q3	Commanding Officer (office)	09:15	426	1.0	55	79
Q4	Lobby	09:40	520	1.3	55	78
Q5	Supply Room Storage	09:45	436	1.0	57	80
Q6	Supply Room (Large)	09:50	431	1.4	49	79
Q7	Men's Locker	10:00	428	--	52	79
Q8	Fitness Center	10:05	399	1.6	50	80
Q9	Kitchen	10:15	421	1.4	47	82
Q10	Drill Hall	10:40	409	1.0	51	80
Q11	Platoon Seargent Office	10:45	413	1.3	48	81
Q12	Distance Learning Center	11:00	429	1.1	48	81
Q13	Computer Learning Center	11:10	413	1.5	41	78
Q14	Meeting Room	11:20	400	1.0	45	80
Q15	Co-Ed Locker Room	11:40	414	1.2	51	77
Q16	Basement Lounge	12:00	636	1.0	45	73
Q17	Boiler Room	12:15	424	1.4	46	81
Q18	Maintenance Bay, long	12:30	360	1.0	48	76
Q19	Outdoors, parking lot	12:35	360	1.0	48	81

* CO_2 levels exceeding 700 ppm indicate occupancy. Higher levels identified may indicate inadequate air exchange.
** %RH levels > 60% may contribute to bioaerosol growth.

TABLE FOOTNOTES

Measurement device: All measurements collected in real-time using a TSI Q-Trak indoor air quality monitor, at approximately 4 feet above ground/floor height.

ppm Parts of contaminant per million parts of air. All CO_2 and CO concentrations expressed in ppm.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record # L-15-0085 (MD)
Released by National Guard Bureau
Page 1961 of 5269

BEST AVAILABLE COPY

Exposure Guidelines

CO_2	Indoor CO_2 concentrations should be maintained at less than 700 ppm above outdoor air levels – (ASHRAE 62.1-2007)[2]
CO	50 ppm (OSHA PEL-TWA); 25 ppm (ACGIH TLV-TWA)
Temperature	68 ºF to 79 ºF (ASHRAE 55-2004)[3]
Relative Humidity (%RH)	30% to 60% (ASHRAE 55-2004)[3]

3.2 Lead Dust Sampling

IES performed wipe sampling throughout facility areas of the RC and FMS 9, at specified and other selected locations. All wipe sampling was conducted according to best practices and guidelines published in Section II: Chapter 2, Sampling for Surface Contamination, of the OSHA Technical Manual. Wipe samples were collected over 100 cm^2 areas using pre-packaged, pre-wetted Ghost Wipes (Environmental Express). Surface dust samples were subsequently packaged and shipped to AMA Analytical Services of Lanham, Maryland for lead analysis according to Method EPA600/R-93/(200M)-7421. AMA maintains accreditation with the American Industrial Hygiene Association, and with the National Voluntary Laboratory Accreditation Program.

All wipe sample results were reported in micrograms of lead per square foot of surface sampled ($\mu g/ft^2$) for the purposes of this assessment, and for subsequent comparison with OSHA guideline criteria of 200 $\mu g/ft^2$.

A summary of analysis results are presented in Table 2 – Wipe Sampling Results Summary (Lead). Refer to Appendix C for the complete laboratory analysis results.

TABLE 2
WIPE SAMPLING RESULTS SUMMARY (LEAD)

Location: Cumberland National Guard RC, Cumberland, Maryland
Date: July 24, 2008

Sample ID	Location	Surface Area Sampled	Lead Surface Concentration ($\mu g/ft^2$)
CW-01	Basement, Co-Ed Locker, top of cabinets, horizontal surface composite (HSC)	100 cm^2	< 110
CW-02	Basement, Lounge, HSC	100 cm^2	< 110
CW-06	Kitchen, top of old refrigerator	100 cm^2	110
CW-07	Kitchen, heater vent fins	100 cm^2	480
CW-08	Kitchen, make-up air vent to outdoors	100 cm^2	< 110
CW-09	Drill Room/Assembly Hall, top of exit light	100 cm^2	< 110
CW-10	Platoon Sergeant Office, HSC	100 cm^2	< 110
CW-11	Distance Learning Office, HSC	100 cm^2	< 110
CW-12	Computer Learning Laboratory, HSC	100 cm^2	< 110
CW-13	Library (near Administrative Office), HSC	100 cm^2	530
CW-14	Administrative Office, HSC	100 cm^2	420

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record # L-15-0085 (MD)
Released by National Guard Bureau
Page 1962 of 5269

BEST AVAILABLE COPY

Sample ID	Location	Surface Area Sampled	Lead Surface Concentration ($\mu g/ft^2$)
CW-15	NE Stairwell, wall @ stair ledge, HSC	100 cm^2	< 110
CW-16	Women's Restroom, top of door	100 cm^2	160
CW-17	Supply Storage Room, HSC	100 cm^2	210
CW-18	Men's Locker Room, exhaust vent surfaces, HSC	100 cm^2	420
CW-19	Fitness Center, top of electric conduit near ceiling	100 cm^2	140
CW-20	Basement, Maintenance Bay, HSC	100 cm^2	< 110
CW-21	Basement, Stairwell near Maintenance Office, wall @ stair ledge, HSC	100 cm^2	280

TABLE FOOTNOTES

Collection procedure: Wipe sample collected with nitrile glove donned on hand, using 'Ghost Wipe' towlette, by sequential wipe using template or best estimate of 100 cm2 area; multiple passes with clean surface of wipe and subsequent folding, and placement to a labeled, sealed plastic vial or bag.

µg/ft2: Micrograms lead per square foot. Note: laboratory converts result from $\mu g/100\ cm^2$ to $\mu g/ft^2$, prior to reporting.

< 1% Pb Less than 1% lead detected in sample results.

OSHA guideline standard for surface contamination by lead The USDOL/OSHA does not have a promulgated standard for lead surface contamination; however, OSHA has provided an interpretive level of 200 $\mu g/ft^2$ to assess the housekeeping requirement of "as free as reasonably practicable". This interpretation is presented in OSHA Industrial Hygiene Technical Manual (TED 01-00-0150; 1/20/1999), and in a letter of interpretation dated 01/13/2003, and subsequently issued into public domain.

3.3 Lead Paint Chip Sampling

IES observed certain deteriorating paint surfaces within the facility. Two paint chip samples were subsequently collected and shipped for analysis by AMA Analytical Services of Lanham, Maryland. Samples were analyzed for lead content according to the USEPA Method EPA600/R-93/(200M)-7421. All sample results were reported as percent lead for purposes of this assessment. According to the method, lead-based paint is defined as containing lead equal to or exceeding 1 milligram per square centimeter (mg/cm^2) or containing 0.5% by weight.

A summary of results are presented in Table 3 – Paint Chip Sampling Summary below. Refer to Appendix C for the complete laboratory analysis results.

TABLE 3
PAINT CHIP SAMPLING RESULTS SUMMARY (LEAD)

Location: Cumberland National Guard RC, Cumberland, Maryland
Date: July 24, 2008

Sample Number	Sample Location	Paint characteristic	Result (% Pb)
CW-04	Basement, Boiler Room, floor paint	Grey-Blue Paint	0.079
CW-05	Basement, Boiler Room, circulating water valve	White Paint	0.02

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record # L-15-0085 (MD)
Released by National Guard Bureau
Page 1963 of 5269

ENGINEERS

3.4 Asbestos Bulk Sampling

Ceiling plaster collected from the Women's restroom ceiling was submitted for analysis by AMA Analytical Services, a laboratory participating in the National Voluntary Laboratory Accreditation Program. Sample analysis was performed by polarized light microscopy according to USEPA method EPA/600R-93/116, with results reported as "No Asbestos Detected". Further sampling may be advised wherever major renovation or repair is completed, since plaster composition may vary depending on batch materials used.

A summary of analysis results are presented in Table 4 – Asbestos Bulk Sampling Results Summary. Refer to Appendix C for the complete laboratory analysis results.

TABLE 4
ASBESTOS BULK SAMPLING RESULTS SUMMARY

Location: Cumberland National Guard RC, Cumberland, Maryland
Date: July 24, 2008

Sample Number	Sample Location	Sample characteristic	Result (% Asbestos)
CW-22	Women's Restroom, plaster ceiling material, finish coat	Plaster layer	NAD *

* "NAD" No asbestos detected via polarized light microscopy – Analysis Method EPQ/600/R-93/116 dated Jul 1993.

3.5 Illuminance Survey

The illumination survey was performed pursuant to best Industrial Hygiene practices and the guidelines found in the ARNG document entitled, "Evaluation of Lighting Standing Operating Procedure (SOP) and Illumination Requirements for Existing Facilities," dated November 17, 2007.[4] All measurements were made in slow response mode and were expressed in foot candles (fc). The measurements were used to calculate average illuminance levels for each workspace.

Based on the activities conducted in each workspace, the calculated average illuminance level was compared to the ARNG recommended illuminance values.

A table of illuminance measurements is presented in Table 5 – Illuminance Readings Summary. The data reported in this table represent the average illuminance readings from the accessible locations of the commonly occupied work areas of the facility.

Refer to Appendix D – Illuminance Readings Map for sample locations.

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record # L-15-0085 (MD)
Released by National Guard Bureau
Page 1964 of 5269

BEST AVAILABLE COPY

ENGINEERS

TABLE 5
ILLUMINANCE READINGS SUMMARY

Location: Cumberland National Guard RC, Cumberland, Maryland
Date: July 24, 2008

Sample ID	Sample Description	Average Illuminance Measurements (fc)	ARNG Recommended Illuminance Value (fc)
I1	Main Office, table height (TH)	29	30-50
I2	NCO (Commanding Officer) Office	28	30-50
I3	Orderly Room	50	30-50
I4	First Sergeant's Office	56	30-50
I5	Retention NCO	46	30-50
I6	Lobby	4	10
I7	Supply Room Storage	23	30
I8	Large Supply Room	8	10
I9	Men's Locker	13	7
I10	Fitness Center	23	30
I11	Kitchen	26	50
I12	Drill Hall	20	10
I13	Platoon Sergeant's Office	20	30-50
I14	Distance Learning Center	27	30-50
I15	Computer Learning Center	28	30-50
I16	Meeting Room	17	30-50
I17	Copy Room	10	10
I18	Basement, Co-Ed Locker Room (drill weekends)	21	7
I19	Basement, Lounge	14	10
I20	Basement, Boiler Room	6	30
I21	Garage, Maintenance Bays	52	50

NOTES:
All illuminance measurements and recommended values are expressed in foot candles (fc), and were collected from approximate table height.

4.0 SAMPLING EQUIPMENT

Table 6 lists the sampling equipment that was used as a part of the assessment.

BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record # L-15-0085 (MD)
Released by National Guard Bureau
Page 1965 of 5269

BEST AVAILABLE COPY

TABLE 6
SAMPLING EQUIPMENT LIST

Equipment Type	Make/Model	Equipment/Serial Number	Equipment Identification
Light Meter	International Light, IL1400A, illum. probe	3206/1782	R2373/3691
Indoor Air Quality Monitor	TSI Model 8554 Q-Trak	02071015	R10120

5.0 REFERENCES

1. ACGIH, *2008 TLVs and BEIs*.
2. American Society of Heating, Refrigeration, and Air Conditioning Engineers (ASHRAE), Standard 62-2007, "Ventilation for Acceptable Indoor Air Quality," ASHRAE, Atlanta, Georgia, 2004.
3. American Society of Heating, Refrigeration, and Air Conditioning Engineers (ASHRAE), Standard 55-2004, "Thermal Environmental Conditions for Human Occupancy," ASHRAE, Atlanta, Georgia, 2004.
4. "Evaluation of Lighting Standing Operating Procedure (SOP) and Illumination Requirements for Existing Facilities," ARNG, 17 November 2007.
5. Occupational Safety and Health Administration, 29 CFR 1910.1025, Lead.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record # L-15-0085 (MD)
Released by National Guard Bureau
Page 1966 of 5269

BEST AVAILABLE COPY

APPENDIX A

READINESS CENTER PHOTOGRAPHS

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau
Page 1967 of 5269

Photograph #1 – RC Lobby/Entry Area, view from entrance

Photograph #2 – Drill Hall, general view

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau

Photograph #3 – Drill Hall, wall-mounted ventilation exhaust

Photograph #4 – Women's Restroom, water-damaged ceiling plaster

Photograph #5 – Supply Room Office/Storage, material stacked in space

Photograph #6 – Men's Locker Room, non-functional exhaust (lead sample collected at vent)

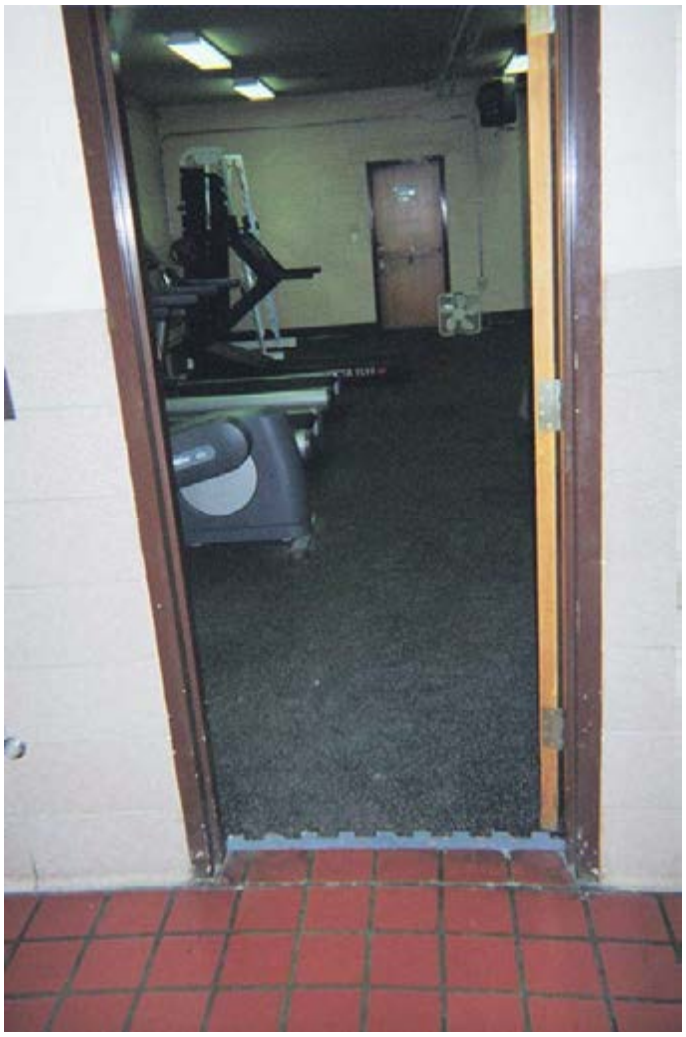

Photograph #7 – Fitness Center, rubber mat over 12 x 12 tile

Photography #8 – Fitness Center, natural ventilation via open windows

Photograph #9 – Kitchen, outdoor/make-up air duct/vent

Photograph #10 – Distance Learning Center office, portable “drainless” air-conditioner, (vent intake and exhaust to outdoors)

Photograph #11 – Computer Lab/Learning center

Main Floor, Administrative Office, nine inch square floor tile

Photograph #12 – Basement, Unknown HVAC/ventilation duct

Basement, Recruiter's Office

Basement, Lounge, view of window-mounted air-conditioner

Main Floor, Old Signal Command Office, view of 9 inch square floor tile (presumed asbestos-containing)

Basement, FMS Unit Office, nine inch square floor tile maintained in good condition.

Basement, Boiler Room, delaminating paint from valves

Basement, Caretaker's Office/Storage (old coal room), storage conditions

Basement, FMS 9 Garage, view of vehicle exhaust vent system

Basement, FMS 9, Flammable and Combustible storage cabinets

Basement, FMS 9 Office, written programs applicable to FMS 9

BEST AVAILABLE COPY

APPENDIX B

INDOOR AIR QUALITY MAP

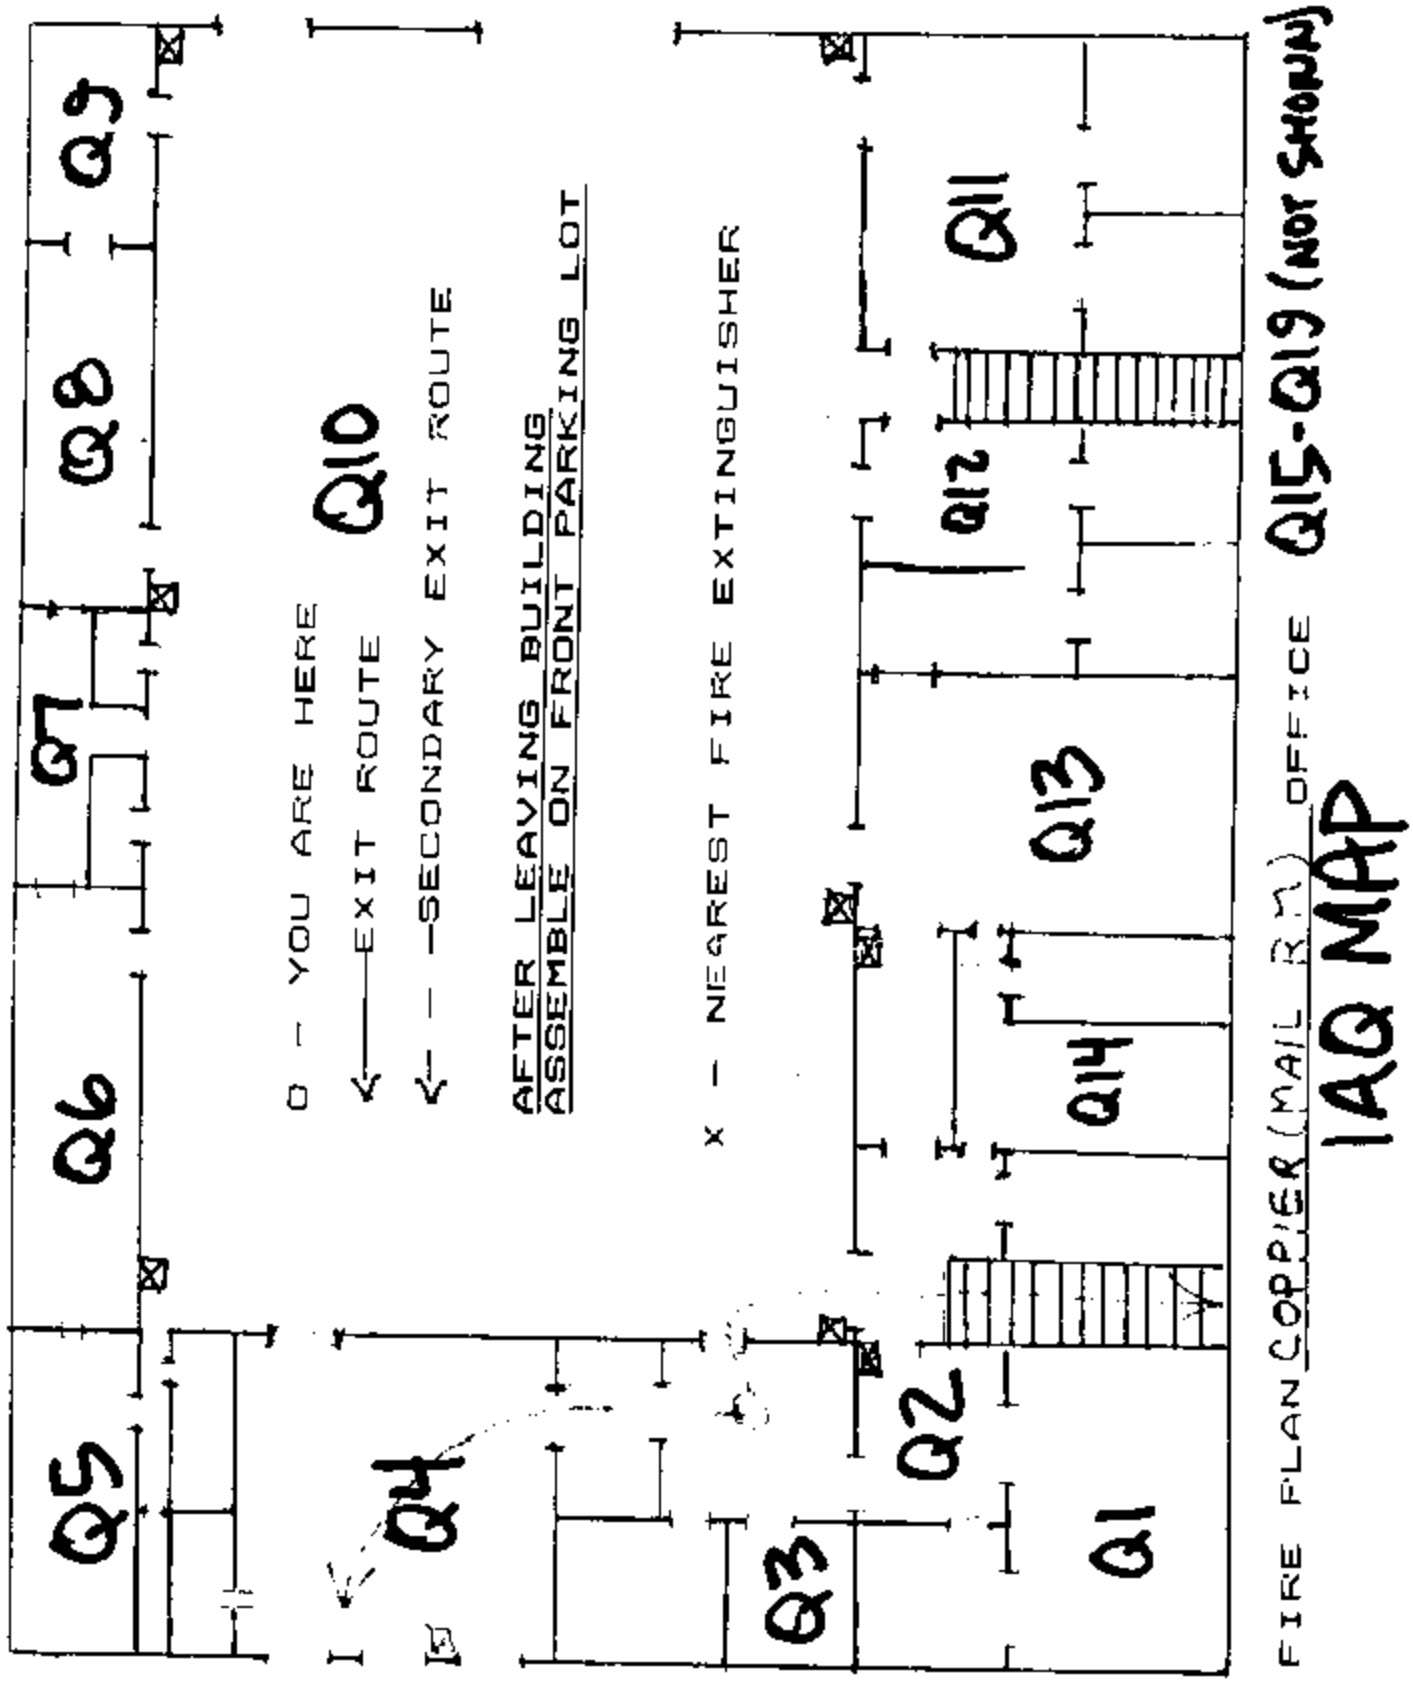
Q9
Q8
Q7
Q6
Q5
Q4
Q3
Q2
Q1
Q10
Q11
Q12
Q13
Q14
Q15-Q19 (NOT SHOWN)
O - YOU ARE HERE
EXIT ROUTE
- SECONDARY EXIT ROUTE
AFTER LEAVING BUILDING
ASSEMBLE ON FRONT PARKING LOT
X - NEAREST FIRE EXTINGUISHER
FIRE PLAN COPIER (MAIL RM) OFFICE
IAQ MAP

BEST AVAILABLE COPY

APPENDIX C

LABORATORY ANALYSIS RESULTS

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1984 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihalap.org for details

100470

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	National Guard Bureau	**Chain Of Custody:**	502993		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	7/28/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	EHS08794.02	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	8/1/2008	**Report Date:**	8/1/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0873108	CW-01	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873109	CW-02	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873110	CW-04	Flame	Paint Chip	****	N/A	0.01	%Pb		0.079	%Pb	
0873111	CW-05	Flame	Paint Chip	****	N/A	0.01	%Pb		0.02	%Pb	
0873112	CW-06	Flame	Wipe	****	0.108	111.52	ug/ft²		110	ug/ft²	
0873113	CW-07	Flame	Wipe	****	0.108	111.52	ug/ft²		480	ug/ft²	
0873114	CW-08	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873115	CW-09	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873116	CW-10	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873117	CW-11	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873118	CW-12	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873119	CW-13	Flame	Wipe	****	0.108	111.52	ug/ft²		530	ug/ft²	
0873120	CW-14	Flame	Wipe	****	0.108	111.52	ug/ft²		420	ug/ft²	
0873121	CW-15	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0873122	CW-16	Flame	Wipe	****	0.108	111.52	ug/ft²		160	ug/ft²	
0873123	CW-17	Flame	Wipe	****	0.108	111.52	ug/ft²		210	ug/ft²	
0873124	CW-18	Flame	Wipe	****	0.108	111.52	ug/ft²		420	ug/ft²	
0873125	CW-19	Flame	Wipe	****	0.108	111.52	ug/ft²		140	ug/ft²	
0873126	CW-20	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client:	National Guard Bureau	**Job Name:**	National Guard Bureau	**Chain Of Custody:**	502993
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	7/28/2008
	Havre de Grace, Maryland 21078	**Job Number:**	EHS08794.02	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	8/1/2008
				Report Date:	8/1/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments
0873127	CW-21	Flame	Wipe	****	0.108	111.52 ug/ft²	280 ug/ft²	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1985 of 5269

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1986 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) **502993**

BILL THE NATIONAL GUARD BUREAU REGION NORTH II OFFICE DIRECTLY. 1/2

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location:
3. Job #: EHS 08794.02. P.O. #:
4. Contact Pers[redacted] Phone # 610 828-3578
5. Submitted by [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day +	☐ Email: @
Comments:	☐ 2 Day Date Due: 8/4/08	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)
		☐ Fax:
		☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☒ EPA 600 – Visual Estimate CW-22 (QTY)
☒ EPA Point Count CW-22 (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Gray. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis CW-04, CW-05
☒ Paint Chip ____ (QTY)
☒ Dust Wipe (wipe type: ____) ____ (QTY)
☐ Air ____ (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe (Surface/wipe type ____) ____ (QTY)

Mold – Direct Microscopic Analysis
☐ Spore Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	WORK PLACE	TAPE	SWAB
CW-01	COED LR TL	7/24/08	–	100 cm²				✓								
~~CW-02~~	BASE LWG HS							✓								
~~CW-03~~																
CW-04	BR Floor			BULK				✓			✓					
CW-05	BR Valve			BULK				✓			✓					
CW-06	K ORT							✓								
CW-07	K Heater							✓								
CW-08	K MAV							✓								
CW-09	DR Break Area							✓								
CW-10	PSO HSC							✓								
CW-11	DLO HSC							✓								

THO

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 8/1/08 @ 1030 Via: FedEx By (Print): M. Sampson Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

LAB CONTACT: ERIN K. MEARA/AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1987 of 5269

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number for Inquiries) S02993 2/2

BILL THE NATIONAL GUARD BUREAU REGION NORTH IN OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location: CUMBERLAND ARMORY
3. Job #: EHS 08794.07 P.O. #
4. Contact Pers[redacted] w/ phone # 610 828-3078
5. Submitted by[redacted]

Reporting Information (Results will be provided as soon as technically feasible): [redacted]

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
❑ Immediate Date Due: ❑ 24 Hours Time Due: Comments:	❑ Immediate ❑ 3 Day ❑ Next Day ❑ 5 Day ❑ 2 Day Date Due: ❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	❑ Include COC/Field Data Sheets with Report ❑ Email: @ ❑ Fax: ❑ Verbals:

Asbestos Analysis
PCM Air Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)
TEM Air - Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
PLM Bulk
☑ EPA 600 - Visual Estimate ____ (QTY)
☑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)
TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

❑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
❑ Paint Chip ____ (QTY)
☑ Dust Wipe (wipe type: GAV, Exp. Ghost Wipe) (QTY) 1000 cm²
❑ Air ____ (QTY)
❑ Soil/Solid ____ (QTY)
❑ TCLP ____ (QTY)
❑ Drinking Water ____ (QTY)
❑ Waste Water ____ (QTY)
❑ Dust Wipe (wipe type: ____) ____ (QTY)

Mold - Direct Microscopic Analysis
❑ Spore Trap ____ (QTY) ❑ Bulk ____ (QTY)
❑ Surface Swab ____ (QTY) ❑ Surface Vacuum Dust ____ (QTY)
❑ Surface Tape ____ (QTY) ❑ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SOIL	TAPE	SWAB
CW-12	CL HSC	7/24/08	—	1000 cm²				✓								
CW-13	AO HSC							✓								
CW-14	LIBRARY HSC							✓								
CW-15	NE STAIR HSC							✓								
CW-16	Women's RR TD							✓								
CW-17	Supply Store HSC							✓								
CW-18	Mon's Locker EV							✓								
CW-19	FC EC/H HSC							✓								
CW-20	Maint Unit HSC							✓								
CW-21	FM9 Stair HSC							✓								
CW-22	Women's RR CP			BULK ASBESTOS			✓				✓					

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

LAB CONTACT: ERIN K. MEARA/AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1988 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP 101143-0

Client:	National Guard Bureau	**Job Name:**	National Guard Bureau	**Chain Of Custody:**	502993
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	8/1/2008
	Havre de Grace, Maryland 21078	**Job Number:**	EHS08794.02	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided		

Attention: [redacted]

Summary of Polarized Light Microscopy

AMA Sample Number	Client Sample #	Total Asbestos	Chrysotile Percent	Amosite Percent	Crocidolite Percent	Other Asbestos Percent	Mineral Wool Percent	Fiberglass Percent	Organic Percent	Synthetic Percent	Other Percent	Particulate Percent	Sample Color	Homogeneity	Analyst ID	Comments
0873128	CW-22	NAD	--	--	--	--	--	--	--	--	--	100	White	Homogeneous	LBP	

The following footnotes only apply to those samples which the total asbestos result is flagged with a note number.

1 TEM RECOMMENDATION - Please note, due to resolution limitations with optical microscopy and/or interference from matrix components of this sample, results which are reported via PLM as negative or trace (<1%) for asbestos may contain a significant quantity of asbestos. It is recommended that the additional analytical technique of TEM be used to check for asbestos fibers below the resolution limits of optical microscopy.

2 MATRIX REDUCTION RECOMMENDATION - Please note, due to interference from the matrix components of this sample, results which are reported via PLM as negative or trace (<1%) for asbestos may contain a significant quantity of asbestos which is obscured from view. It is recommended that the additional preparation technique of gravimetric reduction be performed on this sample to minimize the obscuring effects of matrix components, followed by reanalysis by PLM and/or TEM.

Analysis Method - EPA/600/R-93/116 dated July 1993

NAD = "No Asbestos Detected" TR = "Trace equals less than 1% of this component"

Uncertainty: For samples containing asbestos in range of 1-10% the CV is 0.43, 11-35% CV=0.55, >35 CV=0.23

Lom Butruk

Lom Butruk

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1989 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) **502993**

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY. 1/2

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: _____ Fax #: _____

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location:
3. Job #: [redacted] P.O. #:
4. Contact Perso[redacted] @ phone # 610 828-3078
5. Submitted by: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day +	
Comments:	☐ 2 Day Date Due: 8/4/08	

☐ Include COC/Field Data Sheets with Report
☐ Email: @
☐ Fax:
☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ___ in a 25mm 37mm
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ___ in a 25mm 37mm
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)
PLM Bulk
☒ EPA 600 – Visual Estimate CW-22 (QTY)
☒ EPA Point Count CW-22 (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D5755-95 (QTY)
☐ Quan. (s/area)Dust D6480-99 (QTY)
TEM Water
☐ Qual. (pres/abs) (QTY)
☐ ELAP 198.2/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples "C")

Lead Analysis CW-04, CW-05
☒ Paint Chip (QTY)
☒ Dust Wipe (wipe type) (QTY)
☐ Air (QTY)
☐ Soil/Solid (QTY)
☐ TCLP (QTY)
☐ Drinking Water (QTY)
☐ Waste Water (QTY)
☐ Dust Wipe Furnace (wipe type) (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap (QTY) ☐ Bulk (QTY)
☐ Surface Swab (QTY) ☐ Surface Vacuum Dust (QTY)
☐ Surface Tape (QTY) ☐ Other (Specify) (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND SOIL/SOLID	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
CW-01	COED LR TL	7/21/08	–	100cm²				✓									Date/Time: Contact: By:
CW-02	BASE LNG HS							✓									
~~CW-03~~								~~✓~~									
CW-04	BR Floor			BULK				✓			✓						
CW-05	BR Valve			BULK				✓			✓						Date/Time: Contact: By:
CW-06	K ORT							✓									
CW-07	K Heater							✓									
CW-08	K MAV							✓									
CW-09	DR Break Area							✓									Date/Time: Contact: By:
CW-10	PSO HSC							✓									
CW-11	DLO HSC							✓									

THD

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 8/7/08 @ 1030 Via: FedEx By (Print): M. Sampson Sign: MS
2. Date/Time Analyzed: 8 / 4 / 08 @ 1620 By (Print): LOM BUTRUK Sign: Lom Butruk
3. Results Reported To: T. H. Derr Via: Date: 8 / 4 / 08 Time: Initials: LRP
4. Comments:

LAB CONTACT: ERIN K. MEARA/AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1990 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 502993 2/2

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location: CUMBERLAND ARMORY
3. Job #: EHS 08794.02 P.O. #:
4. Contact Perso[redacted] @ phone # 610 828-3078
5. Submitted by: [redacted]

Reporting Information (Results will be provided as soon as technically feasible): [redacted]

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
❑ Immediate Date Due:	❑ Immediate ❑ 3 Day	❑ Include COC/Field Data Sheets with Report
❑ 24 Hours Time Due:	❑ Next Day ❑ 5 Day 4	❑ Email: @
Comments:	❑ 2 Day Date Due:	❑ Fax:
	❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	❑ Verbals:

Asbestos Analysis
PCM Air - Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)
TEM Air - Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
PLM Bulk
☑ EPA 600 - Visual Estimate ____ (QTY)
☑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)
TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

❑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
❑ Paint Chip ____ (QTY)
☑ Dust Wipe (wipe type GW. Exp. Ghost Wipe) (QTY) 100cm²
❑ Air ____ (QTY)
❑ Soil/Solid ____ (QTY)
❑ TCLP ____ (QTY)
❑ Drinking Water ____ (QTY)
❑ Waste Water ____ (QTY)
☑ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
❑ Spore-Trap ____ (QTY) ❑ Bulk ____ (QTY)
❑ Surface Swab ____ (QTY) ❑ Surface Vacuum Dust ____ (QTY)
❑ Surface Tape ____ (QTY) ❑ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
CW-12	CL HSC	7/01/08	—	100cm²				✓									Date/Time: Contact: By:
CW-13	AO HSC							✓									
CW-14	LIBRARY HSC							✓									
CW-15	NE STAIR HSC							✓									
CW-16	Women's RR TD							✓									Date/Time: Contact: By:
CW-17	Supply Store HSC							✓									
CW-18	Men's Locker EV							✓									
CW-19	FC EC/H HSC							✓									
CW-20	Maint Unit HSC							✓									Date/Time: Contact: By:
CW-21	FM9 SW/ HSC							✓									
CW-22	Women RR EP			BULK ASBESTOS			✓				✓						

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print) ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments

LAB CONTACT: ERIN K. MEARA/AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

APPENDIX D

ILLUMINANCE READINGS MAP

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

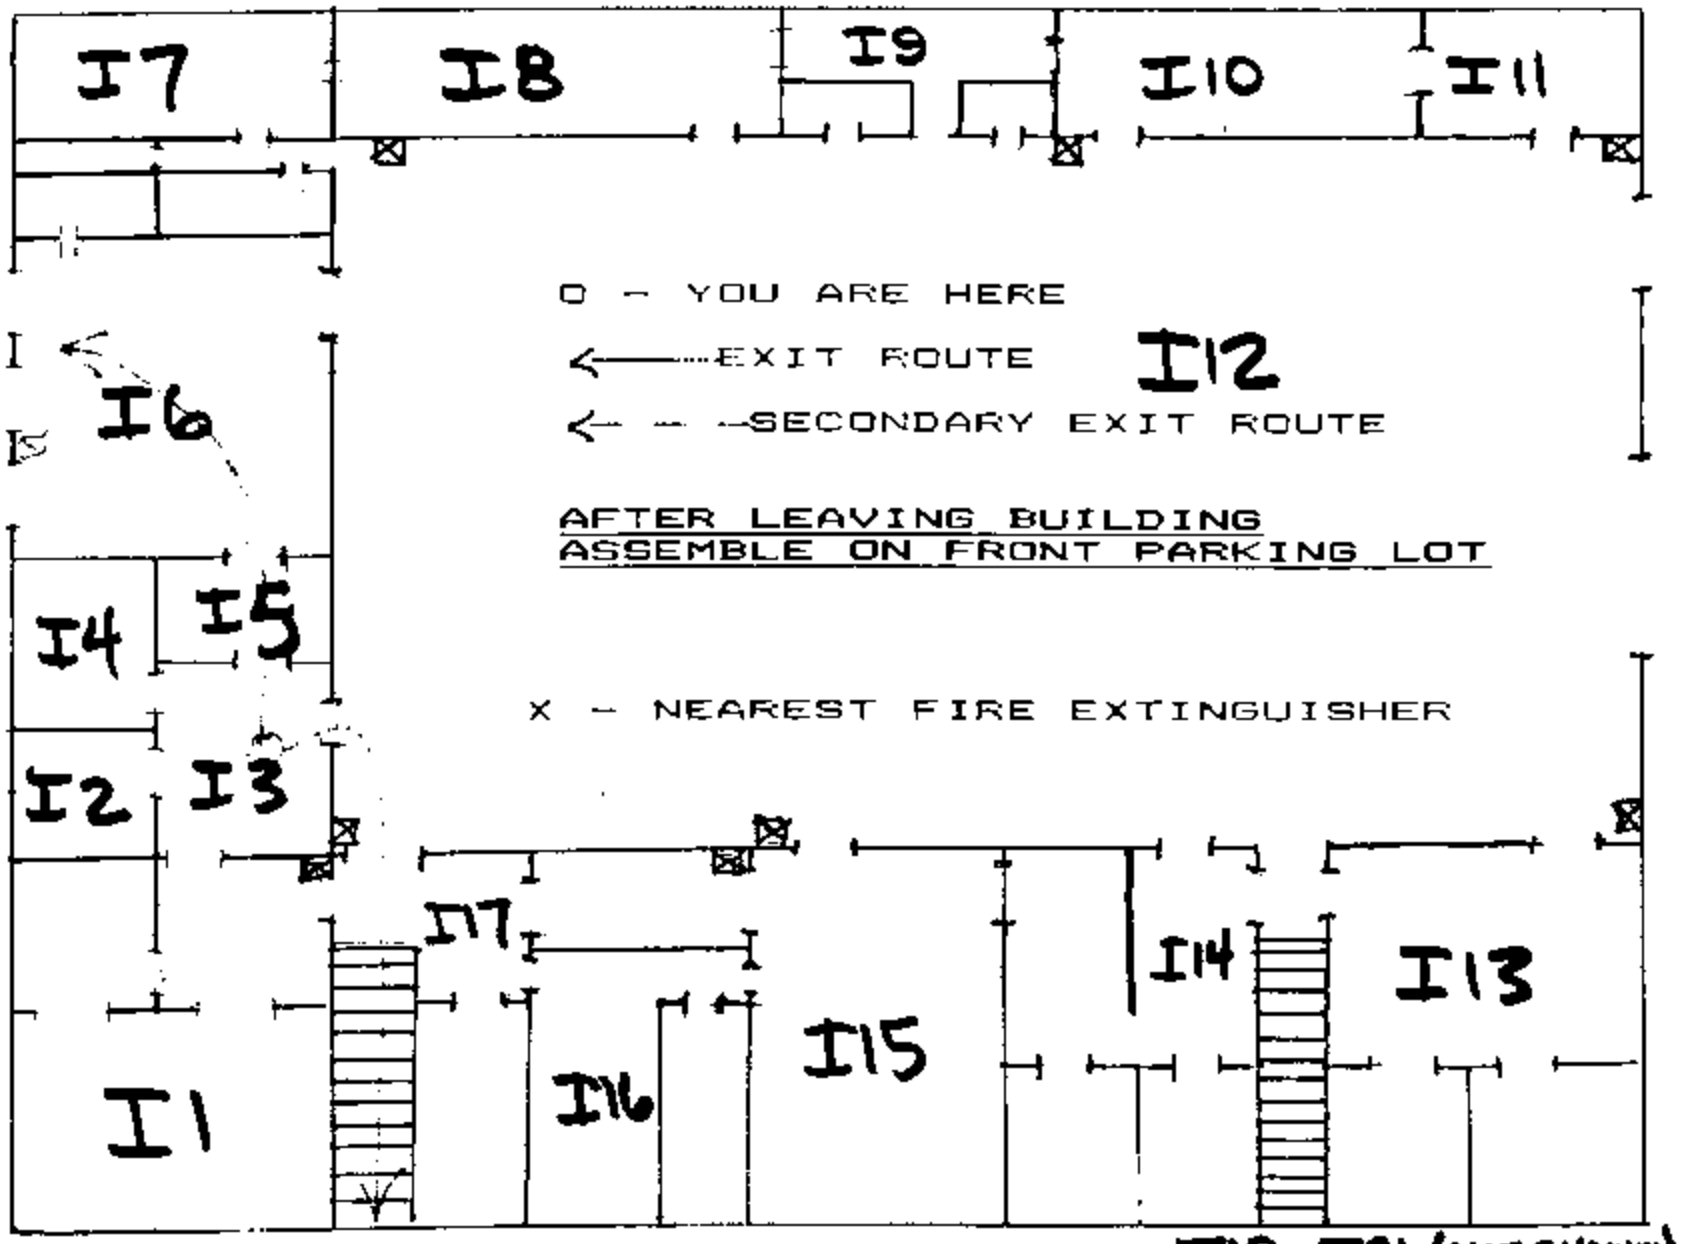

FIRE PLAN COPPIER (MAIL ROOM) OFFICE

ILLUMINANCE SURVEY MAP

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1992 of 5269

BEST AVAILABLE COPY

National Guard Region North

National Guard Readiness Center
Industrial Hygiene Evaluation
Cumberland Army National Guard Armory
Cumberland, MD 21502-3499

Prepared for:

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078

Attn: Non-Responsive

Prepared by:

Bonus Environmental, LLC
P.O. Box 121
Mt. Pleasant, Michigan 48804

Project No. 1061-03
August 4, 2010

Bonus Environmental, LLC

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

TABLE OF CONTENTS

1. EXECUTIVE SUMMARY 1

2. LEAD SAMPLING 2
2.1 Lead Wipe Sampling 2
2.2 Lead Air Sampling 3

3. PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERS 4
3.1 Lead Based Paint 4
3.2 Presumed Asbestos Containing Materials 4
3.3 Water Damage/Mold Growth 5
3.4 Housekeeping 5
3.5 Employee Interviews 5
3.6 Indoor Air Quality 5

4. LIGHTING SURVEY 6

5. EVALUATION OF ATTACHED GARAGE 8
5.1 Operation Description 8
5.2 Local Exhaust Ventilation System 8

6. BATTERY SHOP 9
7. CONCLUSION 9

BEST AVAILABLE COPY

APPENDICES

Appendix A *Shop Diagram*

Appendix B *Lead Sample Results*

Appendix C *Photographs*

Appendix D *References*

BEST AVAILABLE COPY

BEST AVAILABLE COPY

August 4, 2010
Project No. 1061-03

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078-4003

Attn: Non-Responsive

Project: Army National Guard Readiness Center, Industrial Hygiene Evaluation
Cumberland Army National Guard Armory

1.0 - EXECUTIVE SUMMARY

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Cumberland Army National Guard Readiness Center located at 1100 Brown Avenue in Cumberland, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. The following industrial hygiene and safety programs were evaluated during this industrial hygiene evaluation performed by Bonus Environmental, LLC representative Non-Responsive on May 18, 2010:

- Indoor Air Quality
- Use of items on the Hazardous Materials List
- Vehicle maintenance activities
- Lead Wipe & Air Sampling
- Illumination
- Ergonomics
- Evaluation of the physical condition of the facility in regards to peeling paint, asbestos containing materials, water damage or mold problems, and housekeeping practices.

The Cumberland Readiness Center is an Army National Guard armory comprised of offices, a drill hall, kitchens, a former indoor firing range, an attached maintenance garage, a fitness room, supply rooms, a boiler room, a battery room, a locker room, a classroom and a lunch room. The point of contact for this facility was SFC Non-Responsive. Five (5) full-time administrative personnel and four (4) full-time maintenance personnel are employed in the approximately 25,922 ft² facility. A shop diagram depicting the locations of the operations identified during this industrial hygiene evaluation is attached to this report as Appendix A.

The National Guard Bureau Region North Industrial Hygiene Office provided governmental furnished equipment and sampling media required to perform the industrial hygiene evaluation. Chain of custody forms for laboratories approved by the National Guard Bureau Region North Industrial Hygiene Office were provided with the sampling media. All samples collected during this industrial

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

hygiene evaluation were sent to the National Guard Bureau Region North Industrial Hygiene Office approved laboratories for analysis.

2.0 – LEAD SAMPLING

2.1 – Lead Wipe Sampling

Lead wipe sampling was performed according to the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame). Twenty one (21) wipe samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. The National Guard Bureau Region North Industrial Hygiene Office has established/interpreted a threshold of 200 µg/ft² of lead concentration for surface cleanliness. The following table outlines the locations and analytical results for the lead wipe samples collected during this project

Army National Guard - Cumberland Readiness Center ***Lead Wipe Sample Results***				
Sample #	***Sample Date***	***Sample Location***	***Sample Area (ft^2)***	***Sample Result ($\mu g/ft^2$)***
CL-W-1	5-18-10	Field Blank	---	< 12
CL-W-2	5-18-10	Drill hall, NW corner, top of microwave	0.111	< 110
CL-W-3	5-18-10	Drill hall, along west wall, top of trophy case	0.111	< 110
CL-W-4	5-18-10	Drill hall, along east wall, top of "Amnesty box"	0.111	< 110
CL-W-5	5-18-10	Drill hall, floor, south end "free throw" line	0.111	< 110
CL-W-6	5-18-10	Drill hall, floor, north end "free throw" line	0.111	< 110
CL-W-7	5-18-10	Kitchen (NW corner of Drill hall), along south wall, top of file cabinet	0.111	< 110
CL-W-8	5-18-10	Locker room (former indoor firing range), NE corner, light fixture	0.111	140
CL-W-9	5-18-10	Locker room (former indoor firing range), SE corner, surface of overhead heater	0.111	< 110
CL-W-10	5-18-10	Locker room (former indoor firing range), SW corner, top of locker #53	0.111	< 110
CL-W-11	5-18-10	Locker room (former indoor firing range), center of room, floor	0.111	< 110
CL-W-12	5-18-10	Outside of NE entrance to locker room, on handrail to ground floor	0.111	< 110
CL-W-13	5-18-10	Fitness room, NE corner, top of stereo	0.111	< 110
CL-W-14	5-18-10	Supply room #2, center of room, top of file cabinet	0.111	< 110
CL-W-15	5-18-10	Lobby, ledge along north wall	0.111	< 110
CL-W-16	5-18-10	Office #8/9, NW corner, table top surface	0.111	< 110
CL-W-17	5-18-10	DLC classroom, north side, surface of eastern-most desk	0.111	< 110

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1997 of 5269

BEST AVAILABLE COPY

Army National Guard - Cumberland Readiness Center ***Lead Wipe Sample Results***				
Sample #	***Sample Date***	***Sample Location***	***Sample Area (ft^2)***	***Sample Result ($\mu g/ft^2$)***
CL-W-18	5-18-10	Lunch room, on bar countertop surface	0.111	< 110
CL-W-19	5-18-10	FMS maintenance office room #19, along north wall, top of shelf	0.111	< 110
CL-W-20	5-18-10	Boiler room, SW corner, top of compressor	0.111	< 110
CL-W-21	5-18-10	Maintenance garage, south side of bay #2, top of parts drawer	0.111	< 110
CL-W-22	5-18-10	Maintenance garage, battery room, surface of center storage shelf	0.111	1,800

Surface cleanliness threshold = < 200 $\mu g/ft^2$

2.2 – Lead Air Sampling

The purpose of lead air monitoring was to document task-specific activities and corresponding exposures to lead. Occupational Safety and Health Administration (OSHA) 29 CFR 1926.62 requires employers whose employees are exposed to lead in the work place, in any quantity, make a determination whether any employee's exposure exceeds the action level (AL) of 30 $\mu g/m^3$ or the maximum permissible exposure limit (PEL) of 50 $\mu g/m^3$ as 8-hour time weighted averages (TWAs). If employee exposures are less than 30 $\mu g/m^3$, training is required under the Hazard Communication 29 CFR 1926.59. Exposures that exceed the AL or PEL require the employer to comply with additional requirements, including air monitoring, additional training, and restricted work practices as outlined in OSHA 29 CFR 1926.62.

Representative fixed area sampling was conducted for potential airborne concentrations of lead in accordance with accepted Industrial Hygiene methods recognized by the National Institute for Occupational Safety and Health (NIOSH) and OSHA. Representative breathing zone samples were not collected from an employee performing administrative tasks.

Lead exposure monitoring was performed in accordance with the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame) with SKC personal air sampling pumps calibrated to 2.0 liters per minute. All samples were collected on 37 mm diameter cassettes with mixed-cellulose ester filters. All sampling pumps were calibrated before and after each use to ensure volume accuracy. Two (2) samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. Analytical results of the lead wipe and air samples are attached to this report as Appendix B.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1998 of 5269

BEST AVAILABLE COPY

Army National Guard - Cumberland Readiness Center Lead Air Sample Results									
Sample #	**Sample Type**	**Sample Location**	**Flow Rate**	**Start**	**Stop**	**Vol.**	**Reprt. Limit (µg/m³)**	**Results (µg/m³)**	**8 hr TWA (µg/m³)**
May 18, 2010									
CL-A-1	FB	Field Blank	---	---	---	0	3	< 3	N/A
CL-A-2	IWA	Room #6, SFC[redacted] office desk, during daily activities	2.0	0743	1523	920	3.3	< 3.3	N/A
CL-A-3	IWA	Maintenance garage, between bays 1 & 2	2.0	0746	1526	920	3.3	< 3.3	N/A

PS = Personal sample, **IWA** = Inside work area, **N/A** = Not Applicable
Note: The OSHA PEL of 50 µg/m³ is averaged over an 8 hr work shift

3.0 - PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERNS

3.1 - Lead Based Paint

During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC performed a visual inspection of the facility in regards to lead based paint. Bonus Environmental, LLC identified one area of peeling paint which could potentially pose a lead exposure hazard. This area was the west wall of the boiler room. A bulk sample paint chip was collected from the west wall of the boiler room. The paint chip sample was sent under chain-of-custody procedures to AMA Analytical Services, Inc. located in Lanham, Maryland for analysis. Sample analysis has indicated that the paint chip sample contained detectable levels of lead. The paint is therefore considered to be lead based paint and all activities that involve lead based paints are regulated by OSHA Lead in Construction Standard, 29 CFR 1926.62. The OSHA Lead in Construction Standard does not assign a numerical value of which must be present within the paint to be considered lead based paint. Paints which contain any detectable level of lead shall be treated and handled as lead based paint. HUD defines lead based paint as having greater than 0.5% lead by weight. The paint chip sample collected during this industrial hygiene evaluation did not contain lead in excess of 0.5% by weight. Analytical results are attached to this report as Appendix B.

LeadCheck™, ChromateCheck™, NickelCheck™, and CadmiumCheck™ swabs were utilized as a screening method on the floor of Maintenance bay #1, where welding activities have occurred in the past. Metal-specific swabs were used to test for the presence of cadmium, chromate, lead, and nickel. All swabs gave a negative indication for the given metal contaminant.

3.2 – Presumed Asbestos Containing Materials

During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC performed a visual inspection to identify presumed asbestos containing materials (PACM) and, if found, to note their condition. Bonus Environmental, LLC did not identify any PACM that was considered to be in poor or damaged condition.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 1999 of 5269

BEST AVAILABLE COPY

3.3 - Water Damage/Mold Growth
During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC performed a visual inspection to report the location and perform an evaluation of any water damaged or visible mold problems. Bonus Environmental, LLC identified no water-damaged and/or moldy building materials during the survey.

3.4 - Housekeeping
During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC performed an evaluation of the housekeeping practices. Bonus Environmental, LLC found the housekeeping to be in good order.

3.5 – Employee Interviews
During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC performed interviews and made observations to determine if the work activities being performed possessed any ergonomic concerns. Following the interviews and observations, no ergonomic and or indoor air quality concerns were identified.

3.6 – Indoor Air Quality
During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC measured temperature, relative humidity, carbon monoxide (CO), and carbon dioxide (CO_2) throughout the facility. A calibrated TSI Q-Trak Model 7565 Indoor Air Quality Monitor equipped with a Q-Trak Probe 982 was utilized to record indoor air quality measurements.

Carbon dioxide is a natural component of air and the amount of CO_2 in a given air sample is commonly expressed as parts per million (ppm). The outdoor air in most locations contains about 380 ppm carbon dioxide. Higher outdoor CO_2 concentrations can be found near vehicle traffic areas, industry and sources of combustion. The concentrations of CO_2 found in most offices are well below the OSHA Permissible Exposure Limit (PEL) of 5,000 ppm when averaged over an 8-hour time period for an industrial workplace. While levels below 5,000 ppm are considered to pose no serious health threat, studies have indicated that individuals in offices with elevated CO_2 concentrations tend to report drowsiness, lethargy and a general sense that the air is stale. Ventilation rates for office spaces are defined by various codes and standards. The most widely accepted standard is the American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE) Standard 62. According to ASHRAE Standard 62.1-2007, CO_2 concentrations below 700 ppm above the outdoor level are considered to indicate adequate ventilation and provide human comfort. The CO_2 measurements collected during this industrial hygiene evaluation ranged from 438 ppm to 543 ppm and indicate adequate ventilation within the facility.

Carbon monoxide, also known as the "silent killer," is a colorless, odorless, poisonous gas that results from the incomplete burning of common fuels such as natural or liquefied petroleum gas, oil, wood or coal. When carbon monoxide is inhaled, it enters the blood stream and reduces the ability of the blood to carry oxygen to vital organs, such as the heart and brain. Because it is impossible to see, taste or smell the toxic fumes, CO can harm you before you are aware it is in your work area. At lower levels of exposure, CO causes mild effects that are often mistaken for the flu. These symptoms include

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2000 of 5269

BEST AVAILABLE COPY

headaches, dizziness, disorientation, nausea and fatigue. The effects of CO exposure can vary greatly from person to person depending on age, overall health and the concentration and length of exposure. The OSHA has established a PEL of 50 ppm. OSHA standards prohibit worker exposure to more than 50 parts of the gas per million parts of air averaged during an 8-hour time period. The peak CO level for employees is 200 ppm. The CO measurements collected during this industrial hygiene evaluation ranged from 0.5 ppm to 1.2 ppm. CO levels were well below the OSHA PEL during this industrial hygiene evaluation.

During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC collected temperature measurements. Temperature measurements throughout the facility ranged from 64.8ºF to 71.6ºF and are considered to be within an acceptable range.

During the industrial hygiene evaluation of the Army National Guard Cumberland Readiness Center, Bonus Environmental, LLC collected relative humidity measurements. Relative humidity measurements throughout the facility ranged from 45.3% to 47.8% and are considered to be within an acceptable range. Indoor air quality measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard - Cumberland Readiness Center
Indoor Air Quality Measurements

Location	*CO_2 (ppm)*	*CO (ppm)*	*Relative Humidity (%)*	*Temperature (ºF)*
Outdoors, south side entrance	401	1.7	63.8	65.1
Drill hall, center of room	438	1.1	46.1	64.8
Fitness room #3	474	0.6	46.9	65.0
Supply room #2	472	0.9	47.4	65.5
Office room 8/9	509	1.0	47.8	66.4
VTEC room	511	0.5	47.7	70.7
Lunch room	505	1.0	46.7	70.0
FMS maintenance office room #19	543	1.1	46.2	71.1
Boiler room	476	1.2	45.7	71.6
Battery room	484	1.2	45.3	70.3
Maintenance garage, between bays 1 & 2	468	1.1	45.5	70.4

Required/Recommended Values
CO_2 *- OSHA PEL = 5,000 ppm and ASHRAE Standard 62.1-2007 = no greater than 700 ppm above outdoor*
CO *- OSHA PEL = 50 ppm and OSHA Ceiling Limit = 200 ppm*
Temperature *- ASHRAE Standard 55-2004 = between approximately 67 and 82 °F.*
RH *– ANSI/ASHRAE Standard 62.1-2007 = <65%*

4.0 – LIGHTING

Utilizing a properly calibrated Cooke Corporation cal-Light 400 light meter, Bonus Environmental, LLC collected illumination readings throughout the facility. Illumination measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2001 of 5269

BEST AVAILABLE COPY

Army National Guard - Cumberland City Readiness Center Lighting Survey			
Location	*Measurement in Foot Candles*	*Requirement in Foot Candles*	*Requirement Met?*
Common area/Kitchen/Room 116	13.2	10	YES
Fitness room #3	5.2	30	NO
Men's latrine	25.5	5	YES
Supply room #2	36.4	30	YES
Supply room #1	11.9	30	NO
FAC Engineer office #4	36.0	50	NO
Common women's latrine	21.8	5	YES
Drill hall, center of room	26.5	30	NO
Front entrance lobby	11.7	5	YES
Room #6 – Office	61.6	50	YES
Retention NCO office	27.3	50	NO
Room #7 – Office	22.1	50	NO
Room #8/9 – Office	66.0	50	YES
Library	79.7	30	YES
Room #10 – Office	23.9	50	NO
Room #11 – Office	58.5	50	YES
Telecommunications Room (Internet access room)	8.6	30	NO
SR. staff men's latrine	36.6	5	YES
Copy room	21.7	30	NO
Common kitchen	16.6	10	YES
Training room #12	23.9	30	NO
Female restroom	22.1	5	YES
DLC classroom	32.2	30	YES
VTEC office	38.4	50	NO
Room #13 – Office	52.5	50	YES
Room #14 – Office	14.6	50	NO
Room #15 - Office	36.9	50	NO
Locker room #16	60.4	7	YES
Recruiter's office #17	21.5	50	NO
Common men's room	41.2	5	YES
Lunch room	22.4	10	YES
Common kitchen	3.2	10	NO
Hallway outside of lunch room	15.4	5	YES
Dispatch office #18	68.5	50	YES
FMS Maintenance Office #19	98.5	50	YES
Boiler room	32.0	30	YES
Caretaker's storage room	11.2	30	NO
Center of maintenance shop, bay #1	52.0	75	NO
OMS tool room #23	16.8	30	NO
OMS computer room #24	29.5	30	NO
Battery room #22	45.9	30	YES
Storage area above rooms 22 & 24	18.4	30	NO
Maintenance shop, between bays 2 & 3	20.6	75	NO
Storage vaults 1 & 2	Inaccessible		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2002 of 5269

BEST AVAILABLE COPY

Lighting levels were compared to the levels outlined within the ANSI/IESNA RP-1-04 Office Lighting Handbook, and the ANSI/IESI RP-7-01 Lighting Industrial Facilities Handbook. Areas within the facility which did not meet the foot candle requirements are identified with a "NO" within the Requirement Met? column. It is recommended that illumination be improved in all the areas that did not meet the requirements. Improving illumination can be achieved by replacing burned-out lamps/bulbs, cleaning fixtures, relocating detailed work activities to more illuminated areas, and using supplemental task lighting.

5.0 – EVALUATION OF ATTACHED GARAGE

5.1 – Operational Description - Readiness Center

Five administrative and four maintenance personnel are assigned to the Cumberland Readiness Center to provide space for units to support and train soldiers. Vehicle maintenance typically occurs during the normal work hours of Monday-Friday, 0630-1700. The attached garage includes four bays, three of which include vehicle exhaust ventilation. Personal protective equipment including leather gloves, nitrile gloves, ear plugs, and safety glasses are available to all employees who work within the attached garage. Activities conducted on the day of the industrial hygiene evaluation included engine and brake repairs.

5.2 – Local Exhaust Ventilation System

Exhaust ventilation systems were identified in the Cumberland Readiness Center facility during the industrial hygiene evaluation. The ventilation system consisted of a central exhaust fan and series of flexible trunks of ductwork. The central exhaust fan was centrally located and exhausted directly to the outdoors through the west wall. The exhaust ventilation system was installed for the purpose of removing diesel exhaust fumes. A TSI VelociCalc 9555 Multiparameter Ventilation Monitor was utilized to collect multiple measurements of the face velocity of each flexible trunk of ductwork. The table below details the results of the ventilation system evaluation in the Cumberland Readiness Center facility.

Army National Guard - Cumberland Readiness Center Vehicle Exhaust - Ventilation System Evaluation				
Location	*Measured Average Face Velocity (fpm)*	*Calculated Volumetric Flow (cfm)*	*Area of the Opening (ft²)*	*Sufficient Air Flow*
Bay #2 (south)	2,473	866	0.35	NO
Bay #3 (center)	1,164	407	0.35	NO
Bay #4 (north)	1,438	503	0.35	NO

cfm = cubic feet per minute, calculated by multiplying the measured face velocity by the area of the opening, **fpm** = feet per minute, **calculated reference value** = 1,385 acfm

Figure VS-85-02 on page 13-151 of the ACGIH "A Manual of Recommended Practice for Design, 26th Edition" specifies that tailpipe exhaust ventilation volumes for operating engines connected directly to a tailpipe exhaust system are to be determined by the engine displacement, the engine RPM, and tailpipe exhaust temperature, plus a 20% safety factor. The largest types of vehicles serviced within the Maintenance Shop are M917A2 20-ton dump trucks equipped with a Detroit Diesel 60

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2003 of 5269

BEST AVAILABLE COPY

series 12.7 Liter diesel engine which operates at 1,800 RPM. Based on an average tailpipe temperature of 300ºF, the minimum required volume flow rate of the overhead exhaust system used to control emissions from the fumes of diesel exhaust was calculated to be 1,385 acfm (actual cubic feet per minute). The representative exhaust duct systems tested in the Cumberland Readiness Center facility did not provide sufficient air flow.

6.0 – BATTERY SHOP

Mechanics from the Maintenance Shop work within the Battery Shop on an as needed basis. The Battery room is used for storage and charging of batteries. Batteries in need of repair are shipped to another facility. Personal protective equipment including an apron, nitrile gloves, eye goggles, and face shield are available to all employees who work within the Battery Shop. No work activities were being performed within the Battery Shop during the industrial hygiene evaluation.

Lead acid batteries produce hydrogen gas and other fumes at 80% recharge point, making proper ventilation in the battery charging area extremely important. Hydrogen gas is not only colorless and odorless, but is lighter than air, causing the gas to rise to the top of a building. For safety purposes, the concentration of hydrogen in the air should be kept below 1% to reduce risk of explosion. An evaluation of the ventilation system within the Battery Shop was performed during this industrial hygiene evaluation of the facility. The Battery Shop is used as a place of storage and charging of lead-acid batteries. Forty (40) 8-cell (1,225 cranking amps capacity) batteries were located in the battery room, with twenty three (23) of them on chargers. A wall-mounted rectangular exhaust fan measuring 22”x 8” located along the west wall provides ventilation to the room. A TSI VelociCalc 9555 Multiparameter Ventilation Monitor was utilized to measure the face velocity at the exhaust fan. Measurements indicated that the exhaust fan provides an average volumetric flow rate of 583 fpm. The entry door to the Battery Shop is kept open to provide make-up air. The ventilation rate of the exhaust system required during the charging of twenty three (23) 8-cell batteries within the Battery Shop was calculated with the following formula.

Q = 0.054 x I x N where,

- Q = required ventilation rate, cfm
- I = 0.21 x (capacity of largest battery to be charged in amp-hours)
  or 0.25 x (maximum obtainable amps from charger), whichever is greater
- N = number of batteries to be charged at one time x number of cells per battery

In this case, the required ventilation of the exhaust system (Q) within the Battery Shop was determined to be 250 cfm, where I=0.21 x 120 Ah, N=23 x 8. The ventilation rate of the exhaust system in place within the Battery Shop was determined to be 711 cfm.

7.0 - CONCLUSION

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Cumberland Army National Guard Readiness Center located at 1100 Brown Avenue in Cumberland, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2004 of 5269

BEST AVAILABLE COPY

so that employee exposure history can be provided to each civilian and military employee. An industrial hygiene evaluation of the facility was performed by Bonus Environmental, LLC representative Jeff Walworth on May 18, 2010:

Bonus Environmental, LLC recommends that any areas of concerns outlined within this report be evaluated to ensure the necessary actions are made. Following the completion of the industrial hygiene evaluation, Bonus Environmental, LLC found the following safety and/or indoor air quality conditions of the facility to be within acceptable levels/condition in regards to the following:

- Carbon Dioxide
- Carbon Monoxide
- Lead Air Samples
- Water-Damage / Mold Growth
- Ergonomics
- Housekeeping
- Presumed Asbestos Containing Materials
- Temperature
- Relative Humidity

Air sampling was not conducted during this industrial hygiene evaluation for metal welding fumes, as this task was not performed during this industrial hygiene evaluation. It was reported to Bonus Environmental, LLC that welding activities are conducted approximately once per month, with a typical duration of 1-2 minutes. It is recommended that air sampling be performed during the next scheduled industrial hygiene evaluation for metal welding fumes if welding activities are conducted on a larger scale within this facility.

It has been a pleasure to be of assistance to you. Please contact us if you have any questions concerning this report or if we can be of any further assistance in any other environmental or occupational health matter.

Sincerely,

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Cumberland_10_Report.docx

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2005 of 5269

BEST AVAILABLE COPY

Appendix A

Shop Diagram

BEST AVAILABLE COPY

Armory Space Utilization

AS OF: 5/18/2010

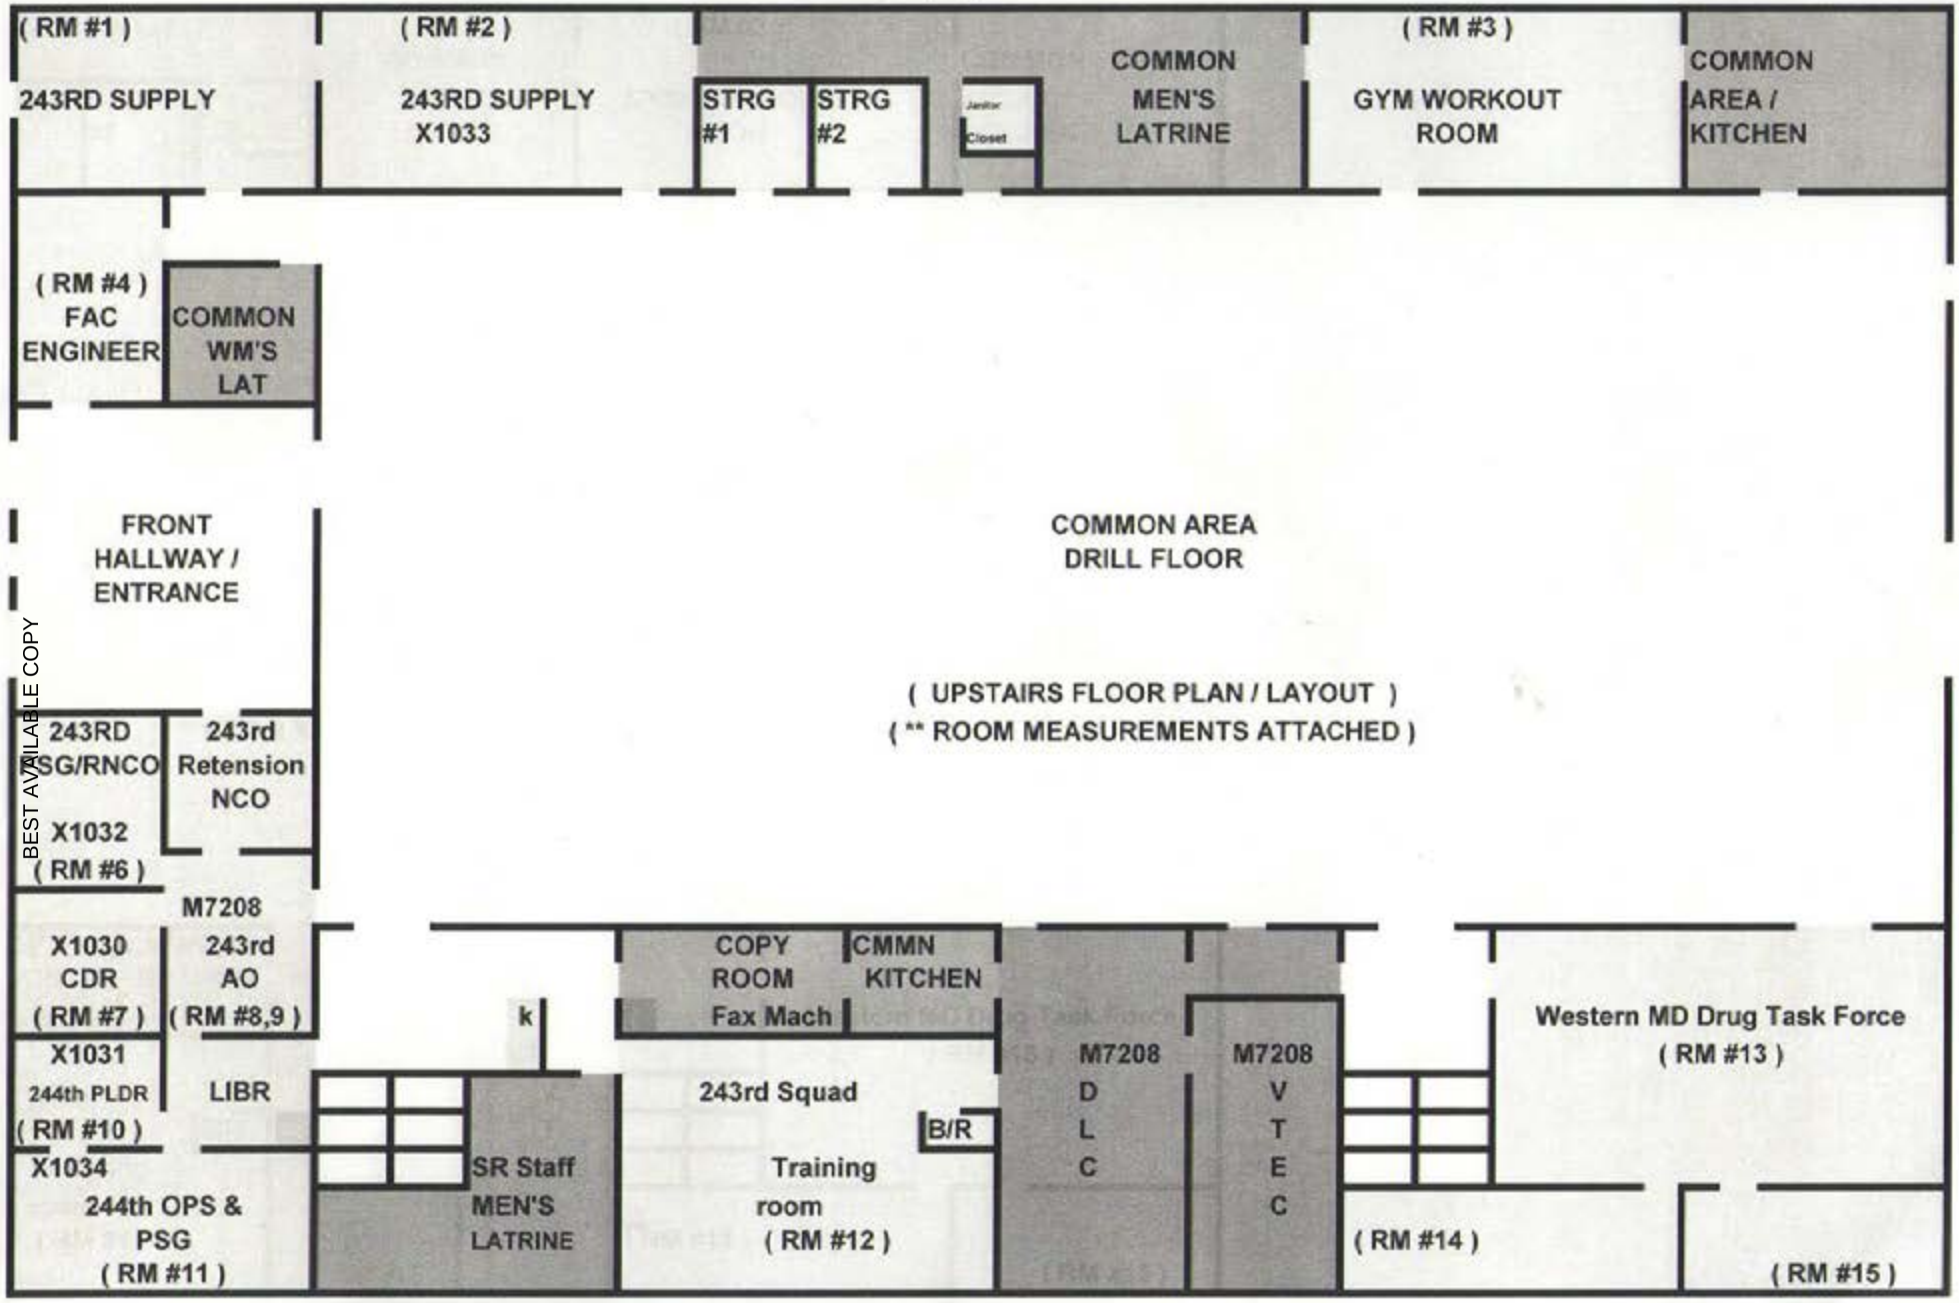

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2007 of 5269

Posted to NGB FOIA Reading Room
May, 2018

Armory Space Utilization

AS OF: 5/18/2010

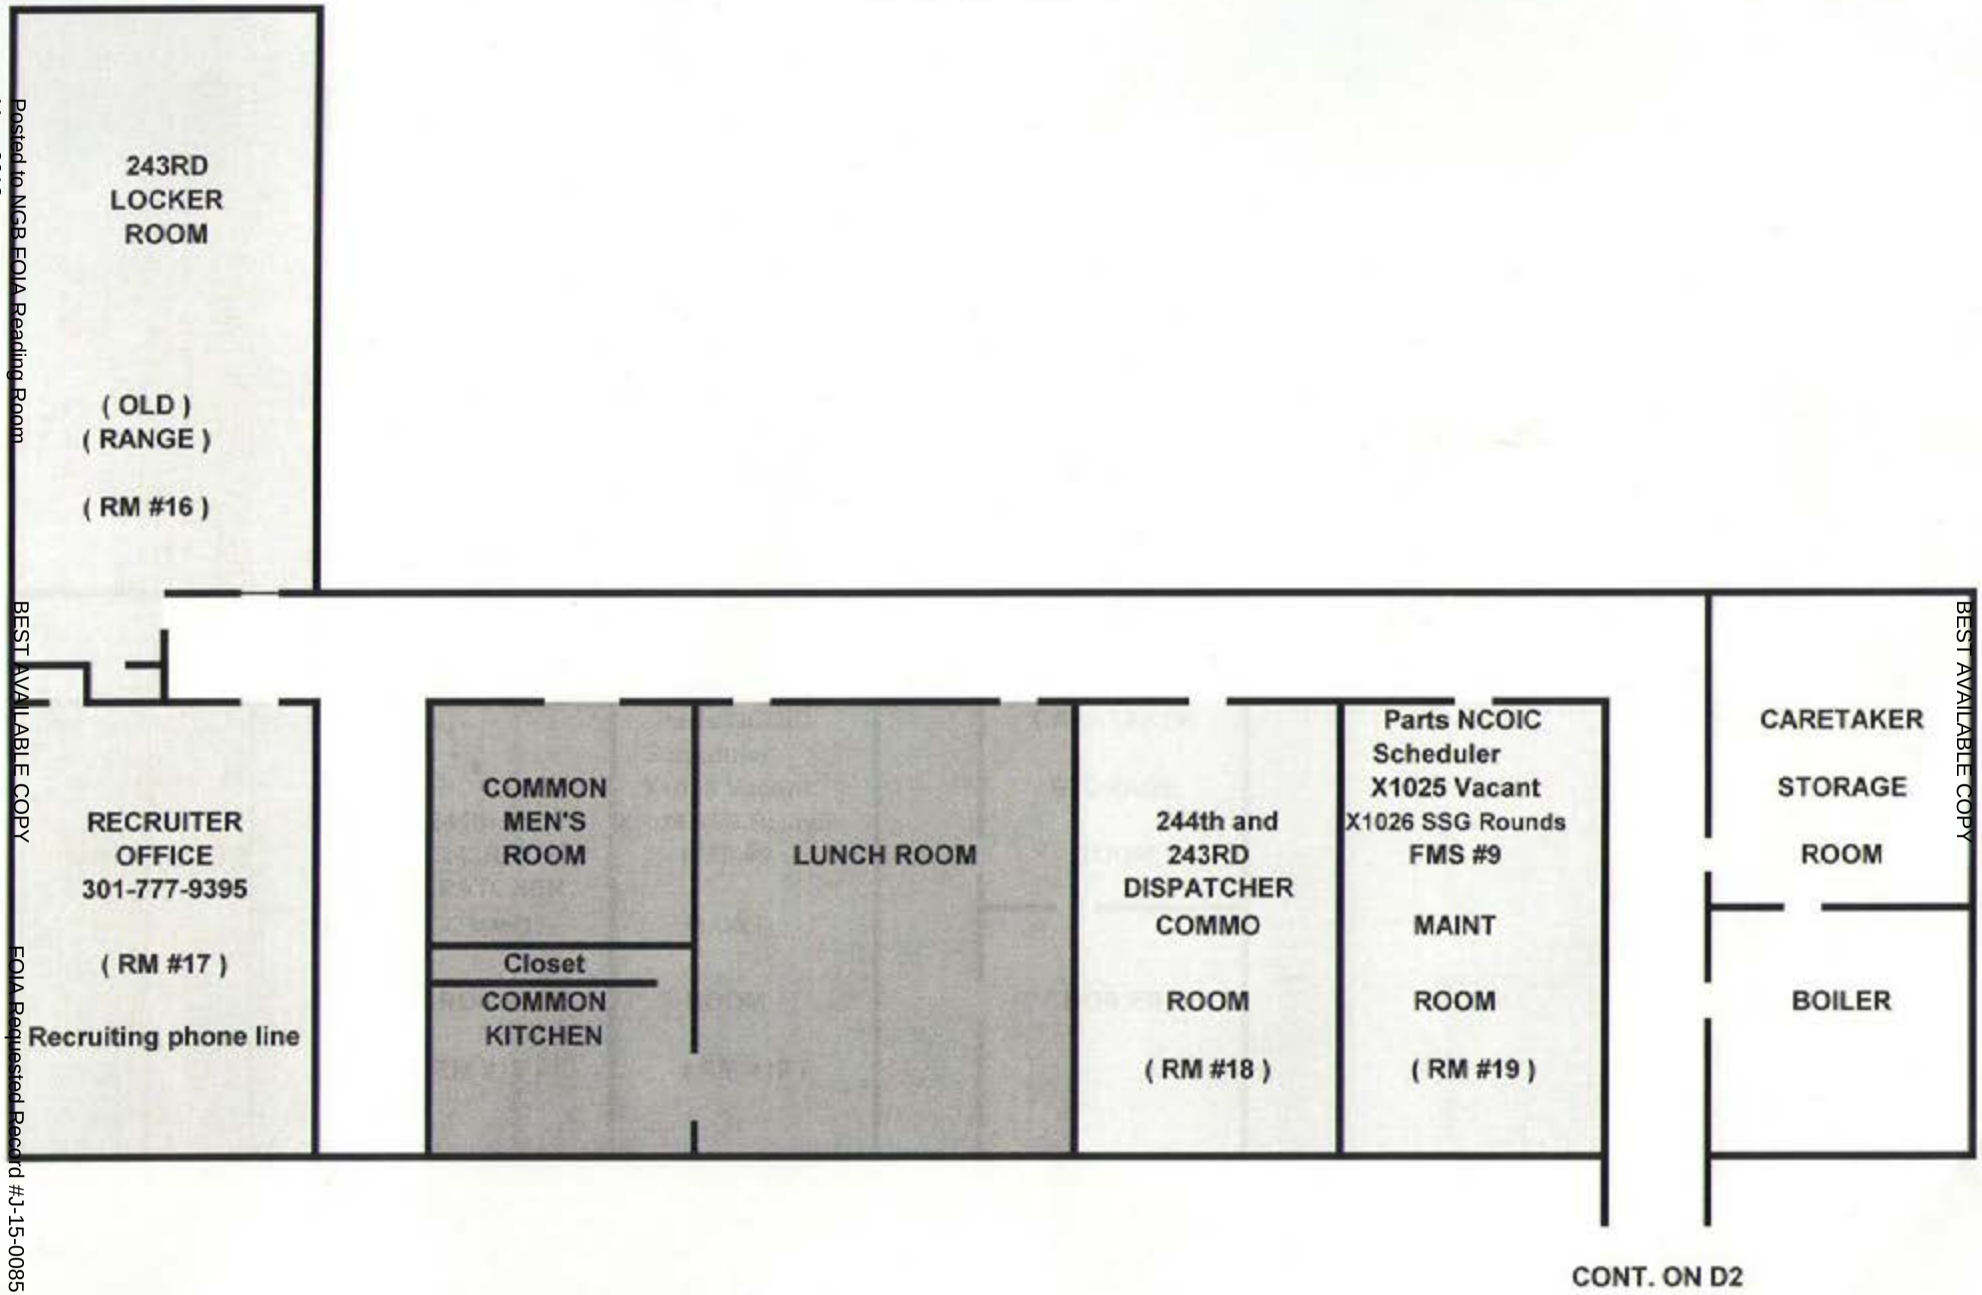

CONT. ON D2

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2008 of 5269

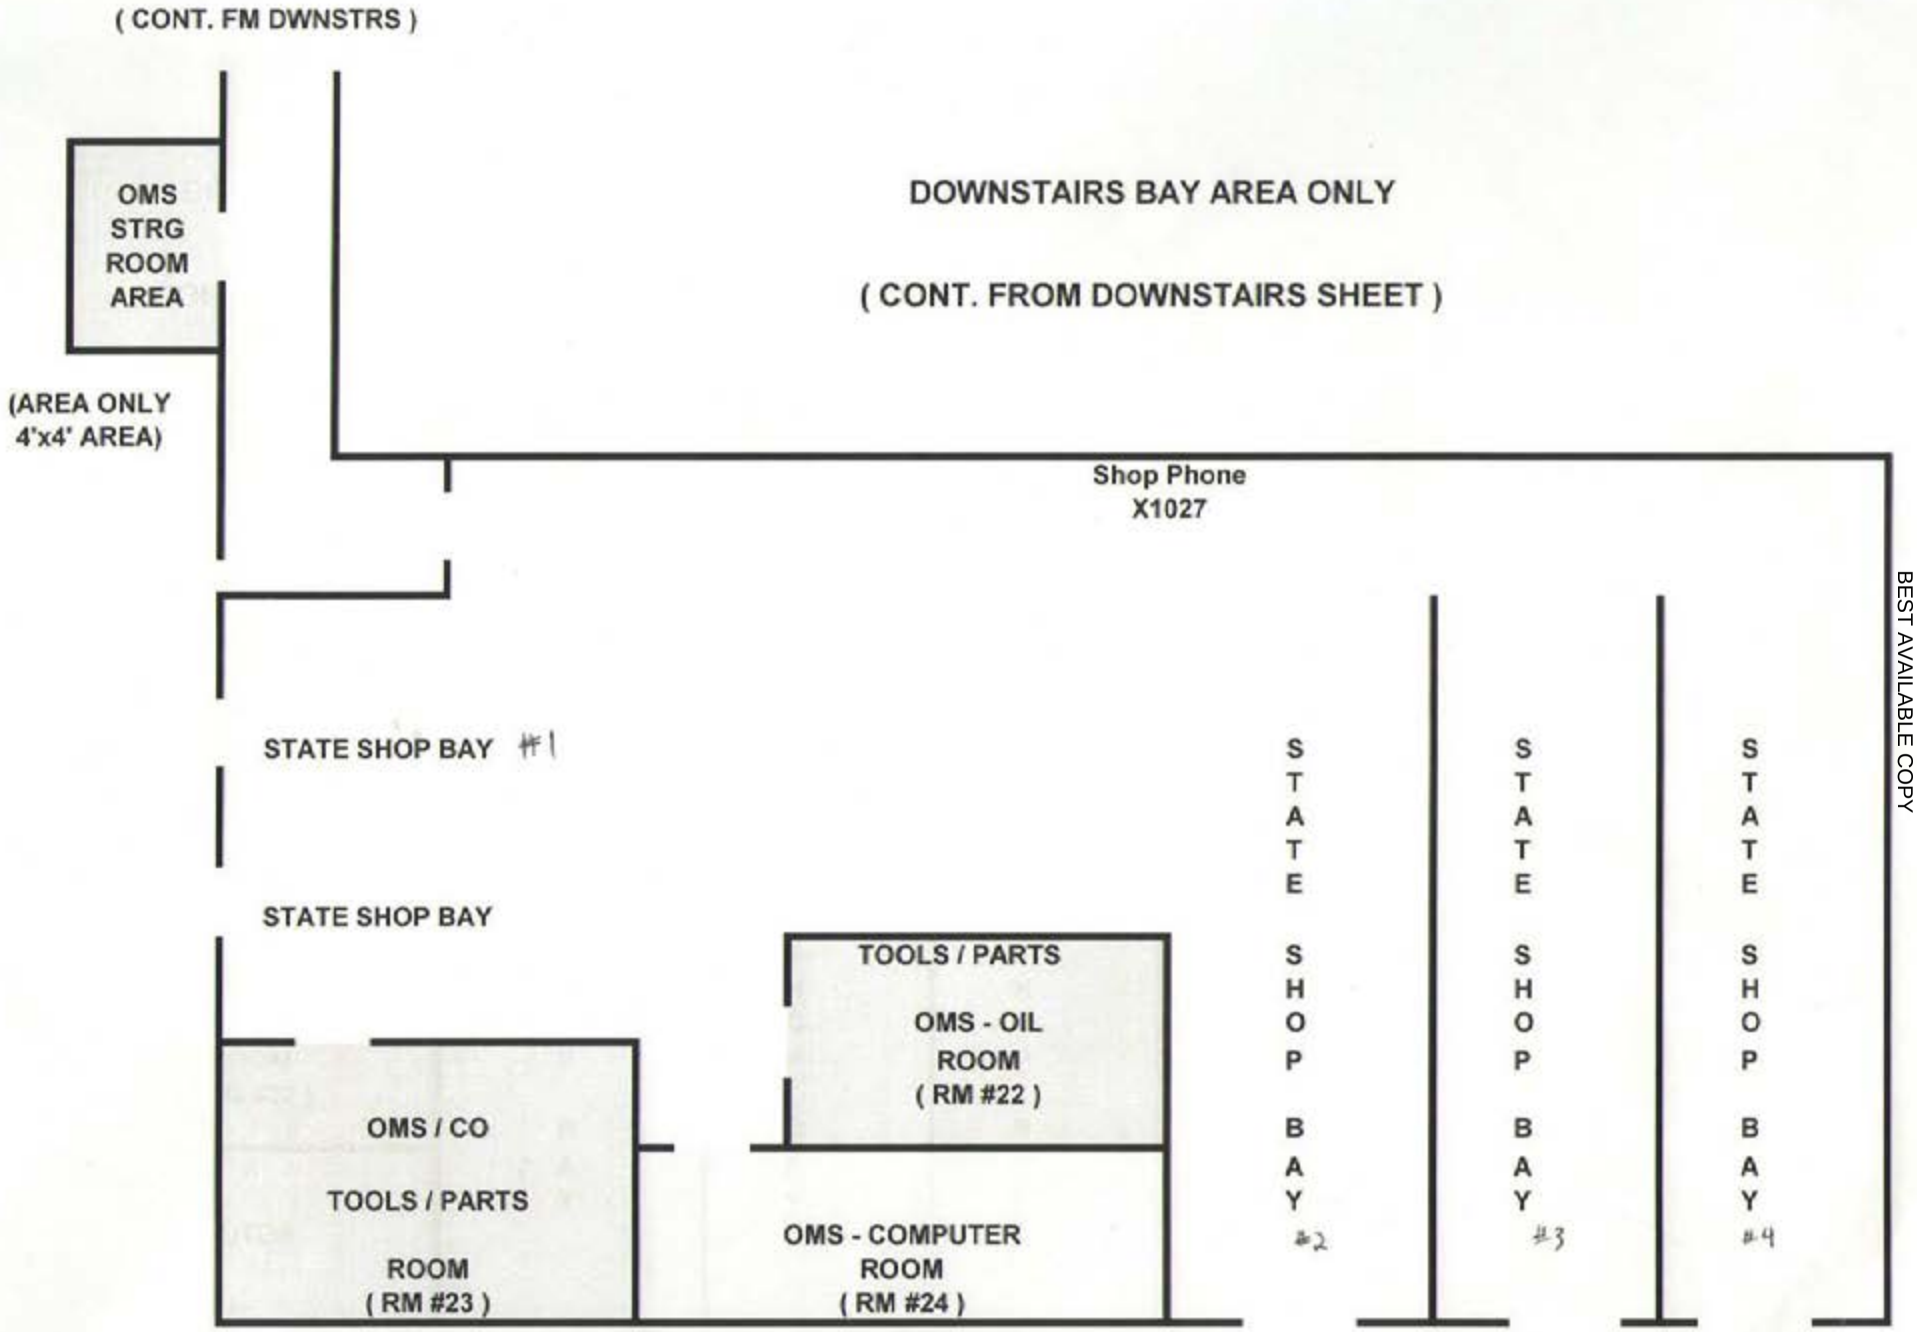

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2009 of 5269
BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B

Lead Sample Results

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

RECEIVED JUN 14 2010

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client: National Guard Bureau

Address: 301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation

Havre de Grace, Maryland 21078

Job Name: Cumberland Armory

Job Location: Cumberland, MD

Job Number: Cumberland Armory

P.O. Number: W912K6-09-A-0003

Chain Of Custody: 507190

Date Submitted: 5/21/2010

Person Submitting: [redacted]

Date Analyzed: 5/28/2010 **Report Date:** 6/1/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047866	CL-PC-1	Flame	Paint Chip	****	N/A	0.0092	%Pb		0.22	%Pb	
1047867	CL-A-1	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1047868	CL-A-2	Flame	Air	920	N/A	3.3	ug/m³	<3	<3.3	ug/m³	
1047869	CL-A-3	Flame	Air	920	N/A	3.3	ug/m³	<3	<3.3	ug/m³	
1047870	CL-W-1	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1047871	CL-W-2	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047872	CL-W-3	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047873	CL-W-4	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047874	CL-W-5	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047875	CL-W-6	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047876	CL-W-7	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047877	CL-W-8	Flame	Wipe	****	0.111	110	ug/ft²	16	140	ug/ft²	
1047878	CL-W-9	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047879	CL-W-10	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047880	CL-W-11	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047881	CL-W-12	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047882	CL-W-13	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047883	CL-W-14	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047884	CL-W-15	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0086 (MD)
Released by National Guard Bureau
Page 2011 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client: National Guard Bureau

Address: 301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation

Havre de Grace, Maryland 21078

Attention: [redacted]

Job Name: Cumberland Armory

Job Location: Cumberland, MD

Job Number: Cumberland Armory

P.O. Number: W912K6-09-A-0003

Chain Of Custody: 507190

Date Submitted: 5/21/2010

Person Submitting: [redacted]

Date Analyzed: 5/28/2010 **Report Date:** 6/1/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047885	CL-W-16	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047886	CL-W-17	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047887	CL-W-18	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047888	CL-W-19	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047889	CL-W-20	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047890	CL-W-21	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047891	CL-W-22	Flame	Wipe	****	0.111	110	ug/ft²	200	1800	ug/ft²	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: Nida McGarvey

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0088 (MB)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 19395

Analysis Type: Flame
Sample Type: Wipe
Analysis Date: 5/28/2010

	Result		Percent Recovery	RPD	Comment
Preparation Blank	-0.088	ppm			Acceptable
Report Limit Verification Sample	0.2719	ppm	81.6%		Acceptable
Expected Spike Level (ppm) 0.3333					
Duplicate Sample 1		mg/Kg			
Duplicate Sample 2		mg/Kg			Acceptable
Matrix Spike Analysis					
Spiked Sample					Acceptable
Spike Duplicate					Acceptable
Laboratory Control Sample 1	264.000	µg	103.85%		Acceptable
Laboratory Control Sample 2	304.125	µg	105.10%	1.20%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999829

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507190	47870	CL-W-1
507190	47871	CL-W-2

SDG Number: 19395

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2013 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507190	47872	CL-W-3
507190	47873	CL-W-4
507190	47874	CL-W-5
507190	47875	CL-W-6
507190	47876	CL-W-7
507190	47877	CL-W-8
507190	47878	CL-W-9
507190	47879	CL-W-10
507190	47880	CL-W-11
507190	47881	CL-W-12
507190	47882	CL-W-13
507190	47883	CL-W-14
507190	47884	CL-W-15
507190	47885	CL-W-16
507190	47886	CL-W-17
507190	47887	CL-W-18
507190	47888	CL-W-19
507190	47889	CL-W-20

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2014 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Focused on Results!!

NVLAP 101143-0
NY ELAP 10920
AIHA 100470

Submitting Samples for National Guard Jobs

1) All samples shall be submitted to AMA Analytical Services, Attn: Sample Receiving, utilizing the enclosed Chain-of-Custody Form. The highlighted areas must be completed by the Subcontractor, however, the Sample Information/Analysis/Matrix section will not need to be completed if field date sheets are submitted with the samples. Please be sure to include a contact phone number for the person submitting the samples.
2) Results shall be reported via email to the following persons:
   a. National Guard Subcontracto[redacted] @ bonusenvironmental.com
   b. [redacted] CIV NGB: [redacted]@us.army.mil
   c. [redacted] CIV NGB [redacted].army.mil
3) Hard Copy Reports & Invoices shall be handled in the following manner:
   a. Original Invoices and Copies of Reports shall be sent to the National Guard
      National Guard Bureau
      Attn: Shirley Chapman/Ken Forsythe
      301-IH Old Bay Lane
      Attn: NGB-AVN-SI, State Military Reservation
      Havre de Grace, Maryland 21078
   b. Original Reports shall be sent the National Guard Subcontractor

      Attn: [redacted]
      office: 989-779-7686
      cell: 989-621-3862
4) All Pb Wipes shall be handled in the following manner:
   a. All samples shall be analyzed utilizing FLAA procedures
   b. Samples whose results are reported as less than the reporting limit, and the reporting limit is greater than 40ug/ft2 shall be re-analyzed utilizing GFAA procedures.
5) All other samples – Pb Paints, Soils, & Airs, PCM Airs, PLM Bulks, TEM Airs, & TEM Bulks shall be analyzed utilizing standard analytical procedures

Asbestos · Lead · Mold

4475 Forbes Blvd. · Lanham, MD 20706 · (301) 459-2640 · Fax (301) 459-2643 · www.amalab.com

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2016 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

507190

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) Sheet 1 of 3

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Cumberland Armory
2. Job Location: Cumberland, MD
3. Job #: Cumberland Armory
4. Contact Perso[redacted] #: W912K6-09-A-0003
5. Submitted by: [redacted] @ phone #: (410) 942-0273

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due: ____
❑ 24 Hours Time Due: ____
Comments: ____

Reporting Information (Results will be provided as soon as technically feasible):

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day + Date Due: 5-28-10
❑ 2 Day
❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
☒ Inclu[redacted]h Report
☒ [redacted] bonusenvironmental.com
❑ Fax: [redacted] s.army.mil
❑ Verba[redacted] s.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)

TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan (√area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (√area) Dust D6480-99 ____ (QTY)

TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
☒ Pb Paint Chip 1 (QTY)
☒ Pb Dust Wipe (wipe type Ghost), 22 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
CL-PC-1	Boiler Rm	5-18	—	—												
CL-A-1	Field Blnk		0	—				*			*					
CL-A-2	Rm # 6		920	—				*		*						
CL-A-3	Maint. Garage		920	—				*		*						
CL-W-1	Field Blnk		—	—				*		*						
CL-W-2	Drill Hall		—	4"x4"				*				*				
CL-W-3	Drill Hall		—					*				*				
CL-W-4	Drill Hall		—					*				*				
CL-W-5	Drill Hall		—					*				*				
CL-W-6	Drill Hall		—					*				*				
CL-W-7	Kitchen		—					*				*				
CL-W-8	Locker Rm		—					*				*				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 21 / 10 @ 9.45 Via: FedEx By (Print): Surat Watson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: Mail Date: 6 / 1 / 10 Time: 1905 Initials: MM
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2017 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) Sheet 2 of 3

507190

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Cumberland Armory
2. Job Location: Cumberland, MD
3. Job #: Cumberland Armory
4. Contact Pers[redacted] #: W912K6-09-A-0003
5. Submitted by [redacted] @ phone # (410) 942-0273

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due:
❑ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day + Date Due: 5-28-10
❑ 2 Day
❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
☒ Inclu[redacted] with Report
☒ Email [redacted] bonusenvironmental.com
❑ Fax: [redacted] @us.army.mil
❑ Verba[redacted] @us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 _____ (QTY)
❑ Fiberglass _____ (QTY)

TEM Air – Please Indicate Filter Type:
❑ AHERA _____ (QTY)
❑ NIOSH 7402 _____ (QTY)
❑ Other (specify _____) _____ (QTY)

PLM Bulk
❑ EPA 600 – Visual Estimate _____ (QTY)
❑ EPA Point Count _____ (QTY)
❑ NY State Friable 198.1 _____ (QTY)
❑ Grav. Reduction ELAP 198.6 _____ (QTY)
❑ Other (specify _____) _____ (QTY)

MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield _____ (QTY)
❑ NY State PLM/TEM _____ (QTY)
❑ Residual Ash _____ (QTY)

TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust _____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 _____ (QTY)
❑ Quan. (s/area) Dust D6480-99 _____ (QTY)

TEM Water
❑ Qual. (pres/abs) _____ (QTY)
❑ ELAP 198.2/EPA 100.2 _____ (QTY)
❑ EPA 100.1 _____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples _____ °C)

Media Analysis
☒ Pb Paint Chip 1 (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 22 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid _____ (QTY)
❑ Pb TCLP _____ (QTY)
❑ Drinking Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
❑ Waste Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
❑ Pb Furnace (Media _____) _____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: _____
Collection Media _____
❑ Spore-Trap _____ (QTY)
❑ Surface Swab _____ (QTY)
❑ Surface Tape _____ (QTY)
❑ Other (Specify _____) _____ (QTY)
❑ Surface Vacuum Dust _____ (QTY)
❑ Culturable ID Genus (Media _____) _____ (QTY)
❑ Culturable ID Species (Media _____) _____ (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
CL-W-9	Locker Rm	5-18	—	4"x4"				X				X				
CL-W-10	Locker Rm		—					X				X				
CL-W-11	Locker Rm		—					X				X				
CL-W-12	Stairway handrail		—					X				X				
CL-W-13	Fitness Rm		—					X				X				
CL-W-14	Supply Rm #2		—					X				X				
CL-W-15	Lobby		—					X				X				
CL-W-16	Office Rm 8,9		—					X				X				
CL-W-17	DLC classroom		—					X				X				
CL-W-18	Lunch Rm		—					X				X				
CL-W-19	FMS Rm 19		—					X				X				
CL-W-20	Boiler Rm		—					X				X				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 21 / 10 @ 9:45 Via: FedEx By (Print): Sarah Watson Sign:
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): _____ Sign: _____
3. Results Reported To: _____ Via: _____ Date: ____ / ____ / ____ Time: _____ Initials: _____
4. Comments: _____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2018 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) Sheet 3 of 3

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Cumberland Armory
2. Job Location: Cumberland, MD
3. Job #: Cumberland Armory
4. Contract Perso[redacted] #: W912K6-09-A-0003
5. Submitted by: [redacted] @ phone #: (410) 942-0273

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due:
❑ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day +
❑ 2 Day Date Due:
❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
☒ Inclu[redacted] with Report
☒ Email [redacted] @bonusenvironmental.com
❑ Fax: [redacted] @us.army.mil
❑ Verba[redacted] @us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)

TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

❑ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☒ Pb Paint Chip 1 (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 22 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
CL-W-21	Garage, Bay 2	5-18	—	4"x4"				X				X				
CL-W-22	Battery Rm	↓	—	↓				X				X				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

Appendix C

Photographs

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Building exterior, south entrance

Building exterior, east side

Drill Hall

Boiler Room

Boiler Room, west wall, peeling lead based paint

Maintenance Garage, parts cleaner

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2020 of 5269

BEST AVAILABLE COPY

Maintenance Garage, safety board

Battery Shop, exhaust grill on west wall

Battery Shop

Maintenance Garage, vehicle exhaust system

Maintenance Garage, flammable storage cabinet

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2021 of 5269

BEST AVAILABLE COPY

Appendix D

References

BEST AVAILABLE COPY

BEST AVAILABLE COPY

1. Department of Defense Instruction (0001) 6055.1, Department of Defense Occupational Safety and Health (OS H) Program, August 19, 1998.

2. Army Regulation (AR) 11-34, The Army Respiratory Protection Program, February 15, 1990.

3. DA PAM 40-503, Medical Service, Industrial Hygiene Program, October 30, 2000.

4. Technical Manual (T.M) 5-810-1, Mechanical Design, Heating, Ventilation, and Air Conditioning, June 1991.

5. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEls), American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

6. Industrial Ventilation - A Manual of Recommended Practices, American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

7. UFC 3-410-01 FA Heating, Ventilating, and Air Conditioning, 15 May 2003

8. Occupational Safety and Health Administration (OSHA) Lead in Construction Standard, 29 CFR 1926.62

9. OSHA Lead Standard 29 CFR 1910.1025

10. OSHA Respiratory Protection Standard 29 CFR 1910.134

11. Army Regulation (AR) 385-10, The Army Safety Program, August 23, 2007.

12. RP-1-2004, Office Lighting, Illuminating Engineering Society of North America (IESNA)/ANSI.

13. RP-7-2001, Industrial Lighting, (IESNA)/ANSI.

14. The American Society of Heating, Refrigerating, and Air-Conditioning Engineers (ASHRAE), Standard 62.1-2007, "Ventilation for Acceptable Indoor Air Quality".

15. ASHRAE Standard 55-2004 – “Thermal Environmental Conditions for Human Occupancy”

16. Title 24, CFR, Part 35, Subpart B, Sections 35.110, Definitions of Lead-Based Paint, Housing and Urban Development, U.S. Department of Housing.

17. OSHA Personal Protective Equipment 29 CFR 1910.132

18. OSHA Permissible Exposure Limit (PEL) for General Industry 29 CFR 1910.1000 Z-1 Table

19. Guidelines on Assessment and Remediation of Fungi in Indoor Environments, New York City Department of Health and Mental Hygiene, November 2008.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2023 of 5269

BEST AVAILABLE COPY

20. Mold Remediation in Schools and Commercial Buildings, U.S. Environmental Protection Agency, March 2001

21. Army Facilities Management Information Document on Mold Remediation Issues TG277, February 2002

22. OSHA Welding, Cutting, Brazing 29 CFR 1910.252

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2024 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Cumberland Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Cumberland Readiness Center** **1100 Brown Avenue** **Cumberland, MD 21502**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**June 4, 2013**
Report Date:	**July 2, 2013**

[redacted]

Non-Responsive
Senior Industrial Hygienist

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on June 4, 2013, at the Cumberland Readiness Center located at 1100 Brown Avenue, Cumberland, MD 21502. The survey was performed by Mr. Non-Responsive [redacted].

1. Lead surface, bulk, and air samples were collected. Surface levels of lead were below 200 micrograms per square foot (ug/ft^2) in all locations sampled. See Section 3.0 for detailed sampling results.

2. Lighting levels did not meet the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in two locations. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in the areas sampled.

    b. The relative humidity levels met the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60% in all occupied areas sampled.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 ppm.

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2010 recommended guidelines for mechanically ventilated office buildings and commercial settings.

4. Several areas have suspect asbestos containing material (ACM) floor tiles. Black floor tile mastic was sampled and found to contain 3% chrysotile asbestos. See Section 6.0 for detailed findings.

Section 2.0 Operation Description & Observations

The Cumberland Readiness Center is mainly an administrative facility with a drill hall, offices, distance learning center, and a converted firing range area (currently wall locker storage room). There were approximately 2 full-time employees stationed at this facility at the time of this survey. It was reported that in 2009 a new roof and gas to hot water heating system were installed. There is an FMS facility at this location.

The building is reported to have been built in 1960. It is a two-story structure. The exterior is brick. The interior walls are concrete block, plaster, and paneling with drywall in some of the offices. The floors are concrete, carpet, 9”X9” and 12”X12” floor tiles.

The heating system consists of a gas-fired hot water generating unit. There is no central A/C system; some portable A/C units are present in the facility.

There is no child-care facility in the building.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

This facility has a converted firing range that is now used to store wall lockers.

It was reported that the new heating system (2009) dose not have thermostat controls on one side of the building, the distant learning center side of the building, which is causing temperature extremes in the facility.

This facility has some areas of localized damaged and missing 9”X9” asbestos floor tile, < 10% of the total floor tile. The areas of missing floor tiles have exposed black mastic.

House keeping practices were good.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Drill Hall	<6.7	*
2	Converted Firing Range/Wall Locker Storage	<6.7	*
3	Drill Hall – Floor	*	<110
4	Drill Hall – Top of Pepsi Machine	*	<110
5	Drill Hall – Top of Table	*	<110
6	Kitchen – Top of Refrigerator	*	<110
7	Kitchen – Top of Toaster Oven	*	<110
8	Converted Firing Range/Wall Locker Storage – Floor	*****	<110
9	Converted Firing Range/Wall Locker Storage – Top of Wall Locker	*****	<110
10	Hallway – Floor outside of Converted Firing Range/Wall Locker Storage	*	<110
11	Room 5 Lounge – Top of Bar	*****	<110
12	Basement Hallway – Top of Heating Radiator	*	<110
13	Room 14 Office – Top of Desk	*	<110
14	Distant Learning Center – Top of TV	*	<110
15	Room 11 – Office Top of Book Shelf	*	<110
16	Room 2 243rd Supply – Top of File Cabinet	*	<110
17	Blank - Wipe	*	<12
18	Blank - Air	<3	*
-	**Criteria**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges

2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were below the recommended guideline of 200 ug/ft^2 in all of the locations sampled

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

- No Chipping or Peeling paint was observed at the time of the inspection.

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98011EL). The light meter was last calibrated in November 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Drill Hall	23.8	10	Yes
Kitchen	**24.4**	**50**	**No**
Gym	40.4	30	Yes
Men's Bathroom	28.6	5	Yes
Room 2 243rd Supply	80.5	30	Yes
Room 1 243rd Supply	**20.2**	**30**	**No**
Room 8/9 Office	72.7	30-50	Yes
Room 10 Office	36.6	30-50	Yes
Room 11 Office	35.7	30-50	Yes
Copy Room	25.1	10	Yes
Distant Learning Center	84.1	50	Yes
Room 14 Office	66.3	30-50	Yes
Lounge	31.9	10	Yes
Converted Firing Range/Wall Locker Storage	61.3	30	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting level did not meet the minimum recommended guideline in the kitchen, and room one. Lighting should be improved in these areas.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Room 14 Office	70.0	55.8	553	0.0
Distant Learning Center	73.3	41.4	393	0.0
Room 2 243rd Supply	73.2	42.0	378	0.0
Outdoors	67.0	35.1	352	0.0
Criteria	**68-79**	**30-60**	**<1,052**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements met the recommended 68-79°F in all occupied areas.

- Relative humidity levels met the recommended guidelines in all sampled areas. Relative humidity should be maintained at 30-60%.

- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level for this survey. For this survey, carbon dioxide levels did not exceed the recommended ceiling of 1,052 ppm. This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observation were noted:

    - It was reported that the new heating system (2009) dose not have thermostat controls on one side of the building, the distant learning center side of the building, which is causing temperature extremes in the facility.

Section 6.0 Suspect Asbestos Containing Building Materials

The following suspect ACM was noted at the time of this survey:

1. The facility has 9”X9” floor tiles in most rooms green, black, and red.

2. The following areas have localized <10% of the total floor tile present, damaged or missing floors tiles exposing the black mastic, and should be repaired:
   - Room 12 approximately 10 missing tiles
   - Room 2 243rd supply approximately 45 missing tiles

A bulk sample was collected from room 12 of the black mastic where the 9”X9” floor tiles are missing. The laboratory results showed that the mastic contained 3% chrysotile asbestos.

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98011EL	11/2012	NA
SKC Air Sampling Pump	647598	6/4/13	2.5 LPM
SKC Air Sampling Pump	648349	6/4/13	2.5 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG-MD	**Chain Of Custody:**	516067
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cumberland RC	**Date Submitted:**	6/10/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	[redacted] **Report Date:** 6/12/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13068537	1	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13068538	2	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13068539	3	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068540	4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068541	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068542	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068543	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068544	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068545	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068546	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068547	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068548	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068549	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068550	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068551	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068552	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13068553	17	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
13068554	18	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	ARNG-MD	**Chain Of Custody:**	516067
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cumberland RC	**Date Submitted:**	6/10/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/12/2013 **Report Date:** 6/12/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: Suphin Chinnapad

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516067 page 1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG MD
2. Job Location: Cumberland RC
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Pers[redacted] @ phone # (410) 942-0273
5. Submitted by [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☒ Incl[redacted]th Report
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day + Date Due: 6/17/13	☒ [redacted]
Comments:	☐ 2 Day ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Fax: [redacted]us.army.mil
		☐ Verb[redacted]us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☒ EPA 600 – Visual Estimate 1 (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type Cloth) 15 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1 Drill Hall		6-4	450					X		X							Date/Time: Contact: By:
2 Commental	Range		450					X		X							
3 Drill Hall - floor				100 cm2				X				X					
4 Drill Hall - Repair Machine								X				X					
5 Drill Hall	Tables							X				X					Date/Time: Contact: By:
6 Kitchen - Top	of Fridge							X				X					
7 Kitchen - Top	of toaster oven							X				X					
8 Commental Range	Floor							X				X					
9 Commental Range	locker							X				X					Date/Time: Contact: By:
10 Hallway Range	floor							X				X					
11 Rec - S	lounge							X				X					
12 Basement Hall	- Boiler																

Juice did not survive (when receipt - Nicole)

1. Date/Time RCVD: 6 / 10 / 13 @ 910 Via: Fedex By (Print): NLM Sign: ____

LABORATORY STAFF ONLY: (CUSTODY)
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____

Posted to NGB FOIA Reading Room May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

5160207
page 2-2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG MD
2. Job Location: Cumberland RC
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Per: Non-Responsive @ ph Non-Responsive 0273
5. Submitted By: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☐ 5 Day +	☒ Br Non-Responsive
Comments: ____	☐ 2 Day Date Due: ____	☐ Fa [redacted] @us.army.mil
	☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☐ V [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
- ☐ Pb Air ____ (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION					ANALYSIS							MATRIX					CLIENT CONTACT (LABORATORY STAFF ONLY)		
CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	Date/Time:	Contact:	By:
13 Room 14	Desk	6-9		100cm				X				X							
14 Learning Center	TV	↓		↓				X				X							
15 Rm 11	Book Shelf							X				X							
16 Room 2	File Cabinet			↓				X				X							
17 Blank - Wipe				0				X				X					Date/Time:	Contact:	By:
18 Blank - Air			0					X		X									
19 Bulk Asbestos	Floor tile	↓					X												
	mastic																		
																	Date/Time:	Contact:	By:

LABORATORY USE ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____
4. Comments: ____

Posted to NGB FOIA Reading Room May 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

NVLAP 101143-0

Client:	National Guard Bureau	**Job Name:**	ARNG-MD	**Chain Of Custody:**	516067
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Cumberland RC	**Date Analyzed:**	6/14/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003		

Attention: Non-Responsive

Summary of Polarized Light Microscopy

AMA Sample Number	Client Sample #	Total Asbestos	Chrysotile Percent	Amosite Percent	Crocidolite Percent	Other Asbestos Percent	Mineral Wool Percent	Fiberglass Percent	Organic Percent	Synthetic Percent	Other Percent	Particulate Percent	Sample Type	Sample Color	Homogeneity	Analyst ID	Comments
13068555	19	3	3	--	--	--	--	--	--	--	--	97	MS	Black	Homogeneous	LBP	

The following footnotes only apply to those samples which the total asbestos result is flagged with a note number.

1 TEM RECOMMENDATION - Please note, due to resolution limitations with optical microscopy and/or interference from matrix components of this sample, results which are reported via PLM as negative or trace (<1%) for asbestos may contain a significant quantity of asbestos. It is recommended that the additional analytical technique of TEM be used to check for asbestos fibers below the resolution limits of optical microscopy.

2 MATRIX REDUCTION RECOMMENDATION - Please note, due to interference from the matrix components of this sample, results which are reported via PLM as negative or trace (<1%) for asbestos may contain a significant quantity of asbestos which is obscured from view. It is recommended that the additional preparation technique of gravimetric reduction be performed on this sample to minimize the obscuring effects of matrix components, followed by reanalysis by PLM and/or TEM.

Analysis Method - EPA/600/R-93/116 dated July 1993

NAD = "No Asbestos Detected" TR = "Trace equals less than 1% of this component"

Uncertainty: For samples containing asbestos in range of 1-10% the CV is 0.43, 11-35% CV=0.55, >35 CV=0.23

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

Technical Director Peerawut Chaikeenee **Analyst(s)** Lom Butruk

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

NVLAP (101143-0) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516067

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: ARNG - MD
2. Job Location: Cumberland RC
3. Job #: [redacted] P.O. #: W912K6-09-A-0003
4. Contact Person: Non-Responsive [redacted] @ phone: Non-Responsive 0273
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS		REPORT TO:
☐ Immediate Date Due:	NRM ~~☒ Immediate~~	☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day	☒ 5 Day + Date Due: 6/17/13	☒ Non-Responsive @ cumphamsepla.com
Comments:	☐ 2 Day	☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☐ @us.army.mil
			☐ [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☒ EPA 600 – Visual Estimate 1 (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type Ghost) 15 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1 Drill Hall		6-4	450					X		X							Date/Time: Contact: By:
2 Converted Range			450					X		X							
3 Drill Hall - floor				100 cm2				X				X					
4 Drill Hall - Repair Machine								X				X					
5 Drill Hall - Table								X				X					Date/Time: Contact: By:
6 Kitchen - Top of Fridge								X				X					
7 Kitchen - Top of toaster oven								X				X					
8 Converted Range - Floor								X				X					
9 Converted Range - locker								X				X					Date/Time: Contact: By:
10 Hallway Range - floor								X				X					
11 Room 5 - lounge								X				X					
12 Basement Hall - Heater																	

Tube did not secured when receipt (illegible)

LABORATORY USE ONLY (CUSTODY)
1. Date/Time RCVD: 6/10/13 @ 9:10 Via: FedEx By (Print): NRM Sign:
2. Date/Time Analyzed: 6/17/13 @ 8:30 By (Print): Lom BUTRUK Sign: Lom Butruk
3. Results Reported To: Shirley Chaymany Via: Email Date: 6/17/13 Time: Initials: LB
4. Comments: 7945 0138 5859 60

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516067

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: ARNG - MD
2. Job Location: Cumberland RC
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Perso[redacted] Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☐ 5 Day + Date Due: ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Emai[redacted] Non-Responsive ☐ Fax: ☐ Verba[redacted] ous.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 (QTY)
- ☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA (QTY)
- ☐ NIOSH 7402 (QTY)
- ☐ Other (specify) (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate (QTY)
- ☐ EPA Point Count (QTY)
- ☐ NY State Friable 198.1 (QTY)
- ☐ Grav. Reduction ELAP 198.6 (QTY)
- ☐ Other (specify) (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield (QTY)
- ☐ NY State PLM/TEM (QTY)
- ☐ Residual Ash (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 (QTY)
- ☐ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
- ☐ Qual. (pres/abs) (QTY)
- ☐ ELAP 198.2/EPA 100.2 (QTY)
- ☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
- ☐ Pb Paint Chip (QTY)
- ☐ Pb Dust Wipe (wipe type) (QTY)
- ☐ Pb Air (QTY)
- ☐ Pb Soil/Solid (QTY)
- ☐ Pb TCLP (QTY)
- ☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Pb Furnace (Media) (QTY)

Fungal Analysis

Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ☐ Spore-Trap (QTY)
- ☐ Surface Swab (QTY)
- ☐ Surface Tape (QTY)
- ☐ Surface Vacuum Dust (QTY)
- ☐ Culturable ID Genus (Media) (QTY)
- ☐ Culturable ID Species (Media) (QTY)
- ☐ Other (Specify) (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
13 Room 14	Desk	6-4		100 cm²				X				X				
14 Learning Center	TV							X				X				
15 Rm 11	Book Shelf							X				X				
16 Room 2	File Cabinet							X				X				
17 Blank - Wipe				0				X				X				
18 Blank - Air			0					X		X						
19 Bulk	Asbestos Floor tile						X									
	mastic - Black															

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

LABORATORY STATUS: (CUSTODY)

1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time:
4. Comments:

Posted to NGB FOIA Reading Room May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD) Released by National Guard Bureau

Appendix B. Photographs

Exterior of facility

Drill Hall

Converted firing range/wall locker storage area

One of two locations of missing 9”X9” floor tile exposing black mastic, this location is room 2, 243rd supply room, the other location is room 12

Appendix C. Floor Plan

BEST AVAILABLE COPY

Armory Space Utilization

AS OF: 10/26/2011

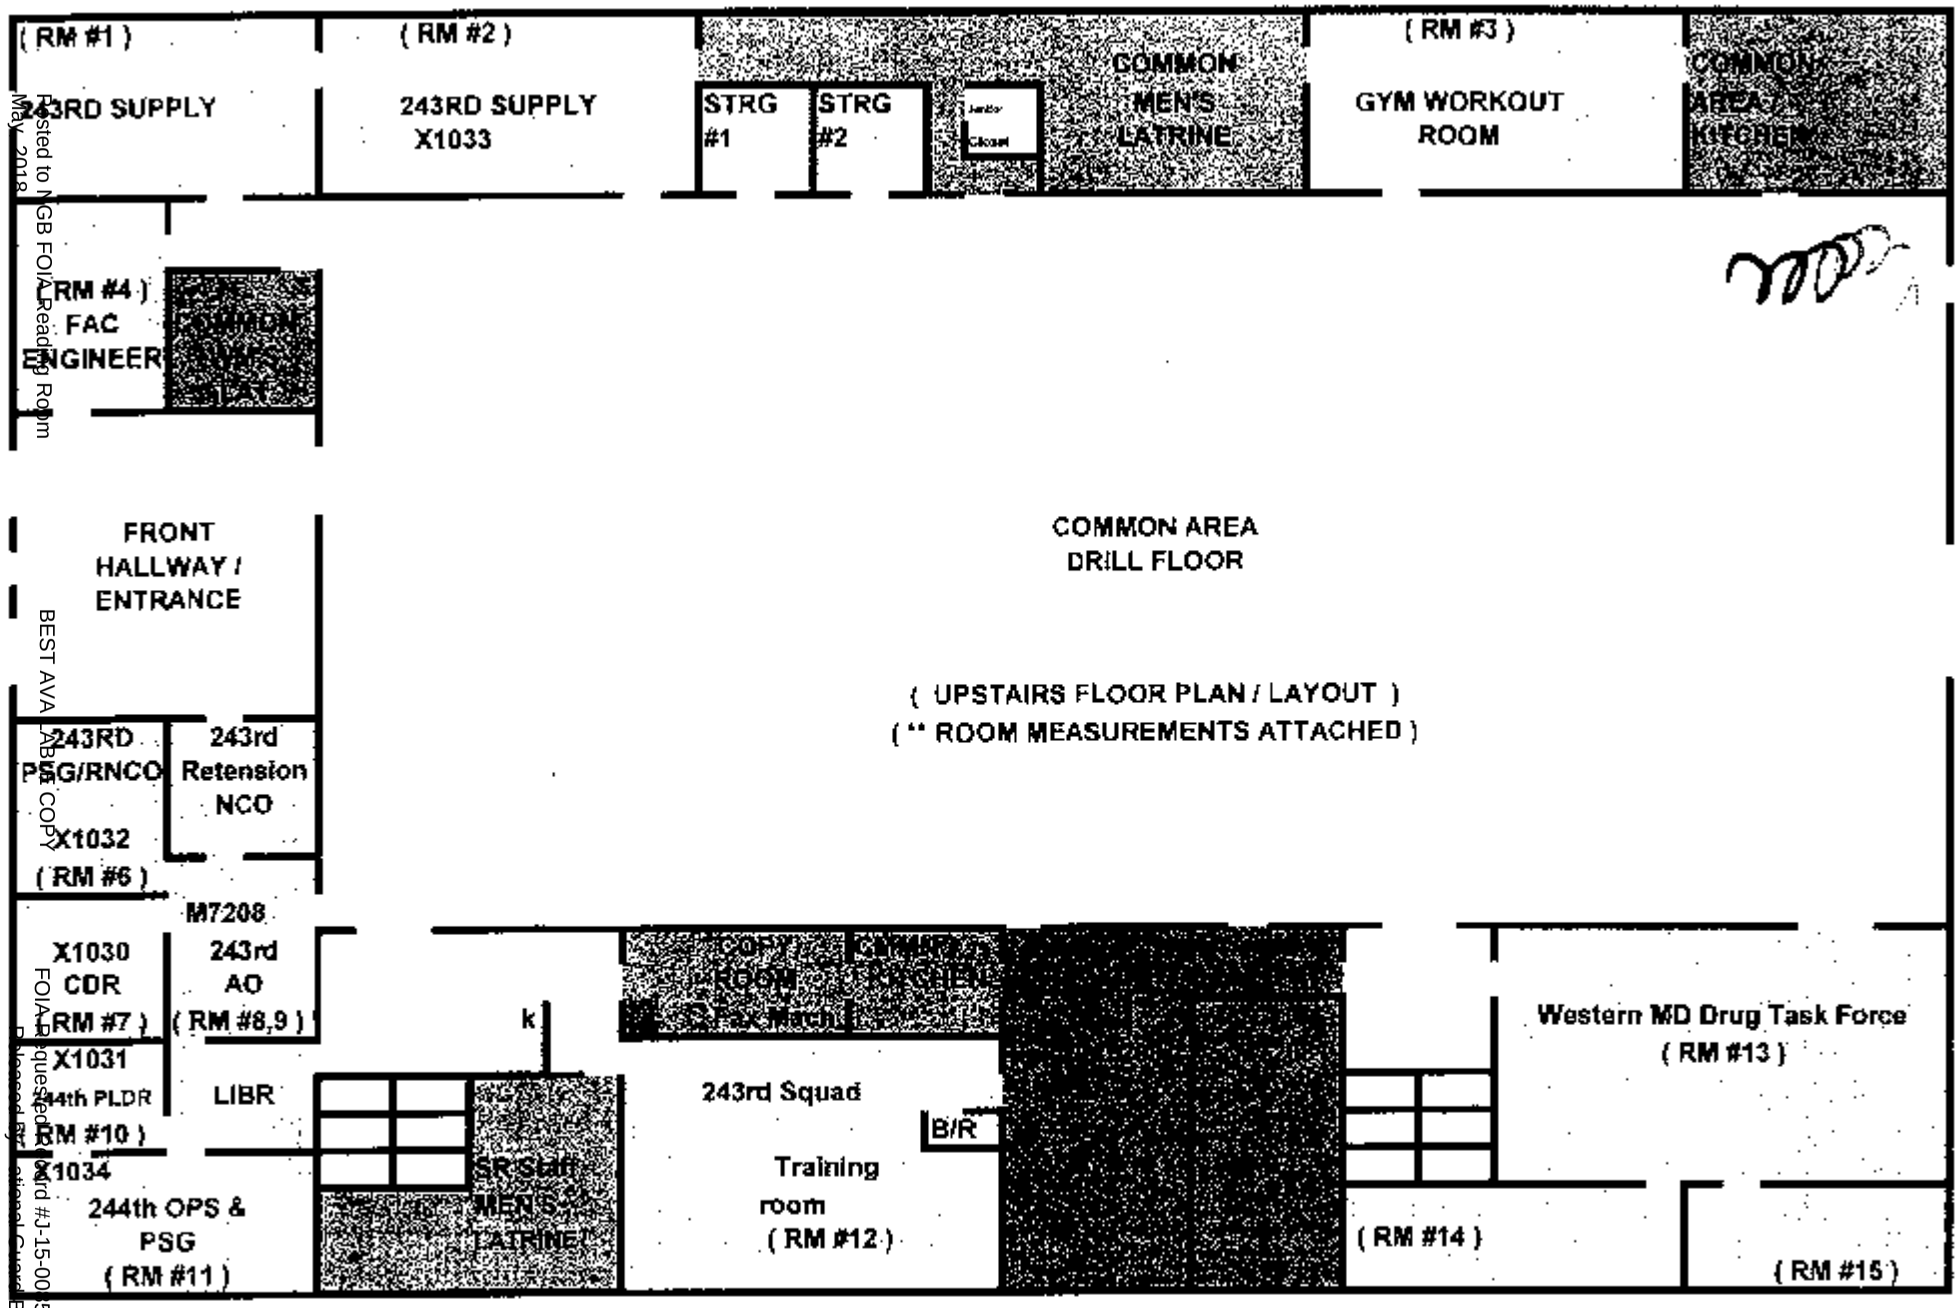

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0005 (MD)
Released By National Guard Bureau

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2050 of 5269

O – YOU ARE HERE

EXIT ROUTE

SECONDARY EXIT ROUTE

AFTER LEAVING BUILDING
ASSEMBLE ON FRONT PARKING LOT

X – NEAREST FIRE EXTINGUISHER

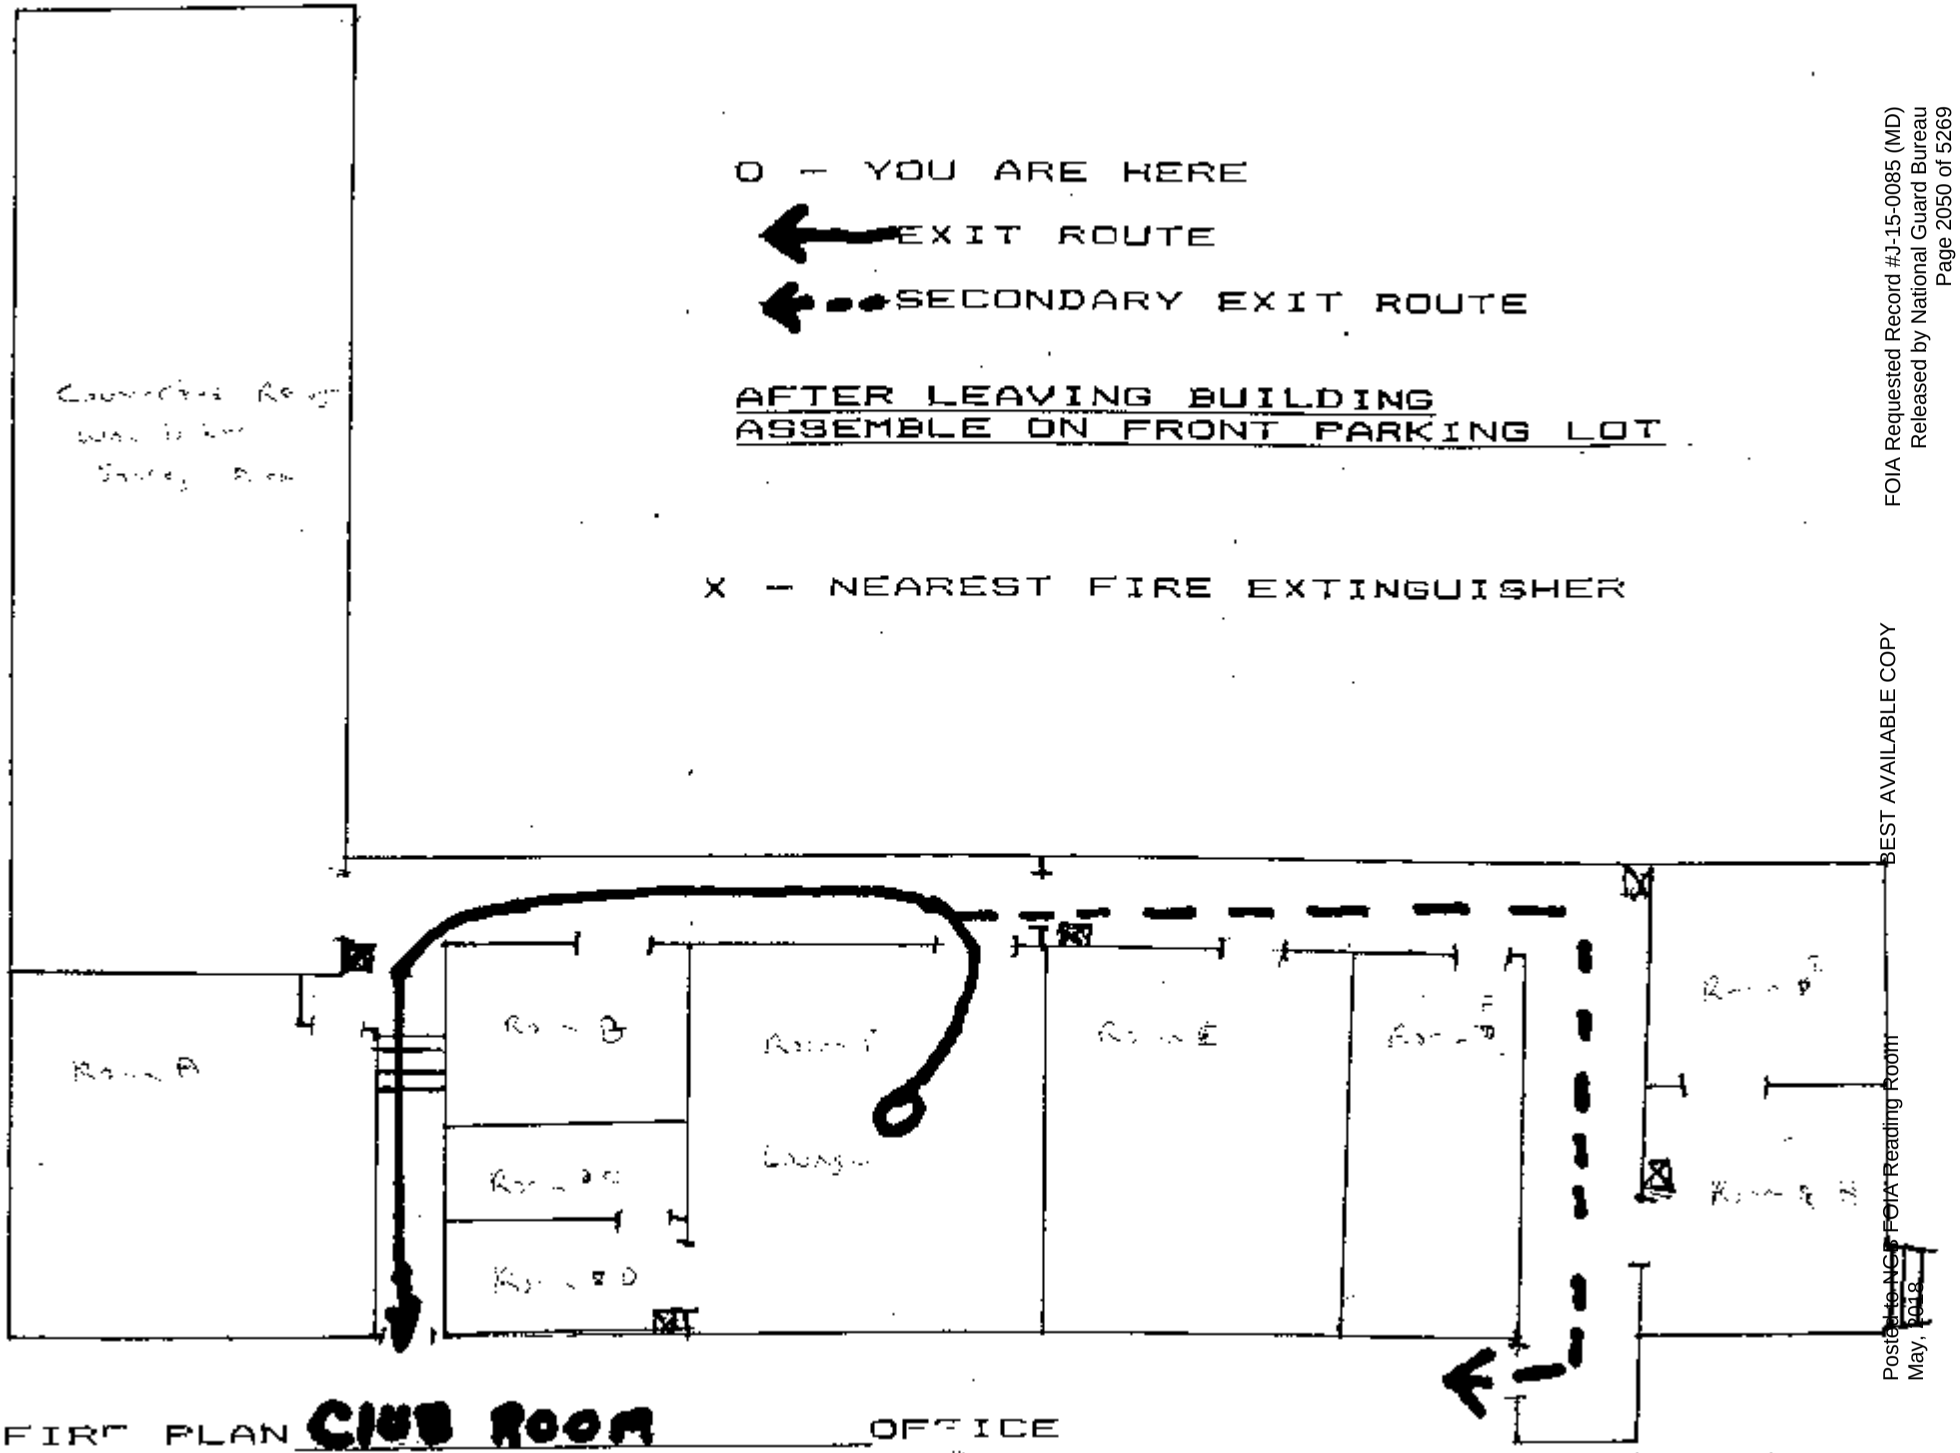

FIRE PLAN CLUB ROOM

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MEMORANDUM FOR Region North Industrial Hygiene Office (NGB-AVS-SI-IH/ Ms. Non-Responsive), Army National Guard Bureau, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, SGM Jerome Maynard Grollman Armory, Dundalk, MD, Project No. 55-ML-01ED-03/05

1. Enclosed is the final copy of the subject report and two CD-ROMs.

2. The project number for this service reflects the current fiscal year of dispatch and the actual field work which was completed for fiscal year 2003. The State of Maryland Army National Guard occupational health nurse was immediately notified in writing of findings necessitating immediate corrective action in Maryland armories. In addition, the National Guard Bureau Region North Industrial Hygiene Office has been notified of all the results of lead in dust sampling conducted in all facilities. Draft reports were reviewed by you or other members of the National Guard and members of this Center, including our editorial staff, during drafting stages in report preparation leading up to the final report.

3. Our point of contact is Ms. Non-Responsive at commercial 410-436-5475/3118, DSN 584-5475/3118, or electronic mail: Non-Responsive@us.army.mil

FOR THE COMMANDER:

Non-Responsive

Encl

Director, Occupational Health Sciences

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
DUNDALK ARMORY
DUNDALK, MD
PROJECT NO. 55-ML-01ED-03/05
23 JULY 2003

1. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at these facilities. The survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee.

2. FINDINGS.

a. Lead. Lead levels in dust exceeded the recommended limit in several areas of the building. Higher results in the former indoor firing range (IFR) indicate that it was not properly decontaminated when it was converted to a storage area. Personnel working in the former IFR are exposed to lead on stored materials and track lead into other areas of the armory and into their own vehicles and homes. Lead-contaminated paint has begun to deteriorate and will continue to do so unless it is stabilized. Falling paint is likely to contribute to the levels of lead in dust. Lead in dust sample results from several areas in the armory greatly exceeded the regulatory limits for children under 6 years of age. Although children are unlikely to occupy this armory for more than the minimum 60 hours per year required for the regulatory limits to apply, we believe that these conditions pose a significant health hazard from lead exposure to children using this facility that warrants clean-up to these limits before allowing children to continue to use it.

b. Asbestos. All known asbestos in the armory has been abated.

c. Lighting. All areas were judged to be adequately lit except for Room 102 A.

3. RECOMMENDATIONS.

a. Lead. The Risk Assessment Codes (RACs) for health hazards due to lead exposure were assessed as 3 for adult exposure and 2 for child exposure. To minimize exposure to lead develop and implement a written Lead Hazard Management Plan for Dundalk Armory. Ensure that the armory is in compliance with the Occupational Safety and Health Administration (OSHA) general industry lead standard, Title 29 Code of Federal Regulations (CFR) Part 1910.1025, and the OSHA Lead in Construction Standard, Title 29 CFR Part 1926.62. Address all potential lead

Printed on Recycled Paper
BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

hazards before continuing to extend the use of this facility to children. If children will continue to use this facility, clean surfaces to the Environmental Protection Agency and State of Maryland lead in dust standards. Discontinue events and advertising until cleanup is completed. Clean all areas where sampling results showed elevated levels of lead. At a minimum, if only adults use this facility, clean to the recommended safe levels for adults. Follow the comprehensive guidelines for cleaning in Appendix E. Follow the decontamination requirements for the IFR in the Addendum to National Guard Bureau All States Letter P01-0075. Consult with the Maryland Armory Environmental Coordinator concerning disposal requirements after cleanup. Stabilize the deteriorated paint on the walls. Pending clean-up, restrict access to the former IFR by keeping it locked. Post a sign warning against use of the room except in an emergency. Ensure that personnel wear disposable gloves and disposable coveralls to prevent tracking lead out when working in the former IFR.

b. Lighting. The RAC for health hazards associated with inadequate illumination was assessed as 5. Increase lighting levels in Room 102 A to 28-46 foot candles to conform to the Illuminating Engineering Society of North America guidelines.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2054 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
DUNDALK ARMORY
DUNDALK, MD
PROJECT NO. 55-ML-01ED-03/05
23 JULY 2003

1. REFERENCES. See Appendix A.

2. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. The survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee.

3. AUTHORITY. Fax, National Guard Bureau (NGB) Region North Industrial Hygiene Office. (NGB-AVS-SI-IH/Ms. Non-Responsive), 28 February 2003, subject: SAB

4. BACKGROUND INFORMATION.

a. Armory Mission. Light infantry battalion.

b. Facility Use by Children. The point of contact stated that the armory periodically sponsors family support group activities and meals. The Maryland Military Department is currently advertising Dundalk Armory as available for rental for activities that include young children.

5. FACILITY EVALUATION.

a. Sampling Locations and Results. Samples were collected for lead in air, on surfaces (wipe samples), and in bulk paint to determine the presence of lead hazards. Sample locations are shown in Appendix B.

b. Physical Condition of Facility.

(1) General. There was deteriorated paint throughout the armory. Otherwise, the facility appeared to be in good physical condition. No mold or moisture source capable of supporting mold was observed.

BEST AVAILABLE COPY

(2) Asbestos. At the time of the survey, the building was under contract to have all asbestos floor tiles replaced and to have the asbestos insulation on pipes removed. The building manager, MAJ Non-Responsive, stated on 22 March 2005 that all known asbestos has been removed.

(3) Safety Hazards. Personnel conducting the survey reported that furniture and other equipment on the drill hall floor posed a potential tripping hazard. MAJ Non-Responsive stated on 22 March 2005 that all equipment had been removed from the drill hall.

c. Safety and Industrial Hygiene Programs. There were no written records for Safety or Industrial Hygiene programs, nor was there any documentation of program elements.

d. Heating, Ventilation, and Air Conditioning Systems. The building was centrally heated by steam baseboard radiators. Some areas of the building had central air conditioning, but most areas had window air conditioning units.

e. Lighting. All areas of the armory were judged to be adequately lit except for Room 102A, where lighting levels of 17-20 foot candles were measured.

f. Converted Indoor Firing Range (IFR). The IFR had been converted to a storage area.

g. Photographs. See Appendix C.

h. Survey Date. 23 July 2003.

6. ASSESSMENT CRITERIA FOR LEAD. See Appendix D for details.

a. Lead in Air. The army occupational exposure limit for lead in air is the Occupational Safety and Health Administration (OSHA) 8-hour time-weighted average Permissible Exposure Limit of 50 micrograms of lead per cubic meter ($\mu g/m^3$) of air.

b. Lead in Dust. The Environmental Protection Agency (EPA) and State of Maryland limits for lead in dust are 40 micrograms per square foot ($\mu g/ft^2$) on floors, 250 $\mu g/ft^2$ on window sills, and 400 $\mu g/ft^2$ in window troughs. These limits apply to pre-1978 army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The NGB Region North concurs with the U.S. Army Center for Health Promotion and Preventive Medicine-recommended safe limit of 200 $\mu g/ft^2$ on floors and frequently-contacted surfaces.

c. Lead in Paint. Paint containing lead levels of 0.5% or more by weight in dried solid (also reported as 5000 milligrams per kilogram) is considered to be lead based paint according to both Federal and Maryland State Regulations. Paint containing lead levels of more than 0.7 milligrams per square centimeter is considered to be lead based paint according to Maryland

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2056 of 5269

BEST AVAILABLE COPY

State Regulations. In AR 420-70, Buildings and Structures, lead-contaminated paint is defined as any paint containing detectable amounts of lead. The army considers lead-contaminated paint to be potentially hazardous to children if it is disturbed or deteriorating.

d. Lead Carcinogenicity. The Department of Health and Human Services National Toxicology Program (NTP) released the Report on Carcinogens, Eleventh Edition in February 2005. The NTP report lists "lead and lead compounds" as "reasonably anticipated to be human carcinogens".

7. SAMPLING RESULTS FOR LEAD. See Appendix B.

a. Lead in Air. All air sample results were below the laboratory reporting limits for lead in air of 5.8-5.9 µg/m³ and were therefore far below the army exposure limit.

b. Bulk Paint Samples. The two bulk samples of deteriorated paint had detectable levels of lead and were therefore lead-contaminated paint.

c. Lead in Dust. Four of the10 surface wipe results were above the recommended adult exposure limit. The highest measured result was 47,000 µg/ft² on the floor of the former IFR in the bullet trap area (photo #1355). A level of 973 µg/ft² was found on a baffle suspended from the ceiling in the former IFR (photos #1356-1358). Levels of 518 µg/ft² and 344 µg/ft² were found on the operations office window sill (photo #1364) and on a work table in the exercise area in the garage (photo #1360) respectively.

d. Child Exposure to Lead in Dust. Five of the 10 surface lead wipe results were above the EPA and State of Maryland exposure limits for children under the age of six.

8. DISCUSSION AND CONCLUSIONS.

a. Lead Exposure.

(1) Adults. No significant airborne exposures were measured. Lead levels in dust exceeded the recommended limit in several areas of the building. Higher results in the former IFR indicate that it was not properly decontaminated when it was converted to a storage area. Personnel working in the former IFR are exposed to lead on stored materials and track lead into other areas of the armory and into their own vehicles and homes. Lead-contaminated paint has begun to deteriorate and will continue to do so unless it is stabilized. Falling paint is likely to contribute to the levels of lead in dust. At a minimum, the former IFR should be properly decontaminated in accordance with NGB guidance, other rooms with excessive levels should be cleaned using appropriate techniques, and all deteriorated paint surfaces should be stabilized. In the meantime, personnel working in the former IFR should wear disposable garments to prevent them from tracking lead out, and this room should be locked and posted for access in

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2057 of 5269

BEST AVAILABLE COPY

emergencies only. Compliance with OSHA lead regulations is required to protect personnel working in areas with elevated lead levels or repairing deteriorated lead-contaminated paint. A written Lead Hazard Management Plan should be developed and implemented to properly manage lead hazards and their sources until they are eliminated.

(2) Children. Lead in dust results from several areas in the armory greatly exceeded the regulatory limits for children under 6 years of age, and the two samples of deteriorated paint were found to be lead-contaminated paint. Lead is being tracked throughout the facility. Although children are unlikely to occupy this armory for more than the minimum 60 hours per year required for the regulatory limits to apply, we believe that these conditions pose a significant health hazard from lead exposure to children using this facility that warrants clean-up to these limits before allowing children to continue to use it.

b. Lighting. Lighting levels in Room 102 A should be increased to 28-46 foot candles to conform to the Illuminating Engineering Society of North America standard.

9. RECOMMENDATIONS.

The Department of Defense Instruction 6055.1 provides a method for assigning Risk Assessment Codes (RACs) to health hazards that are based on the magnitude of exposures to physical, chemical, and biological agents and the possible medical effects. A RAC is an expression of the risk associated with a hazard that combines the hazard severity and accident probability into a single numeral. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead Exposure for Adults. RAC 3. Lead Exposure for Children. RAC 2.

(1) Develop and implement a written Lead Hazard Management Plan for Dundalk Armory. Ensure that the armory is in compliance with the Occupational Safety and Health Administration (OSHA) general industry lead standard, Title 29 Code of Federal Regulations, Parts1910.1025, and the OSHA Lead in Construction Standard, Title 29 CFR Part 1926.62.

(2) Address all potential lead hazards before continuing to extend the use of this facility to children. If children will continue to use this facility, clean surfaces to the EPA and State of Maryland lead in dust standards of 40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ on window sills. Discontinue advertising and hosting events that include children until cleanup is completed.

(3) Clean all areas where sampling results showed elevated levels of lead. At a minimum, if only adults use this facility, clean to the recommended safe levels for adults. Follow the comprehensive guidelines for cleaning in Appendix E. Follow the decontamination

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2058 of 5269

BEST AVAILABLE COPY

requirements for the IFR provided in the Addendum to NGB All States Letter P01-0075. Consult with the Maryland Armory Environmental Coordinator concerning disposal requirements after cleanup.

(4) Stabilize the deteriorated paint on the walls.

(5) Pending clean-up, restrict access to the former IFR by keeping it locked. Post a sign warning against use of the room except in an emergency. Ensure that personnel wear disposable gloves and disposable coveralls to prevent tracking lead out when working in the former IFR.

b. Lighting. RAC 5. Increase lighting levels in Room 102A to 28-46 foot candles.

10. SITE MAP. See Appendix F.

11. MOLD GUIDANCE. There was no visible mold present at the time of the survey. If mold occurs in the future, refer to the mold guidance in Appendix G.

12. ADDITIONAL ASSISTANCE. For additional assistance or questions concerning this report, please contact the undersigned at DSN 584-5475/3118, commercial (410) 436-5475/3118, or electronic mail: Non-Responsive@us.army.mil

Non-Responsive

Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive

Technical Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2059 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2060 of 5269

APPENDIX A

REFERENCES

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current edition.
http://www.osha.gov/comp-links.html

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998.
http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990.
http://www.usapa.army.mil/pdffiles/r40_5.pdf

4. AR 385-10, The Army Safety Program, 29 February 2000.
http://www.usapa.army.mil/pdffiles/r385_10.pdf

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000.
http://www.usapa.army.mil/pdffiles/p40_503.pdf

6. American Conference of Governmental Industrial Hygienists (ACGIH), Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), ACGIH Cincinnati, OH, 2005.
http://www.acgih.org/TLV/

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. Illuminating Engineering (February 1, 1993) RP-1-1993, American National Standard Practice for Office Lighting, ANSI/IES RP-1-1993.

9. USACHPPM Interim Report No. 39-EJ-1157-99, Derivation of Wipe Surface Screening Levels for Environmental Chemicals, 1999.

10. OSHA Instruction, CPL 02-02-058 - CPL 2-2.58 - 29 CFR 1926.62, Lead Exposure In Construction; Interim Final Rule-- Inspection and Compliance, Procedures, 1993.
http://www.osha.gov/pls/oshaweb/owadisp.show_document?p_table=DIRECTIVES&p_id=1570

11. U.S. Department of Housing and Urban Development (HUD), Technical Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing 1998.
http://www.hud.gov/offices/lead/guidelines/hudguidelines/index.cfm

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2061 of 5269

BEST AVAILABLE COPY

APPENDIX B

SAMPLING SHEETS AND LAB ANALYSES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2062 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

August 15, 2003

Laboratory Code:	**RES**
Subcontract Number:	**NA**
Laboratory Report:	**RES 96014-1**
Project Description:	**None Given**
	Pikesville NG Armory

[redacted]
USACHPPM
USACHPM, ATTN: MCHB-TS-OFS Bldg 1570
APG MD 21010

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the American Industrial Hygiene Association, Lab ID 101533 - Accreditation Certificate #480. The laboratory is currently proficient in both PAT & ELPAT programs respectively.

Reservoirs has analyzed the following sample(s) using Atomic Emission Spectroscopy - Inductively Coupled Plasma (AES-ICP) per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the analysis table. Results have been sent to your office.

RES 96014-1 is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those authorized by the client. Samples will be disposed of after sixty days unless longer storage is requested. If you should have any questions about this report, please feel free to call me at 303-964-1986.

Sincerely,

[redacted]

President

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2063 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN PAINT

RES Job Number:	RES 96060-1
Client:	Army National Guard IH – West
Client Project Number / P.O.:	None Given
Client Project Description:	None Given
Date Samples Received:	July 30, 2003
Analysis Type:	USEPA SW846 3050B / AA (7420)
Turnaround:	3-5 Day
Date Samples Analyzed:	July 31, 2003

Client ID Number	Lab ID Number	Detection Limit (%)	LEAD CONCENTRATION (%)
PI BULK 01	EM 800569	0.005	0.149
PI BULK 02	EM 800570	0.005	0.396
PI BULK 03	EM 800571	0.005	0.863
PI BULK 04	EM 800572	0.005	0.139
PI BULK 05	EM 800573	0.005	0.067
PI BULK 06	EM 800574	0.005	0.120
PI BULK 07	EM 800575	0.005	0.110
PI BULK 08	EM 800576	0.005	0.259
PI BULK 09	EM 800577	0.005	0.058
PI BULK 010	EM 800578	0.005	0.008
DK BULK 01	EM 800579	0.005	0.136
DK BULK 02	EM 800580	0.005	0.014
CA BULK 01	EM 800581	0.005	0.345
CA BULK 02	EM 800582	0.005	0.118
CA BULK 03	EM 800583	0.005	0.037
CA BULK 04	EM 800584	0.005	0.154
CA BULK 05	EM 800585	0.005	0.034
CA BULK 06	EM 800586	0.005	0.005

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2064 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN AIR

RES Job Number: **RES 96012-1**
Client: **USACHPPM**
Client Project Number / P.O.: **None Given**
Client Project Description: **Dun Daik NG Armory**
Date Samples Received: **July 29, 2003**
Analysis Type: **NIOSH AA(7082)**
Turnaround: **3-5 Day**
Date Samples Analyzed: **July 30, 2003**

Client ID Number	Lab ID Number	Air Volume (L)	LEAD (µg)	Detection Limit (µg/m³)	LEAD CONCENTRATION (µg/m³)
DKAS-01	EM 799976	428	BDL	5.8	BDL
DKAS-02	EM 799977	428	BDL	5.8	BDL
DKAS-03	EM 799978	426	BDL	5.9	BDL
DKPb-Blank01	EM 799979	0	BDL	----	----
DKPb-Blank02	EM 799980	0	BDL	----	----

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2065 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN PAINT

RES Job Number:	RES 96060-1
Client:	Army National Guard IH - West
Client Project Number / P.O.:	None Given
Client Project Description:	None Given
Date Samples Received:	July 30, 2003
Analysis Type:	USEPA SW846 3050B / AA (7420)
Turnaround:	3-5 Day
Date Samples Analyzed:	July 31, 2003

Client ID Number	Lab ID Number	Detection Limit (%)	LEAD CONCENTRATION (%)
PI BULK 01	EM 800569	0.005	0.149
PI BULK 02	EM 800570	0.005	0.396
PI BULK 03	EM 800571	0.005	0.863
PI BULK 04	EM 800572	0.005	0.139
PI BULK 05	EM 800573	0.005	0.067
PI BULK 06	EM 800574	0.005	0.120
PI BULK 07	EM 800575	0.005	0.110
PI BULK 08	EM 800576	0.005	0.259
PI BULK 09	EM 800577	0.005	0.058
PI BULK 010	EM 800578	0.005	0.008
DK BULK 01	EM 800579	0.005	0.136
DK BULK 02	EM 800580	0.005	0.014
CA BULK 01	EM 800581	0.005	0.345
CA BULK 02	EM 800582	0.005	0.118
CA BULK 03	EM 800583	0.005	0.037
CA BULK 04	EM 800584	0.005	0.154
CA BULK 05	EM 800585	0.005	0.034
CA BULK 06	EM 800586	0.005	0.005

BDL – Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2066 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN AIR

RES Job Number:	RES 96012-1
Client:	USACHPPM
Client Project Number / P.O.:	None Given
Client Project Description:	Dun Daik NG Armory
Date Samples Received:	July 29, 2003
Analysis Type:	NIOSH AA(7082)
Turnaround:	3-5 Day
Date Samples Analyzed:	July 30, 2003

Client ID Number	Lab ID Number	Air Volume (L)	LEAD (µg)	Detection Limit (µg/m³)	LEAD CONCENTRATION (µg/m³)
DKAS-01	EM 799976	428	BDL	5.8	BDL
DKAS-02	EM 799977	428	BDL	5.8	BDL
DKAS-03	EM 799978	426	BDL	5.9	BDL
DKPb-Blank01	EM 799979	0	BDL	---	---
DKPb-Blank02	EM 799980	0	BDL	---	---

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2067 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

August 8, 2003

Laboratory Code:	**RES**
Subcontract Number:	**NA**
Laboratory Report:	**RES 96061-1**
Project Description:	**None Given**
	None Given

Non-Responsive
Army National Guard IH - West
3401 Quebec Street, Suite 7200
Denver CO 80207

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the American Industrial Hygiene Association, Lab ID 101533 - Accreditation Certificate #480. The laboratory is currently proficient in both PAT & ELPAT programs respectively.

Reservoirs has analyzed the following sample(s) using Atomic Emission Spectroscopy - Inductively Coupled Plasma (AES-ICP) per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the analysis table. Results have been sent to your office.

RES 96061-1 is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those authorized by the client. Samples will be disposed of after sixty days unless longer storage is requested. If you should have any questions about this report, please feel free to call me at 303-964-1986.

Sincerely,

Non-Responsive

President

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2068 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	**RES 96061-1**
Client:	**Army National Guard IH - West**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**None Given**
Date Samples Received:	**July 30, 2003**
Analysis Type:	**USEPA SW846 3050B / AA(7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 4, 2003**

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
PI Blank 1	EM 800587	0.11	BDL	23	BDL
PI Blank 2	EM 800588	0.11	BDL	23	BDL
PI Blank 3	EM 800589	0.11	BDL	23	BDL
PI Blank 4	EM 800590	0.11	BDL	23	BDL
PI W16	EM 800591	0.11	22.8	23	207
PI W17	EM 800592	0.11	14.2	23	129
PI W18	EM 800593	0.11	56.2	23	511
PI W19	EM 800594	0.11	26.2	23	238
PI W20	EM 800595	0.11	10.1	23	92
PI W21	EM 800596	0.11	BDL	23	BDL
PI W22	EM 800597	0.11	BDL	23	BDL
PI W23	EM 800598	0.11	BDL	23	BDL
PI W24	EM 800599	0.11	BDL	23	BDL
PI W25	EM 800600	0.11	BDL	23	BDL
PI Blank 5	EM 800601	0.11	BDL	23	BDL
PI Blank 6	EM 800602	0.11	BDL	23	BDL
DK Blank 01	EM 800603	0.11	BDL	23	BDL
DK W01	EM 800604	0.11	BDL	23	BDL
DK W02	EM 800605	0.11	BDL	23	BDL
DK W03	EM 800606	0.11	BDL	23	BDL
DK W04	EM 800607	0.11	BDL	23	BDL
DK W05	EM 800608	0.11	5200.0	23	47273
DK W06	EM 800609	0.11	107.0	23	973
DK W07	EM 800610	0.11	37.8	23	344
DK W08	EM 800611	0.11	BDL	23	BDL
DK W09	EM 800612	0.11	7.2	23	65
DK W10	EM 800613	0.11	57.0	23	518
DK Blank 02	EM 800614	0.11	BDL	23	BDL
DK W11	EM 800615			Sample not submitted	
DK Blank 03	EM 800616	0.11	BDL	23	BDL

BDL Below Detection Limit

BEST AVAILABLE COPY

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2069 of 5269

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2070 of 5269

Dundalk Armory Locations of Lead Paint and Surface Wipe Samples

Photo Number	Location of Samples
1350	Lead Wipe Sample/Top of refrigerator in kitchen area
1351	Lead Wipe Sample/Horizontal wall near refrigerator and window in kitchen
1352	Bulk Paint Sample/Supply Room/recently renovated, painted roof
1353	Lead Wipe Sample/HHC orderly office on floor under window
1354	Lead Wipe Sample/Anti-armor Platoon office walls and floors being renovated
1355	Lead Wipe Sample/Storage Room/former IFR Bullet Trap area /renovated and being used for storage
1356	Lead Wipe Sample/former IFR near light pointed toward bullet trap
1357	Lead Wipe Sample/Storage Room (former IFR) near light pointed toward bullet trap
1358	Lead Wipe Sample/Storage Room (former IFR) near light pointed toward bullet trap
1359	Bulk Paint Sample/wall near entrance to former IFR
1360	Lead Wipe Sample/Worktable in garage/workout area with equipment
1361	Lead Wipe Sample/Mail Room/Personnel office/floor under window
1362	Lead Wipe Sample/On top locker in one room of Mail Room/Personnel office
1363	Lead Wipe Sample/On top locker in one room of Mail Room/Personnel office
1364	Lead Wipe Sample/Operations office window sill

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2071 of 5269

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

NO
SMOKING
EXIT

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

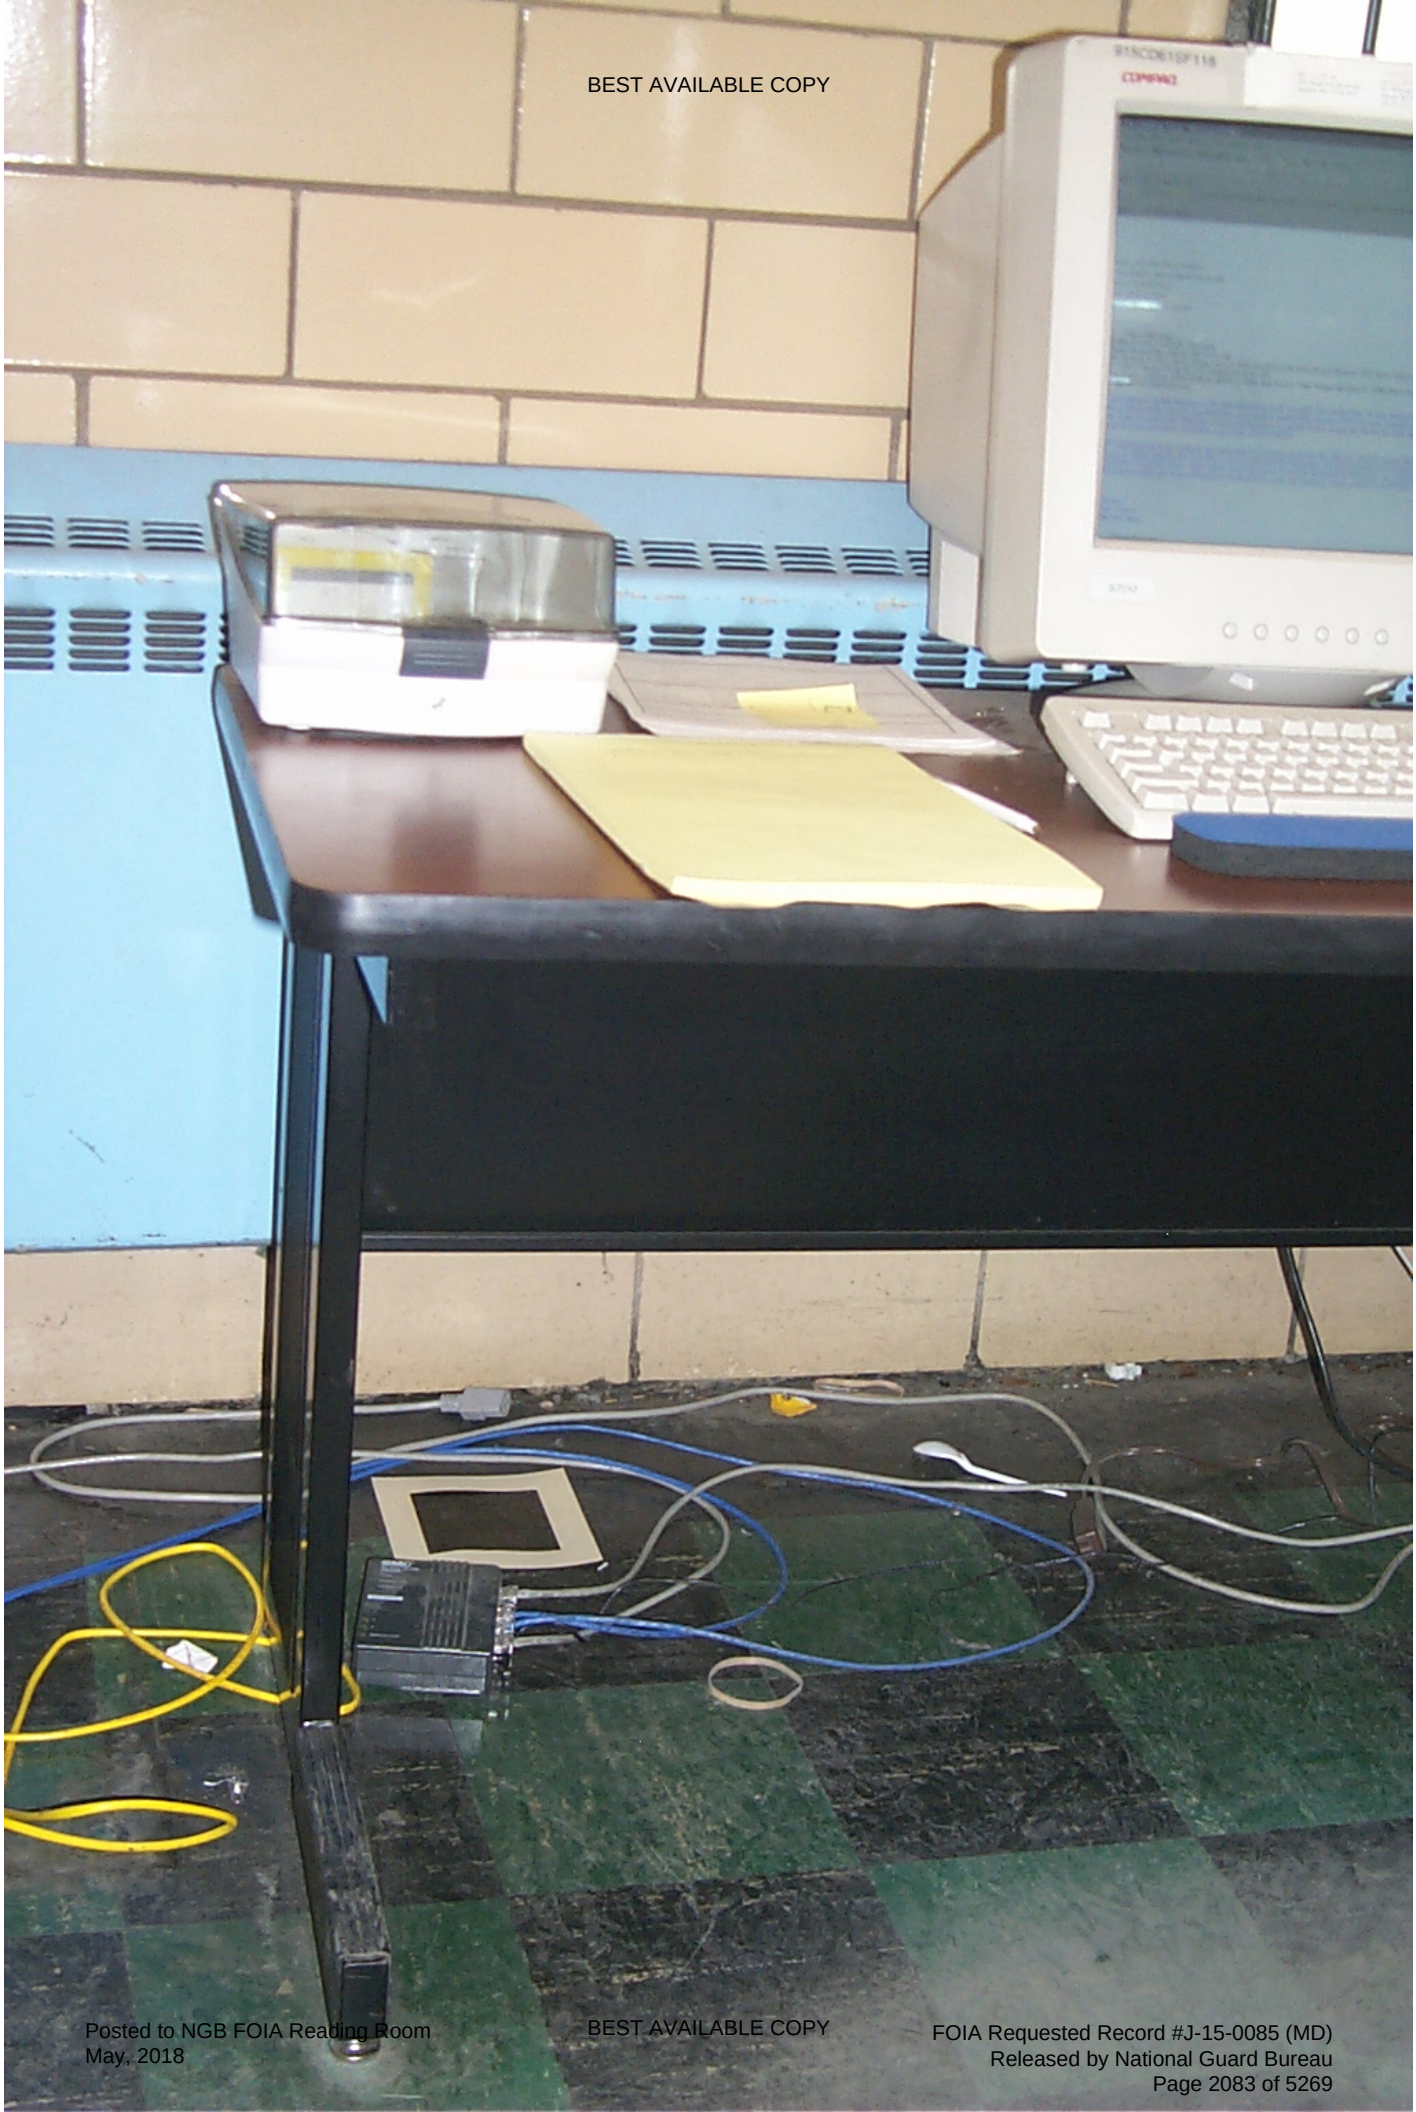

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX D

NATIONAL GUARD BUREAU REGION NORTH INDUSTRIAL HYGIENE OFFICE

ASSESSMENT CRITERIA FOR LEAD

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2087 of 5269

SUBJECT: National Guard Bureau Region North Industrial Hygiene Office
Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 µg/ft². This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. The EPA standards (40 CFR 745.227(e) (8) (viii)) and State of Maryland standards are not directly applicable because they are developed for floors (40 µg/ft²), windowsills (250 µg/ft²)and window troughs (400 µg/ft²) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. The OSHA has no specific requirement for work area surfaces. The OSHA lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. The OSHA cites a level of 200 µg/ft² in OSHA Instruction CPL 2-2.58 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 µg/ft² is a safe surface contamination level for adult exposures. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels higher than those recommended above do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All States will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 50 µg/m³ averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2088 of 5269

BEST AVAILABLE COPY

APPENDIX E

LEAD CLEANING GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2089 of 5269

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2090 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2091 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2092 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2093 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2094 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2095 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2096 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2097 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

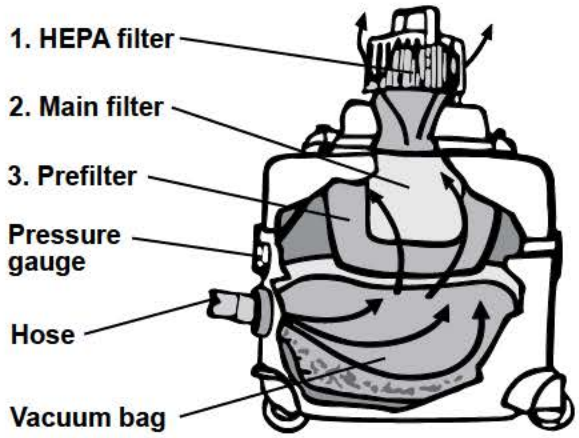

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

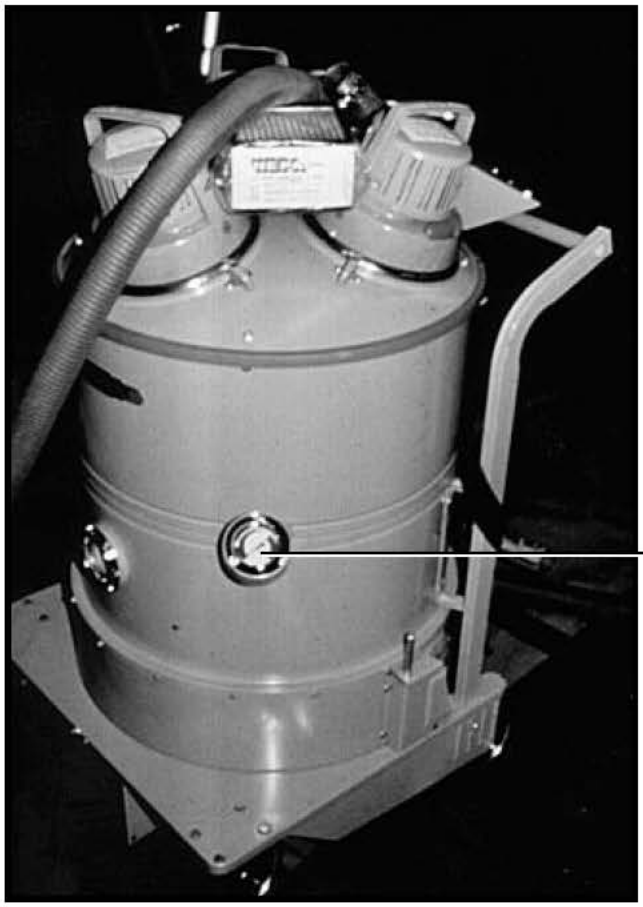

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2098 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

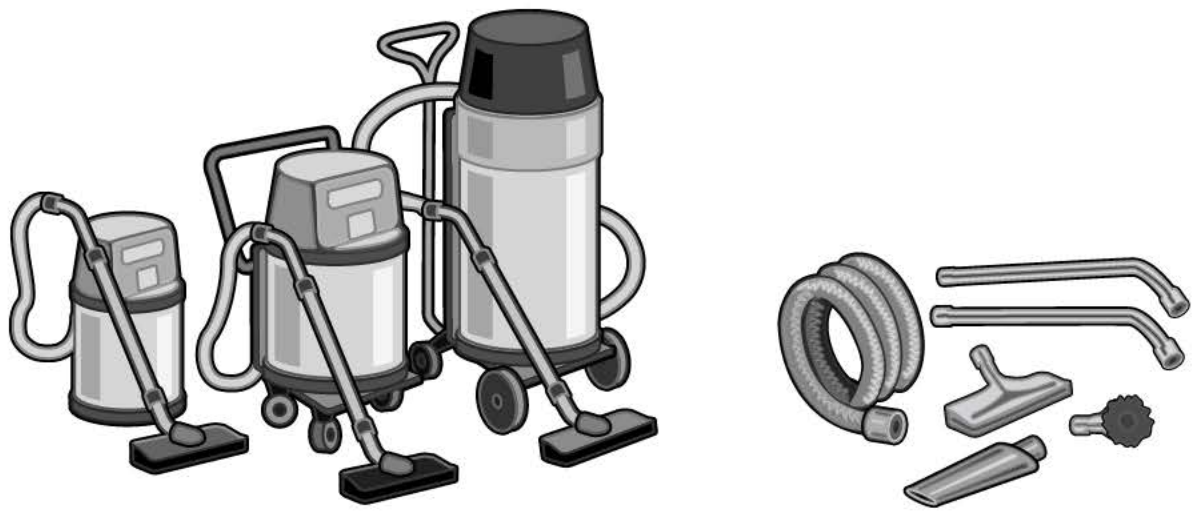

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2099 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

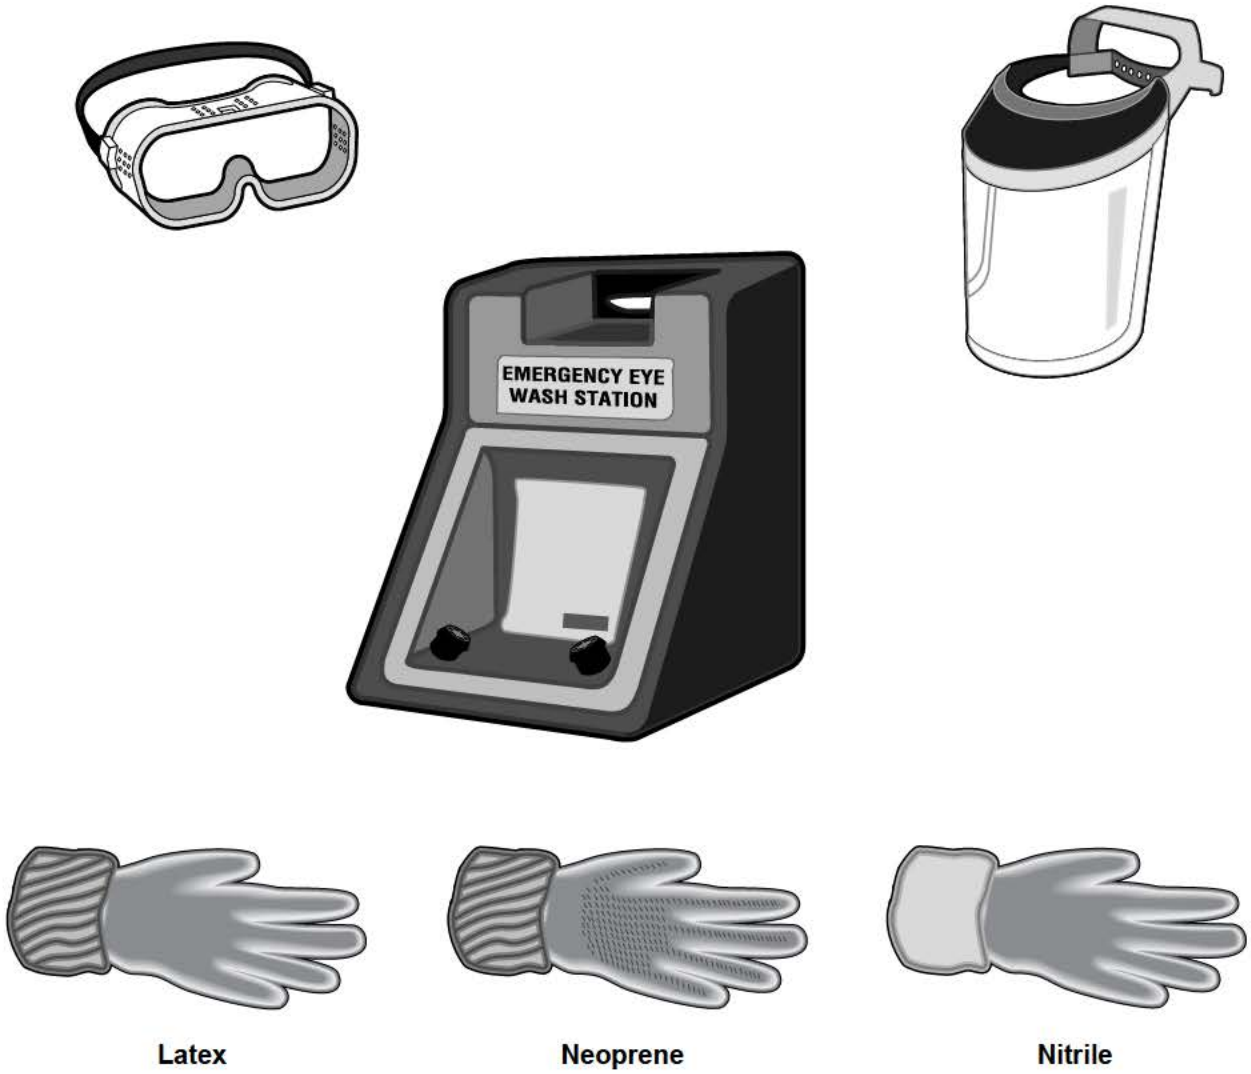

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2100 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

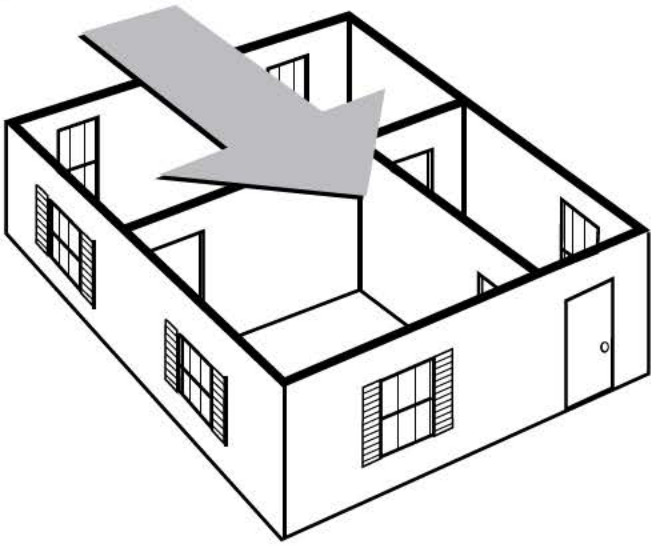

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

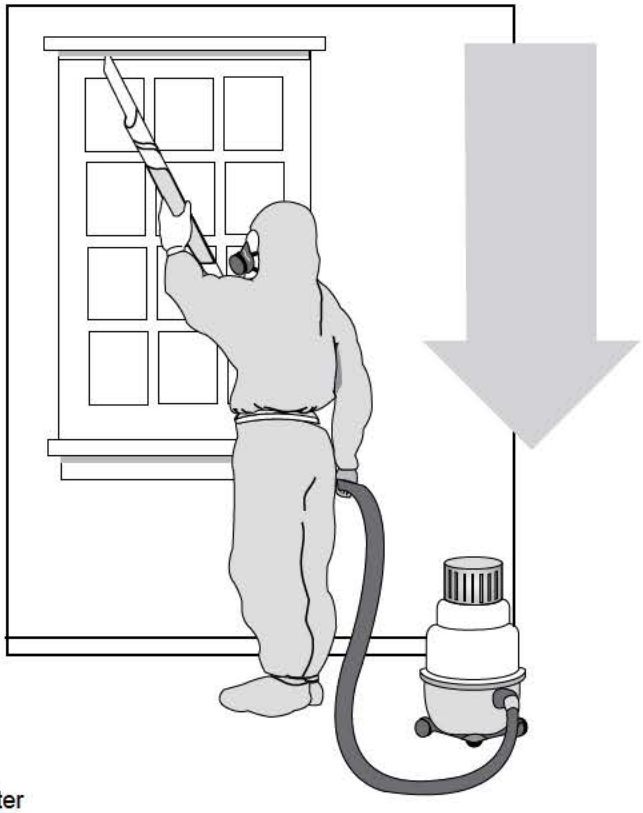

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2101 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2102 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

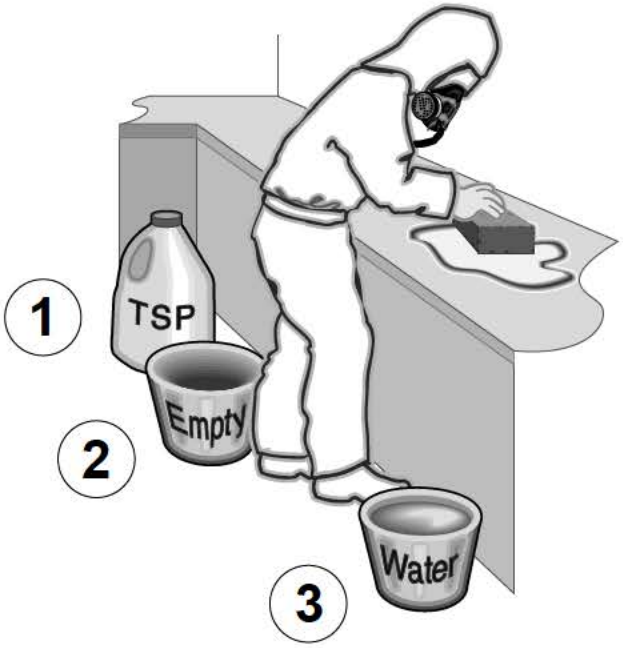

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2103 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

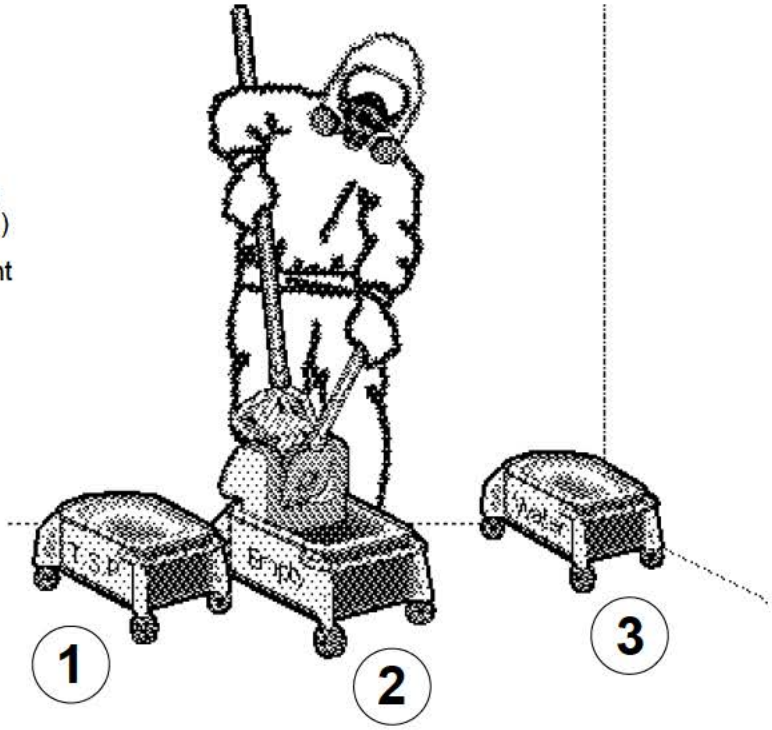

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

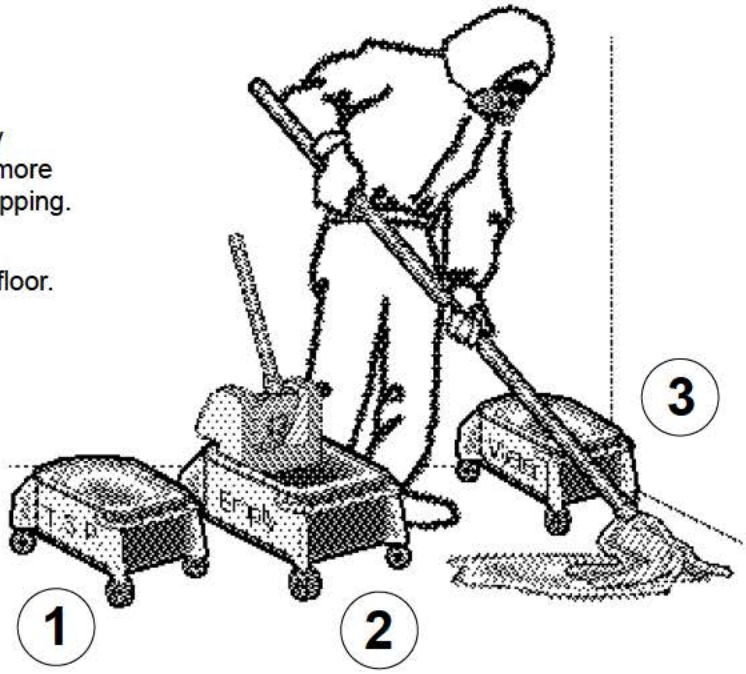

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2104 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

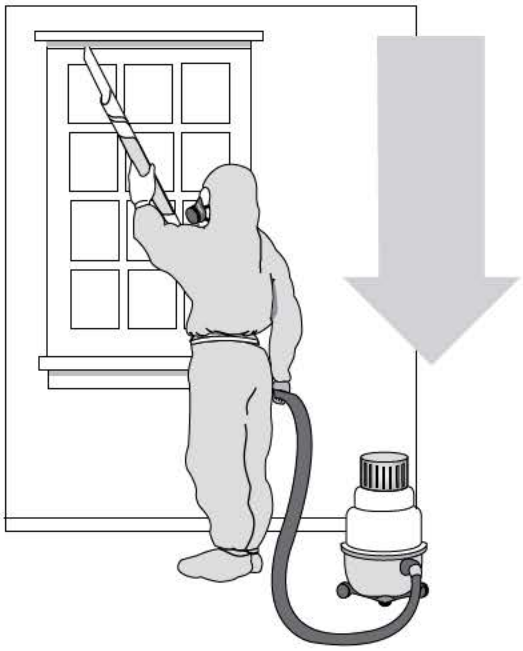

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2105 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2106 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2107 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2108 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2109 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2110 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2111 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2112 of 5269

BEST AVAILABLE COPY

APPENDIX F

RECOMMENDATIONS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2113 of 5269

DUNDALK ARMORY RECOMMENDATIONS

The Department of Defense Instruction (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure that allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority. The DODI 6055.1 also provides RACs for Safety and Ergonomic Hazards. The RAC for this armory for Lead Exposure is classified as 4. The RAC for Asbestos Exposure is classified as 3. The RAC for Illumination is classified as 5. The RAC for Safety Hazards is classified as 5. The RAC for Ventilation is classified as 1.

1. Lead Exposure. RAC 4.

a. Develop a written Lead Hazard Management Plan for Dundalk Armory.

b. Clean all areas where sampling results showed elevated levels of lead, especially in the converted indoor firing range area that is currently being used for storage. Comprehensive guidelines for cleaning are in Appendix E. Consult with the Maryland Armory Environmental Coordinator concerning disposal requirements after cleanup.

c. Address all potential lead hazards before continuing to extend the use of this facility for children. If children will continue to use this facility, clean surfaces to the EPA and State of Maryland dust-lead standards for young children of 40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ for dust-lead on window sills.

d. A potential occupational exposure to lead has been identified for workers who may be involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard, Title 29 CFR 1926.62.

e. Stabilize the deteriorated paint on the walls.

f. There is the potential that lead contamination could be taken home. Wear disposable chemical-resistant gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

g. Test drinking water from water fountains and faucets for lead.

2. Asbestos Exposure. RAC 3. Continue with ongoing asbestos renovation activities.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2114 of 5269

3. Illumination. RAC 5. Increase lighting levels in SFC Miller's office to 28-46 foot candles to conform to Illuminating Engineering Society of North America guidelines.

4. Safety Hazards. RAC 5. Address fire and trip hazard on drill floor. The drill floor was full of equipment due to the ongoing renovation and abatement.

5. Ventilation. RAC 5. Investigate operating problems with air handling systems. Consider re-surveying indoor air conditions in hot weather with windows closed and systems fully operational.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2115 of 5269

BEST AVAILABLE COPY

APPENDIX G

SITE MAPS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2116 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

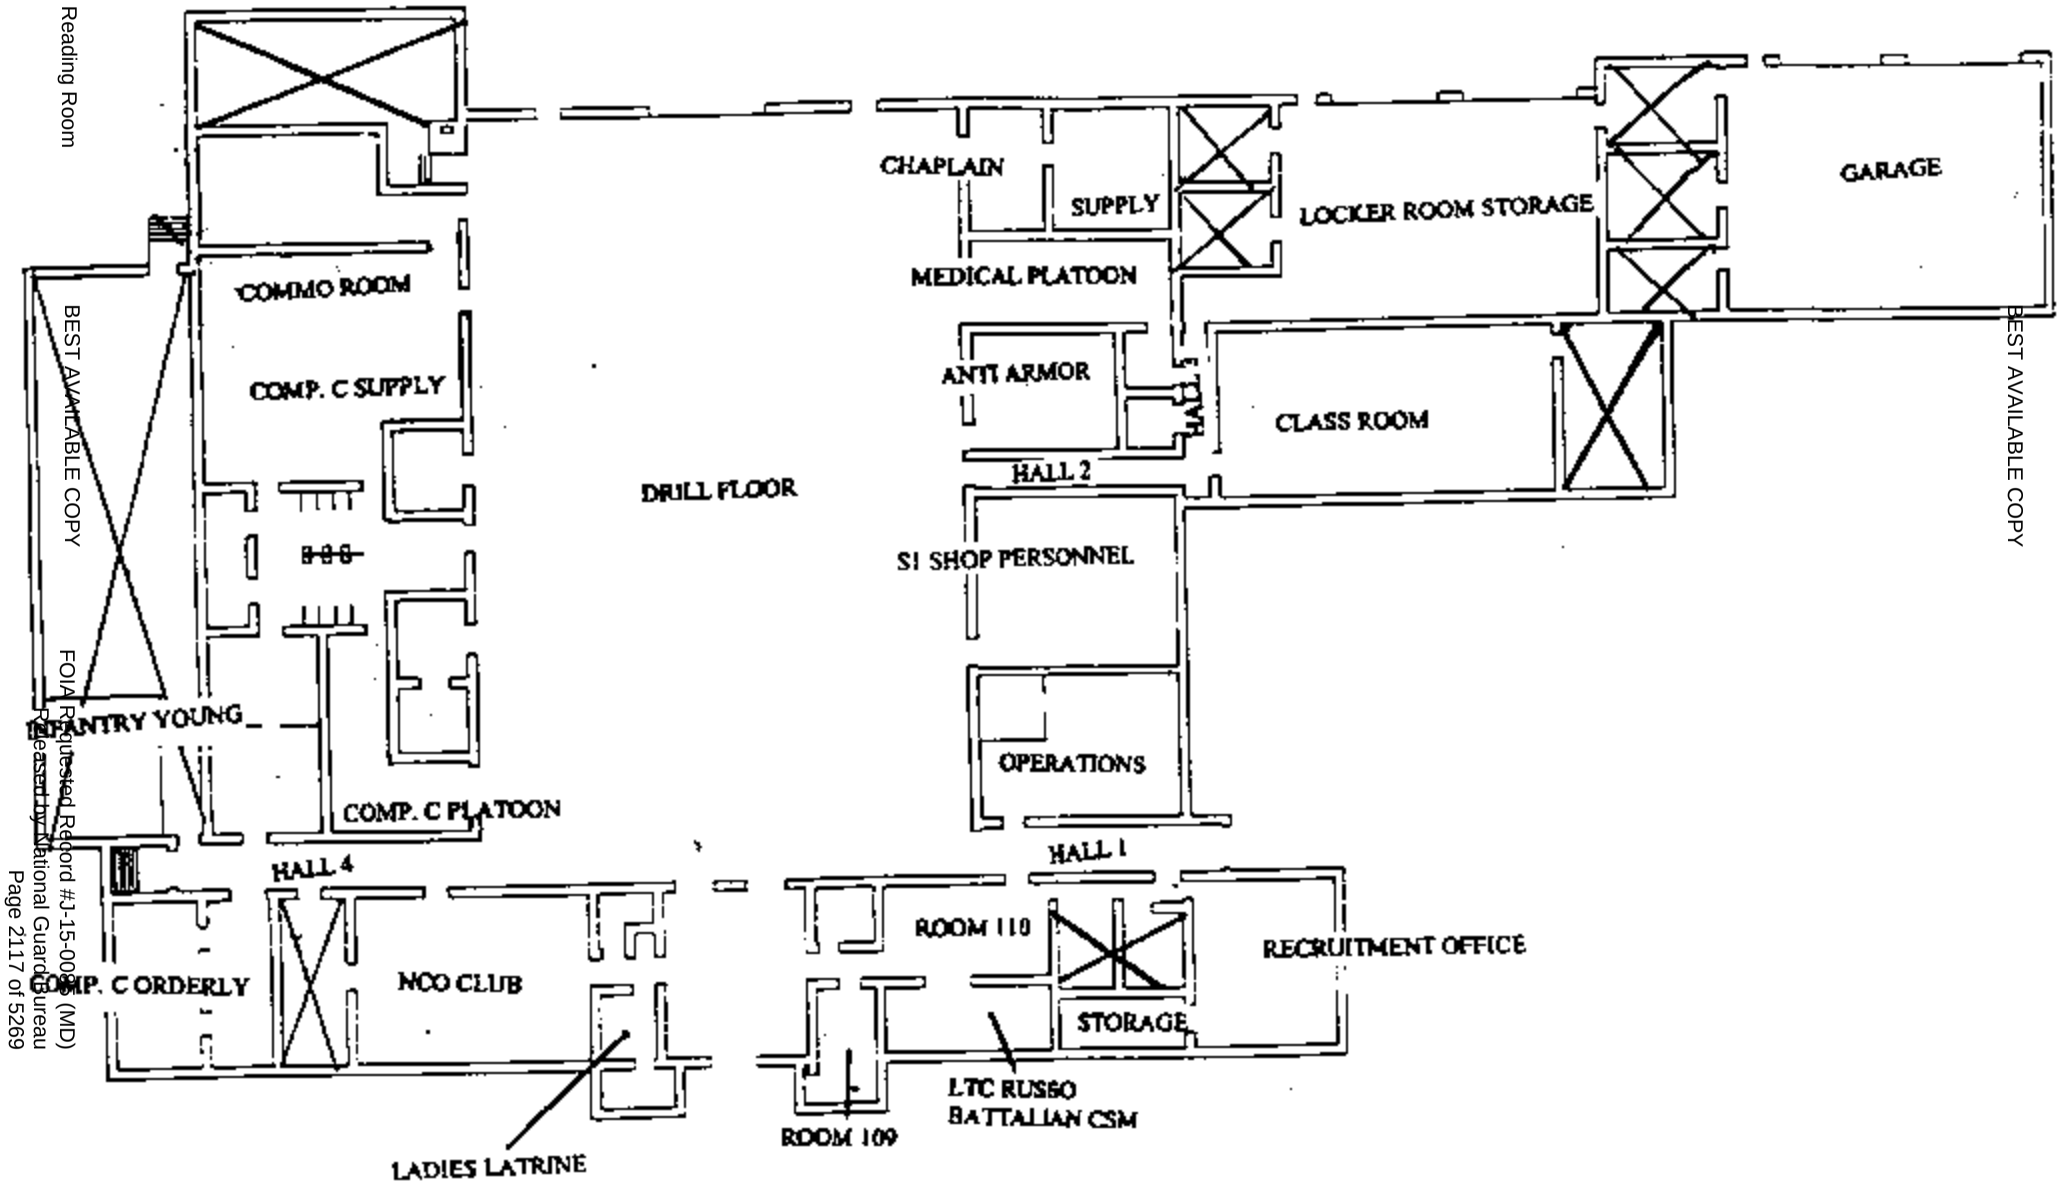

BEST AVAILABLE COPY

FOIA Requested Record #J-15-008 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX H

MOLD GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2118 of 5269

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2119 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2121 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2122 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet -** e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2123 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2124 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2125 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2126 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2127 of 5269

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2128 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2129 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2130 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2131 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2132 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2133 of 5269

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2134 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2135 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2136 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2137 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2138 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2139 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2140 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2141 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2142 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2144 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2145 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2146 of 5269

MOLD INVESTIGATION DECISION LOGIC

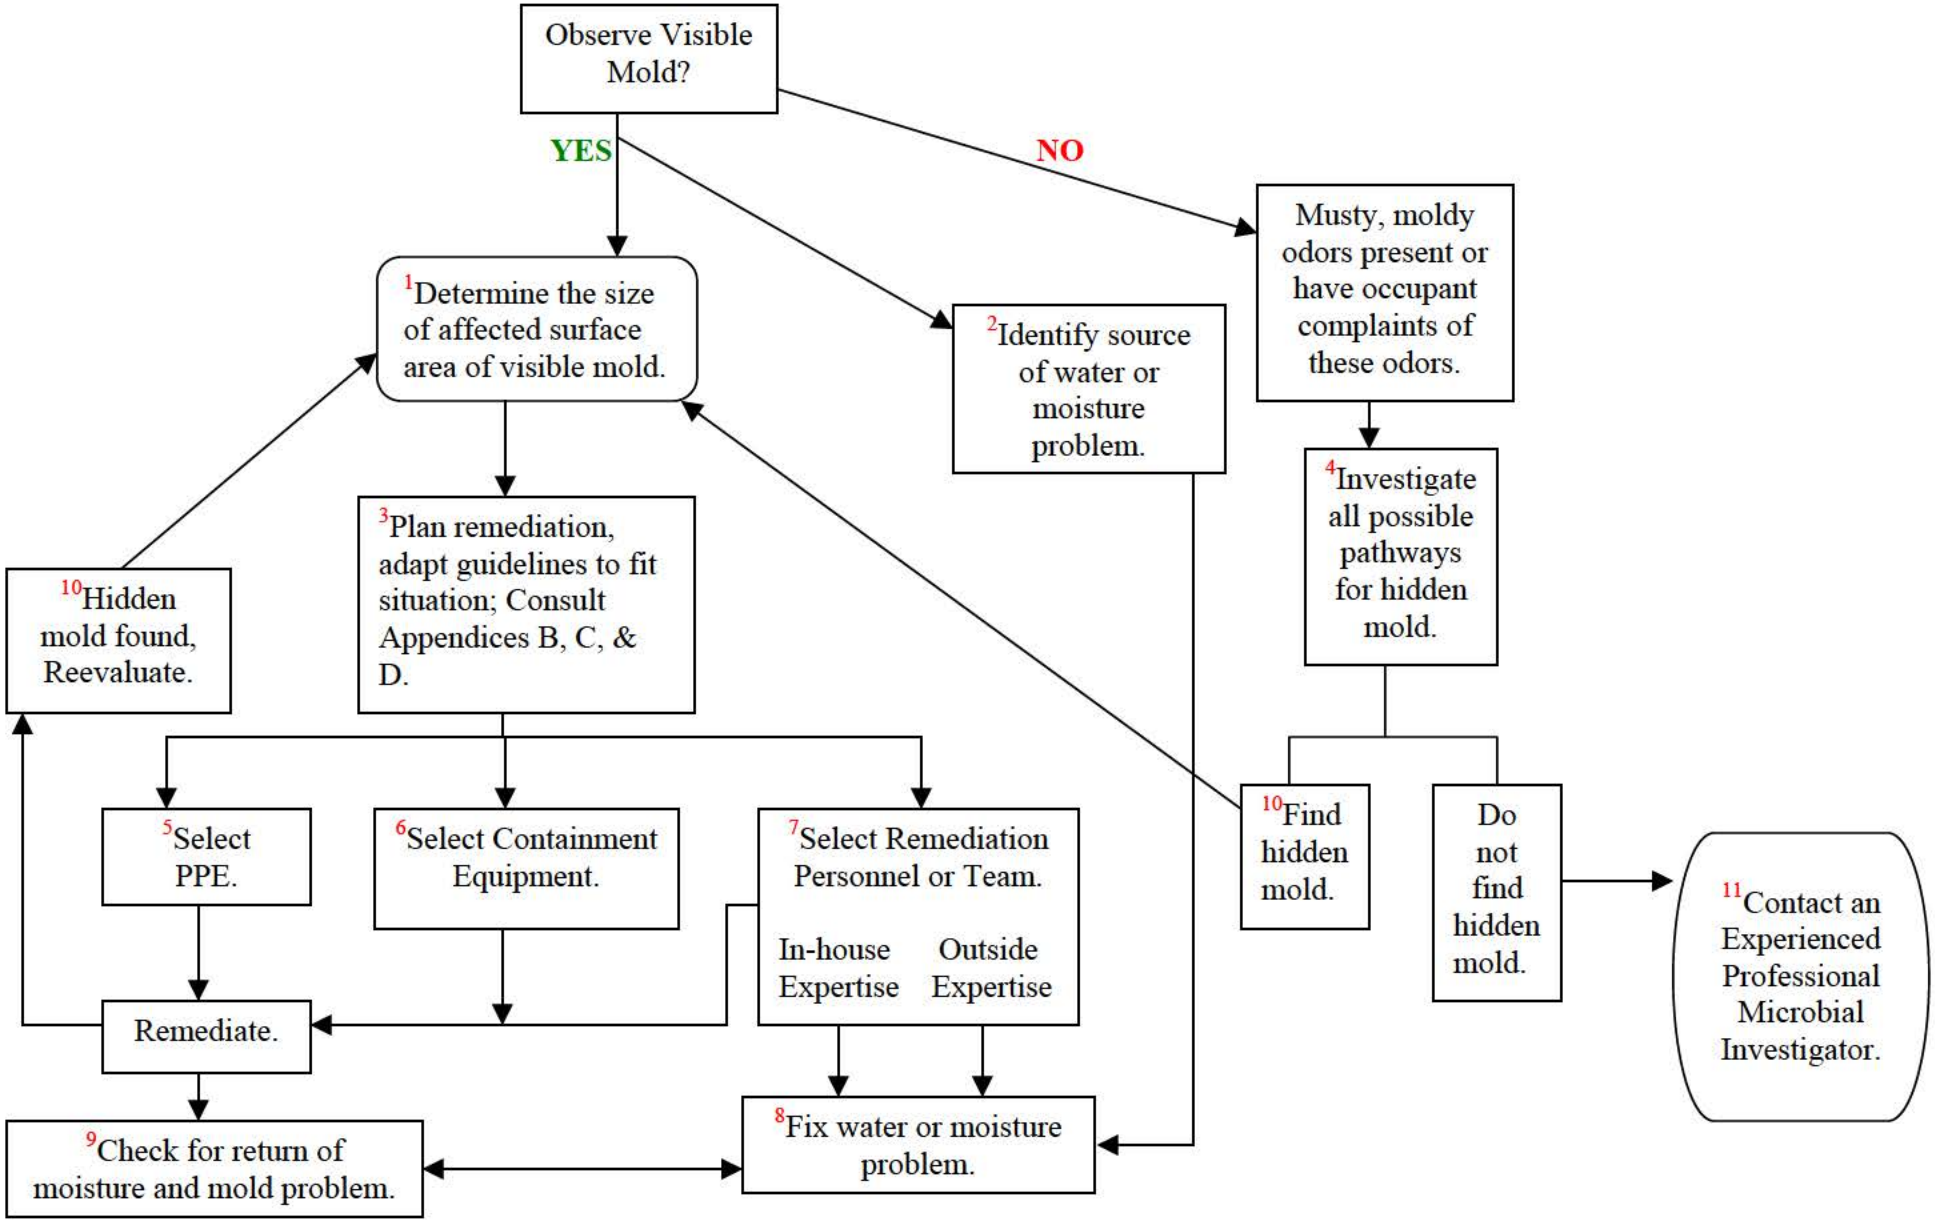

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2148 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2149 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2150 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2151 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2152 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2154 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2155 of 5269

BEST AVAILABLE COPY

TG 278

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2156 of 5269

BEST AVAILABLE COPY

Industrial Hygiene Study

National Guard Facility
Dundalk Readiness Center
2101 North Point Blvd.
Dundalk, MD
21222

Prepared for:

National Guard Bureau Region North IH Office
301-IH Old Bay Lane
Havre de Grace, Maryland
21078

Prepared by:

The EI Group, Inc.
2101 Gateway Centre Blvd.
Morrisville, North Carolina
27560

Report Date: December 18, 2008

Project ID: IHMO080101.03

Non-Responsive [redacted]

Manager, Charlotte Operations

Non-Responsive [redacted]

Senior Industrial Hygienist

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2157 of 5269

TABLE OF CONTENTS

Executive Summary	3
Operation Description	4
Noise	4
Lead Testing	4
Lighting	5
Indoor Air Quality	6
Suspect ACBM	8
Maintenance Bay	8
Ventilation Assessment	8
Limitations	8
References	9

List of Appendices

Appendix A: Photographs

Appendix B: Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2158 of 5269

EXECUTIVE SUMMARY

An industrial hygiene survey was conducted July 29, 2008 at the Readiness Center Facility Identification No. 492 located in Dundalk, Maryland. The study was performed by Mr. [redacted], CIH.

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lighting within the facility was also evaluated. Lighting was found to be within applicable recommended levels.

Various surfaces within the HVAC system and throughout the facility were screened for lead. The screening was completed using surface/wipe and air samples. None of the air samples collected were found to have detectable levels of the respective lead contaminant, and four (4) of the five (5) surface samples collected were found to have detectable levels of lead.

Indoor air quality parameters were also evaluated during the assessment. Indoor air quality was found to be within those parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE). The firing range is inactive, having been converted into a classroom, but could have contributed to lead contamination in areas adjacent to the old firing range.

During the assessment, written programs for Health and Safety, NESHAP Operations and Maintenance Asbestos Survey, and the Hazard Communication Program were requested for review, however, the onsite personnel was not able to locate the documents.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2159 of 5269

Operation Description

The Dundalk Readiness Center primarily serves as an equipment storage facility and is equipped to conduct light vehicle maintenance. The facility consists of a single story response center that contains a maintenance bays, office spaces, classrooms, a kitchen area, an assembly hall, boiler room, locker rooms, and unit storage areas.

The exterior walls of the building were constructed of a concrete block system (CBS) finished with red brick. The interior walls were composed of concrete block and in some areas were finished with drywall. The roof of the facility consisted of a built up roof system covered with stone. The heating, ventilating, and air conditioning system (HVAC) consisted of a split direct-expansion (DX) system and several window unit air conditioners. The floors were composed of a poured concrete slab and in some areas were finished with vinyl floor tiles. The ceilings were generally composed of wood deck and in some areas were finished with a suspended drop ceiling system. In many areas a spline ceiling panel system is located above a drop down grid ceiling tile system.

Site personnel at the time of the site assessment consisted of three administrative personnel. The employees on site were conducting general administrative work.

Noise Survey

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lead Testing

At the time of the assessment, no activities were observed which may lead to lead exposure other than ammunition handling. The facility contains an indoor firing range that was converted to a classroom and storage area. Several areas containing a painted ceiling were found to be in poor condition due to humidity damaged delaminated paint.

Various surfaces within the facility were screened for lead using surface/wipe samples and the collection of air samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 µm MCE cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, MD for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix B.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2160 of 5269

Lead Testing Results Summary

Location	Air ug/m^3	Surface ug/ft^2	Bulk	Chip %Pb
Classroom (Old Range)	ND			
Classroom (Old Range)	ND			
Blank	ND			
Wall in Old Range		ND		
Kitchen- Top of Refrigerator		**1700**		
Old Supply Duct- Arms Range		**15000**		
Top of Locker- Room S-2		49		
COC Supply Room- Top of Shelf		**200**		
Blank		ND		
NCO Club: Window				0.17%
COC Supply Room: Ceiling				**3.6%**
Criteria	**50**	**200**	**5,000**	**0.5**

Key: ND – None Detected
PB – Lead

Detectable levels of lead were identified in the former range supply vent, kitchen, Supply Room and locker room. The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying contaminated surfaces. In the" Derivation of Wipe Surface Screening Levels for Environmental Chemicals", the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, HUD levels of 40 µg/ft^2 on floors and 250 µg/ft^2 on windowsills should be observed.

No detectable levels of lead were identified in those air samples collected. Currently, OSHA observed an 8-hour time weighted average of 50 ug/m^3.

Deteriorated paint was observed throughout the facility. Delaminated paint was mostly due to age along with prolonged exposure to elevated humidity levels. Lead-based paint chips were identified in the COC Supply Room.

Lighting

A lighting assessment was conducted throughout the facility. The survey was conducted with large bay doors closed. Measurements were collected using a Cooke

BEST AVAILABLE COPY

Cal-Light 400L Precision Light Meter (Serial No. 98047EL). The light meter was last calibrated on February 22, 2008. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
HHC Supply Room	61-74	30	Yes
HHC TNG Office	68-77	30-50	Yes
COC Supply Room	**7-22**	30	NO
Office in COC Supply Room	77-85	30-50	Yes
Latrine	38-44	5	Yes
HHC ORD Room	34-61	30-50	Yes
NCO Club	82-105	10	Yes
Main Entrance Foyer	32-40	10	Yes
Conference Room	28-35	30-50	Yes
REC and RTN	25-30	30-50	Yes
Room S-3	28-37	30-50	Yes
Office in Room S-2	38-49	30-50	Yes
BN Pack	32-41	30-50	Yes
Chapel and Adjacent Office	30-41	30-50	Yes
Hall to Classroom	33	5	Yes
Classroom (Old Range)	90-110	30-50	Yes
Locker Room	15-31	7	Yes
SGT. Office	21-34	30-50	Yes

Insufficient lighting was identified in the COC Supply Room.

Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTrak IAQ Meter, Model 8550 (Serial No. 11050). The IAQ Meter was last calibrated in January 2008.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2162 of 5269

readings from the interior of the structure ranged from 72.5°F to 85.1°F with relative humidity readings ranging from 43.5% to 64.5%. The results of the testing for relative humidity exceeded the US Army guidelines in two (2) of the fourteen (14) locations tested.

During the survey, CO_2 levels ranged from 466 ppm to 635 ppm within the facility compared to an outdoor CO_2 level of 397 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,097 ppm (397 ppm + 700 ppm). The results of the testing met the ASHRAE guidelines.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Drill Floor	**80.6**	57.6	483	0
Class Room	**80.3**	58.7	475	0
Locker Room	**80.3**	**60.9**	466	0
Room BN S-4	72.5	51.1	604	0
Room S-2/S-4	73.4	43.5	635	0
Rec/Ret	73.5	51.9	607	0
Conference Room	77.0	**64.5**	559	0
NCO Club	74.3	50.1	528	0
Supply Room	**81.5**	56.9	579	0
PLI Room/Gym	**81.3**	55.3	473	0
HHC ORD	**82.4**	52.3	529	0
HHC Training Room	75.2	49.8	584	0
Mess PLT Storage	**80.6**	55.1	469	0
Outdoors	85.1	46.8	397	0
Criteria	**73.0-79.0**	**30-50**	**<1,097**	**<9.0**

Elevated humidity levels were identified in the locker room and Conference Room. The locker room was thought to have elevated humidity due to insufficient exhaust. No source of moisture intrusion or wetted materials could be identified in the Conference Room.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspected was conducted to assess sources or pathways of IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

- Paint was observed to be delaminating from the supply room and weight room. Laboratory analysis of the paint chips collected revealed detectable levels of lead. Delaminating appears to be due to prolonged periods of elevated humidity.

- Water impacted ceiling tiles were identified throughout the facility from apparent roof leaks. Roofing tar was identified in several exterior gutter downspouts indicating recent roofing repairs.

Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials include sheetrock/joint compound, floor tiles and associated mastic, splined ceiling pane system, dropped in ceiling panel system and vinyl covebase. Thermal system insulation was found to be paper wrapped fiberglass with PVC and mudded fittings.

Maintenance Bay

The maintenance bay was found to contain a local exhaust ventilation system which was not operable. The Maintenance Bay is used for vehicle storage and on the day of the site visit was being used as a carpentry shop.

The maintenance bay was found to contain custodial items, tools, waste motor oil, ladders and flammable storage cabinet. The flammable storage cabinet contained various paints and cleaning solvents.

PPE identified in the site included safety glasses and chemical gloves. Materials were kept in good, clean condition.

Ventilation System Assessment

The facility was found to boiler operated radiant heating and window unit air conditioners. A closed system boiler is located in the boiler room.

The LEV system located in the garage was not operable at the time of the assessment. The system consists of one main fan and two flex duct branches.

Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicated within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau,

and The EI Group, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

References

Title 29 Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration.

Lead - (29 CFR 1910.1025(h))

American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2008 Edition

Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

Georgia Army National Guard: Standard Army Safety and Occupational Health Inspection Checklist; 1 October 1999 Edition

ANSI Z358.1 – 2004, Emergency Eye Wash and Shower Equipment

American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007.

RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

National Emission Standard Hazardous Air Pollutants (NESHAP) - The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3))

Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Appendix A

Photographs

Exterior view of the facility

Delaminated paint located in COC Supply Room

View of delaminated paint weight room (drawing COC PL1)

View of two ceiling tile systems

View of TSI

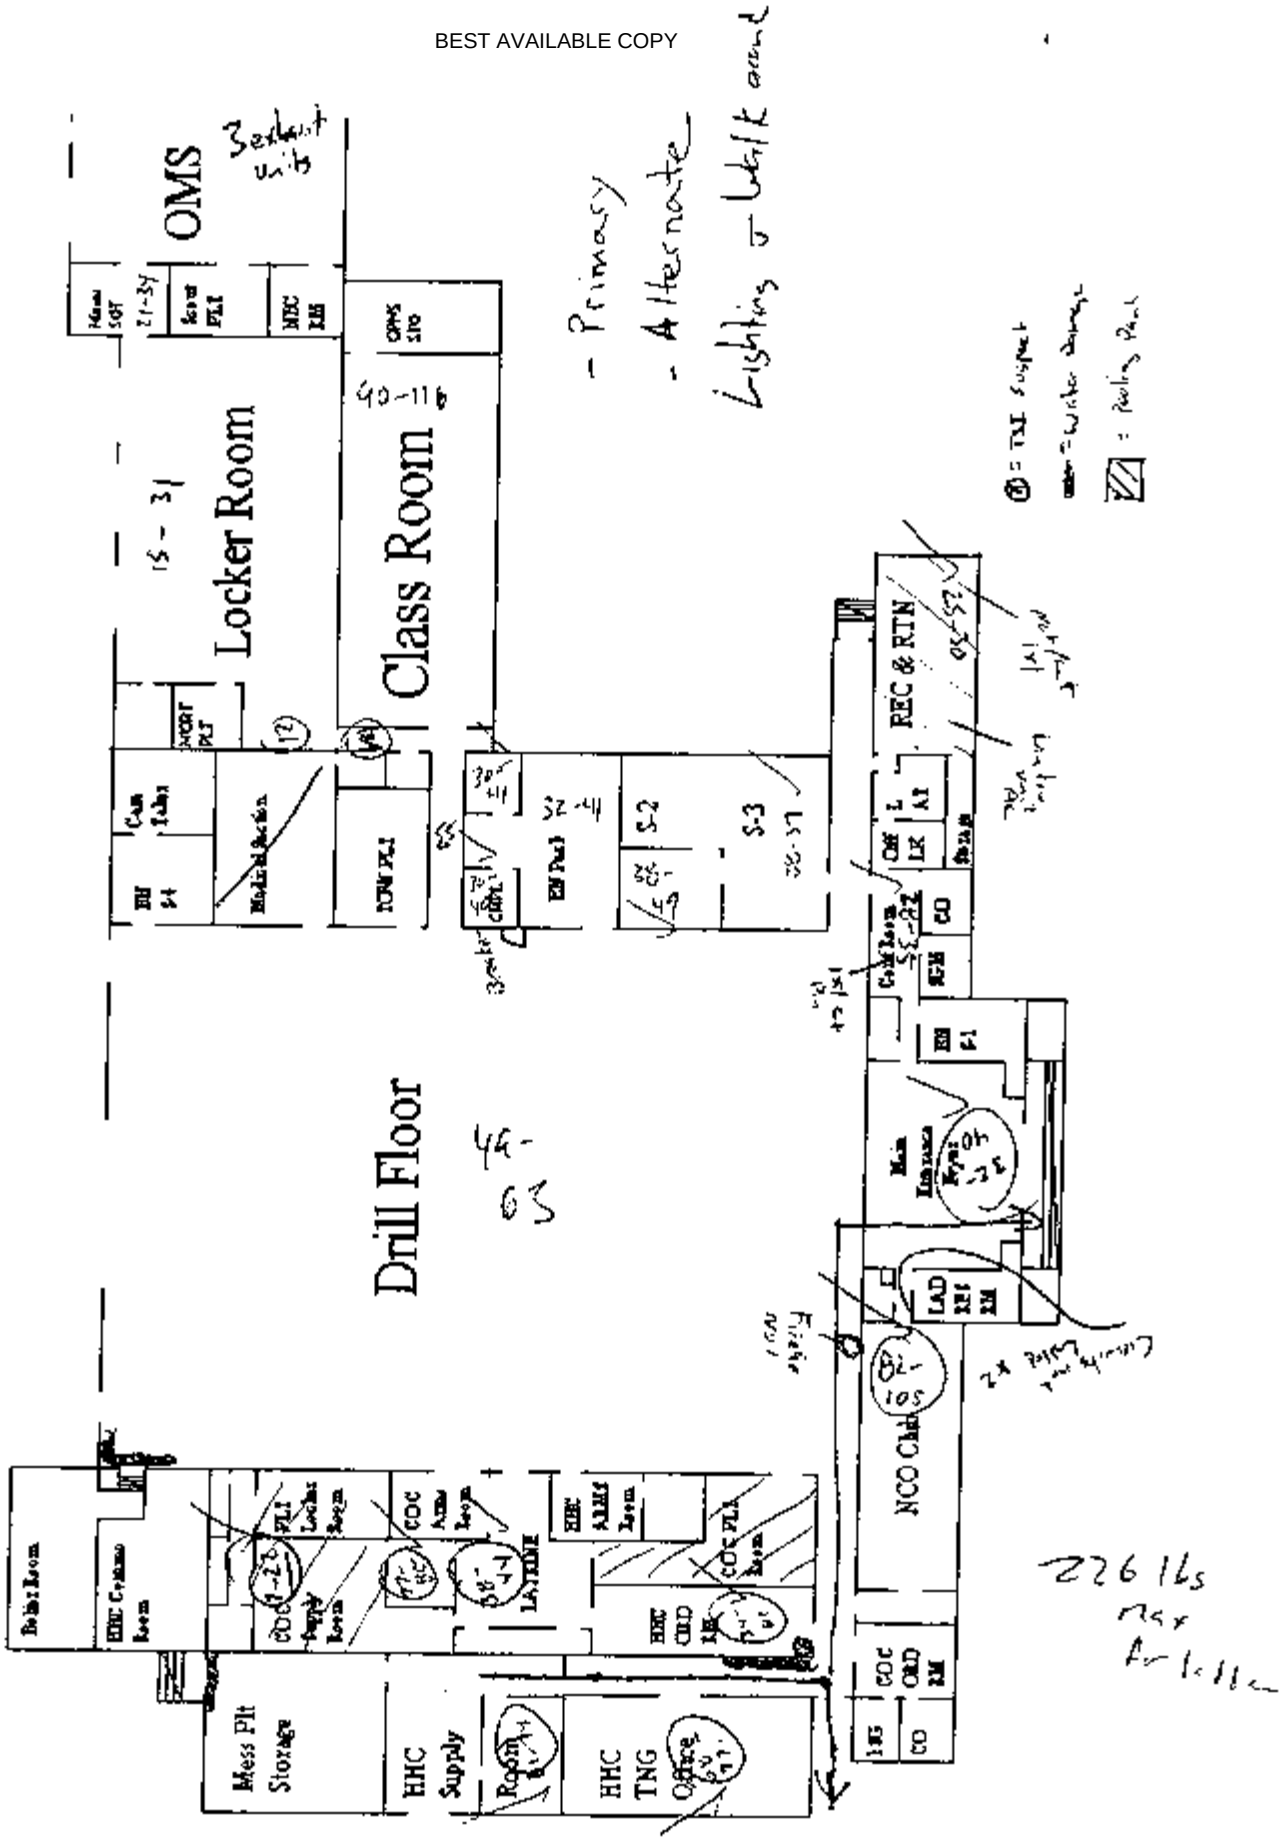
OMS
3 exhaust units
Locker Room
Class Room
Drill Floor
REC & RTN
NCO Club
Mess Plt Storage
HHC Supply Room
HHC TNG Office
LATRINE
- Primary
- Alternate
Lighting & Walk around
226 lbs max for latter

BEST AVAILABLE COPY

W1 - Wall in old range 13 x 14.5

W2 - Kitchen - Fridge Top 10 x 13 Chips from ceiling paint

W3 Old Supply dock: Arms Range 24 x 3

W4 - Top of Locker Room S-3/S2 12 x 12.5

W5 - Supply - Top of shelf 13 x 13

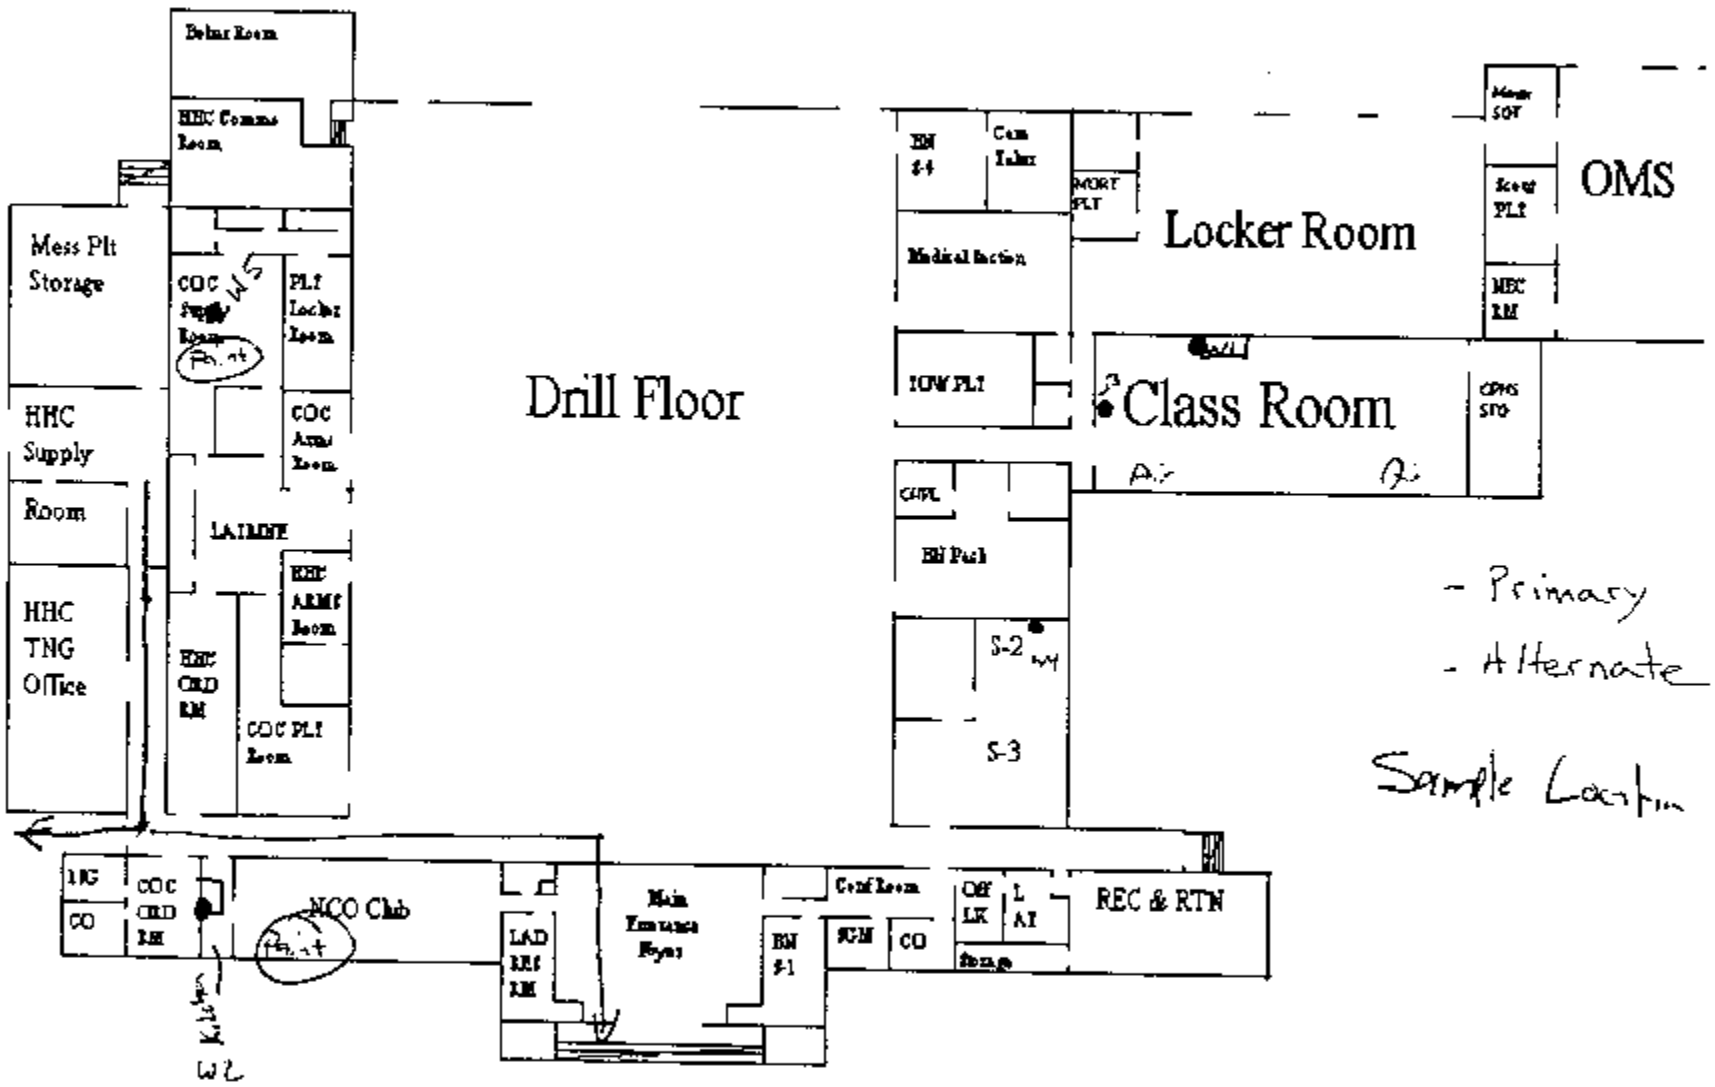

- Primary
- Alternate

Sample Location

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Appendix B

Laboratory Analysis Report

Released to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aiha.org/aqp.org for details

100470

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	RC 492 Dundalk, MD	**Chain Of Custody:**	181417
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008 **Report Date:** 9/9/2008
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0882245	492-2	Flame	Air	972	N/A	3.09	ug/m³	<	3.1	ug/m³	
0882246	492-1	Flame	Air	952	N/A	3.15	ug/m³	<	3.2	ug/m³	
0882247	492-3	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0882248	W1	Flame	Wipe	****	1.309	9.17	ug/ft²	<	9.2	ug/ft²	
0882249	W2	Flame	Wipe	****	0.903	13.29	ug/ft²		1700	ug/ft²	
0882250	W3	Flame	Wipe	****	0.500	24.00	ug/ft²		15000	ug/ft²	
0882251	W4	Flame	Wipe	****	1.042	11.52	ug/ft²		49	ug/ft²	
0882252	W5	Flame	Wipe	****	1.174	10.22	ug/ft²		200	ug/ft²	
0882253	W6	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0882254	C1	Flame	Paint Chip	****	N/A	0.01	%Pb		0.17	%Pb	
0882255	C2	Flame	Paint Chip	****	N/A	0.01	%Pb		3.6	%Pb	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-00[illegible]
Released by National Guard Bureau (NGB)
Page 2173 of 5269

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client:	National Guard Bureau	**Job Name:**	RC 492 Dundalk, MD	**Chain Of Custody:**	181417
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008 **Report Date:** 9/9/2008
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.
Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson **Technical Manager:** G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

FOIA Requested Record #J-15-0083 (MD)
Released by National Guard Bureau
Page 2174 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 181417

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-1H Old Bay Lane
3. Address 2: Havre de Grace, MD 21078
4. Address 3:
5. Phone #: 336 455 2558 Fax #: 704 593 1640

Submittal Information:
1. Job Name: RC 492 Dundalk, MD
2. Job Location:
3. Job #: [redacted] P.O. #:
4. Contact Perso[redacted] @ phone # 336 455 2558
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day +	☒ Email: [redacted] @ [illegible]
Comments:	☐ 2 Day Date Due: 9/11/08	☐ Fax:
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- PC MCE Porosity ____ in a 25mm 37mm
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- PC MCE Porosity ____ in a 25mm 37mm
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Lead Analysis
- ☒ Paint Chip 2 (QTY)
- ☒ Dust Wipe (wipe type ____) 6 (QTY)
- ☒ Air 3 (QTY)
- ☐ Soil/Solid ____ (QTY)
- ☐ TCLP ____ (QTY)
- ☐ Drinking Water ____ (QTY)
- ☐ Waste Water ____ (QTY)
- ☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
- ☐ Collection Apparatus for Spore Traps: ____
- ☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
- ☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
	See attached															

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 9 / 4 / 08 @ 900 Via: UPS By (Print): M Sampson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2175 of 5269

SAMPLE CHAIN OF CUSTODY

EI

DATE SHIPPED	# OF SAMPLES	SAMPLE MEDIA TYPE	PROJECT NAME
	11		Dundalk 181417

CONTACT	TELEPHONE NUMBER
Non-Responsive [redacted]	336 455 2558

SAMPLE # OR AREA	SAMPLE DATE	SAMPLE VOLUME	ANALYSIS REQUESTED
492-2	7/29/08	971.81 L	Lead Air
492-1		951.46 L	
492-3		Ø L	
W1 Range Flr		188.5 in²	Lead wipe
W2 Kit. Fiber Top		130 in²	
W3 Range - old supply		72 in²	
W4 Locker		150 in²	
W5 Supply shelf		169 in²	
W6 Blank		0 in²	
C1		—	Lead - Chip
C2		—	

Samples Relinquished By:	Non-Responsive [redacted]	8/19/08 Date
Samples Received By:	Signature	Date
Samples Analyzed By:	Signature	Date

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Survey

National Guard Facility
Dundalk Armory
2101 North Point Blvd.
Dundalk, MD 21222

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Dundalk Armory** **2101 North Point Blvd.** **Dundalk, MD 21222**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**August 5, 2010**
Report Date:	**August 30, 2010**
ALSI Project #:	**1008504**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

3544 North Progress Avenue ✦ Suite 100 ✦ Harrisburg, PA 17110
TEL: 717-540-3424 ✦ FAX: 717-540-3488

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Suspect Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Limitations 13

Appendix A. Laboratory Analysis Report 14

Appendix B. Photographs 15

Appendix C. Floor Plan 16

Appendix D. References 17

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2178 of 5269

BEST AVAILABLE COPY

Section 1.0
Executive Summary

BEST AVAILABLE COPY

Section 1.0 Executive Summary

An industrial hygiene survey was conducted August 5, 2010, at the Readiness Center Facility located at 2101 North Point Blvd., Dundalk, MD 21222. The study was performed by Ms Non-Responsive [redacted]

1. Lead surface, air and bulk samples were collected. Surface levels of lead exceeded 200 ug/ft^2 in the converted firing range on the ledge of cutout in wall.

   Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2. Damaged paint should be repaired and properly remediated.

2. Lighting levels met the minimum recommended guidelines in all but three areas: 1) Room 110, 2) Kitchen, 3) Co 128 BSB Supply Room, 4) S1 Office, 5) S3 Office. Lighting should be improved in these areas. It should be noted that lights in some areas were missing light bulbs. These should be replaced.

3. Indoor air quality parameters of temperature, relative humidity carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment. Relative humidity exceeded the recommended ceiling of 60% and temperature exceeded the recommended criteria of 79 degrees F in some indoor locations. There is no central air conditioning system in this building. Outdoor conditions were hot and humid. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation. For comfort, temperature levels should be maintained between 73-79 degrees F.

4. In the garage an overhead vehicle exhaust system is present but not in operation. The motor has been removed. We recommend that the ventilation system be repaired and utilized if vehicle maintenance activity is performed in this facility that would require the use of the overhead vehicle exhaust system.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2180 of 5269

BEST AVAILABLE COPY

Section 2.0
Operation Description & Observations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Dundalk Armory serves as an office setting and equipment storage facility. The facility consists of offices, a drill hall, garage, and storage areas. There are approximately 20-25 full-time employees stationed at the facility.

The building was initially constructed in 1970s. The exterior of the building is brick. The interior walls are primarily concrete block with some areas finished with drywall. The heating, ventilating, and air conditioning system (HVAC) consisted of a few window unit air conditioners and a boiler with radiators. Outdoor air ventilation occurs via open windows, doors, etc. No forced-air ventilation system is present. The floors were composed of a poured concrete slab. Some areas were finished with vinyl floor tiles or other flooring. The ceilings were generally composed of metal roof deck and some areas were finished with a suspended drop ceiling system.

There is an old firing range in the building. It was closed in the 1970's and has been fully abated. It is used as an office and gym facility.

Overall housekeeping was good. Areas were clean and well kept.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2182 of 5269

BEST AVAILABLE COPY

Section 3.0
Noise Survey

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2184 of 5269

BEST AVAILABLE COPY

Section 4.0
Lead Testing

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. The facility contains a gym and office area which was once an indoor firing range.

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m³	Surface ug/ft²	Paint Chip %Pb
1	Drill Hall	<4		
2	S4 Office	<3.6		
3	Blank	<3 ug		
4	Supply Room - Chipping Paint from Ceiling			0.11
5	Room 110 – Top of Bookshelf		<110	
6	Lobby - Top of Heater on Wall		<110	
7	Drill Hall – Floor		<110	
8	Drill Hall - Top of Soda Machine		<110	
9	Drill Hall – Table Top		<110	
10	Lounge - Top of Fireplace		<110	
11	Kitchen - Floor		<110	
12	Kitchen - Top of Locker		<110	
13	Communications Room - Top of Filing Cabinet		<110	
14	Supply Room – Top of Locker		160	
15	S3 Office - Top of Desk		<110	
16	Attached Garage - Table Top		<110	
17	Converted Firing Range – Floor		<110	
18	Converted Firing Range Ledge of Cutout in Wall		**380**	
19	Converted Firing Range – Fan Vent on Wall		<110	
20	Floor Outside Converted Firing Range		<110	
21	S4 Office Top of Glass Cabinet		<110	
22	Blank		<12 ug	
Criteria		**50**	**200**	**0.5**

Key: **Bolded** results exceed listed criteria

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2186 of 5269

Lead surface, air and bulk samples were collected. Surface levels of lead exceeded 200 ug/ft^2 in the converted firing range on the ledge of cutout in wall.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for Environmental Chemicals," the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3. In fact, no detectable level of lead was identified in the air samples collected.

Deteriorated paint was observed in a few locations throughout the facility. Delaminated paint was mostly due to age along with prolonged exposure to elevated relative humidity levels. A paint chip sample was collected from peeling paint in the supply room. This was found to be below the HUD definition of lead-based paint (0.5%).

Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2. The damaged paint in the supply room should be repaired and properly remediated.

BEST AVAILABLE COPY

Section 5.0
Lighting

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Room 110	**18.3**	30-50	No
Lounge	65.3	30-50	Yes
Co 128th BSB - Orderly Room	43.5	30-50	Yes
Kitchen	**30.0**	50	No
Drill Hall	30.8	30-50	Yes
Co 128th BSB – Supply Room	**24.7**	30	No
Communications Room	66.1	30-50	Yes
S4 Office	87.0	30-50	Yes
(Converted Firing Range) Office	65.5	30-50	Yes
(Converted Firing Range) Gym	49.2	30	Yes
S1 Office	**13.3**	30-50	No
S3 Office	**21.1**	30-50	No
Recruiting Office	30.0	30-50	Yes
Medical Supply	31.5	30	Yes
Attached Garage	171.8	75	Yes

Lighting levels met the minimum recommended guidelines in all but three areas: 1) Room 110, 2) Kitchen, 3) Co 128 BSB Supply Room, 4) S1 Office, 5) S3 Office. Lighting should be improved in these areas. It should be noted that lights in some areas were missing light bulbs. These should be replaced.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2189 of 5269

BEST AVAILABLE COPY

Section 6.0
Indoor Air Quality

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The IAQ Meter was last calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 70.9 to 83.4 degrees F with relative humidity readings ranging from 35.2% to 71.5%. During the survey, carbon dioxide (CO_2) levels ranged from 426 ppm to 1,364 ppm within the facility compared to an outdoor CO_2 level of 428 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,128 ppm (428 ppm + 700 ppm). Carbon monoxide (CO) ranged from 0.0 – 0.2 ppm.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	83.7	63.0	439	0.2
Room 110	**83.4**	**60.3**	465	0.0
Lounge	78.0	57.2	539	0.0
Co 128th BSB – Orderly Room	75.2	40.9	1,038	0.0
Kitchen	**79.5**	**68.4**	513	0.0
Drill Hall	**82.4**	**65.9**	429	0.0
Co 128th BSB – Supply Room	**83.4**	**63.4**	436	0.0
Communications Room	76.7	35.2	521	3.6
S4 Office	75.1	49.4	775	0.0
Converted Firing Range Office	75.7	51.3	599	0.0
Converted Firing Range Gym	73.7	59.4	586	0.0
S1 Office	75.4	53.1	**1,364**	0.0
S3 Office	70.9	39.6	650	0.2
Recruiting Office	73.1	57.1	500	0.0

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2191 of 5269

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Medical Supply	**80.1**	**71.5**	656	0.1
Attached Garage	**82.2**	**67.4**	426	0.0
Outdoors	86.0	59.8	417	0.0
Criteria	**73.0-79.0**	**30-60**	**<1,128**	**<9.0**

Key: **Bolded** results exceed listed criteria

Relative humidity exceeded the recommended ceiling of 60% and temperature exceeded the recommended criteria of 79 degrees F in some locations. There is no central air conditioning system in this building. Outdoor conditions were hot and humid. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation.

Carbon dioxide levels exceeded the recommended ceiling of 1,128 ppm in one location (S1 Office). This suggests that outdoor air ventilation is inadequate in this area. There is no mechanical ventilation system for this facility. No outdoor air ventilation is introduced into the building via the HVAC system.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

1. Water damaged ceiling tiles were observed in approximately 8-10 locations. No current water leaks were noted. It was reported that the water stains were from past water leaks that have been repaired.

2. There was a musty type of odor noted in Office S-4. The source of the odor could not be determined.

3. Workers in the Medical Supply Area reported that there is often condensation present on surfaces. The area seems hot and humid. There is no air-conditioning in this area.

4. No areas of fungal growth were observed.

All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

BEST AVAILABLE COPY

Section 7.0
Suspect Asbestos Containing Building Materials

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 7.0 Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials (ACM) include sheetrock/joint compound, plaster wall and ceiling systems, floor tiles and associated mastic, and vinyl cove base. Thermal system insulation which is most likely a combination of paper wrapped fiberglass with PVC elbows and well as pre-formed TSI with mudded elbows was suspected. No samples were collected. Inaccessible areas were not inspected.

The following are the most notable findings regarding suspect ACM at the time of this survey:

1. 9" x 9" vinyl floor tile and mastic was observed in the kitchen under the sink. This was in good condition.

2. 12" x 12" vinyl floor tile and mastic was observed throughout the facility. This was in good condition.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2194 of 5269

BEST AVAILABLE COPY

Section 8.0
Maintenance Bay

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is a garage area at this facility. It is used for small repair and maintenance jobs. No maintenance activity was in progress at the time of this survey.

A three-drop, overhead vehicle exhaust system is present but not in operation. The motor has been removed.

We recommend that the ventilation system be repaired and utilized if vehicle maintenance activity is performed in this facility that would require the use of the overhead vehicle exhaust system.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2196 of 5269

BEST AVAILABLE COPY

Section 9.0
Limitations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2198 of 5269

BEST AVAILABLE COPY

Appendix A
Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2200 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY

LAB #100470

NY ELAP 10920

Client:	National Guard Bureau	Job Name:	Dundalk Armory	Chain Of Custody:	508544
Address:	301-JH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	Dundalk, MD	Date Submitted:	8/11/2010
	Havre de Grace, Maryland 21078	Job Number:	Dundalk Armory	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	8/13/2010
Attention:	[redacted]			Report Date:	8/17/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1069085	1008504-1	Flame	Air	745	N/A	4	ug/m³	<3	<4	ug/m³	
1069086	1008504-2	Flame	Air	839	N/A	3.6	ug/m³	<3	<3.6	ug/m³	
1069087	1008504-3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1069088	1008504-4	Flame	Paint Chip	****	N/A	0.01	%Pb		0.11	%Pb	
1069089	1008504-5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069090	1008504-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069091	1008504-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069092	1008504-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069093	1008504-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069094	1008504-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069095	1008504-11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069096	1008504-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069097	1008504-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069098	1008504-14	Flame	Wipe	****	0.108	110	ug/ft²	17	160	ug/ft²	
1069099	1008504-15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069100	1008504-16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069101	1008504-17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1069102	1008504-18	Flame	Wipe	****	0.108	110	ug/ft²	41	380	ug/ft²	
1069103	1008504-19	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY

NY ELAP 10920

Client:	National Guard Bureau	Job Name:	Dundalk Armory	Chain Of Custody:	508544		
Address:	301-JH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	Dundalk, MD	Date Submitted:	8/11/2010		
	Havre de Grace, Maryland 21078	Job Number:	Dundalk Armory	Person Submitting:	[redacted]		
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	8/13/2010	Report Date:	8/17/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result	
1069104	1008504-20	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²
1069105	1008504-21	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²
1069106	1008504-22	Flame	Wipe Blank	****	N/A	12	ug		<12	ug

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: N. McGarvey / L. Butruk

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100430), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2201 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

DW (410) 247-2024 159282 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) **508544**

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-JH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Dundalk Armory
2. Job Location: Dundalk, MD
3. Job #: Dundalk Armory Proj #: W912K6-09-A-0003
4. Contact Pers[redacted] Telephone #: (410) 942-0273
5. Submitted by [redacted]

Reporting Information (Results will be provided [redacted]

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day Date Due: 8/18/10 ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Inc[redacted] with Report ☒ Fa[redacted] analytical@amalab.com ☐ Fa[redacted] ☐ Va[redacted] us.army.mil us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk:
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM ___(Qual) PLM ___(Quan) PLM/TEM ___(Qual) PLM/TEM ___(Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☒ Pb Paint Chip 1 (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 18 (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	POL	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER (DRINKING/ WASTE)	SPORE TRAP	TAPE	SWAB
1008504-1	Drill Hall	8/5	945.2					X		X						
1008504-2	S4 Office		838.8					X		X						
1008504-3	Blank		0					X		X						
1008504-4	Supply Rm-Ceiling			100cm²				X			X					
1008504-5	Rm 110-Bookshelf			↓				X				X				
1008504-6	Lobby-Heater							X				X				
1008504-7	Drill Hall-F1							X				X				
1008504-8	Drill Hall-Soda Machine							X				X				
1008504-9	Drill Hall-Table							X				X				
1008504-10	Lounge-Fireplace							X				X				
1008504-11	Kitchen-F1							X				X				
1008504-12	Kitchen-Locker			↓				X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 8 / 11 / 10 @ 1030 Via: UPS By (Print): Nicole Maxwell Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2202 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

OW (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0264

Submittal Information:
1. Job Name: Dundalk
2. Job Location:
3. Job #: [redacted] P.O. #: W912K6-09-A-0003
4. Contact Person: [redacted] @ phone #: (410) 942-0273
5. Submitted by: Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 3 Day ☐ 3 Day ☐ 5 Day + Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: @ ☐ Fax: [redacted]@us.army.mil ☐ Verbal: [redacted]@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate (QTY)
☐ EPA Point Count (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D3755-95 (QTY)
☐ Quan. (s/area) Dust D6480-99 (QTY)
TEM Water
☐ Qual. (pres/abs) (QTY)
☐ ELAP 198.2/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
☐ Pb Paint Chip (QTY)
☐ Pb Dust Wipe (wipe type) (QTY)
☐ Pb Air (QTY)
☐ Pb Soil/Solid (QTY)
☐ Pb TCLP (QTY)
☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
☐ Spore-Trap (QTY) ☐ Surface Vacuum Dust (QTY)
☐ Surface Swab (QTY) ☐ Culturable ID Genus (Media) (QTY)
☐ Surface Tape (QTY) ☐ Culturable ID Species (Media) (QTY)
☐ Other (Specify) (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WIPE AND OTHER	WIPE TRACK	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1008504-13	Comm. Rm-Filing Cabinet			100cm²				X				X					Date/Time: Contact: By:
1008504-14	Sign Rm. Locker							X				X					
1008504-15	Desk-S3 Office							X				X					
1008504-16	Garage-Table							X				X					
1008504-17	Firing Range-F1							X				X					Date/Time: Contact: By:
1008504-18	Firing Range-Ledge							X				X					
1008504-19	Firing Range-Filing Cabinet							X				X					
1008504-20	F1 Outside Firing Range							X				X					
1008504-21	Office S4-Cabinet							X				X					Date/Time: Contact: By:
1008504-22	Blank			0cm²				X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2203 of 5269

BEST AVAILABLE COPY

Appendix B. Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2204 of 5269

BEST AVAILABLE COPY

Appendix B
Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

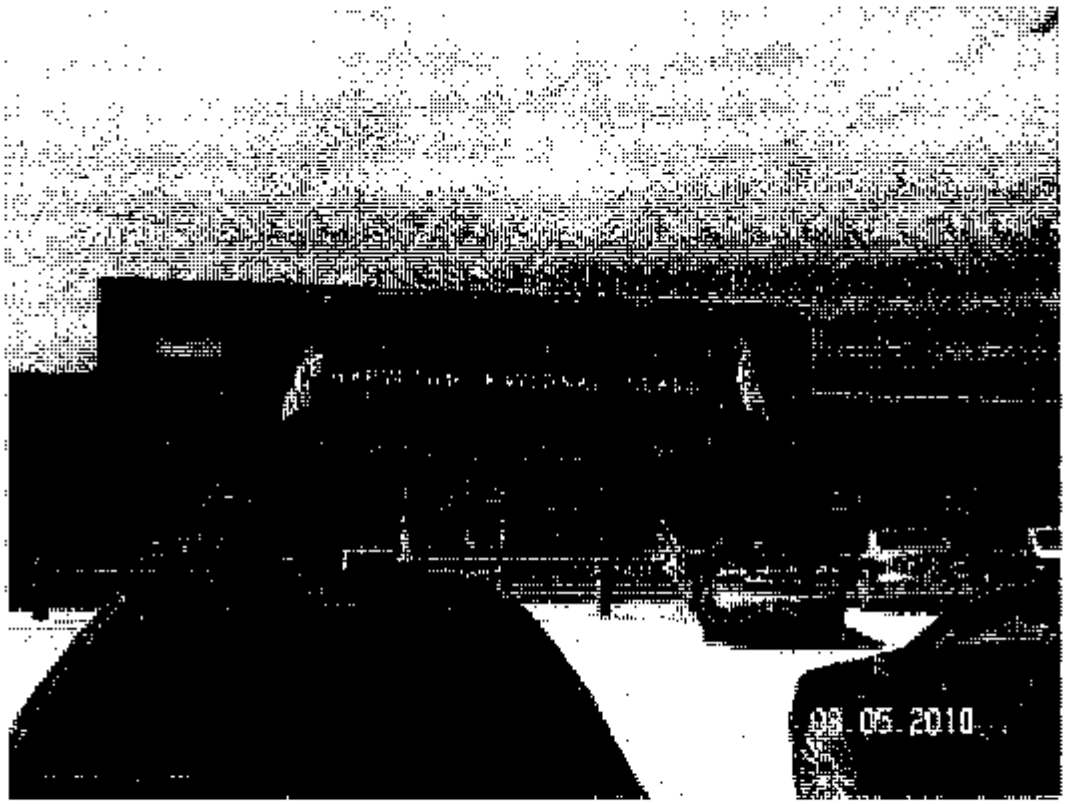

Photo 1: Exterior view, front.

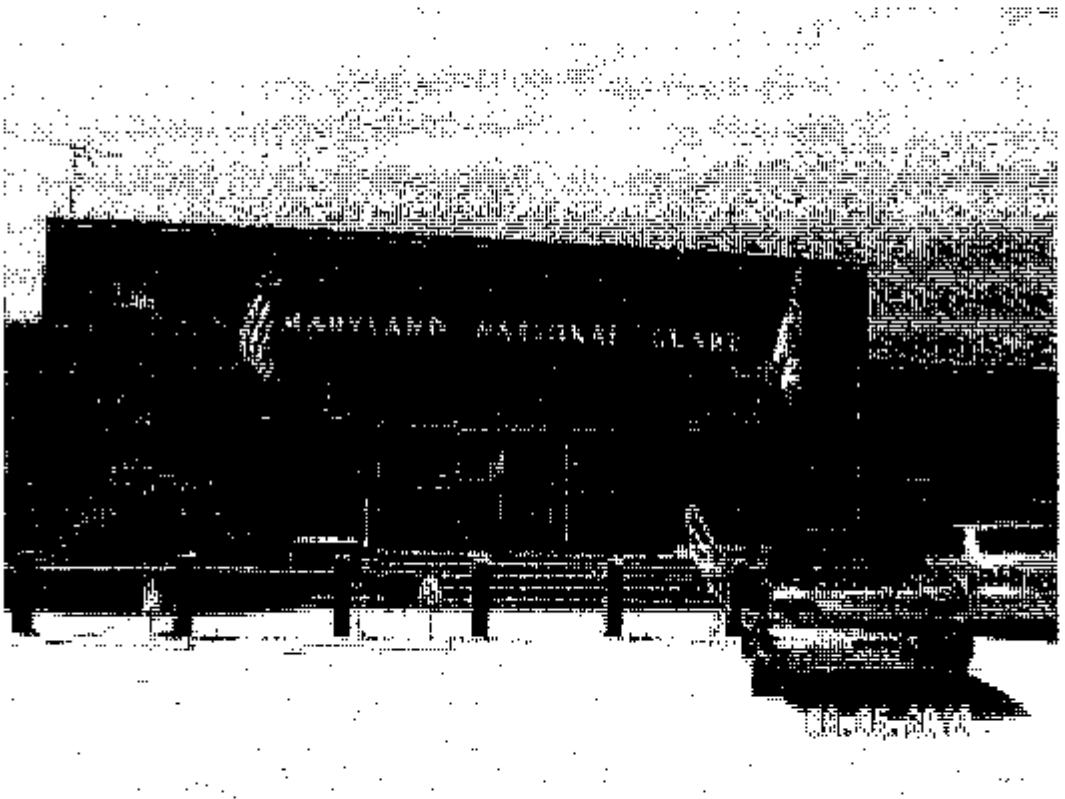

Photo 2: Exterior view, front.

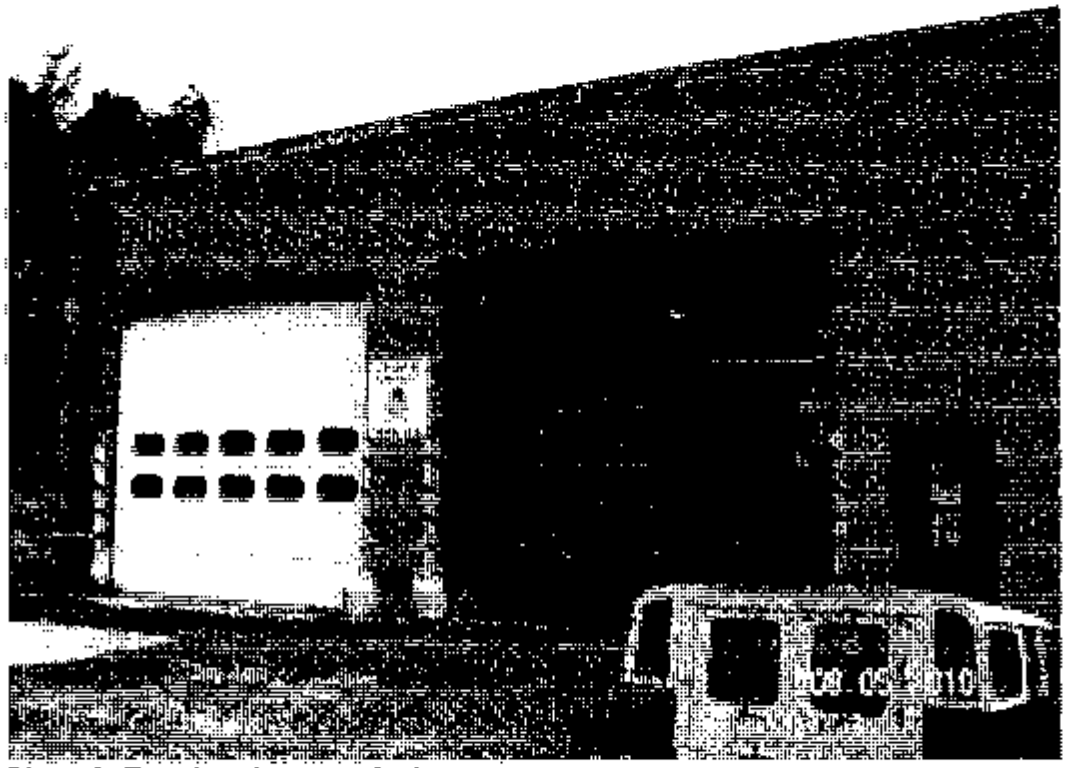

Photo 3: Exterior view, attached garage.

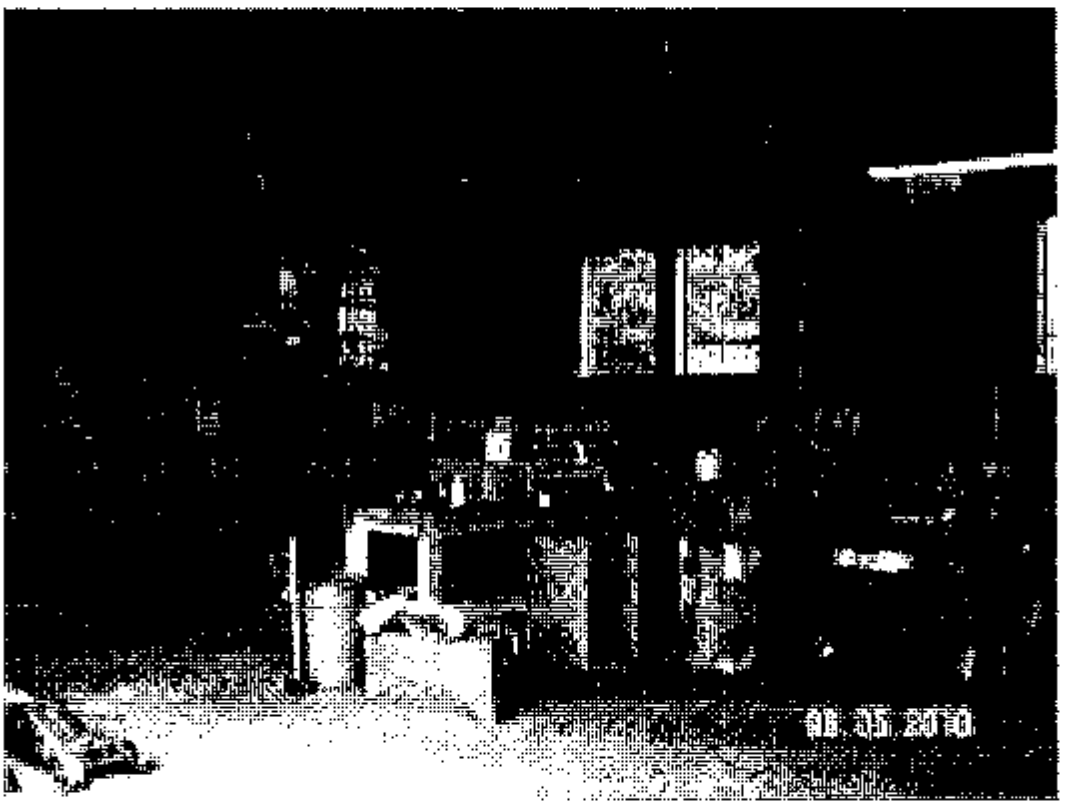

Photo 4: Interior view, attached garage.

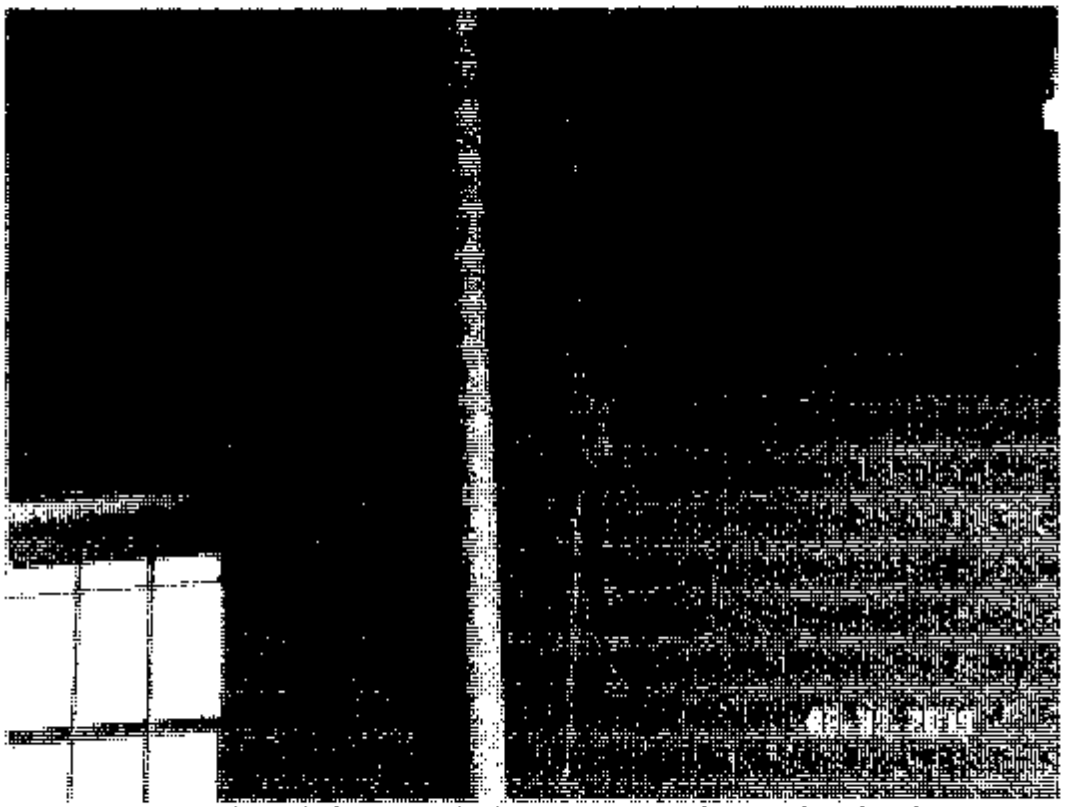

Photo 5: Exhaust hose in bay, attached garage; currently non-functional.

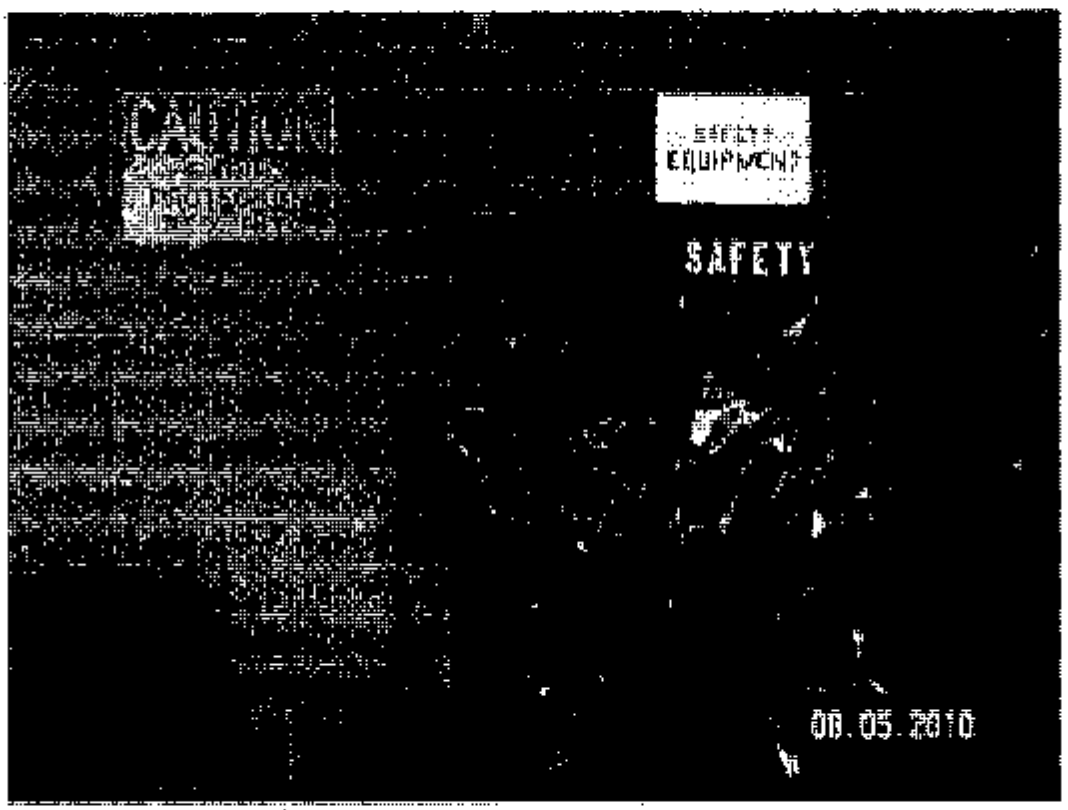

Photo 6: PPE in attached garage.

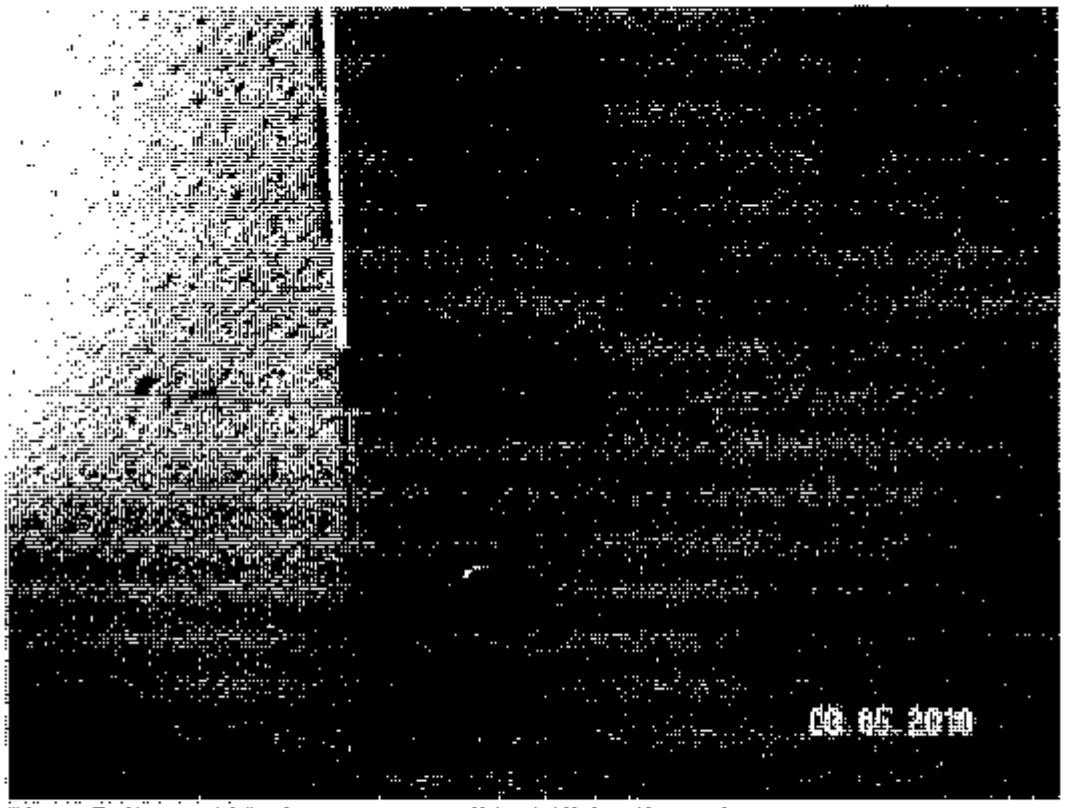

Photo 7: Room 110; damage to possible ACM ceiling tile.

Photo 8: Drill Hall.

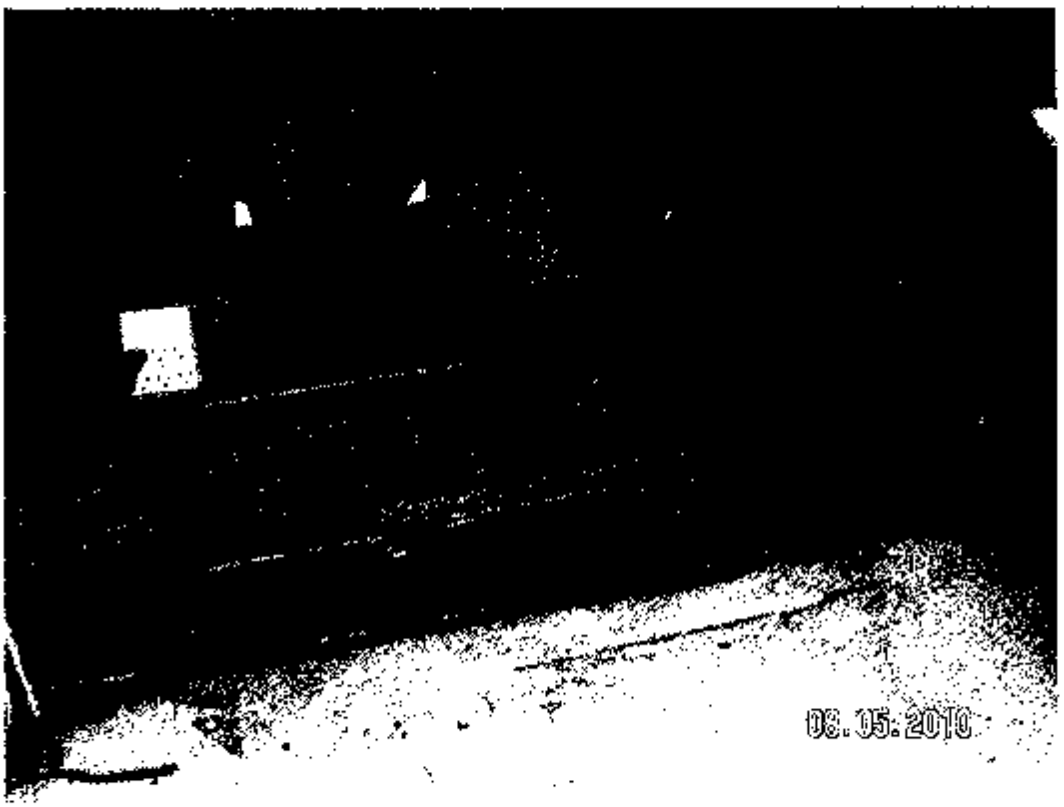

Photo 9: Heating vents.

Photo 10: Supply Room; damaged chipping paint on ceiling.

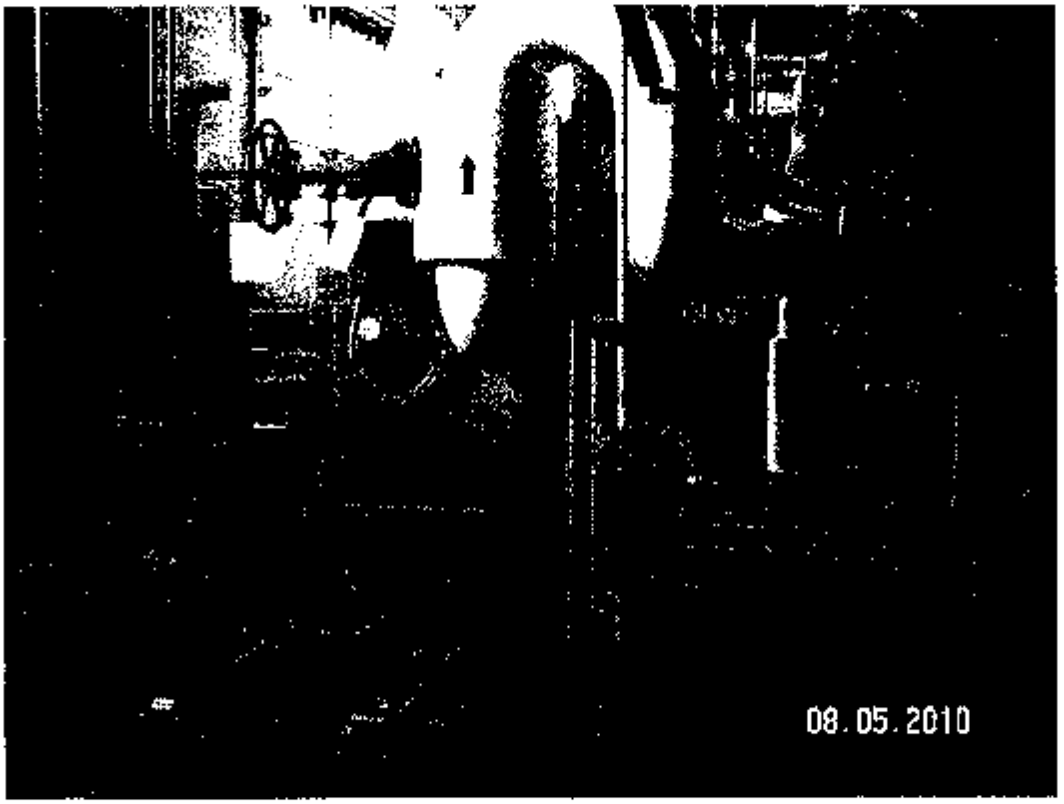

Photo 11: Boiler.

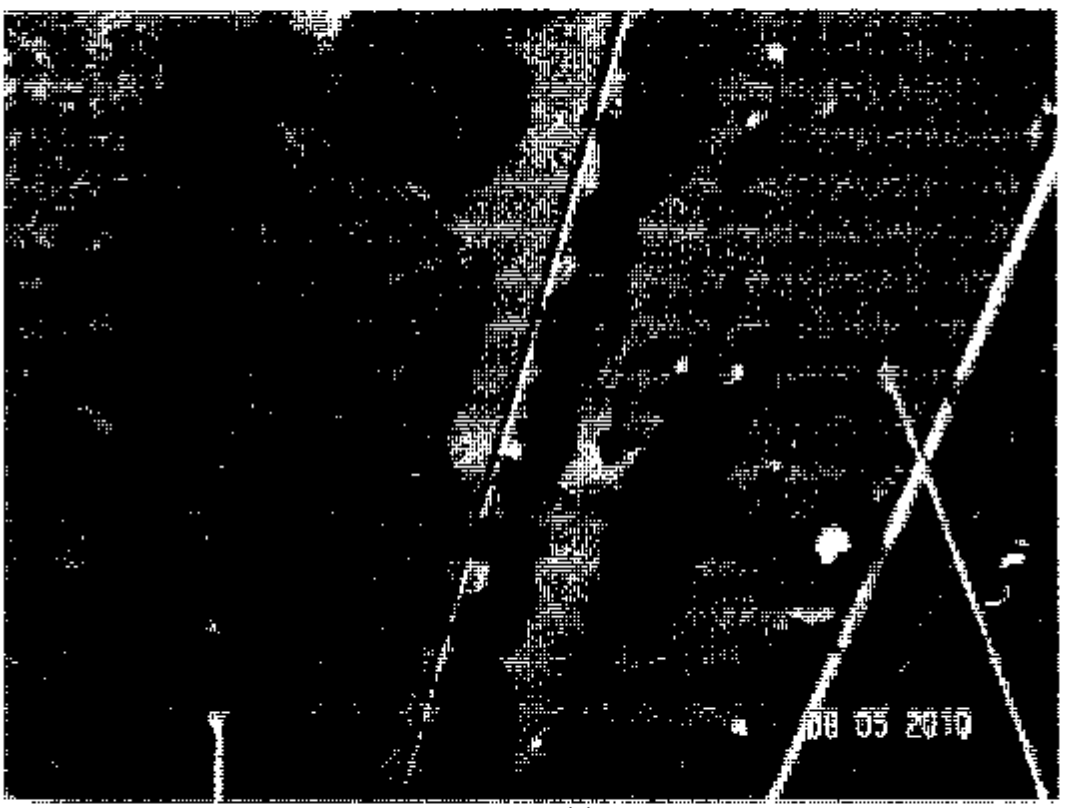

Photo 12: Boiler room, chipping paint on ceiling.

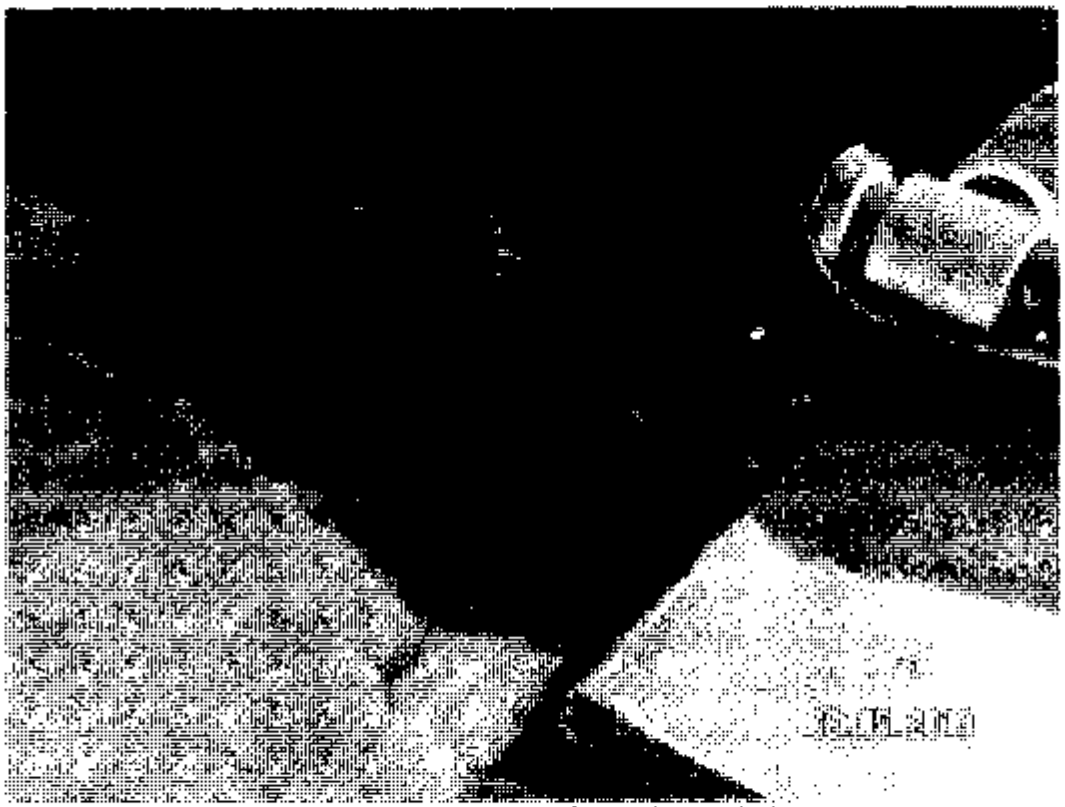

Photo 13: Standing water on floor dripping from pipe on boiler.

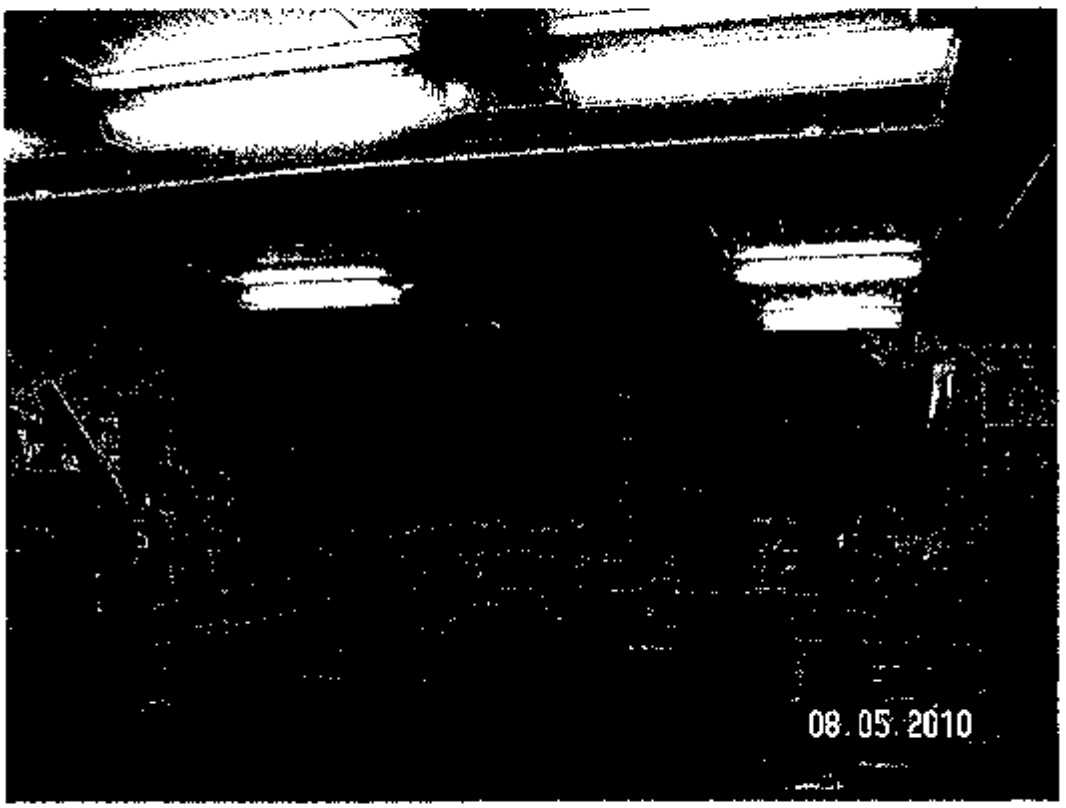

Photo 14: Converted firing range (gym).

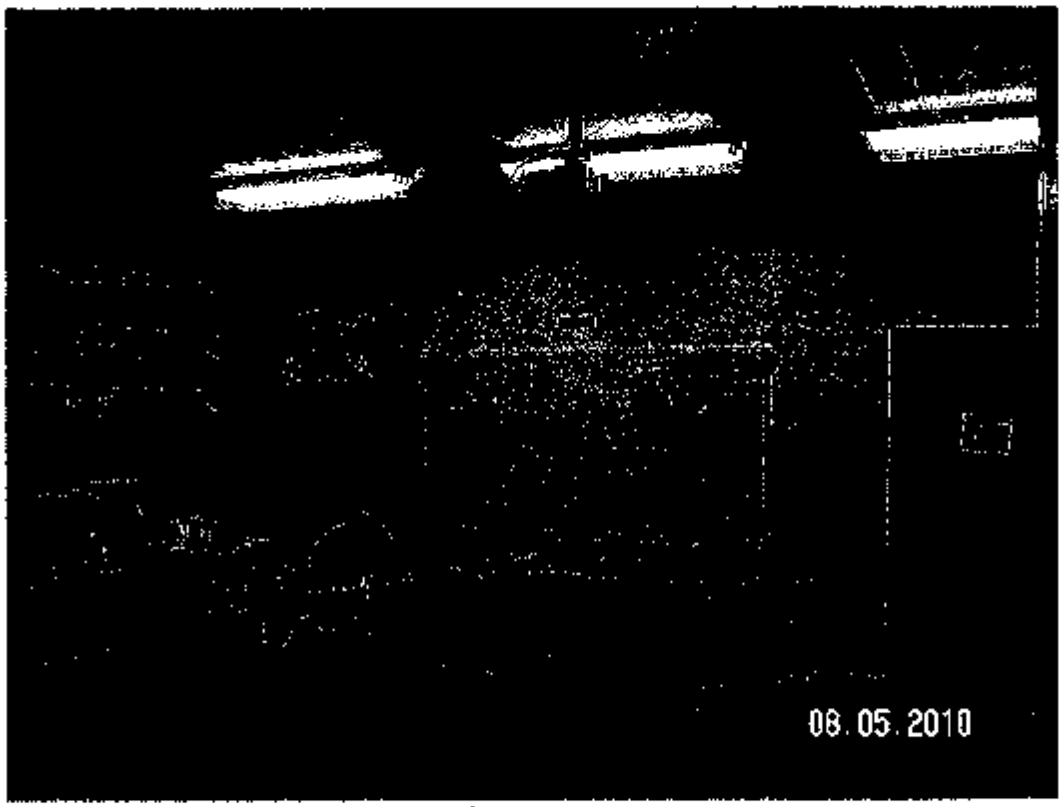

Photo 15: Converted firing range (office).

BEST AVAILABLE COPY

Appendix C
Floor Plans

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

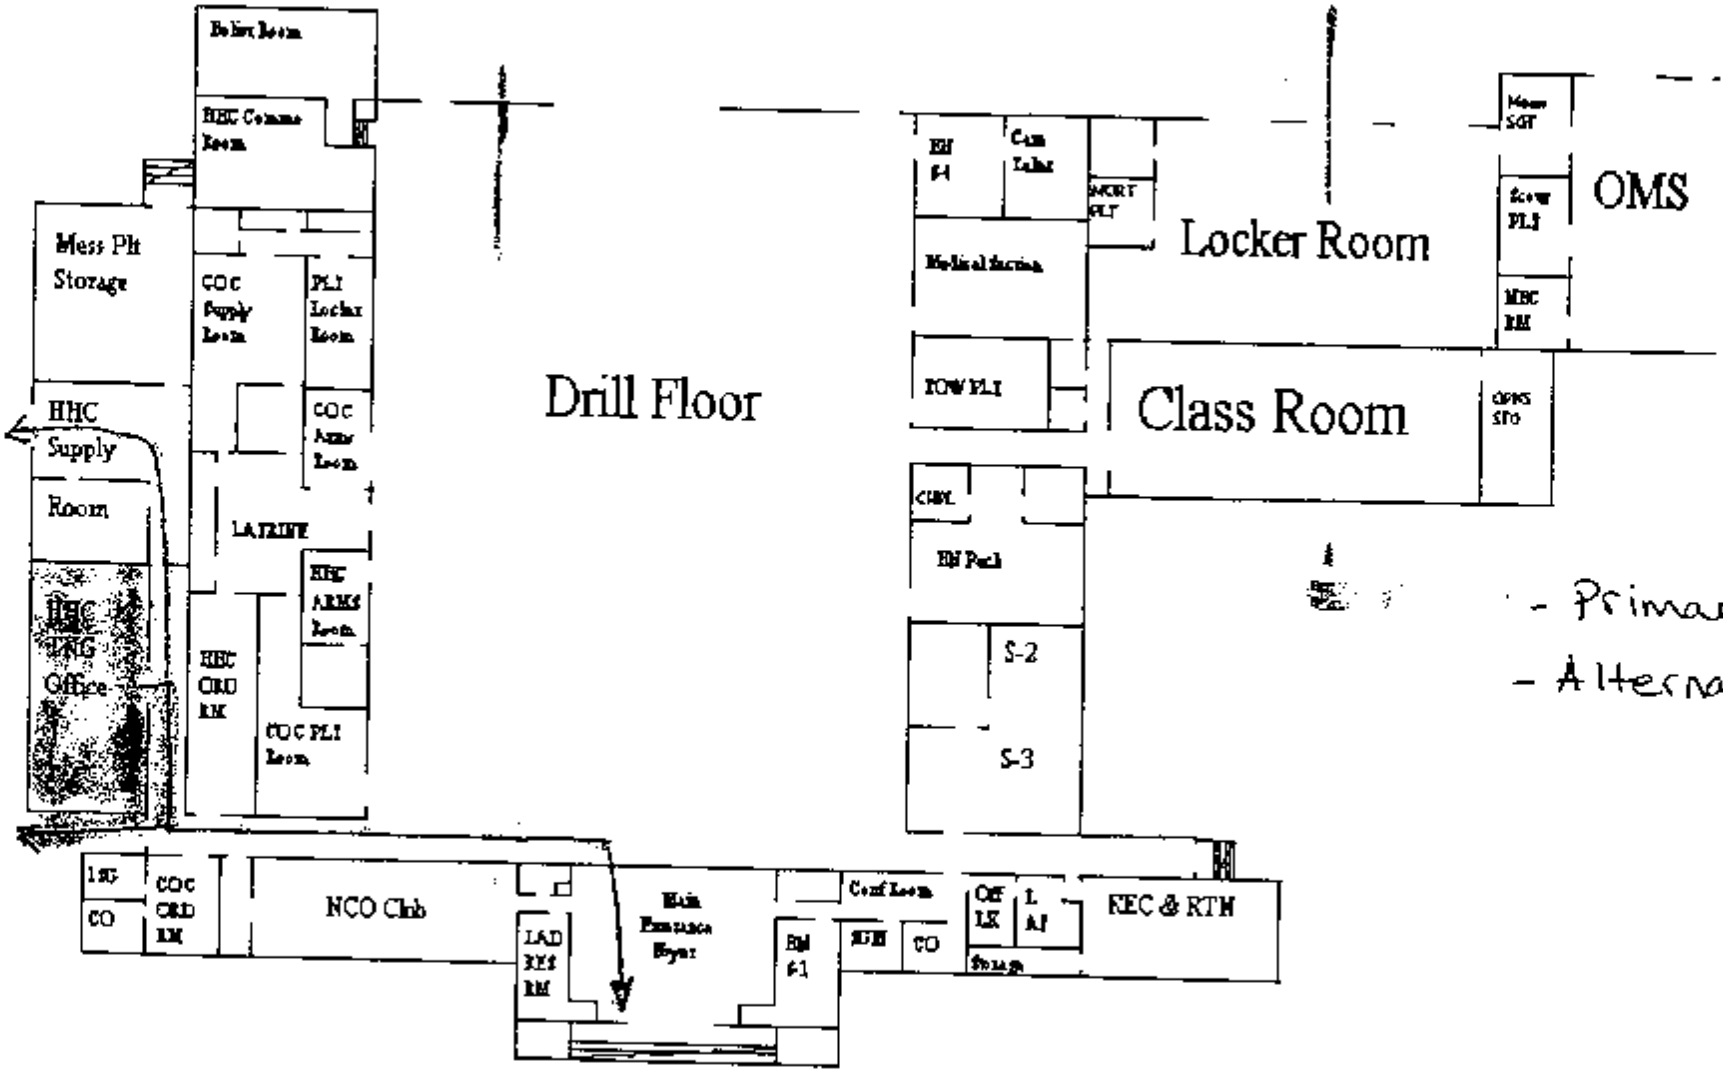

Emergency Escape Plan

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2215 of 5269

BEST AVAILABLE COPY

Appendix D
References

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2217 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS May 2004

MEMORANDUM FOR Army National Guard Bureau (NGB) Region North Industrial Hygiene NGB-AVS-SI-IH/Non-Responsive, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03 SGT. BG Louis G Smith Armory, Easton MD

1. Enclosed is a copy of subject report and one CD-ROM.

2. Please direct any additional comments or concerns to Ms. Non-Responsive at Non-Responsive@apg.amedd.army.mil.

Non-Responsive

ENCL

Industrial Hygienist
Industrial Hygiene Field Services Program

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
BG LOUIS G SMITH ARMORY
EASTON, MD
55-ML-01ED-03

Approved for public release; distribution unlimited.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES INDUSTRIAL HYGIENE BASELINE SURVEYS, BG LOUIS G SMITH ARMORY
EASTON, MD
PROJECT NO. 55-ML-01ED-03

1. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

2. CONCLUSIONS.

a. Indoor Air Quality. The armory relative humidity of 45.3 % to 50.2 % met the ASHRAE recommended guidelines for air quality of 30%- 60% relative humidity. The indoor temperatures ranged from 74.4 to 75.9 degrees Fahrenheit. They were within the ASHRAE recommended guidelines for an acceptable thermal environment of 73-79 degrees Fahrenheit in the summer and 68-74.5 degrees Fahrenheit in the winter at 50 % relative humidity. All indoor carbon dioxide levels met the ASHRAE recommended guidelines. The indoor carbon dioxide levels ranged from 397- to 432 ppm. To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm. Therefore the total carbon dioxide level should not exceed approximately 1050 ppm in this armory.

b. Lead. In the drill area, the walls are brick and acoustical tile. There is no paint in this area. All air samples were below the laboratory analytical detection limit for lead in air of 3.0 to 15.0µg/m³ as well as the Occupational Health and Safety Administration (OSHA) standard of 50µg/m³ for lead in air. Three dust-lead wipe sample results, located on the floor of the former IFR, exceeded the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on frequently contacted surfaces (200 to 1100µg/ft²) (photos 1593, 1594, and 1595). Paint sampling was conducted for deteriorated paint. One sample was from the paint on the wall and ceiling in the kitchen, above and to the right of the sink (photo 1598). The result was 0.009 % lead which is below the laboratory detectible limits of 0.01 %. The other sample was from the wall where the acoustical stops and cmu starts. The result was 0.017 % which is below the lead-based paint standard of 0.5 % but above detection limits and is referred to as lead-contaminated paint.

3. RECOMMENDATIONS. The Department of Defense Risk Assessment Codes (RAC) for Health Hazards enables one to prioritize remedial action for hazards. Risk Assessments Codes range in magnitude from 1 to 5, with 1 being the highest priority. The RAC for Lead Exposure

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2221 of 5269

BEST AVAILABLE COPY

sampling results showed elevated levels of lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area. These actions should be accomplished before allowing children into the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for children and for the general workforce. Repair and stabilize deteriorated paint on walls. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead. Test drinking water from water fountains and faucets for lead. Address all potential lead hazards before extending this facility to use for children. If children will be using this facility, clean surfaces to the EPA dust-lead standards for young children of 40µg/ft² on floors and 250µg/ft² for dust-lead on window sills.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2222 of 5269

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys, BG Louis G Smith Armory, Easton MD
Project No. 55-ML-01ED-03

TABLE OF CONTENTS

Paragraph Page

1. AUTHORITY 1
2. PURPOSE OF EVALUATION 1
3. BACKGROUND INFORMATION 1
4. SUMMARY OF ACTIONS 1
5. ASSESSMENT CRITERIA FOR LEAD 2
6. SAMPLING RESULTS 2
7. DISCUSSION AND CONCLUSIONS 3
8. RECOMMENDATIONS 4
9. ADDITIONAL ASSISTANCE 4

Enclosure 5

Appendices

A. - ASSESSMENT CRITERIA FOR LEAD A-1
B. - SITE MAPS B-1
C. - PHOTOGRAPHS C-1
D. - SAMPLING SHEETS AND LAB ANALYSES D-1
E. - REFERENCES E-1
F. - LEAD CLEANING GUIDANCE F-1
G. - MOLD GUIDANCE G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2223 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: BG Louis G Smith Armory, Easton MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. Light Infantry. Changing to Anti Armor Unit.

b. Date of Construction. 1975.

c. POC. SGM Non-Responsive (410) 974-7400 Cell (443) 277-4923 and Mr. Non-Responsive

d. Survey Date. 26 August 2003.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe and lead in air sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Carbon dioxide, temperature, and relative humidity measurements were collected. Sample results and locations are in Appendix D.

b. Physical Condition of Facilities.

(1) Paint. Staff Sergeant Non-Responsive, Environmental Compliance Assessment Coordinator for the MD NGB, stated that there are no records of lead-based paint abatement. The paint was deteriorated in Room 107 (Library) (photo # 1602).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2224 of 5269

BEST AVAILABLE COPY

(2) Asbestos. Staff Sergeant Non-Responsive stated that there are no records of an asbestos abatement. No asbestos was observed.

(3) Mold. No mold was observed.

(4) Safety Hazards. No safety hazards were observed.

c. Training. SSG Non-Responsive has received HAZCOM and HAZMAT training.

d. Safety and Industrial Hygiene Programs. There are no written program records at the armory.

e. Heating, Ventilation, and Air-conditioning System. There is a central HVAC system for the entire building.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting. No lighting measurements were collected.

h. Converted indoor firing range (IFR). Staff Sergeant Non-Responsive, Environmental Compliance Assessment Coordinator for the MD NGB, stated that there are no records of a lead abatement for the indoor firing range during its conversion. The IFR has been converted into a storage area. There is a new drop ceiling and the old ventilation has been removed.

i. Photographs (Appendix C).

j. Site Maps (Appendix B).

k. Facility use by children. The POC stated that children occupy the armory occasionally when it is rented and twice a year for holiday functions.

5. ASSESSMENT CRITERIA FOR LEAD. (Appendix A).

6. SAMPLING RESULTS.

a. Indoor Air Quality. The outdoor relative humidity was measured as 76.0 %. The outdoor temperature was 86.5 degrees Fahrenheit. The armory relative humidity of 45.3 % to 50.2 % met the ASHRAE recommended guidelines for air quality of 30%- 60% relative humidity. The indoor temperatures ranged from 74.4 to 75.9 degrees Fahrenheit. They were within the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2225 of 5269

BEST AVAILABLE COPY

ASHRAE recommended guidelines for an acceptable thermal environment of 73-79 degrees Fahrenheit in the summer and 68-74.5 degrees Fahrenheit in the winter at 50 % relative humidity.

The outdoor carbon dioxide level was 340 ppm. All indoor carbon dioxide levels met the ASHRAE recommended guidelines. The indoor carbon dioxide levels ranged from 397- to 432 ppm. To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm. Therefore the total carbon dioxide level should not exceed approximately 1050 ppm in this armory.

b. Lead. All air samples were below the laboratory analytical detection limit for lead in air of 3.0 to 15.0µg/m³ as well as the Occupational Health and Safety Administration (OSHA) standard of 50µg/m³ for lead in air. Three dust-lead wipe sample results, located on the floor of the former IFR, exceeded the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on frequently contacted surfaces (200 to 1100µg/ft²). Paint sampling was conducted for deteriorated paint. One result was 0.009ug/ft2 which is below laboratory detectible limits of 0.01ug/ft2. The other sample result was 0.017 which is below the lead-based paint standard of 0.7ug/ft2 but above detection limits and is referred to as lead-contaminated paint.

7. DISCUSSION AND CONCLUSIONS.

a. Indoor Air Quality. The armory relative humidity of 45.3 % to 50.2 % met the ASHRAE recommended guidelines for air quality of 30%- 60% relative humidity. The indoor temperatures ranged from 74.4 to 75.9 degrees Fahrenheit. They were within the ASHRAE recommended guidelines for an acceptable thermal environment of 73-79 degrees Fahrenheit in the summer and 68-74.5 degrees Fahrenheit in the winter at 50 % relative humidity.

All indoor carbon dioxide levels met the ASHRAE recommended guidelines. The indoor carbon dioxide levels ranged from 397- to 432 ppm. To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which is approximately 350 ppm. Therefore the total carbon dioxide level should not exceed approximately 1050 ppm in this armory.

b. Lead. In the drill area, the walls are brick and acoustical tile. There is no paint in this area. All air samples were below the laboratory analytical detection limit for lead in air of 3.0 to 15.0µg/m³ as well as the Occupational Health and Safety Administration (OSHA) standard of 50µg/m³ for lead in air. Three dust-lead wipe sample results, located on the floor of the former IFR, exceeded the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on frequently contacted surfaces. The results were 200 to 1100µg/ft² (photos 1593, 1594, and 1595). Paint sampling was conducted for deteriorated paint. One sample was from

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2226 of 5269

BEST AVAILABLE COPY

the paint on the wall and ceiling in the kitchen, above and to the right of the sink (photo 1598). The result was 0.009 % lead which is below the laboratory detectible limits of 0.01 %. The other sample was from the wall where the acoustical tile stops and the cmu starts- middle (photo 1596). The result was 0.017 %. This is below the lead-based paint standard of 0.5 % but above detection limits and is referred to as lead-contaminated paint. All the floor dust-lead sample results exceeded the EPA lead exposure levels of 40µg/ft² for children for dust-lead on floors. There are significant levels of lead in the converted IFR storage room. Children may be exposed to significant levels of lead from dust-lead, deteriorated lead-based paint, and lead contaminated paint in this facility. AR 420-70 states that the purpose of Army lead hazard management is to protect children from all sources of lead exposure. However, its provisions only control these exposures, and do not eliminate them. Recleaning and sealing former firing range area may further prevent exposures for children under six and for the general workforce.

8. RECOMMENDATIONS. Enclosure.

9. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by e-mail [redacted]@apg.amedd.army.mil.

[redacted]

INDUSTRIAL HYGIENIST
USACHPPM LEAD AND ASBESTOS TEAM LEADER
Industrial Hygiene Field Services Program
EPA AHERA Asbestos Inspector and Management Planner/
Certification Number MD-070340
EPA Lead Inspector and Lead Risk Assessor/
Certification Number 04-7913

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2227 of 5269

BEST AVAILABLE COPY

ENCLOSURE

EASTON ARMORY RECOMMENDATIONS

The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority. The RAC for this armory for Lead Exposure is classified as 5.

a. Clean all areas in and adjacent to the storage room (converted IFR) where sampling results showed elevated levels of lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area. These actions should be accomplished before allowing children into the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for children and for the general workforce.

b. Repair and stabilize deteriorated paint.

c. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62.

d. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

e. Test drinking water from water fountains and faucets for lead. It could not be determined if this has been done.

f. Address all potential lead hazards before extending this facility to use for children. If children will be using this facility, clean surfaces to the EPA dust-lead standards for young children of 40µg/ft² on floors and 250µg/ft² for dust-lead on window sills.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2228 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

Subject: Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 $\mu g/ft^2$. This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e)(8)(viii))are not directly applicable because they are developed for floors (40 $\mu g/ft^2$), windowsills (250 $\mu g/ft^2$) and window troughs (400 $\mu g/ft^2$) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

BEST AVAILABLE COPY

APPENDIX B

SITE MAPS

BEST AVAILABLE COPY

BEST AVAILABLE COPY

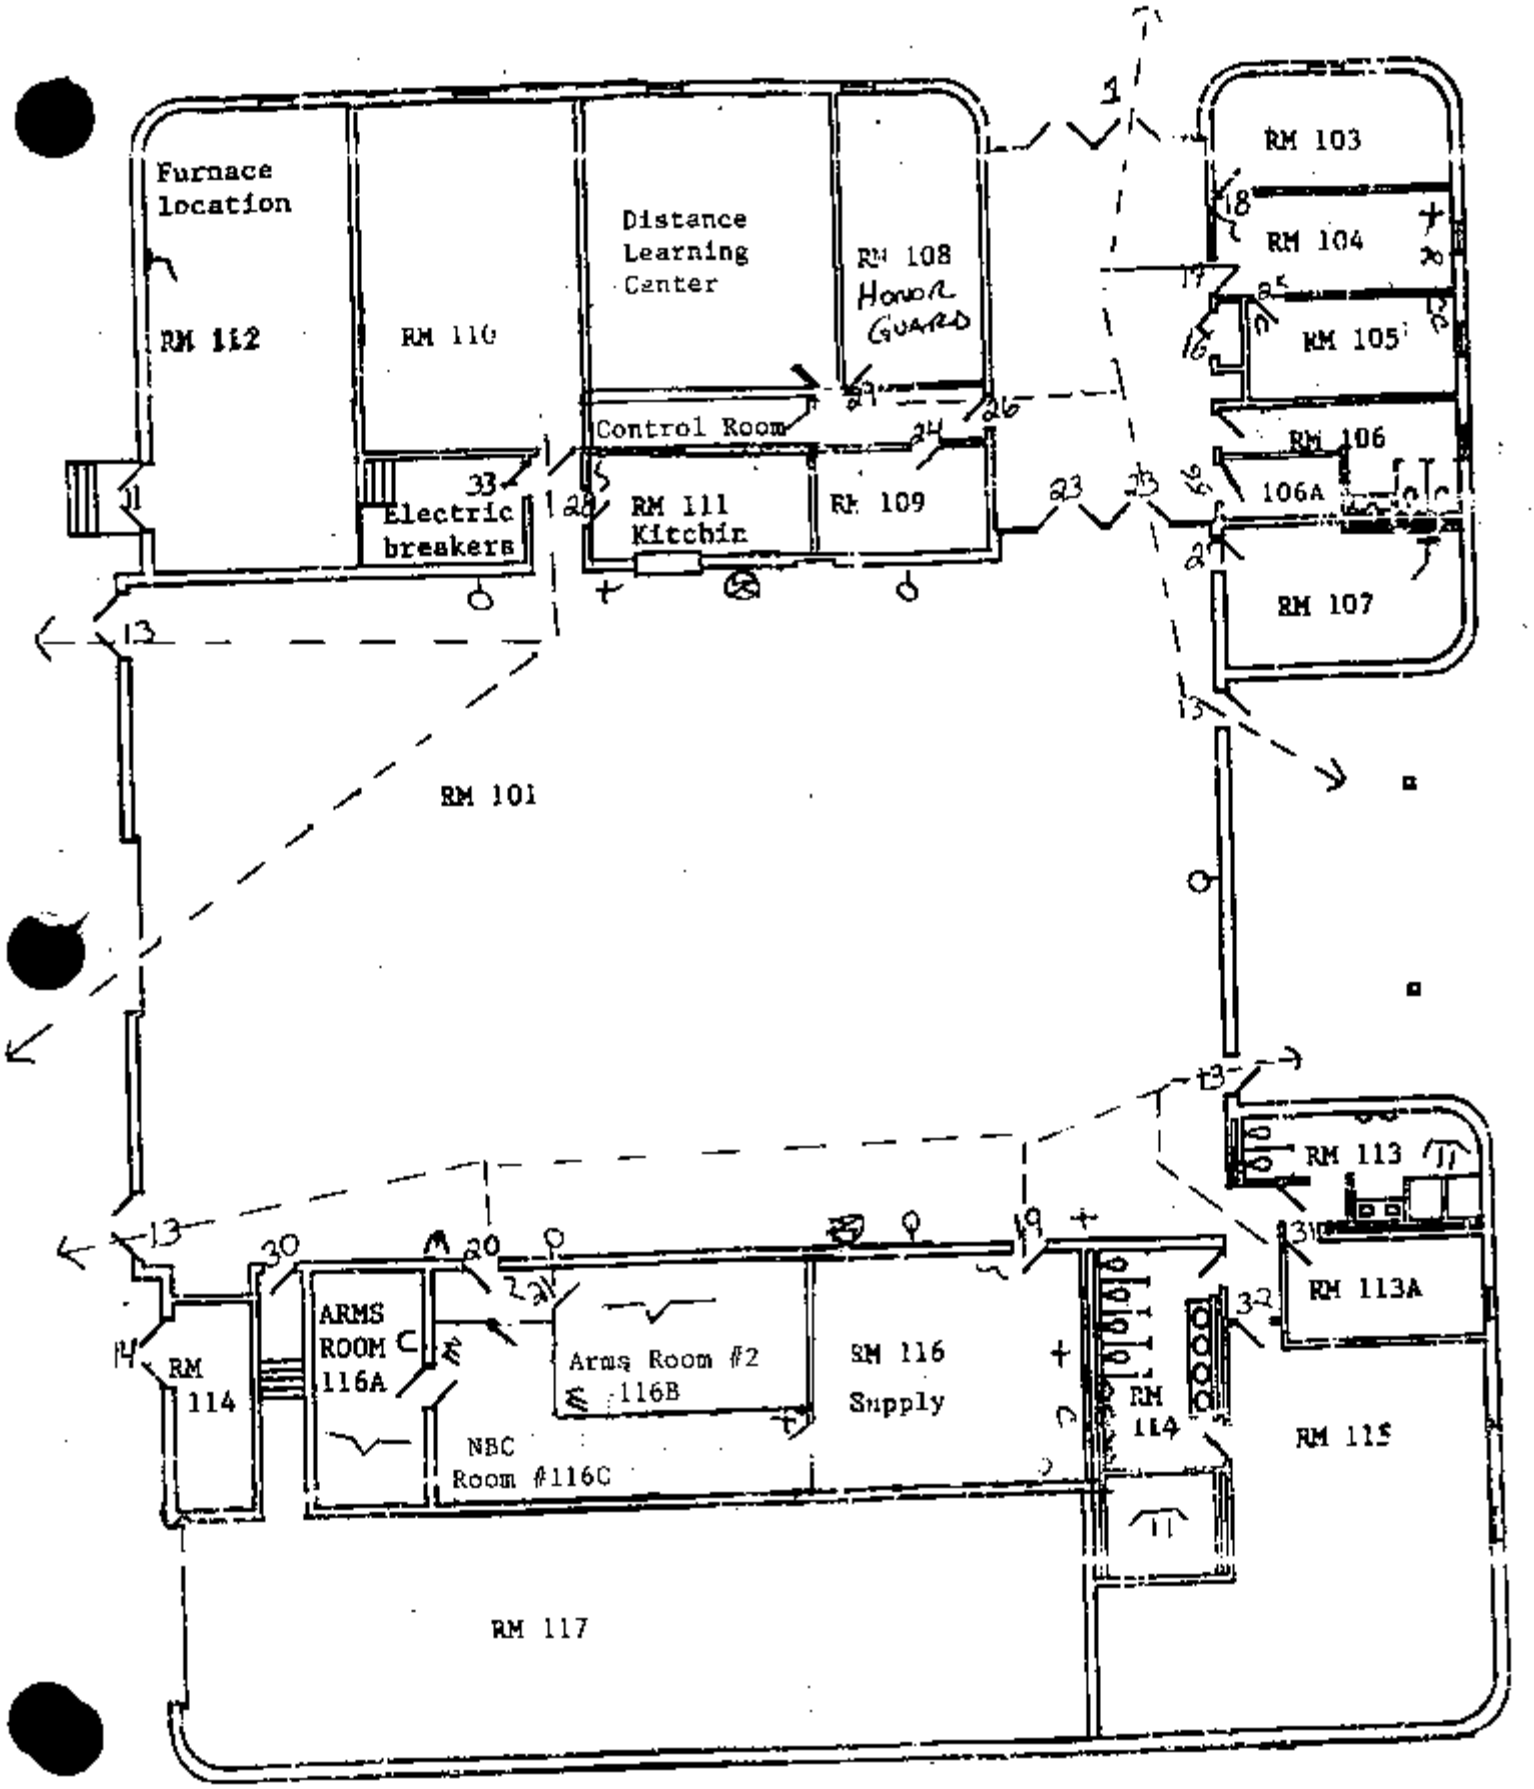

EASTON ARMORY
FLOOR PLAN
NO SCALE

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

BEST AVAILABLE COPY

Photo Number	Photo Location
1593	Floor of former IFR
1594	Floor of former IFR
1595	Floor where baffle used to be – now weight area
1596	Wall where acoustical stops and cmu starts
1597	Kitchen counter
1598	Wall/ceiling in kitchen
1599	Floor in lobby between bathrooms
1600	Desk in Room 105 near window
1601	Wall in Room 103 Recruiter Office
1602	Room 107 Library/ peeling paint

BEST AVAILABLE COPY

P 592.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

P0001593.JPG Unknown

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

P 594.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

P0001595.JPG Unknown

BEST AVAILABLE COPY

P0 596.JPG Unknown

P0001597.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

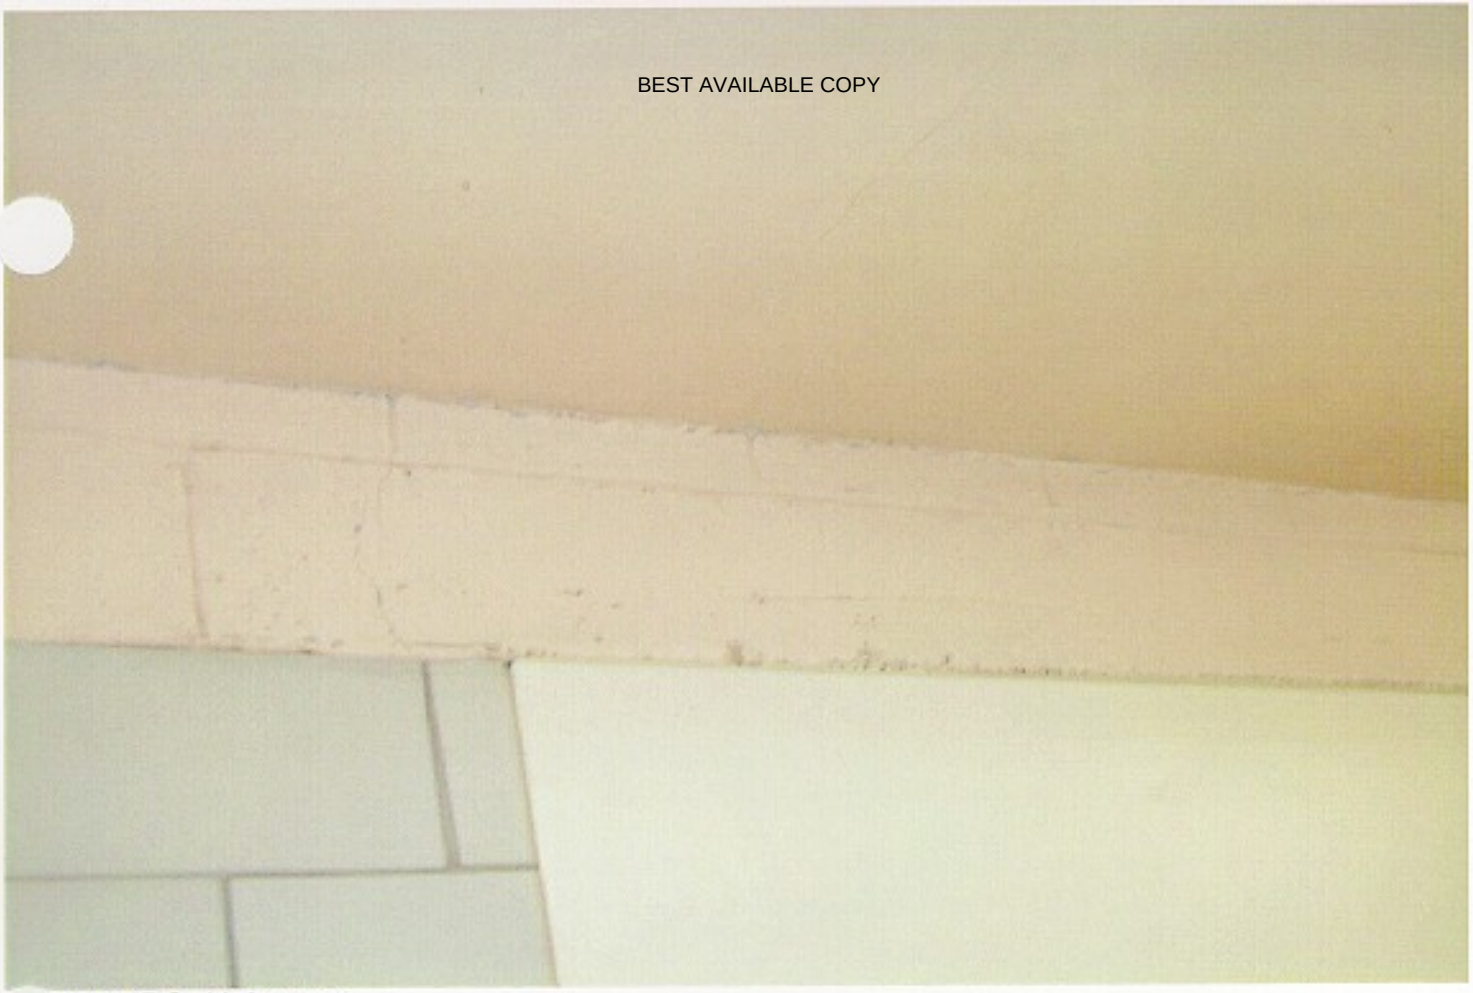

P0 598.JPG Unknown

Posted to NGB FOIA Reading Room
May 2018

BEST AVAILABLE COPY

[redacted] ord #J-15-0085 (MD)
Released by National Guard Bureau

P0001599.JPG Unknown

BEST AVAILABLE COPY

P 600.JPG Unknown

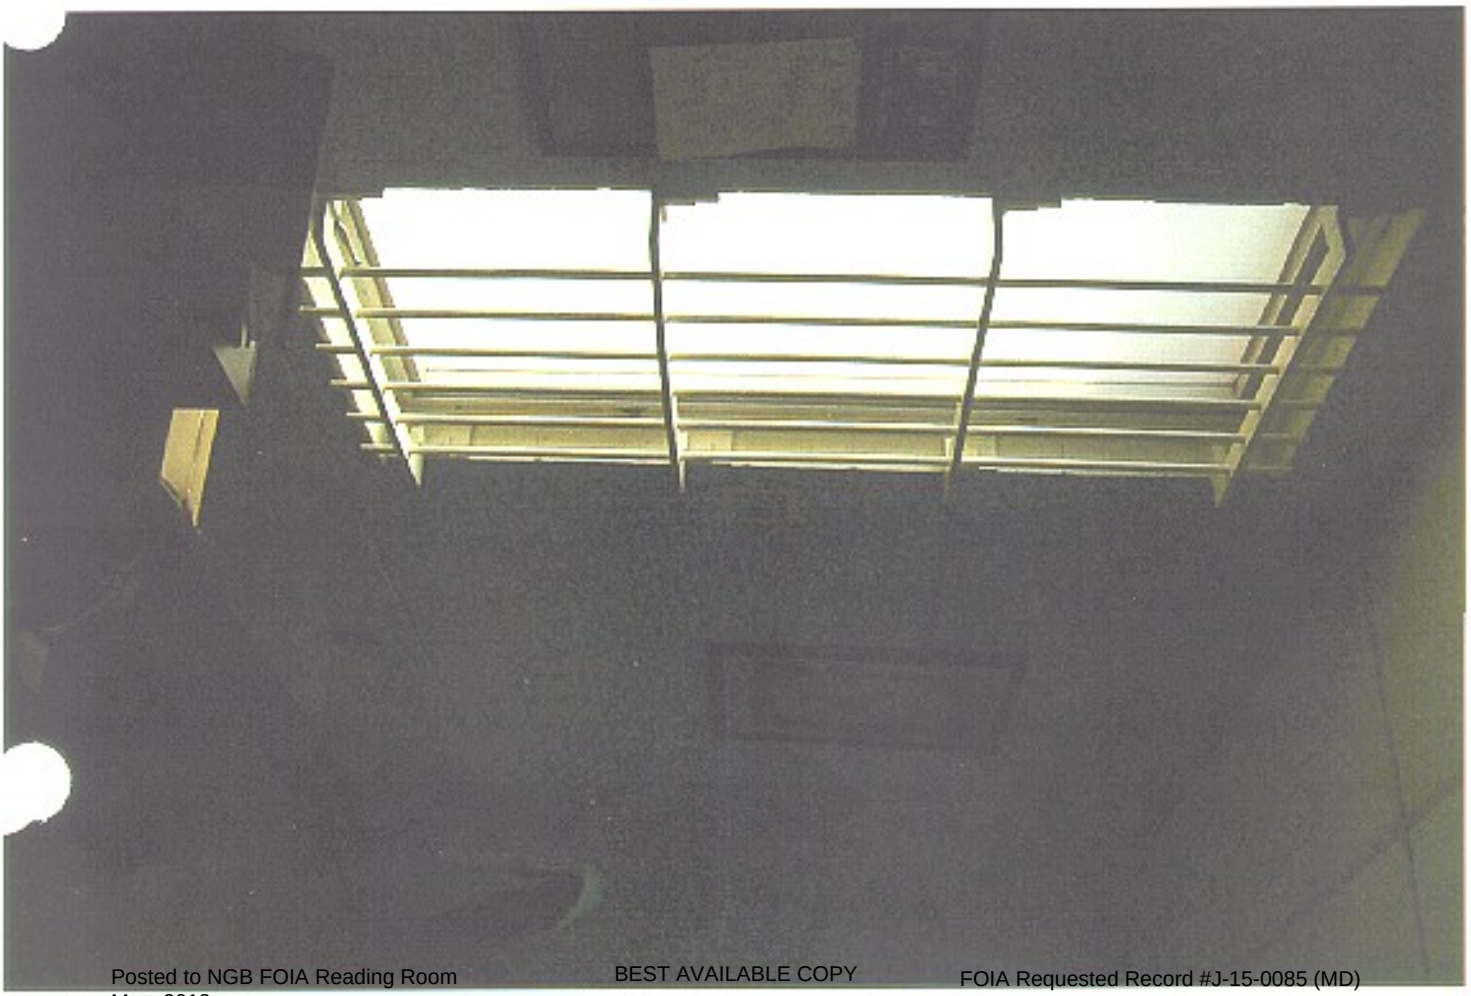

P0001601.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

F 1602.JPG Unknown

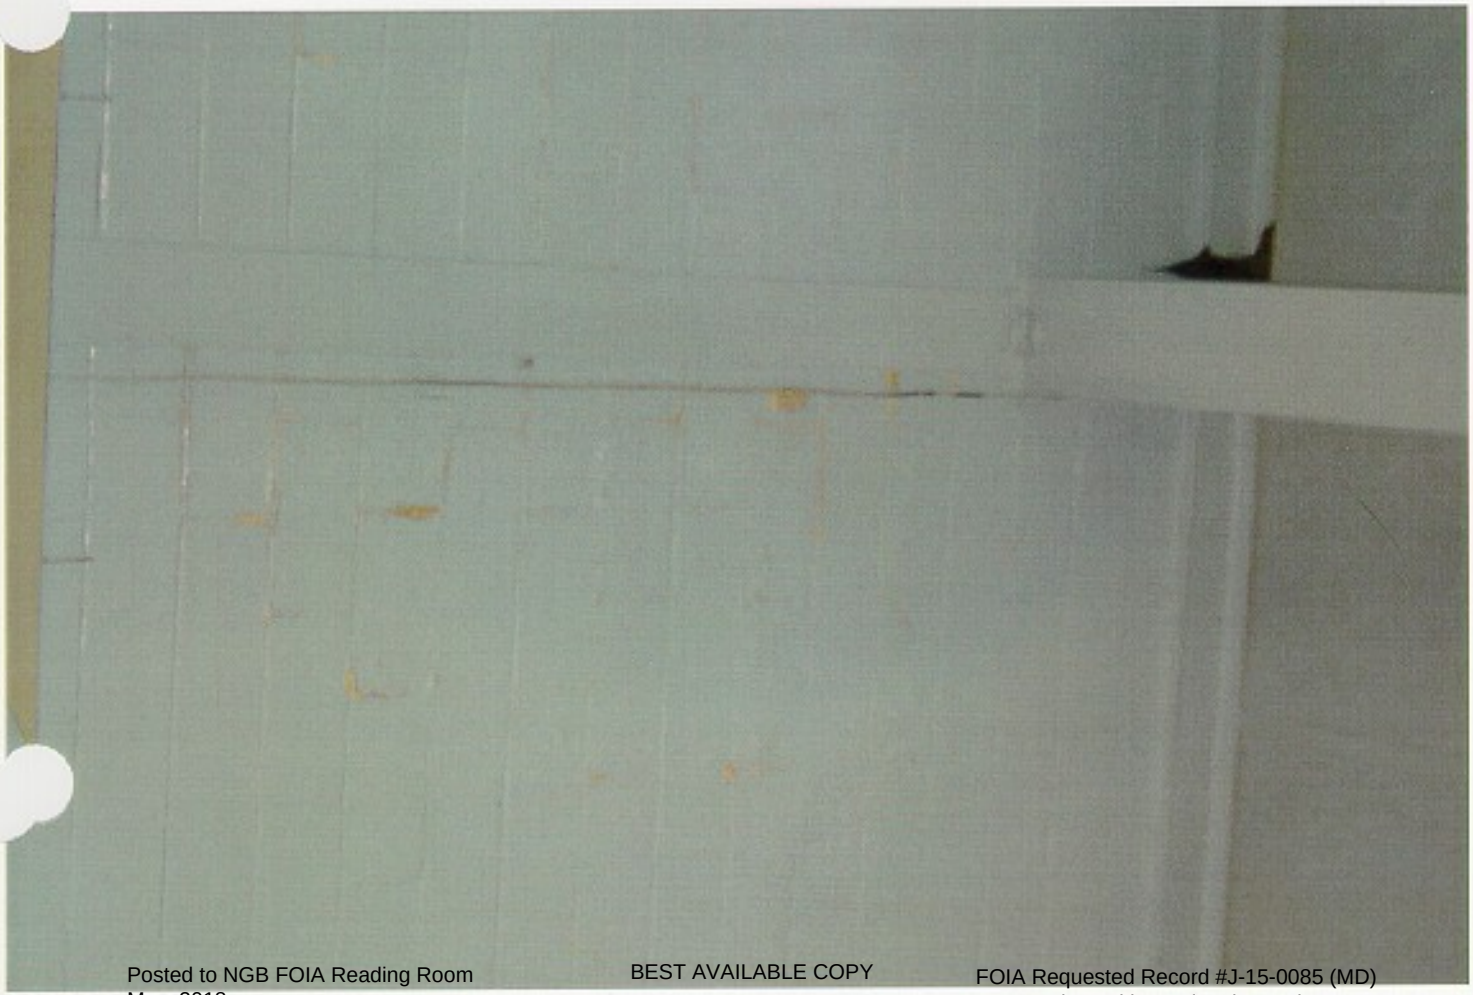

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

P0001604.JPG Unknown

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX D

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Wipe Sample #	Armory	City	Indoor Range Info: Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
				Yes		Unknown		
EAW01	Easton	Easton					On floor on former IFR near door	200
EAW02	Easton	Easton					On floor about midway of former IFR	1100
EAW03	Easton	Easton					On floor where baffle used to be (now weight area)	250
EAW04	Easton	Easton					On counter in kitchen near sink	<110
EAW05	Easton	Easton					On floor in lobby between bathrooms	<110
EAW06	Easton	Easton					On desk in Room 105 near window	<110
EAW07	Easton	Easton					On wall in Room 103 recruiter's office near window	<110
EAW08	Easton	Easton					On floor in Room 107 (library) peeling paint above	<110

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	National Guard Bureau	**Job Name:**	Not Provided	**Chain Of Custody:**	117281
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	09/09/2003
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	09-Sep-03

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0366797	EA W01	Flame	Wipe	****	0.108	111.52	ug/ft²		200	ug/ft²	
0366798	EA Blank 01	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0366799	EA W02	Flame	Wipe	****	0.108	111.52	ug/ft²		1100	ug/ft²	
0366800	EA W03	Flame	Wipe	****	0.108	111.52	ug/ft²		250	ug/ft²	
0366801	EA W04	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366802	EA W05	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366803	EA Blank 02	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0366804	EA W06	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366805	EA W07	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366806	EA W08	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366807	EA Bulk 01	Flame	Paint Chip	****	N/A	0.01	%Pb		0.017	%Pb	
0366808	EA Bulk 02	Flame	Paint Chip	****	N/A	0.01	%Pb	<	0.009	%Pb	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analyst: Jodi Willoughby **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.

All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	National Guard Bureau	**Job Name:**	Not Provided	**Chain Of Custody:**	117281
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Analyzed:**	09/09/2003
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	09-Sep-03

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0366797	EA W01	Flame	Wipe	****	0.108	111.52	ug/ft²		200	ug/ft²	
0366798	EA Blank 01	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0366799	EA W02	Flame	Wipe	****	0.108	111.52	ug/ft²		1100	ug/ft²	
0366800	EA W03	Flame	Wipe	****	0.108	111.52	ug/ft²		250	ug/ft²	
0366801	EA W04	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366802	EA W05	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366803	EA Blank 02	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0366804	EA W06	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366805	EA W07	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366806	EA W08	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0366807	EA Bulk 01	Flame	Paint Chip	****	N/A	0.01	%Pb		0.017	%Pb	
0366808	EA Bulk 02	Flame	Paint Chip	****	N/A	0.01	%Pb	<	0.009	%Pb	

BULK SAMPLES

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analyst: Joni Willoughby **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX E

REFERENCES

BEST AVAILABLE COPY

APPENDIX E

REGULATIONS AND STANDARDS

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current ed. http://www.osha.gov/comp-links.html.

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf.

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990. http://www.usapa.army.mil/pdffiles/r40_5.pdf.

4. AR 385-10, The Army Safety Program, 29 February 2000. http://www.usapa.army.mil/pdffiles/r385_10.pdf.

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p40_503.pdf.

6. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), American Conference of Governmental Industrial Hygienists (ACGIH), current ed.

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. RP-1-1993, Office Lighting, ANSI/ESNA.

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2248 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2249 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2250 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2251 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2252 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2253 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2254 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2255 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

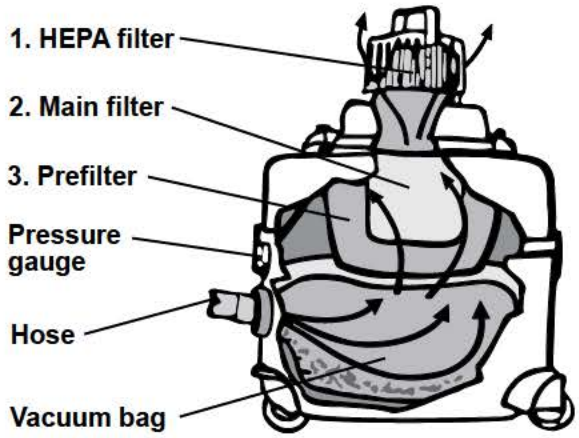

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

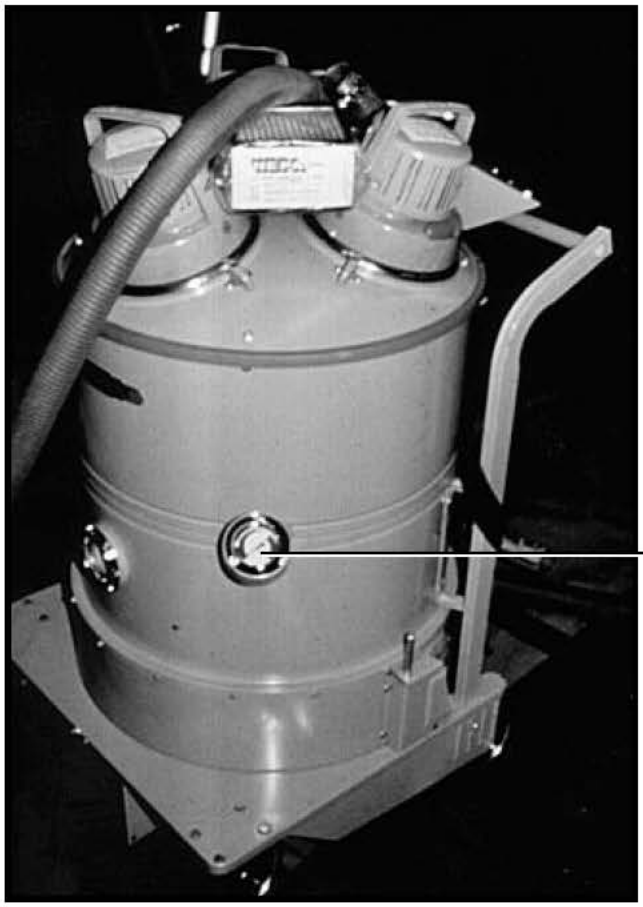

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2256 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

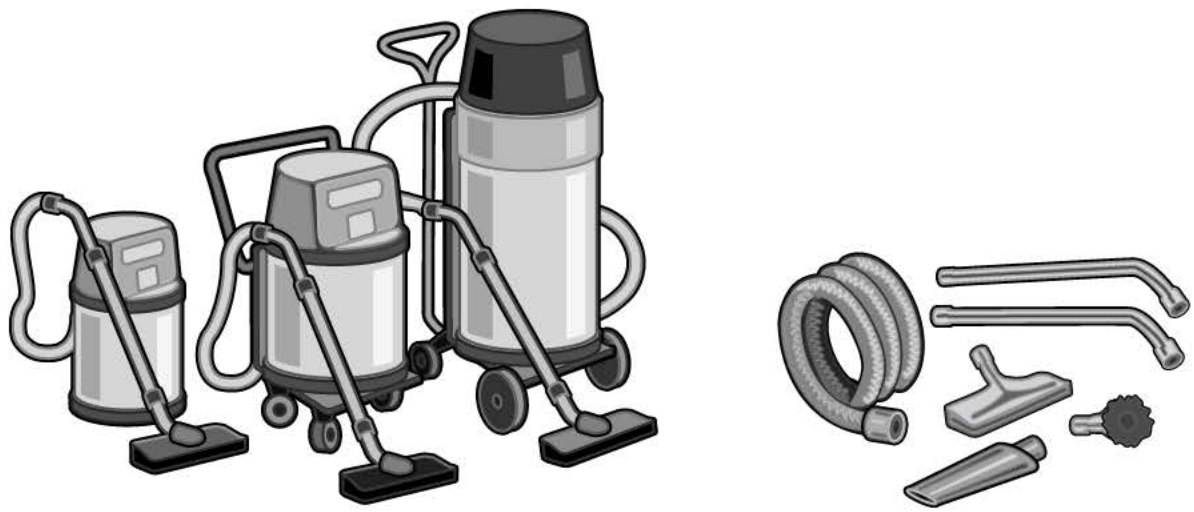

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2257 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

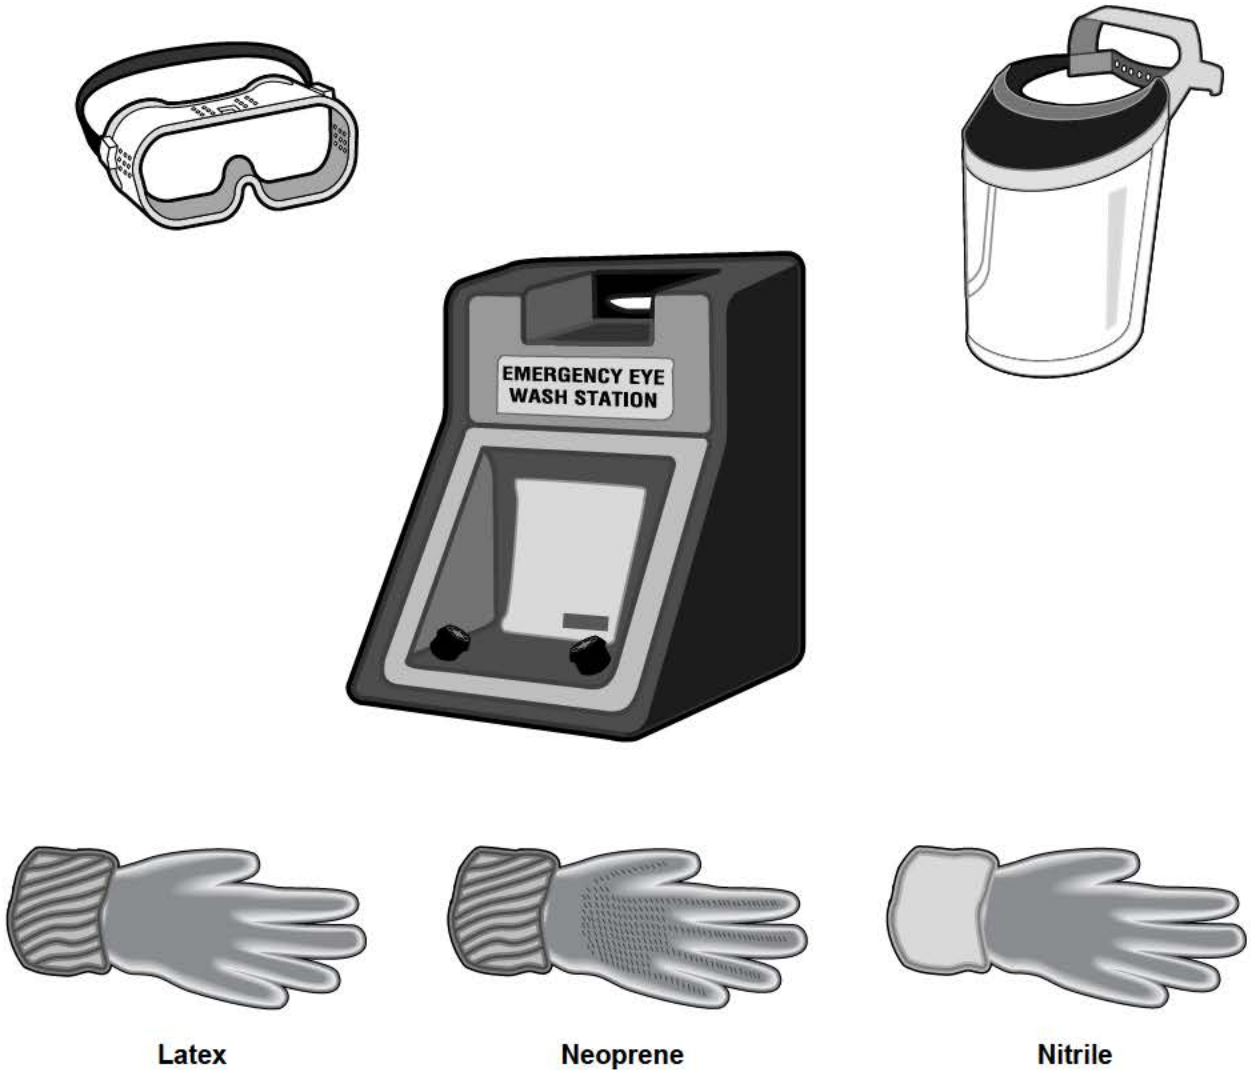

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2258 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

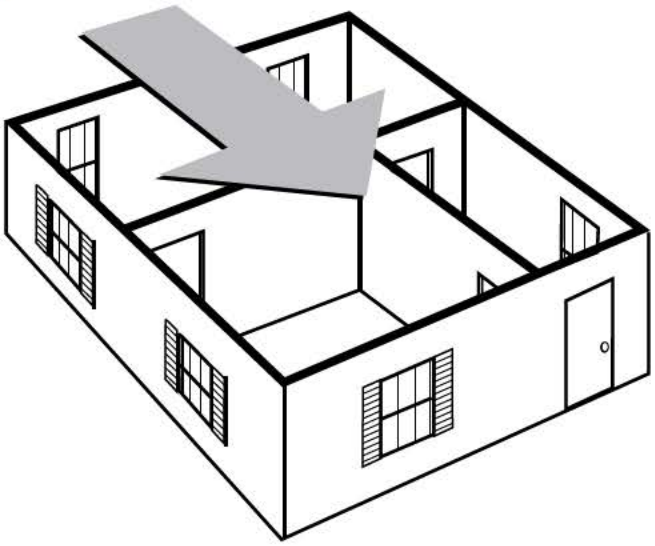

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

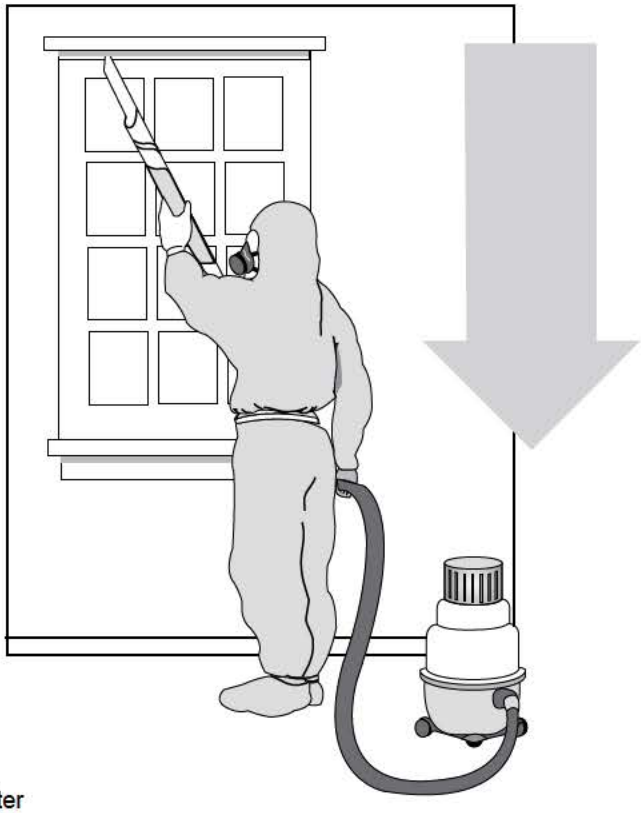

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2259 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

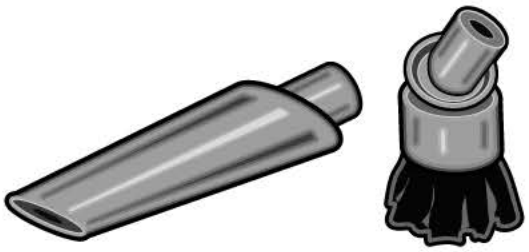

Rubber Cone **Dust Brush**

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2260 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

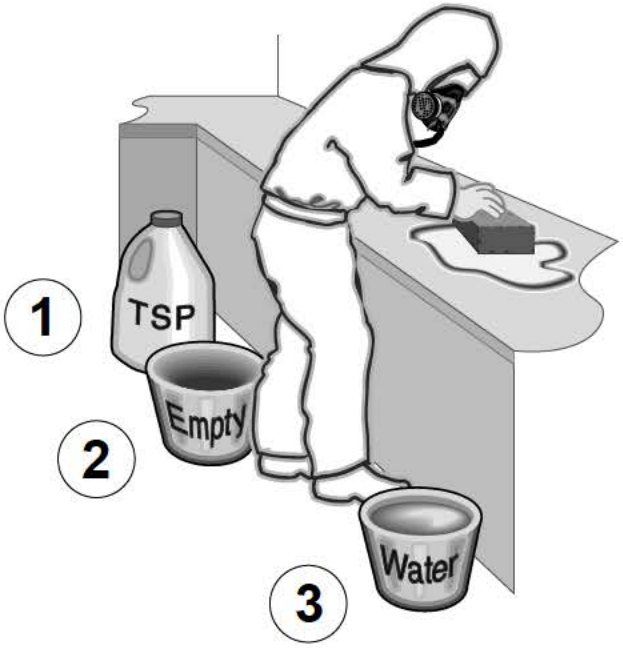

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2261 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

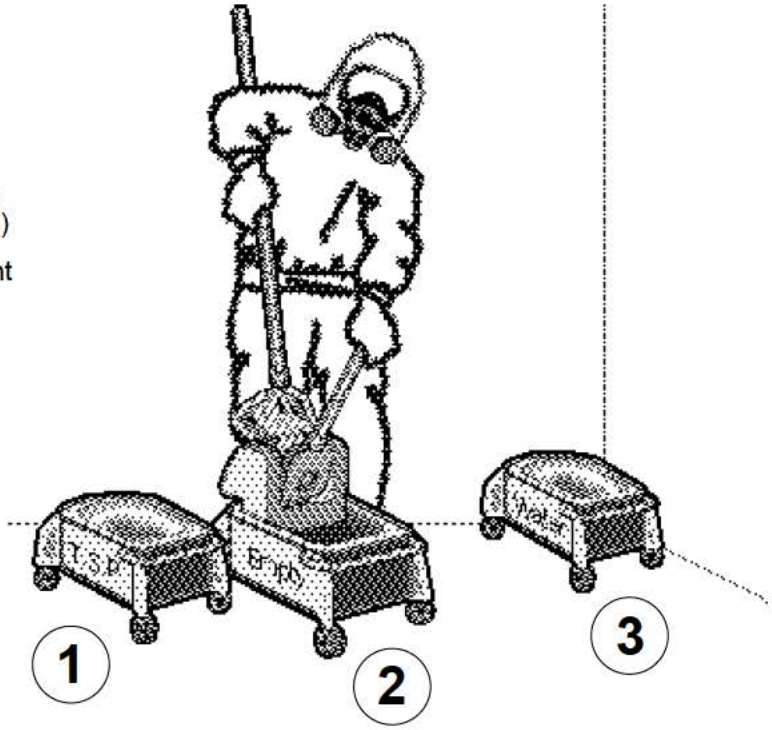

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

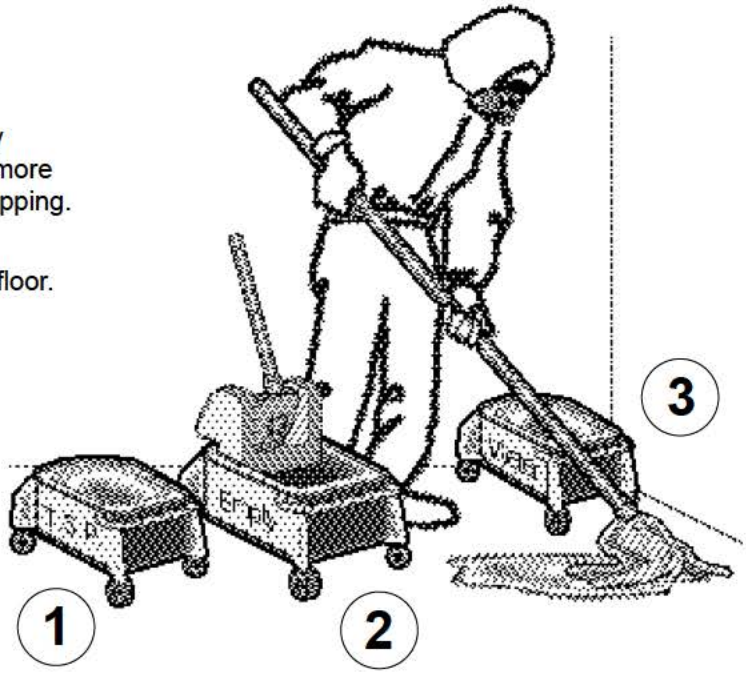

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2262 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

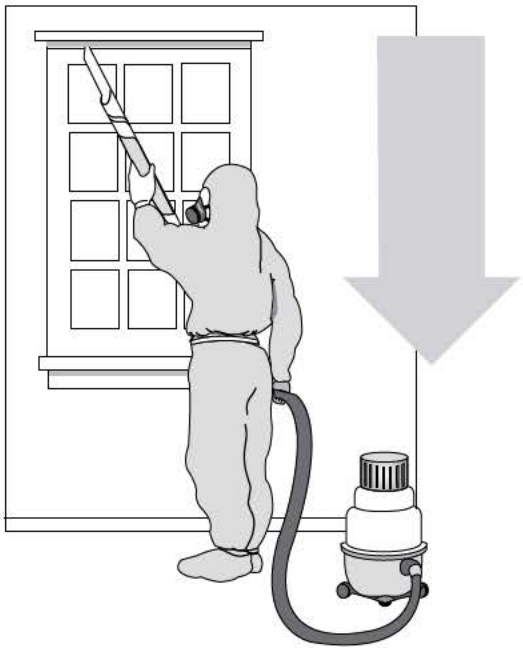

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2263 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2264 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2265 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2266 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2267 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2268 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2269 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2270 of 5269

BEST AVAILABLE COPY

APPENDIX G

MOLD GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2272 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2273 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2274 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2275 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet** - e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2276 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2277 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2278 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2279 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2280 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2281 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2282 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2283 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2284 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2285 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2286 of 5269

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2287 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2288 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2289 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2290 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2291 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2292 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2293 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2294 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2295 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2297 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2298 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2299 of 5269

MOLD INVESTIGATION DECISION LOGIC

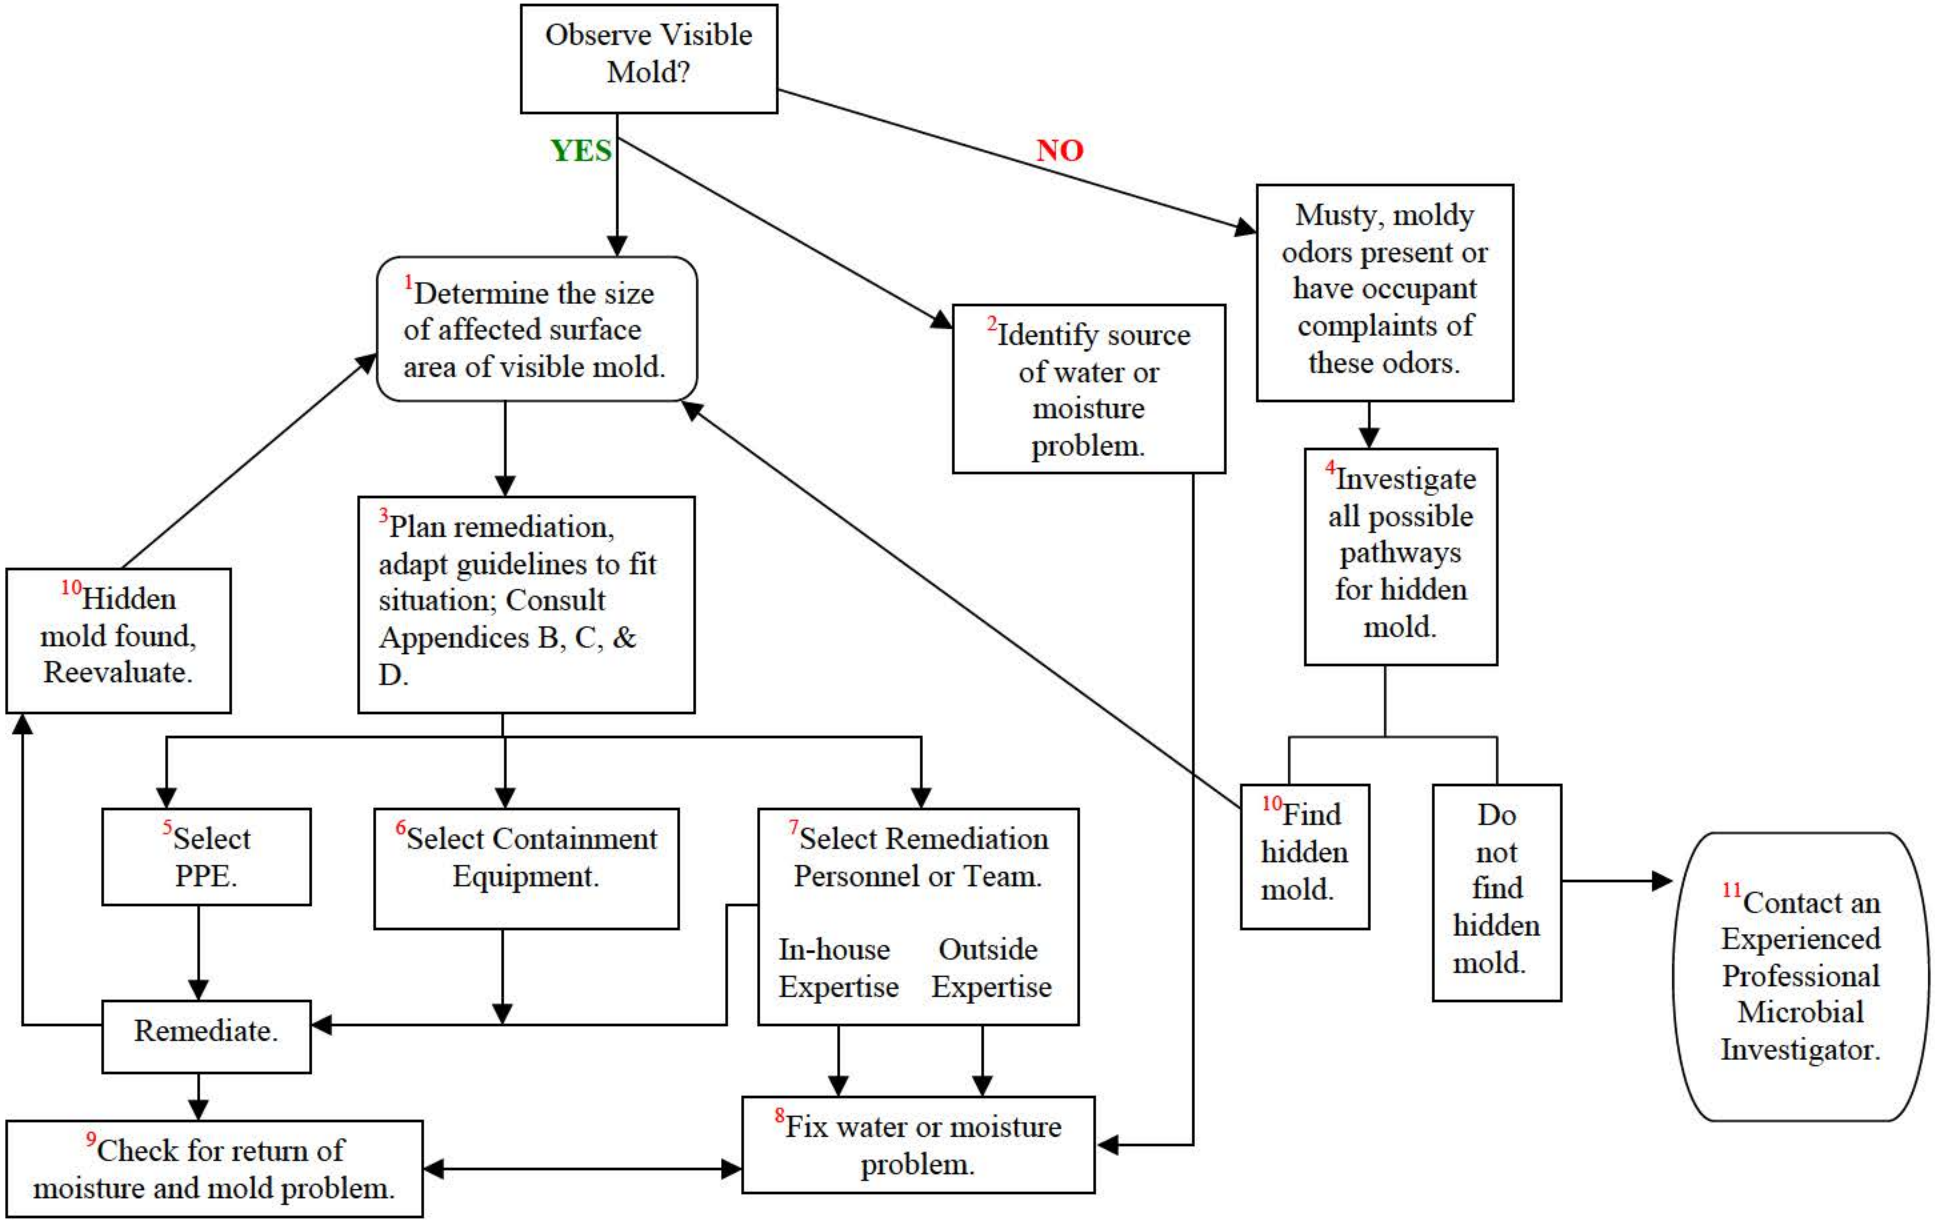

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2301 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2302 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2303 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2304 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2305 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2306 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips

- Always maintain the containment area under negative pressure.
- Exhaust fans to outdoors and ensure that adequate makeup air is provided.
- If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2307 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2308 of 5269

BEST AVAILABLE COPY

TG 278

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2309 of 5269

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Survey

National Guard Facility
Easton Armory
7111 Ocean Gateway
Easton, MD 21604

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Easton Armory** **7111 Ocean Gateway** **Easton, MD 21604**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**September 16, 2010**
Report Date:	**November 1, 2010**
ALSI Project #:	**1009599**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

3544 North Progress Avenue ✦ Suite 100 ✦ Harrisburg, PA 17110
TEL: 717-540-3424 ✦ FAX: 717-540-3428

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Suspect Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Limitations 13

Appendix A. Laboratory Analysis Report 14

Appendix B. Photographs 15

Appendix C. Floor Plan 16

Appendix D. References 17

BEST AVAILABLE COPY

Section 1.0
Executive Summary

BEST AVAILABLE COPY

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on September 16, 2010, at the Easton Armory located at 7111 Ocean Gateway, Easton, MD 21604. The survey was performed by Ms Non-Responsive and Mr. Non-Responsive

1. Lead surface and air samples were collected. All sample results were less than recommended guidelines or regulatory standards.

2. Lighting levels met the minimum recommended guidelines.

3. Relative humidity exceeded the recommended ceiling of 60% and temperature was higher than the recommended criteria of 79 degrees F in many locations. There is no central air conditioning system at this facility. Outdoor conditions were hot and humid and many doors and windows were open. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation.

4. Water damaged ceilings and active roof leaks are present. All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2313 of 5269

BEST AVAILABLE COPY

Section 2.0
Operation Description & Observations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Easton Armory is mainly an administrative facility with offices, training and storage areas. There were approximately four full-time employees stationed at this facility at the time of this survey.

The building was built in 1975. The exterior is brick. The interior walls are concrete block, brick or drywall. The floors are concrete with some vinyl floor tile. Older carpet is present in some offices.

There is an oil-fired boiler providing forced air heat. No central air-conditioning system is present. There are two air handling units (AHU). Outdoor air ventilation occurs via open doors and windows which were open on the day of this survey. A limited inspection of the AHU was performed. The units could not be opened for inspection. Filters were removed and inspected and found to be dirty. AHU are reportedly serviced and the filters are changed two times per year. Portions of the AHU that could be observed were clean and appeared in good condition. The AHU were off for the season.

There is an old firing range in the building. It was closed in the 1970's and has been fully abated. It is now a gym/exercise area. There is no child-care facility in the building.

Overall housekeeping was good. Areas were clean and well kept.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2315 of 5269

BEST AVAILABLE COPY

Section 3.0
Noise Survey

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels. Therefore, noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2317 of 5269

BEST AVAILABLE COPY

Section 4.0
Lead Testing

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. The facility contains a gym/exercise area which was once an indoor firing range.

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Drill Hall	<4.2	
2	Orderly Room #2	<4.3	
3	Blank	<3 (ug)	
4	Gym Converted Firing Range – Floor		<110
5	Gym Converted Firing Range – Top of Locker		<110
6	Gym Converted Firing Range – Tabletop		<110
7	Floor Outside Gym Converted Firing Range		<110
8	Drill Hall – Floor (Center)		<110
9	Drill Hall – Top of Bulletin Board		<110
10	Drill Hall – Floor Outside Maintenance Office		<110
11	Maintenance Office – Top of Refrigerator		<110
12	Orderly Room #2 - Return Grill		<110
13	Commander's Office – Top of Filing Cabinet		<110
14	Kitchen – Floor		<110
15	Men's Locker Room – Top of Locker		<110
16	Blank		<12 (ug)
Criteria		**50**	**200**

Lead surface and air samples were collected. All sample results were less than recommended guidelines or regulatory standards

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2319 of 5269

Environmental Chemicals." the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3. In fact, no detectable level of lead was identified in the air samples collected.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2320 of 5269

BEST AVAILABLE COPY

Section 5.0
Lighting

BEST AVAILABLE COPY

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400I. Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Orderly Room #2	59.6	30-50	Yes
Classroom	40.5	30-50	Yes
Recruiting Office	77.4	30-50	No
Orderly Room #1	63.0	30-50	Yes
Maintenance Office	64.3	30-50	Yes
Drill Hall	52.3	30-50	Yes
Kitchen	131.7	50	Yes
Men's Locker Room	67.5	7	Yes
Women's Locker Room	107.3	7	Yes
Gym (Converted Firing Range)	32.1	30	Yes

Lighting levels met the minimum recommended guidelines.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2322 of 5269

BEST AVAILABLE COPY

Section 6.0
Indoor Air Quality

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The IAQ Meter was last calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 78.1 to 80.4 degrees F with relative humidity readings ranging from 50.8% to 66.5%. During the survey, carbon dioxide (CO_2) levels ranged from 356 ppm to 513 ppm within the facility compared to an outdoor CO_2 level of 372 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,072 ppm (372 ppm + 700 ppm). Carbon monoxide (CO) ranged from 0.0 – 0.1 ppm.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	87.4	56.1	377	0.4
Orderly Room #2	**80.4**	50.8	474	1.1
Classroom	**79.2**	56.2	513	0.8
Recruiting Office	78.1	57.4	436	0.6
Orderly Room #1	78.3	**60.5**	433	0.2
Maintenance Office	78.4	**60.8**	403	0.4
Drill Hall	**80.1**	**65.3**	378	0.2
Kitchen	**80.2**	**63.7**	386	0.1
Men's Locker Room	**79.2**	59.3	400	0.4
Women's Locker Room	**79.3**	**63.1**	369	0.2
Gym Converted Firing Range	**80.4**	**66.5**	356	0.0
Outdoors	87.3	51.3	366	0.0
Criteria	**73.0-79.0**	**30-60**	**<1,072**	**<9.0**

Key: **Bolded** results exceed listed criteria

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2324 of 5269

Relative humidity exceeded the recommended ceiling of 60% and temperature was higher than the recommended criteria of 79 degrees F in many locations. There is no central air conditioning system at this facility. Outdoor conditions were hot and humid and many doors and windows were open. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation.

Carbon dioxide levels did not exceed the recommended ceiling of 1,072 ppm. This suggests that outdoor air ventilation is adequate in this area. Doors and windows were open on the day of this survey.

Carbon monoxide levels were less than the recommended ceiling of 9 PPM.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

1. Water damaged ceilings and roof leaks were present in a few areas. There is a current roof leak in the Supply Room ceiling. Efflorescence, which is an indicator of water infiltration, was observed on the block wall in the Drill Hall. All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

2. Filters in the AHU were dirty and should be replaced more frequently.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2325 of 5269

BEST AVAILABLE COPY

Section 7.0
Suspect Asbestos Containing Building Materials

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 7.0 Suspect Asbestos Containing Building Materials

No suspect asbestos containing materials (ACM) were observed. No samples were collected. Inaccessible areas were not inspected.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2327 of 5269

BEST AVAILABLE COPY

Section 8.0
Maintenance Bay

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is no garage area at this facility.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2329 of 5269

BEST AVAILABLE COPY

Section 9.0
Limitations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2331 of 5269

BEST AVAILABLE COPY

Appendix A
Laboratory Analysis Report

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY

Laboratory
NY ELAP
10920

Client:	National Guard Bureau	Job Name:	Easton	Chain Of Custody:	508811
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	Easton, MD	Date Submitted:	9/20/2010
	Havre de Grace, Maryland 21078	Job Number:	Not Provided	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	9/27/2010
Attention:	[redacted]			Report Date:	9/27/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1080600	1009599-1	Flame	Air	717	N/A	4.2	ug/m³	<3	<4.2	ug/m³	
1080601	1009599-2	Flame	Air	698	N/A	4.3	ug/m³	<3	<4.3	ug/m³	
1080602	1009599-3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1080603	1009599-4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080604	1009599-5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080605	1009599-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080606	1009599-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080607	1009599-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080608	1009599-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080609	1009599-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080610	1009599-11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080611	1009599-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080612	1009599-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080613	1009599-14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080614	1009599-15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1080615	1009599-16	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP® accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2333 of 5269

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY

NY ELAP
10920

Client:	National Guard Bureau	Job Name:	Easton	Chain Of Custody:	508811
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation.	Job Location:	Easton, MD	Date Submitted:	9/20/2010
	Havre de Grace, Maryland 21078	Job Number:	Not Provided	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	9/27/2010
Attention:	[redacted]			Report Date:	9/27/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: Lom Butrak

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100478), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2334 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2335 of 5269

OWI (410) 2-07-2024 | 159.702 | 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) **508811**

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Easton
2. Job Location: Easton, MD
3. Job #: [redacted] W912K6-09-A-0003
4. Contact Pers[redacted] @ phone # (410) 942-0273
5. Submitted by [redacted] Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☒ Include [redacted] with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☒ 5 Day +	☒ Email [redacted] analyticallab.com
Comments: ____	☐ 2 Day Date Due: 9/27/10	☐ Fax: [redacted]
	☐ Results Required By Noon (Every Attempt Will Be Made to Accommodate)	☐ Verbal [redacted]

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM__(Qual) PCM__(Quan) PLMTEM__(Qual) PLMTEM__(Quan)

TEM Bulk
☐ EPA 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pre/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pre/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☐ Pb Paint Ch[redacted]
☒ Pb Dust Wipe (wipe type ____) 13 (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Trap/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WIPE	SOIL	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY) Date/Time: Contact: By:
1009599-1	Drill Hall	9/10	116.9					X		X							
1009599-2	Orderly Rm #9		107.7					X		X							
1009599-3	Plank		0					X		X							
1009599-4	Gym Bldg – Fl Converted Fire			100cm²				X				X					
1009599-5	Gym Bldg – Joist Cavity Converted Fire							X				X					Date/Time: Contact: By:
1009599-6	Gym Bldg – Tanks Converted Fire							X				X					
1009599-7	Fl Outside Gym Converted Fire Bldg							X				X					
1009599-8	Drill Hall Floor Center							X				X					
1009599-9	Drill Hall Top of Bulletin Board							X				X					Date/Time: Contact: By:
1009599-10	Drill Hall Outside Office Top of Cabinet							X				X					
1009599-11	Maintenance Office							X				X					
1009599-12	Orderly Rm #3 Return Box							X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 9/20/10 @ ____ Via: UPS By (Print): Nicole Maxwell Sign:
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

QW pl 00 247-2024 156202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) 508811 1-2/V

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0264

Submittal Information:
1. Job Name: Easton
2. Job Location: Easton MO
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person: [redacted] @ phone #: (410) 942-0273
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☒ 5 Day +	☒ Email: [redacted] @ ____
Comments: ____	☐ 2 Day Date Due: ____	☐ Fax: [redacted] @us.army.mil
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbal: [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Gov. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM ___ (Qual) PLM ___ (Quant) PLM/TEM ___ (Qual) PLM/TEM ___ (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
- ☐ Pb Air ____ (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Trap/Air Samples: ____
Collection Media: ____
- ☐ Spore Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	UNKNOWN SOLID/LIQUID	WIPE/SWAB	TAPE	SWAB
1009599-13	Conference Room Office	9/16		100cm²				X				X				
1009599-14	Kitchen Floor	↓		↓				X				X				
1009599-15	Maintenance Room	↓		↓				X				X				
1009599-16	Blank	↓		0cm²				X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2336 of 5269
BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B
Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Easton MD
Exterior

Easton MD
Drill Hall

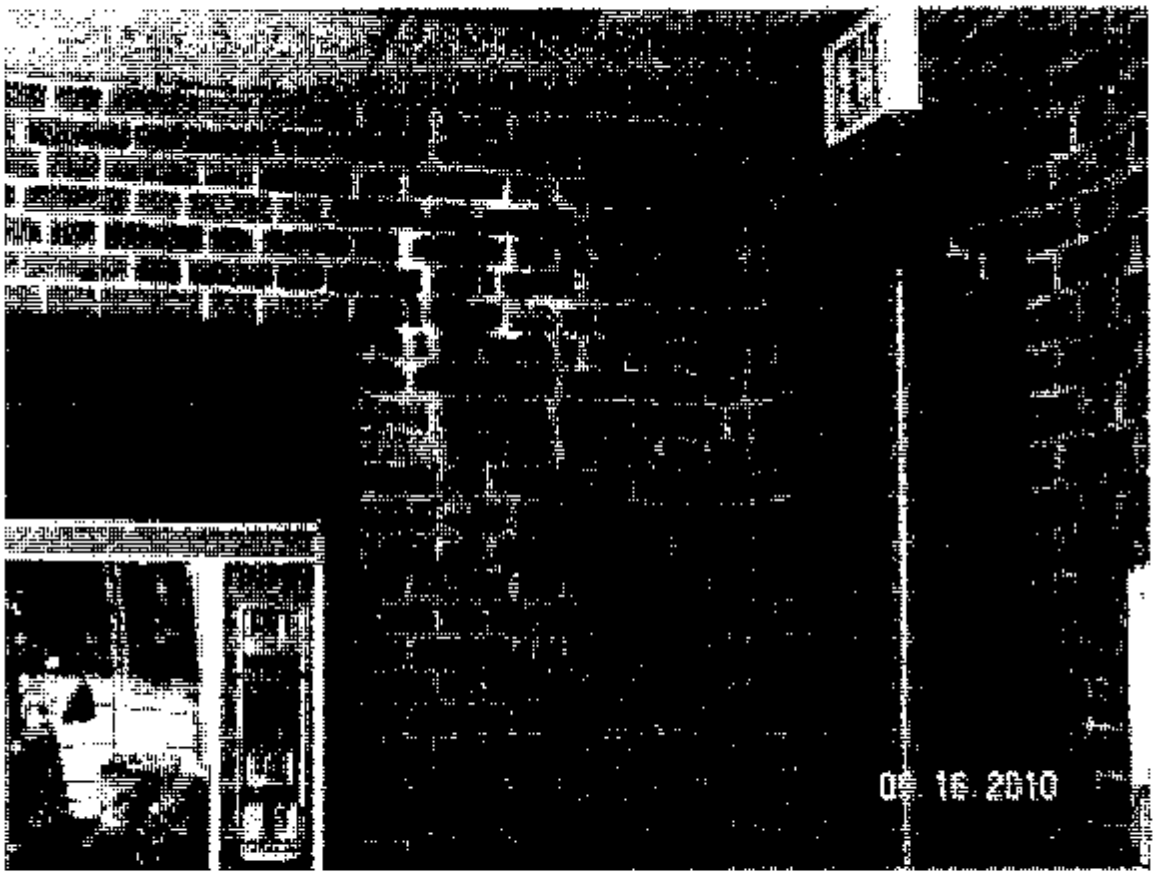

Easton MD
Drill Hall Water Damage on Brick Wall

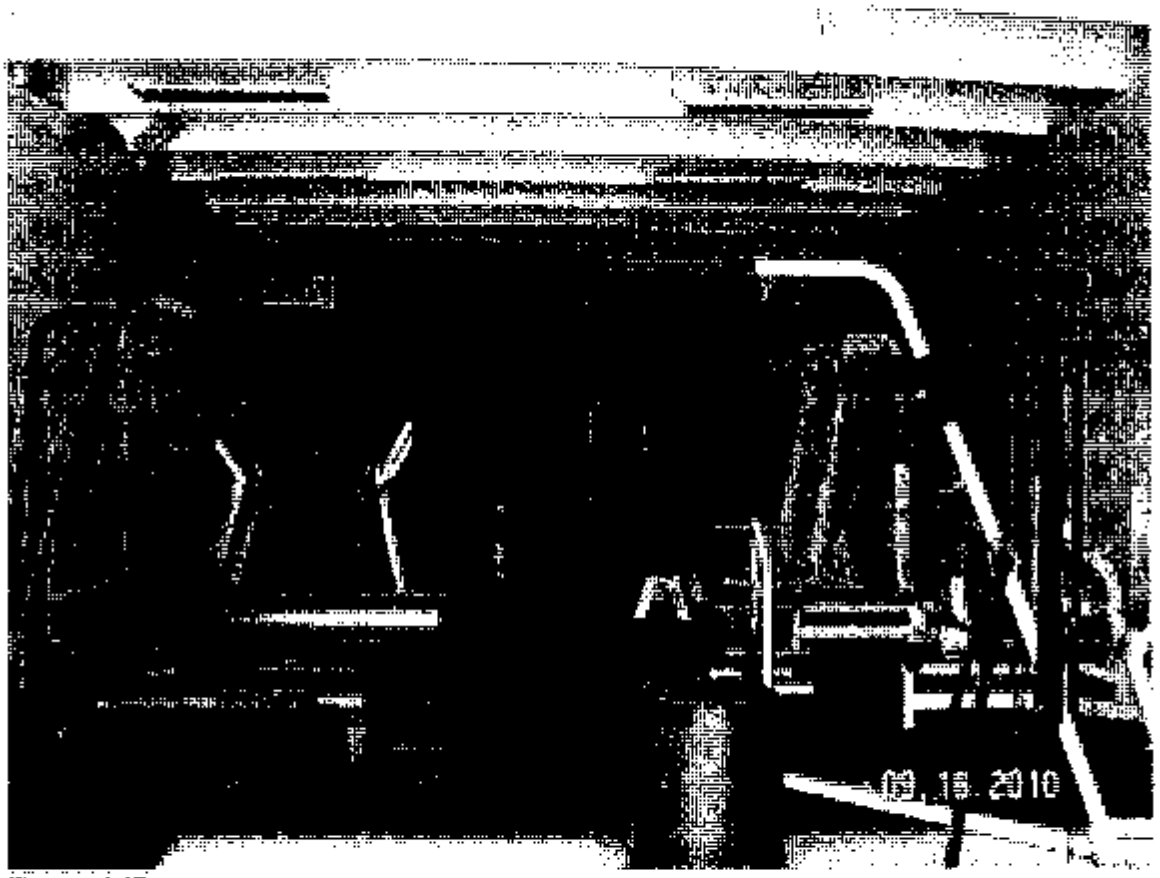

Easton MD
Converted Firing Range (Gym)

Easton MD
Boiler Room

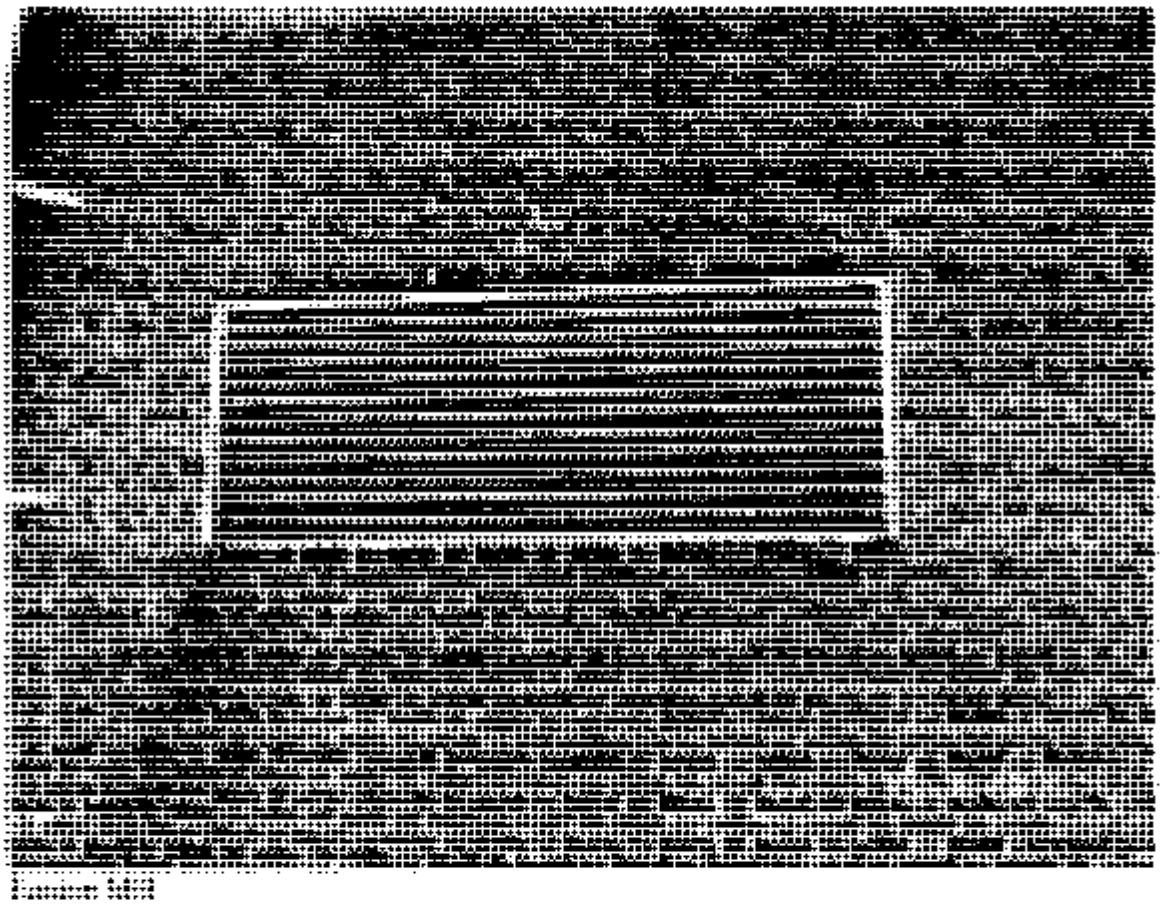

Exterior Fresh Air Intake

BEST AVAILABLE COPY

Appendix C
Floor Plan

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

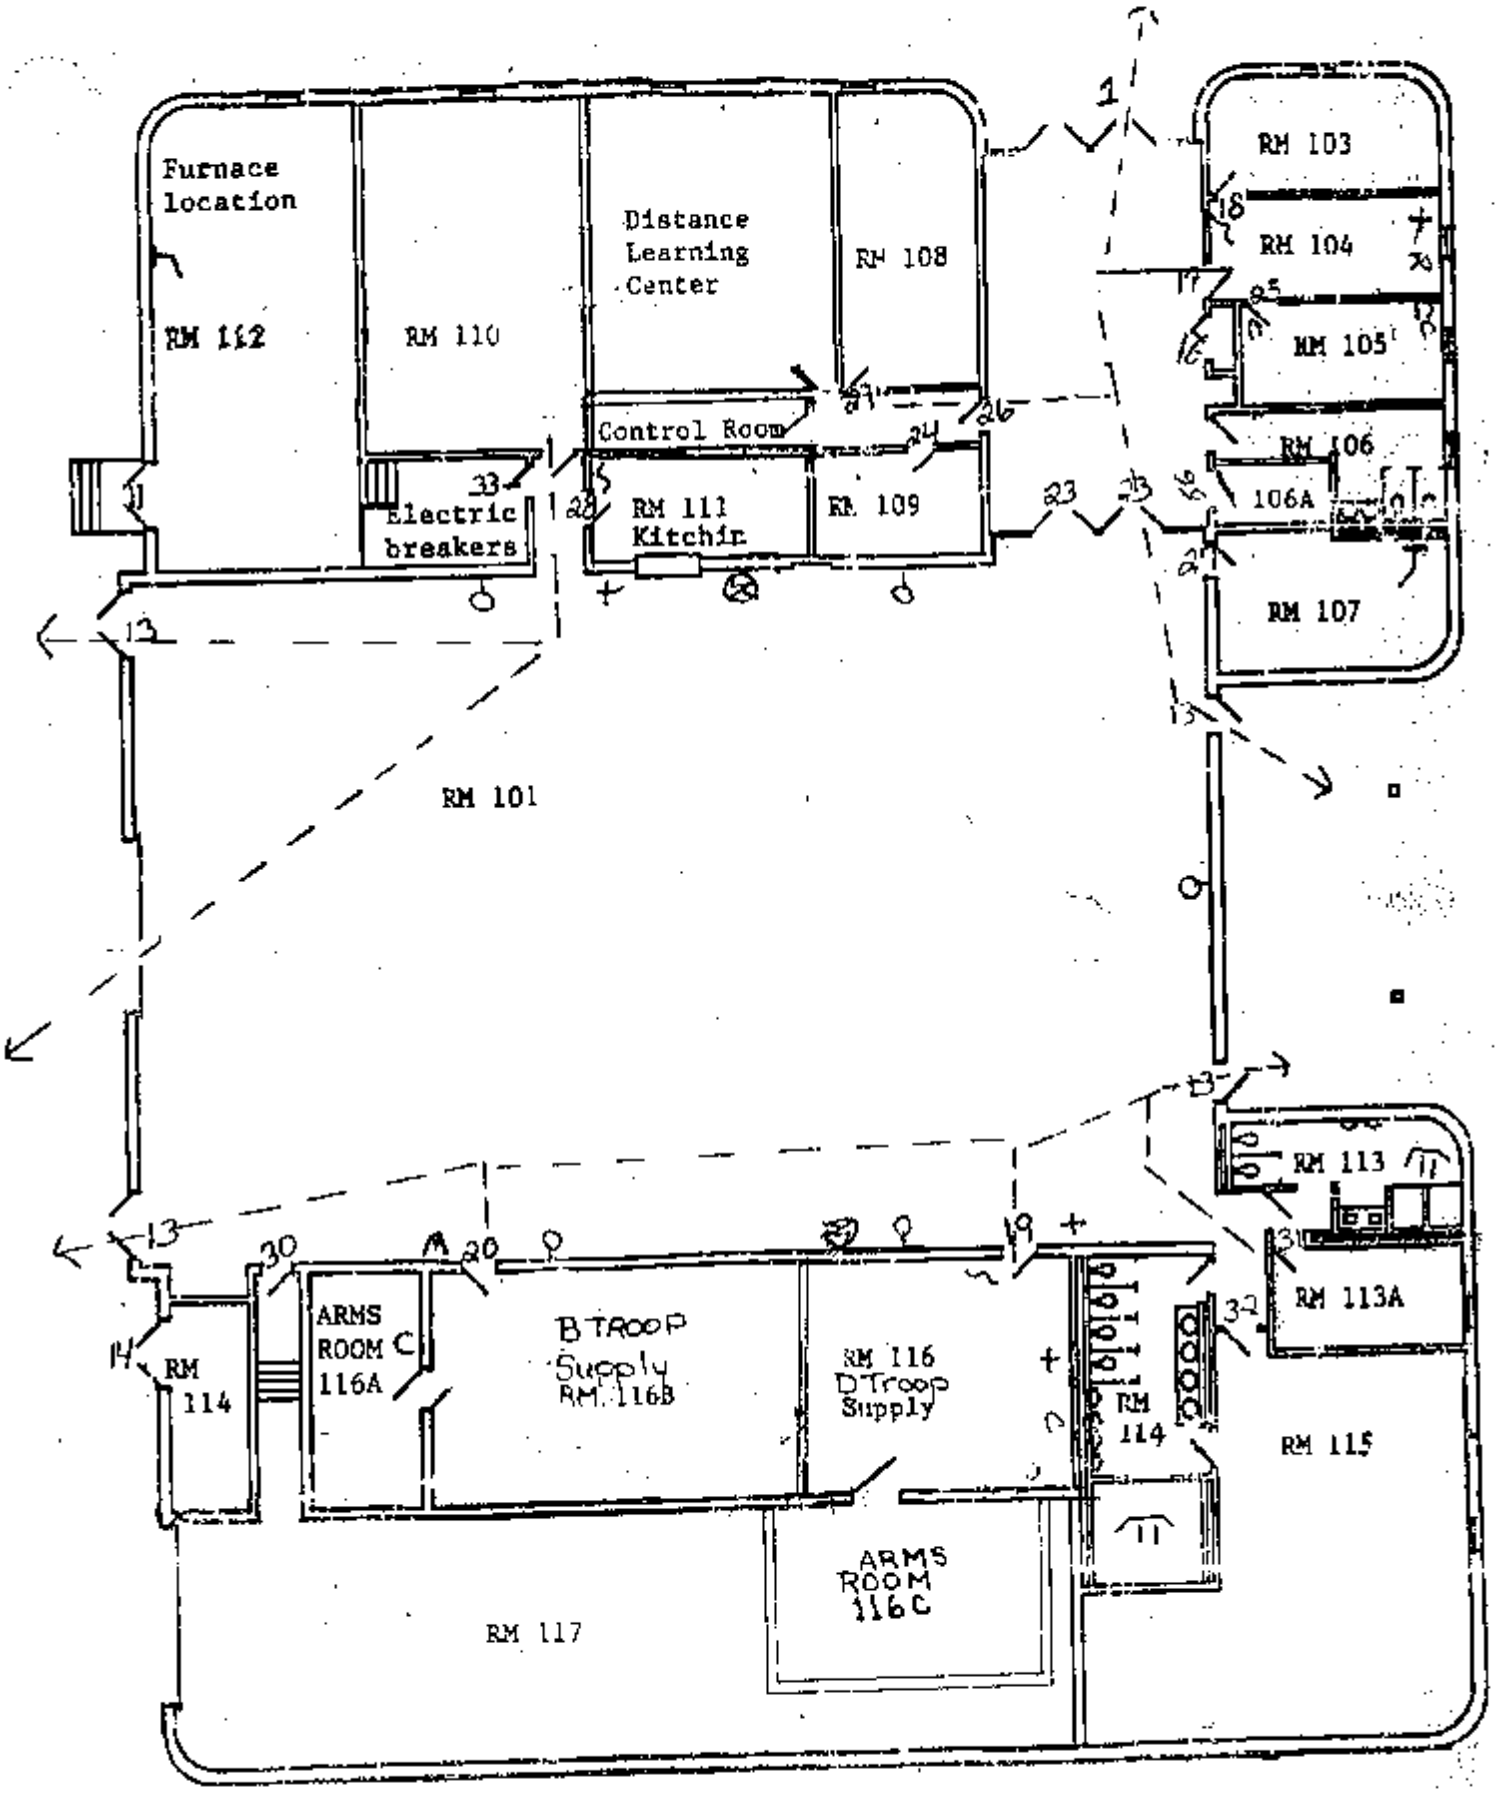

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

EASTON ARMORY

BEST AVAILABLE COPY

Appendix D
References

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2347 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Easton Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Easton Readiness Center** **7111 Ocean Gateway** **Easton, MD 21604**
Prepared By:	**Compliance Management International** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**December 4, 2012**
Report Date:	**January 22, 2013**

[redacted]

[redacted]
Senior Industrial Hygienist

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on December 4, 2012, at the Easton Readiness Center located at 7111 Ocean Gateway, Easton, MD 21604. The survey was performed by Mr. Non-Responsive [redacted], CIH.

1. Lead surface and air samples were collected. Surface levels of lead exceeded 200 micrograms per square foot (ug/ft^2) in one location. Cleaning procedures should be improved and remedial action should be taken to maintain lead levels below 200 ug/ft^2. See Section 3.0 for sampling results.

2. Lighting levels did not meet the American National Standard Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in the Control Room. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were within recommended guidelines during this survey.

Section 2.0 Operation Description & Observations

The Easton Readiness Center is mainly an administrative facility with a drill hall, offices, classrooms, a garage and storage areas. There were approximately 6 full-time employees stationed at this facility at the time of this survey.

The building was initially constructed in 1975. The building is one story with a brick exterior. The interior walls are concrete block or drywall. The floors are concrete with vinyl floor tile or carpet.

There is a central HVAC system present in the facility. HVAC units service the building via a oil fired boiler. The offices have a central air conditioning system..

The firing range has been converted into an exercise room and storage area. It was reported that the remediation of the lead hazards in the firing range had been completed.

There is no child-care facility in the building.

Overall housekeeping practices were good.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Section 3.0 Lead Testing

Due to the age of the building there is the potential for lead based paint to be present. Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Room 103- SFC Larry Smith Office	<6.6	*
2	Drill Hall	<6.7	*
3	Drill Hall – Center of Floor	*	<110
4	Drill Hall – Display Cabinet	*	110
5	Drill Hall – Top of Vending Machine	*	<110
6	Drill Hall – Display Cabinet Permanent	*	<110
7	**Drill Hall – Return Grill**	*	**640**
8	Converted Firing Range – Floor at Bullet Trap	*	<110
9	Converted Indoor Firing Range – Supply Grill	*	<110
10	Converted Indoor Firing Range – Top of Light	*	<110
11	Converted Indoor Firing Range – Top of Locker	*	<110
12	Converted Firing Range – Floor	*	<110
13	Drill Hall Floor Outside of Converted Firing Range	*	<110
14	Room 115 Locker Room – Top of Locker	*	<110
15	Room 103 Office – Desk	*	<110
16	Room 111 Kitchen – Top of Microwave	*	<110
17	Room 110 – Top of Refrigerator	*	<110
18	Room 108 Office – Desk	*	<110
19	Distance Learning Center – Table	*	<110
20	Blank – Wipe	*	<12 ug
21	Blank – Air	<3 ug	*
-	Criteria	50	200

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Source: NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were at or above the recommended guideline of 200 ug/ft^2 in the Drill Hall – Return Grill

  Cleaning procedures should be improved to maintain lead levels on surfaces below the recommended guideline of 200 ug/ft^2.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

- There was no chipping or peeling paint observed in the facility.

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K98364). The light meter was last calibrated in April 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Room 103 – Office	40.6	30-50	Yes
Room 104 – Office	38.0	30-50	Yes
Room 108 – Office	49.1	30-50	Yes
Distance Learning Center	39.8	30-50	Yes
Control Room	**27.8**	**30**	**No**
Room 109 – Recruitment Office	87.7	30-50	Yes
Room 107 – Maintenance Office	43.5	30-50	Yes
Room 110 – Lounge	40.7	10	Yes
Room 112 – Boiler Room	48.5	30	Yes
Room 111 – Kitchen	106.2	50	Yes
Room 117 – Exercise Room	31.0	30	Yes
Room 115 – Locker Room	71.4	7	Yes
Room 101 – Drill Hall	33.2	10	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting level did not meet the minimum recommended guideline in the Control Room. However, the lighting level was within the 10% of the recommend lighting level allowed by ANSI/IESNA RP-1-04 foot note in Table 1. Lighting should be improved in this area.

Section 5.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, carbon monoxide and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565 (Serial #02041015). The IAQ Meter was last calibrated in August 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (◦F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	71.8	52.2	399	3.7
Room 103 – Office	71.6	46.9	472	2.8
Room 104 – Office	71.2	46.6	468	2.8
Room 108 – Office	72.7	45.6	624	2.8
Distance Learning Center	72.9	47.1	462	2.8
Control Room	73.9	46.2	487	2.5
Room 109 – Recruitment Office	74.8	44.0	517	2.7
Room 107 – Maintenance Office	73.8	42.8	521	2.6
Room 110 – Lounge	73.9	47.0	381	2.4
Room 112 – Boiler Room	76.5	44.4	511	2.5
Room 111 – Kitchen	76.8	42.0	488	2.5
Room 117 – Exercise Room	64.8	46.4	398	2.7
Room 115 – Locker Room	68.4	51.0	451	2.4
Room 101 – Drill Hall	73.8	47.6	490	2.4
Outdoors	73.0	51.0	396	2.6
Criteria	**68.0-79.0**	**30-60**	**<1,098**	**<9.0**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **F =** degrees Fahrenheit

Source: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010 & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature and relative humidity measurements were within the recommended guidelines.
- Carbon dioxide levels measured did not exceed the recommended ceiling of 1,098 parts per million (ppm). This indicates that outdoor air ventilation is adequate in all areas.
- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm.
- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. There were no items of concern noted during the survey.

Section 6.0 Suspect Asbestos Containing Building Materials

Based on the age of the building (e.g., constructed in 1975) asbestos-containing materials (ACM) could be present in the facility. No suspect ACM was observed at the time of this survey. Inaccessible areas such as behind walls or crawlspaces were not inspected.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	02041015	8/2012	NA
Cal Light 400 Light Meter	K98364	4/2012	NA
TSI 4199 Calibrator	41460827002	8/2012	NA
SKC Air Sampling Pump	647631	12/3/2012	2.53 LPM
SKC Air Sampling Pump	647610	12/3/2012	2.50 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Not Provided	**Chain Of Custody:**	514700		
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	12/10/2012		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	12/16/2012	**Report Date:**	12/16/2012

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13021232	3	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021233	4	Flame	Wipe	****	0.108	110	ug/ft²	12	110	ug/ft²	
13021234	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021235	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021236	7	Flame	Wipe	****	0.108	110	ug/ft²	69	640	ug/ft²	
13021237	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021238	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021239	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021240	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021241	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021242	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021243	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021244	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021245	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021246	17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021247	18	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021248	19	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13021249	20	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Not Provided	**Chain Of Custody:**	514700		
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	12/10/2012		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]		
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	12/16/2012	**Report Date:**	12/16/2012

Attention: Non-Responsive [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Kim Shipe

Analyst: Kimberly D. Shipe

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

1 of 2

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 514700

(page 1 of 2)

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name:
2. Job Location:
3. Job #: PO #: W912K6-09-A-0003
4. Contact Pers[redacted] @ phone # (410) 942-0273
5. Submitted By[redacted]ature[redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day +	☒ Email [redacted]@us.army.mil
Comments:	☐ 2 Day Date Due: 12/17/12	☐ Fax: [redacted]@us.army.mil
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verb[redacted]

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type Glass) 18 (QTY)
- ☐ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1	Rm 103	12/4/12	455					X		X	Not Not Submitted						Date/Time: Contact: By:
2	Drill Hall	12/4/12	450					X		X	Not Submitted						
3	Drill Hall Floor	12/4/12		100 cm²				X									Lead Air Samples NOT submitted.
4	D.H. Cabinet	12/4/12						X									
5	D.H. Vending	12/4/12						X									Date/Time: Contact: By:
6	D.H. Cabinet	12/4/12						X									
7	D.H. Return	12/4/12						X									
8	Rm 117 Floor	12/4/12						X									
9	Rm 117 Supply	12/4/12						X									Date/Time: Contact: By:
10	Rm 117 Light	12/4/12						X									
11	Rm 117 Locker	12/4/12						X									
12	Rm 117 Floor	12/4/12						X									

LABORATORY STAFF ONLY:
1. Date/Time RCVD: 12 / 10 / 12 @ 1000 Via: Fedex By (Print): NRM Sign:
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign:
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials:
4. Comments: 787939 3323 1840

(CUSTODY)

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

2 of 2

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 514700 (page 2 of 2)

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name:
2. Job Location:
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person [redacted] Non-Responsive Phone #: (410) 942-0273
5. Submitted By: [redacted] Signature: [redacted] Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: [redacted] ☐ Fax: Non-Responsive @us.army.mil ☐ Verbal [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☐ Pb Paint Chip ____ (QTY)
☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
☐ Pb Air ____ (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
13	Rm 117 Floor Out	12/4/12		100 cm²				X									Date/Time: Contact: By:
14	Rm 115 Locker	12/4/12						X									
15	Rm 103 Desk	12/4/12						X									
16	Rm 111 Kitchen	12/4/12						X									
17	Rm 110 Fridge	12/4/12						X									Date/Time: Contact: By:
18	Rm 108 Desk	12/4/12						X									
19	DLC Table	12/4/12		✓				X									
20	Blank	12/4/12		0				X				Not Submitted - NRM					
21	Blank	12/4/12	0					X		X		Not Submitted					Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Easton RC	**Chain Of Custody:**	514784		
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Easton, MD	**Date Submitted:**	12/13/2012		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive		
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	12/17/2012	**Report Date:**	12/17/2012

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13022545	1	Flame	Air	455	N/A	6.6	ug/m³	<3	<6.6	ug/m³	
13022546	2	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13022547	21	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B

See QC Summary for analytical results of quality control samples associated with these samples.

N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)

%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

Analyst: Suphin Chinnapad

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD. 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 514784

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: EASTON RC
2. Job Location: EASTON, MD
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person: [redacted] Non-Responsive
5. Submitted by: [redacted] Signature: [redacted] Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☑ 5 Day +	☐ Email: [redacted] Non-Responsive
Comments:	☐ 2 Day Date Due: 12/6/12	☐ Fax: [redacted] @us.army.mil
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbal: [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☑ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
- ☑ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb____(QTY) ☐ Cu____(QTY) ☐ As____(QTY)
- ☐ Waste Water ☐ Pb____(QTY) ☐ Cu____(QTY) ☐ As____(QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1	Rm 103	12/4/12	455					X								
2	DRILL HALL	12/4/12	450					X								
21	BLANK	12/4/12	0					X								

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 12/13/12 @ 1105 Via: FedEx By (Print): David Hutton Sign: [signature]
2. Date/Time Analyzed: ____/____/____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____/____/____ Time: ____ Initials: ____
4. Comments: 331 3323 13296

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Appendix B. Photographs

Exterior of Building

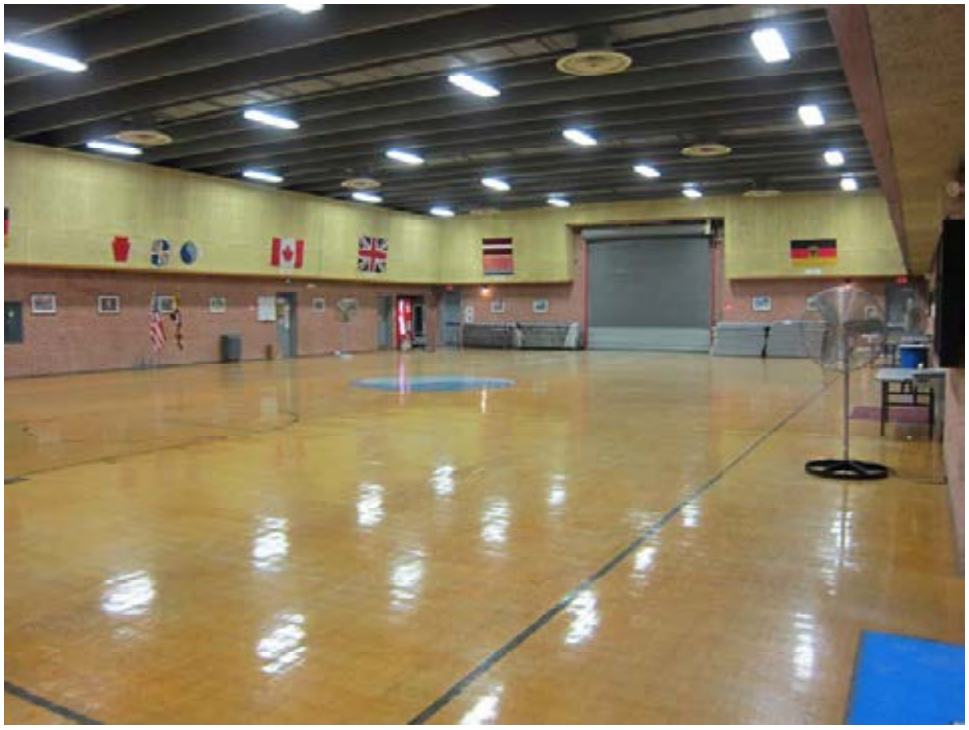

Drill Hall

Converted Firing Range

Appendix C. Floor Plan

BEST AVAILABLE COPY

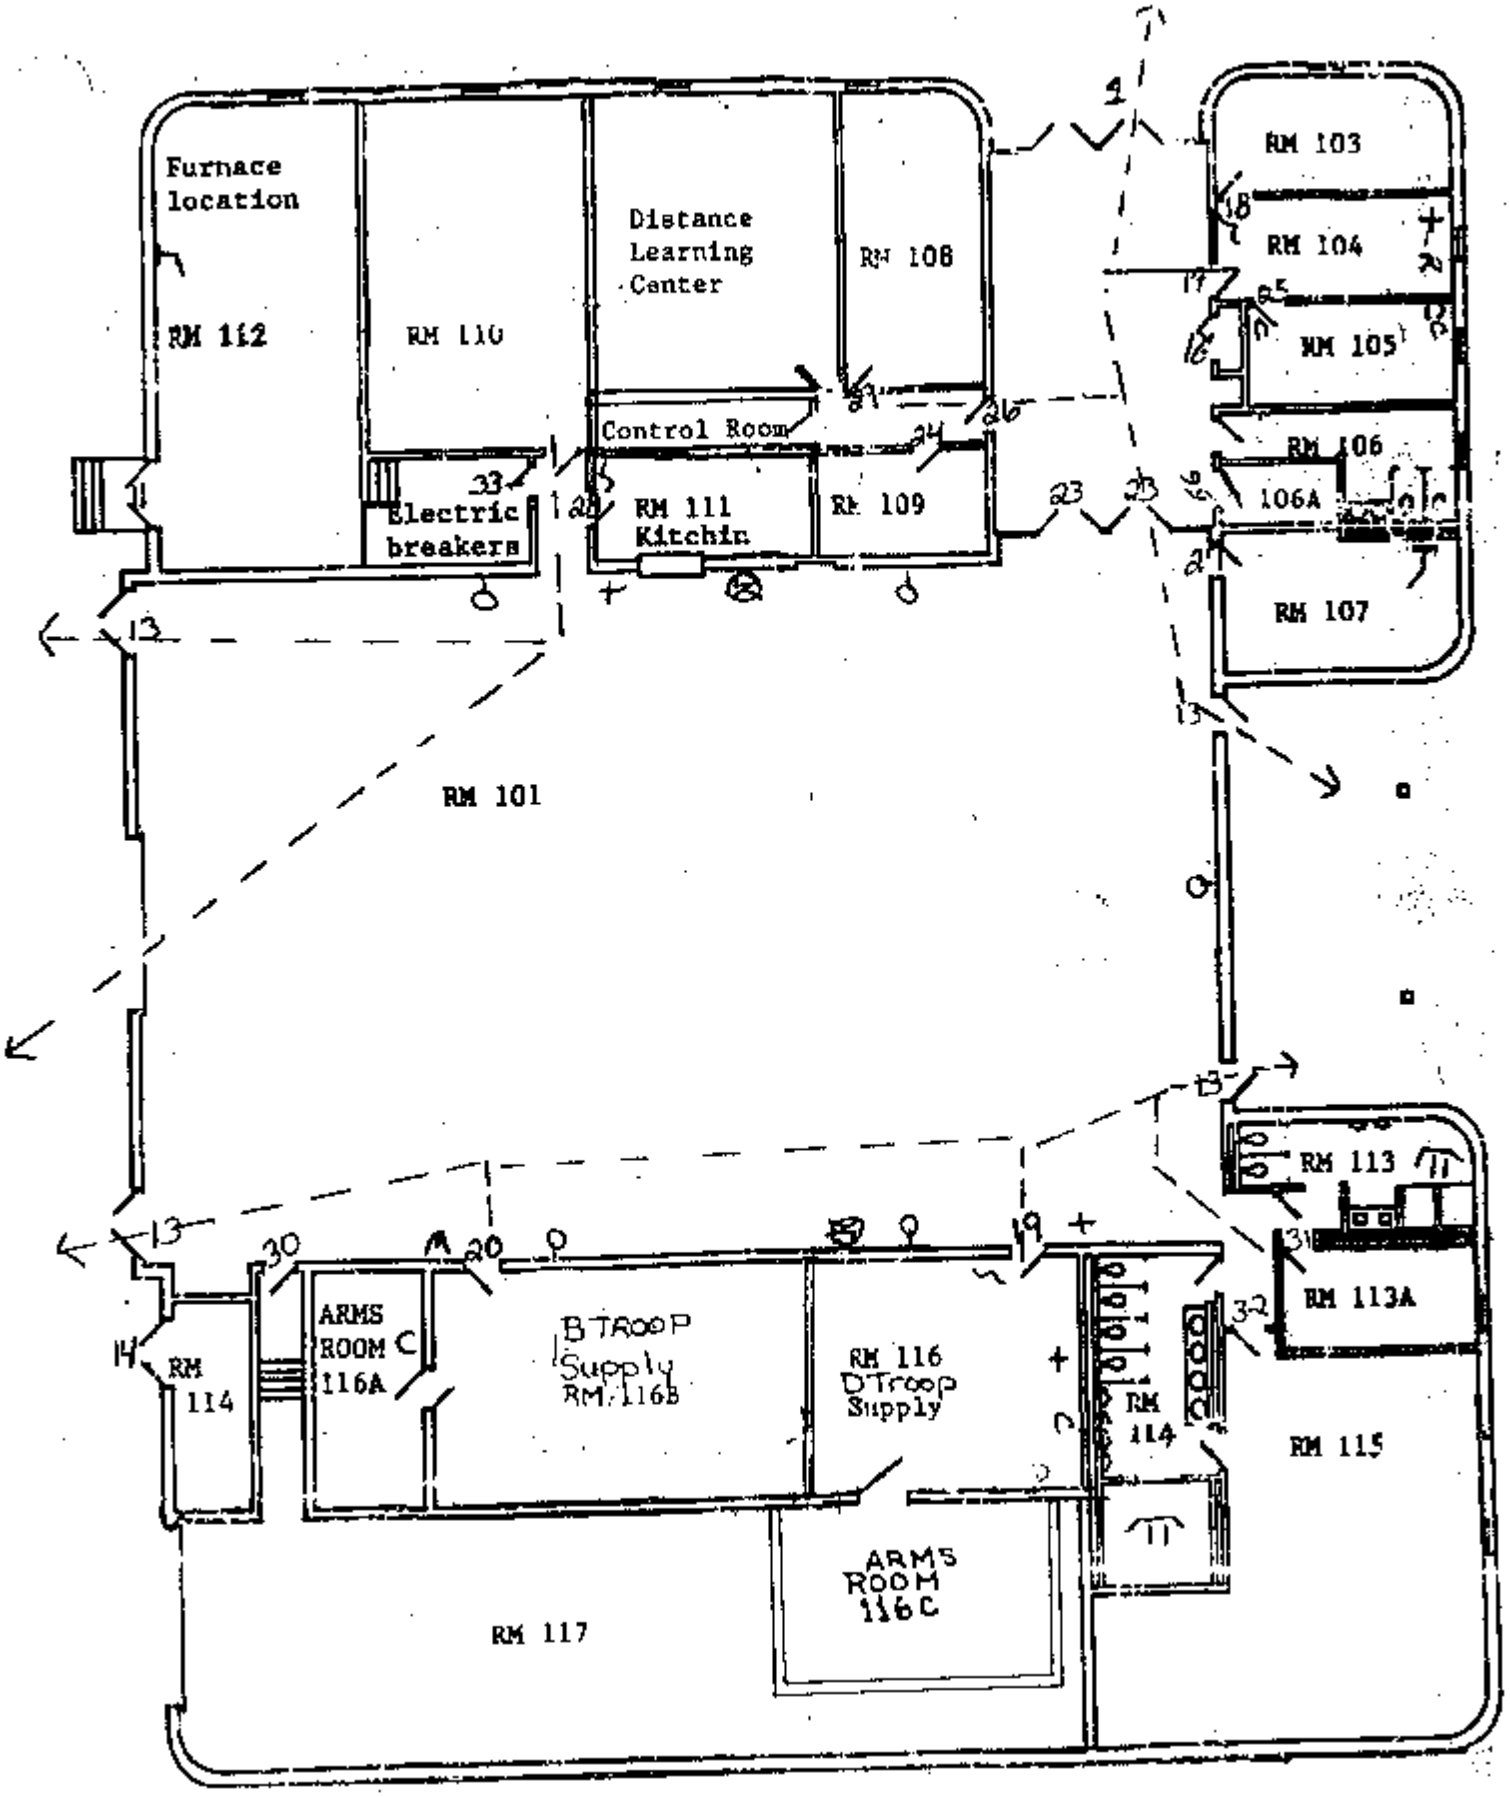

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2371 of 5269

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

11. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 NOV 06.

12. American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

May 2004

MEMORANDUM FOR Army National Guard Bureau (NGB) Region North Industrial Hygiene NGB-AVS-SI-IH/Non-Responsive, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03 Edgewood Armory, Edgewood MD

1. Enclosed is a copy of subject report and one CD-ROM.

2. Please direct any additional comments or concerns to Ms. Non-Responsive, at DSN 584-5475/3118, commercial (410) 436-5475/3118 or e-mail address at Non-Responsive@apg.amedd.army.mil.

Non-Responsive

ENCL

Industrial Hygienist
Industrial Hygiene Field Services Program

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
EDGEWOOD ARMORY
EDGEWOOD, MD
55-ML-01ED-03

Approved for public release; distribution unlimited.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES INDUSTRIAL HYGIENE BASELINE SURVEYS, EDGEWOOD ARMORY
EDGEWOOD, MD
PROJECT NO. 55-ML-01ED-03

1. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

2. CONCLUSIONS.

a. Indoor Air Quality. All measurements met the American Society of Heating, Refrigerating, and Air-Conditioning Engineers, Inc. (ASHRAE) recommended guidelines for indoor air quality. The relative humidity was 46.7 %. The recommended guidelines are between 30 and 60% relative humidity. The indoor temperature of 68.2 degrees Fahrenheit was within the ASHRAE recommended guidelines for an acceptable thermal environment of 73 to 79 degrees Fahrenheit in the summer and 68-74.5 degrees Fahrenheit in the winter at 50 % relative humidity. The outdoor carbon dioxide level was 312 parts per million (ppm). The indoor carbon dioxide level of 313 ppm was within the ASHRAE recommended guidelines.

b. Lead. Five of fourteen dust-lead wipe sample results exceeded the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on surfaces. All five samples were taken from the former indoor firing range (IFR). Personnel using the former IFR may be tracking lead out of the room and redistributing lead into adjacent rooms in the armory. This can result in lead exposures for the general workforce. All water samples are below the EPA National Primary Drinking Water Regulations action level for lead in drinking water of 15 parts per billion (ppb).

c. Mold and Safety. There is both black and white mold on the ceiling. It is possible that mold may also be on the concrete walls throughout the armory. However, the white deposits may be due to efforescence. The POC stated that there has been a problem with condensation on the walls in the armory, and that the water drips onto the floor and presents a slip hazard. To prevent slipping the armory manager has covered all floors in the hallways with rubber mats.

3. RECOMMENDATIONS. The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2376 of 5269

BEST AVAILABLE COPY

medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead. The RAC for Lead Exposure in the former indoor firing range is classified as 5. Clean all areas in and adjacent to the former IFR where sampling results showed significantly elevated levels of dust-lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for the general workforce. Address all potential lead hazards before extending this facility to use for children, such as participation in family support group activities or sports. If children will use this facility in any capacity, clean surfaces to the EPA dust-lead standard for young children of 40µg/ft² on floors and clean to the USACHPPM decontamination level of 200µg/ft² for dust-lead on all other surfaces. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities in the IFR area. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas of the IFR identified as having elevated levels of lead.

b. Mold. A RAC has not been assigned to the mold but we recommend this situation be addressed immediately. The mold will have to be abated. Comprehensive guidelines are provided in Appendix G. The HVAC system should be evaluated by an engineer to ensure effective operation.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2377 of 5269

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys, Edgewood Armory, Edgewood MD
Project No. 55-ML-01ED-03

TABLE OF CONTENTS

Paragraph .....Page

1. AUTHORITY 1
2. PURPOSE OF EVALUATION 1
3. BACKGROUND INFORMATION 1
4. SUMMARY OF ACTIONS 1
5. ASSESSMENT CRITERIA FOR LEAD 2
6. SAMPLING RESULTS 2
7. DISCUSSION AND CONCLUSIONS 4
8. RECOMMENDATIONS 5
9. ADDITIONAL ASSISTANCE 5

Enclosure

1. Lead Exposure 6
2. Mold 6

Appendices

A. - ASSESSMENT CRITERIA FOR LEAD A-1
B. - SITE MAPS B-1
C. - PHOTOGRAPHS C-1
D. - SAMPLING SHEETS AND LAB ANALYSES D-1
E. - REFERENCES E-1
F. - LEAD CLEANING GUIDANCE F-1
G. - MOLD GUIDANCE G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2378 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: Edgewood Armory, Edgewood MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. Administration.

b. Date of Construction. Built in 1983.

c. POC. MSG Non-Responsive, armory manager, 410-436-2423 and Ms. Non-Responsive Non-Responsive, Edgewood Armory employee, 410-612-4198.

d. Survey Dates: 29 April and 25 September 2003.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe and water sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Carbon dioxide, temperature, and relative humidity measurements were collected to determine indoor air quality. Sample results and locations are in Appendix D.

b. Physical Condition of Facilities.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2379 of 5269

BEST AVAILABLE COPY

(1) Paint. Lead-based paint was not used in this armory. It has been Army policy since 1978 to not use lead-based paint in Army facilities.

(2) Asbestos. No asbestos was installed in this armory.

(3) Mold. There is mold in the armory.

(4) Safety Hazards Condensation collects on the walls and drips onto the floor. This presents a potential slip hazard to the employees so the armory manager installed rubber mats throughout the hallways (photograph # 1038).

c. Building concerns. See Safety Hazards.

d. Safety and Industrial Hygiene Programs. There are no written program records at the armory.

e. Heating, Ventilation, and Air-conditioning System (HVAC). There is a central HVAC system throughout the armory. There are windows but they cannot be opened.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting.

h. Converted indoor firing range (IFR). Staff Sergeant Ruth McCuen, Environmental Compliance Assessment Coordinator for the MD NGB, has records that state that lead has been abated in the indoor firing range. However, there are still high levels of dust-lead in the former indoor firing range. The IFR is currently being used for storage. There are plans to use it as an exercise room in the near future.

i. Photographs (Appendix C).

j. Site Maps. (Appendix B).

k. Facility use by children. The POC stated that children do not currently use the armory.

5. ASSESSMENT CRITERIA FOR LEAD. (Appendix A).

6. SAMPLING RESULTS.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2380 of 5269

BEST AVAILABLE COPY

a. Indoor Air Quality. The armory relative humidity of 46.7 % met the American Society of Heating, Refrigerating, and Air-Conditioning Engineers, Inc. (ASHRAE) recommended guidelines for air quality of 30%- 60% relative humidity. The indoor temperature of 68.2 degrees Fahrenheit was within the ASHRAE recommended guidelines for an acceptable thermal environment of 73-79 degrees Fahrenheit in the summer and 68-74.5 degrees Fahrenheit in the winter at 50 % relative humidity. The outdoor carbon dioxide level was 312 parts per million (ppm). The indoor carbon dioxide level of 313 ppm was within the ASHRAE recommended guidelines. To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which was 350 ppm. Therefore the total carbon dioxide level should not exceed approximately 1012 ppm in this armory.

b. Lead. Five of fourteen dust-lead wipe sample results exceeded the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on surfaces. All five samples were taken from the former IFR.

All water samples are below the EPA National Primary Drinking Water Regulations action level for lead in drinking water of 15 parts per billion (ppb).

See Table 1 and Appendix D for dust-lead wipe and water locations, photograph numbers, and analytical results. All sample results that are equal to or exceed 200µg/ft² of dust-lead are highlighted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2381 of 5269

Table 1: Sample Locations, Photograph numbers, and Analytical Results

Sample Numbers	Type of Sample	Location	Photo	Result µg/ft²
AB W01	Wipe	Drill Floor (near main entrance)	1021	<110
AB W02	Wipe	Drill Floor (middle of floor)	1022	<110
AB W03	Wipe	Drill Floor (near exit to rear of armory)	1023	<110
AB W04	Wipe	Drill Floor (table top on right side of drill room)	1024	<110
AB W05	Wipe	Drill Floor (table on left side of drill room)	1025	<110
AB W06	Wipe	Former IFR baffle area	1028	8000
AB W07	Wipe	Former IFR middle of floor	1029	260
AB W08	Wipe	Former IFR floor (rear)	1030	850
AB W09	Wipe	Former IFR rear storage room floor	1031	1600
AB W10	Wipe	Former IFR acoustical wall panel	1032	<110
AB W11	Wipe	Former IFR perforated metal soundproofing panel	1033	1600
AB W12	Wipe	Window Sill Second Floor	0747	<110
AB W13	Wipe	Air Supply Hallway Second Floor	0748	<110
AB W14	Wipe	Hallway Floor Second Floor next to Entrance	0749	<110
Water Samples				Parts Per Billion
ABH2O 01	Water	Women's Bathroom First Floor First Draw		7.9
ABH2O 02	Water	Women's` Bathroom First Floor Second Draw		< 1
ABH2O 03	Water	Utility Sink First Floor First Draw		3.1
ABH2O 04	Water	Utility Sink First Floor Second Draw		< 1

7. DISCUSSION AND CONCLUSIONS.

a. Indoor Air Quality. The armory relative humidity of 46.7 % met the American Society of Heating, Refrigerating, and Air-Conditioning Engineers, Inc. (ASHRAE) recommended guidelines for air quality of 30% to 60% relative humidity. The indoor temperature of 68.2 degrees Fahrenheit was within the ASHRAE recommended guidelines for an acceptable thermal environment of 73 to 79 degrees Fahrenheit in the summer and 68 to 74.5 degrees Fahrenheit in the winter at 50 % relative humidity. The outdoor carbon dioxide level was 312 parts per million (ppm). The indoor carbon dioxide level of 313 ppm was within the ASHRAE recommended guidelines. To alleviate occupant discomfort ASHRAE recommends that the carbon dioxide concentration in the room not exceed 700 ppm more than the outdoor ambient carbon dioxide concentration, which was 350 ppm. Therefore the total carbon dioxide level should not exceed approximately 1012 ppm in this armory.

BEST AVAILABLE COPY

b. Lead. Five of fourteen dust-lead wipe sample results exceeded the USACHPPM recommended decontamination level of 200µg/ft² for dust-lead on surfaces. All five samples were taken from the former IFR. Personnel using this room may be tracking lead out of the area and redistributing lead into adjacent rooms in the armory. This can result in lead exposures for the general workforce. All water samples are below the EPA National Primary Drinking Water Regulations action level for lead in drinking water of 15 parts per billion (ppb).

c. Mold and Safety. There is both black and white mold on the ceiling. Mold also appears to be on the concrete walls throughout the armory. However, we have seen other buildings where efforescence occurs and resembles mold. Efforescence is a white crystalline or powdery, often fluffy or fuzzy deposit on the surface of masonry materials such as concrete, brick, clay and tile. It is caused by water seeping through the wall, floor, or object. The water dissolves salts inside the object while moving through it, and then evaporates leaving the salt on the surface. The salt resembles mold growth. The POC stated that there has been a problem with condensation on the walls in the armory. We observed that the front doors and the rear loading doors in the armory are open occasionally. This can cause warm moist air to enter the building. When this air comes into contact with cooler air it forms condensation on the walls. The POC stated that the water drips onto the floor and presents a slip hazard. To prevent slipping the armory manager has covered all floors in the hallways with rubber mats.

8. RECOMMENDATIONS. Enclosure.

9. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by e-mail Non-Responsive@apg.amedd.army.mil.

Non-Responsive

INDUSTRIAL HYGIENIST
USACHPPM LEAD AND ASBESTOS TEAM LEADER
Industrial Hygiene Field Services Program
EPA AHERA Asbestos Inspector and Management Planner/
Certification Number MD-070340
EPA Lead Inspector and Lead Risk Assessor/
Certification Number 04-7913

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2383 of 5269

BEST AVAILABLE COPY

ENCLOSURE

EDGEWOOD ARMORY RECOMMENDATIONS

The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

1. Lead Exposure. The RAC for Lead Exposure in the former indoor firing range is classified as 5. Clean all areas in and adjacent to the former IFR where sampling results showed significantly elevated levels of dust-lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. Apply a sealant to the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for the general workforce. Address all potential lead hazards before extending this facility to use for children, such as participation in family support group activities or sports. If children will use this facility in any capacity, clean surfaces to the EPA dust-lead standard for young children of 40µg/ft² on floors and clean to the USACHPPM decontamination level of 200µg/ft² for dust-lead on all other surfaces. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities in the IFR area. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas of the IFR identified as having elevated levels of lead.

2. Mold. A RAC has not been assigned to the mold but we recommend this situation be addressed immediately. The mold will have to be abated. Comprehensive guidelines are provided in Appendix G: USACHPPM Technical Guide 277 Army Facilities Management Information Document on Mold Remediation Issues, February 2002. The HVAC system should be evaluated by an engineer to ensure effective operation.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2384 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

Subject: Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 $\mu g/ft^2$. This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e)(8)(viii))are not directly applicable because they are developed for floors (40 $\mu g/ft^2$), windowsills (250 $\mu g/ft^2$) and window troughs (400 $\mu g/ft^2$) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

BEST AVAILABLE COPY

APPENDIX B

SITE MAPS

BEST AVAILABLE COPY

N[redacted]Manager

BEST AV[redacted]COPY

Sgt [redacted]

[redacted]

CW4 [redacted]

1RST Floor

EMERGENCY EVACUATION PLAN

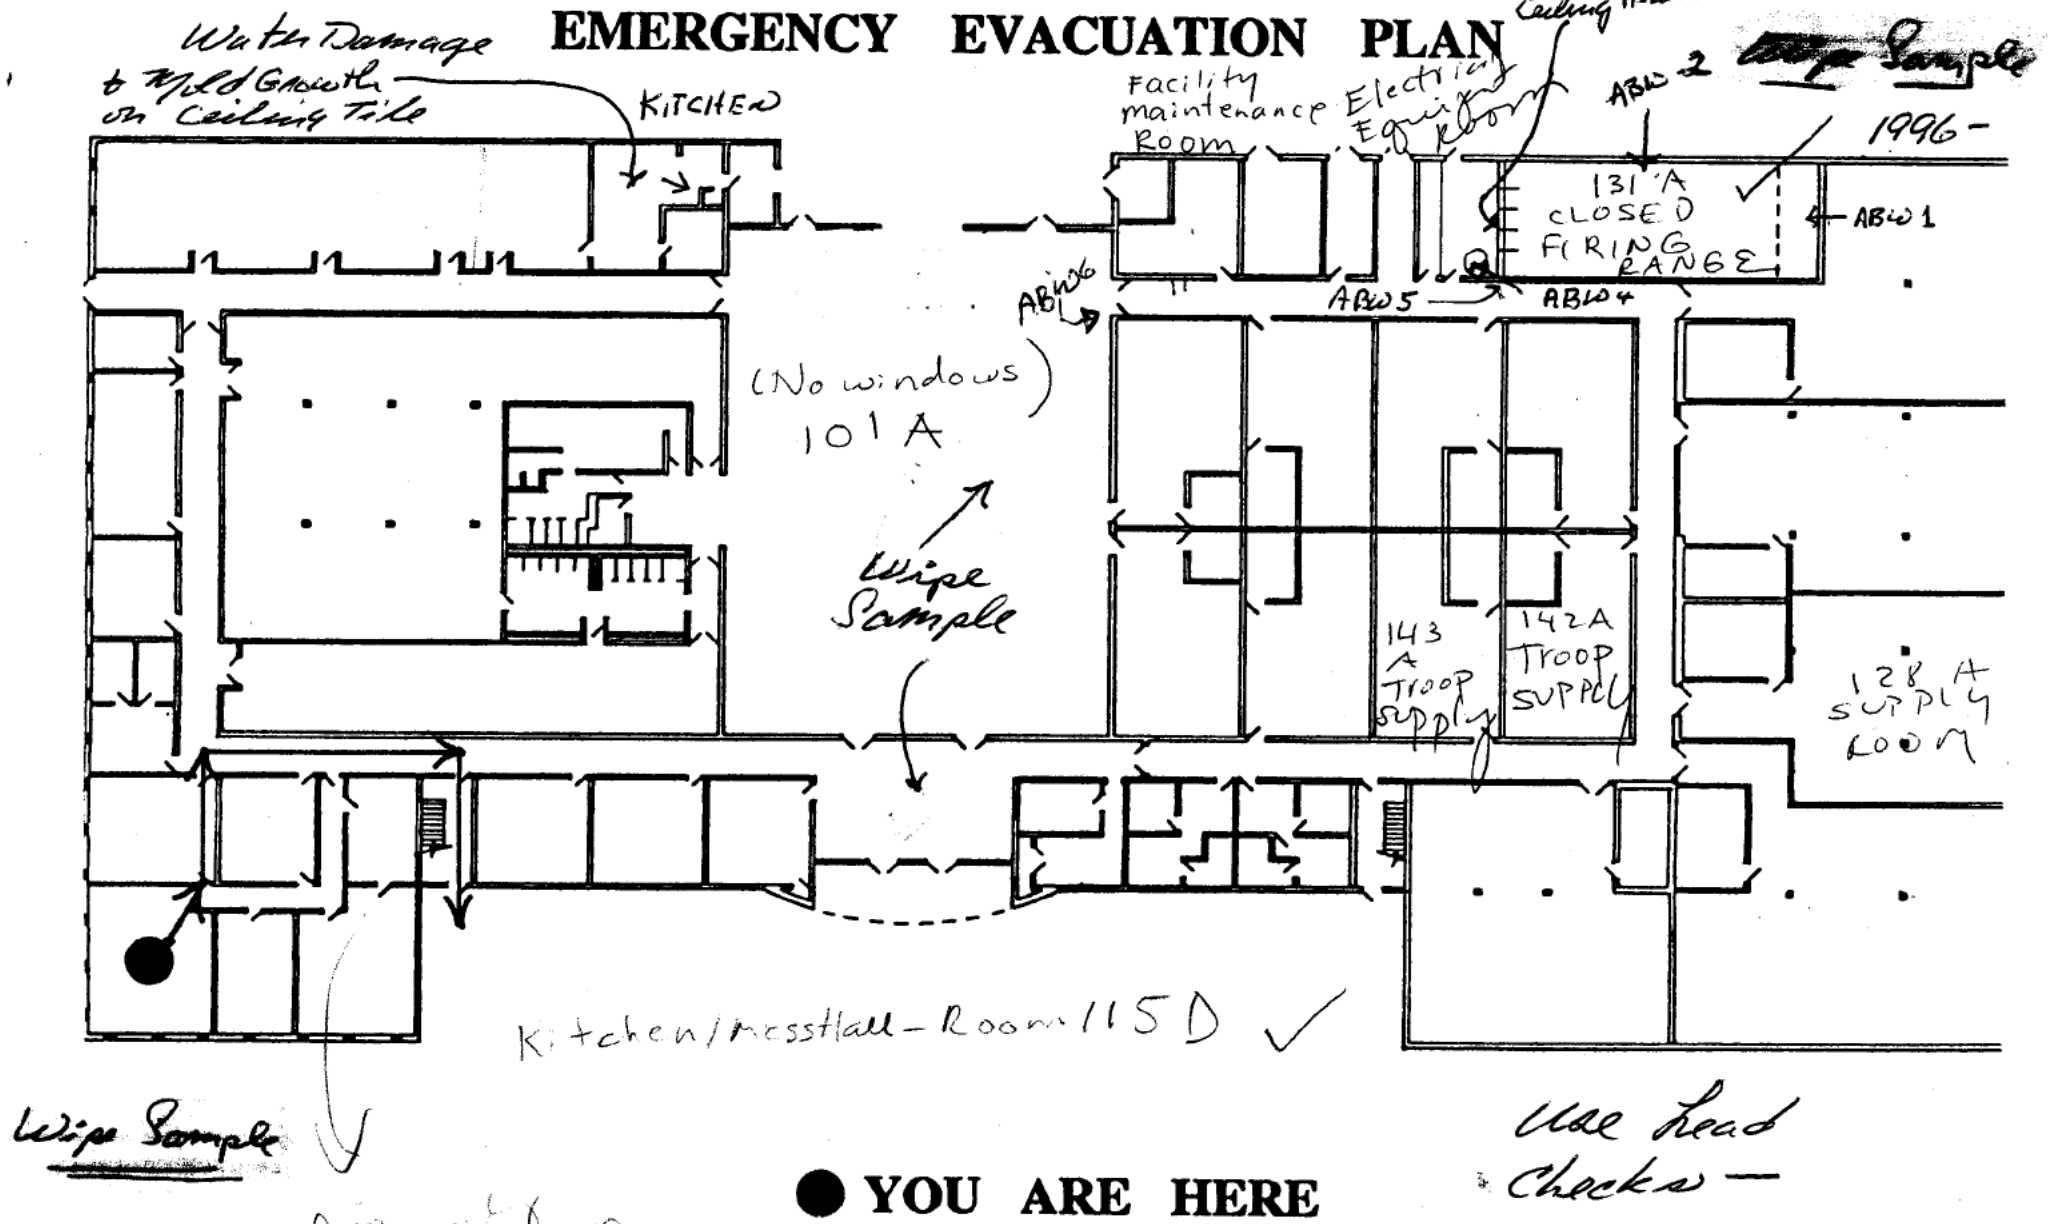

Use Lead Checks —

● YOU ARE HERE

* Look for Mold Damage

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2388 of 5269

BEST AVAILABLE COPY

EMERGENCY EVACUATION PLAN

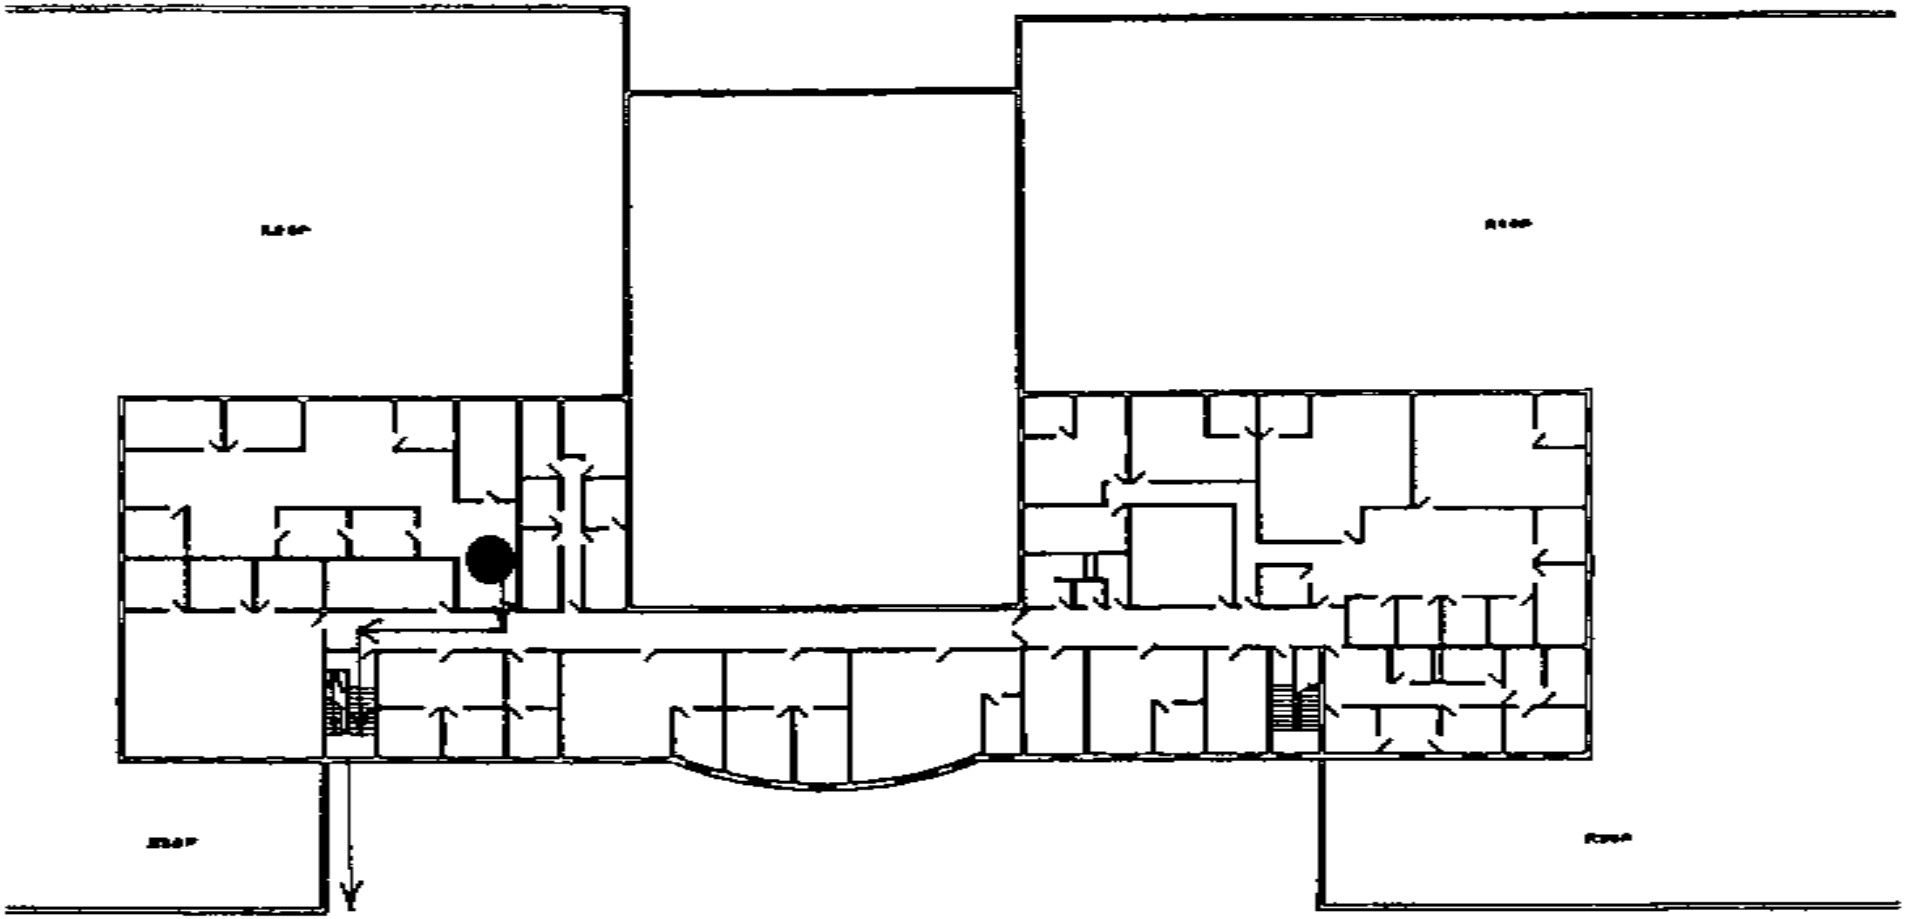

● YOU ARE HERE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Maryland Army National Guard — Edgewood Armory

(Directions)

29th Aviation Brigade, 29th Infantry Division (Light)

Building #4305
Aberdeen Proving Grounds
Edgewood Area
Aberdeen, MD 21010-5401

Call 410-679-3050

Local Recruiters: SSG Non-Responsive **and SFC** Non-Responsive

Resident Units:

- 29th Aviation Brigade, 29th Infantry Division (Light)
  - Headqurters & Headquarters Company
  - 224th Aviation Regiment
    - Company F (AVIM)
    - Company C (Assault Helicopter), 2nd Battalion
  - 1st Squadron, 158th Cavavlry Regiment (RECON) *"The Governor's Guard"*
    - Troop B
    - Troop C
    - Troop D
- 29th Air Traffic Control Services Group
  - Headquarters
  - 129th Air Traffic Services Company (Div)
  - 104th Medical Company (Air Ambulance)
- MDNG Military Youth Corps (ChalleNGe)
- Mobilization AVCRAD Control Element
- Operational Support Airlift Detachment

  Building #A1060

- Organizational Maintenace Shop #11

UNDER CONSTRUCTION

Posted to NGB FOIA Reading Room
May 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2390 of 5269

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

BEST AVAILABLE COPY

EDGEWOOD ARMORY

Photo Number	Photo Location
1021	Drill Floor (near main entrance)
1022	Drill Floor (middle of floor)
1023	Drill Floor (near exit to rear of armory)
1024	Drill Floor (table top on right side of drill room)
1025	Drill Floor (table on left side of drill room)
1028	Former IFR baffle area
1029	Former IFR middle of floor
1030	Former IFR floor (rear)
1031	Former IFR rear storage room floor
1032	Former IFR acoustical wall panel
1033	Former IFR perforated metal soundproofing panel
0747	Window Sill Second Floor
0748	Air Supply Hallway Second Floor
0749	Hallway Floor Second Floor next to Entrance

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1025.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2395 of 5269

DCP_1022.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1023.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1024.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1028.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1029.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1030.JPG Unknown

BEST AVAILABLE COPY

Posted to CSB FOIA Reading Room
May, 2018
DCP_1031.JPG Unknown
Released by National Guard Bureau
Page 2403 of 5269

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1032.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018

DCP_1034.JPG Unknown

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1037.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1038.JPG Unknown

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

DCP_1039.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

APPENDIX D

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

			Indoor Range Info					
Wipe Sample #	Armory	City	Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
				Yes		Yes		
AB W01	Edgewood	Edgewood					Drill Floor (near main entrance)	<110
AB W02	Edgewood	Edgewood					Drill Floor (middle of floor)	<110
AB W03	Edgewood	Edgewood					Drill Floor (near exit to rear of armory)	<110
AB W04	Edgewood	Edgewood					Drill Floor (table top on right side of drill room)	<110
AB W05	Edgewood	Edgewood					Drill Floor (table on left side of drill room)	<110
AB W06	Edgewood	Edgewood					Former IFR baffle area	8000
AB W07	Edgewood	Edgewood					Former IFR middle of floor	260
AB W08	Edgewood	Edgewood					Former IFR floor (rear)	850
AB W09	Edgewood	Edgewood					Former IFR rear storage room floor	1600
AB W10	Edgewood	Edgewood					Former IFR acoustical wall panel	<110
AB W11	Edgewood	Edgewood					Former IFR perforated metal soundproofing panel	1600
AB W12	Edgewood	Edgewood					Window Sill Second Floor	<110
AB W13	Edgewood	Edgewood					Air Supply Hallway Second Floor	<110
AB W14	Edgewood	Edgewood					Hallway Floor Second Floor next to Entrance	<110

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	National Guard	**Chain Of Custody:**	116953
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road	**Job Location:**	Aberdeen/Edgewood Armoy	**Date Analyzed:**	10/10/2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	10-Oct-03
Attention:	Non-Responsive				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0401861	ABH2O 01	Furnace	Water	****	N/A	1.00	ug/L		7.9	ug/L	
0401862	ABH2O 02	Furnace	Water	****	N/A	1.00	ug/L	<	1	ug/L	
0401863	ABH2O 03	Furnace	Water	****	N/A	1.00	ug/L		3.1	ug/L	
0401864	ABH2O 04	Furnace	Water	****	N/A	1.00	ug/L	<	1	ug/L	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analyst: Jodi Willoughby **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	Aberdeen Armory	**Chain Of Custody:**	116944
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road	**Job Location:**	Not Provided	**Date Analyzed:**	10/2/2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	02-Oct-03

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0400454	ABWBlank 1	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0400455	ABW 01	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400456	ABW 02	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400457	ABW 03	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400458	ABW 04	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400459	ABW 05	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400460	ABWBlank 2	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0400461	ABW 06	Flame	Wipe	****	0.108	111.52	ug/ft²		8000	ug/ft²	
0400462	ABW 07	Flame	Wipe	****	0.108	111.52	ug/ft²		260	ug/ft²	
0400463	ABW 08	Flame	Wipe	****	0.108	111.52	ug/ft²		850	ug/ft²	
0400464	ABW 09	Flame	Wipe	****	0.108	111.52	ug/ft²		1600	ug/ft²	
0400465	ABW 10	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400466	ABWBlank 3	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0400467	ABW 11	Flame	Wipe	****	0.108	111.52	ug/ft²		1600	ug/ft²	
0400468	ABWBlank 4	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0400469	ABW 12	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400470	ABW 13	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400471	ABW 14	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0400472	ABWBlank 5	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-3640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2418 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

NVLAP
NY ELAP
AIHA

Client:	US Army - CHPPM	**Job Name:**	Aberdeen Armory	**Chain Of Custody:**	116944
Address:	Attn: MCHB-TS-OFS, 5158 Blackhawk Road	**Job Location:**	Not Provided	**Date Analyzed:**	10/2/2003
	Aberdeen Proving Grounds, Maryland 21010-5403	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	Not Provided	**Report Date:**	02-Oct-03
Attention:	Non-Responsive				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Analyst: Daniel P. Swanson **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP Accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples.
All rights reserved. AMA Analytical Services, Inc.

An AIHA (#8863), NVLAP (# 101143), & New York ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD 20706 • (301) 459-2640 • Toll Free (800) 346-0961 • Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX E

REFERENCES

BEST AVAILABLE COPY

APPENDIX E

REGULATIONS AND STANDARDS

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current ed. http://www.osha.gov/comp-links.html.

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf.

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990. http://www.usapa.army.mil/pdffiles/r40_5.pdf.

4. AR 385-10, The Army Safety Program, 29 February 2000. http://www.usapa.army.mil/pdffiles/r385_10.pdf.

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p40_503.pdf.

6. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), American Conference of Governmental Industrial Hygienists (ACGIH), current ed.

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. RP-1-1993, Office Lighting, ANSI/ESNA.

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2423 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2424 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2425 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2426 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2427 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2428 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2429 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2430 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

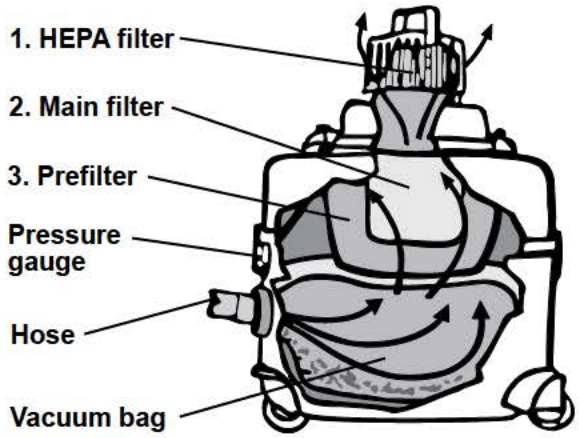

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

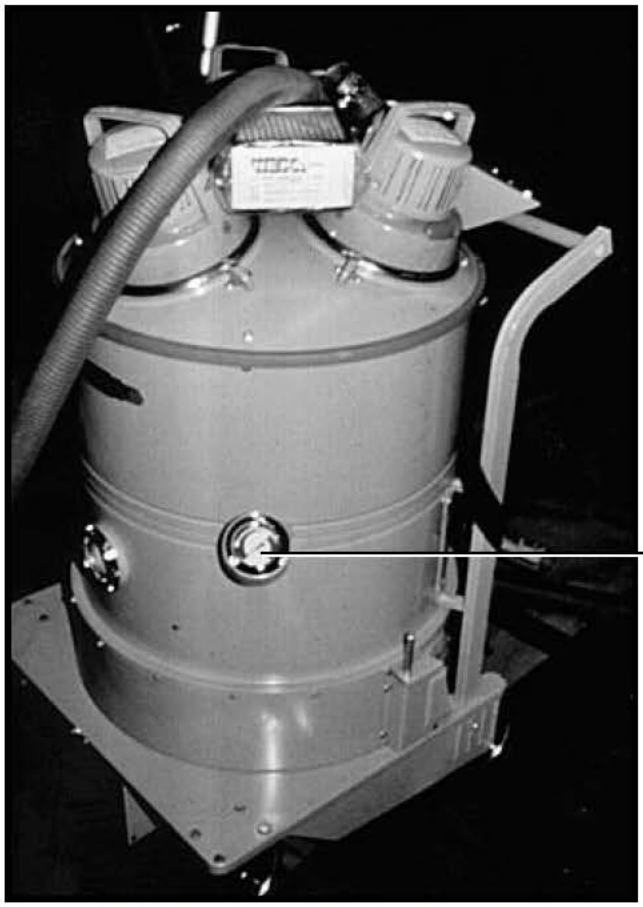

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2431 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

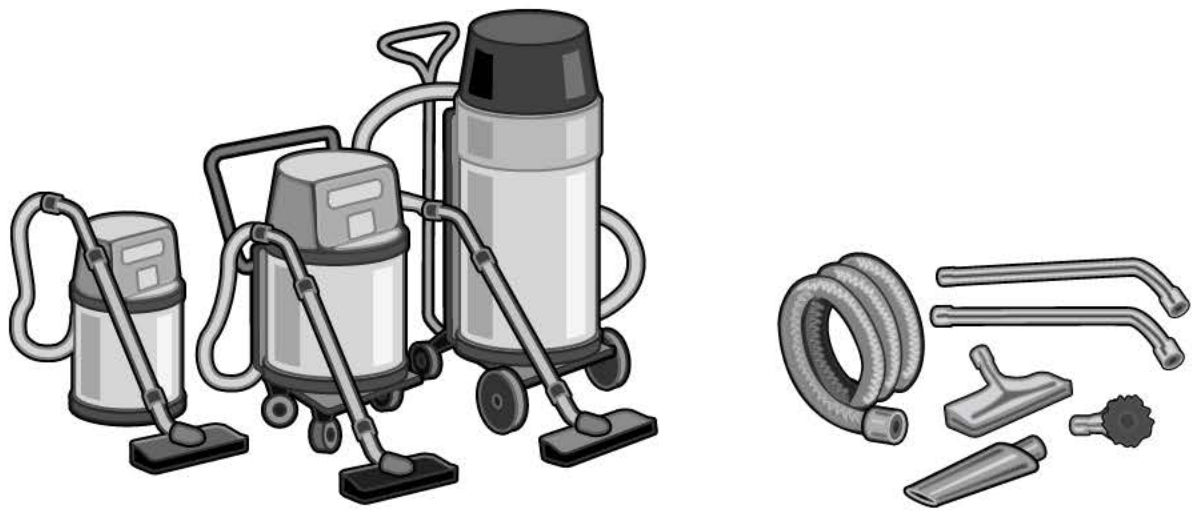

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2432 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

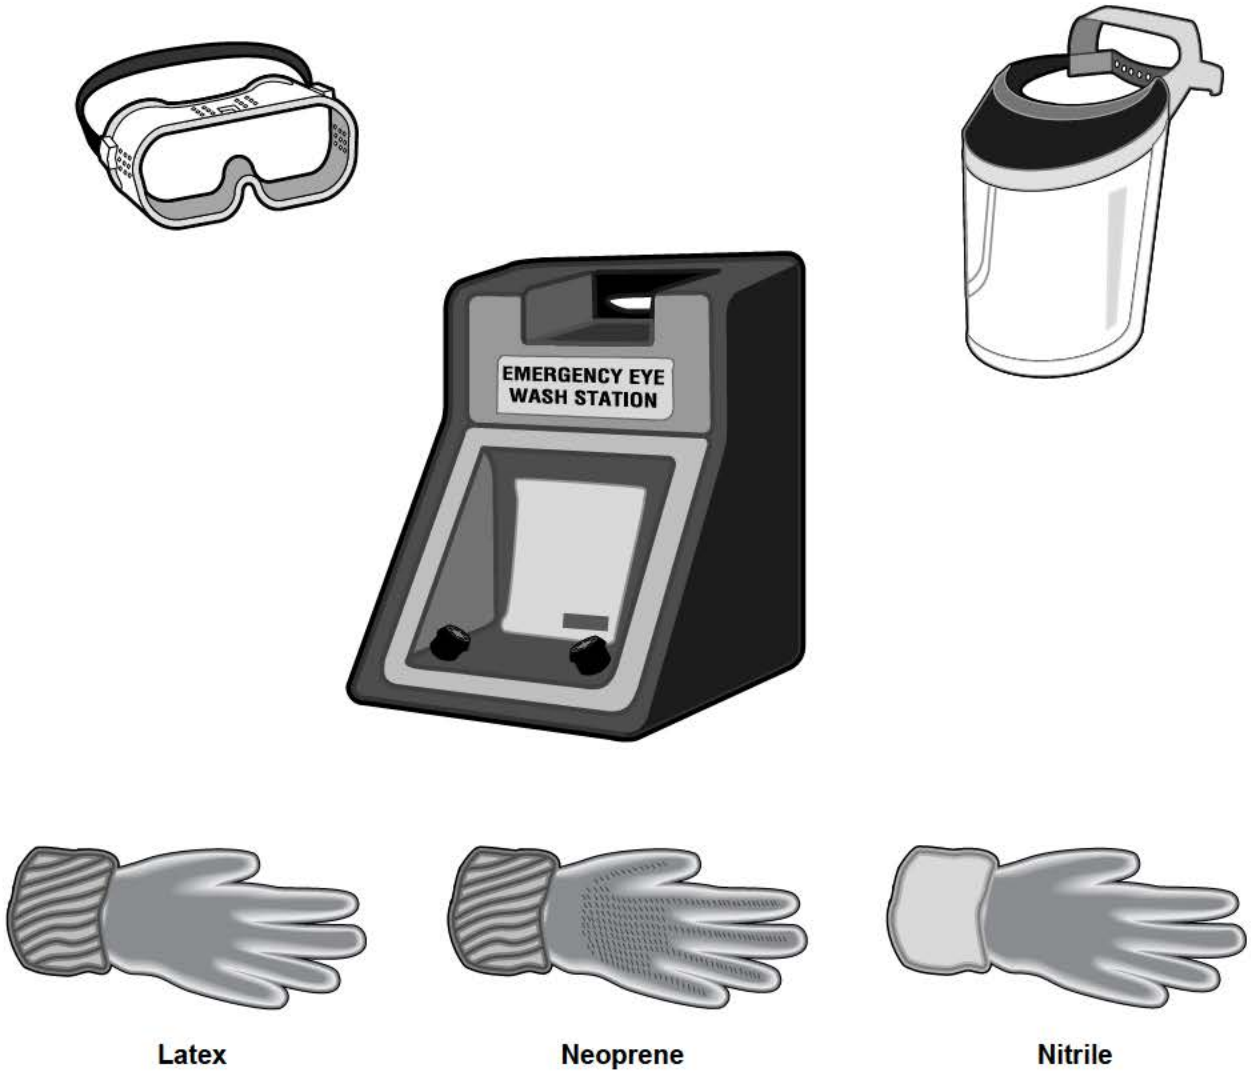

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2433 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

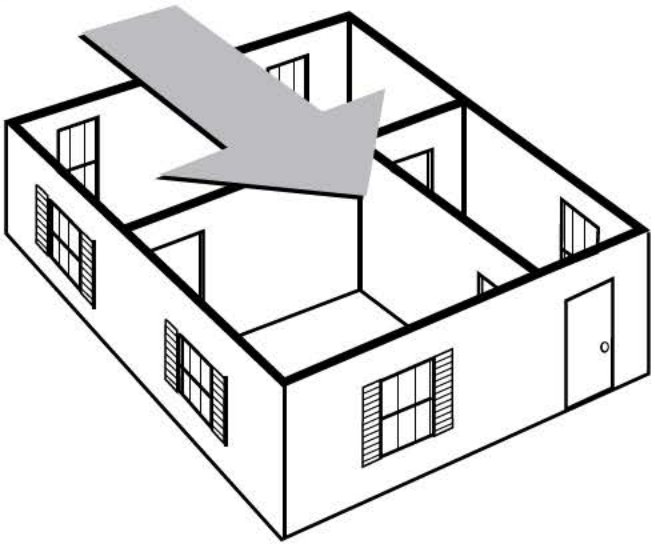

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

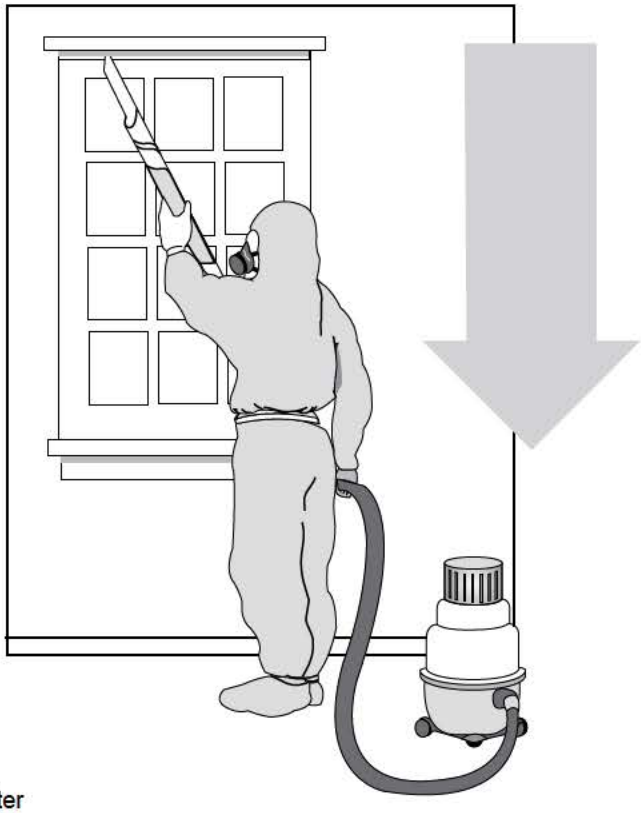

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2434 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2435 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

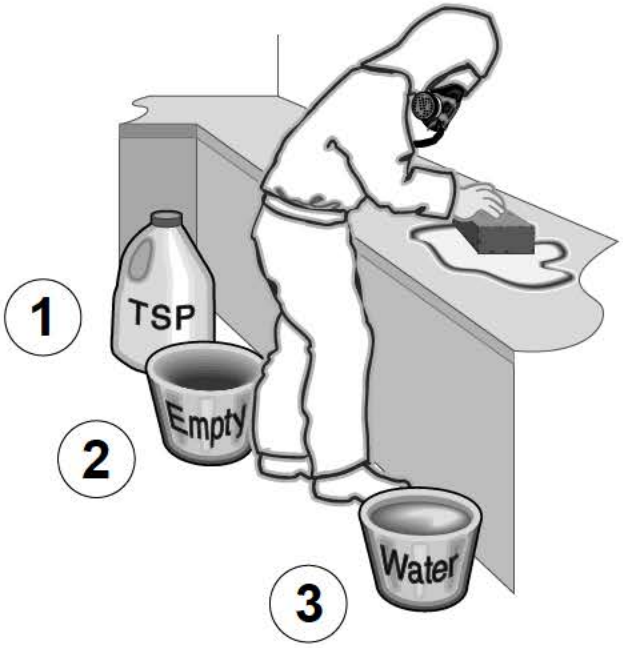

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2436 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

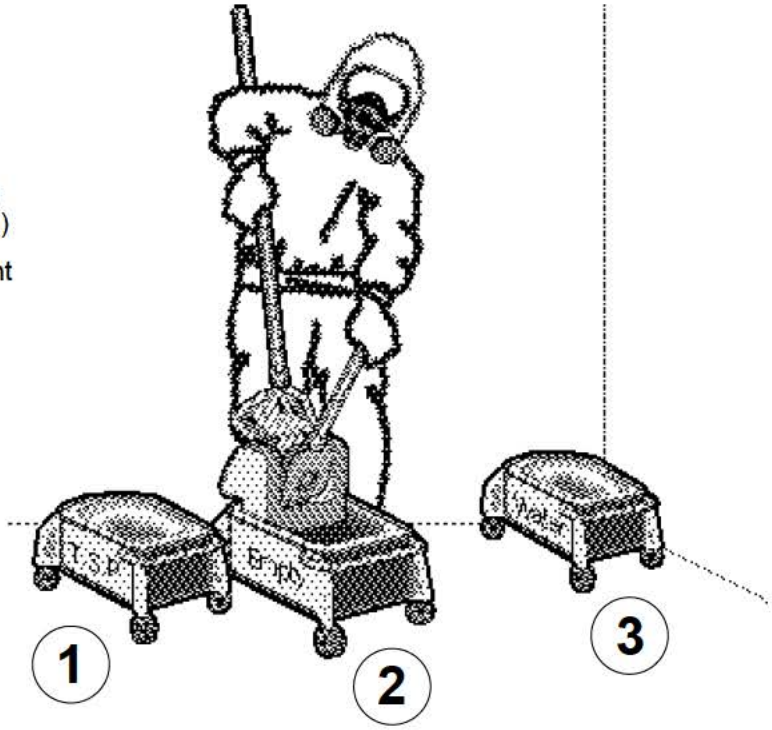

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

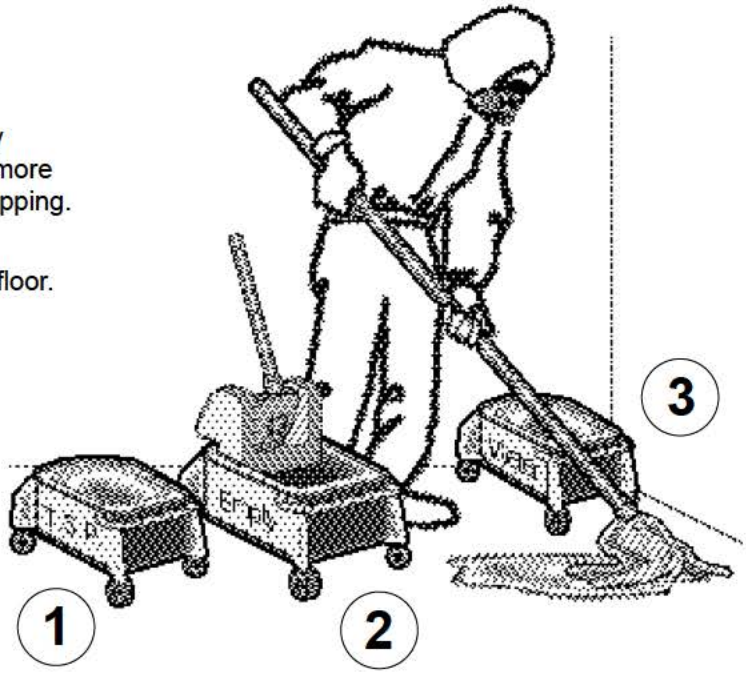

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2437 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

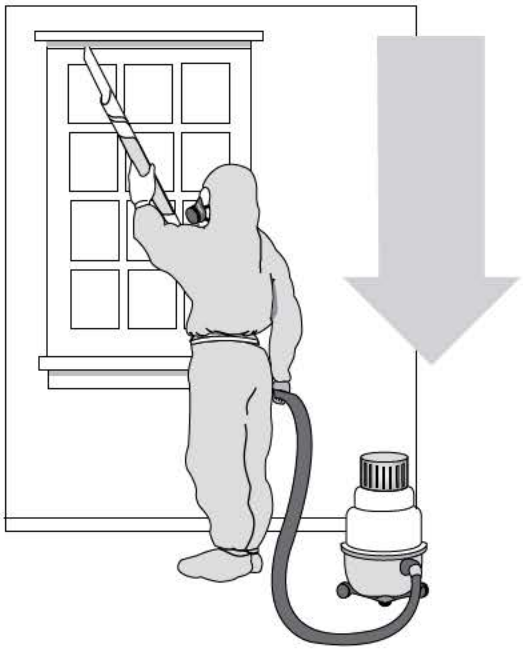

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2438 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2439 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2440 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2441 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2442 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2443 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2444 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2445 of 5269

BEST AVAILABLE COPY

APPENDIX G

MOLD GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2447 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2448 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2449 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2450 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet -** e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2451 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2452 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2453 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2454 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2455 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2456 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2457 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2458 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2459 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2460 of 5269

BEST AVAILABLE COPY

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2461 of 5269

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2462 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2463 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2464 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2465 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2466 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2467 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2468 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2469 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2470 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2472 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2473 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2474 of 5269

MOLD INVESTIGATION DECISION LOGIC

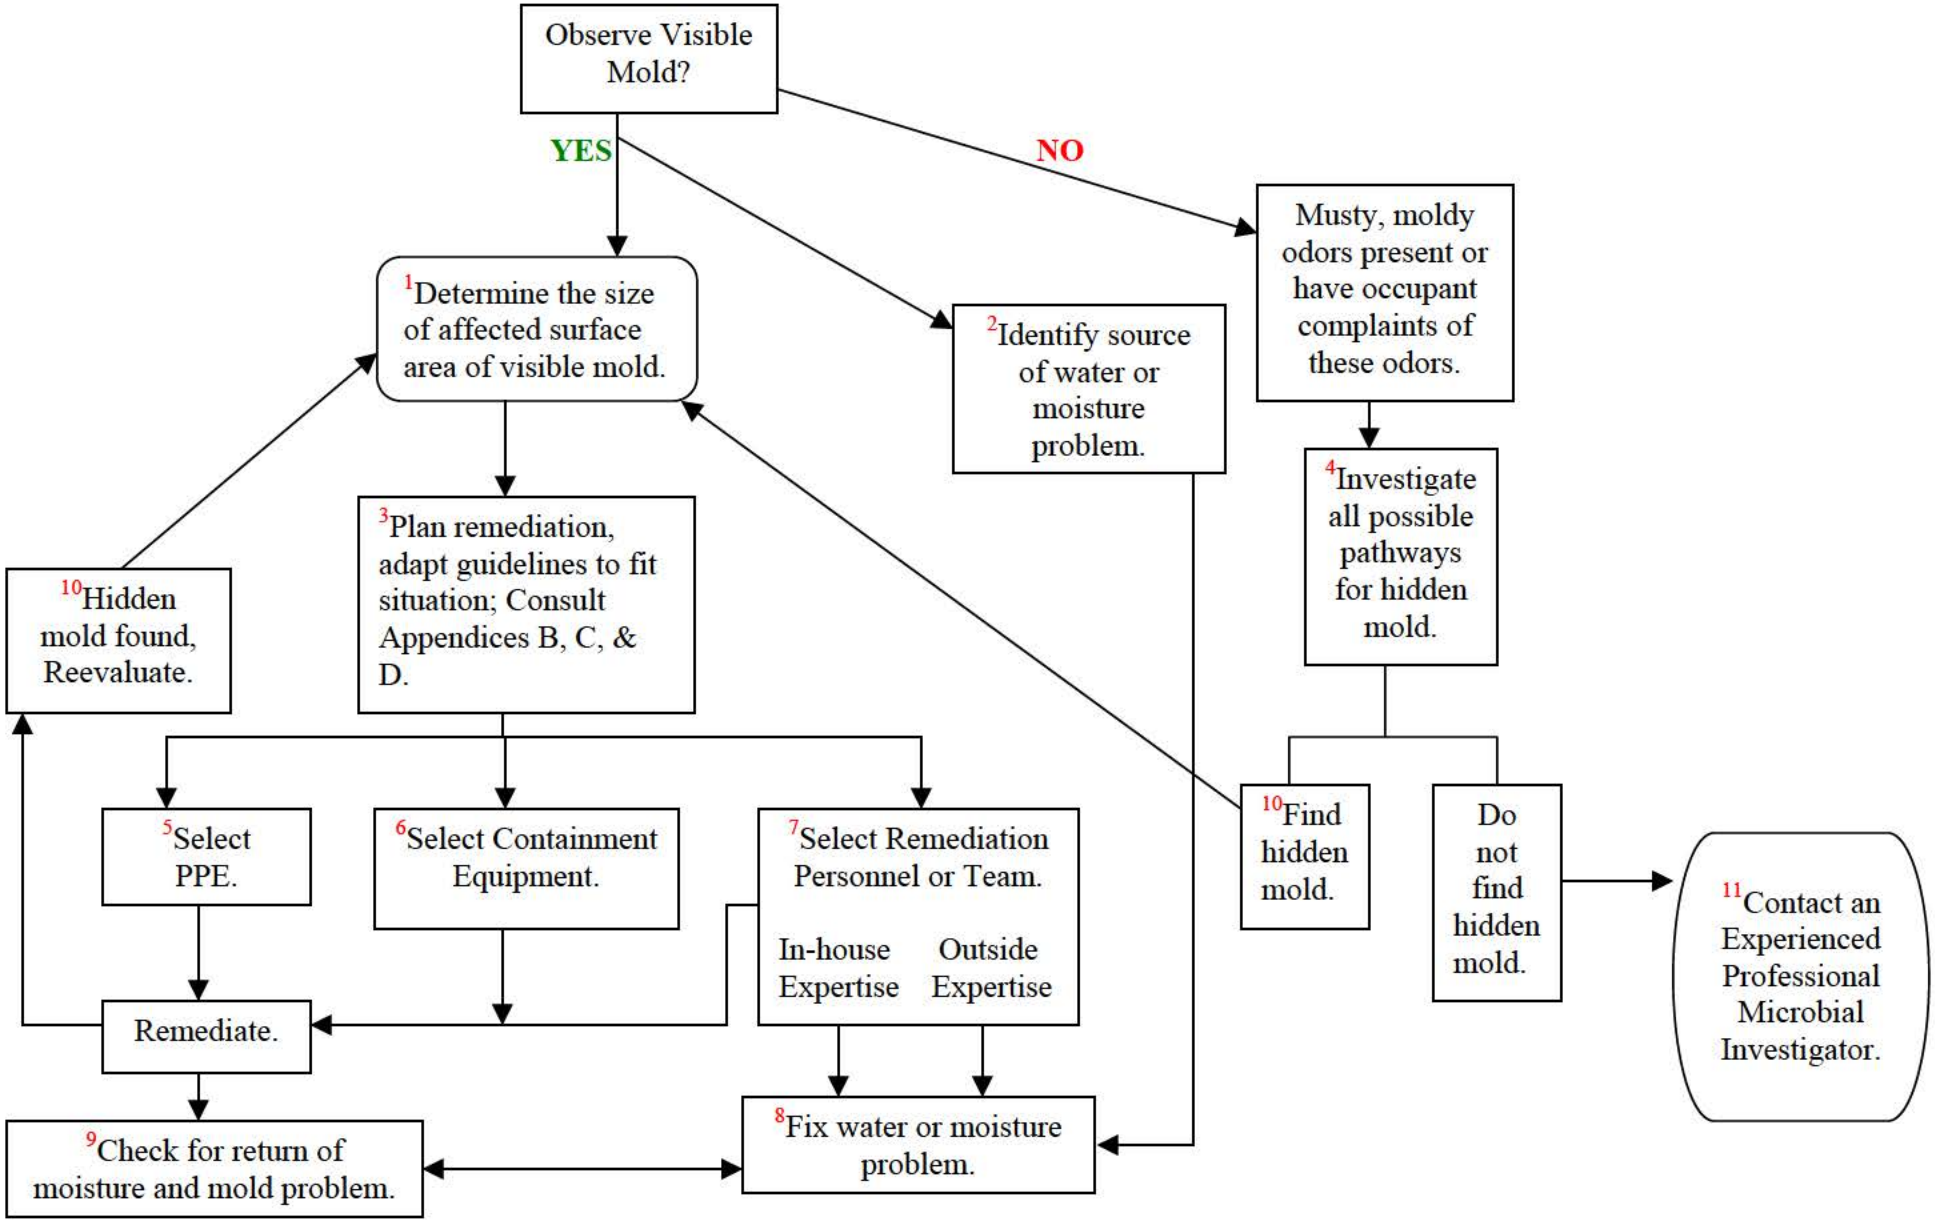

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2476 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2477 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2478 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2479 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2480 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2481 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2482 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2483 of 5269

BEST AVAILABLE COPY

TG 278

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2484 of 5269

BEST AVAILABLE COPY

Industrial Hygiene Study

National Guard Facility
Edgewood Readiness Center
Building E4305, APG
Edgewood, Maryland
21010-5401

Prepared for:

National Guard Bureau Region North IH Office
301-IH Old Bay Lane
Havre de Grace, Maryland
21078

Prepared by:

The EI Group, Inc.
2101 Gateway Centre Blvd.
Morrisville, North Carolina
27560

Report Date: December 30, 2008

Project ID: IHMO080101.03

Non-Responsive [redacted] _____

Manager, Charlotte Operations

Non-Responsive [redacted] _____

Senior Industrial Hygienist

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

TABLE OF CONTENTS

Executive Summary	3
Operation Description	4
Noise	4
Lead Testing	4
Lighting	5
Indoor Air Quality	6
Suspect ACBM	7
Ventilation Assessment	7
Additional Items	7
Limitations	7
References	8

List of Appendices

Appendix A: Photographs

Appendix B: Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2486 of 5269

EXECUTIVE SUMMARY

An industrial hygiene survey was conducted August 21, 2008 at the Readiness Center Facility Identification No.494 located in Edgewood, Maryland. The study was performed by Mr. [redacted].

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lighting within the facility was also evaluated. Lighting was found to be within applicable recommended levels.

Various surfaces within the HVAC system and throughout the facility were screened for lead. The screening was completed using surface/wipe and air samples. None of the samples collected were found to have detectable levels of lead contaminant.

Indoor air quality parameters were also evaluated during the assessment. Indoor air quality was found to be within those parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE).

Operation Description

The Edgewood Readiness Center primarily serves as an office setting and equipment storage facility. The facility consists of a single story response center that contains office spaces, decommissioned gun range, and storage areas.

The exterior walls of the building were constructed of a concrete block system (CBS) finished with red brick. The interior walls were composed of concrete block and in some areas were finished with drywall. The roof of the facility consisted of a flat rubber membrane roof system covered with stone. The heating, ventilating, and air conditioning system (HVAC) consisted of a split direct-expansion (DX) system and a radiator heating system. The floors were composed of a poured concrete slab and in some areas were finished with 12”x12” vinyl floor tiles. The ceilings were generally composed of metal corrugated roof deck and in some areas were finished with a suspended drop ceiling system.

Site personnel at the time of the site assessment consisted of 70 administrative personnel. The employees on site were conducting general administrative work.

Noise Survey

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lead Testing

At the time of the assessment, no activities were observed which may lead to lead exposure other than ammunition handling. The facility contains an unoccupied room which was once an indoor firing range.

Various surfaces within the facility were screened for lead using surface/wipe samples and the collection of air samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 µm MCE cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, MD for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix B.

No deteriorated paint was observed. No lead was detected in any sample collected.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2488 of 5269

Lead Testing Results Summary

Location	Air ug/m^3	Surface ug/ft^2	Bulk	Chip %Pb
01-A: Former Range/Gym	<3.3			
02-A: 104D: Office	<3.3			
01-W: Former Range/Gym Floor	<3			
02-W: Kitchen Shelf		<110		
03-W: Office 104D Cabinet Top		<110		
04-W: Office 206C Office Cabinet Top		<110		
05-W: Office 204A Mail File		<110		
06-W: Main Lobby: Shelf Top		<110		
Criteria	**50**	**200**	**5,000**	**0.5**

Key: ND – None Detected
PB – Lead

Lighting

A lighting assessment was conducted throughout the facility. The survey was conducted with large bay doors closed. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. 98047EL). The light meter was last calibrated on February 22, 2008. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Gym	39	30	Yes
Kitchen	63	50	Yes
Supply – 113A	51	30	Yes
Locker area	8	7	Yes
Room 109A	38	30-50	Yes
Room 106A	41	30-50	Yes
Room 104A	76	30-50	Yes
Room 130A	50	30-50	Yes
Room 206C	66	30-50	Yes
Room 201F	54	30-50	Yes
Room 201L	76	30-50	Yes
Room 205F	56	30-50	Yes
Room 204A	38	30-50	Yes
Room 203C	58	30-50	Yes
Room 201M	53	30-50	Yes

Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a Fluke IAQ Meter, Model 975. The IAQ Meter was last calibrated in April 2008.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2007). The US Army Technical Guide 277, Army Facilities Management Information Document on Mold Remediation Issues, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 68.0°F to 79.7°F with relative humidity readings ranging from 50.0% to 67.8%. During the survey, CO_2 levels ranged from 410 ppm to 632 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,089 ppm (389 ppm + 700 ppm). The results of the testing met the ASHRAE guidelines.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	83.4	47.7	400	0
Outdoors	86.0	41.1	389	0
Gym	79.7	50.0	632	0
Kitchen	77.9	52.3	500	0
Supply Room 113A	75.2	58.1	483	0
Locker Room	73.4	56.8	447	0
Office 109A	72.5	56.2	442	0
Office 104D	73.4	55.2	410	0
Office 130A	78.8	52.9	554	0
Office 206C	75.2	56.4	456	0
Office 201F	73.4	59.0	458	0
Office 201L	72.5	**60.6**	494	0
Office 205F	71.6	**62.3**	480	0
Office 204A	68.0	**67.8**	467	0
Office 203C	69.8	**65.4**	504	0
Office 201M	69.8	**64.1**	503	0
Criteria	**73.0-79.0**	**30-50**	**<1,084**	**<9.0**

Air quality samples were collected from Rooms 113A, 104D, and 206C as well as outdoors (as control). Indoor fungal spore levels ranged from 328 to 6,130 spores/m^3. The concentration observed outdoors was found to range from 7,020 to 8,250 spores/m^3. Fungal spore concentrations from inside the building were compared to those levels identified outdoors. Indoor air quality, in relation to airborne fungal spores, was found to be acceptable with the exception of room 113A which was found to have elevated levels of *Aspergillus/Penicillium*. Outdoor *Aspergillus/Penicillium* counts ranged from 492 to 903 spores/m^3 while Room 113A was found to have an *Aspergillus/Penicillium* concentration of 1,640 spores/m^3.

Water damaged ceiling tiles were identified in several areas and appeared to have been impacted by roofing leaks. Reportedly, a new roof was added to the facility in 2007.

Elevated humidity levels were identified throughout the second floor. It appears to be due to operational parameters of the HVAC equipment.

Suspect Asbestos Containing Building Materials

- Suspect asbestos containing materials include sheetrock/joint compound, floor tiles and associated mastic, and vinyl covebase. Thermal system insulation was found to be a combination of paper wrapped fiberglass with PVC elbows.

Ventilation System Assessment

The heating, ventilating, and air conditioning system (HVAC) consisted of a split direct-expansion (DX) system and a radiator heating system. The intake filters and coils appeared to be in good condition with little dust loading. Interior fiberglass appeared to have visible dust accumulation. No record keeping could be identified concerning the frequency of maintenance activities such as cleaning or filter changes. Supply ducts were found to contain dust loading.

Additional Items

No O&M plan could be identified. Initiate an O&M Plan for the asbestos containing materials or presumed asbestos containing materials. Maintain a copy of the O&M Plan onsite at all times.

Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicated within the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2491 of 5269

scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and The EI Group, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

References

Title 29 Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration.

Lead - (29 CFR 1910.1025(h))

American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2008 Edition

Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

Georgia Army National Guard: Standard Army Safety and Occupational Health Inspection Checklist; 1 October 1999 Edition

ANSI Z358.1 – 2004, Emergency Eye Wash and Shower Equipment

American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62-1-2007.

RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

National Emission Standard Hazardous Air Pollutants (NESHAP) - The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3))

Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

BEST AVAILABLE COPY

Appendix A

Photographs

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Dust loading on HVAC supply duct

Water damaged ceiling panel – Room 104

BEST AVAILABLE COPY

Water damaged ceiling – room 113A

Exterior view of facility

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

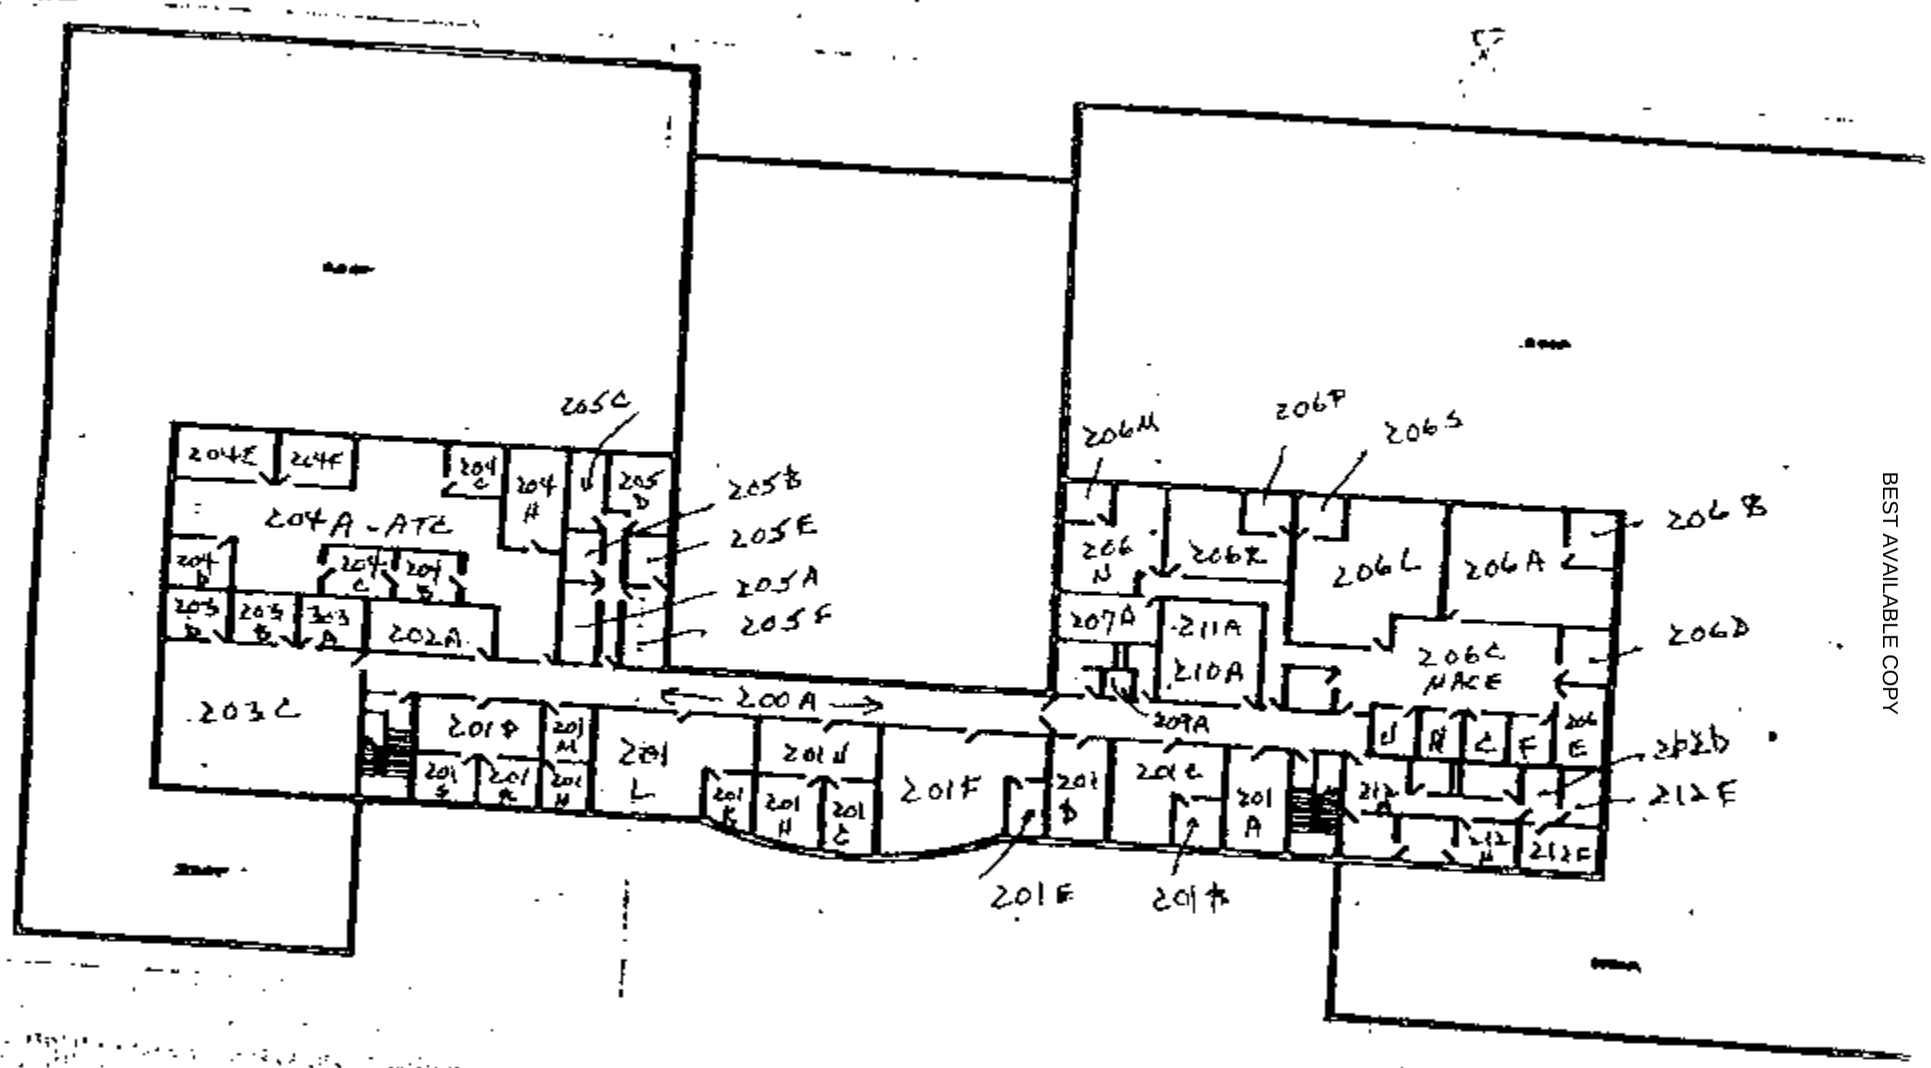

EDGEWOOD ARMORY
SECOND FLOOR PLAN
NO SCALE

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2497 of 5269

Appendix B

Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Invoice: 95246

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI	**Job Location:**	Not Provided	**Date Submitted:**	10/1/2008
	State Military Reservation	**Job Number:**	Not Provided	**Date Analyzed:**	10/8/2008
	Havre de Grace, Maryland	**P.O. Number:**	Not Provided	**Date Invoiced:**	10/8/2008
	21078			**Person Submitting:**	Non-Responsive [redacted]

Attention: Non-Responsive [redacted]

AMA Sample #	Client Sample #	Analysis and Sample Type	Turn Around	Cost	Additional Analysis and Sample Type *	Turn Around *	Additional Cost *	Total Cost
0882217	NGA-01-A	AA Lead Air	5 Day +	**$8.00**				**$8.00**
0882218	NGA-02-A	AA Lead Air	5 Day +	**$8.00**				**$8.00**
0882219	NGA-03-A	AA Lead Air	5 Day +	**$8.00**				**$8.00**
0882220	NGA-01-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882221	NGA-02-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882222	NGA-03-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882223	NGA-04-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882224	NGA-05-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882225	NGA-06-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882226	NGA-07-W	AA Lead Wipe	5 Day +	**$8.00**				**$8.00**
0882227	OR	MLD Spore Trap	5 Day +	**$30.00**				**$30.00**
0882228	OF	MLD Spore Trap	5 Day +	**$30.00**				**$30.00**
0882229	113A	MLD Spore Trap	5 Day +	**$30.00**				**$30.00**
0882230	104D	MLD Spore Trap	5 Day +	**$30.00**				**$30.00**
0882231	206C	MLD Spore Trap	5 Day +	**$30.00**				**$30.00**

Sub-Total:	**$230.00**
Additional Charge:	**$0.00**
Total:	**$230.00**

Note: Payment Due Upon Receipt.

Note: All Accounts over 30 days are subject to a 1½% per month service charge.

* Only apply if additional analysis was performed on the sample(s)

Account Code: NATLG

Remit to: P.O. Box 646, Hanover, Maryland 21076, 410-684-3327

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2499 of 5269

FOIA Requested Record #[illegible]-0085 (MD)
Released by National Guard Bureau
Page 2500 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008 **Report Date:** 9/9/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0882217	NGA-01-A	Flame	Air	920	N/A	3.26	ug/m³	<	3.3	ug/m³	
0882218	NGA-02-A	Flame	Air	916	N/A	3.28	ug/m³	<	3.3	ug/m³	
0882219	NGA-03-A	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0882220	NGA-01-W	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882221	NGA-02-W	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882222	NGA-03-W	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882223	NGA-04-W	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882224	NGA-05-W	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882225	NGA-06-W	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882226	NGA-07-W	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008 **Report Date:** 9/9/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson **Technical Manager:** G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-10085 (MD)
Released by National Guard Bureau
Page 2501 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16548

Analysis Type:	Flame
Sample Type:	Wipe
Analysis Date	9/9/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		0.021	ppm			Acceptable
Report Limit Verification Sample		0.3886	ppm	116.6%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				99.37%		Acceptable
Spike Duplicate						Acceptable
Laboratory Control Sample 1		293.671	µg	103.05%		Acceptable
Laboratory Control Sample 2		288.608	µg	103.42%	0.36%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999987

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
503164	81783	OLN-4 W-01
503164	81784	OLN-4 W-02

SDG Number: 16548

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2502 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
503164	81785	OLN-LW-03
503164	81786	OLN-LW-04
503164	81787	OLN-LW-05
503164	81788	OLN-LW-06
503164	81789	OLN-LW-07
503164	81790	OLN-LW-08
503164	81791	OLN-LW-09
503164	81792	OLN-LW-10
503164	81793	OLN-LW-FB1
181402	82220	NGA-01-W
181402	82221	NGA-02-W
181402	82222	NGA-03-W
181402	82223	NGA-04-W
181402	82224	NGA-05-W
181402	82225	NGA-06-W
181402	82226	NGA-07-W

SDG Number: 16548

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2503 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16547

Analysis Type: Flame
Sample Type: Air
Analysis Date: 9/8/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.103	ppm			Acceptable
Report Limit Verification Sample		0.2194	ppm	87.8%		Acceptable
Expected Spike Level (ppm)	0.25					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				106.15%		Acceptable
Spike Duplicate				104.70%	1.38%	Acceptable
Laboratory Control Sample 1		110.689	µg	105.18%		Acceptable
Laboratory Control Sample 2		113.155	µg	103.75%	1.36%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.99991

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
180767	82077	N0276-01
180767	82078	N0276-02

SDG Number: 16547

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2504 of 5269

BEST AVAILABLE COPY

Samptes included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
180767	82079	N0276-03
181402	82217	NGA-01-A
181402	82218	NGA-02-A
181402	82219	NGA-03-A
181404	82232	487-1
181404	82233	487-2
181404	82234	487-3
181417	82245	492-2
181417	82246	492-1
181417	82247	492-3
503172	82261	94081.BP-1
503172	82262	94081.BP-2
503173	82263	92081.BP-1
503173	82264	92081.BP-2
503174	82265	95081.BP-1
503174	82266	95081.BP-2
503175	82267	93081.BP-1
503175	82268	93081.BP-2

SDG Number: 16547

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2505 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
Attention:	[redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/9/2008

AMA Sample #	0882227	**AMA Sample #**	0882228
Client ID	OR	**Client ID**	OF
Analyst ID	RC	**Analyst ID**	RC
Collection Apparatus	Air-O-Cell	**Collection Apparatus**	Air-O-Cell
Sample Volume (L)	150	**Sample Volume (L)**	150
Analytical Sensitivity (sp/m³)	41	**Analytical Sensitivity (sp/m³)**	41
Sample Condition	Acceptable	**Sample Condition**	Acceptable

	Raw CT.	%	sp/m³		Raw CT.	%	sp/m³
Alternaria	Present		< 41	**Alternaria**	2	1.0%	82
Ascospores	14	8.2%	574	**Ascospores**	18	9.0%	738
Aureobasidium				**Aureobasidium**			
Basidiospores	105	61.4%	4,310	**Basidiospores**	103	51.2%	4,230
Bipolaris/Drechslera/Helm.				**Bipolaris/Drechslera/Helm.**			
Boletus				**Boletus**			
Botrytis				**Botrytis**			
Cercospora				**Cercospora**			
Chaetomium	Present		< 41	**Chaetomium**			
Cladosporium	13	7.6%	533	**Cladosporium**	25	12.4%	1,030
Coprinus				**Coprinus**			
Curvularia				**Curvularia**			
Epicoccum				**Epicoccum**	1	0.5%	41
Fusarium				**Fusarium**			
Ganoderma				**Ganoderma**			
Nigrospora				**Nigrospora**			
Penicillium / Aspergillus	12	7.0%	492	**Penicillium / Aspergillus**	22	10.9%	903
Pithomyces	Present		< 41	**Pithomyces**	1	0.5%	41
Rusts				**Rusts**			
Smuts/Periconia/Myxomycetes	2	1.2%	82	**Smuts/Periconia/Myxomycetes**	Present		< 41
Stachybotrys				**Stachybotrys**			
Stemphylium				**Stemphylium**			
Trichoderma				**Trichoderma**			
Torula				**Torula**	Present		< 41
Ulocladium				**Ulocladium**			
Zygomycetes				**Zygomycetes**			
Other Colorless	24	14.0%	985	**Other Colorless**	29	14.4%	1,190
Unknown				**Unknown**	Present		< 41
Hyphal Fragments*	Present		< 41	**Hyphal Fragments***	2		82
Zygophiala	1	0.6%	41				
Totals Spore Concentration			7,020	**Totals Spore Concentration**			8,250
Location				**Location**			
Comments				**Comments**			

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. • Lanham, MD, 20706 • (301) 459-2640 • Toll Free (800) 3-0-0 • Fax (301) 459-2643
Tuesday, September 09, 2008
Page 1 of 4

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Request Record # 1-0085 (MD)
Released by National Guard Bureau
Page 2506 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
Attention:	[redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/9/2008

AMA Sample #	0882229	**AMA Sample #**	0882230
Client ID	113A	**Client ID**	104D
Analyst ID	RC	**Analyst ID**	RC
Collection Apparatus	Air-O-Cell	**Collection Apparatus**	Air-O-Cell
Sample Volume (L)	150	**Sample Volume (L)**	150
Analytical Sensitivity (sp/m³)	27	**Analytical Sensitivity (sp/m³)**	27
Sample Condition	Acceptable	**Sample Condition**	Acceptable

	Raw CT.	%	sp/m³	Raw CT.	%	sp/m³
Alternaria	1	0.4%	27	Present		< 27
Ascospores	23	10.3%	629	10	10.1%	274
Aureobasidium						
Basidiospores	90	40.2%	2,460	44	44.4%	1,200
Bipolaris/Drechslera/Helm.						
Boletus						
Botrytis						
Cercospora						
Chaetomium						
Cladosporium	31	13.8%	848	6	6.1%	164
Coprinus						
Curvularia	1	0.4%	27	Present		< 27
Epicoccum	Present		< 27	3	3.0%	82
Fusarium						
Ganoderma						
Nigrospora	Present		< 27			
Penicillium / Aspergillus	60	26.8%	1,640	22	22.2%	602
Pithomyces	Present		< 27			
Rusts						
Smuts/Periconia/Myxomycetes	1	0.4%	27	1	1.0%	27
Stachybotrys						
Stemphylium						
Trichoderma						
Torula						
Ulocladium						
Zygomycetes						
Other Colorless	17	7.6%	465	13	13.1%	356
Unknown	Present		< 27			
Hyphal Fragments*	1		27	Present		< 27
Totals Spore Concentration			6,130			2,710
Location						
Comments						

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Request Record #: 2640085 (MD)
Released by National Guard Bureau
Page 2507 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiaap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
Attention:	Non-Responsive [redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/9/2008

AMA Sample #	0882231
Client ID	206C
Analyst ID	RC
Collection Apparatus	Air-O-Cell
Sample Volume (L)	150
Analytical Sensitivity (sp/m³)	27
Sample Condition	Acceptable

	Raw CT.	%	sp/m³
Alternaria			
Ascospores	1	8.3%	27
Aureobasidium			
Basidiospores	2	16.7%	55
Bipolaris/Drechslera/Helm.			
Boletus			
Botrytis			
Cercospora			
Chaetomium			
Cladosporium	1	8.3%	27
Coprinus			
Curvularia			
Epicoccum			
Fusarium			
Ganoderma			
Nigrospora			
Penicillium / Aspergillus	8	66.7%	219
Pithomyces			
Rusts			
Smuts/Periconia/Myxomycetes			
Stachybotrys			
Stemphylium			
Trichoderma			
Torula			
Ulocladium			
Zygomycetes			
Other Colorless			
Unknown			
Hyphal Fragments*	1		27
Totals Spore Concentration			328

Location

Comments

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Report Released by National Guard Bureau
Page 2508 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #494 Edgewood, Maryland	**Chain Of Custody:**	181402
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
Attention:	Non-Responsive [redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/9/2008

General Comments, Disclaimers, and Footnotes

Analytical Method: Sample are analyzed following the instructions and guidelines outlined in AMA Analytical Services, Inc. SOP 901.

Sample Condition: Acceptable: The sample was collected and delivered to the our location without disturbing the material on the sampling media.

Unacceptable: 1. The sample is overloaded with material. 2. The sample trace has been disturbed. 3. The sample was not collected properly.

Obscured: The loading on the sample is high, possibly obscuring spores present. The quantity reported should be considered the minimum concentration present. The actual concentration may be higher than the reported concentration.

Spore Notes: Based on their small size and very few distinguishing characteristics, Aspergillus and Penicillium cannot be differentiated by non-viable sampling methods. There are other types of spores whose morphology is similar to Aspergillus and Penicillium and cannot be differentiated by non-viable sampling methods. Examples of these similar spores are Acremonium, Paecilomyces, Wallemia, and Trichoderma.

Smut, Periconia and Myxomycetes are three different types of organisms that have similar morphological characteristics.

Bipolaris/Dreschlera/Helm: Bipolaris / Dreschlera / Helminthosporium group.

Other Colorless represents all colorless spores that are non-distinctive and unidentifiable.

* Hyphal Fragments: A portion of the mycelium that becomes separated from the remainder of the thallus (vegetative body), each of which has the capacity to grow and form new individuals. Results for hyphal fragments are in fragments/m³ and are not incorporated in the total spore concentration.

Quantification: Analytical Sensitivity (A.S.): This is dependent on the volume of air collected and the amount of the trace that was analyzed.

The value of "Present" indicated in the Raw Count column represents the presence of this spore type during the preliminary exam at 400x. The Raw Count converts to a whole number if the spore type is encountered again during the 1,000x enumeration. The sp/m³concentration will be reported as less than the analytical sensitivity if "Present" is reported in the Raw Count.

Due to rounding, totals may not equal 100%

sp/m³: Spores per cubic meter.

Results are reported to 3 significant figures.

Rolenda Chuyate

Analyst Rolenda Chuyate

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 340-0961 · Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #2413-0085 (MD)
Released by National Guard Bureau
Page 2509 of 5269

EI Edgewood, MD

SAMPLE CHAIN OF CUSTODY

DATE SHIPPED	# OF SAMPLES	SAMPLE MEDIA TYPE	PROJECT NAME
	15		#181402 AMA

CONTACT	TELEPHONE NUMBER
Non-Responsive [redacted]	336 455 2558

SAMPLE # OR AREA	SAMPLE DATE	SAMPLE VOLUME	ANALYSIS REQUESTED
NGA-01-A	8/21/08	920L	Lead: Air
NGA-02-A		916L	
NGA-03-A		0	
OR		150L	Fungal Spore: Air
OF			
1134			
1041			
206L			
NGA-01-W		100cm²	Lead: Surface wipe
NGA-02-W			
NGA-03-W			
NGA-04-W			
NGA-05-W			
NGA-06-W			
NGA-07-W		Blank	

Samples Relinquished By:	Signature	Date 8/22/08
Samples Received By:	Signature	Date
Samples Analyzed By:	Signature	Date

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) 181402

Mailing/Billing Information:
1. Client Name: National Guard Bureau NE
2. Address 1: 301 -1H Old Bay Lane
3. Address 2: Havre de Grace, MD 21078
4. Address 3:
5. Phone #: 336 455 2558 Fax #: 704 593 1650

Submittal Information:
1. Job Name: RC #494 Edgewood, Maryland
2. Job Location:
3. Job #: P.O. #:
4. Contact Person: [redacted] @ phone # 336 455 2558
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS		REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ Next Day ☐ 2 Day	☐ 3 Day ☒ 5 Day + Date Due: 9/11/08	☐ Include COC/Field Data Sheets with Report ☒ Email [redacted] @ ei1.com
☐ 24 Hours Time Due:			☐ Fax:
Comments:		☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Lead Analysis
☐ Paint Chip ____ (QTY)
☒ Dust Wipe (wipe type ____) 7 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Collection Apparatus for Spore Traps: ____
☒ Spore-Trap 5 (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	MATRIX: AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
	See Attached															

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 9 / 4 / 08 @ 800 Via: UPS By (Print): M. Sampson Sign: [signature]
2. Date/Time Analyzed: 9 / 9 / 08 @ ____ By (Print): Rolenda Chuyate Sign: Rolenda Chuyate
3. Results Reported To: Vince Maisto Via: Email Date: 9 / 9 / 08 Time: ____ Initials: ____
4. Comments:

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2511 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Survey

National Guard Facility
Edgewood Armory
Building E4305
Aberdeen Proving Grounds, MD 21010

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Edgewood Armory** **Building E4305** **Aberdeen Proving Grounds, MD**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**July 30, 2010**
Report Date:	**August 13, 2010**
ALSI Project #:	**1007487**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

3544 North Progress Avenue ✦ Suite 100 ✦ Harrisburg, PA 17110
TEL: 717-540-3424 ✦ FAX: 717-540-3428

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Limitations 13

Appendix A. Laboratory Analysis Report 14

Appendix B. Photographs 15

Appendix C. Floor Plan 16

Appendix D. References 17

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2513 of 5269

BEST AVAILABLE COPY

Section 1.0
Executive Summary

BEST AVAILABLE COPY

Section 1.0 Executive Summary

On July 30, 2010, Analytical Laboratory Services, Inc. (ALSI) personnel Non-Responsive Non-Responsive conducted an industrial hygiene survey at the Edgewood Armory located at Building E4305, Aberdeen Proving Grounds, MD 21010. This facility is also known as the Major General Warren D. Hodges Armory.

1. Surface levels of lead exceeded 200 ug/ft^2 in the attached garage on the floor by the TIG welder. Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2.

2. Lighting levels met the minimum recommended guidelines in all but the following areas: 1) Room 110, 2) Room 115B, 3) Fitness – Room 131A, 4) Room 141A, 5) Room 142A, 6) Room 201A. Lighting should be improved in these areas.

3. Indoor air quality parameters of temperature, relative humidity carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment. Relative humidity exceeded the recommended ceiling of 60% and temperature exceeded the recommended criteria of 79 degrees F in one indoor location. There is a central air conditioning system in this building. Outdoor conditions were hot and humid. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation. For comfort, temperature levels should be maintained between 73-79 degrees F. Carbon dioxide and carbon monoxide levels were within parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE).

4. Overhead vehicle exhaust and battery room exhaust ventilation should be repaired or modified to provide the minimum recommended ventilation rate.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2515 of 5269

BEST AVAILABLE COPY

Section 2.0
Operation Description & Observations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Edgewood Armory consists of offices, a drill hall, garage, and storage areas. There are approximately 50 full-time employees stationed at the facility. On drill weekends there can be many more occupants.

The building was initially constructed in 1970's. The exterior of the building is brick. The interior walls are primarily concrete block, and drywall. The heating, ventilating, and air conditioning system (HVAC) consists of five air handlers. Three are new and two are currently being refurbished. The floors were composed of a poured concrete slab. Some office areas are carpeted. The ceilings were generally composed of a roof deck and in some areas were finished with a suspended drop ceiling system.

There is an old firing range in the building. It was closed in the 1970's and has been fully abated. It is used as a weight and exercise room.

Site personnel at the time of the site assessment consisted of administrative and maintenance personnel. On site duties were normal or typical.

Overall housekeeping was good. Areas were clean and well kept. Paint was in good condition throughout the facility

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs. Some lap top computers were in use.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2517 of 5269

BEST AVAILABLE COPY

Section 3.0
Noise Survey

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels. Therefore, noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2519 of 5269

BEST AVAILABLE COPY

Section 4.0
Lead Testing

BEST AVAILABLE COPY

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. The facility contains an area which was once an indoor firing range. It has been abated and is now a storage area. There is no child care facility.

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m³	Surface ug/ft²	Paint Chip %Pb
1	Drill Hall - Room 101A	<4.3		
2	Room 203C	<4.9		
3	Blank	<3 ug		
4	**Attached Garage – Floor by TIG Welder**		**370**	
5	Attached Garage – Office Area Desk		<110	
6	Drill Hall – Heater on Wall		<110	
7	Drill Hall – Floor		<110	
8	Drill Hall – Top of Table		<110	
9	Converted Firing Range Room 131A – Floor		<110	
10	Converted Firing Range Room 131A – Front of TV		<110	
11	Floor Outside Converted Firing Range Room 131A		<110	
12	Room 141A – Top of TV		<110	
13	Room 104D – Top of Microwave		<110	
14	Main Lobby – Floor		<110	
15	Room 105A – Supply Vent		<110	
16	Room 105A – Top of Cabinet		<110	
17	Room 110A – Top of Desk		<110	
18	Room 109A – Top of Desk Shelf		<110	
19	Floor Outside Room 113A		<110	
20	Room 115B – Bookshelf		<110	
21	Room 206C – Supply Vent		<110	
22	Room 206E – Top of Desk		<110	
23	Room 201F – Top of Desk Shelf		<110	
24	Room 204A – Window Sill		<110	

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2521 of 5269

Sample #	Location	Air ug/m^3	Surface ug/ft^2	Paint Chip %Pb
25	Floor Outside Room 203C		<110	
26	Room 201P Baseboard Heater		<110	
27	Blank		<12 ug	
Criteria		**50**	**200**	**0.5**

Key: **Bolded** results exceed listed criteria

The surface level of lead exceeded 200 ug/ft^2 in the attached garage on the floor by the TIG welder.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for Environmental Chemicals," the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3. In fact, no detectable level of lead was identified in the air samples collected.

Housekeeping and cleaning activities should be improved to maintain surface lead dust concentrations below 200 ug/ft^2.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2522 of 5269

BEST AVAILABLE COPY

Section 5.0
Lighting

BEST AVAILABLE COPY

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Drill Hall -- Room 101A	14.6	30-50	No
Room 105A	48.9	30-50	Yes
Room 110	**15.3**	30-50	No
Room 110D	41.3	30-50	Yes
Room 111A	34.7	30-50	Yes
Room 113A	66.2	30-50	Yes
Room 115B	**27.2**	30-50	No
Fitness Room 131A	**21.5**	30	No
Room 141A	**19.2**	30-50	No
Room 142A	**13.2**	30-50	No
Room 104D	61.3	30-50	Yes
Room 206C	49.3	30-50	Yes
Room 201A	**29.3**	30-50	No
Room 201F	48.6	30-50	Yes
Room 201L	45.5	30-50	Yes
Room 204A	33.2	30-50	Yes
Room 203C	38.2	30-50	Yes

Lighting levels met the minimum recommended guidelines in all but the following areas: 1) Room 110, 2) Room 115B, 3) Fitness - Room 131A, 4) Room 141A, 5) Room 142A, 6) Room 201A. Lighting should be improved in these areas.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2524 of 5269

BEST AVAILABLE COPY

Section 6.0
Indoor Air Quality

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The IAQ Meter was last calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 68.6 to 82.6 degrees F with relative humidity readings ranging from 43.2% to 61.7%. During the survey, carbon dioxide (CO_2) levels ranged from 437 ppm to 680 ppm within the facility compared to an outdoor CO_2 level of 389 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,089 ppm (389 ppm + 700 ppm). The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	81.8	42.7	376	0.0
Drill Hall Room 101A	**82.6**	43.2	437	0.1
Room 105A	70.9	50.3	592	0.0
Room 110	69.7	52.8	574	0.0
Room 110D	68.6	54.4	570	0.0
Room 111A	68.8	56.1	571	0.0
Room 113A	69.3	55.9	623	0.0
Room 115B	68.3	55.6	563	0.0
Fitness Room 131A	73.2	**61.7**	604	0.0
Room 141A	76.1	52.3	601	0.0
Room 142A	75.4	51.0	597	0.0
Room 104D	73.6	50.3	606	0.1
Room 206C	72.4	51.4	652	0.0
Room 201A	71.9	52.3	680	0.0
Room 201F	72.1	53.3	669	0.0
Room 201L	70.3	53.3	647	0.0
Room 204A	70.6	55.5	661	0.0

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2526 of 5269

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Room 203C	70.6	54.6	621	0.0
Outdoors	85.9	41.1	401	0.0
Criteria	**73.0-79.0**	**30-60**	**<1,089**	**<9.0**

Key: **Bolded** results exceed listed criteria

Indoor air quality parameters of temperature, relative humidity carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment. Relative humidity exceeded the recommended ceiling of 60% and temperature exceeded the recommended criteria of 79 degrees F in one indoor location. There is a central air conditioning system in this building. Outdoor conditions were hot and humid. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation. For comfort, temperature levels should be maintained between 73-79 degrees F. Carbon dioxide and carbon monoxide levels were within parameters established by EPA and ASHRAE.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The following items were noted by ALSI personnel on site:

1. The HVAC system is currently being refurbished. There are a total of five air-handlers. Three air-handlers are new. Two air-handlers are being refurbished.

2. No notable water damage or peeling paint was observed. No fungal growth was observed.

3. Many areas of the ceiling were missing ceiling tile due to HVAC renovation.

BEST AVAILABLE COPY

Section 7.0
Suspect Asbestos Containing Building Materials

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 7.0 Asbestos Containing Building Materials

Only one suspect asbestos containing material (ACM) was identified in the areas inspected. This was spray-on insulation on the metal structural beam in the hallway outside Room 141A. This material appeared to be in good condition. It could also be present in other areas of the building that were not inspected. Hidden or inaccessible areas were not inspected. ACM could be present in hidden areas. No samples were collected.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2529 of 5269

BEST AVAILABLE COPY

Section 8.0
Maintenance Bay

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is a garage area with four maintenance bays at this facility. Vehicle maintenance is performed in this area. There are five full time mechanics. On the day of the survey no noise hazardous operations were performed. Therefore, no noise monitoring was conducted. The area is posted with appropriate signage for noise, chemical, and other safety hazards. Garage areas were clean, well kept, and organized.

A Local Exhaust Ventilation (LEV) system is present to remove vehicle exhaust from the building. The LEV system contains four drops or exhausts. The LEV in each bay consists of a flex duct with an 8" duct diameter. The following flow rates were measured:

1. Bay 1 – 398 CFM
2. Bay 2 -- 446 CFM
3. Bay 3 – 442 CFM
4. Bay 4 – 460 CFM

The actual flow rate that is required in an overhead vehicle exhaust system varies depending on the engine tail pipe temperature, whether or not the vehicle is "under load" or idling, engine displacement, engine size, etc. We recommend the overhead vehicle exhaust system be inspected to determine if it is operating as designed and meets the minimum requirements as recommended by the American Conference of Governmental Industrial Hygienists (ACGIH) Industrial Ventilation: A Manual of Recommended Practice for Design (27th Edition).

There is a battery charging room in place at this facility. There is an exhaust fan in the roof of this area but staff personnel reported that the fan was currently out of operation. This exhaust fan should be repaired to provide the minimum recommended ventilation for battery charging operations.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2531 of 5269

BEST AVAILABLE COPY

Section 9.0
Limitations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2533 of 5269

BEST AVAILABLE COPY

Appendix A
Laboratory Analysis Report

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2535 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY

LAB #100470

NY ELAP 10920

Client:	National Guard Bureau	Job Name:	Edgewood Armory	Chain Of Custody:	508496
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	APG MD	Date Submitted:	8/5/2010
	Havre de Grace, Maryland 21078	Job Number:	Edgewood Armory	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	8/11/2010
Attention:	[redacted]			Report Date:	8/11/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1067613	1007487-1	Flame	Air	693	N/A	4.3	ug/m³	<3	<4.3	ug/m³	
1067614	1007487-2	Flame	Air	616	N/A	4.9	ug/m³	<3	<4.9	ug/m³	
1067615	1007487-3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1067616	1007487-4	Flame	Wipe	****	0.108	110	ug/ft²	40	370	ug/ft²	
1067617	1007487-5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067618	1007487-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067619	1007487-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067620	1007487-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067621	1007487-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067622	1007487-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067623	1007487-11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067624	1007487-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067625	1007487-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067626	1007487-14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067627	1007487-15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067628	1007487-16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067629	1007487-17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067630	1007487-18	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067631	1007487-19	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
LAB #100470
NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	Edgewood Armory	**Chain Of Custody:**	508496
Address:	304-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	APG MD	**Date Submitted:**	8/5/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Edgewood Armory-	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	8/11/2010 **Report Date:** 8/11/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1067632	1007487-20	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067633	1007487-21	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067634	1007487-22	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067635	1007487-23	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067636	1007487-24	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067637	1007487-25	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067638	1007487-26	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1067639	1007487-27	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2536 of 5269

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2537 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
EAR #100470
NY ELAP
10920

Client:	National Guard Bureau	Job Name:	Edgewood Armory	Chain Of Custody:	508496
Address:	301-H Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	Job Location:	APG MD	Date Submitted:	8/5/2010
	Havre de Grace, Maryland 21078	Job Number:	Edgewood Armory	Person Submitting:	[redacted]
		P.O. Number:	W912K6-09-A-0003	Date Analyzed:	8/11/2010 Report Date: 8/11/2010
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: N. McGarvey / L. Butruk Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

OW: (410) 247-2024 | 150282 | 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) **508496**

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SL State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Edgewood Armory
2. Job Location: APG, MD
3. Job #: Edgewood Armory P.O. #: W912K6-09-A-0003
4. Contact Pers[redacted] @[redacted]
5. Submitted by [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☒ 5 Day +	☒ Email: [redacted]@analyticallab.com
Comments: ____	☐ 2 Day Date Due: 8/12/10	☐ Fax: [redacted]@us.army.mil
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals: [redacted]@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Gravimetric Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM ___ (Qual) PLM ___ (Quant) PLM/TEM ___ (Qual) PLM/TEM ___ (Quant)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (prep/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (prep/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C).

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☒ Pb Dust Wipe (wipe type Ghost) 24 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	FUNGI	AIR	BULK	DUST	MATRIX: Water/Soil/Solid	MATRIX: Drinking Water	MATRIX: Tape	MATRIX: Swab	CLIENT CONTACT (LABORATORY STAFF ONLY)
1007487-1	Drill Hall Room	7/30	693					X		X							Date/Time: Contact: By:
1007487-2	Rm 203C		1110					X		X							
1007487-3	Blank		0					X		X							
1007487-4	Attached Garage-Fl			100cm²				X				X					
1007487-5	Attached Garage-Desk							X				X					Date/Time: Contact: By:
1007487-6	Drill Hall-Heater							X				X					
1007487-7	Drill Hall-Fl							X				X					
1007487-8	Drill Hall-Table							X				X					
1007487-9	Rm 13A-Fl							X				X					Date/Time: Contact: By:
1007487-10	Rm 13A-TV							X				X					
1007487-11	Fl Outside Rm 13A							X				X					
1007487-12	Rm 13A-TV							X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 8 / 5 / 10 @ 915 Via: UPS By (Print): Nicole Maxwell Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2538 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2539 of 5269

OWI (410) 847-2024 159202 210 REV. 6/08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-H Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Edgewood Armory
2. Job Location:
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person [redacted] @ phone # (410) 942-0273
5. Submitted by: [redacted] Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ 3 Day ☐ Next Day ☐ 5 Day ☐ 2 Day Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: [redacted] @us.army.mil ☐ Fax: ☐ Verbal: [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate (QTY)
☐ EPA Point Count (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)
TEM Dust
☐ Qual. (pre/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D5755-95 (QTY)
☐ Quan. (s/area)Dust D6480-99 (QTY)
TEM Water
☐ Qual. (pre/abs) (QTY)
☐ ELAP 198.1/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
☐ Pb Paint Chip (QTY)
☐ Pb Dust Wipe (wipe type) (QTY)
☐ Pb Air (QTY)
☐ Pb Soil/Solid (QTY)
☐ Pb TCLP (QTY)
☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Pb Furnace (Media) (QTY)
Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
☐ Spore-Trap (QTY) ☐ Surface Vacuum Dust (QTY)
☐ Surface Swab (QTY) ☐ Culturable ID Genus (Media) (QTY)
☐ Surface Tape (QTY) ☐ Culturable ID Species (Media) (QTY)
☐ Other (Specify) (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WIPE	SOIL	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY): Date/Time: Contact: By:
1007487-13	Rm 104D-Microwave	7/30		100cm²				X				X					
1007487-14	Main Lobby-F1							X				X					
1007487-15	Rm 105A Supply							X				X					
1007487-16	Rm 105A Cabinet							X				X					
1007487-17	Rm 110A Desk							X				X					Date/Time: Contact: By:
1007487-18	Rm 109A Desk Shelf							X				X					
1007487-19	F1 Outside Rm 112A							X				X					
1007487-20	Rm 115B Bookshelf							X				X					
1007487-21	Rm 300C Supply							X				X					Date/Time: Contact: By:
1007487-22	Rm 306E Desk							X				X					
1007487-23	Rm 306F Desk Shelf							X				X					
1007487-24	Rm 204A Win. Sill							X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2540 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

0/98 (410) 247-8024 159202 210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0264

Submittal Information:

1. Job Name: Edgewood Armory
2. Job Location:
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Perso[redacted] @ phone # (410) 942-0273
5. Submitted by: Signature:

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☑ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☐ 5 Day +	☑ Email: [redacted]@us.army.mil
Comments:	☐ 2 Day Date Due:	☐ Fax:
	☐ Results Required By Noon (EveryAttempt Will Be Made to Accommodate)	☐ Verba[redacted]@us.army.mil

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 (QTY)
- ☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA (QTY)
- ☐ NIOSH 7402 (QTY)
- ☐ Other (specify) (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate (QTY)
- ☐ EPA Point Count (QTY)
- ☐ NY State Friable 198.1 (QTY)
- ☐ Grav. Reduction ELAP 198.6 (QTY)
- ☐ Other (specify) (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield (QTY)
- ☐ NY State PLM/TEM (QTY)
- ☐ Residual Ash (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 (QTY)
- ☐ Quan. (v/area) Dust D6480-99 (QTY)

TEM Water
- ☐ Qual. (pres/abs) (QTY)
- ☐ ELAP 198.2/EPA 100.2 (QTY)
- ☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
- ☐ Pb Paint Chip (QTY)
- ☐ Pb Dust Wipe (wipe type) (QTY)
- ☐ Pb Air (QTY)
- ☐ Pb Soil/Solid (QTY)
- ☐ Pb TCLP (QTY)
- ☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Pb Furnace (Media) (QTY)

Fungal Analysis

Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ☐ Spore-Trap (QTY)
- ☐ Surface Swab (QTY)
- ☐ Surface Tape (QTY)
- ☐ Other (Specify) (QTY)
- ☐ Surface Vacuum Dust (QTY)
- ☐ Culturable ID Genus (Media) (QTY)
- ☐ Culturable ID Species (Media) (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WIPE AND SOIL	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1007487-25	F1 Outside Entrance	7/30		100cm²				X				X					Date/Time: Contact: By:
1007487-26	Ramp Shutter	↓		100cm²				X				X					
1007487-27	Blank	↓		0				X				X					
																	Date/Time: Contact: By:
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY):

1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B
Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

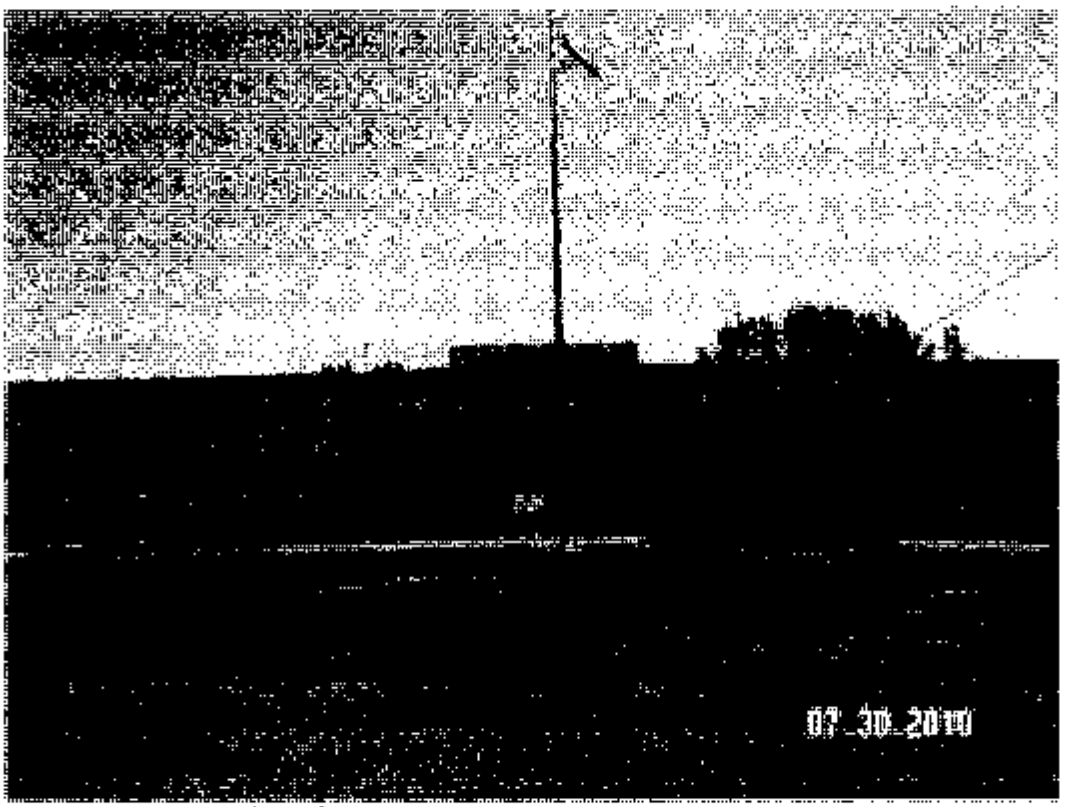

Photo 1: Exterior view, front.

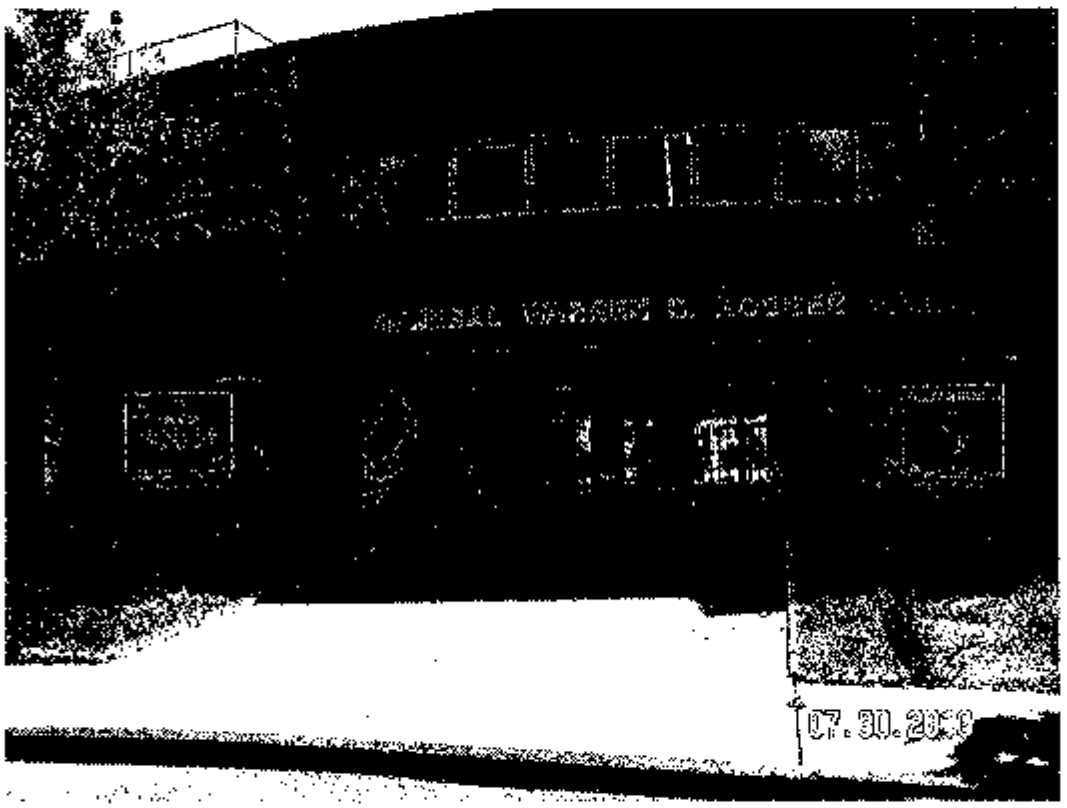

Photo 2: Exterior view, front.

Photo 3: Attached garage; vehicle maintenance.

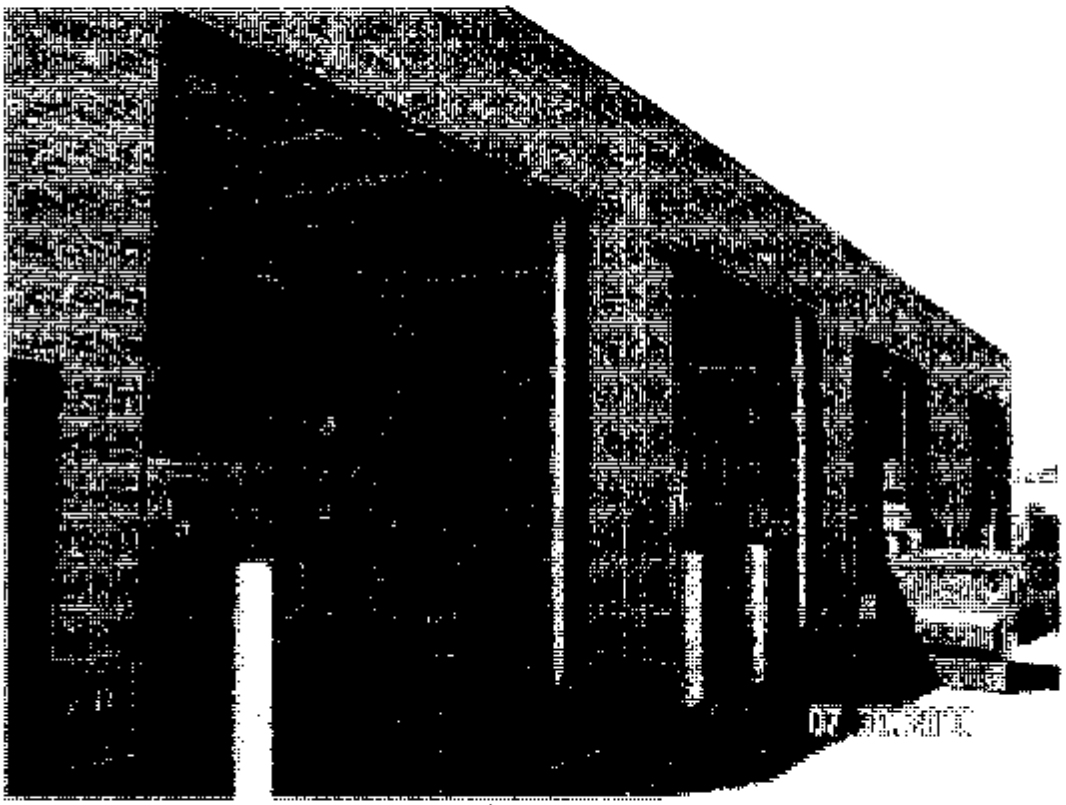

Photo 4: Attached garage; vehicle maintenance.

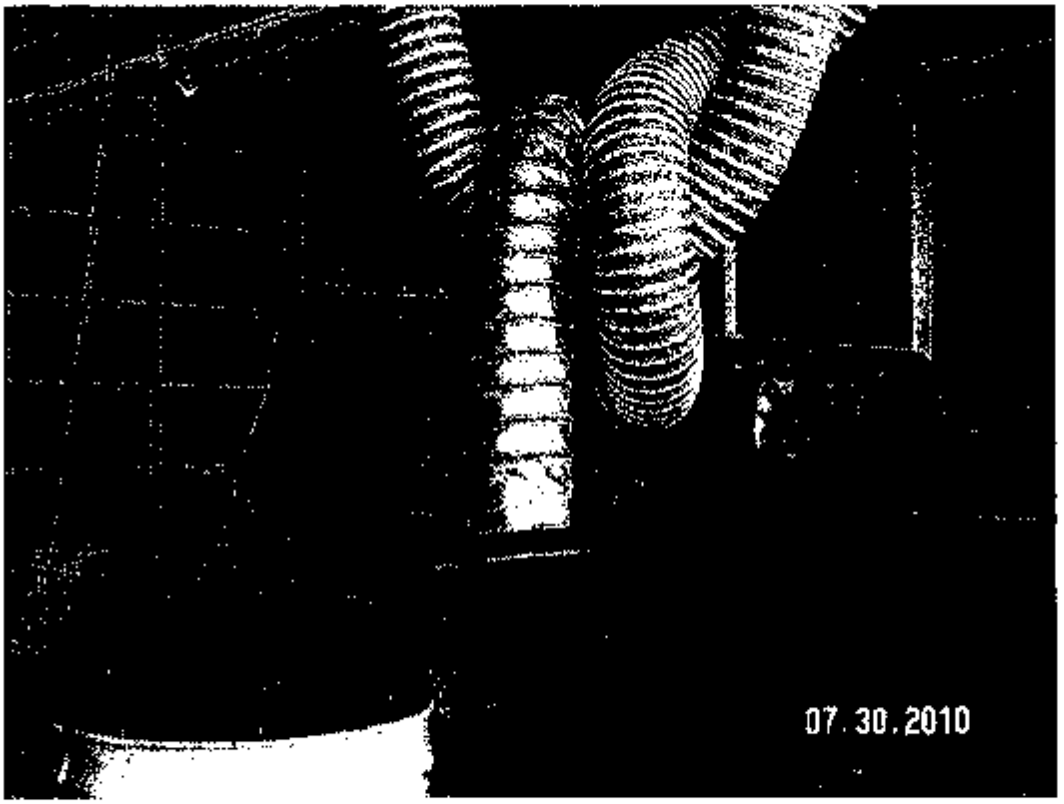

Photo 5: Exhaust ductwork in attached garage.

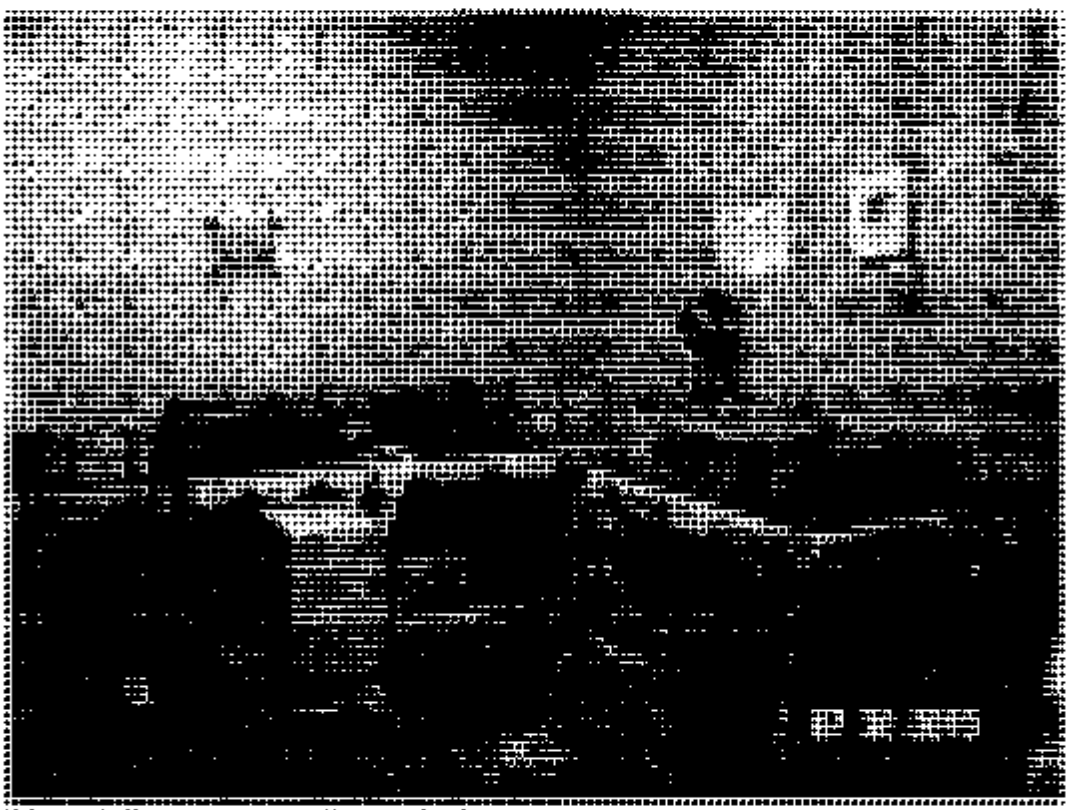

Photo 6: Battery storage/unattached garage.

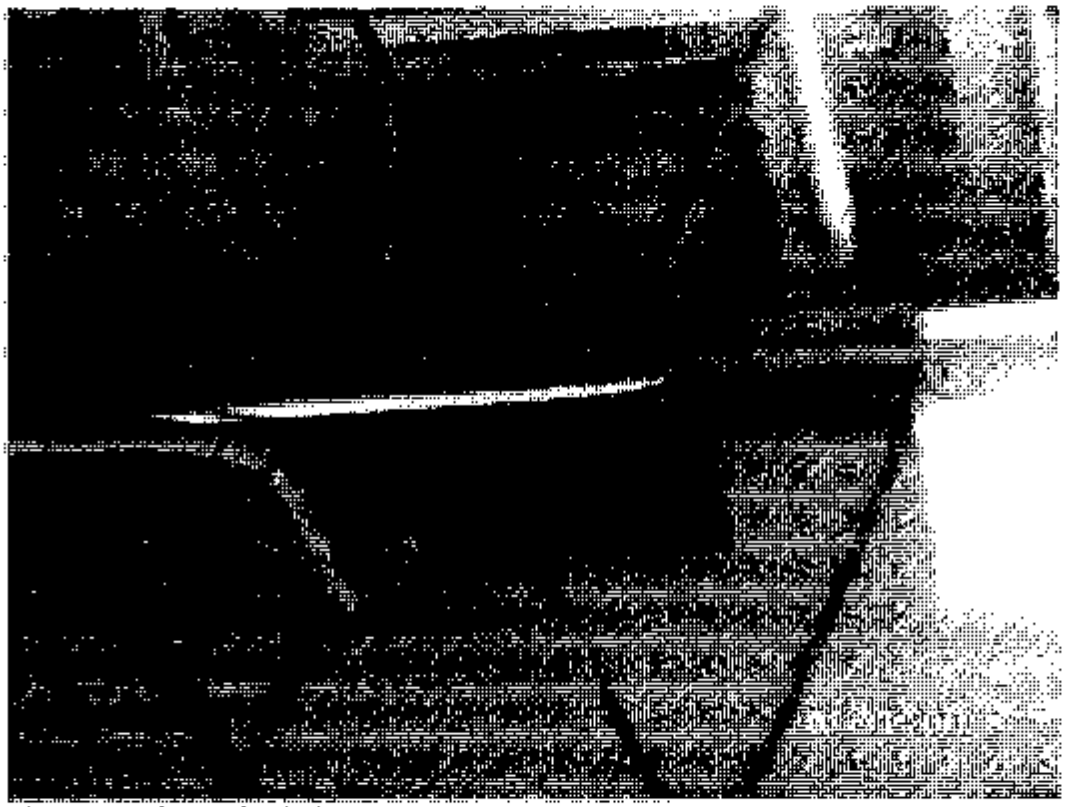

Photo 7: Exhaust fan in battery storage area.

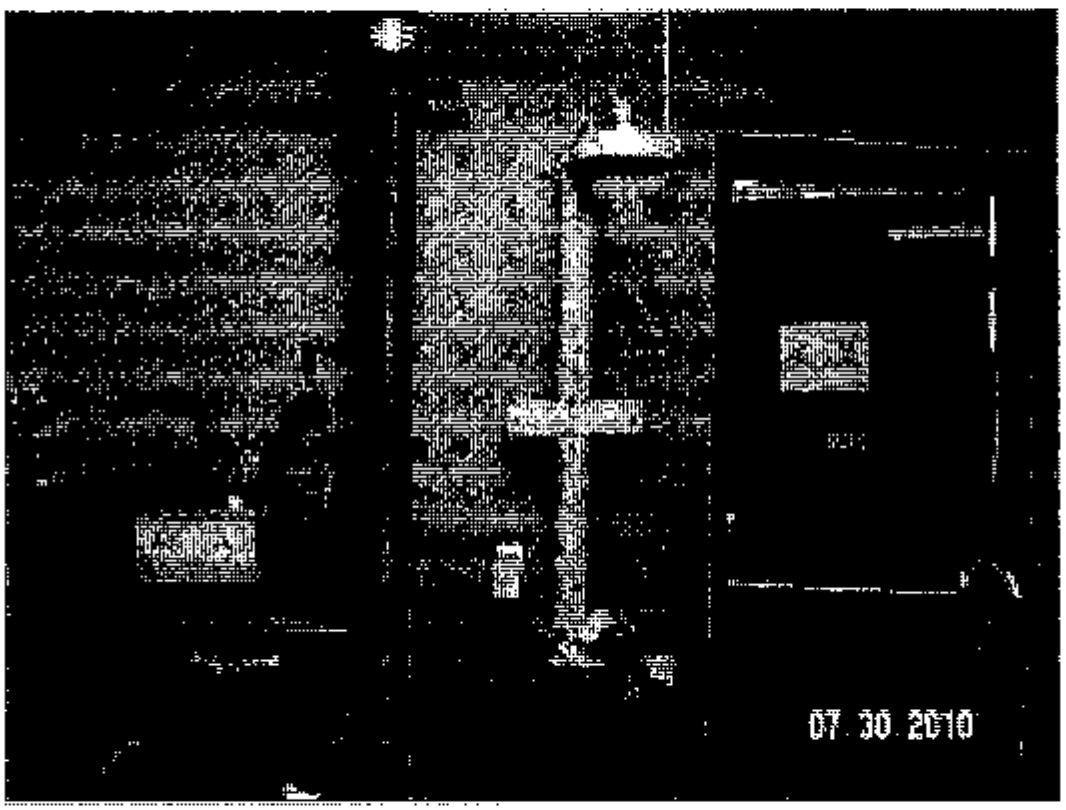

Photo 8: Emergency eye wash and shower in battery storage area.

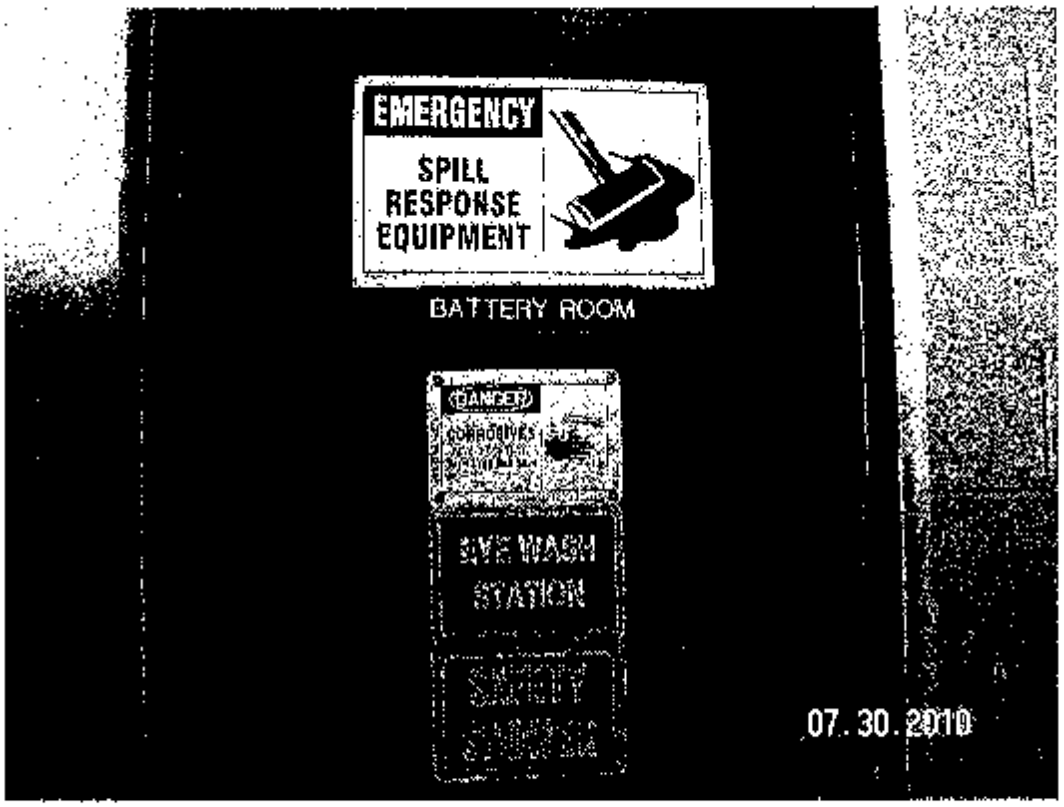

Photo 9: Battery room door.

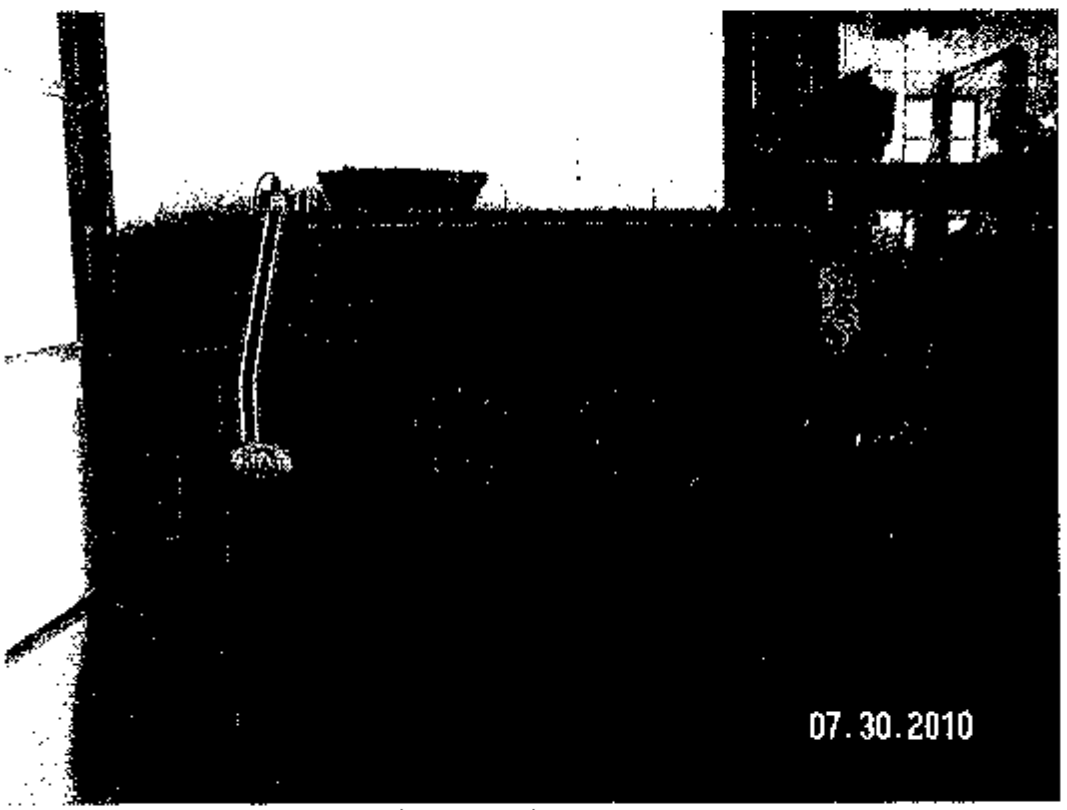

Photo 10: Dry Blast Machine, in attached garage.

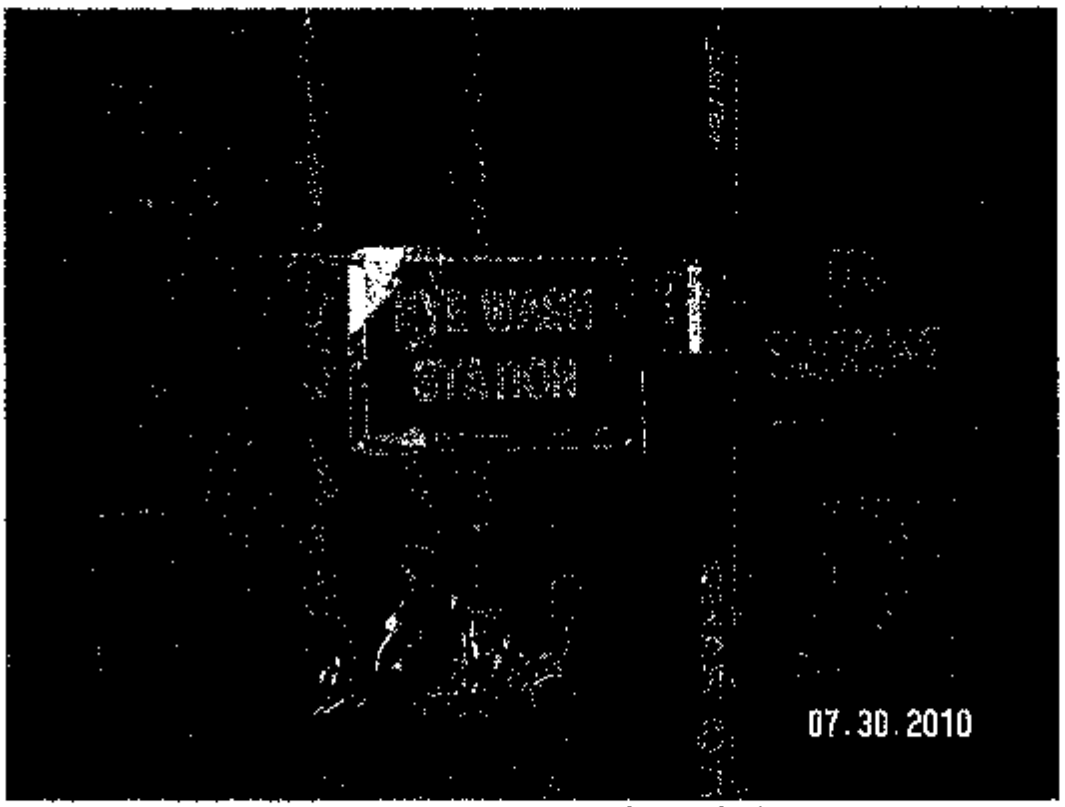

Photo 11: Eye wash station in maintenance bay, in attached garage.

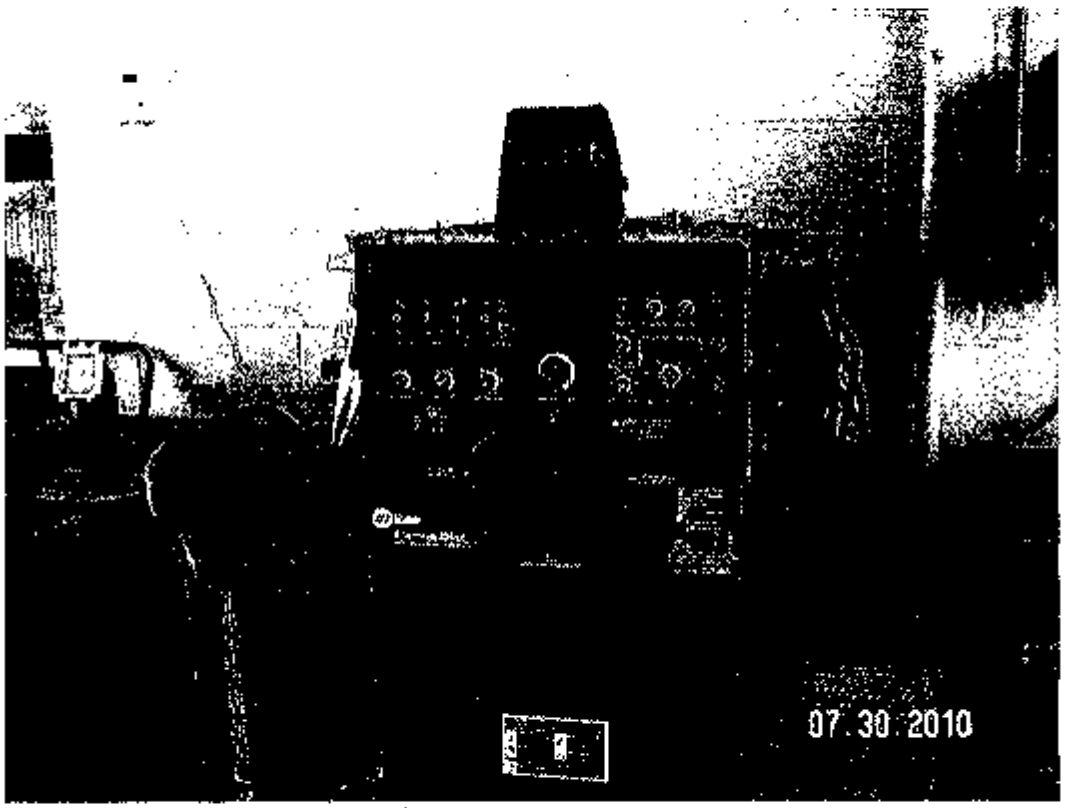

Photo 12: TIG Welder, in attached garage.

Photo 13: MKF Pedestal, no attached gauges

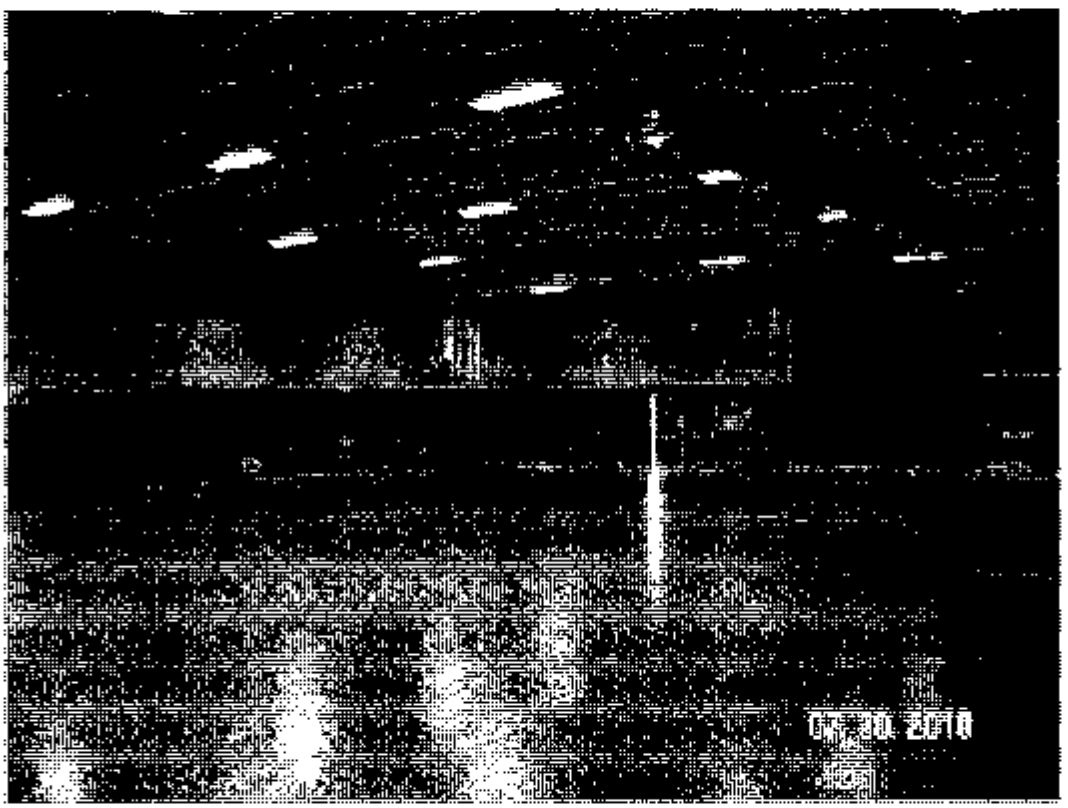

Photo 14: Drill Hall.

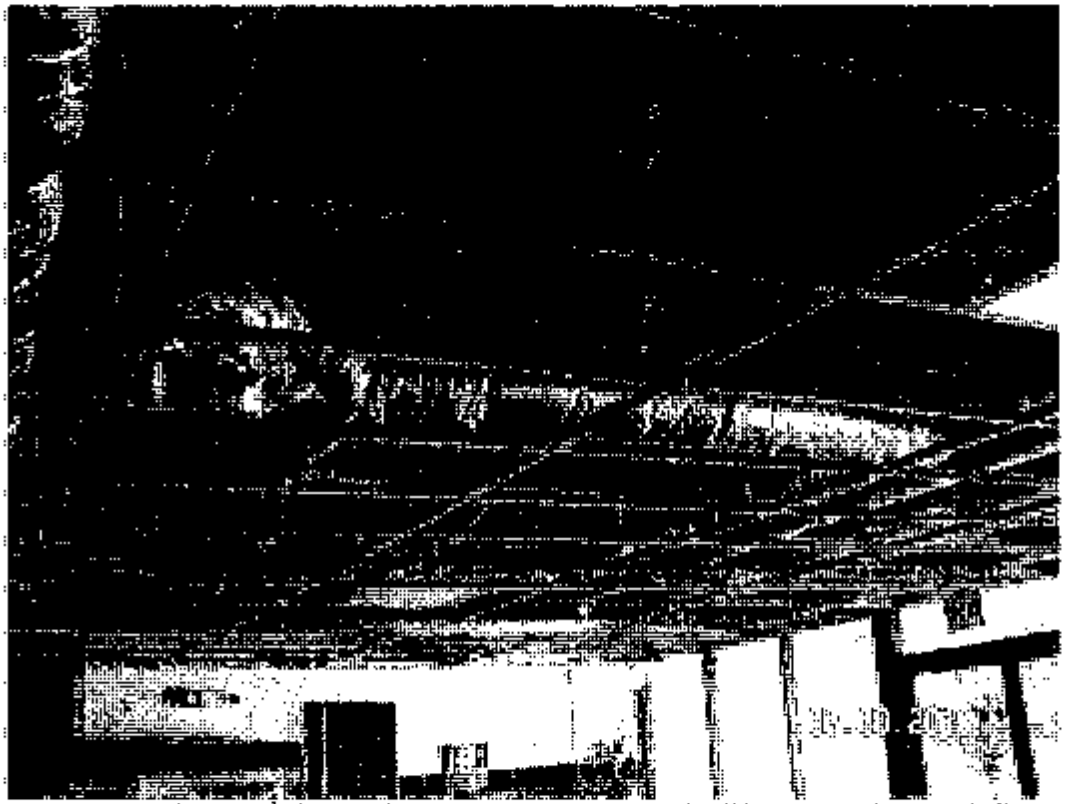

Photo 15: Ceiling, 1st floor hallway; representative of ceiling throughout building.

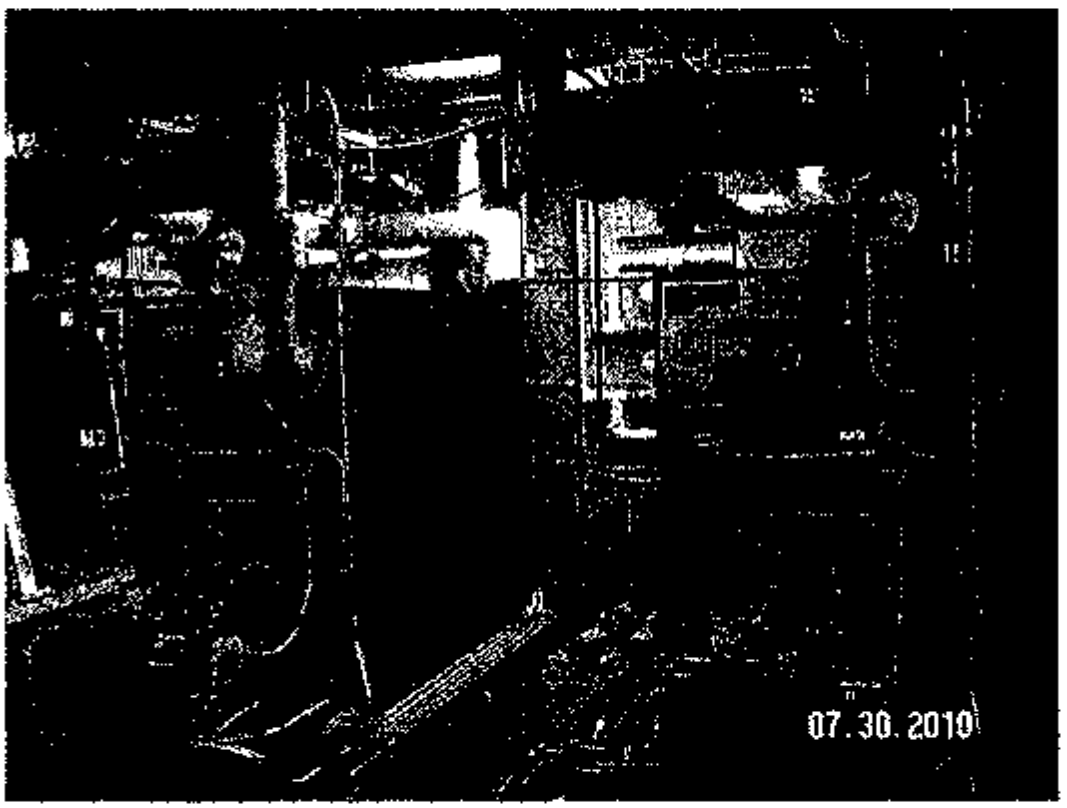

Photo 16: Boilers.

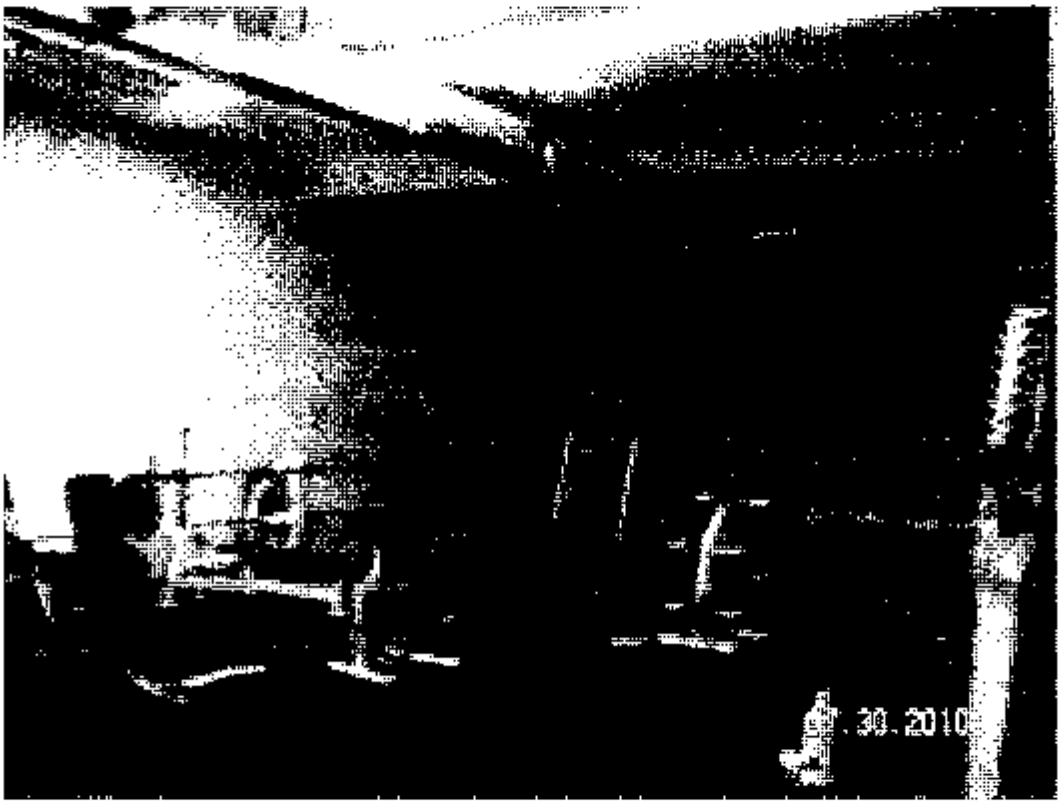

Photo 17: Converted Kitchenette.

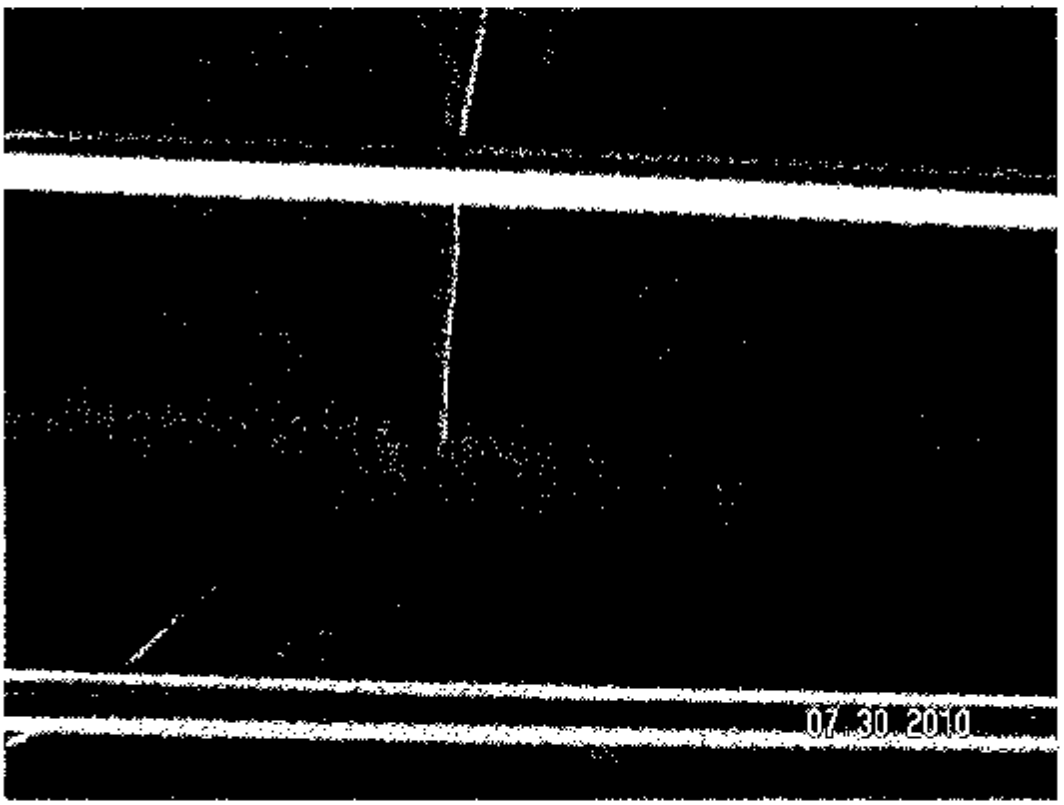

Photo 18: Hallway outside room 141A, spray-on insulation on metal beam, possible ACM.

BEST AVAILABLE COPY

Appendix C
Floor Plans

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

1st Floor

EMERGENCY EVACUATION PLAN

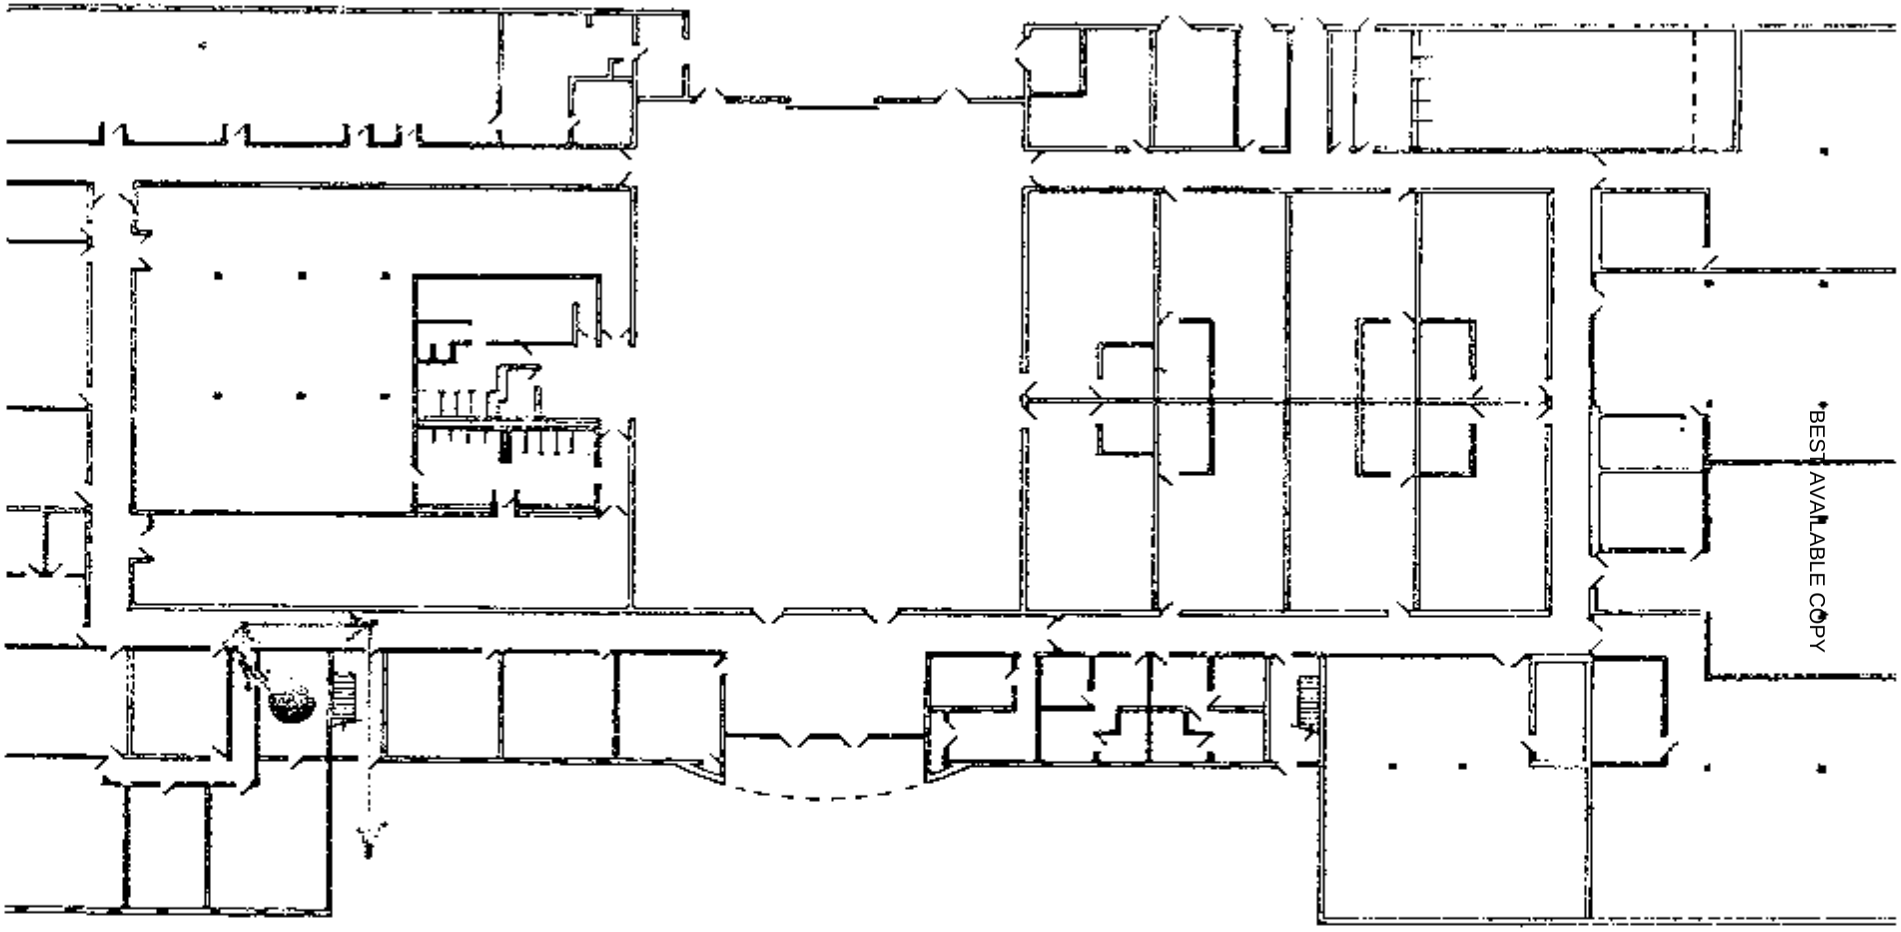

YOU ARE HERE

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2553 of 5269

BEST AVAILABLE COPY

3rd Floor

EMERGENCY EVACUATION PLAN

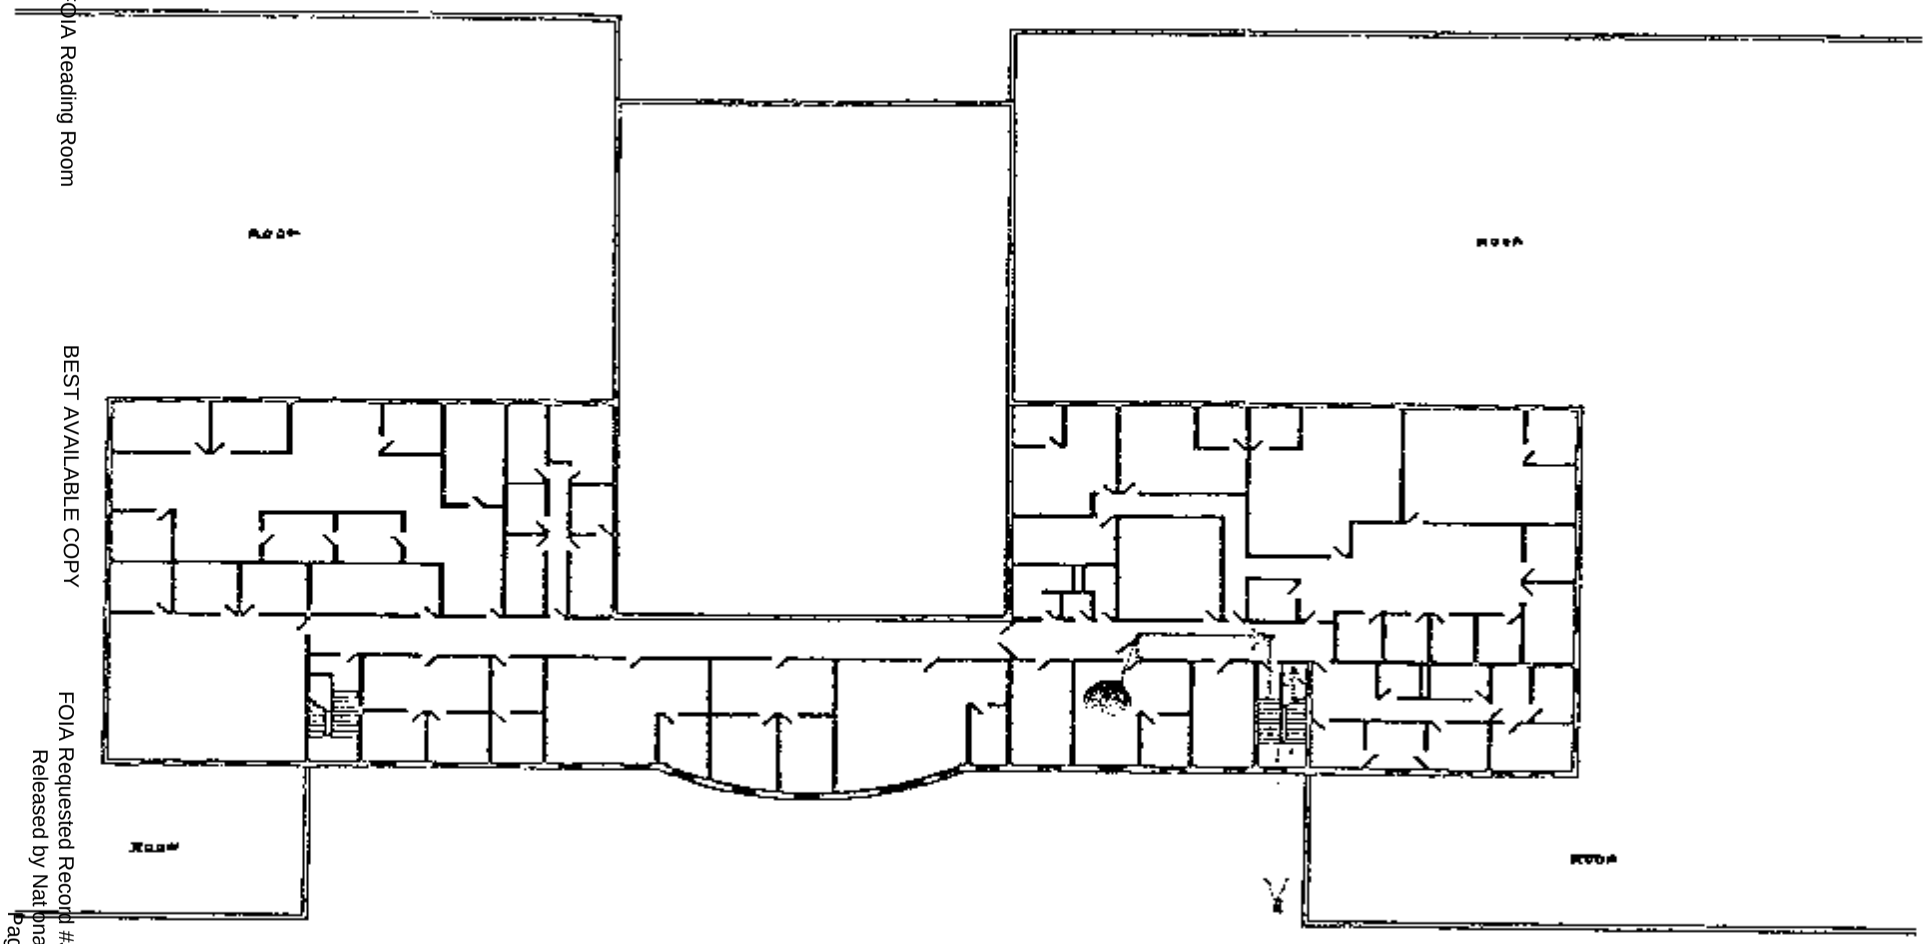

YOU ARE HERE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FMS-5

FIRE EVACUATION PLAN

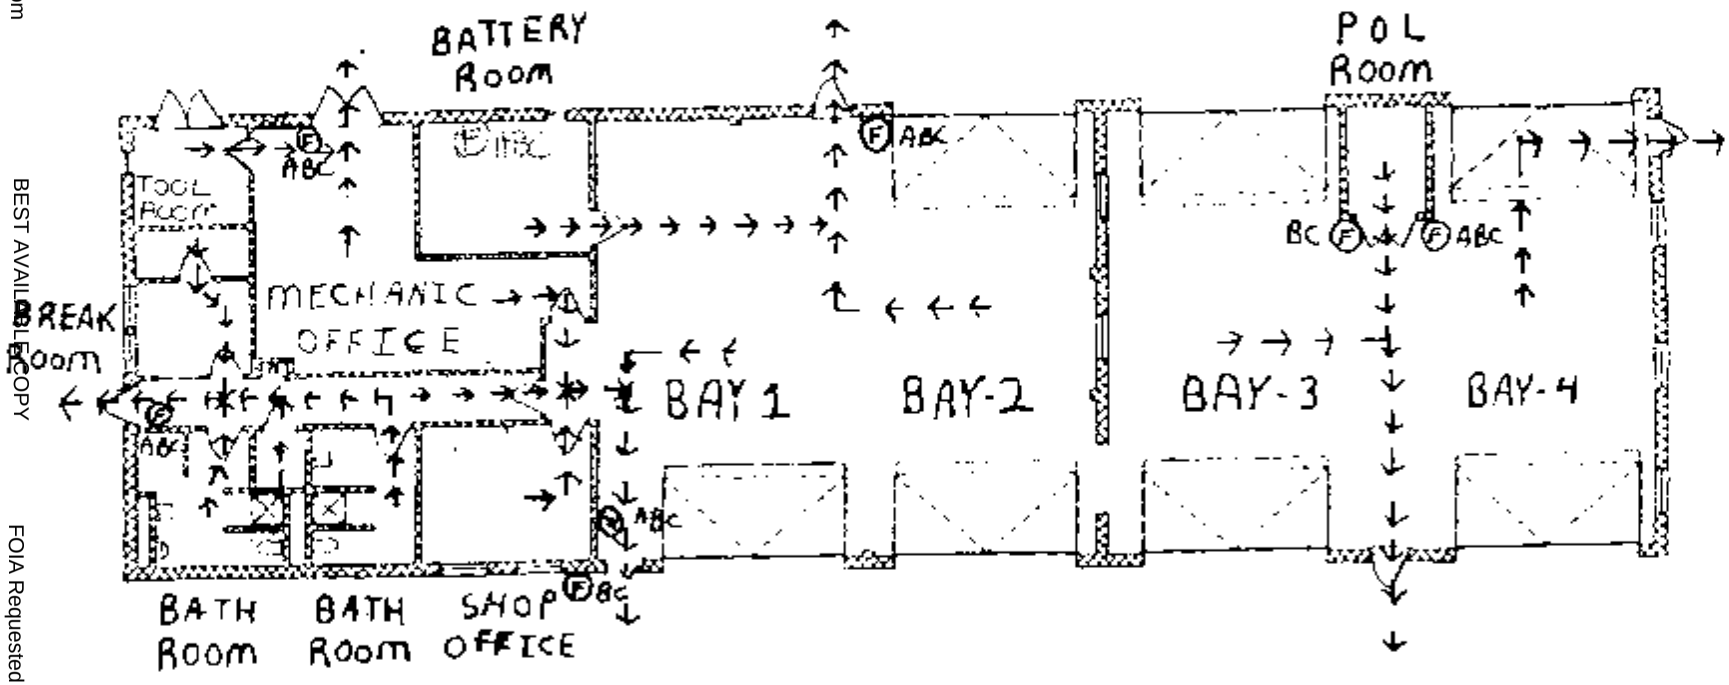

EXIT ROUTE - →→

FIRE EXTINGUISHER - Ⓕ

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2554 of 5269

BEST AVAILABLE COPY

Appendix D
References

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. American Conference of Governmental Industrial Hygienists (ACGIH), Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) - The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

9. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

10. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2556 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Edgewood Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Edgewood Readiness Center** **Bldg E4305, APG-EA** **Edgewood, MD 21010**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**May 28, 2013**
Report Date:	**June 26, 2013**

[redacted]

Manager, Industrial Hygiene Services

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on May 28, 2013, at the Edgewood Readiness Center located at Building E4305, APG-EA Edgewood, MD 21010. The survey was performed by Mr.Non-Responsive, CIH.

1. Surface and air samples for lead were collected. Surface samples were less than the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended guideline. Air samples were less than the Occupational Safety and Health Administration (OSHA) Action Level for lead. See Section 3.0 for detailed findings.

2. Lighting did not meet the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in the 1st floor supply cage areas, fitness center and Classroom 115 Distance Learning Center. Lighting should be improved in these areas. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide, and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels were within the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F.

    b. Relative humidity levels did not exceed the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60%.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 parts per million (ppm).

    d. Carbon dioxide (CO_2) levels were less than the ASHRAE 62.1-2010 recommended ceiling for mechanically ventilated office buildings and commercial settings.

    See Section 5.0 for detailed findings.

4. A small area of fungal growth was observed in the Men's Restroom next to the Assembly Hall. A few roof leaks are present in the building. See Section 5.0 for detailed findings.

5. The building was built in 1989 so no suspect asbestos containing material (ACM) is believed to be present. See Section 6.0 for detailed findings.

Section 2.0 Operation Description & Observations

The Edgewood Readiness Center is mainly an administrative facility with an assembly hall, offices, supply areas, conference rooms and classrooms. There were approximately 60 full-time employees stationed at this facility at the time of this survey.

The building was built in 1989. It is a two-story structure with brick exterior. The interior walls are concrete block and drywall. The floors are concrete, floor tile and carpet.

The Heating, Ventilation, and Air-Conditioning (HVAC) system consists of a forced air, ducted system with roof-top units. This system was on during the survey.

Due to the age of the building there no lead-based paint issues are believed to be present other than those potentially related to the past presence of an indoor firing range. The indoor firing range was previously located on the 1st floor in Rooms 131A and 131B. These rooms are now used for a Fitness Center (131A) and Supply Storage (131B). All of the firing range components have been removed.

There is no child-care facility in the building.

Overall housekeeping practices were good.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 micrometer (um) mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Fitness Room 131A (old firing range)	<8.1	*
2	Hallway Outside 140A	<8.2	*
3	Blank	<3 ug	*
4	Hallway Outside 131B (old firing range)	*	<110
5	Room 131B Floor	*	<110
6	Room 131B Floor	*	<110
7	Room 131A HVAC Supply Vent Surface	*	<110
8	Room 131A Stored Items	*****	<110
9	Kitchen Table	*****	<110
10	Assembly Hall Room 101A – Heater	*	<110
11	Assembly Hall Room 101A – Floor	*****	<110
12	Room 110B Floor	*	<110
13	Room 203C Conference Room Table	*	<110
14	Room 204A Table	*	<110
15	Room 201P HVAC Supply Vent	*	<110
16	Blank	*	<110 ug
	Criteria	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges
2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of

Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were below the recommended guideline of 200 ug/ft^2 at all of the locations sampled.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. 98011EL). The light meter was last calibrated in November 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
138A Supply Cage	**15-37**	**30**	**No**
130A Supply Cage	**10-20**	**30**	**No**
137A Supply Cage	**10-51**	**30**	**No**
128A Supply Cage	**8-28**	**30**	**No**
Hallway Outside Supply 130A/131A	5-40	5	Yes
Storage/Supply Room 131B	**1.7-10.1**	**30**	**No**
Room 131A Fitness Center	**4-31**	**30**	**No**
Room 134 A HVAC Room	60	30	Yes
Assembly Hall	20-24	10	Yes
Kitchen	106	50	Yes
Dining Room	36	10	Yes
Classroom 115 DLC	**27.3**	**30-50**	**Yes**
Office 112A	50.5	30-50	Yes
Office 110D	58.6	30-50	Yes
Office 201F	40.3	30-50	Yes
Office 201D	71.3	30-50	Yes
Office 201A	48.1	30-50	Yes
Conference Room 211A	60.4	30-50	Yes
Office 212A	76	30-50	Yes
Office 204A	46	30-50	Yes
2nd Floor Hallway	49.5	5	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting levels did not meet the minimum recommended guideline in the 1st floor supply cage areas, fitness center and Classroom 115 Distance Learning Center. Lighting should be improved in these areas.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Room 130A Supply Cage	70.4	53.3	448	0
Room 131A Fitness Room	68	59	455	0
Assembly Hall	72.5	63.2* (Overhead Door Open)	503	0
Office 112A	74	47.7	655	0
Office 201F	70.4	55.8	583	0
Outdoors	72.2	67.7	362	0
Criteria	**68-79**	**30-60**	**<1,062**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements were within recommended guidelines in all areas tested.

- Relative humidity levels were within the recommended guidelines in all areas tested except the Assembly Hall. However, this can be explained due to an overhead door being open while a truck was being loaded. Relative humidity should be maintained at 30-60%.

- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level at the time of the survey. For this survey, carbon dioxide levels did not exceed the recommended ceiling of 1,062 ppm. This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide.

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observations were noted:

    - There was a small area of visible fungal growth in the Men's Restroom about the sink due to a leak. The leak in this area needs to be identified and repaired. The area of fungal growth needs to be properly remediated.

    - All roof leaks need to be identified and repaired.

Section 6.0 Suspect Asbestos Containing Building Materials

The following suspect asbestos containing material (ACM) was noted at the time of this survey:

1. The building was built in 1989. No suspect ACM is believed to be present in the building.

2. Inaccessible areas such as behind walls or crawlspaces were not inspected.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98011EL	11/2012	NA
SKC Air Sampling Pump	647598	5/28/13	2.5 LPM
SKC Air Sampling Pump	648349	5/28/13	2.5 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Edgewood RC	**Chain Of Custody:**	515991
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	APG-Edgewood, MD	**Date Submitted:**	5/30/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/6/2013 **Report Date:** 6/6/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13066066	1	Flame	Air	370	N/A	8.1	ug/m³	<3	<8.1	ug/m³	
13066067	2	Flame	Air	368	N/A	8.2	ug/m³	<3	<8.2	ug/m³	
13066068	3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
13066069	4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066070	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066071	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066072	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066073	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066074	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066075	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066076	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066077	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066078	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066079	14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066080	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13066081	16	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Edgewood RC	**Chain Of Custody:**	515991
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	APG-Edgewood, MD	**Date Submitted:**	5/30/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/6/2013 **Report Date:** 6/6/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: N. McGarvey / S. Chinnapad **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 515991

page 1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Edgewood RC
2. Job Location: ARG-Edgewood, MD
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person: Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Signature: Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
☐ Immediate Date Due:
☐ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
☐ Immediate ☐ 3 Day
☐ Next Day ☒ 5 Day + NOW
☐ 2 Day Date Due: 6/6/13
☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
☒ Incl[redacted]ith Report
☒ Ema[redacted] Non-Responsive [redacted]us.army.mil
☐ Fax: [redacted]us.army.mil
☐ Verb[redacted]

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)
☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☐ Pb Paint Chip ____ (QTY)
☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
☐ Pb Air 3 (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
1	Fitness Room	5/28	370	100cm²				X		X						
2	Hallway 140A		368	0				X		X						
3	Blank		0	0				X		X						
4	Hallway Outside FR			100cm²				X				X				
5	131B Floor							X				X				
6	131B Floor							X				X				
7	131A SE HVAC							X				X				
8	131A Stairwell							X				X				
9	Kitchen Table							X				X				
10	101-A Heater							X				X				
11	101-A Floor							X				X				
12	110B Floor															

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 30 / 13 @ 1030 Via: FedEx By (Print): NEM Sign:
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____
4. Comments: ____ Initials: ____

Posted to NGB FOIA Reading Room May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD) Released by National Guard Bureau Page 2572 of 5269

BEST AVAILABLE COPY

OWI (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

515991
page 2 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Edgewood RC
2. Job Location: ABG- Edgewood, MD
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person: [redacted] Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Non-Responsive nature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
☐ Immediate Date Due: ____
☐ 24 Hours Time Due: ____
Comments: ____

NORMAL BUSINESS HOURS
☐ Immediate ☐ 3 Day
☐ Next Day ☐ 5 Day +
☐ 2 Day Date Due: ____
☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
☒ Include COC/Field Data Sheets with Report
☒ Email: [redacted] Non-Responsive @compliance-plus.com
☐ Fax: [redacted] @us.army.mil
☐ Verbals [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
☐ Pb Paint Chip ____ (QTY)
☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION: CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
~~2025 Comp Table RC~~																
13	2025 Comp. Table 5/28			100cm²				X				X				
14	204A Table			↓				X				X				
15	201P HVAC Supply			↓				X				X				
16	Blank	↓		–				X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD) Released by National Guard Bureau
Page 2573 of 5269

Appendix B. Photographs

Edgewood Readiness Center Photo Log
5/28/2013

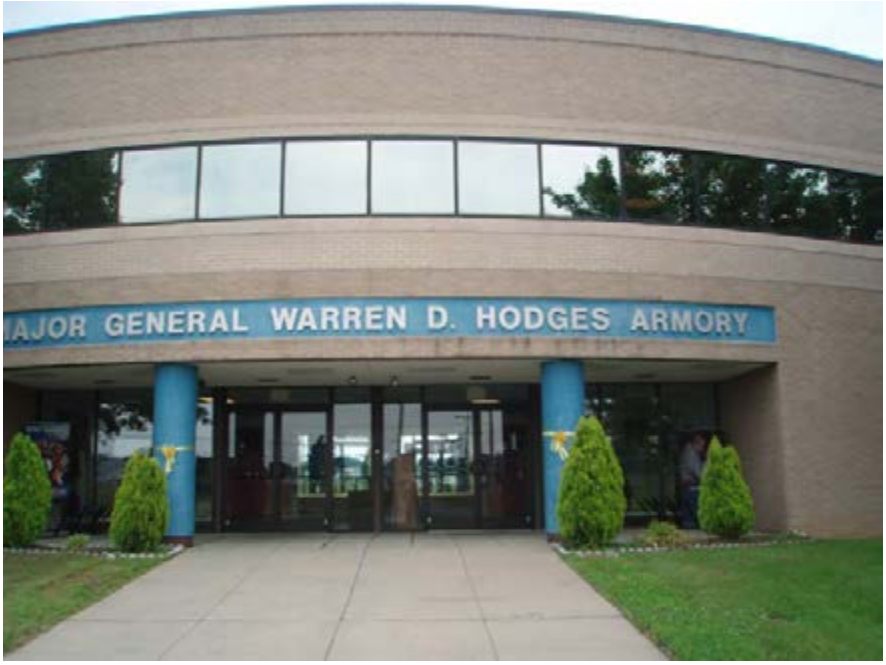

Entrance

Location

Front of Building

Front of Building

Boilers

Fitness Center (Previously Firing Range)

Assembly Hall

Fungal Growth on Ceiling in Men's Restroom by Assembly Hall

Appendix C. Floor Plan

BEST AVAILABLE COPY

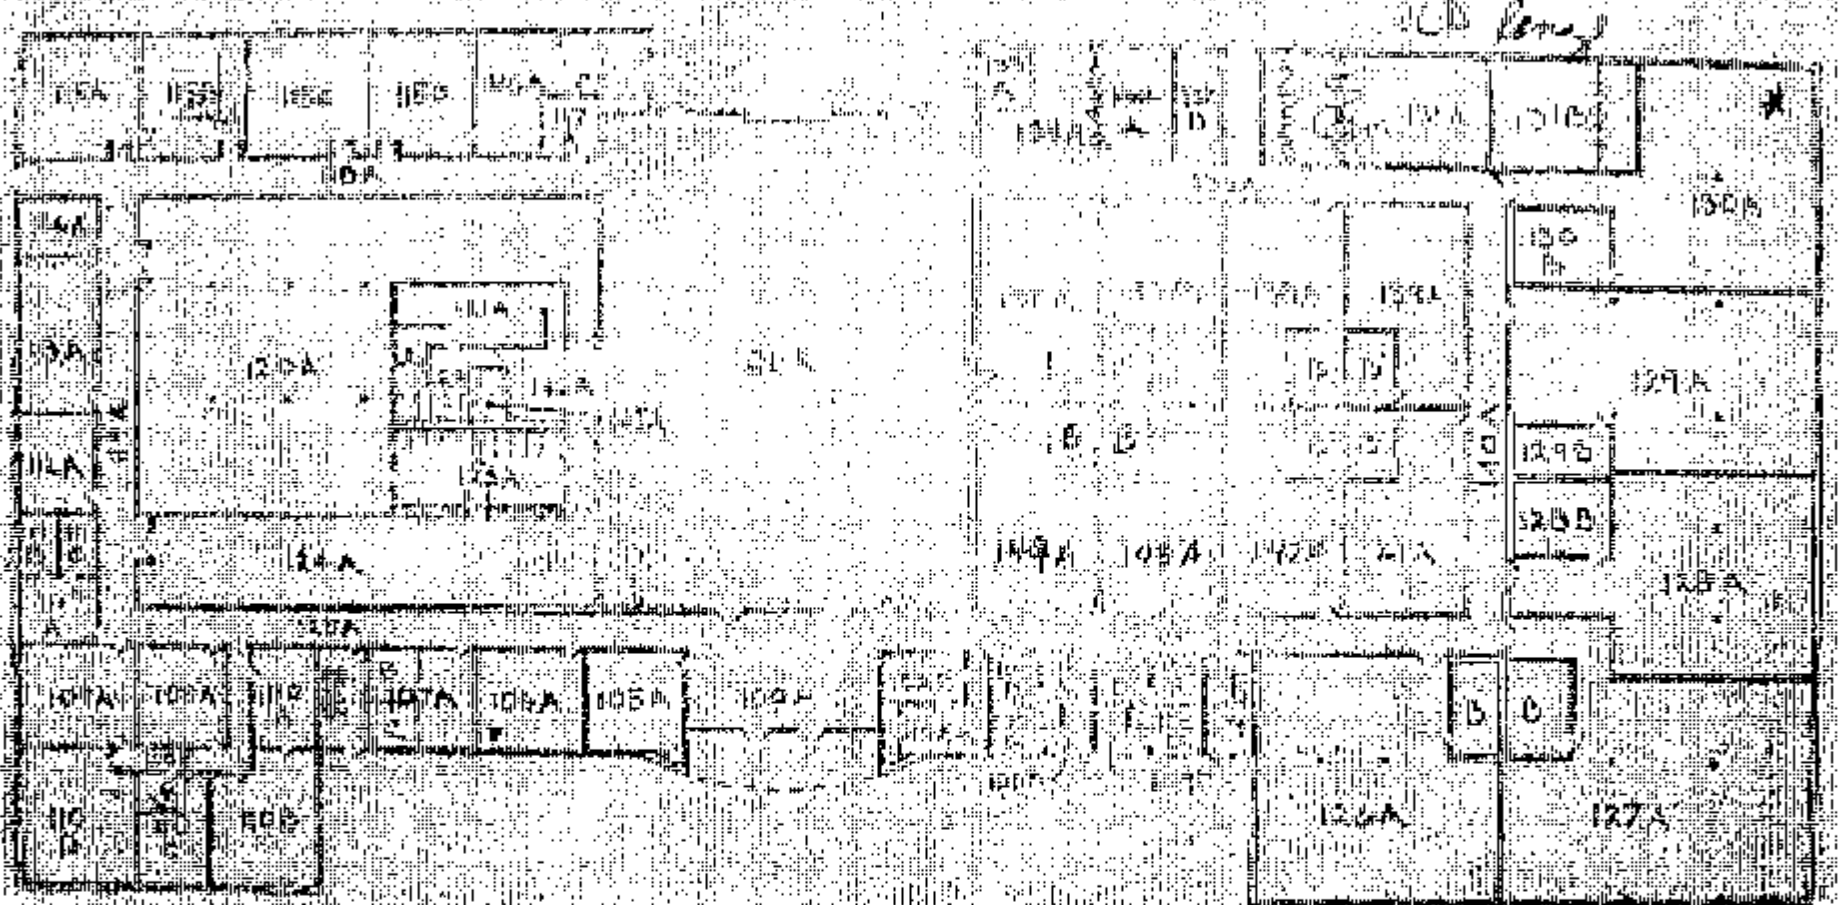

EDGEWOOD ARMORY
FIRST FLOOR PLAN
NO SCALE

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record # 15-0085 (MP)
Released by National Guard Bureau
Page 2380 of 2260

BEST AVAILABLE COPY

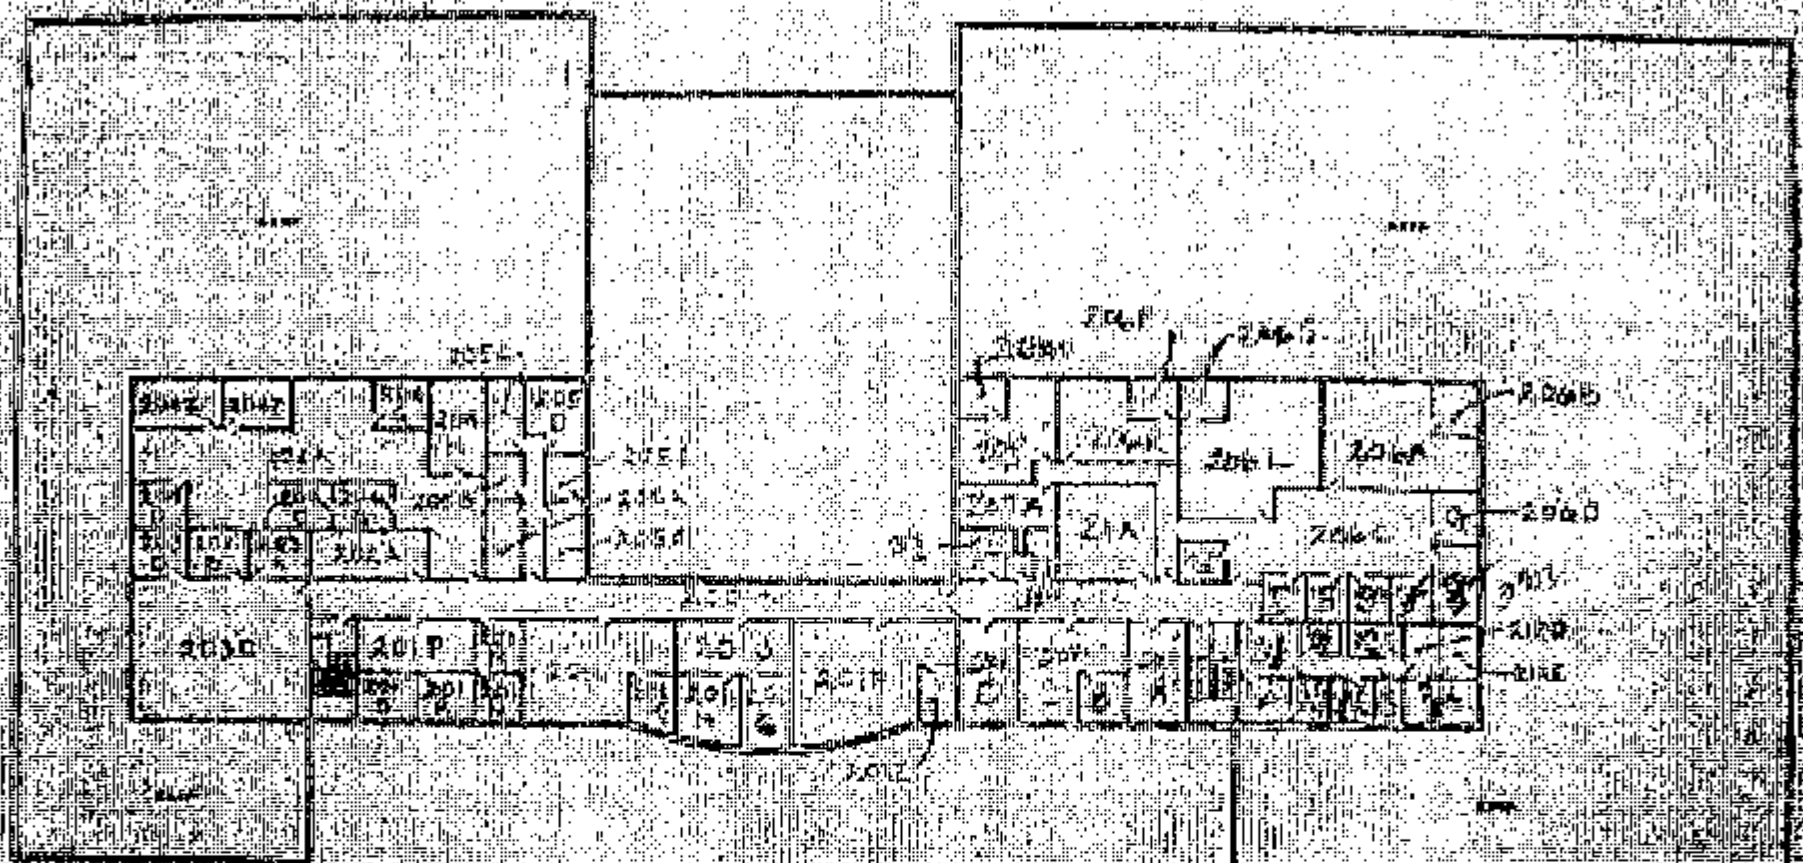

EDGEWOOD ARMORY

SECOND FLOOR PLAN

NOT SCALE

24/10/15

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. American National Standards Institute (ANSI)/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MEMORANDUM FOR Region North Industrial Hygiene Office (NGB-AVS-SI-IH/ Ms. Non-Responsive Army National Guard Bureau, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, LTC James Victor McCool Armory, Elkton, MD, Project No. 55-ML-01ED-03/05

1. Enclosed is the final copy of the subject report and two CD-ROMs.

2. The project number for this service reflects the current fiscal year of dispatch and the actual field work which was completed for fiscal year 2003. The State of Maryland Army National Guard occupational health nurse was immediately notified in writing of findings necessitating immediate corrective action in Maryland armories. In addition, the National Guard Bureau Region North Industrial Hygiene Office has been notified of all the results of lead in dust sampling conducted in all facilities. Draft reports were reviewed by you or other members of the National Guard and members of this Center, including our editorial staff, during drafting stages in report preparation leading up to the final report.

3. Some of the original color photographs may be hole-punched because the document was originally submitted in a notebook.

4. Our point of contact is Ms. Non-Responsive at commercial (410)436-5474/3118, DSN 584-5475/3118, or by electronic mail: Non-Responsive@us.army.mil

FOR THE COMMANDER:

Non-Responsive

Encl

Director, Occupational Health Sciences

Readiness thru Health

Printed on Recycled Paper
BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
LTC JAMES VICTOR MCCOOL ARMORY
ELKTON, MD
PROJECT NO. 55-ML-01ED-03/05

Approved for public release; distribution unlimited

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2584 of 5269

BEST AVAILABLE COPY

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03 ***(reverse)***

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
LTC JAMES VICTOR MCCOOL ARMORY
ELKTON, MD
PROJECT NO. 55-ML-01ED-03/05
16 JULY 2003

1. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee for the Defense Occupational and Environmental Health Readiness System.

2. CONCLUSIONS.

a. Lead Exposure.

(1) Lead in Paint. Bulk deteriorated paint samples were lead-based paint and lead-contaminated paint. The Army considers both lead-based paint and lead-contaminated paint to be potentially hazardous to children if they are disturbed or deteriorating.

(2) Lead in Air. All air samples were below the Occupational Safety and Health Administration standard for lead in air.

(3) Lead in Dust. Lead in dust wipe sample results exceeded the National Guard Bureau (NGB) Region North and U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended decontamination level for lead in dust on frequently contacted surfaces. There were elevated levels of lead in dust in the converted indoor firing range (IFR) storage room. Lead from the converted IFR storage room can be tracked into other areas of the armory. The NGB Region North Industrial Hygiene Office was notified of these results.

(4) Child Lead Exposure. Many lead in dust sample results exceeded the Environmental Protection Agency (EPA) and the State of Maryland lead exposure levels for children. These conditions pose a significant health hazard from lead exposure to children using this facility that warrants clean up to these limits before allowing children to continue to use this armory.

b. Asbestos Exposure. Some pipe insulation presumed to be asbestos-containing was exposed. There were also presumed asbestos vinyl floor tiles in the armory. Some of these tiles were buckling due to moisture. If additional damage occurs in the future, the asbestos tiles and pipe insulation may become friable and asbestos fibers may be released. The MDARNG state occupational health nurse has been informed of this finding.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2586 of 5269

BEST AVAILABLE COPY

c. Mold Exposure. Excessive moisture in the armory has caused mold growth.

d. Safety Hazards. Some ceiling tiles have buckled due to water damage. Occasionally these ceiling tiles become dislodged when building occupants bounce basketballs on the drill floor.

e. Additional Building Concerns. The point of contact stated that the drinking water occasionally appears to be rusty or cloudy. He also stated that the armory does not have enough electrical circuits.

3. RECOMMENDATIONS.

a. Lead Exposure. The Department of Defense Risk Assessment Code (RAC) for health hazards associated with lead exposure in the LTC James Victor McCool Armory is RAC 3.

(1) Occupational Exposure. Clean all areas in and adjacent to the former IFR and other areas where sampling results showed elevated levels of lead. Comprehensive guidelines for cleaning are in Appendix F. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up. Apply a sealant to the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for children and for the general workforce. Pending clean up, restrict access to the former IFR by keeping it locked. Post a sign warning against use of the room except in an emergency. Ensure that personnel wear disposable gloves and disposable coveralls to prevent tracking lead out when working in the former IFR. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

(2) Child Exposure. Address all potential lead hazards before extending use of this facility to children. If children will be using this facility, clean surfaces to the EPA lead in dust standard for young children and to the NGB Region North and USACHPPM decontamination level for lead in dust on all other surfaces. Repair and stabilize deteriorated paint.

b. Asbestos Exposure. The RAC for health hazards associated with asbestos exposure is RAC 1. Determine if pipe insulation is asbestos-containing material. If it is determined to be asbestos it must be encapsulated or removed as soon as possible. Repair or replace vinyl floor tiles as soon as possible.

c. Mold Exposure. The RAC for health hazards associated with mold exposure is RAC 4. Reduce the moisture level in the air, repair leaks, increase ventilation (if weather is cold and dry), or dehumidify (if weather is warm and humid). Dehumidifying can be accomplished either by closing the windows and turning on the window air conditioning units or by using a portable dehumidifier. Abate all areas of visible mold. Remove and replace ceiling tiles with mold

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2587 of 5269

BEST AVAILABLE COPY

growth. Vacuum or damp wipe walls, floors and other surfaces with mold growth with water and mild detergent and allow to dry. For additional guidance refer to USACHPPM TG 278, Industrial Hygiene/ Preventive Medicine Mold Assessment Guides, and USACHPPM TG 277, Army Facilities Management Information Document on Mold Remediation Issues.

d. Safety Hazards. The RAC for safety hazards associated with the ceiling tiles is RAC 3. Replace loose ceiling tiles.

e. Additional Building Concerns.

(1) Obtain the services of a professional electrician to review the electrical system throughout the armory to determine whether there are enough circuits. No RAC assigned.

(2) Test the drinking water from water fountains and faucets for lead and other contaminants. The RAC for health hazards associated with the drinking water is RAC 3.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2588 of 5269

BEST AVAILABLE COPY

TABLE OF CONTENTS

Paragraph	Page
1. REFERENCES	1
2. PURPOSE OF EVALUATION	1
3. AUTHORITY	1
4. BACKGROUND INFORMATION	1
5. FACILITY EVALUATION	1
6. ASSESSMENT CRITERIA FOR LEAD	3
7. SAMPLING RESULTS, DISCUSSION AND CONCLUSIONS	3
8. RECOMMENDATIONS	5
9. SITE MAPS	6
10. ADDITIONAL ASSISTANCE	6

APPENDICES

A. REFERENCES	A-1
B. SAMPLING SHEETS AND LAB ANALYSES	B-1
C. PHOTOGRAPHS	C-1
D ASSESSMENT CRITERIA FOR LEAD	D-1
E. MOLD GUIDANCE	E-1
F LEAD CLEANING GUIDANCE	F-1
G. SITE MAPS	G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2589 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
LTC JAMES VICTOR MCCOOL ARMORY
ELKTON, MD
PROJECT NO. 55-ML-01ED-03/05
16 JULY 2003

1. REFERENCES. See Appendix A.

2. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee for the Defense Occupational and Environmental Health Readiness System.

3. AUTHORITY. Fax, National Guard Bureau (NGB) Region North Industrial Hygiene Office (NGB-AVS-SI-IH/Ms. Non-Responsive, 28 February 2003, subject: SAB

4. BACKGROUND INFORMATION.

a. Armory Mission. The Total Light Anti-Tank Unit from Elkton Armory serves Aberdeen Proving Ground by providing force protection and perimeter security for the base.

b. Date of Construction. 1911.

c. Facility Use by Children. The point of contact (POC) stated that children occupy the armory occasionally. The Maryland Military Department is currently advertising Elkton Armory as available for rental for activities that include young children.

5. FACILITY EVALUATION.

a. Sampling. Samples were collected for lead in air, on surfaces (wipe samples), and in bulk paint to determine the presence of lead hazards. Sample locations and results are shown in Appendix B.

b. Physical Condition of Facilities.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2590 of 5269

BEST AVAILABLE COPY

(1) Paint. Staff Sergeant (SSG) Non-Responsive Environmental Compliance Assessment Coordinator for the MDARNG, stated that there are no records of lead-based paint abatement for this armory. Some of the paint was deteriorated in the drill hall and in Room 204.

(2) Asbestos. SSG Non-Responsive stated that there are no records of an asbestos abatement in this armory. There is presumed asbestos-containing insulation on the pipes throughout the building. Some of the presumed asbestos-containing material is exposed. There are also some vinyl floor tiles which are presumed to be vinyl asbestos tiles.

(3) Mold. There is mold in the armory on some ceiling tiles.

(4) Safety Hazards. Building occupants bounce basketballs on the drill floor, and this causes ceiling tiles to fall onto the floor.

c. Other Building Concerns.

(1) The POC stated that the armory does not have enough electrical circuits. Three circuits run the air conditioners and fans.

(2) Some panels in the ceiling have buckled due to water damage.

(3) Some vinyl floor tiles have buckled due to water damage.

(4) The drinking water occasionally appears to be rusty or cloudy.

d. Safety and Industrial Hygiene Programs. The only written program records at the armory are for the Hazardous Communication Program.

e. Heating, Ventilation, and Air-Conditioning System. Ventilation and air are provided mainly by window-mounted air conditioning units and the manual operation of windows when the building is not being heated. The building is heated by steam heated radiators.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. All areas of the armory were judged to be adequately lit and occupants reported no areas of deficient lighting.

h. Converted Indoor Firing Range. SSG Non-Responsive stated that all lead was abated in the indoor firing range (IFR) during its conversion. The room is being used as a storage area.

i. Photographs. See Appendix C.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2591 of 5269

BEST AVAILABLE COPY

6. ASSESSMENT CRITERIA FOR LEAD. See Appendix D for details.

a. Lead in Air. The Army occupational exposure limit for lead in air is the Occupational Safety and Health Administration (OSHA) 8-hour time-weighted average Permissible Exposure Limit of 50 micrograms of lead per cubic meter ($\mu g/m^3$) of air.

b. Lead in Dust. The Environmental Protection Agency (EPA) and State of Maryland limits for lead in dust are 40 micrograms per square foot ($\mu g/ft^2$) on floors, 250 $\mu g/ft^2$ on window sills, and 400 $\mu g/ft^2$ in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The NGB Region North concurs with the U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended safe limit of 200 $\mu g/ft^2$ on floors and frequently contacted surfaces.

c. Lead in Paint. Paint containing lead levels of 0.5% or more by weight in dried solid (also reported as 5000 milligrams per kilogram) is considered to be lead-based paint according to both Federal and Maryland State Regulations. Paint containing lead levels of more than 0.7 milligrams per square centimeter is considered to be lead-based paint according to Maryland State Regulations. In Army Regulation 420-70, Buildings and Structures, lead-contaminated paint is defined as any paint containing detectable amounts of lead. The Army considers lead-contaminated paint to be potentially hazardous to children if it is disturbed or deteriorating.

d. Lead Carcinogenicity. The Department of Health and Human Services National Toxicology Program (NTP) released the Report on Carcinogens, Eleventh Edition in February 2005. The NTP report lists "lead and lead compounds" as "reasonably anticipated to be human carcinogens".

7. SAMPLING RESULTS, DISCUSSION AND CONCLUSIONS.

a. Lead in Air. All air sample results were below the laboratory analytical detection limit for lead of 3 $\mu g/m^3$ as well as the OSHA standard of 50 $\mu g/m^3$ for lead in air.

b. Lead in Paint. Samples of deteriorated paint were analyzed for lead. One sample result was 1.118% and is lead-based paint. Another sample result was 0.359% and is lead-contaminated paint.

c. Lead in Dust. Two of seventeen lead in dust wipe sample results, located on the top of the refrigerator in the kitchen and on the base of the former metal target stands in the converted IFR, exceeded the NGB Region North and USACHPPM recommended decontamination level of 200 $\mu g/ft^2$ for lead in dust on frequently contacted surfaces. The converted range room metal target stand surface wipe result was 318 $\mu g/ft^2$. The top of the refrigerator surface wipe sample was 478 $\mu g/ft^2$. Four lead in dust sample results exceeded the EPA and the State of Maryland

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2592 of 5269

BEST AVAILABLE COPY

lead exposure levels for children. There are elevated levels of lead in dust in the converted IFR storage room. Personnel using this room are potentially exposed to lead in dust, and are tracking lead out of the area and redistributing lead into adjacent rooms in the armory. This can result in lead exposures for children and for the general workforce outside of areas thought only to contain lead.

d. Child Lead Exposure. Lead in dust results from several areas in the armory greatly exceeded the regulatory limits for children 6 years of age and under. Two deteriorated paint samples were found to be lead-based and lead-contaminated paint. Lead is being tracked throughout the facility. Although children are unlikely to occupy this armory for more than the minimum 60 hours per year required for the regulatory limits to apply, we believe that these conditions pose a significant health hazard from lead exposure to children using this facility that warrants clean up to the minimum limits before allowing children to continue to use the armory. The NGB Region North Industrial Hygiene Office was notified of these results.

e. Asbestos Exposure. Some pipe insulation is presumed to be asbestos-containing and is exposed. If it is determined to be asbestos it must be encapsulated or removed as soon as possible. There are also presumed asbestos vinyl floor tiles in the armory. Some of the presumed asbestos tiles are buckling due to moisture in the armory. If further damage occurs in the future, the asbestos tiles and the pipe insulation may become friable and asbestos fibers may be released. Army policy requires the armory to establish and execute an asbestos hazard management plan for all asbestos in the facility, and to take immediate corrective action where a possible asbestos related health hazard has been identified. The Maryland state occupational nurse has been informed of this finding.

f. Mold and Moisture Exposure. Excessive moisture in the armory has caused mold growth. Mold and sources of moisture must be eliminated. See Appendix E for guidelines in identifying, removing, and abating mold.

g. Safety Hazards. Some panels in the ceiling have buckled due to water damage. Building occupants bounce basketballs on the drill floor and this causes ceiling tiles to fall onto the floor.

h. Other Building Concerns.

(1) The POC stated that the armory does not have enough electrical circuits. Three circuits run the air conditioners and fans.

(2) The drinking water occasionally appears rusty or cloudy.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2593 of 5269

BEST AVAILABLE COPY

8. RECOMMENDATIONS.

a. Lead Exposure. The Risk Assessment Code (RAC) for health hazards associated with lead exposure is RAC 3.

(1) Occupational Exposure. Clean all areas in and adjacent to the former IFR and other areas where sampling results showed elevated levels of lead. Comprehensive guidelines for cleaning are in Appendix F. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up. Apply a sealant to the area. Recleaning and sealing the IFR may further prevent lead from becoming redistributed into adjacent rooms and resulting in exposures for children and for the general workforce. Pending clean up, restrict access to the former IFR by keeping it locked. Post a sign warning against use of the room except in an emergency. Ensure that personnel wear disposable gloves and disposable coveralls to prevent tracking lead out when working in the former IFR. Wear disposable gloves and disposable coveralls as extra protection when working in all areas identified as having elevated levels of lead.

(2) Child Exposure. Address all potential lead hazards before extending use of this facility to children. If children will be using this facility, clean surfaces to the EPA lead in dust standard for young children and to the NGB Region North and USACHPPM decontamination level for lead in dust on all other surfaces. Repair and stabilize deteriorated paint.

b. Asbestos Exposure. The RAC for health hazards associated with asbestos exposure is RAC 1. Determine if pipe insulation is asbestos-containing material. If it is determined to be asbestos it must be encapsulated or removed as soon as possible. Repair or replace vinyl floor tiles as soon as possible.

c. Mold Exposure. The RAC for health hazards associated with mold exposure is RAC 4. Reduce the moisture level in the air, repair leaks, increase ventilation (if weather is cold and dry), or dehumidify (if weather is warm and humid). Dehumidifying can be accomplished either by closing the windows and turning on the window air conditioning units or by using a portable dehumidifier. Abate all areas of visible mold. Remove and replace ceiling tiles with mold growth. Vacuum or damp wipe walls, floors and other surfaces with mold growth with water and mild detergent and allow to dry. For additional guidance refer to USACHPPM TG 278, Industrial Hygiene/ Preventive Medicine Mold Assessment Guides, and USACHPPM TG 277, Army Facilities Management Information Document on Mold Remediation Issues.

d. Safety Hazards. The RAC for safety hazards associated with the ceiling tiles is RAC 3. Replace loose ceiling tiles.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2594 of 5269

BEST AVAILABLE COPY

e. Additional Building Concerns.

(1) Obtain the services of a professional electrician to review the electrical system throughout the armory to determine whether there are enough circuits. No RAC assigned.

(2) Test the drinking water from water fountains and faucets for lead and other contaminants. The RAC for health hazards associated with the drinking water is RAC 3.

9. SITE MAPS. See Appendix G.

10. ADDITIONAL ASSISTANCE. For additional assistance or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by electronic mail: Non-Responsive@us.army.mil

Non-Responsive

Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive

Technical Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2595 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2596 of 5269

APPENDIX

REFERENCES

1. Occupational Safety and Health Administration, Title 29, Code of Federal Regulations (CFR), Part 1910, current ed. 1910.107 and 1019.94.
http://www.osha.gov/comp-links.html

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, 19 August 1998.
http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

3. AR 40-5, Preventive Medicine, 15 October 1990.
http://www.usapa.army.mil/pdffiles/r40_5.pdf

4. AR 385-10, The Army Safety Program, 29 February 2000.
http://www.usapa.army.mil/pdffiles/r385_10.pdf

5. DA PAM 40-501, Medical Services, Hearing Conservation Program, 10 December 1998.
http://www.usapaarmy.mil/pdffiles/p40_501.pdf

6. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000.
http://www.usapa.army.mil/pdffiles/p4C_503.pdf

7. OSHA 29 CFR 1910.1200, Hazard Communication, current ed.
http//www.osha.gov/pls/oshaweb/owadisp.show_document?p_id=10099&p_table=STANDARDS

8. American Conference of Governmental Industrial Hygienists (ACGIH), Threshold Limit Values and Biological Exposure Indices, ACGIH, Cincinnati, OH, 2004.
http://www.acgih.org/TLV/

9. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.
http://www.ashrae.org

10: ANSI 2358.1-2004, American National Standards Institute, Inc. American National Standard for Emergency Eyewash and Shower Equipment.

11. Illuminating Engineering Society of North America, ANSI/IESNA. RP-I-1993, Office Lighting.

12. ACGIH, Industrial Ventilation: A Manual of Recommended Practices, 25th ed. 2003.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2597 of 5269

13. U.S. Army National Guard Bureau, Design Guide 415-2 Design Guide for Logistics Facilities, 30 November 1990.

14. EPA 40 CFR, Part 61--National Emission Standards for Hazardous Air Pollutants, Subpart M--National Emission Standard for Asbestos.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2598 of 5269

BEST AVAILABLE COPY

APPENDIX B

SAMPLING SHEETS AND LAB ANALYSES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2599 of 5269

TABLE: Lead in Dust Wipe and Bulk Paint Sample Locations, Photograph Numbers, and Analytical Results

Sample Numbers	Type of Sample	Location	Photo #	Result µg/ft²
EL W01	Wipe	Drill Floor Entrance	0839	39
EL W02	Wipe	Drill Floor Middle	0840	BDL
EL W03	Wipe	Drill Floor Back of Drill Hall	0841	59
EL W04	Wipe	Drill Floor Window Sill	0843	45
EL W05	Wipe	Recreation Room Lunch Table	0846	BDL
EL W06	Wipe	Kitchen Counter	0854	BDL
ELW07	Wipe	Top of Refrigerator	-	478
EL W08	Wipe	Converted Range Floor	0848	120
EL W09	Wipe	Converted Range Floor Original Air Outlet	0849	BDL
EL W10	Wipe	Converted Range Floor Outside Wall	-	BDL
EL W11	Wipe	Converted Range Room Air Intake	0847	82
EL W12	Wipe	Converted Range Room Original Wall Plenum	0848	81
EL W13	Wipe	Converted Range Room New Wall Plenum	-	32
EL W14	Wipe	Converted Range Room Metal Target Stands	0848	318
EL W15	Wipe	Converted Range Room Ceiling Sound Proofing	0871	BDL
EL W16	Wipe	Desk Top	0861	BDL
EL W17	Wipe	Distance Learning Classroom	0863	BDL
Bulk Samples				**% Lead**
EL Bulk 1	Bulk	Drill Hall	0862	0.359
EL Bulk 2	Bulk	Room 204 Office	0861	1.118
Air Samples				**mg/m³**
ELAIR01	Air	Drill Hall	0862	BDL
ELAIR02	Air	Room 205	0863	BDL
ELAIR03	Air	Knotty Pine Room	0846	BDL

Note: BDL = Below Detection Limit.

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2600 of 5269

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
US Army CHPPM
Bldg. 1570 Stark Road
APG, MD 21015

Reference Data:	**Lead**
Client Sample No.:	ELAIR01 through ELAIR05
P.O. No.:	Not Available
Sample Location:	Elkton Armory
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-3782
DCL Sample ID No.:	03-23206 through 03-23210
Sample Receipt Date:	8/5/2003
Preparation Date:	08/06/03
Analysis Date:	08/07/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive

Analyst

Non-Responsive

Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2601 of 5269

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m³
ELAIR01	03-23206	0	ND	-
ELAIR02	03-23207	293	ND	<0.003
ELAIR03	03-23208	300	ND	<0.003
ELAIR04	03-23209	304	ND	<0.003
ELAIR05	03-23210	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		99.	
RPL			1.	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2602 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	**RES 95626-1**
Client:	**USACHPPM**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**MD National Guard**
Date Samples Received:	**July 18, 2003**
Analysis Type:	**USEPA SW846 3050B / AA(7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**July 24, 2003**

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
ELBLANK1	EM 796343	0.11	BDL	23	BDL
ELWO1	EM 796344	0.11	4.3	23	39
ELWO2	EM 796345	0.11	BDL	23	BDL
ELWO3	EM 796346	0.11	6.5	23	59
ELWO4	EM 796347	0.11	5.0	23	45
ELW05	EM 796348	0.11	BDL	23	BDL
ELBLANK2	EM 796349	0.11	BDL	23	BDL
ELWO6	EM 796350	0.11	BDL	23	BDL
ELWO7	EM 796351	0.11	52.6	23	478
ELWO8	EM 796352	0.11	13.2	23	120
ELWO9	EM 796353	0.11	BDL	23	BDL
ELW10	EM 796354	0.11	BDL	23	BDL
ELBLANK3	EM 796355	0.11	BDL	23	BDL
ELW11	EM 796356	0.11	9.0	23	82
ELW12	EM 796357	0.11	8.9	23	81
ELW13	EM 796358	0.11	3.5	23	32
ELW14	EM 796359	0.11	35.0	23	318
ELW15	EM 796360	0.11	BDL	23	BDL
ELBLANK4	EM 796361	0.11	BDL	23	BDL
ELW16	EM 796362	0.11	BDL	23	BDL
ELW17	EM 796363	0.11	BDL	23	BDL

***Calculations Based On A 1 sq.ft. Sample Area Unless Otherwise Noted**

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2603 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN PAINT

RES Job Number:	**RES 95628-1**
Client:	**USACHPPM**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**None Given**
Date Samples Received:	**July 18, 2003**
Analysis Type:	**USEPA SW846 3050B / AA (7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**July 22, 2003**

Client ID Number	Lab ID Number	Detection Limit (%)	LEAD CONCENTRATION (%)
ELBULK1	EM 796367	0.005	0.359
ELBULK2	EM 796368	0.005	1.118

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2604 of 5269

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2605 of 5269

Elkton Armory Photographs

Photo #	Location
0839	Drill Floor Entrance/ Lead Wipe Sample
0840	Drill Floor Middle/ Lead Wipe Sample
0841	Drill Floor Back of Drill Hall/ Lead Wipe Sample
0842	Drill Floor Back of Drill Hall/ Lead Wipe Sample
0843	Drill Floor Window Sill/ Lead Wipe Sample
0844	Drill Floor Window Sill/ Deteriorated Paint
0845	Drill Floor Window Sill/ Deteriorated Paint
0846	Recreation Room Lunch Table/ Lead Wipe and Air Samples
0847	Converted Range Room Air Intake/ Lead Wipe Sample
0848	Converted Range Room Metal Target Stands and Original Wall Plenum/ Lead Wipe Sample
0849	Converted Range Floor Original Air Outlet/ Lead Wipe Sample
0850	Presumed Vinyl Asbestos Floor Tiles
0852	Locker Room
0854	Kitchen Counter/ Lead Wipe Sample
0859	Chipping and Deteriorated Paint
0860	Drill Hall/ Loose Ceiling Tiles
0861	Room 204 Office Desk Top/ Lead Wipe and Bulk Paint Samples
0862	Drill Hall/ Lead in Air and Bulk Paint Samples
0863	Distance Learning Classroom Room 205/ Lead Wipe and Air Samples
0864	Locker Room/ Loose Ceiling Tiles
0865-68	Exposed Pipe Insulation
0871	Converted Range Room Ceiling Sound Proofing/ Wipe Sample

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2606 of 5269

BEST AVAILABLE COPY

DCP_0839.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0840.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DCP_0841.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0842.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0843.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DCP_0844.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0845.JPG Unknown

BEST AVAILABLE COPY

DCP_0846.JPG Unknown

DCP_0847.JPG Unknown

BEST AVAILABLE COPY

DCP_0848.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DCP_0849.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

BEST AVAILABLE COPY

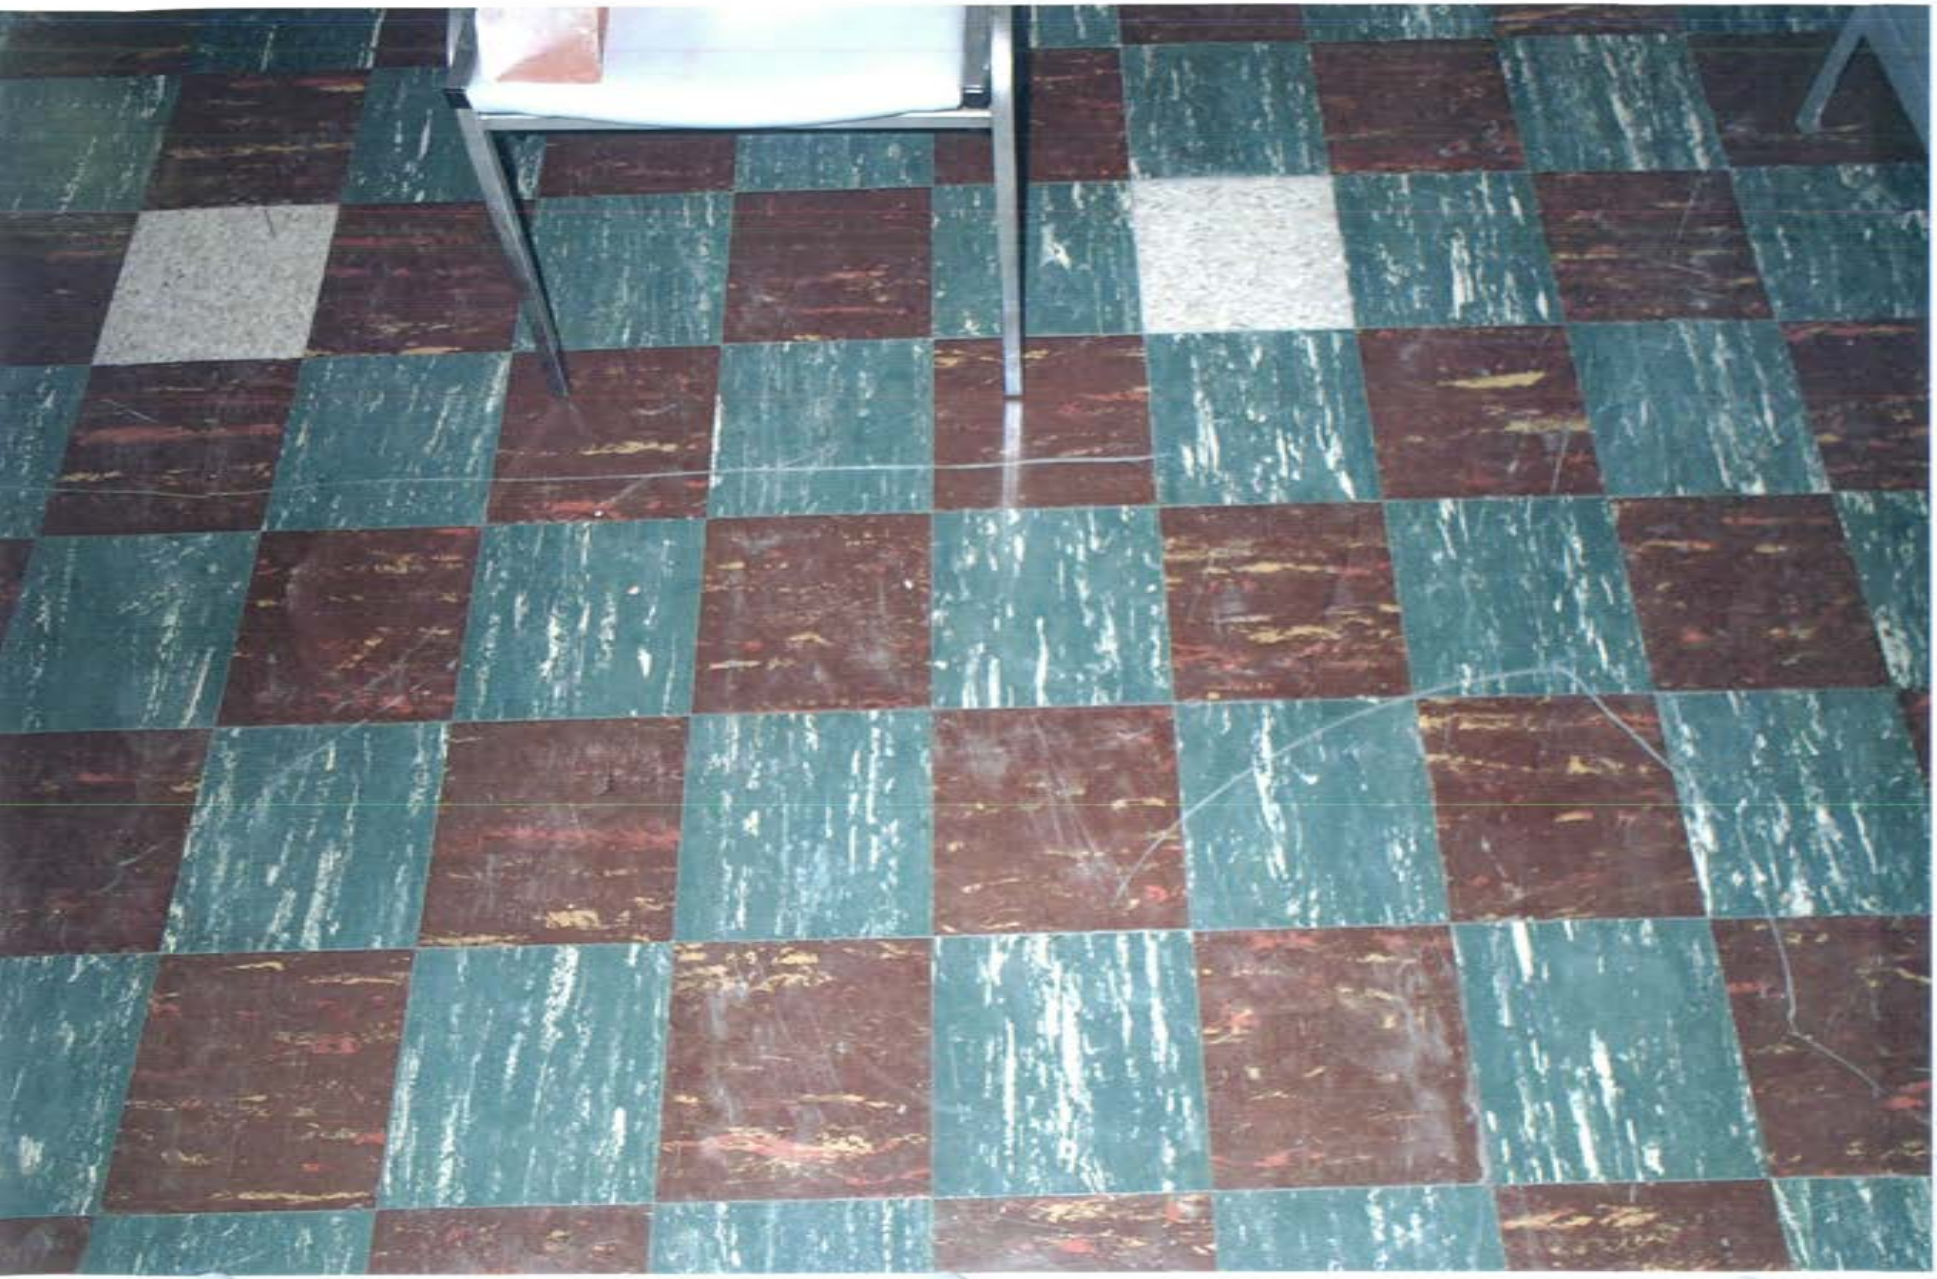

DCP_0850.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DCP_0852.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0854.JPG Unknown

BEST AVAILABLE COPY

DCP_0859.JPG Unknown

BEST AVAILABLE COPY

DCP_0860.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0861.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0862.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DCP_0863.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

DCP_0864.JPG Unknown

BEST AVAILABLE COPY

DCP_0865.JPG Unknown

BEST AVAILABLE COPY

DCP_0866.JPG Unknown

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DCP_0867.JPG Unknown

BEST AVAILABLE COPY

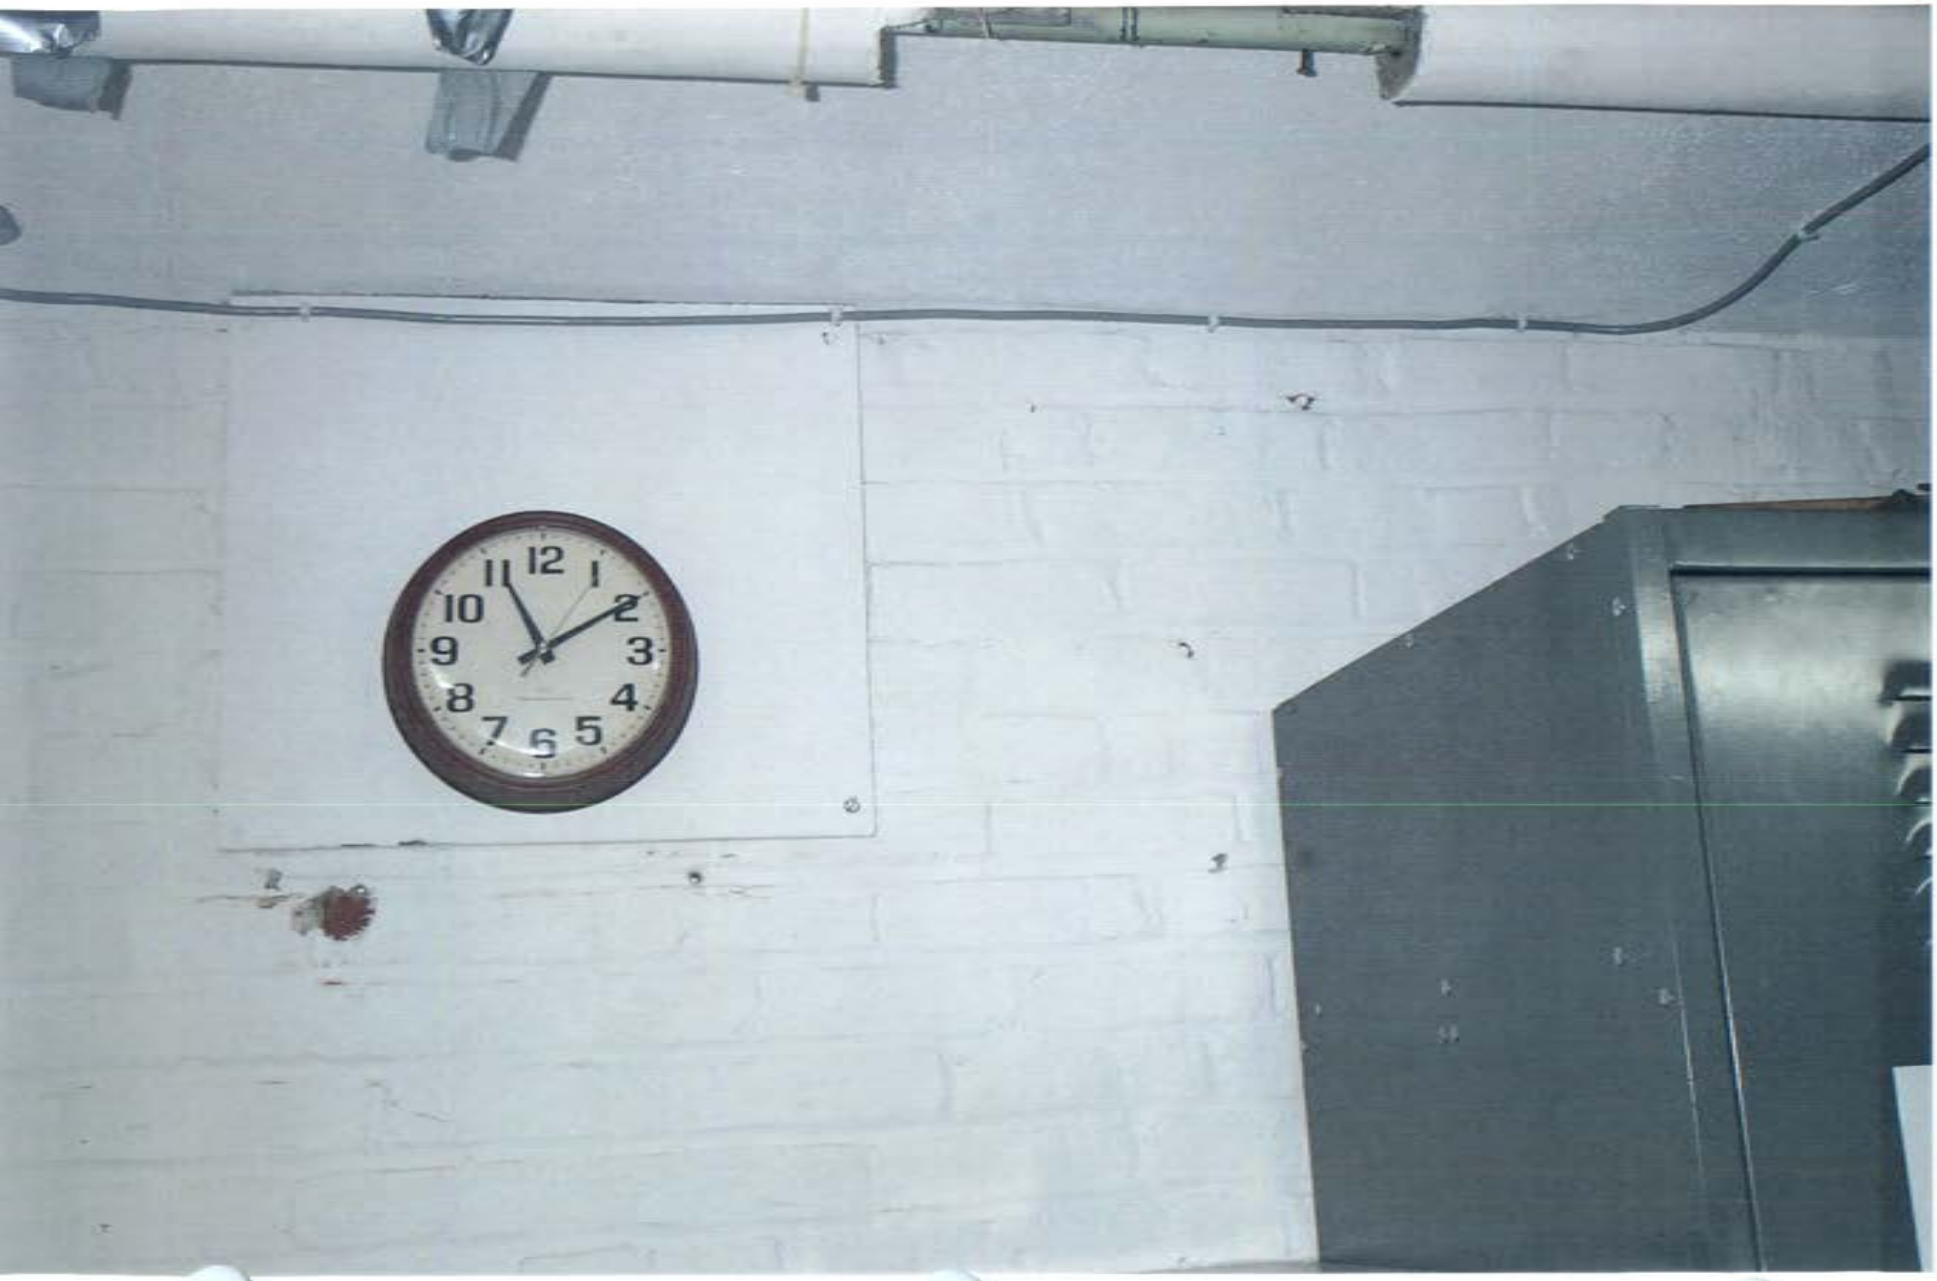

DCP_0868.JPG Unknown

BEST AVAILABLE COPY

DCP_0871.JPG Unknown

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX D

NATIONAL GUARD BUREAU REGION NORTH INDUSTRIAL HYGIENE OFFICE

ASSESSMENT CRITERIA FOR LEAD

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2632 of 5269

SUBJECT: National Guard Bureau Region North Industrial Hygiene Office
Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 µg/ft². This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e) (8) (viii)) and State of Maryland standards are not directly applicable because they are developed for floors (40 µg/ft²), windowsills (250 µg/ft²)and window troughs (400 µg/ft²) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The OSHA lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA cites a level of 200 µg/ft² in OSHA Instruction CPL 2-2.58 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 µg/ft² is a safe surface contamination level for adult exposures. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels higher than those recommended above do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All States will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 50 µg/m³ averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2633 of 5269

BEST AVAILABLE COPY

APPENDIX E

MOLD GUIDANCE

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2634 of 5269

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2635 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2636 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2637 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2638 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet -** e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2639 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2640 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2641 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2642 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2643 of 5269

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2644 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2645 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2646 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2647 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2648 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2649 of 5269

BEST AVAILABLE COPY

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2650 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2651 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2652 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2653 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2654 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2655 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2656 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2657 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2658 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2660 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2661 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2662 of 5269

MOLD INVESTIGATION DECISION LOGIC

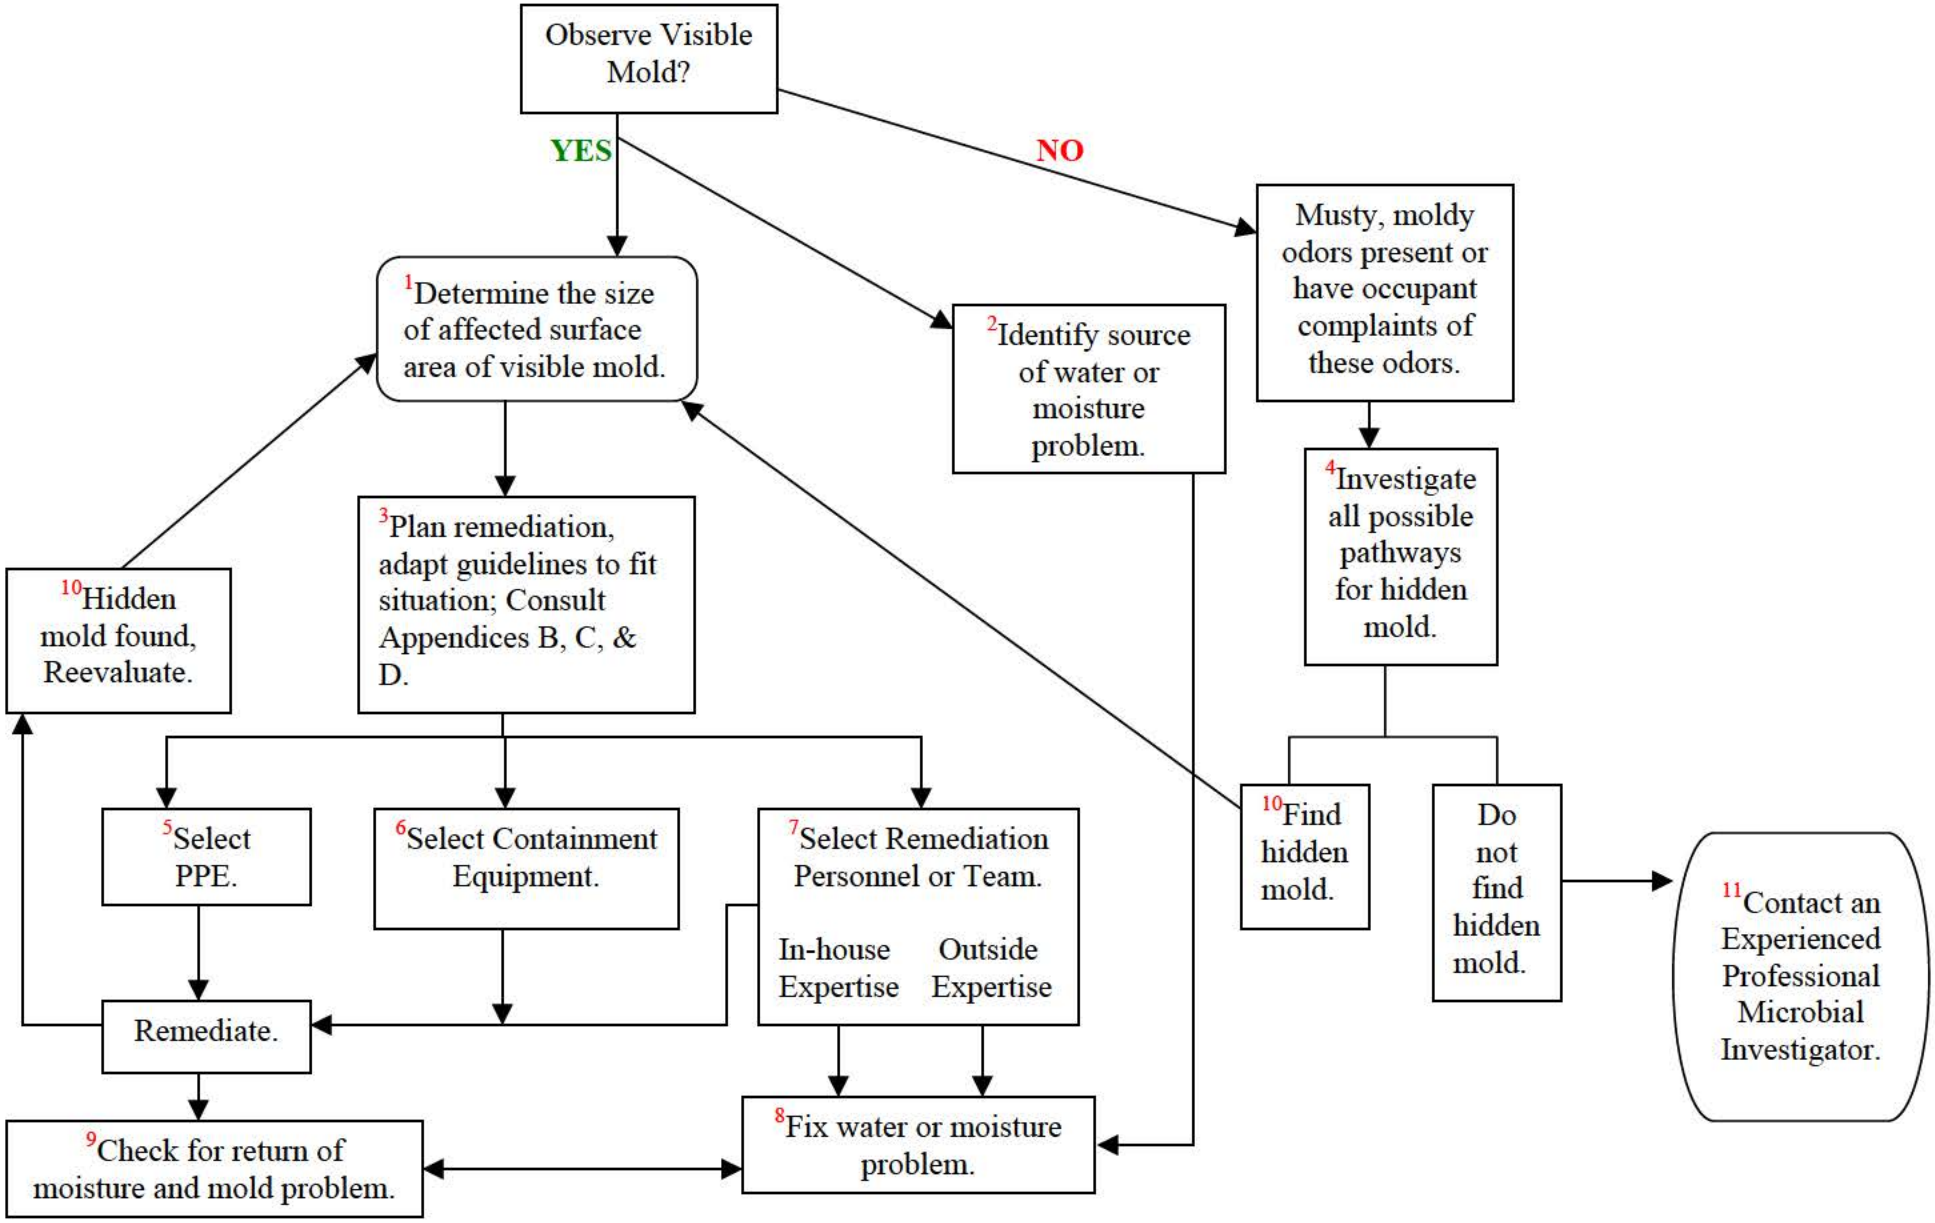

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2664 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2665 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2666 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2667 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2668 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2669 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips

- Always maintain the containment area under negative pressure.
- Exhaust fans to outdoors and ensure that adequate makeup air is provided.
- If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2670 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2671 of 5269

BEST AVAILABLE COPY

TG 278

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2672 of 5269

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

HUD TECHNICAL GUIDELINES FOR THE EVALUATION AND CONTROL OF LEAD-BASED PAINT HAZARDS IN HOUSING 1998

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2673 of 5269

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2674 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2675 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2676 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2677 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2678 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2679 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2680 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2681 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

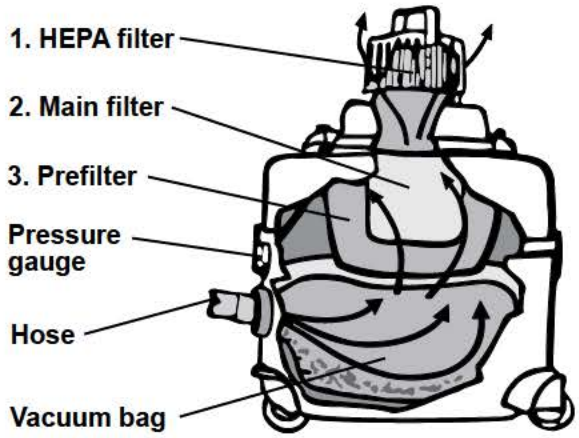

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

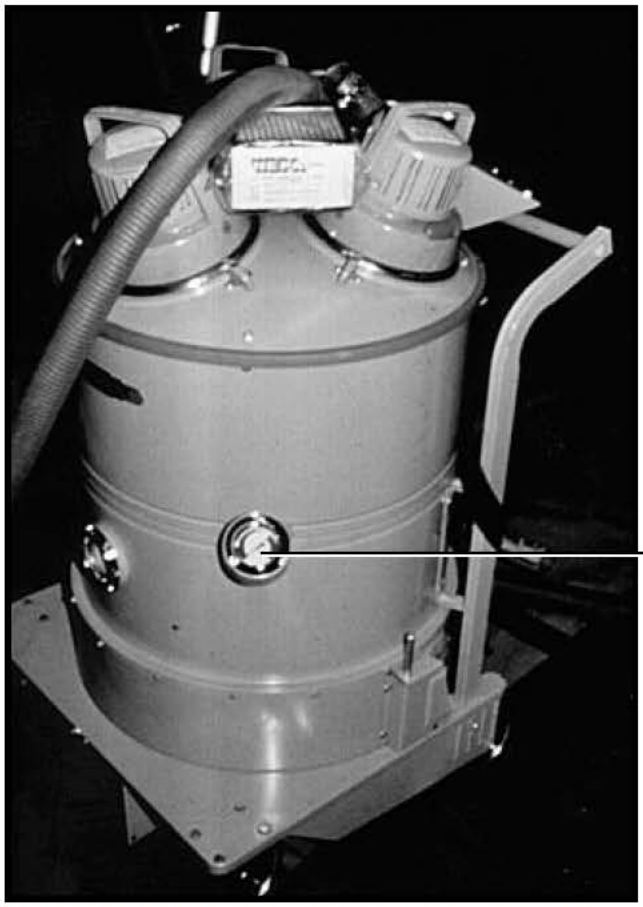

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2682 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

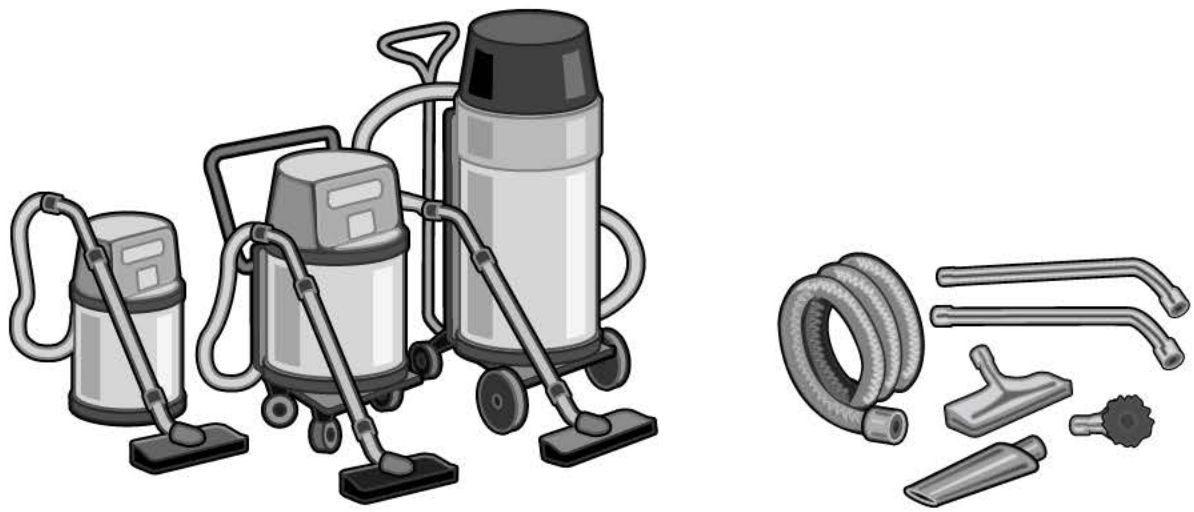

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2683 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

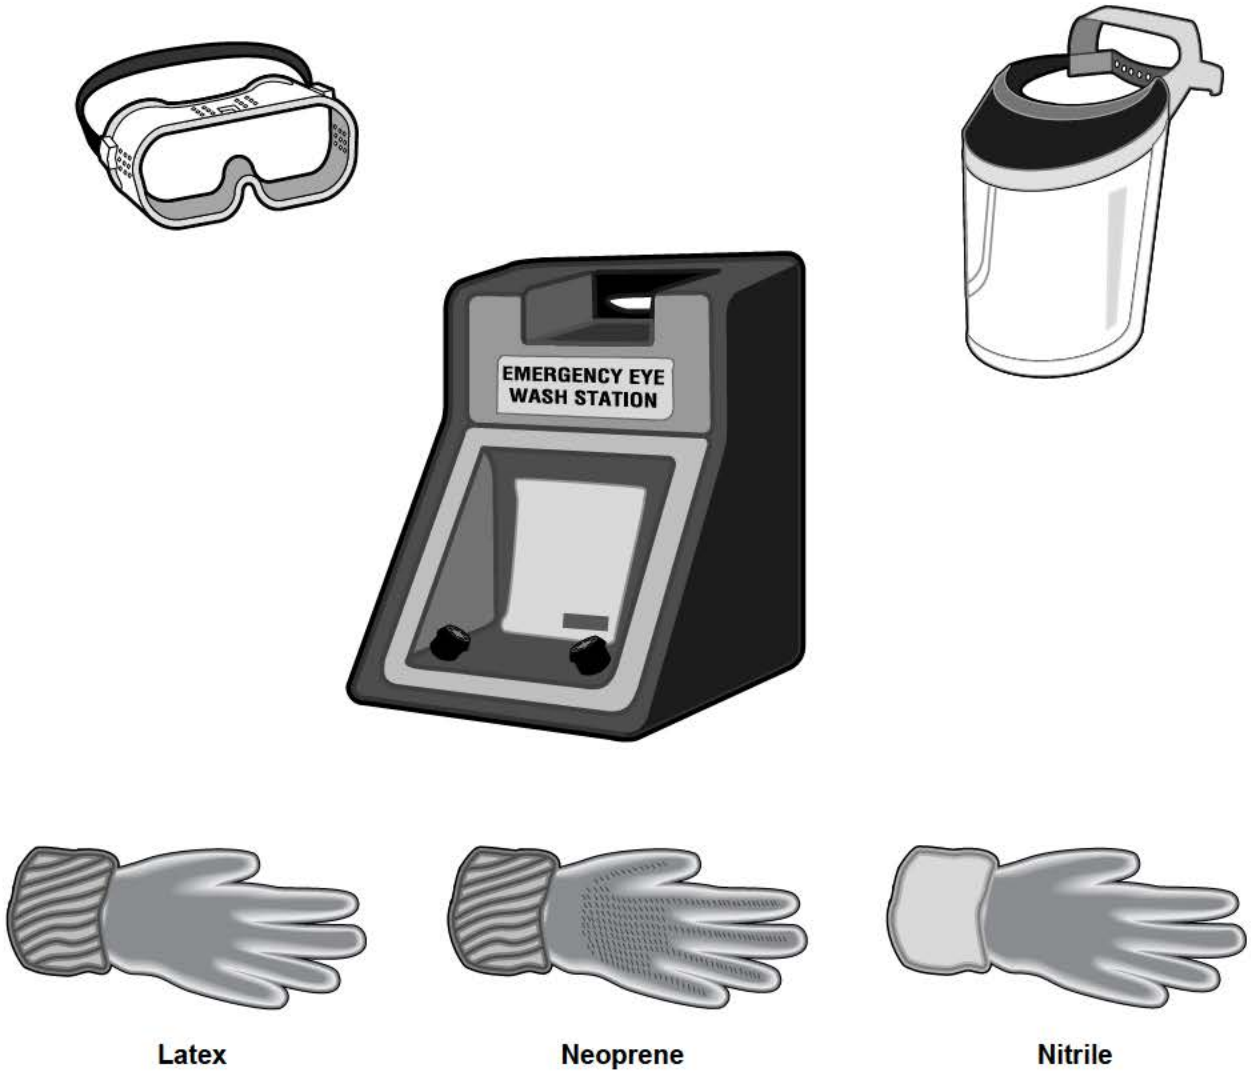

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2684 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

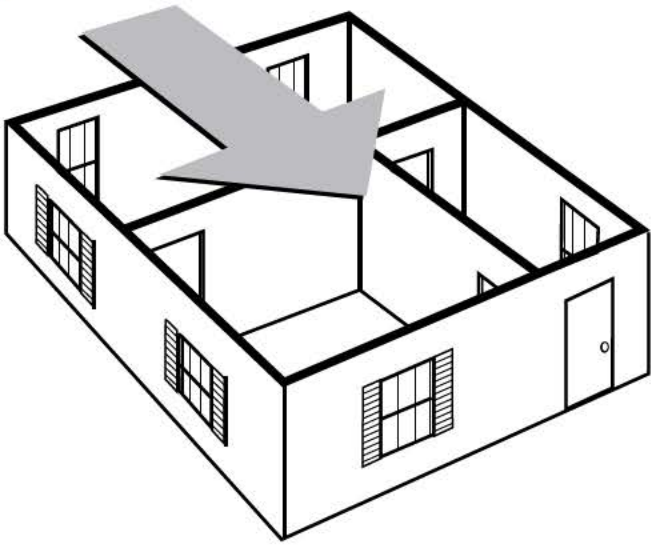

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

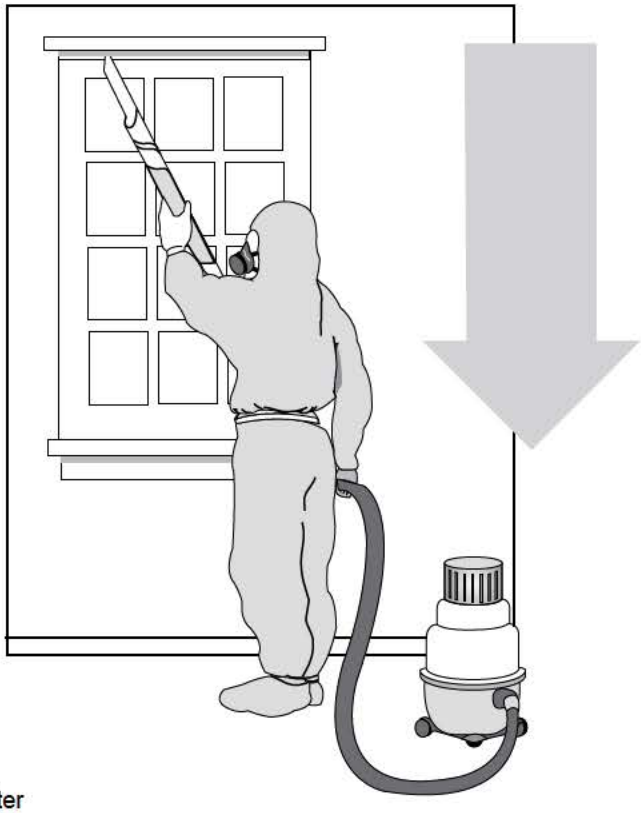

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2685 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2686 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

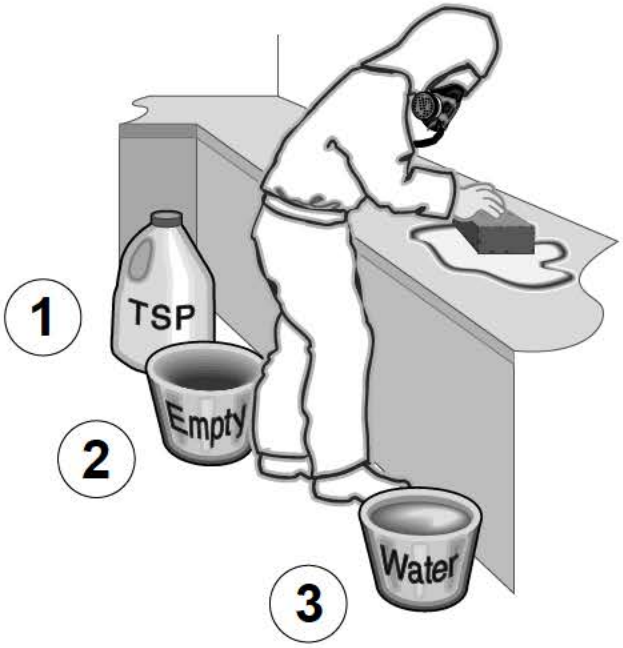

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2687 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

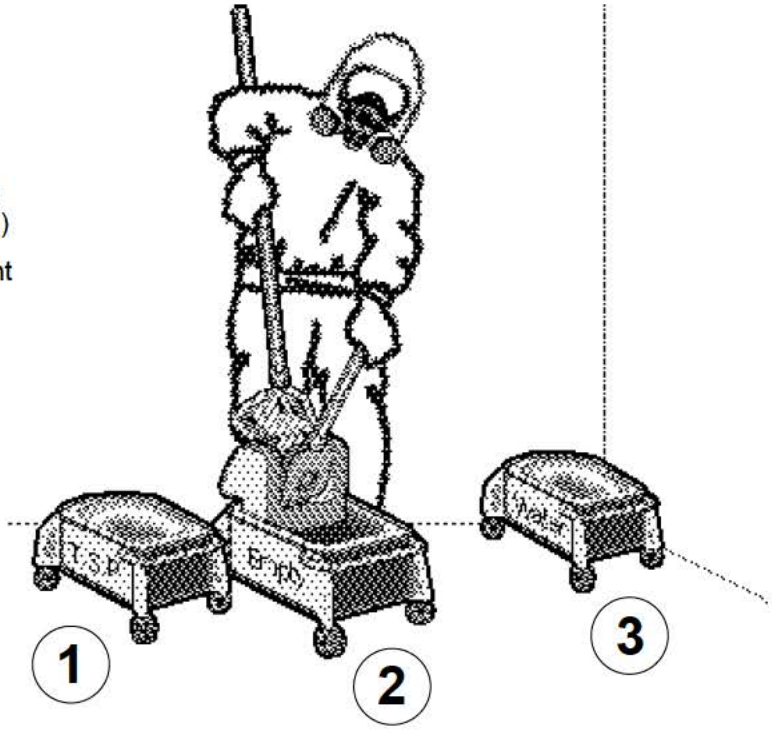

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

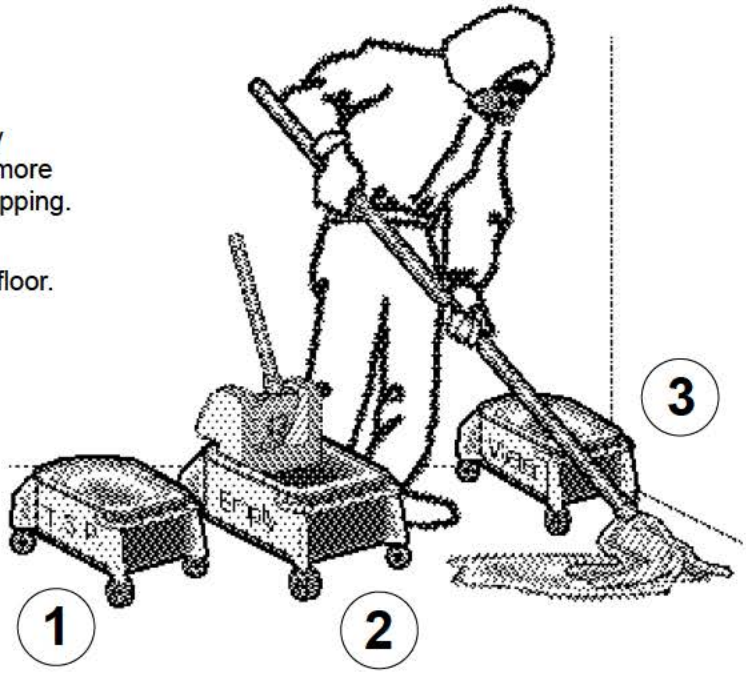

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2688 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

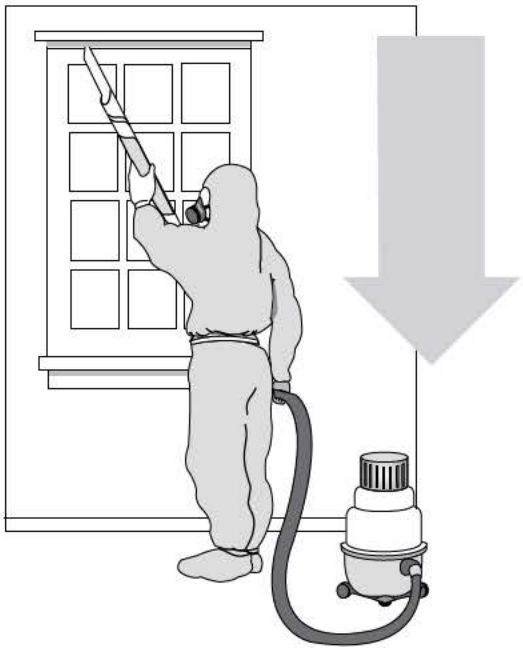

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2689 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2690 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2691 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2692 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2693 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2694 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2695 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2696 of 5269

BEST AVAILABLE COPY

APPENDIX G

SITE MAPS

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2697 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2698 of 5269

[redacted]

FIRE EVACUATION PLAN

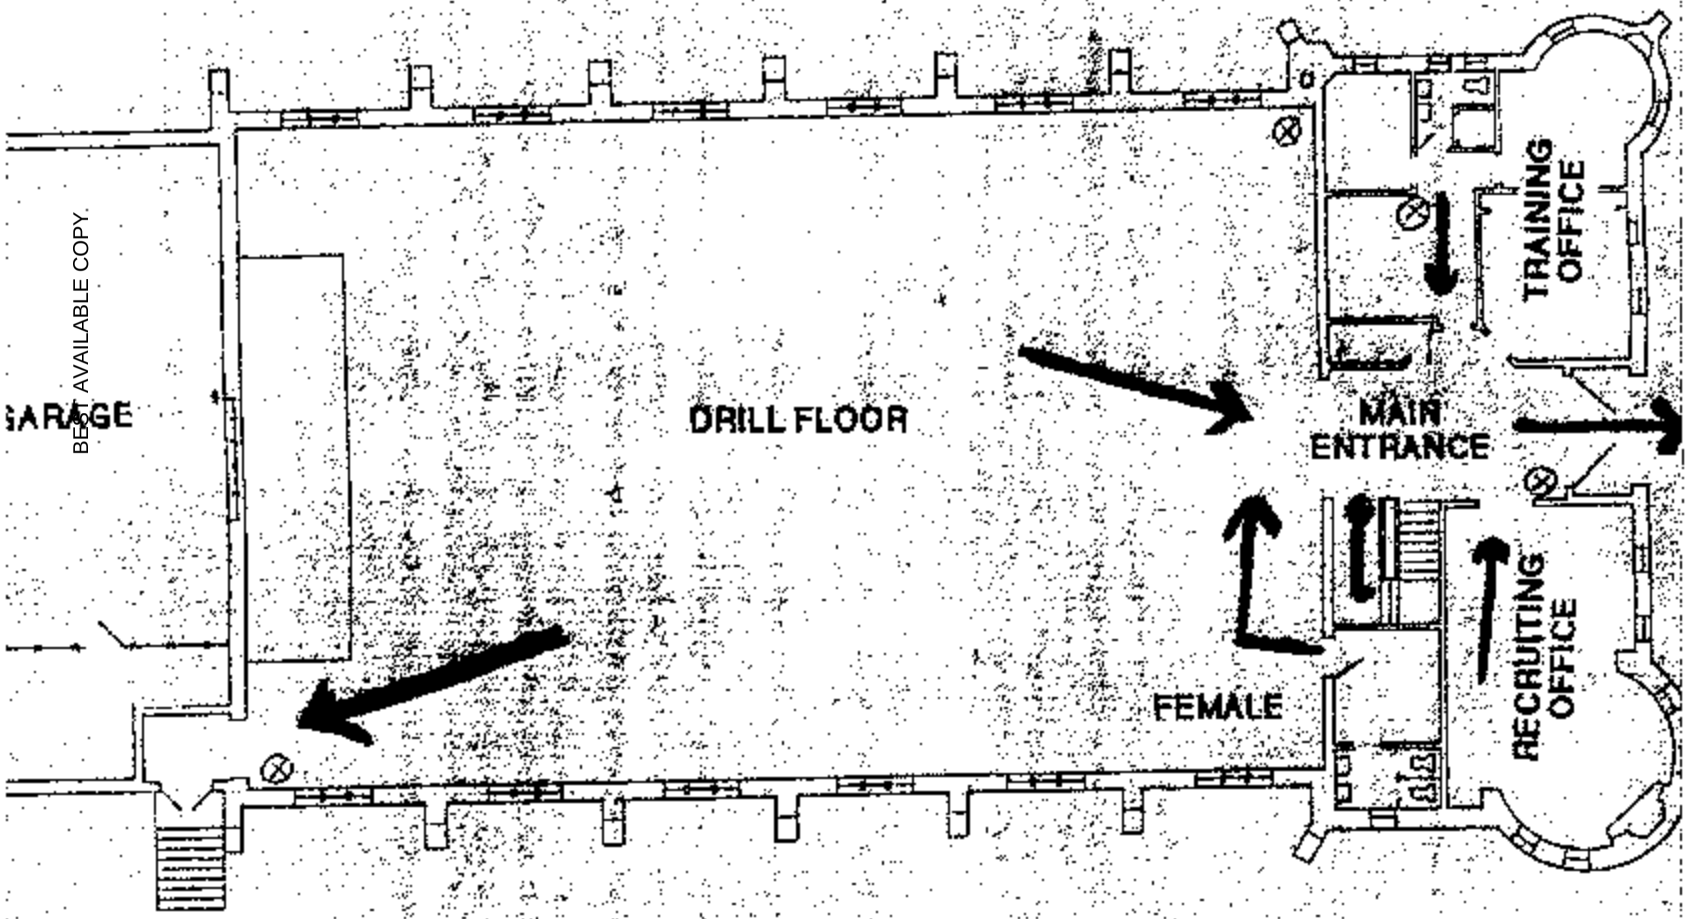

ELKTON ARMORY
FIRST FLOOR PLAN
NO SCALE

FIRE EXTINGUISHER ⊗

BEST AVAILABLE COPY

BEST AVAILABLE COPY

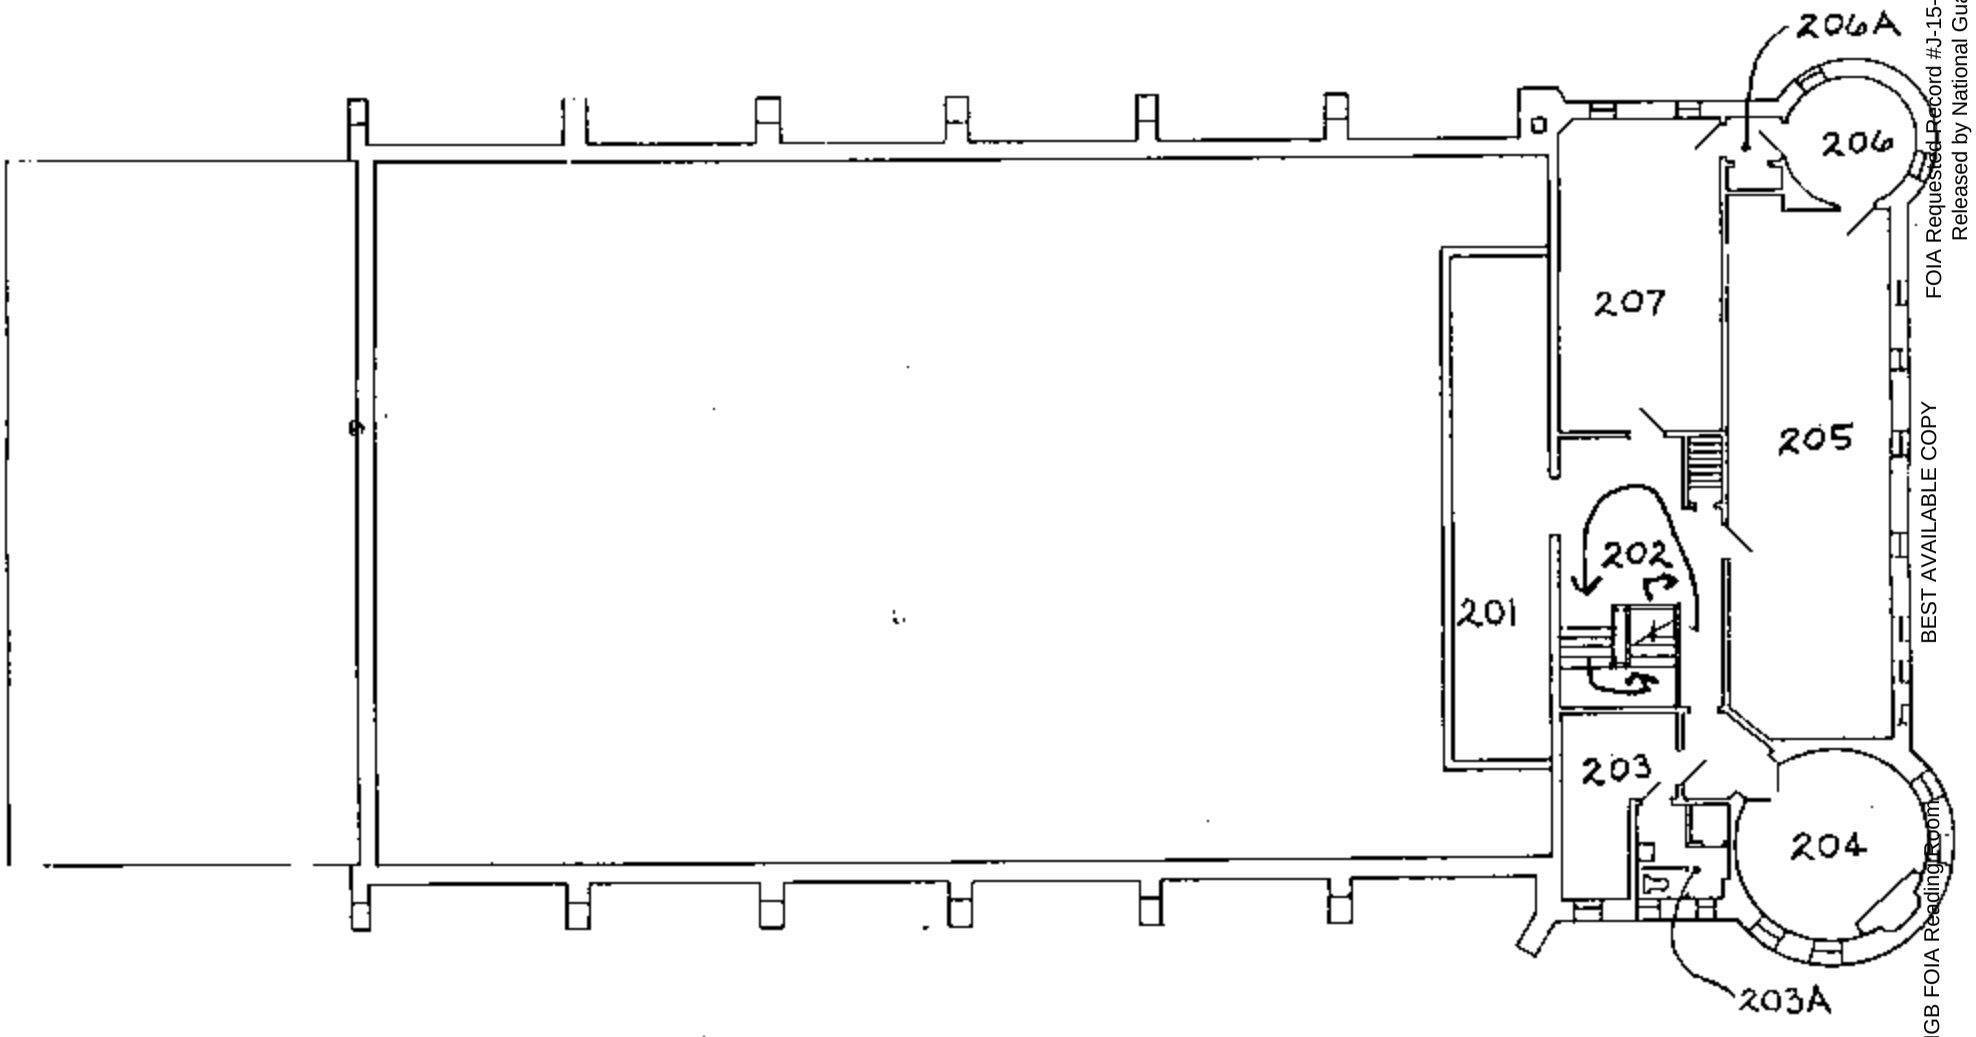

ELKTON ARMORY

SECOND FLOOR PLAN

NO SCALE

BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2699 of 5269

[redacted]

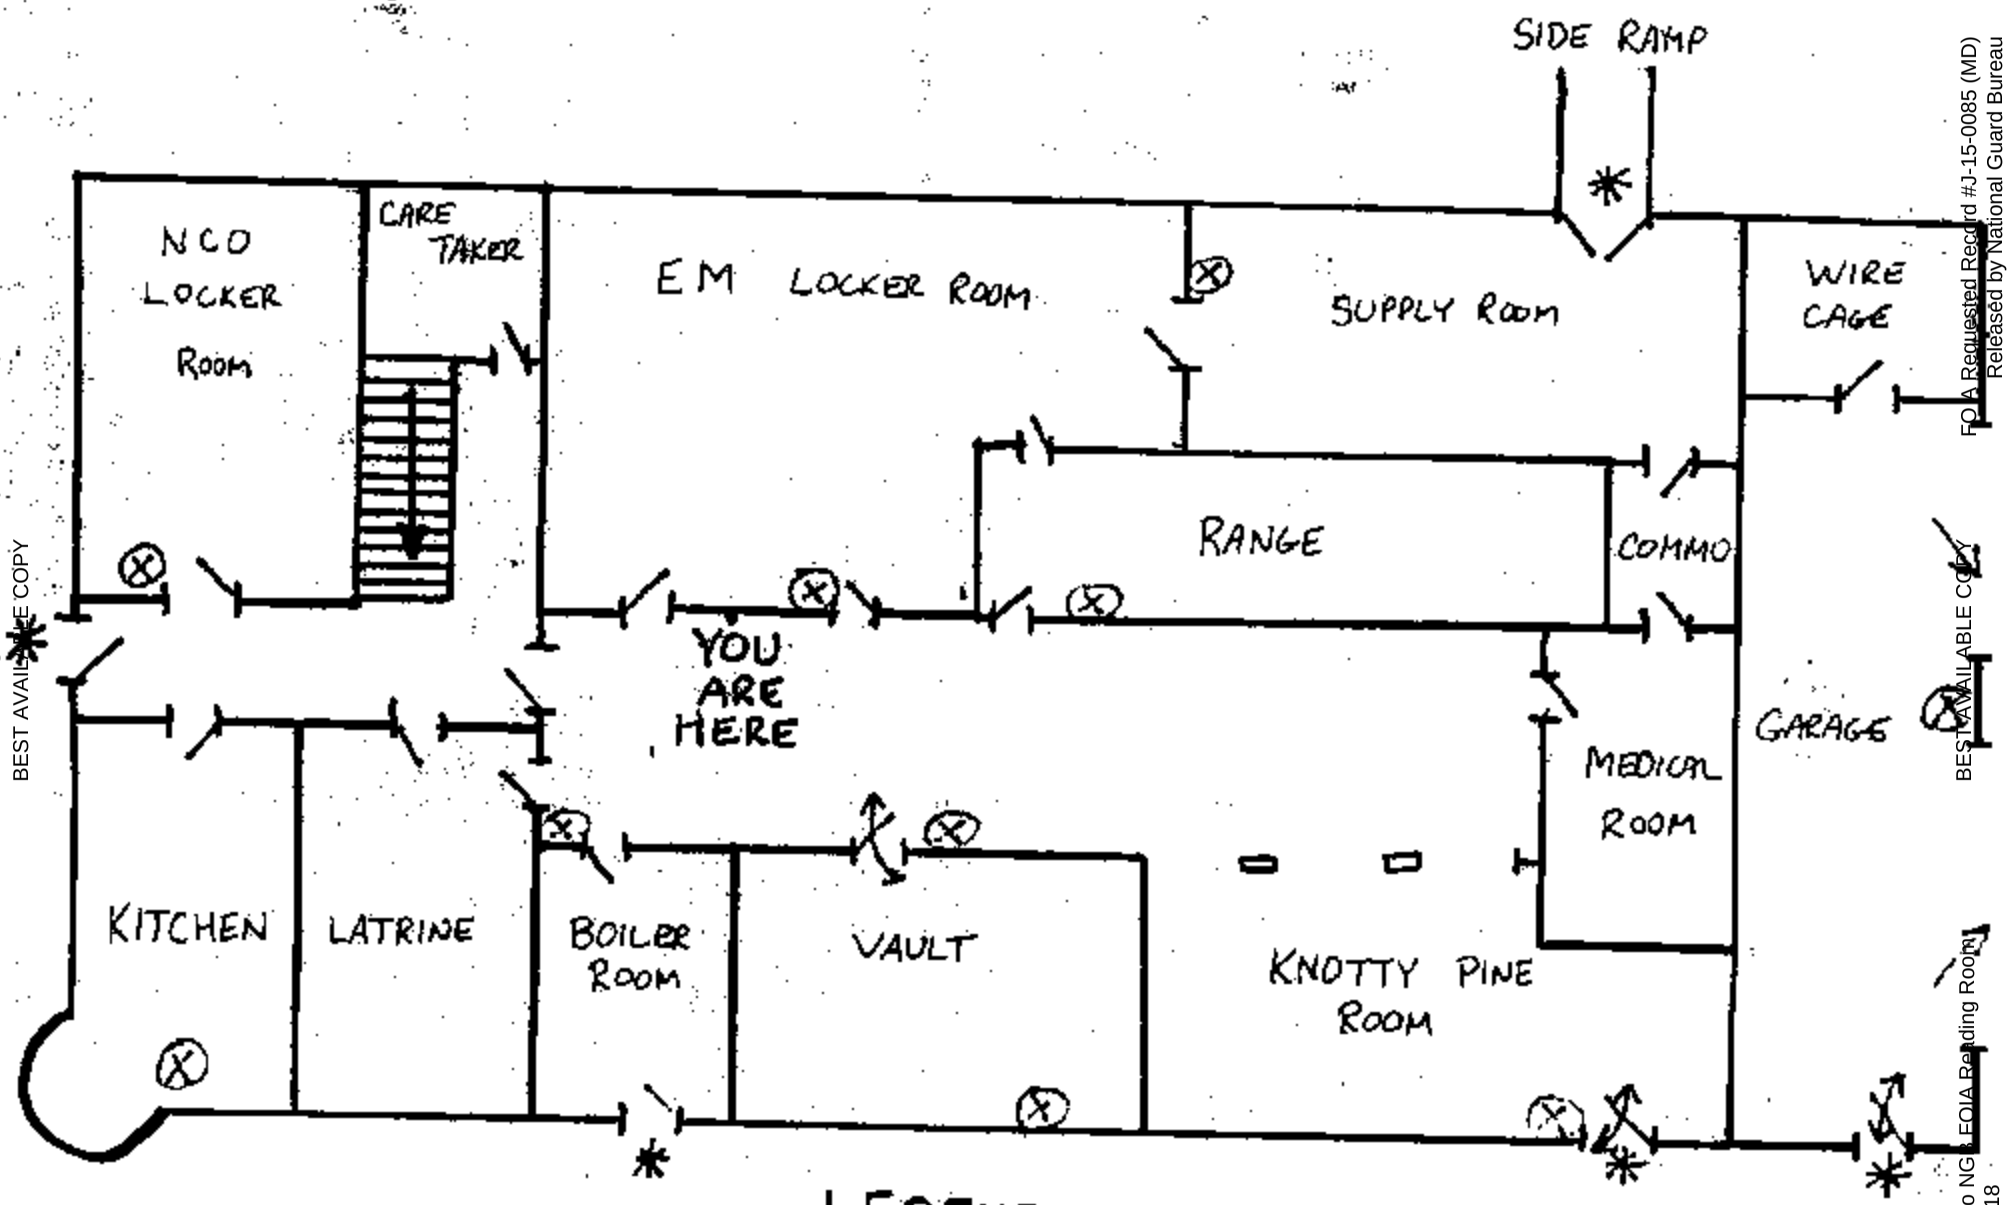

LEGEND:

* EXITS FOR FIRE
⊗ FIRE EXTINGUISHER

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2700 of 5269
Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

Industrial Hygiene Study

National Guard Facility
Elkton Readiness Center
101 Railroad Avenue
Elkton, Maryland
21921-5535

Prepared for:

National Guard Bureau Region North IH Office
301-IH Old Bay Lane
Havre de Grace, Maryland
21078

Prepared by:

The EI Group, Inc.
2101 Gateway Centre Blvd.
Morrisville, North Carolina
27560

Report Date: December 30, 2008

Project ID: IHMO080101.03

Non-Responsive [redacted]

Manager, Charlotte Operations

Non-Responsive [redacted]

Senior Industrial Hygienist

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2701 of 5269

TABLE OF CONTENTS

Executive Summary	3
Operation Description	4
Noise	4
Lead Testing	4
Lighting	6
Indoor Air Quality	6
Suspect ACBM	8
Maintenance Bay Inspection	8
Ventilation Assessment	8
Additional Items	9
Limitations	9
References	10

List of Appendices

Appendix A: Photographs

Appendix B: Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2702 of 5269

EXECUTIVE SUMMARY

An industrial hygiene survey was conducted August 7, 2008 at the Readiness Center Facility Identification No.495 located in Elkton, Maryland. The study was performed by Mr. Non-Responsive, CIH.

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lighting within the facility was also evaluated. Lighting was found to be within applicable recommended levels.

Various surfaces within the HVAC system and throughout the facility were screened for lead. The screening was completed using surface/wipe and air samples. None of the air samples collected were found to have detectable levels of the respective lead contaminant. Lead contamination was identified in the old firing range, top of kitchen refrigerator, hallway floor at arms vault and Maintenance Room shelf.

Indoor air quality parameters were also evaluated during the assessment. Indoor air quality was found to be within those parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE). The firing range is inactive but could have contributed to lead exposure to building occupants. Lead identified in the HVAC system could originate from outdoor environmental sources.

During the assessment, written programs for Health and Safety, NESHAP Operations and Maintenance Asbestos Survey, and the Hazard Communication Program were requested for review, however, the onsite personnel was not able to locate the documents.

Operation Description

The Elkton Readiness Center primarily serves as an office setting and equipment storage facility. The facility consists of a two story garage facility plus a basement response center that contains office spaces, decommissioned gun range, and storage areas.

The exterior walls of the building were constructed of a concrete block system (CBS) finished with stone. The interior walls were composed of concrete block and in some areas were finished with drywall or plaster. The roof of the facility consisted of a pitched shingle roof as well as a built-up roofing system. The heating, ventilating, and air conditioning system (HVAC) consisted of window unit air conditioners and a radiator heating system. The floors were composed of a poured concrete slab and in some areas were finished with 9”x9” and 12”x12” vinyl floor tiles. The ceilings were generally composed of wood decking and in some areas were finished with a suspended drop ceiling system.

An attached garage at the rear of the facility is equipped with an inoperable local exhaust ventilation system. Infrequent minor auto repairs are performed. The area is primarily used for cold weather storage.

Site personnel at the time of the site assessment consisted of 5 administrative personnel. The employees on site were conducting general administrative work.

Noise Survey

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lead Testing

At the time of the assessment, no activities were observed which may lead to lead exposure other than ammunition handling. The facility contains a converted locker room which was once an indoor firing range.

Various surfaces within the facility were screened for lead using surface/wipe samples and the collection of air samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 µm MCE cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, MD for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix B.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2704 of 5269

Lead Testing Results Summary

Location	Air ug/m^3	Surface ug/ft^2	Bulk	Chip %Pb
495-1: Range/Supply	<2.1			
495-5: Air Blank	<3			
495-3: Supply Clerk	<2.2			
495-L-4: B01				0.11
495-L-6: 101				**0.97**
495-L-7: 102				0.19
495-L-10: 205A				0.098
495-L-11: 203A				**4.5**
495-L-1: B-11 Range		110		
495-L-2: B-08 Arms Vault		130		
495-L-3: B01 Shelf Top		**470**		
495-L-5: B04 Kitchen Fridge top		**3,200**		
495-L-8: 107 Floor		<110		
495-L-9: 203A Floor		<110		
495-L-12: Blank		<12		
Criteria	**50**	**200**	**5,000**	**0.5**

Key: ND – None Detected
PB – Lead

Detectable levels of lead were identified in the former range, arms vault, maintenance office and kitchen. The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying contaminated surfaces. In the" Derivation of Wipe Surface Screening Levels for Environmental Chemicals", the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, HUD levels of 40 µg/ft^2 on floors and 250 µg/ft^2 on windowsills should be observed.

No detectable levels of lead were identified in those air samples collected. Currently, OSHA observed an 8-hour time weighted average of 50 ug/m^3.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2705 of 5269

Deteriorated paint was observed throughout the facility. Delaminated paint was mostly due to age along with prolonged exposure to elevated humidity levels. Lead-based paint chips were identified in the drill hall and 2nd floor latrine.

Lighting

A lighting assessment was conducted throughout the facility. The survey was conducted with large bay doors closed. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. 98047EL). The light meter was last calibrated on February 22, 2008. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
101: Drill Floor	57-109	30-50	Yes
102: Latrine	39-62	5	Yes
109: Office	47-59	30-50	Yes
107: Office	39-58	30-50	Yes
108: Latrine	30-51	5	Yes
106: Office	52-64	30-50	Yes
103: Recruiter	7-14	30-50	**NO**
207: Locker	26-51	7	Yes
205: Classroom	29-66	30-50	Yes
Basement Hall	56-78	5	Yes
B11: Storage/Range	30-90	30	Yes
B03: Locker	17-23	7	Yes
B10: Supply Clerks	44-120	30-50	Yes
B01: Maintenance	21-93	75	Yes
B05: Latrine	36-58	5	Yes
B05: Locker/Latrine	24-49	7	Yes
B04: Kitchen	28-63	50	Yes

Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a Fluke IAQ Meter, Model 975. The IAQ Meter was last calibrated in April 2008.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2007). The US Army Technical Guide 277, Army Facilities Management Information

Document on Mold Remediation Issues, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population.

The temperature readings from the interior of the structure ranged from 71.6 to 84.2 °F with relative humidity readings ranging from 45.2 to 65.5%. During the survey, CO_2 levels ranged from 480 to 702 ppm.

Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,098 ppm (398 ppm + 700 ppm). The results of the testing met the ASHRAE guidelines.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	72.6	58.2	398	0
Basement Hall	78.6	**60.6**	533	0
B-11 Storage/Range	78.8	**61.2**	519	0
Basement Locker	78.3	**60.9**	527	0
Supply Room-B10	78.0	**61.0**	528	0
Maintenance Office-B01	78.4	**61.7**	541	0
Latrine-B05	77.9	**65.4**	567	0
Locker-B07	78.9	**65.5**	519	0
Kitchen-B04	79.7	**62.5**	702	0
Drill Floor-101	84.2	52.8	480	0
Men's Latrine-102	82.5	48.0	615	0
Storage-109	73.4	45.8	604	0
Office-107	71.6	47.2	518	0
Latrine-108	77.2	46.9	509	0
Office-106	72.5	45.2	622	0
Recruiter-103	79.7	**60.6**	615	0
Classroom-207	84.2	53.5	538	0
Classroom-205	84.4	53.5	522	0
Criteria	**73.0-79.0**	**30-50**	**<1,084**	**<9.0**

Elevated humidity levels were identified throughout the basement area, likely due to insufficient exhaust ventilation associated with the shower facilities.

Limited fungal growth was identified in the Locker Room B03 and appears to be caused by sub-grade water intrusion.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2707 of 5269

Water damaged ceiling tiles/ceiling materials were identified in 101 (Drill Hall), 110, 109, 207, 205, 203, 203A, B06 as well as in B05.

Air samples were collected from several areas indoors. Rooms B03, 103 and 207 were assessed as well as outside as control. A tape sample was collected of suspect fungal growth observed in Room B03. Indoor concentrations ranged from 1,100 spores/m^3 to 2,200 spores/m^3 compared to an outdoor concentration of 16,000 spores/m^3. Indoor samples were found to have similar rank order. Based on the review of sample data, indoor air quality in relation to airborne fungal spore counts appear to be acceptable.

The tape lift sample collected in room B03 was found to have moderate levels of *Cladosporium* (81,000 spores/in^2), few counts of *Aureobasidium* (9,720 spores/in^2) and hyphal fragments (11,900 spores/in^2).

Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials include sheetrock/joint compound, plaster wall and ceiling systems, floor tiles and associated mastic, and vinyl covebase. Thermal system insulation was found to be a combination of paper wrapped fiberglass with PVC elbows as well as canvas wrapped fiberglass and air cell TSI in basement. Approximately 15 linear feet of the air cell is damaged and should be removed.

One air sample for asbestos was collected in the basement maintenance room with a concentration of 0.007 fibers/cc.

Maintenance Bay

The maintenance bay was not found to contain a local exhaust ventilation system which was not operable. Site personnel suggest that the bay is generally used for cold weather storage only.

The maintenance bay was found to contain custodial items, tools, waste motor oil, ladders and flammable storage cabinet. The flammable storage cabinet contained various paints and cleaning solvents.

PPE identified in the site included safety glasses and chemical gloves. Materials were kept in good, clean condition.

Ventilation System Assessment

The facility was found to boiler operated radiant heating and window unit air conditioners. A closed system boiler is located in the boiler room.

The LEV system located in the garage was not operable at the time of the assessment. The system consists of one main fan and three flex duct branches.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2708 of 5269

Additional Items

No O&M plan could be identified. Initiate an O&M Plan for the asbestos containing materials or presumed asbestos containing materials. Maintain a copy of the O&M Plan onsite at all times.

Conduct a cleaning of the kitchen and maintenance office for removal of surface lead.

Efflorescence was noted on the outdoor fuel tank, which is covered in a concrete material. The builder of the tank system suggests that the original waterproofing of top mounted piping and hardware should be reapplied as well as the full application of waterproofing agent.

Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicated within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and The EI Group, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2709 of 5269

References

Title 29 Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration.

Lead - (29 CFR 1910.1025(h))

American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2008 Edition

Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

Georgia Army National Guard: Standard Army Safety and Occupational Health Inspection Checklist; 1 October 1999 Edition

ANSI Z358.1 – 2004, Emergency Eye Wash and Shower Equipment

American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62-1-2007.

RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

National Emission Standard Hazardous Air Pollutants (NESHAP) - The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3))

Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

BEST AVAILABLE COPY

Appendix A

Photographs

BEST AVAILABLE COPY

Damaged ACM in basement hallway

Visible fungal growth on wall of B03

Exterior View of facility

Efflorescence on rear fuel storage tank

LEV fan in maintenance bay

Typical water damage of ceiling materials on second floor

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

Mike Bu
804 901 2350

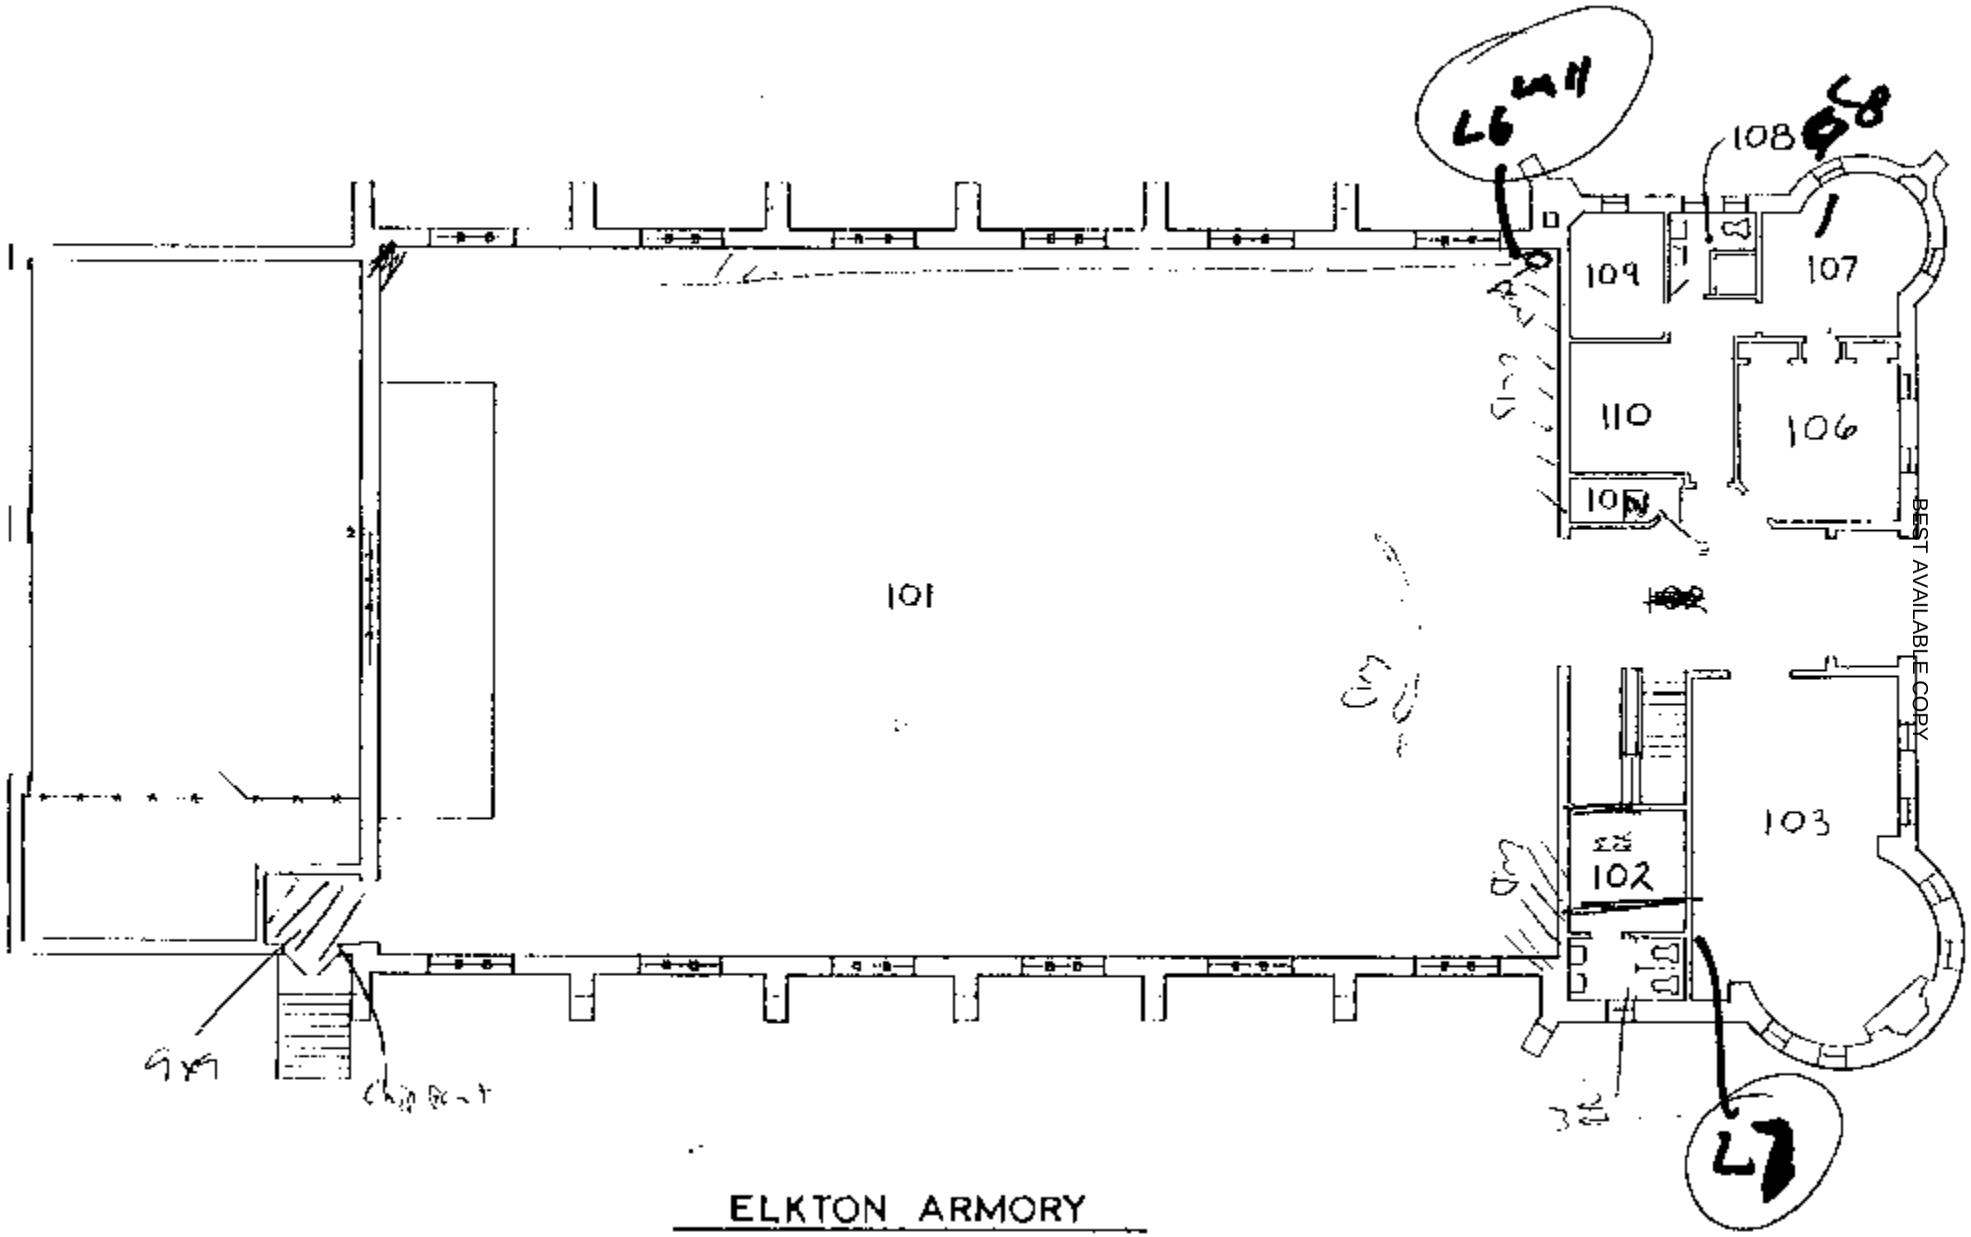

ELKTON ARMORY
FIRST FLOOR PLAN
NO SCALE

24/10/95

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

207 84.2
S2.5
D
S3D
26-51

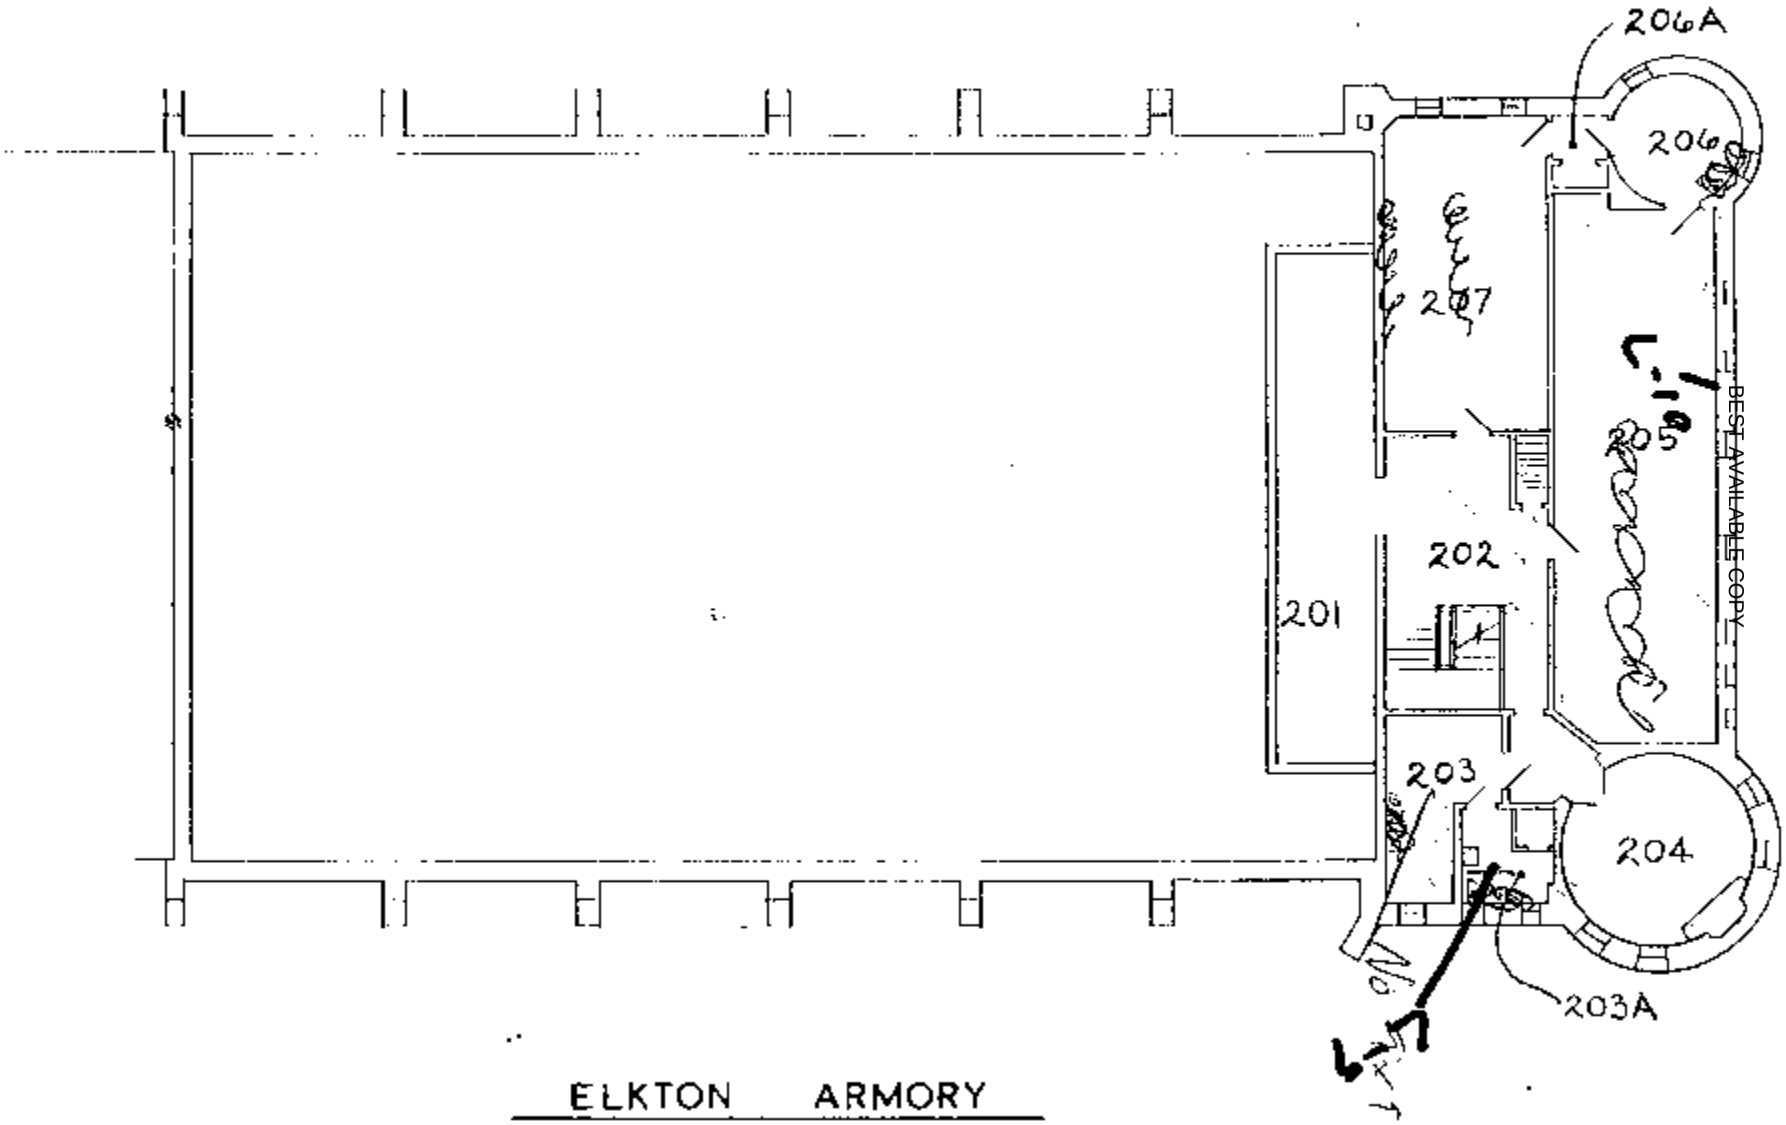

ELKTON ARMORY

SECOND FLOOR PLAN
NO SCALE

24/10/95

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2716 of 5269
BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

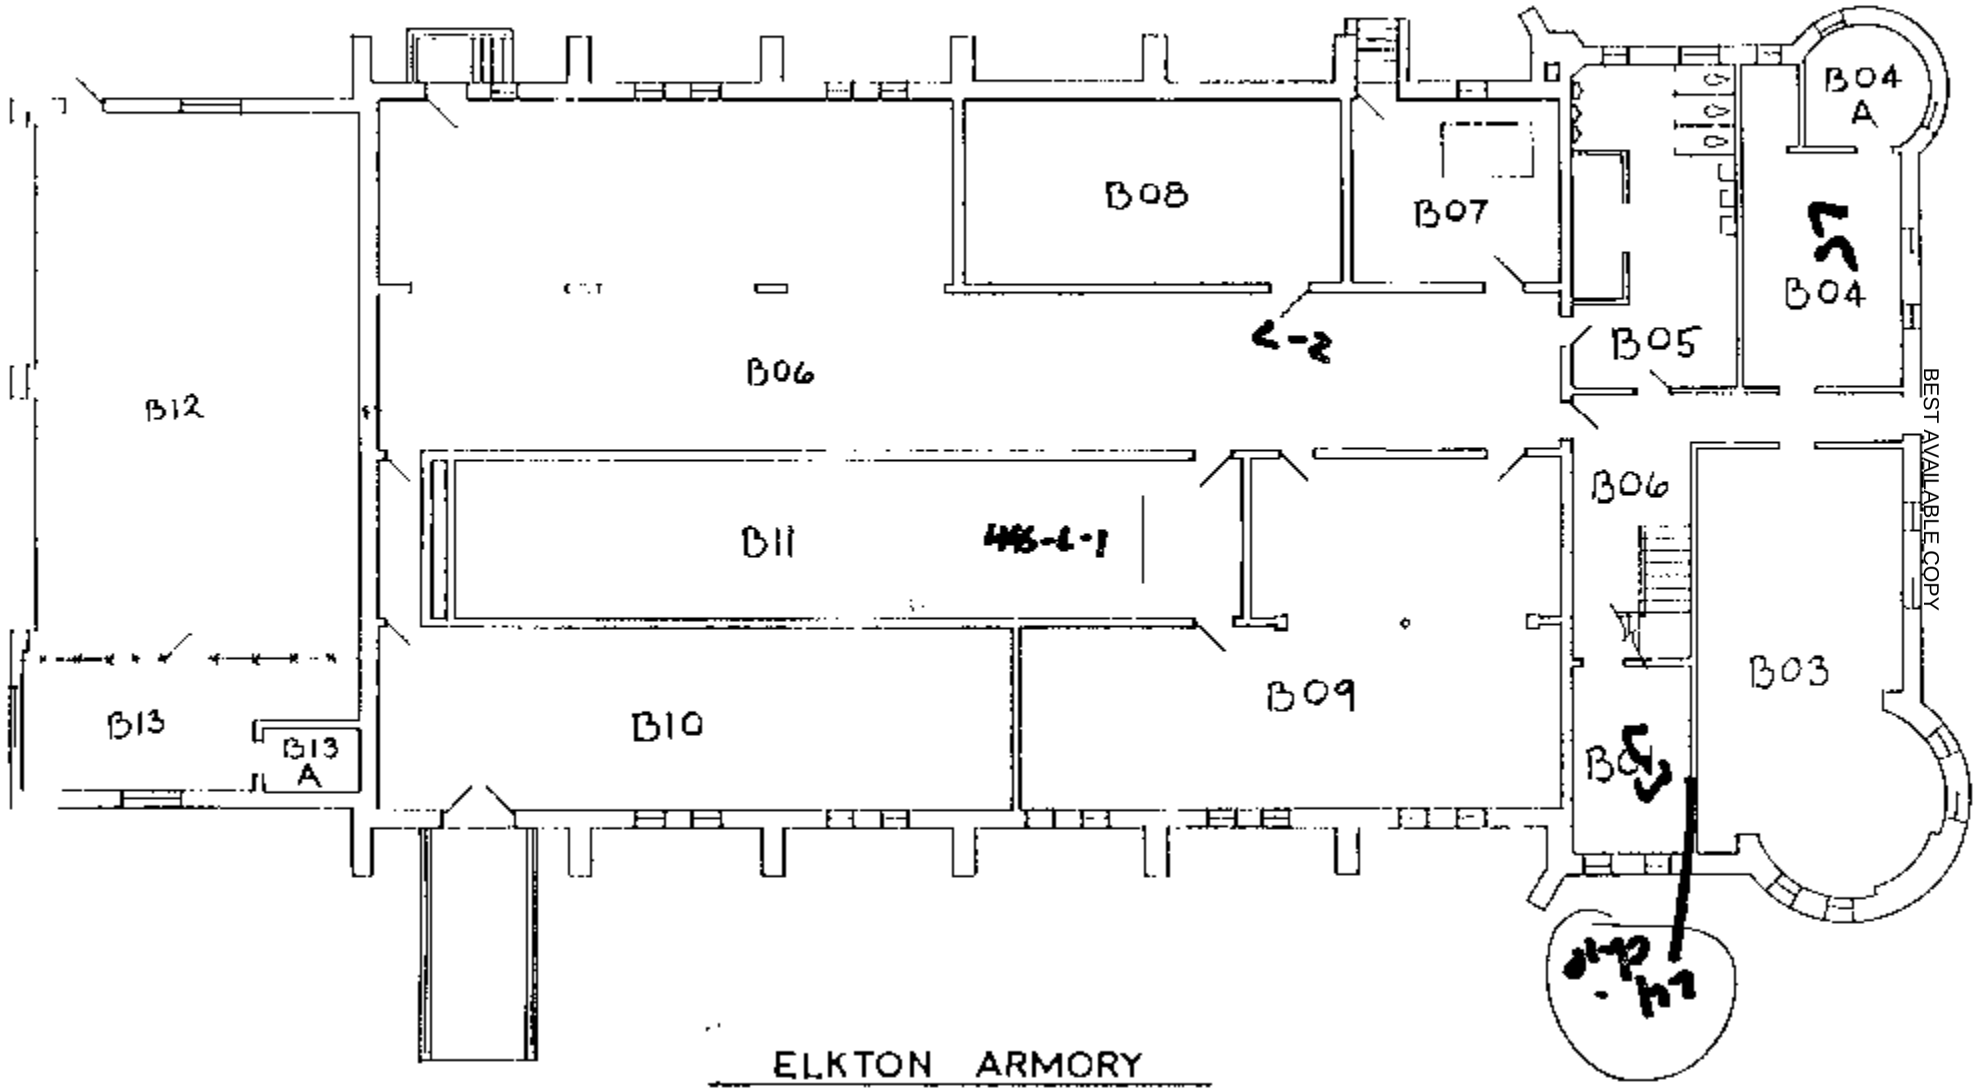

ELKTON ARMORY
BASEMENT FLOOR PLAN
NO SCALE

24/10/95

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2717 of 5269

Appendix B

Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Invoice: 95263

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI	**Job Location:**	Not Provided	**Date Submitted:**	10/1/2008
	State Military Reservation	**Job Number:**	Not Provided	**Date Analyzed:**	10/8/2008
	Havre de Grace, Maryland	**P.O. Number:**	Not Provided	**Date Invoiced:**	10/8/2008
	21078			**Person Submitting:**	Non-Responsive

Attention: Non-Responsive

AMA Sample #	Client Sample #	Analysis and Sample Type	Turn Around	Cost	Additional Analysis and Sample Type *	Turn Around *	Additional Cost *	Total Cost
0882197	495-1	AA Lead Air	5 Day +	$8.00				$8.00
0882198	495-5	AA Lead Air	5 Day +	$8.00				$8.00
0882199	495-3	AA Lead Air	5 Day +	$8.00				$8.00
0882200	495-L-4	AA Lead Paint	5 Day +	$9.00				$9.00
0882201	495-L-6	AA Lead Paint	5 Day +	$9.00				$9.00
0882202	495-L-7	AA Lead Paint	5 Day +	$9.00				$9.00
0882203	495-L-10	AA Lead Paint	5 Day +	$9.00				$9.00
0882204	495-L-11	AA Lead Paint	5 Day +	$9.00				$9.00
0882205	495-L-1	AA Lead Wipe	5 Day +	$8.00				$8.00
0882206	495-L-2	AA Lead Wipe	5 Day +	$8.00				$8.00
0882207	495-L-3	AA Lead Wipe	5 Day +	$8.00				$8.00
0882208	495-L-5	AA Lead Wipe	5 Day +	$8.00				$8.00
0882209	495-L-8	AA Lead Wipe	5 Day +	$8.00				$8.00
0882210	495-L-9	AA Lead Wipe	5 Day +	$8.00				$8.00
0882211	495-L-12	AA Lead Wipe	5 Day +	$8.00				$8.00
0882212	M-495-3	MLD Spore Trap	5 Day +	$30.00				$30.00
0882213	M-495-4	MLD Spore Trap	5 Day +	$30.00				$30.00
0882214	M-495-5	MLD Spore Trap	5 Day +	$30.00				$30.00
0882215	M-495-6	MLD Spore Trap	5 Day +	$30.00				$30.00
0882216	495-3A	MLD Surface Tape	5 Day +	$21.00				$21.00
0882195	495-4	PCM Air	5 Day +	$10.00				$10.00
0882196	495-2	PCM Air	5 Day +	$10.00				$10.00

Note: Payment Due Upon Receipt.

Note: All Accounts over 30 days are subject to a 1½% per month service charge.

* Only apply if additional analysis was performed on the sample(s)

Account Code: NATLG

Remit to: P.O. Box 646, Hanover, Maryland 21076, 410-684-3327

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Invoice: 95263

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI	**Job Location:**	Not Provided	**Date Submitted:**	10/1/2008
	State Military Reservation	**Job Number:**	Not Provided	**Date Analyzed:**	10/8/2008
	Havre de Grace, Maryland	**P.O. Number:**	Not Provided	**Date Invoiced:**	10/8/2008
	21078			**Person Submitting:**	Non-Responsive [redacted]

Attention: Non-Responsive [redacted]

AMA Sample #	Client Sample #	Analysis and Sample Type	Turn Around	Cost	Additional Analysis and Sample Type *	Turn Around *	Additional Cost *	Total Cost

Sub-Total:	**$286.00**
Additional Charge:	**$0.00**
Total:	**$286.00**

Note: Payment Due Upon Receipt.

Note: All Accounts over 30 days are subject to a 1½% per month service charge.

* Only apply if additional analysis was performed on the sample(s)

Account Code: NATLG

Remit to: P.O. Box 646, Hanover, Maryland 21076, 410-684-3327

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihalap.org for details 100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008	**Report Date:**	9/9/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0882197	495-1	Flame	Air	1410	N/A	2.13	ug/m³	<	2.1	ug/m³	
0882198	495-5	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0882199	495-3	Flame	Air	1343	N/A	2.23	ug/m³	<	2.2	ug/m³	
0882200	495-L-4	Flame	Paint Chip	****	N/A	0.01	%Pb		0.11	%Pb	
0882201	495-L-6	Flame	Paint Chip	****	N/A	0.01	%Pb		0.97	%Pb	
0882202	495-L-7	Flame	Paint Chip	****	N/A	0.01	%Pb		0.19	%Pb	
0882203	495-L-10	Flame	Paint Chip	****	N/A	0.01	%Pb		0.098	%Pb	
0882204	495-L-11	Flame	Paint Chip	****	N/A	0.01	%Pb		4.5	%Pb	
0882205	495-L-1	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882206	495-L-2	Flame	Wipe	****	0.108	111.52	ug/ft²		130	ug/ft²	
0882207	495-L-3	Flame	Wipe	****	0.108	111.52	ug/ft²		470	ug/ft²	
0882208	495-L-5	Flame	Wipe	****	0.108	111.52	ug/ft²		3200	ug/ft²	
0882209	495-L-8	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882210	495-L-9	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0882211	495-L-12	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #: 16-0085 (MD)
Released by National Guard Bureau
Page 2721 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihalapp.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008 **Report Date:** 9/9/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson

Technical Manager: G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-00085 (NG)
Released by National Guard Bureau
Page 2722 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16553

Analysis Type:	Flame
Sample Type	Air
Analysis Date:	9/9/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.021	ppm			Acceptable
Report Limit Verification Sample		0.2096	ppm	83.8%		Acceptable
Expected Spike Level (ppm)	0.25					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				104.24%		Acceptable
Spike Duplicate				104.69%	0.43%	Acceptable
Laboratory Control Sample 1		133.054	µg	103.51%		Acceptable
Laboratory Control Sample 2		126.233	µg	103.92%	0.39%	Acceptable

Calibration Information

Correlation of Calibration Curve 0.999875

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181397	81899	486-1
181397	81900	486-2

SDG Number: 16553

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2723 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181397	81901	486-3
181401	82176	5-1
181401	82177	5-2
181401	82178	5-3
181401	82179	5-4
181430	82197	495-1
181430	82198	495-5
181430	82199	495-3
182583	82391	LOC-104
182583	82392	LOC-105
182583	82393	LOC-106
182583	82394	LOC-107
182583	82395	LOC-108
182583	82396	LOC-109

SDG Number: 16553

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2724 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16552

Analysis Type: Flame
Sample Type: Paint Chip
Analysis Date: 9/8/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.031	ppm			Acceptable
Report Limit Verification Sample		0.3418	ppm	102.6%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1		9723	mg/Kg			
Duplicate Sample 2		8821	mg/Kg		9.73%	Acceptable
Matrix Spike Analysis						
Spiked Sample				92.45%		Acceptable
Spike Duplicate				94.00%	1.66%	Acceptable
Laboratory Control Sample 1		528.377	µg	110.78%		Acceptable
Laboratory Control Sample 2		429.110	µg	94.52%	15.84%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999853

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181397	81909	486-11
181397	81910	486-12

SDG Number: 16552

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2725 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181397	81911	486-13
181397	81912	486-14
181430	82200	495-L-4
181430	82201	495-L-6
181430	82202	495-L-7
181430	82203	495-L-10
181430	82204	495-L-11
181404	82235	487-7
181404	82236	487-9
181404	82237	487-10
181417	82254	C1
181417	82255	C2
176586	82328	CBC080908-10
176586	82329	CBC080908-11

SDG Number: 16552

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2726 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16550

Analysis Type:	Flame
Sample Type:	Wipe
Analysis Date:	9/9/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.051	ppm			Acceptable
Report Limit Verification Sample		0.302	ppm	90.6%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				93.21%		Acceptable
Spike Duplicate						Acceptable
Laboratory Control Sample 1		304.012	µg	99.98%		Acceptable
Laboratory Control Sample 2		291.358	µg	100.69%	0.71%	Acceptable

Calibration Information

Correlation of Calibration Curve 0.999884

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181430	82205	495-L-1
181430	82206	495-L-2

SDG Number: 16550

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2727 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181430	82207	495-L-3
181430	82208	495-L-5
181430	82209	495-L-8
181430	82210	495-L-9
181430	82211	495-L-12
181417	82248	W1
181417	82249	W2
181417	82250	W3
181417	82251	W4
181417	82252	W5
181417	82253	W6

SDG Number: 16550

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2728 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
Attention:	Non-Responsive	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/10/2008

AMA Sample #	0882212		**AMA Sample #**	0882213	
Client ID	M-495-3		**Client ID**	M-495-4	
Analyst ID	TLW		**Analyst ID**	TLW	
Collection Apparatus	Allergenco		**Collection Apparatus**	Allergenco	
Sample Volume (L)	75		**Sample Volume (L)**	75	
Analytical Sensitivity (sp/m³)	55		**Analytical Sensitivity (sp/m³)**	55	
Sample Condition	Acceptable		**Sample Condition**	Acceptable	

	Raw CT.	%	sp/m³		Raw CT.	%	sp/m³
Alternaria				**Alternaria**			
Ascospores	2	5.0%	110	**Ascospores**	2	5.9%	110
Aureobasidium				**Aureobasidium**			
Basidiospores	18	45.0%	991	**Basidiospores**	8	23.5%	441
Bipolaris/Drechslera/Helm.				**Bipolaris/Drechslera/Helm.**	1	2.9%	55
Boletus				**Boletus**			
Botrytis				**Botrytis**			
Cercospora				**Cercospora**			
Chaetomium				**Chaetomium**			
Cladosporium	2	5.0%	110	**Cladosporium**	8	23.5%	441
Coprinus				**Coprinus**			
Curvularia				**Curvularia**			
Epicoccum				**Epicoccum**			
Fusarium				**Fusarium**			
Ganoderma				**Ganoderma**			
Nigrospora				**Nigrospora**			
Penicillium / Aspergillus	4	10.0%	220	**Penicillium / Aspergillus**	5	14.7%	275
Pithomyces				**Pithomyces**	Present		< 55
Rusts				**Rusts**			
Smuts/Periconia/Myxomycetes	2	5.0%	110	**Smuts/Periconia/Myxomycetes**	4	11.8%	220
Stachybotrys				**Stachybotrys**			
Stemphylium				**Stemphylium**			
Trichoderma				**Trichoderma**			
Torula				**Torula**			
Ulocladium				**Ulocladium**			
Zygomycetes				**Zygomycetes**			
Other Colorless	12	30.0%	661	**Other Colorless**	6	17.6%	330
Unknown				**Unknown**			
Hyphal Fragments*				**Hyphal Fragments***	Present		< 55
				Trichocladium	Present		< 55
Totals Spore Concentration			2,200	**Totals Spore Concentration**			1,870
Location	B03			**Location**	103		
Comments				**Comments**			

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

BEST AVAILABLE COPY

4475 Forbes Blvd. Lanham, MD, 20706 (301) 459-2640 Toll Free (800) 346-0961 Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018
Released by National Guard Bureau
Page 2729 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
Attention:	Non-Responsive [redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/10/2008

AMA Sample #	0882214	**AMA Sample #**	0882215
Client ID	M-495-5	**Client ID**	M-495-6
Analyst ID	TLW	**Analyst ID**	TLW
Collection Apparatus	Allergenco	**Collection Apparatus**	Allergenco
Sample Volume (L)	75	**Sample Volume (L)**	75
Analytical Sensitivity (sp/m³)	55	**Analytical Sensitivity (sp/m³)**	55
Sample Condition	Acceptable	**Sample Condition**	Acceptable

	Raw CT.	%		sp/m³
Alternaria				
Ascospores	2	10.0%		110
Aureobasidium				
Basidiospores	3	15.0%		165
Bipolaris/Drechslera/Helm.				
Boletus				
Botrytis				
Cercospora				
Chaetomium				
Cladosporium	2	10.0%		110
Coprinus				
Curvularia				
Epicoccum	Present		<	55
Fusarium				
Ganoderma				
Nigrospora				
Penicillium / Aspergillus	2	10.0%		110
Pithomyces	Present		<	55
Rusts	1	5.0%		55
Smuts/Periconia/Myxomycetes	2	10.0%		110
Stachybotrys				
Stemphylium				
Trichoderma				
Torula				
Ulocladium				
Zygomycetes				
Other Colorless	8	40.0%		441
Unknown				
Hyphal Fragments*				
Totals Spore Concentration				1,100

Location 207

Comments

	Raw CT.	%		sp/m³
Alternaria	2	0.7%		110
Ascospores	63	21.6%		3,470
Aureobasidium				
Basidiospores	46	15.8%		2,530
Bipolaris/Drechslera/Helm.	Present		<	55
Boletus				
Botrytis				
Cercospora	Present		<	55
Chaetomium				
Cladosporium	130	44.7%		7,160
Coprinus				
Curvularia	1	0.3%		55
Epicoccum	2	0.7%		110
Fusarium				
Ganoderma				
Nigrospora	Present		<	55
Penicillium / Aspergillus	17	5.8%		936
Pithomyces	Present		<	55
Rusts				
Smuts/Periconia/Myxomycetes	13	4.5%		716
Stachybotrys				
Stemphylium				
Trichoderma				
Torula	Present		<	55
Ulocladium				
Zygomycetes				
Other Colorless	13	4.5%		716
Unknown				
Hyphal Fragments*	1			55
Peronospora/Oidium	3	1.0%		165
Pyricularia	1	0.3%		55
Totals Spore Concentration				16,000

Location Out

Comments

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room May, 2018

FOIA Request Date: 18-0-F-0085 (MD) Released by National Guard Bureau Page 2730 of 5269

AMA Analytical Services, Inc. BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
Attention:	Non-Responsive [redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/10/2008

General Comments, Disclaimers, and Footnotes

Analytical Method: Sample are analyzed following the instructions and guidelines outlined in AMA Analytical Services, Inc. SOP 901.

Sample Condition: Acceptable: The sample was collected and delivered to the our location without disturbing the material on the sampling media.

Unacceptable: 1. The sample is overloaded with material. 2. The sample trace has been disturbed. 3. The sample was not collected properly.

Obscured: The loading on the sample is high, possibly obscuring spores present. The quantity reported should be considered the minimum concentration present. The actual concentration may be higher than the reported concentration.

Spore Notes: Based on their small size and very few distinguishing characteristics, Aspergillus and Penicillium cannot be differentiated by non-viable sampling methods. There are other types of spores whose morphology is similar to Aspergillus and Penicillium and cannot be differentiated by non-viable sampling methods. Examples of these similar spores are Acremonium, Paecilomyces, Wallemia, and Trichoderma.

Smut, Periconia and Myxomycetes are three different types of organisms that have similar morphological characteristics.

Bipolaris/Dreschlera/Helm: Bipolaris / Dreschlera / Helminthosporium group.

Other Colorless represents all colorless spores that are non-distinctive and unidentifiable.

* Hyphal Fragments: A portion of the mycelium that becomes separated from the remainder of the thallus (vegetative body), each of which has the capacity to grow and form new individuals. Results for hyphal fragments are in fragments/m³ and are not incorporated in the total spore concentration.

Quantification: Analytical Sensitivity (A.S.): This is dependent on the volume of air collected and the amount of the trace that was analyzed.

The value of "Present" indicated in the Raw Count column represents the presence of this spore type during the preliminary exam at 400x. The Raw Count converts to a whole number if the spore type is encountered again during the 1,000x enumeration. The sp/m³concentration will be reported as less than the analytical sensitivity if "Present" is reported in the Raw Count.

Due to rounding, totals may not equal 100%

sp/m³: Spores per cubic meter.

Results are reported to 3 significant figures.

Tristan Ward

Analyst Tristan Ward

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Request Tracking Number 0085 (MD)
Released by National Guard Bureau
Page 2731 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

Quantitative Spore Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
Attention:	Non-Responsive	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/10/2008

AMA Sample #	0882216
Client ID	495-3A
Analyst ID	TLW
Sample Type	Tape
Sample Condition	Acceptable
Analytical Sensitivity	1080 sp/in²

	sp/in²	Loading
Alternaria		
Ascospores		
Aureobasidium	9,720	Few
Basidiospores		
Bip/Dresch/Helm		
Boletus		
Botrytis		
Cercospora		
Chaetomium		
Cladosporium	81,000	Moderate
Coprinus		
Curvularia		
Epicoccum		
Fusarium		
Ganoderma		
Nigrospora		
Pen/Asp Like		
Pithomyces		
Rusts		
Smuts/Peri/Myx		
Stachybotrys		
Stemphylium		
Trichoderma		
Torula		
Ulocladium		
Zygomycetes		
Other Colorless		
Hyphal Fragments	11,900	Few
Unknown		

Location B03

Comments

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

Quantitative Spore Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
Attention:	Non-Responsive	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/9/2008
				Report Date:	9/10/2008

General Comments, Disclaimers, and Footnotes

Sample Condition: **Acceptable: The sample was collected and delivered to the our location without disturbing the material on the sampling media.**

Unacceptable: 1. The sample is overloaded with material. 2. The sample was not collected properly.

Obscured: The loading on the sample is high, possibly obscuring spores present. The quantity reported should be considered the minimum concentration present. The actual concentration may be higher than the reported concentration.

Spore Notes: **Pen/Asp: Penicillium / Aspergillius. Based on their small size and very few distinguishing characteristics, Aspergillus and Penicillium cannot be differentiated by non-viable sampling methods. There are other types of spores whose morphology is similar to Aspergillus and Penicillium and cannot be differentiated by non-viable sampling methods. Examples of these similar spores are Acremonium, Paecilomyces, Wallemia, and Trichoderma.**

Smuts/Peri/Myx: Smut, Periconia and Myxomycetes are three different types of organisms that have similar morphological characteristics.

Bip/Dresch/Helm: Bipolaris / Dreschlera / Helminthosporium group.

Other Colorless represents all colorless spores that are non-distinctive and unidentifiable.

Hyphal Fragments: A portion of the mycelium that becomes separated from the remainder of the thallus (vegetative body), each of which has the capacity to grow and form new individuals.

Quantification: **Rare: <1,600 sp/in², Few: 1,600 to 16,000 sp/in², Moderate: >16,000 to 160,000 sp/in², Heavy: >160,000 sp/in².**

Analytical Sensitivity: Represents the value of one spore divided by the area analyzed.

sp/in²: Spores per inch squared.

Results are reported to 3 significant figures.

Analyst Tristan Ward

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client.

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Industrial Hygiene See aihalap.org for details

NY ELAP

Client:	National Guard Bureau	**Job Name:**	RC #495: Elkton, MD	**Chain Of Custody:**	181430		100470
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/7/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]		10920
		P.O. Number:	Not Provided	**Date Analyzed:**	9/9/2008	**Report Date:**	9/10/2008

Attention: [redacted]

Summary of Phase Contrast Microscopy

AMA Sample Number	Client Sample Number	Volume Sampled (Liters)	Fibers Per Millimeter Squared	Fibers Per Cubic Centimeter	Analyst I.D.	Sample Type	Comments
0882195	495-4	0	< 7.0 *	*****	CK	N/P	
0882196	495-2	1049.43	8.3	0.007	CK	N/P	

* The Reporting Limit for AMA Laboratory is 7.0 fibers per square millimeter of filter. The reporting limit for the air concentration of fibers (f/cc) is dependent on the sampled air volume. Fibers counts were determined by the methods described in NIOSH Analytical Method 7400, 'Fibers' (Revision 3, Issue 2, 8/15/94). All personnel samples were analyzed following the OSHA Reference Method.

Sample results shown here have been corrected for any field blank(s) submitted with this sample set.

Note: All samples were received in good condition unless otherwise noted.

Uncertainty: for fibers/mm² in the range of 7-25 the CV is 0.305, 26-64 CV=0.264, 64-127 CV=0.302, >127 CV=0.344

Analyst: Crystal Kellam

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #[redacted]-0085 (MD)
Released by National Guard Bureau
Page 2734 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

EI

SAMPLE CHAIN OF CUSTODY

181430

DATE SHIPPED	# OF SAMPLES	SAMPLE MEDIA TYPE	PROJECT NAME
	22		Elkton: MD NG

CONTACT	TELEPHONE NUMBER
Non-Responsive	

SAMPLE # OR AREA	SAMPLE DATE	SAMPLE VOLUME	ANALYSIS REQUESTED
495-1	8/7/08	1409.88	Air: Lead
495-2.5		0	
495-3		1342.59	
495-4		0	Air: Asb
495-2		1049.43	
M-495-3 (B03)		750 L	Air: Fungal Spore
M-495-4 (103)			
M-495-5 (207)			
M-495-6 (Out)			
495-3A (B03)		—	Surface: Fungal spore
495-L-4 (B01)		—	Lead: Chips
495-L-6 (101)		—	
495-L-7 (102)		—	
495-L-10 (205A)		—	
495-L-11 (203A)		—	

Samples Relinquished By:	Signature	Date 8/7/08
Samples Received By:	Signature	Date
Samples Analyzed By:	Signature	Date

1/2

SAMPLE CHAIN OF CUSTODY

EI

181430

DATE SHIPPED	# OF SAMPLES	SAMPLE MEDIA TYPE	PROJECT NAME
			Elkton: MD Na

CONTACT	TELEPHONE NUMBER
Non-Responsive [redacted]	

SAMPLE # OR AREA	SAMPLE DATE	SAMPLE VOLUME	ANALYSIS REQUESTED
495-L-1 (B-11 R)	8/7/08	100 cm²	Lead: wipe
495-L-2 (B-08 V)			
495-L-3 (B01)			
495-L-5 (B04 R)			
495-L-8 (107)			
495-L-9 (203 A)			
495-L-12 (Blank)			

Samples Relinquished By:	Signature	Date 8/12/08
Samples Received By:	Signature	Date
Samples Analyzed By:	Signature	Date

2/2

AMA Analytical Services, Inc.
Focused on Results
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) 181430

Mailing/Billing Information:
1. Client Name: National Guard Bureau NE
2. Address 1: 301-1H Old Bay Lane
3. Address 2: Havre de Grace, Maryland 21078
4. Address 3:
5. Phone #: 336 455 2558 Fax #: 704 593 1650

Submittal Information:
1. Job Name: KC # 495: Elkton, MD
2. Job Location:
3. Job #: P.O. #:
4. Contact Person: @ phone # 336 455 2558
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Include [redacted] Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day ☒ 5 Day +	☒ Email [redacted] @ eil.com
Comments:	☐ 2 Day Date Due: 9/11/08	☐ Fax:
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☒ NIOSH 7400 2 (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
☒ Paint Chip 5 (QTY)
☒ Dust Wipe (wipe type ____) 7 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Collection Apparatus for Spore Traps:
☒ Spore-Trap 4 (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☒ Surface Tape 1 (QTY) ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
																	Date/Time: Contact: By:
	See Attached 2 pages																Date/Time: Contact: By:
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 9 / 4 / 08 @ 800 Via: UPS By (Print): M Sampson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments:

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2737 of 5269
Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

ANALYTICAL LABORATORY SERVICES, INC.
Environmental ✦ Industrial Hygiene ✦ Field Services
www.analyticallab.com

Industrial Hygiene Survey

National Guard Facility
Elkton Armory
101 Railroad Avenue
Elkton, MD 21921-5535

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Elkton Armory** **101 Railroad Avenue** **Elkton, MD 21921**
Prepared By:	**Analytical Laboratory Services, Inc.** **3544 North Progress Avenue** **Suite 100** **Harrisburg, PA 17110**
Survey Date:	**July 16, 2010**
Report Date:	**August 23, 2010**
ALSI Project #:	**1007445**

Non-Responsive

[redacted]

Director, Environmental Health & Safety

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2738 of 5269

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Noise Survey 5

Section 4.0 Lead Testing 6

Section 5.0 Lighting 8

Section 6.0 Indoor Air Quality 9

Section 7.0 Suspect Asbestos Containing Building Materials 11

Section 8.0 Maintenance Bay 12

Section 9.0 Limitations 13

Appendix A. Laboratory Analysis Report 14

Appendix B. Photographs 15

Appendix C. Floor Plan 16

Appendix D. References 17

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2739 of 5269

BEST AVAILABLE COPY

Section 1.0
Executive Summary

BEST AVAILABLE COPY

Section 1.0 Executive Summary

An industrial hygiene survey was conducted July 16, 2010, at the Elkton Armory located at 101 Railroad Avenue, Elkton, Maryland 21921. The survey was performed by Ms. Non-Responsive

1. Lead surface, air and bulk samples were collected. Surface levels of lead exceeded 200 ug/ft^2 in attached garage on top of the locker. Housekeeping and cleaning should be improved to maintain lead levels below 200 ug/ft^2.

2. Employees were not performing tasks that provided excessive noise levels. Therefore, noise exposure monitoring was not conducted.

3. Lighting levels met the minimum recommended guidelines in all but the following areas: 1) Room 103, 2) Room B04 3) Room B03. Lighting should be improved in these areas.

4. Indoor air quality parameters of temperature, relative humidity carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment. Relative humidity exceeded the recommended ceiling of 60% and temperature exceeded the recommended criteria of 79 degrees F in some indoor locations. There is no central air conditioning system in this building. Outdoor conditions were hot and humid. Relative humidity should be maintained at 30-60% whenever possible.

5. A few water damaged ceilings or other areas were observed. All sources of water infiltration should be identified and repaired. Water damaged ceiling and building materials should be removed and replaced. Some water damaged building materials may contain asbestos and should be handled properly.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2741 of 5269

BEST AVAILABLE COPY

Section 2.0
Operation Description & Observations

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 2.0 Operation Description & Observations

The Elkton Armory serves primarily as an office setting and equipment storage facility. The facility consists of offices, a drill hall, garage, and storage areas. There are eight full-time employees stationed at the facility. On drill weekends there can be many more occupants.

The building was initially constructed in 1915. There is a garage attached to the Armory. The exterior of the building is stone or masonry. The interior walls are primarily concrete block, stone and plaster. The heating, ventilating, and air conditioning system (HVAC) consisted of a few window unit air conditioners and a boiler. Outdoor air ventilation occurs via open windows, doors, etc. No forced-air ventilation system is present. The floors were composed of a poured concrete slab. The Drill Hall has a wooden floor. Some areas were finished with vinyl floor tiles or other flooring on top of the concrete. The ceilings were generally composed of a roof deck. Some areas were finished with a suspended drop ceiling system.

There is an old firing range in the building. It is closed and has been fully abated. It is used for storage and as a locker room.

Site personnel at the time of the site assessment consisted of four administrative personnel and four maintenance personnel. The employees on site were conducting general administrative work.

Overall housekeeping was good. Areas were clean and well kept.

No ergonomic concerns were reported. Office areas have computer work stations. Many areas have lap top computers. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2743 of 5269

BEST AVAILABLE COPY

Section 3.0
Noise Survey

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 3.0 Noise Survey

Employees were not performing tasks that provided excessive noise levels. Therefore noise exposure monitoring was not conducted.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2745 of 5269

BEST AVAILABLE COPY

Section 4.0
Lead Testing

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Section 4.0 Lead Testing

At the time of the assessment, no activities were observed which would generate lead exposure. Soldiers reportedly clean rifles sometimes during drill weekends. The facility contains a room which was once an indoor firing range. It has been abated and is now a locker room and storage area.

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2	Paint Chip %Pb
1	Room B09	<3.5		
2	Room 102	<3.6		
3	Blank	<3 ug		
4	Converted Firing Range – Room B11 Top of Desk		<110	
5	Converted Firing Range – Room B11 Top of Locker		<110	
6	Converted Firing Range – Room B11 – Floor		<110	
7	Hallway Floor Outside of Converted Firing Range Room B11		<110	
8	Lounge – Top of Bar		<110	
9	Room B09 – Top of Typewriter Table		<110	
10	Kitchen Room B04 – Top of Table with Microwave		<110	
11	**Attached Garage – Top of Locker**		**1,100**	
12	Room 107 – Top of Bookshelf		<110	
13	Room 103 – Top of TV Shelf		<110	
14	Drill Hall – Stepper		<110	
15	Drill Hall – Floor by Flags		<110	
16	Drill Hall – Floor Behind Bicycle		<110	
17	Room 204 Top of Bookshelf on Center Wall		<110	
18	Blank		<12 ug	
19	Boiler Room – Ceiling			0.051
Criteria		**50**	**200**	**0.5**

Key: **Bolded** results exceed listed criteria

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2747 of 5269

Surface levels of lead exceeded 200 ug/ft^2 in the attached garage on top of the locker.

The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying lead-contaminated surfaces. In the "Derivation of Wipe Surface Screening Levels for Environmental Chemicals," the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 ug/m^3. In fact, no detectable level of lead was identified in the air sample collected.

Deteriorated paint was observed at various locations throughout the facility. Delaminated paint was mostly due to age along with prolonged exposure to elevated relative humidity levels. A paint chip sample was collected from the Boiler Room Ceiling. The result did not exceed the HUD definition of lead-based paint (0.5%).

Housekeeping and cleaning activities should be improved to maintain surface lead dust concentrations below 200 ug/ft^2. Deteriorated and peeling paint should be properly remediated and repaired.

BEST AVAILABLE COPY

Section 5.0
Lighting

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Section 5.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K070003). The light meter was last calibrated on November 26, 2009. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Measured Lighting (Foot Candles)	Recommended Lighting (Foot Candles)	Sufficient Lighting
Attached Garage	99.6	75	Yes
Drill Hall	81.3	30-50	Yes
Room 207	46.7	30-50	Yes
Room 205	45.5	30-50	Yes
Room 204	29.0	30-50	No
Room 203	46.7	30-50	Yes
Room 102	34.0	30-50	Yes
Room 107	32.1	30-50	Yes
Room 103	**15.3**	30-50	No
B09	79.2	30-50	Yes
B09 Supply Room	102.0	30-50	Yes
B11	76.5	30-50	Yes
Lounge/Conference Room	42.6	30-50	Yes
B04	**27.3**	30-50	No
B03	**28.5**	30-50	No

Lighting levels met the minimum recommended guidelines in all but the following areas: 1) Room 103, 2) Room B04 3) Room B03. Lighting should be improved in these areas.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2750 of 5269

BEST AVAILABLE COPY

Section 6.0
Indoor Air Quality

BEST AVAILABLE COPY

Section 6.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565X (Serial # 0839020). The instrument was factory calibrated in March 2010.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2007). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 71.2 to 89 degrees F with relative humidity readings ranging from 41.8% to 76.4%. During the survey, carbon dioxide (CO_2) levels ranged from 415 ppm to 831 ppm within the facility compared to an average outdoor CO_2 level of 429 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,129 ppm (429 ppm + 700 ppm). The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Outdoors	88.9	68.7	410	0.1
Attached Garage	**89.0**	**67.5**	415	0.3
Drill Hall	**86.9**	55.1	557	0.3
Room 207	**87.9**	54.2	582	0.3
Room 205	**88.0**	55.0	527	0.2
Room 204	**88.0**	56.1	555	0.0
Room 203	**88.2**	54.8	587	0.2
Room 102	**85.7**	41.8	657	0.1
Room 107	79.0	44.5	636	0.3
Room 103	76.4	36.8	505	0.1
B09	**74.9**	50.1	816	0.0
B09 Supply Room	74.7	53.1	831	0.0
B11	74.5	50.5	651	0.0
Lounge/Conference Room	71.2	51.6	621	0.0
B04	74.2	**75.0**	556	0.0
B03	75.2	**76.4**	495	0.0
Outdoors	93.3	60.2	448	0.0
Criteria	**73.0-79.0**	**30-60**	**<1,129**	**<9.0**

Key: **Bolded** results exceed listed criteria

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2752 of 5269

Relative humidity exceeded the recommended ceiling of 60% and temperature exceeded the recommended criteria of 79 degrees F in some locations. There is no central air conditioning system in this building. A few areas have air conditioners. Outdoor conditions were hot and humid. Relative humidity should be maintained at 30-60%. Low relative humidity can lead to the drying of mucous tissues and an increased susceptibility to respiratory infection. High relative humidity can provide an environment suitable for microbial growth and proliferation. Carbon dioxide and carbon monoxide were within recommended guidelines.

A visual inspection was conducted throughout visually accessible portions of the facility. The visual inspection was conducted to assess sources or pathways of factors potentially deleterious to IAQ. The visual inspection revealed the following items that may be potential sources of poor IAQ:

1. Water damage was observed in the following locations:

    - Drill Hall;
    - Room 108;
    - Room 205;
    - Room 207;
    - Room 203;
    - Room B09;
    - Lounge;
    - Boiler Room.

2. Damaged ceiling appear to be from previous water leaks that have been repaired.

3. No areas of fungal growth were observed.

All sources of water infiltration should be identified and repaired. Water damaged ceiling tile should be removed and replaced.

BEST AVAILABLE COPY

Section 7.0
Suspect Asbestos Containing Building Materials

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 7.0 Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials (ACM) include sheetrock/joint compound, plaster wall and ceiling systems, floor tiles and associated mastic, and vinyl cove base. Thermal system insulation which is most likely a combination of paper wrapped fiberglass with PVC elbows and well as pre-formed TSI with mudded elbows was suspected due to the age of the building. No samples were collected.

The following suspect ACM was noted at the time of this survey:

1. Approximately 500-1,000 ft^2 of 9" x 9" vinyl floor tile and mastic was observed in several locations throughout the building. In Room 102 some of the floor tiles have been removed leaving exposed mastic.

2. Pipe insulation and ceiling tile may also be asbestos containing materials.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2755 of 5269

BEST AVAILABLE COPY

Section 8.0
Maintenance Bay

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 8.0 Maintenance Bay

There is a garage area attached to the Armory. Regular maintenance activities are no longer performed in this area. It is used primarily for storage and minor repairs as needed.

In the garage area there is an overhead vehicle exhaust system present. It was reported that this system is seldom, if ever, needed for the type of routine maintenance activity that is performed in the building. A ventilation survey of the current overhead vehicle exhaust system was performed by ALSI. Each drop consisted of a flex duct with a 5" duct diameter. The flow rate was measured and found to be 37.8 Cubic Feet per Minute (CFM) in Bay 1 and 23.66 in Bay 2. The actual flow rate that is required in a overhead vehicle exhaust system varies depending on the engine tail pipe temperature, whether or not the vehicle is "under load" or idling, engine displacement, engine size, etc. We recommend that if vehicle maintenance is to be performed in this facility the overhead vehicle exhaust system should be inspected to determine if it is operating as designed and meets the minimum requirements as recommended by the American Conference of Governmental Industrial Hygienists (ACGIH) Industrial Ventilation: A Manual of Recommended Practice for Design (27th Edition).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2757 of 5269

BEST AVAILABLE COPY

Section 9.0
Limitations

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Section 9.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Analytical Laboratory Services, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2759 of 5269

BEST AVAILABLE COPY

Appendix A
Laboratory Analysis Report

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC
ACCREDITED LABORATORY

LAB #100470

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	Elkton Armory	**Chain Of Custody:**	508327
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Elkton, MD	**Date Submitted:**	7/20/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Elkton Armory	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/27/2010 **Report Date:** 7/27/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1062036	1007445-1	Flame	Air	850	N/A	3.5	ug/m³	<3	<3.5	ug/m³	
1062037	1007445-2	Flame	Air	844	N/A	3.6	ug/m³	<3	<3.6	ug/m³	
1062038	1007445-3	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1062039	1007445-4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062040	1007445-5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062041	1007445-6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062042	1007445-7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062043	1007445-8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062044	1007445-9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062045	1007445-10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062046	1007445-11	Flame	Wipe	****	0.108	110	ug/ft²	110	1100	ug/ft²	
1062047	1007445-12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062048	1007445-13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062049	1007445-14	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062050	1007445-15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062051	1007445-16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062052	1007445-17	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
1062053	1007445-18	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1062054	1007445-19	Flame	Paint Chip	****	N/A	0.01	%Pb		0.051	%Pb	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2762 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY

LAB #100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	Elkton Armory	**Chain Of Custody:**	508327
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Elkton, MD	**Date Submitted:**	7/20/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Elkton Armory	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	7/27/2010 **Report Date:** 7/27/2010

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: G. Carney / Nida McGarvey

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

Page 1 of 2

OWI (410) 247-2624 159202 210 REV. 5.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) **508327**

p. 1/2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Elkton Armory
2. Job Location: Elkton, MD
3. Job #: Elkton Armory PO #: W912K6-09-A-0003
4. Contact P[redacted] @ phone # (410) 942-0273
5. Submitted [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ____	☐ Immediate ☐ 3 Day	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: ____	☐ Next Day ☒ 4-5 Day +	☒ Email: [redacted]@analyticallab.com
Comments:	☐ 2 Day Date Due: 7/27/10	☐ Fax: [redacted]@us.army.mil
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verb[redacted]@us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify: ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify: ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 400.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
☒ Pb Paint Chip 1 (QTY)
☒ Pb Dust Wipe (wipe type ghost) 15 (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media: ____) ____ (QTY)
Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media: ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER (ANTI-COAGULANT)	SWAB	TAPE	SWAB
1007445-1	Rm 109	7/16	850					X		X						
1007445-2	Rm 102		844					X		X						
1007445-3	Blank		0					X		X						
1007445-4	Rm 111 Desk			100cm²				X				X				
1007445-5	Rm 111 Top of Locker							X				X				
1007445-6	Rm 111 Floor							X				X				
1007445-7	Hallway Fl 1st							X				X				
1007445-8	Laundry-Bar							X				X				
1007445-9	B01-Toilet Seat							X				X				
1007445-10	B01-Top of Toilet							X				X				
1007445-11	Gym-Locker							X				X				
1007445-12	Rm 107 Bookshelf							X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 7/20/10 @ 10a Via: UPS By (Print): Chris Nicodemus Sign: Chris Nic
2. Date/Time Analyzed: ____/____/____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____/____/____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2763 of 5269

OWI (410) 242-2024 159202 210 REV. 6.08

508327
p2/2

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Elkton Armory
2. Job Location: Elkton, MD
3. Job #: Elkton Armory P.O. #: W912K6-09-A-0003
4. Contact: [redacted] @ phone # (410) 942-0273
5. Submitt[redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be prescheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☐ Immediate ☐ 3 Day ☐ Next Day ☐ 5 Day + ☐ 2 Day Date Due: ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email [redacted] @ ☐ Fax: [redacted] @us.army.mil ☐ Verbal [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify: ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM ___ (Qual) PLM ___ (Quan) PLM/TEM ___ (Qual) PLM/TEM ___ (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
☐ Pb Paint Chip ____ (QTY)
☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
☐ Pb Air ____ (QTY)
☐ Pb Soil/Solid ____ (QTY)
☐ Pb TCLP ____ (QTY)
☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
☐ Pb Furnace (Media: ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
☐ Spore-Trap ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Culturable ID Genus (Media ____) ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Culturable ID Species (Media ____) ____ (QTY)
☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WIPE (AREA)	WIPE (TEM)	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1007445-13	Rm103 TV Shelf	7/10		100cm²				X				X					Date/Time: Contact: By:
1007445-14	Drill Hall Stairs							X				X					
1007445-15	Drill Hall Floor							X				X					
1007445-16	Drill Hall Floor							X				X					
1007445-17	Rm109 Bookshelf							X				X					Date/Time: Contact: By:
1007445-18	Blank			0cm²				X				X					
1007445-19	Boiler Room Ceiling							X			X						
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2764 of 5269
BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B
Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

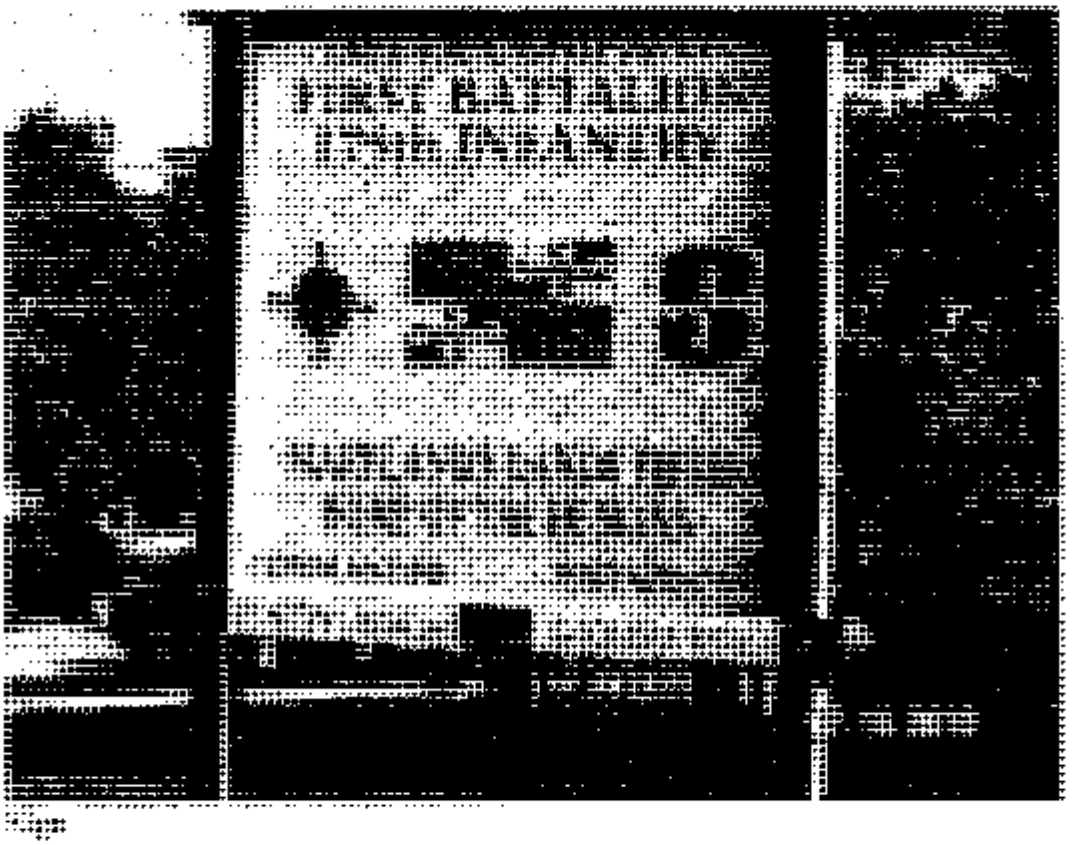

Front of building

Front of maintenance building, attached garage

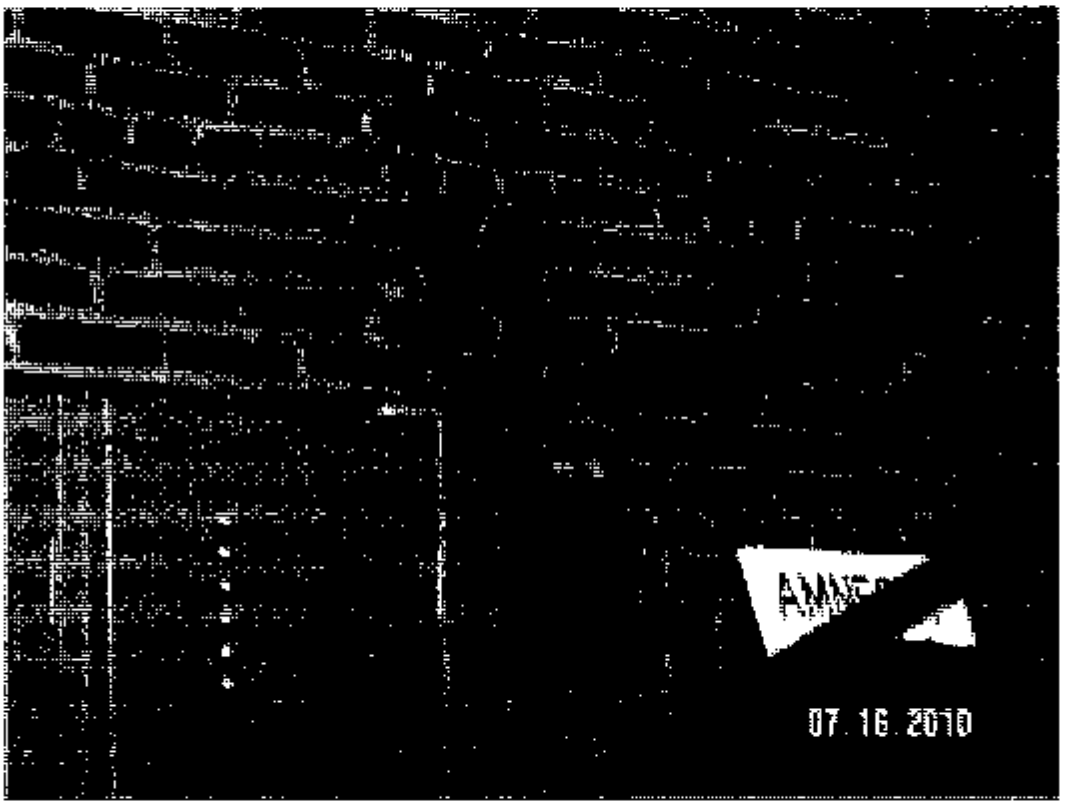

Attached garage, exhaust hose

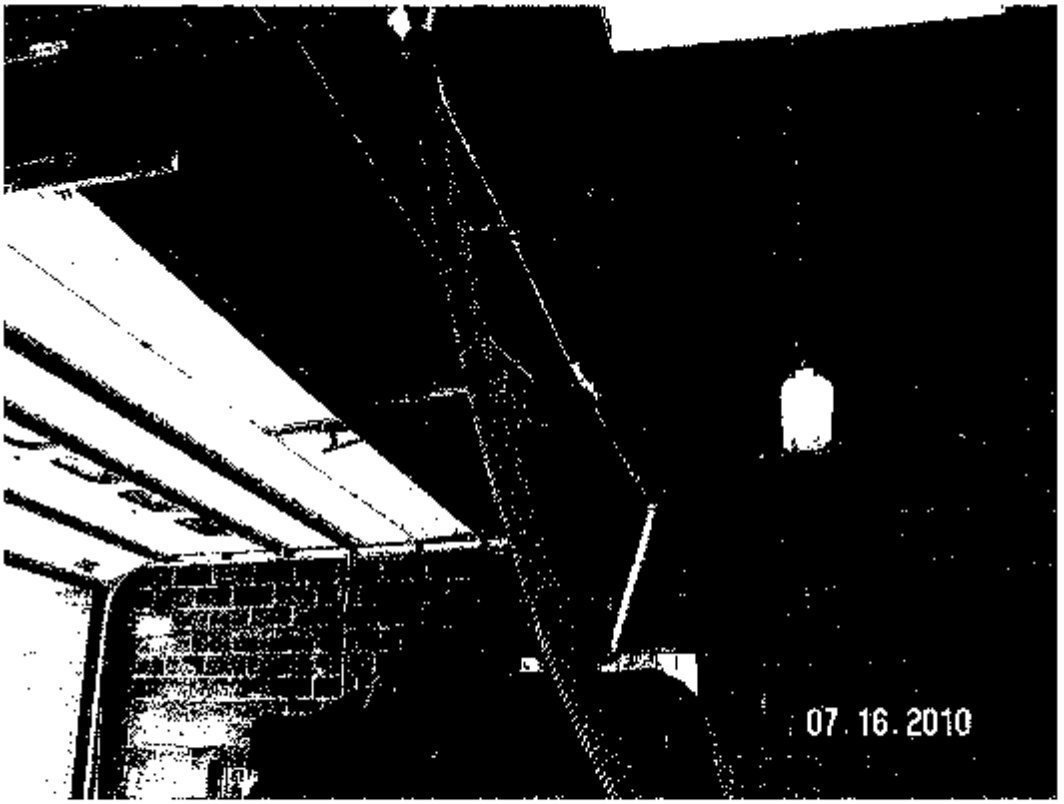

Attached garage, exhaust pipes

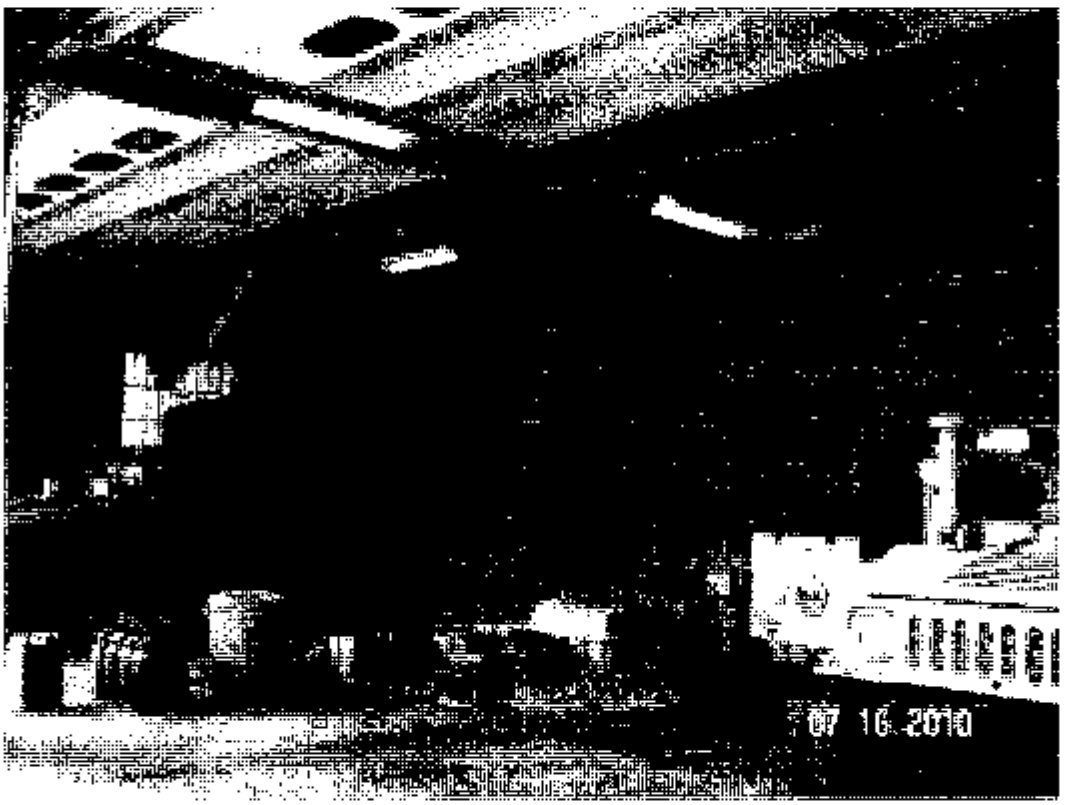

Attached garage, interior

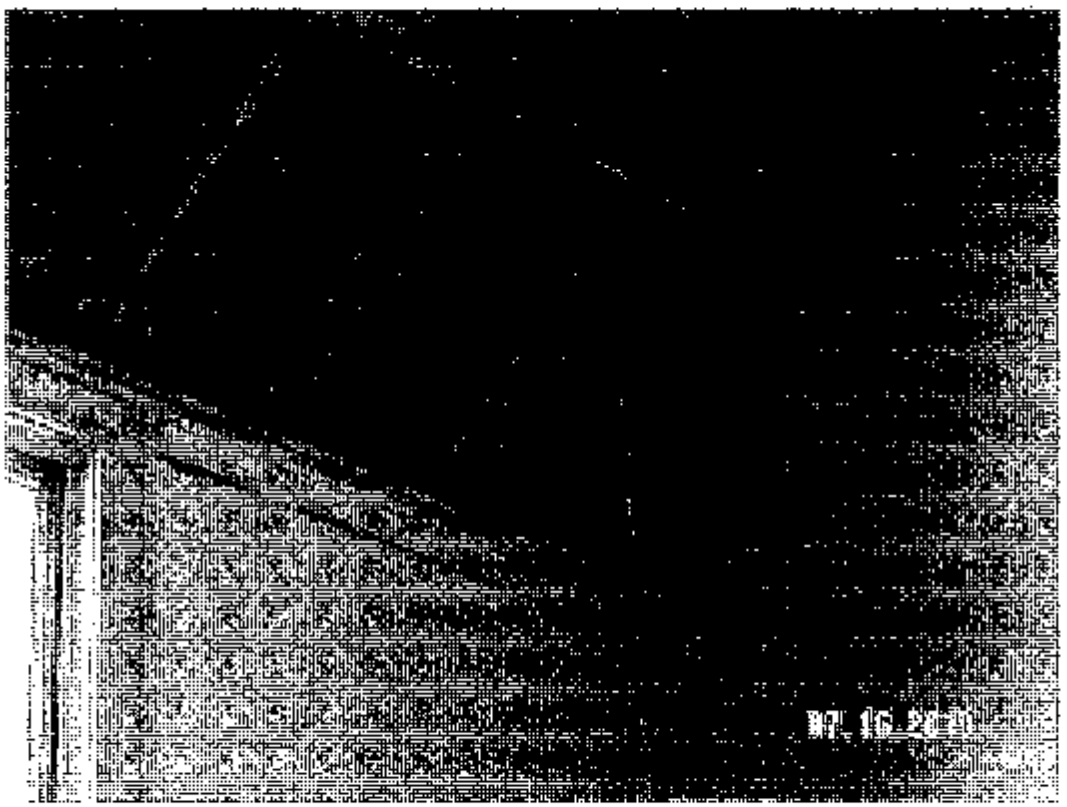

Back of Drill Hall, water / paint damage

Back of Drill Hall, water / paint damage

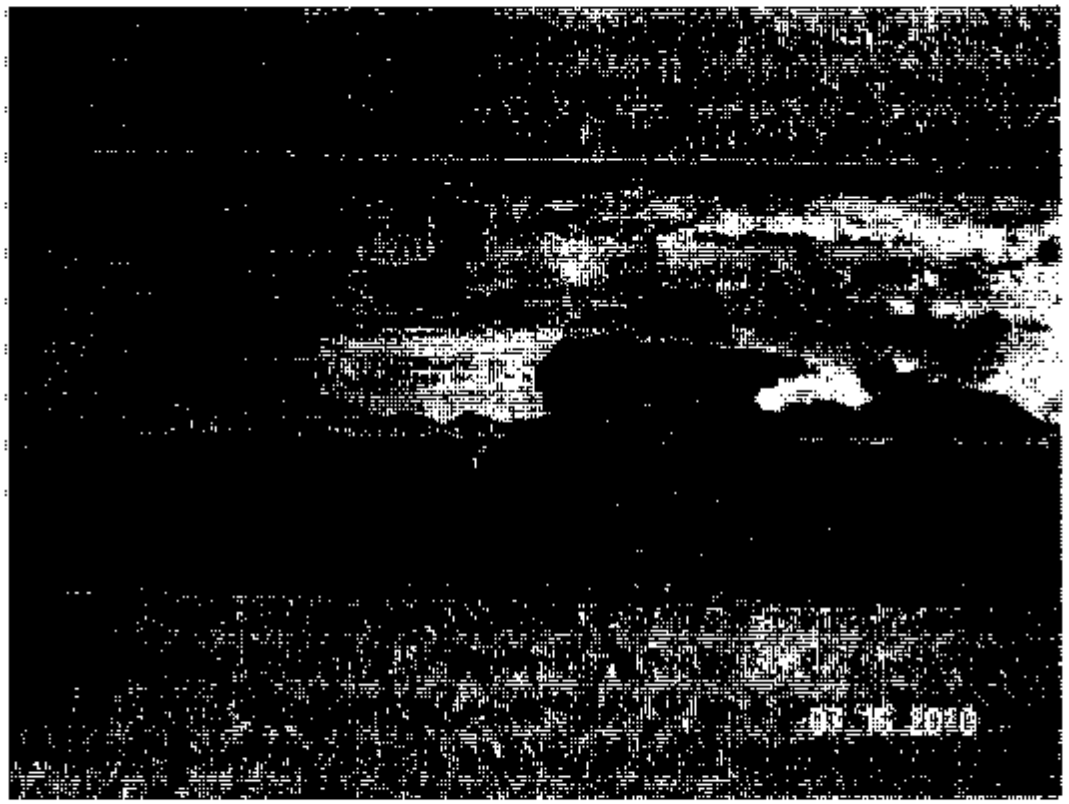

Room 102 – remaining mold from 9" x 9" VFT

Room 107 – remaining 9" x 9" VFT

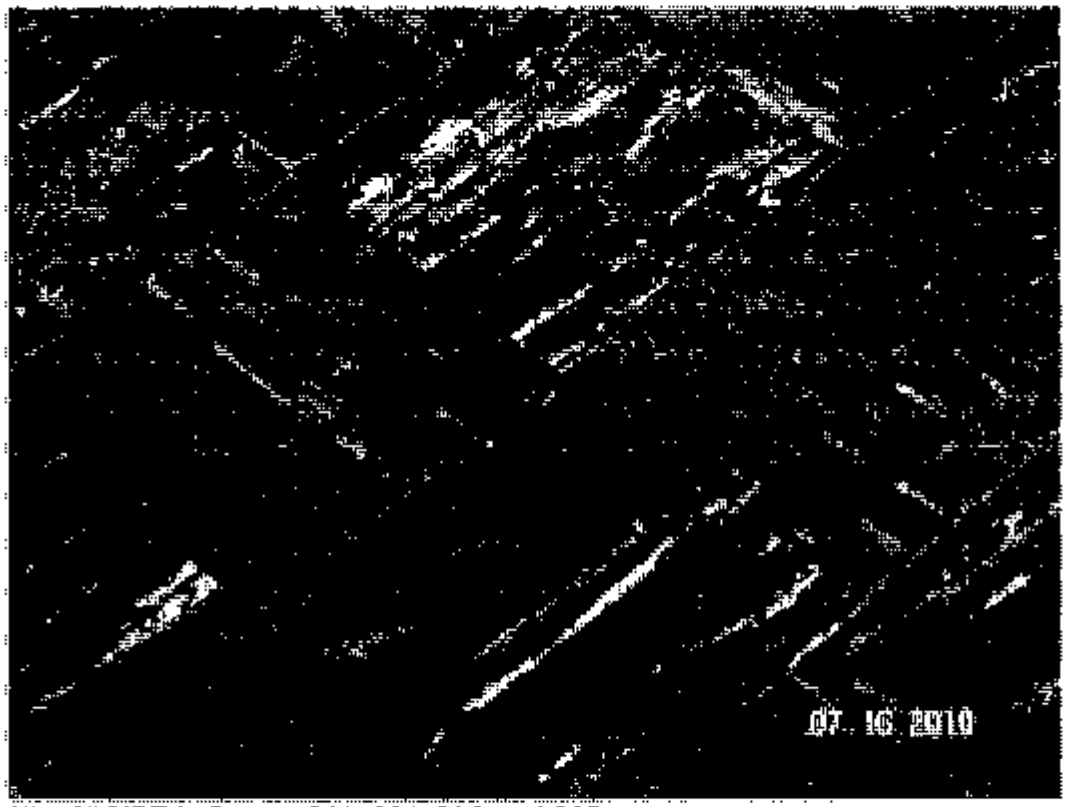

9" x 9" VFT in Rooms 201, 204, 205, and 207

Room 205 and 207, water damaged ceiling tiles

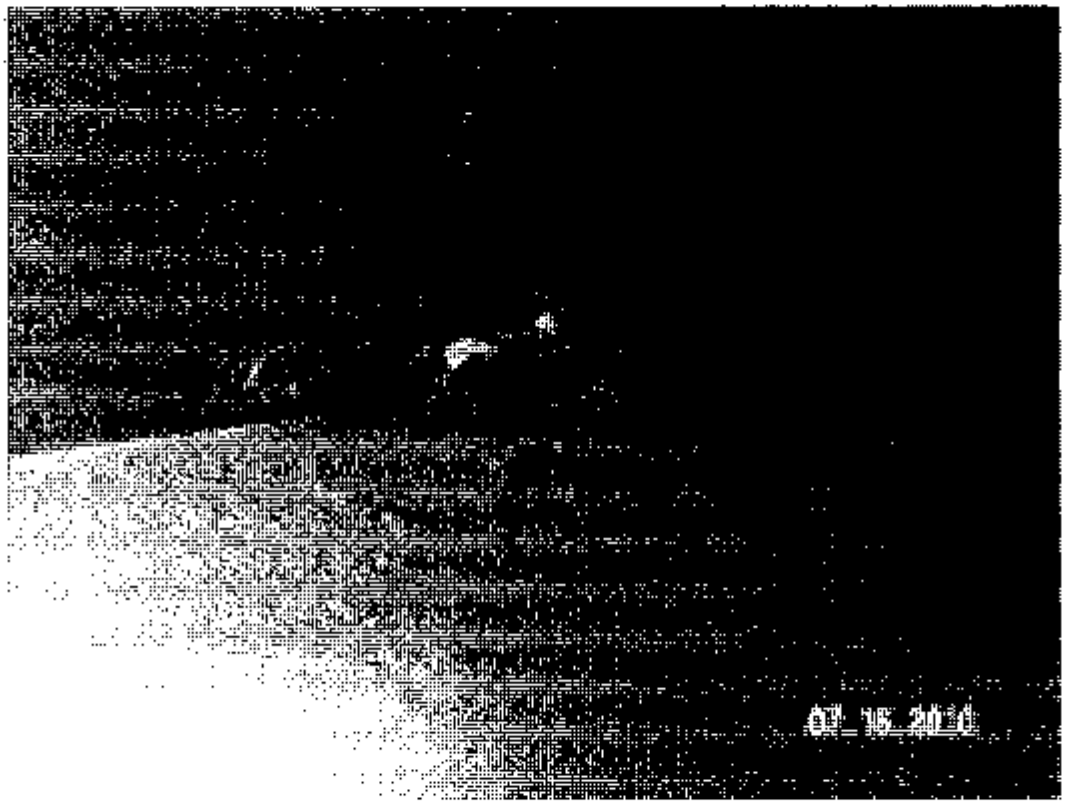

Room 203 / 203 bathroom - water damage / damaged paint on ceilings

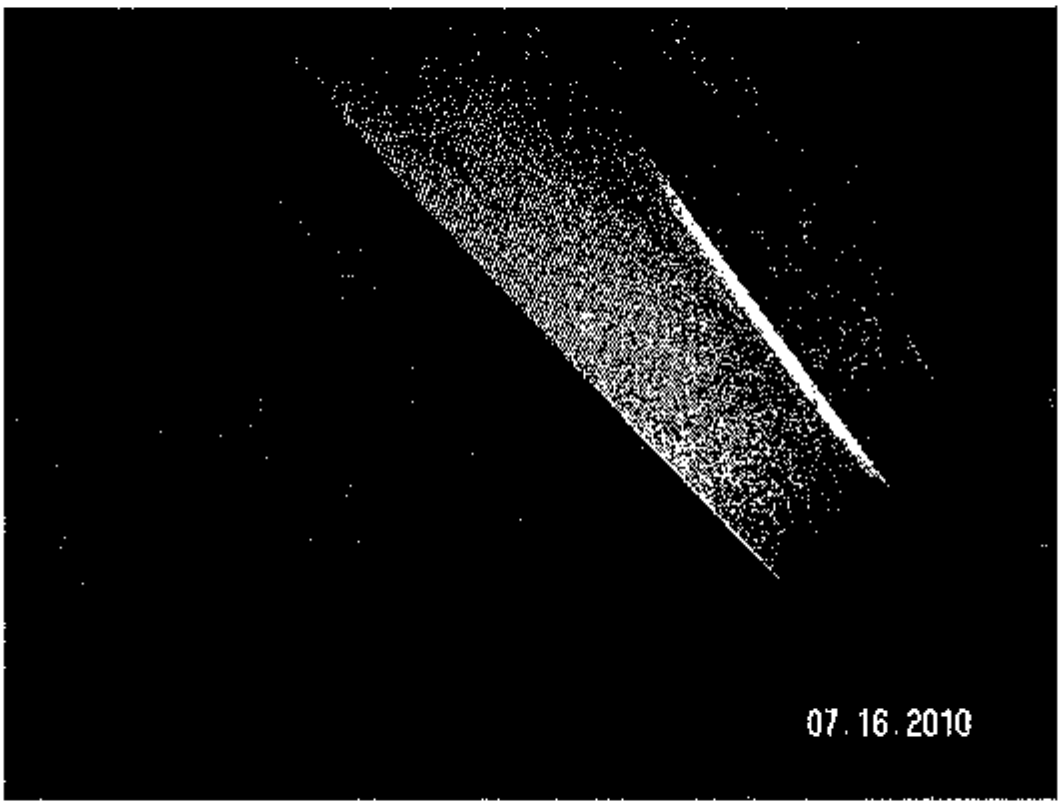

Room 203 / 203 bathroom - water damage / damaged paint on ceilings

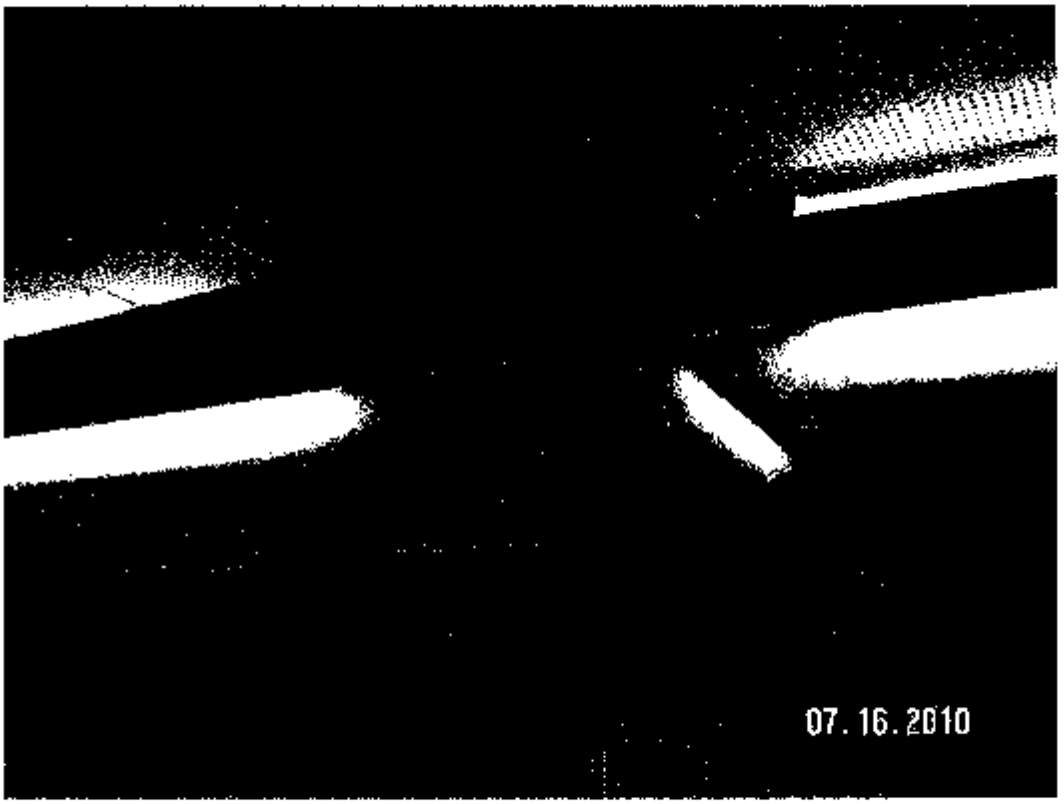

Potential ACM – pipe insulation in Room B09 and hall outside B09

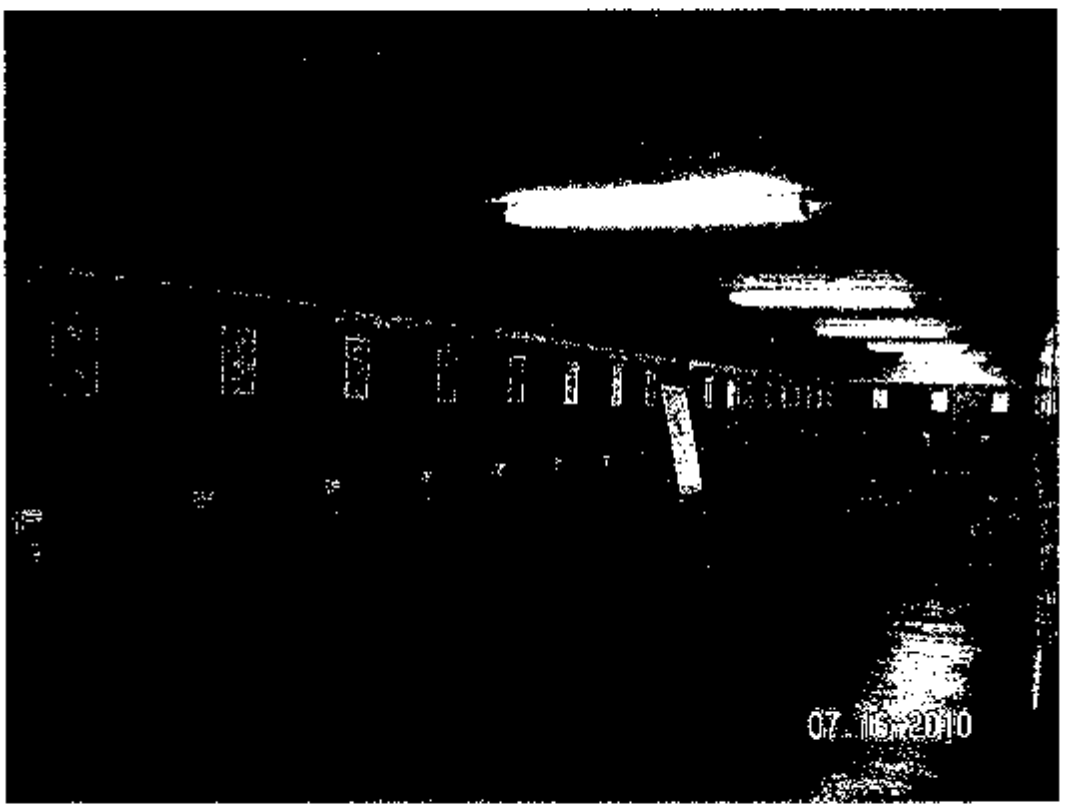

Old firing range, now locker room

Boiler room

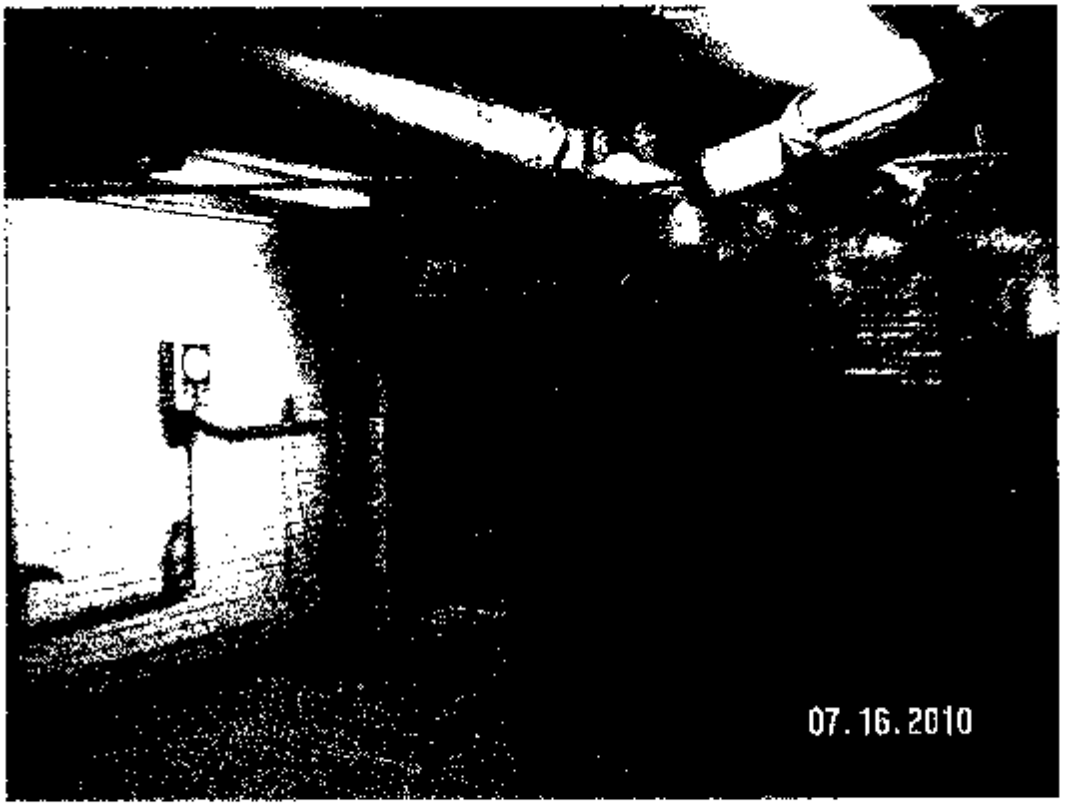

Boiler room

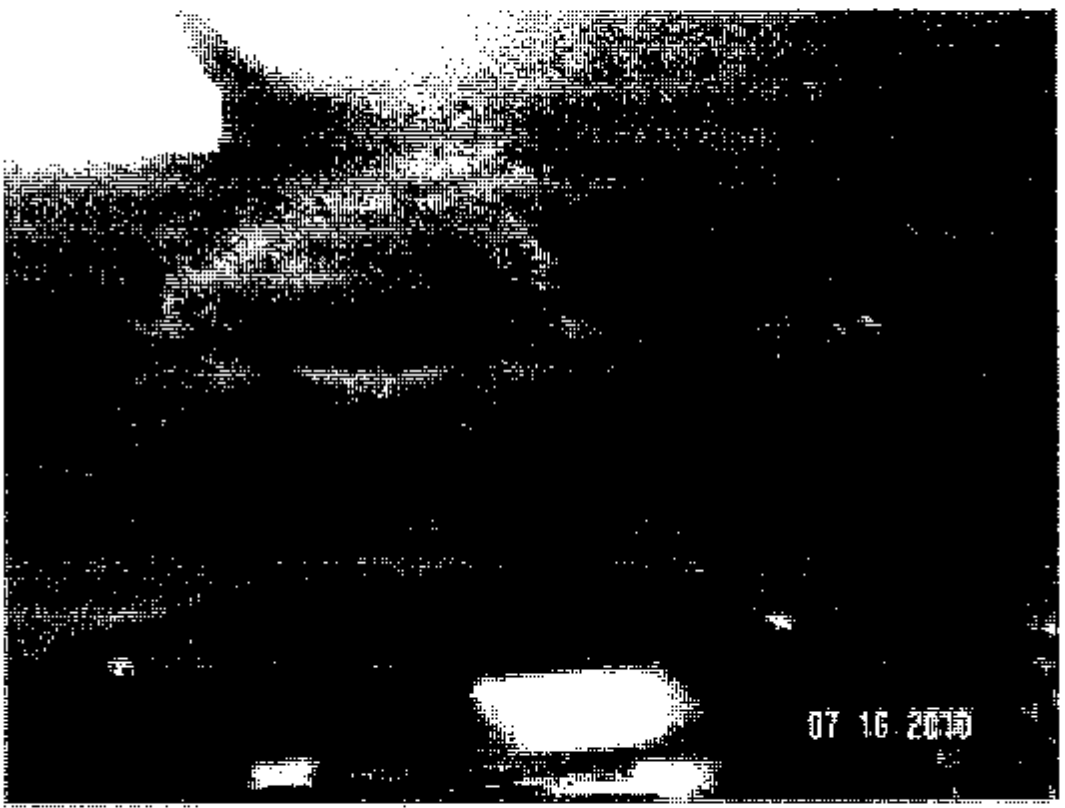

Water damage / damaged paint, back left corner of boiler room

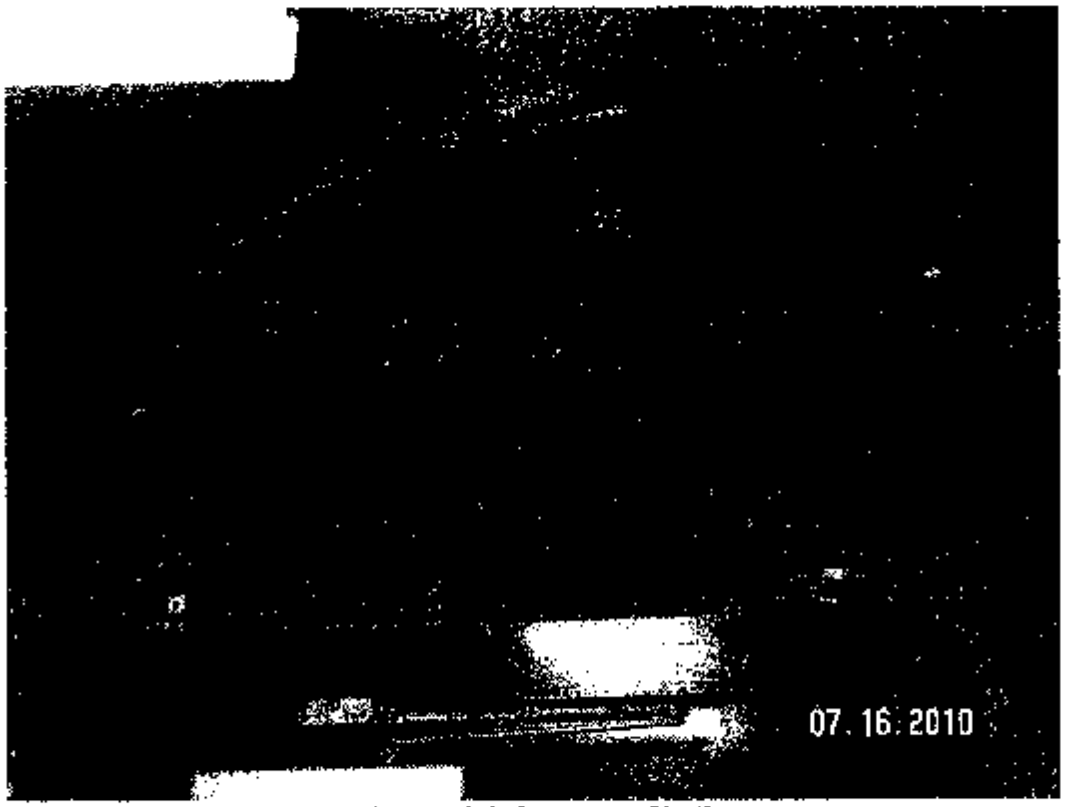

Water damage / damaged paint, back left corner of boiler room

BEST AVAILABLE COPY

Appendix C
Floor Plans

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

FIRE EVACUATION PLAN

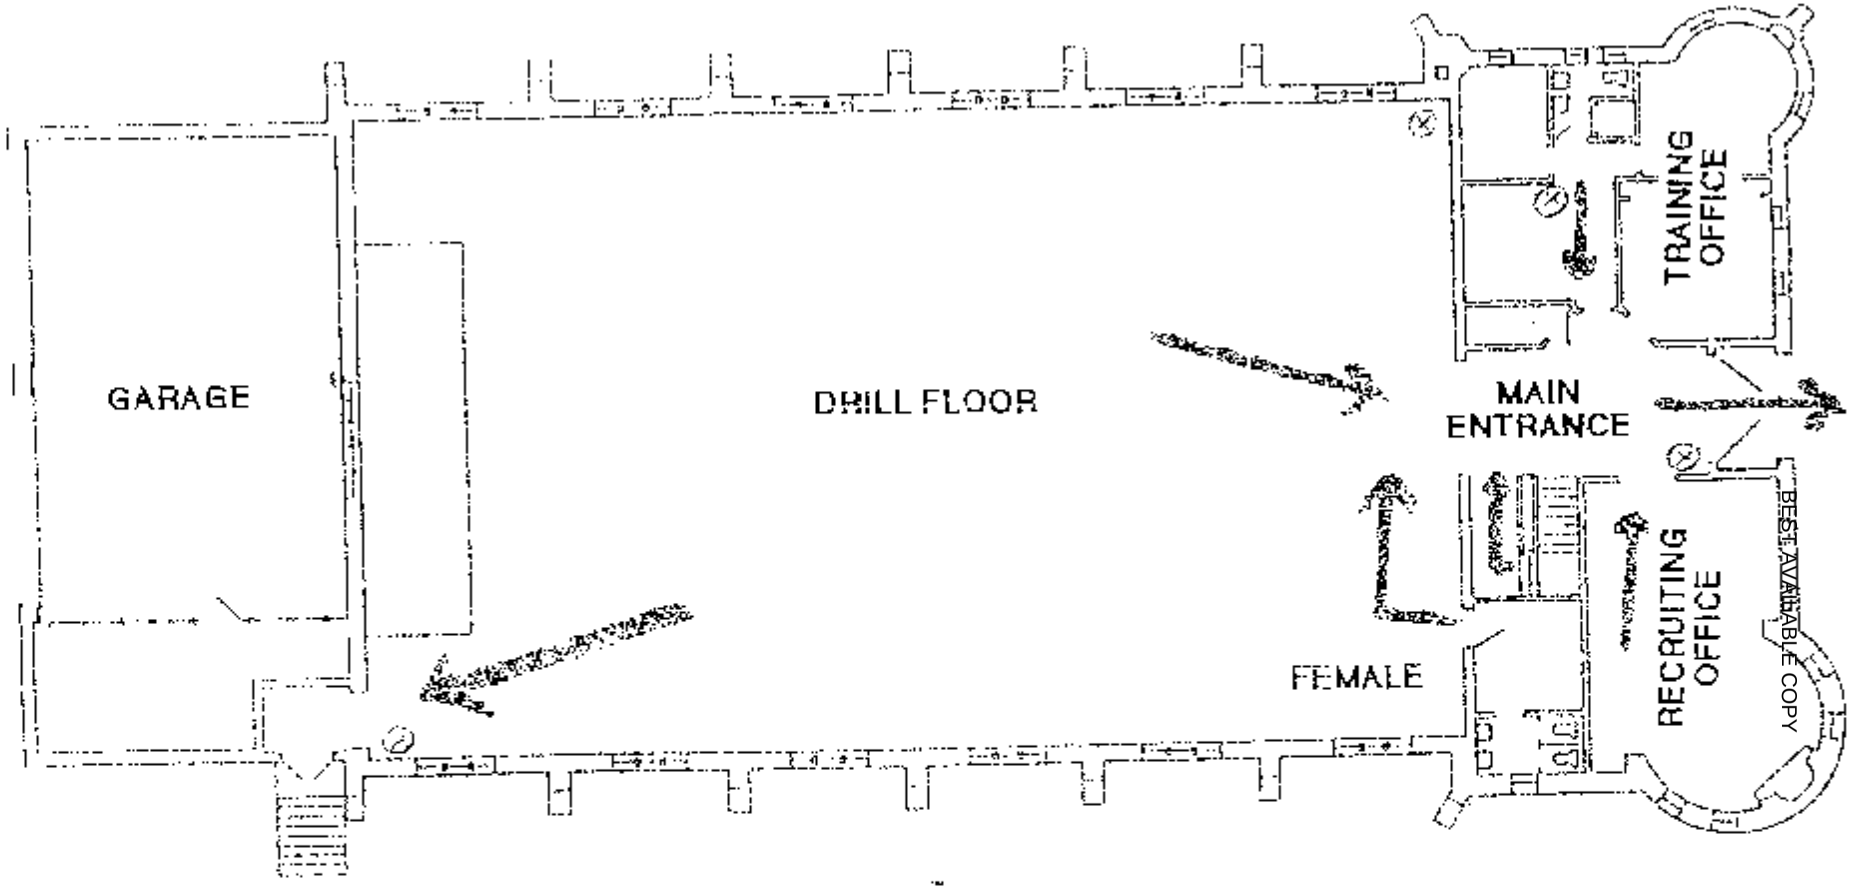

ELKTON ARMORY
FIRST FLOOR PLAN
NO SCALE

FIRE EXTINGUISHER ⊗

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

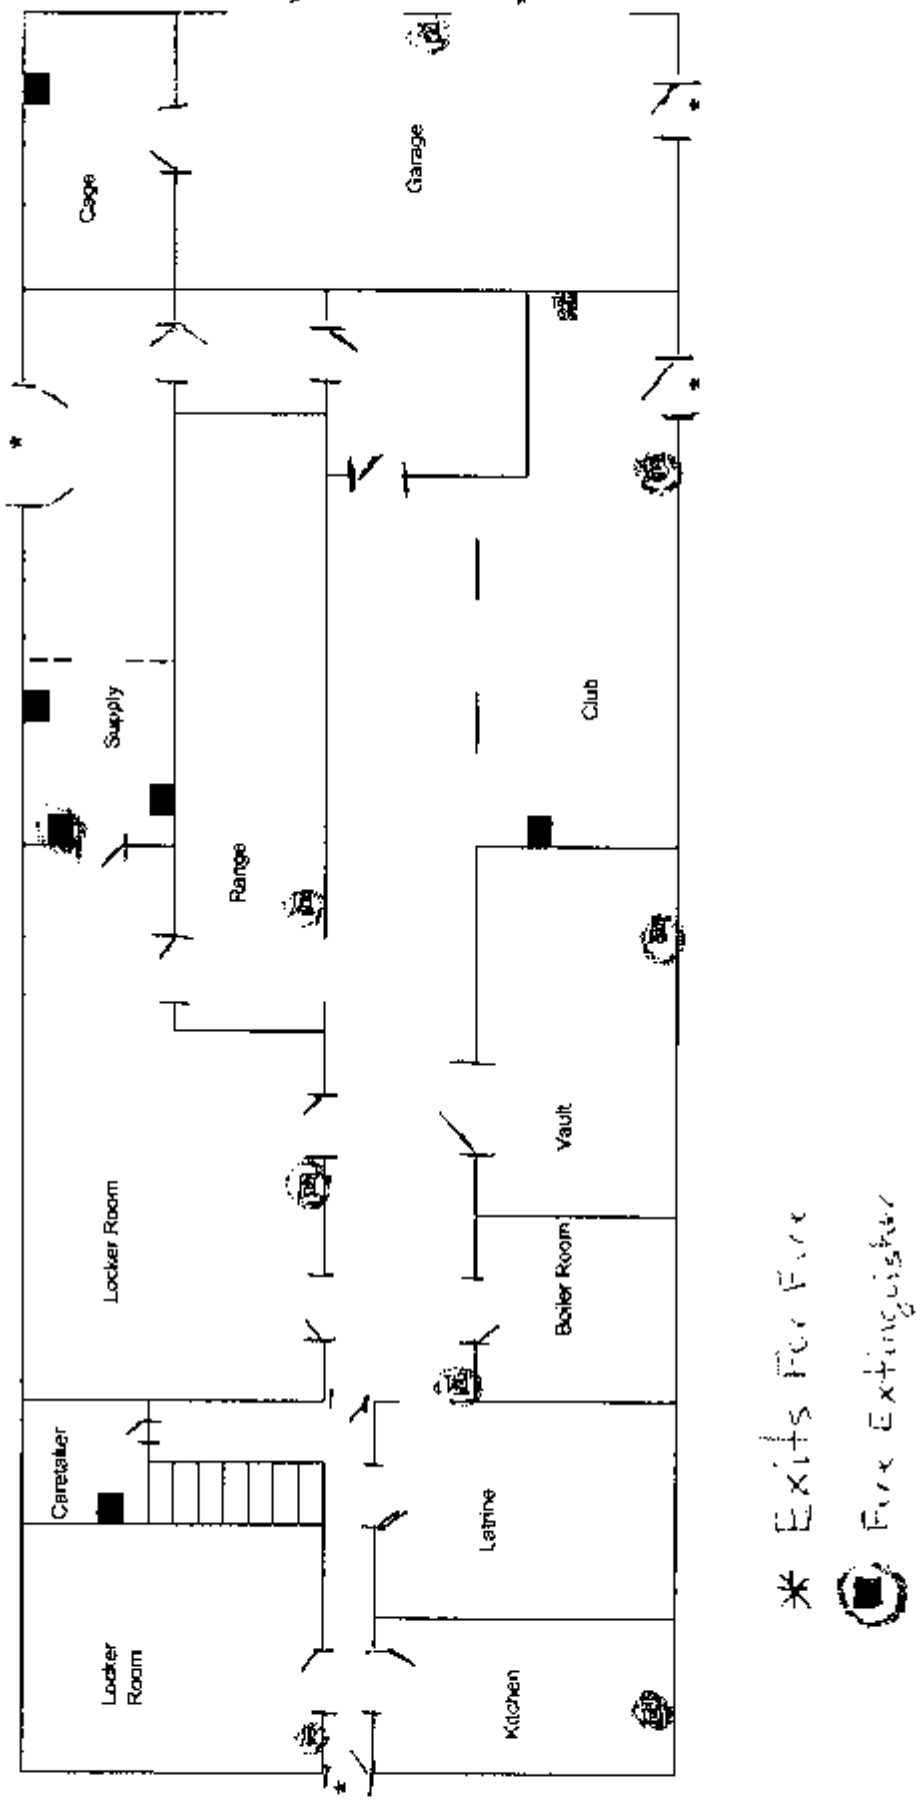
Cage
Garage
Supply
Club
Range
Vault
Locker Room
Boiler Room
Caretaker
Latrine
Locker Room
Kitchen
* Exits For Fire
Fire Extinguisher

LOWER LEVEL

BEST AVAILABLE COPY

Appendix D
References

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) -- Threshold Limit Values and Biological Exposure Indices, 2010 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007

5. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Thermal Environmental Conditions for Human Occupancy, 55-2004

6. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

8. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2781 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Elkton Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Elkton Readiness Center** **101 Railroad Avenue** **Elkton, MD 21921**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**May 30, 2013**
Report Date:	**June 24, 2013**

[redacted]

Non-Responsive

Manager, Industrial Hygiene Services

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on May 30, 2013, at the Elkton Readiness Center located at 101 Railroad Avenue, Elkton, MD 21921. The survey was performed by Mr. Non-Responsive.

1. Lead surface and air samples were collected. Surface and air samples for lead were below recommended guidelines in all sampled locations. See Section 3.0 for detailed sampling results.

2. Lighting levels did not meet the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in one location. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in all areas sampled.

    b. The relative humidity levels met the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60% in all areas sampled.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 parts per million (ppm) in all areas sampled.

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2010 recommended guidelines for mechanically ventilated office buildings and commercial settings in all indoor areas sampled.

    See Section 5.0 for detailed sampling results.

4. Water-stained ceiling tiles were observed in some areas of the facility. See Section 5.0 for detailed findings.

5. All suspect asbestos containing materials (ACM) observed were found to be intact and in good condition except for in the basement bathroom where some fitting and insulation was in poor condition. See Section 6.0 for detailed findings.

Section 2.0 Operation Description & Observations

The Elkton Readiness Center is mainly an administrative facility with a drill hall, offices, classrooms, and a converted firing range area (currently wall locker storage). There were approximately 8 full-time employees stationed at this facility at the time of this survey.

The building was reported to have been built in 1935. It is a two-story structure with a basement. The exterior is constructed of stone and concrete. The interior walls are plaster, wood, and drywall in some of the offices. The floors are concrete, carpet, and tile.

The heating system consists of an oil-fired hot water generating unit. There is no central air-conditioning system. Some window units are present.

There is no child-care facility in the building.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

This facility has a converted firing range that is now used as wall locker storage.

The drill hall ceiling has some isolated areas of peeling paint.

The facility has water stained ceiling tiles and efflorescence on the exterior walls on the 2nd floor.

Housekeeping practices were good.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 micrometer (um) mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	**Location**	**Air ug/m^3**	**Surface ug/ft^2**
1	Drill Hall	<6.7	*
2	Converted Firing Range/Wall Locker Storage	<6.7	*
3	Drill Hall – Floor	*	<110
4	Drill Hall – Top of Computer	*	<110
5	Drill Hall – Top of Table	*	<110
6	Kitchen – Top of Refrigerator	*	<110
7	Kitchen – Top of Microwave	*	<110
8	Converted Firing Range/Wall locker Storage – Floor	*****	<110
9	Converted Firing Range/Wall Locker Storage – Top of Wall Locker	*****	<110
10	Hallway Outside of Converted Range	*	<110
11	Basement Classroom – Top of Desk	*****	<110
12	Supply Office – Top of Desk	*	<110
13	Recruiting Office – Top of File Cabinet	*	<110
14	1st SG Office – Top of Safe	*	170
15	Commander Office – Top of File Cabinet	*	<110
16	2nd Floor Classroom – Top of Table	*****	<110
17	Blank Wipe	*****	<12
18	Blank Air	<3	*
-	**Criteria**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges
2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were below the recommended guideline of 200 ug/ft^2 in all locations tested.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

- Peeling paint was observed in the drill hall on the wooden ceiling. The ceiling was inaccessible therefore sampling was not performed. Approximately 100 square feet of peeling paint was observed. The areas of peeling paint should be repaired.

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98011EL). The light meter was last calibrated in November 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Drill Hall	55.8	10	Yes
Recruiting Office	38.1	30-50	Yes
TNCO Office	40.1	30-50	Yes
RNCO Office	34.8	30-50	Yes
1st SG Office	30.6	30-50	Yes
Supply Office	55.3	30-50	Yes
Converted Firing Range/Locker Storage	73.3	10	Yes
Basement Classroom	55.8	50	Yes
Lounge	30.3	10	Yes
Kitchen	65.4	50	Yes
Locker Room	48.2	7	Yes
2nd Floor Classroom	55.5	50	Yes
Commanders Office	**26.1**	**30-50**	**No**
2nd Floor Locker Room	36.5	7	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting level did not meet the minimum recommended guideline in the Commander's Office. Lighting should be improved in this area. All other areas met the minimum recommended guideline.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters (temperature, relative humidity, carbon dioxide, and carbon monoxide). Air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Recruiting Office	78.6	56.1	684	0.0
Supply Office	77.2	58.6	575	0.0
Outdoors	92.1	41.0	368	0.0
Criteria	**68-79**	**30-60**	**<1,068**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements met the recommended guideline of 68-79°F in all sampled areas.

- Relative humidity levels met the recommended guideline of 30-60% in all sampled areas.

- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level for this

survey. Indoor carbon dioxide levels did not exceed the recommended ceiling of 1,068 ppm. This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observation were noted:

    - Water-stained ceiling tiles were observed in the facility.
    - 2nd floor efflorescence was observed on the exterior walls
    - A few were observed or reported throughout the facility

Section 6.0 Suspect Asbestos Containing Building Materials

The following suspect ACM was noted at the time of this survey:

1. The facility has green, red, and black 9” x 9” floor tiles in some areas of the building. The floor tile was intact and in good condition.

2. The basement bathroom has damaged mudded joint fitting and pipe insulation. A bulk sample was collected from the pipe insulation in the basement bathroom. The sampled contained 5% chrysotile asbestos. All damage pipe insulation and fittings in the bathroom should be professionally remediated.

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98011EL	11/2012	NA
SKC Air Sampling Pump	647598	5/30/13	2.5 LPM
SKC Air Sampling Pump	648349	5/30/13	2.5 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

NVLAP 101143-0

CERTIFICATE OF ANALYSIS

Client:	National Guard Bureau	**Job Name:**	Elkton-RC	**Chain Of Custody:**	516027
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Elkton, MD	**Date Analyzed:**	6/11/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003		

Attention: Non-Responsive

Summary of Polarized Light Microscopy

AMA Sample Number	Client Sample #	Total Asbestos	Chrysotile Percent	Amosite Percent	Crocidolite Percent	Other Asbestos Percent	Mineral Wool Percent	Fiberglass Percent	Organic Percent	Synthetic Percent	Other Percent	Particulate Percent	Sample Type	Sample Color	Homogeneity	Analyst ID	Comments
13067219	19	5	5	--	--	--	--	--	55	--	--	40	NP	Off-White	Homogeneous	LBP	

The following footnotes only apply to those samples which the total asbestos result is flagged with a note number.

1 TEM RECOMMENDATION - Please note, due to resolution limitations with optical microscopy and/or interference from matrix components of this sample, results which are reported via PLM as negative or trace (<1%) for asbestos may contain a significant quantity of asbestos. It is recommended that the additional analytical technique of TEM be used to check for asbestos fibers below the resolution limits of optical microscopy.

2 MATRIX REDUCTION RECOMMENDATION - Please note, due to interference from the matrix components of this sample, results which are reported via PLM as negative or trace (<1%) for asbestos may contain a significant quantity of asbestos which is obscured from view. It is recommended that the additional preparation technique of gravimetric reduction be performed on this sample to minimize the obscuring effects of matrix components, followed by reanalysis by PLM and/or TEM.

Analysis Method - EPA/600/R-93/116 dated July 1993

NAD = "No Asbestos Detected" TR = "Trace equals less than 1% of this component"

Uncertainty: For samples containing asbestos in range of 1-10% the CV is 0.43, 11-35% CV=0.55, >35 CV=0.23

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

Technical Director Peerawut Chaikeenee **Analyst(s)** Lom Butruk

Lom Butruk

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

NVLAP (101143-0) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516027

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Elkton - RC
2. Job Location: Elkton - MD
3. Job #: PO #: W912K6-09-A-0003
4. Contact Person: [redacted] Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Date: [redacted] Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

TJ

AFTER HOURS (must be pre-scheduled)
☒ Immediate Date Due:
☐ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
☒ Immediate
☐ Next Day
☐ 2 Day
☐ 3 Day
☒ 5 Day + Date Due: 6/11/13
☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
☒ Inc[redacted] Non-Responsive with Report
☒ Bi[redacted] @ compliance-plus.com
☐ Fa[redacted] @us.army.mil
☐ Ve[redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)
TEM Air – Please Indicate Filter Type:
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)
PLM Bulk
☒ EPA 600 – Visual Estimate 1 (QTY)
☐ EPA Point Count (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)
MISC
☐ Vermiculite
☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D5755-95 (QTY)
☐ Quan. (s/area)Dust D6480-99 (QTY)
TEM Water
☐ Qual. (pres/abs) (QTY)
☐ ELAP 198.2/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
☐ Pb Paint Chip (QTY)
☐ Pb Dust Wipe (wipe type Chart) 15 (QTY)
☒ Pb Air 3 (QTY)
☐ Pb Soil/Solid (QTY)
☐ Pb TCLP (QTY)
☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
☐ Spore-Trap (QTY)
☐ Surface Swab (QTY)
☐ Surface Tape (QTY)
☐ Other (Specify) (QTY)
☐ Surface Vacuum Dust (QTY)
☐ Culturable ID Genus (Media) (QTY)
☐ Culturable ID Species (Media) (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1 Drill Hall		5-30	450					X		X							Date/Time: Contact: By:
2 Converted Range			450					X		X							
3 Drill Hall floor				100 CM²				X				X					
4 Drill Hall Computer								X				X					
5 Drill Hall Table								X				X					Date/Time: Contact: By:
6 Kitchen Fridge								X				X					
7 Kitchen microwave								X				X					
8 Range Converted floor								X				X					
9 Converted Range locker								X				X					Date/Time: Contact: By:
10 Hallway outside Range floor								X				X					
11 Basement Classroom Desk								X				X					
12 Supply office Desk								X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 6/4/13 @ 1000 Via: FedEx By (Print): MCM Sign:
2. Date/Time Analyzed: 6/11/13 @ 15:35 By (Print): BUTRUK Sign:
3. Results Reported To: Shirley Champman Via: Email Date: 6/11/13 Time:

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room May, 2018

FOIA Requested Record WJ-15-0952 (MD) Released by National Guard Bureau

BEST AVAILABLE COPY

OM (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516027

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Elkton RC
2. Job Location: Elkton MD
3. Job #: PO. #: W912K6-09-A-0003
4. Contact Person: [redacted] Non-Responsive @ ph: [redacted] Non-Responsive 2-0273
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible).

AFTER HOURS (must be pre-scheduled)
- ☐ Immediate Date Due:
- ☐ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ☐ Immediate
- ☐ Next Day
- ☐ 2 Day
- ☐ 3 Day
- ☐ 5 Day +
- Date Due:
- ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
- ☒ Include COC/Field Data Sheets with Report
- ☒ Email: [redacted] Non-Responsive @
- ☐ Fax: @us.army.mil
- ☐ Verbal [redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 (QTY)
- ☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA (QTY)
- ☐ NIOSH 7402 (QTY)
- ☐ Other (specify) (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate (QTY)
- ☐ EPA Point Count (QTY)
- ☐ NY State Friable 198.1 (QTY)
- ☐ Grav. Reduction ELAP 198.6 (QTY)
- ☐ Other (specify) (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield (QTY)
- ☐ NY State PLM/TEM (QTY)
- ☐ Residual Ash (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 (QTY)
- ☐ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
- ☐ Qual. (pres/abs) (QTY)
- ☐ ELAP 198.2/EPA 100.2 (QTY)
- ☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples °C)

Metals Analysis
- ☐ Pb Paint Chip (QTY)
- ☐ Pb Dust Wipe (wipe type) (QTY)
- ☐ Pb Air (QTY)
- ☐ Pb Soil/Solid (QTY)
- ☐ Pb TCLP (QTY)
- ☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Pb Furnace (Media) (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ☐ Spore-Trap (QTY)
- ☐ Surface Swab (QTY)
- ☐ Surface Tape (QTY)
- ☐ Other (Specify) (QTY)
- ☐ Surface Vacuum Dust (QTY)
- ☐ Culturable ID Genus (Media) (QTY)
- ☐ Culturable ID Species (Media) (QTY)

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
13	Recruiting Office Desk	5-30		100 cm²				X				X					Date/Time: Contact: By:
14	JSC office Top of Safe			↓				X				X					
15	Commander Office Bookshelf							X				X					
16	2nd fl. Class room table			↓				X				X					
17	Blank wipe			O				X				X					Date/Time: Contact: By:
18	Blank Air		O					X		X							
19	Mens Bathroom Basin						X				X						
																	Date/Time: Contact: By:

LABORATORY USE ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room May 2009

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditationlab.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Elkton-RC	**Chain Of Custody:**	516027
Address:	301-lH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Elkton, MD	**Date Submitted:**	6/3/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/11/2013 **Report Date:** 6/11/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13067201	1	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13067202	2	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13067203	3	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067204	4	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067205	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067206	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067207	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067208	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067209	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067210	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067211	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067212	12	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067213	13	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067214	14	Flame	Wipe	****	0.108	110	ug/ft²	18	170	ug/ft²	
13067215	15	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067216	16	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067217	17	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
13067218	18	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2798 of 5269

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY
INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY
ISO/IEC 17025:2005
www.aihaaccreditedlabs.org
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Elkton-RC	**Chain Of Custody:**	516027		
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Elkton, MD	**Date Submitted:**	6/3/2013		
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive		
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/11/2013	**Report Date:**	6/11/2013

Attention: Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft^2)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: Suphir Chinnapad

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NYELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516027

page 1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Elkton - RC
2. Job Location: Elkton, MD
3. Job #: [redacted] P.O. #: W912K6-09-A-0003
4. Contact Person: Non-Responsive @ phone # (410) 942-0273
5. Submitted by: [redacted] Signature: Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☒ Immediate Date Due: ☐ 24 Hours Time Due: Comments:	☒ Immediate ☐ Next Day ☐ 2 Day ☐ 3 Day ☒ 5 Day + Date Due: 6/11/13 ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report ☒ Email: Non-Responsive ☐ Fax: [redacted] ☐ Verb [redacted]

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☒ EPA 600 – Visual Estimate 1 (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type Chart) 15 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WIPES AND OTHER	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
1	Drill Hall	5-30	450					X		X							Date/Time: Contact: By:
2	Converted Range		450					X		X							
3	Drill Hall floor			100 cm²				X				X					
4	Drill Hall Computer							X				X					
5	Drill Hall Table							X				X					Date/Time: Contact: By:
6	Kitchen Fridge							X				X					
7	Kitchen microwave							X				X					
8	Range and Converted floor							X				X					
9	Converted Range locker							X				X					Date/Time: Contact: By:
10	Hallway outside Range							X				X					
11	Barracks Classroom Desk							X				X					
12	Supply office Desk							X				X					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 6 / 4 / 13 @ 1000 Via: Fedex By (Print): MEM Sign:
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: 7045 0135 5842

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room May, 2018

FOIA Requested Record #J-15-0085 (MD) Released by National Guard Bureau

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

5160027
page 2 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Elkton NC
2. Job Location: Elkton MD
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Perso[redacted] @ ph[redacted]-0273
5. Submitted by[redacted]ature: [redacted]

Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS			REPORT TO:
☐ Immediate Date Due:	☐ Immediate	☐ 3 Day	☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)	☒ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due:	☐ Next Day	☐ 5 Day +		☒ Email: [redacted]us.army.mil
Comments:	☐ 2 Day	Date Due:		☐ Fax:
				☐ Verbals: [redacted]us.army.mil

Non-Responsive

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area)Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Metals Analysis
- ☐ Pb Paint Chip ____ (QTY)
- ☐ Pb Dust Wipe (wipe type ____) ____ (QTY)
- ☐ Pb Air ____ (QTY)
- ☐ Pb Soil/Solid ____ (QTY)
- ☐ Pb TCLP ____ (QTY)
- ☐ Drinking Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Waste Water ☐ Pb ____ (QTY) ☐ Cu ____ (QTY) ☐ As ____ (QTY)
- ☐ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
- ☐ Spore-Trap ____ (QTY)
- ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Swab ____ (QTY)
- ☐ Culturable ID Genus (Media ____) ____ (QTY)
- ☐ Surface Tape ____ (QTY)
- ☐ Culturable ID Species (Media ____) ____ (QTY)
- ☐ Other (Specify ____) ____ (QTY)

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHERS	SPORE TRAP	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
13	Recruiting - office Desk	5.30		100cm²				X				X					Date/Time: Contact: By:
14	1st office Top of Saf.			↓				X				X					
15	Commander office - Bookshelf							X				X					
16	2nd fl. Class room - table							X				X					
17	Blank - wipe			0				X				X					Date/Time: Contact: By:
18	Blank - Air		0					X		X							
19	Meals Bathroom - Basin						X				X						
																	Date/Time: Contact: By:

LABORATORY STAFF ONLY (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2801 of 5269

Appendix B. Photographs

Exterior of facility

Drill Hall

Converted firing range/wall locker storage area

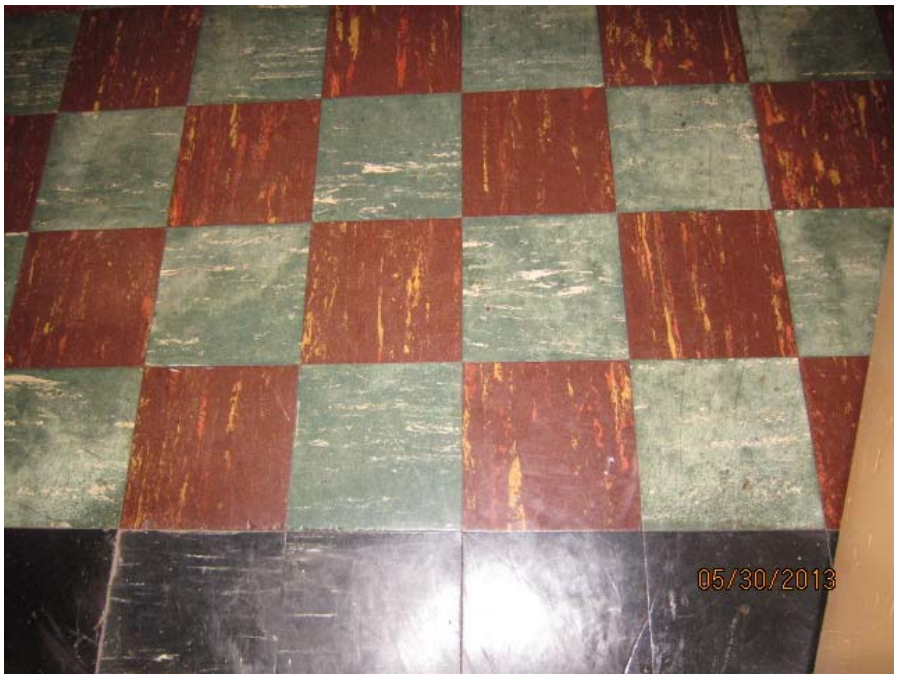

Green, black and red 9”X9” floor tile

Basement bathroom suspect asbestos damaged mudded joint fitting and pip insulation

Water damaged ceiling tiles throughout facility

Effloresce on exterior walls on the second floor

Appendix C. Floor Plan

ELKTON ARMORY FIRE PROTECTION PLAN
LOCATION OF FIRE PROTECTION EQUIPMENT

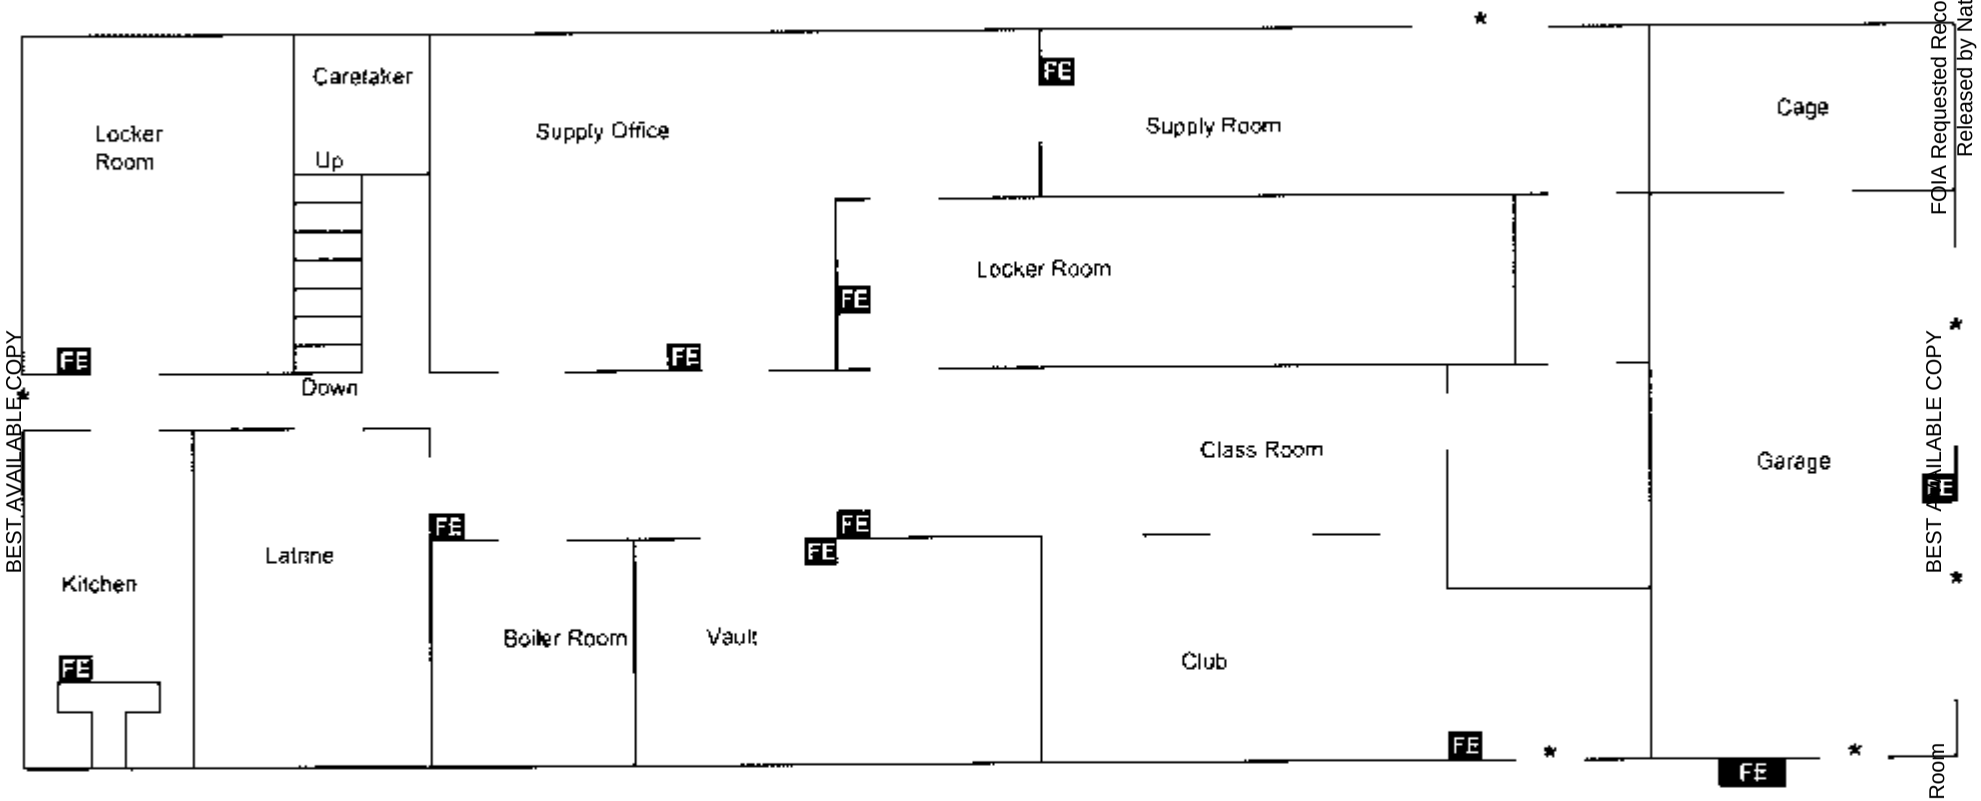

FE Fire Extinguisher

* Building Fire Exits

BASEMENT LEVEL

18 January 2013

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2808 of 5269
Posted to NGB FOIA Reading Room
May, 2018

ELKTON ARMORY FIRE PROTECTION PLAN
LOCATION OF FIRE PROTECTION EQUIPMENT

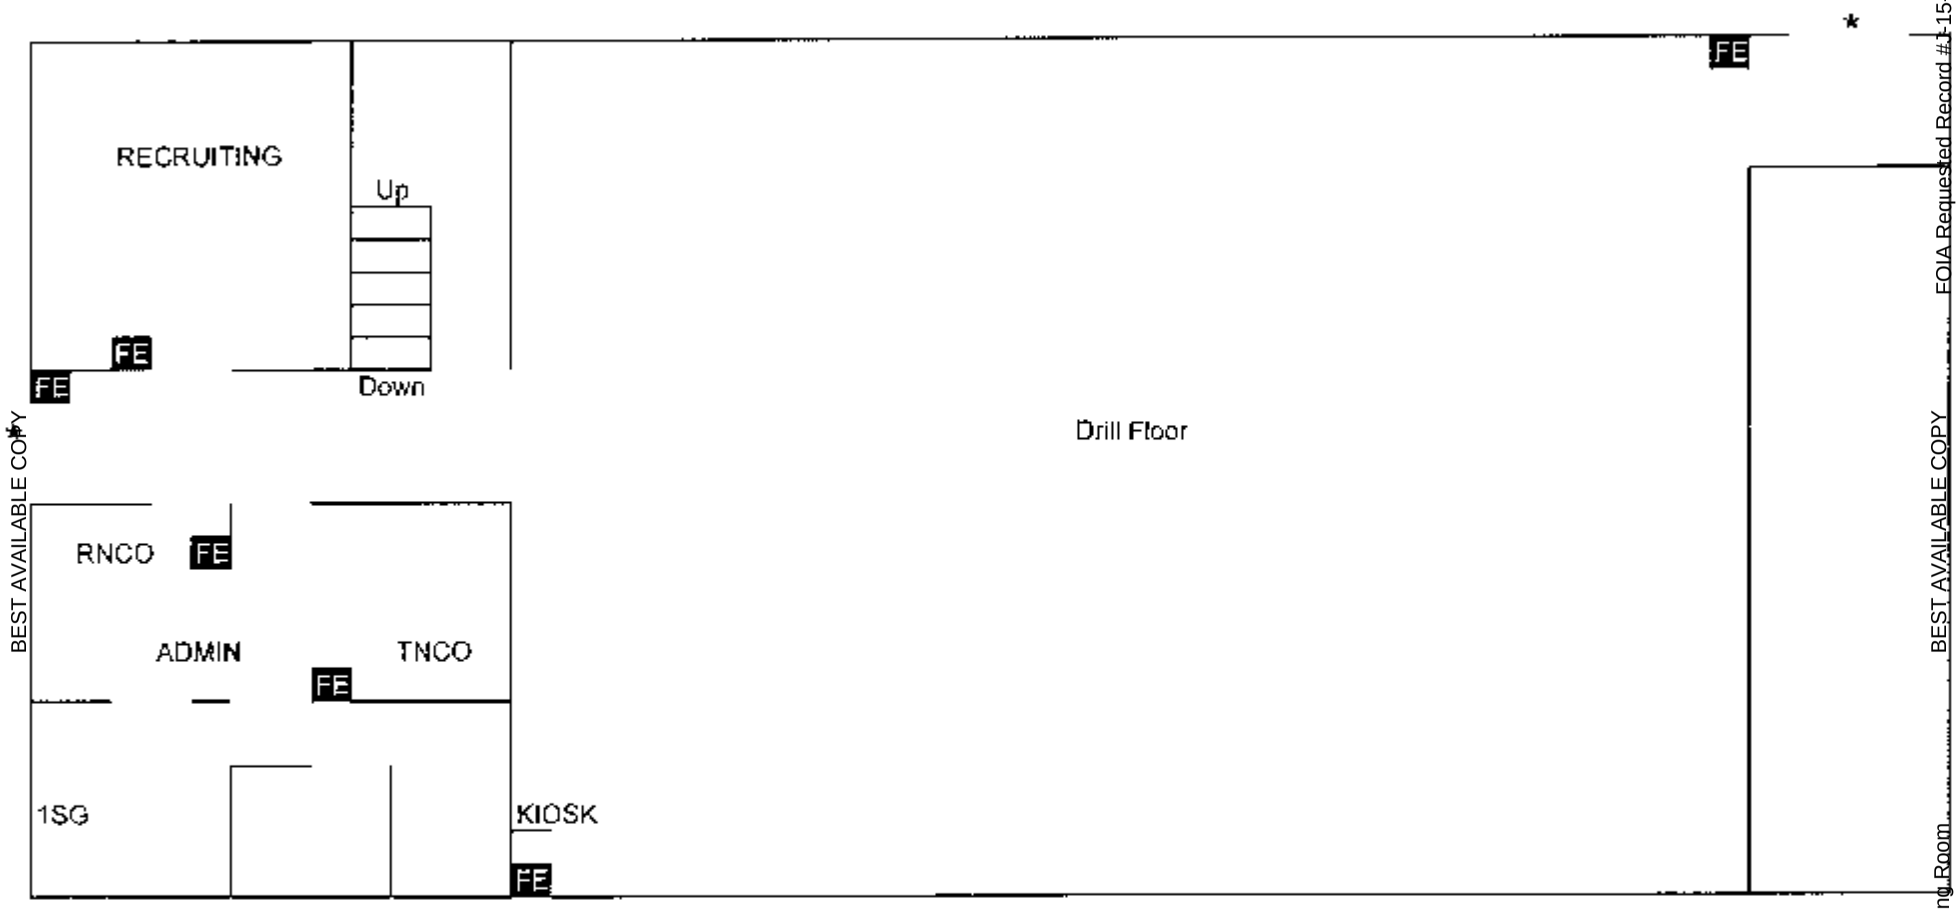

FE Fire Extinguisher

* Building Fire Exits

MAIN FLOOR

18 January 2013

BEST AVAILABLE COPY
BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #1-15-0085 (MD)
Released by National Guard Bureau
Page 2809 of 5269

ELKTON ARMORY FIRE PROTECTION PLAN
LOCATION OF FIRE PROTECTION EQUIPMENT

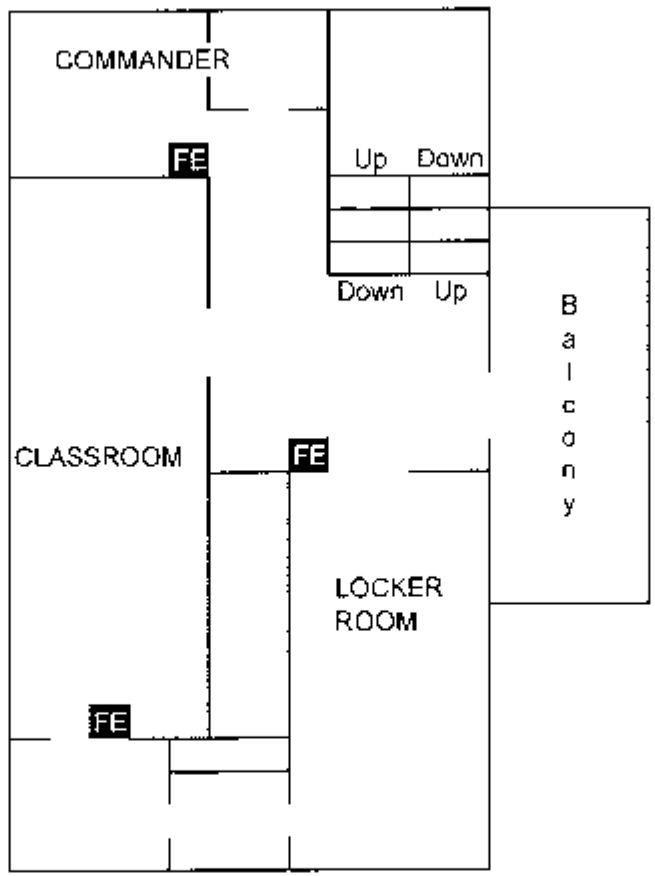

FE Fire Extinguisher

* Building Fire Exits

TOP FLOOR

18 January 2013

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2810 of 5269
Posted to NGB FOIA Reading Room
May, 2018

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. American National Standard Institute (ANSI)/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

May 2004

MEMORANDUM FOR Army National Guard Bureau (NGB) Region North Industrial Hygiene NGB-AVS-SI-IH [redacted], 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03 CPT Michael Cresap Armory, Frederick, MD

1. Enclosed is a copy of subject report and one CD-ROM.

2. Please direct any additional comments or concerns to Ms. [redacted], at DSN 584-5475/3118, commercial (410) 436-5475/3118 or e-mail address at [redacted]@apg.amedd.army.mil.

ENCL

[redacted]
Industrial Hygienist
Industrial Hygiene Field Services Program

Readiness thru Health

Printed on Recycled Paper

BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
CPT MICHAEL CRESAP ARMORY
FREDERICK, MD
55-ML-01ED-03

Approved for public release; distribution unlimited.

CHPPM FORM 432-E (MCHB-CS-IPD), OCT 03

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2813 of 5269

U.S. ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE

The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) lineage can be traced back over 50 years to the Army Industrial Hygiene Laboratory. That organization was established at the beginning of World War II and was under the direct jurisdiction of The Army Surgeon General. It was originally located at the Johns Hopkins School of Hygiene and Public Health, with a staff of three and an annual budget not to exceed $3000. Its mission was to conduct occupational health surveys of Army operated industrial plants, arsenals, and depots. These surveys were aimed at identifying and eliminating occupational health hazards within the Department of Defense's (DOD) industrial production base and proved to be beneficial to the Nation's war effort.

Until 1995, it was nationally and internationally known as the U.S. Army Environmental Hygiene Agency or AEHA. Its mission is expanding to support the worldwide preventive medicine programs of the Army, DOD and other Federal Agencies through consultations/ supportive services; investigations and training.

Today, AEHA is redesignated the U.S. Army Center for Health Promotion and Preventive Medicine. Its mission for the future is to provide worldwide technical support for implementing preventive medicine, public health and health promotion/wellness services into all aspects of America's Army and the Army Community anticipating and rapidly responding to operational needs and adaptable to a changing work environment.

The professional disciplines represented at the Center include chemists, physicists, engineers, physicians, optometrists, audiologists, nurses, industrial hygienists, toxicologists, entomologists, and many other as well as sub-specialties within these professions.

The organization's quest has always been one of excellence and continuous quality improvement; and today its vision, to be the nationally recognized Center for Health Promotion and Preventive Medicine, is clearer than ever. To achieve that end, it holds ever fast to its values which are steeped in its rich heritage:

- *Integrity is the foundation*
- *Excellence is the standard*
- *Customer satisfaction is the focus*
- *Its people are the most valued resource*
- *Continuous quality improvement is its pathway*

The organization, which stands on the threshold of even greater challenges and responsibilities, has General Officer leadership. As it moves into the next century, new programs are being added related to health promotion/wellness, soldier fitness and disease surveillance. As always, its mission focus is centered upon the Army Imperatives so that we are trained and ready to enhance the Army's readiness for war and operations other than war.

It is an organization fiercely proud of its history, yet equally excited about the future. It is destined to continue its development as a world-class organization with expanded services to the Army, DOD, other Federal Agencies, the Nation and the World Community.

CHPPM FORM 433-E (MCHB-CS-IPD), OCT 03 *(reverse)*

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES INDUSTRIAL HYGIENE BASELINE SURVEYS, CPT MICHAEL CRESAP ARMORY
FREDERICK, MD
PROJECT NO. 55-ML-01ED-03

1. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

2. CONCLUSIONS.

a. Lead. All air samples are below the laboratory analytical detection limits for lead in air of 0.003mg/m³. The air is not believed to be an exposure pathway for lead in this facility. One surface dust-lead sample exceeded the USACHPPM recommended decontamination levels for lead. This elevated level of dust-lead may be contacted by the general workforce. Three surface dust-lead samples exceeded the EPA lead exposure levels for children under 6. There is a health risk to children from surface dust-lead in two rooms. Workers involved in renovation and abatement activities may be occupationally exposed to lead.

b. Mold. Excessive moisture from the leaking roof in the armory appears to have caused mold growth.

3. RECOMMENDATIONS.

The Department of Defense Risk Assessment Codes (RAC) for Health Hazards enables one to prioritize remedial action for hazards. Risk Assessments Codes range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead. The RAC for this armory for Lead Exposure is classified as 4. The RAC for Mold Exposure is 5. To minimize lead exposure, develop a written Lead Hazard Management Plan. Clean all areas in and adjacent to the converted indoor firing range where sampling results show elevated levels of lead. Comprehensive guidelines for cleaning are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62. There is a potential for taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2815 of 5269

disposable coveralls as extra protection when working in areas identified as having elevated levels of lead. Address all potential lead hazards before extending this facility to use for children. If children will be using this facility, clean surfaces to the EPA dust-lead standards for young children of 40 µg/ft² on floors and 100µg/ft² for dust-lead on window sills. Test drinking water from water fountains and faucets for lead.

b. Mold. To minimize exposure to mold, abate all areas of visible mold following the most current Army guidance in the USACHPPM Technical Guide 277 Army Facilities Management Information Document on Mold Remediation Issues, February 2002 in Appendix G. The roof will be replaced in late August 2003.

BEST AVAILABLE COPY

MDARNG Facilities IH Baseline Surveys, CPT Michael Cresap Armory, Frederick, MD
Project No. 55-ML-01ED-03

TABLE OF CONTENTS

Paragraph Page

1. AUTHORITY 1
2. PURPOSE OF EVALUATION 1
3. BACKGROUND INFORMATION 1
4. SUMMARY OF ACTIONS 1
5. ASSESSMENT CRITERIA FOR LEAD 2
6. SAMPLING RESULTS 2
7. DISCUSSION 3
8. CONCLUSIONS 3
9. RECOMMENDATIONS 4
10. ADDITIONAL ASSISTANCE 4

Enclosure

1. Lead Exposure 5
2. Mold Exposure 5
3. Additional Recommendations 5

Appendices

A. - ASSESSMENT CRITERIA FOR LEAD A-1
B. - SITE MAPS B-1
C. - PHOTOGRAPHS C-1
D. - SAMPLING SHEETS AND LAB ANALYSES D-1
E. - REFERENCES E-1
F. - LEAD CLEANING GUIDANCE F-1
G. - MOLD GUIDANCE G-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2817 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

REPLY TO ATTENTION OF

MCHB-TS-OFS

MEMORANDUM FOR SEE DISTRIBUTION

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, Project No. 55-ML-01ED-03

LOCATION: CPT Michael Cresap Armory, Frederick, MD

1. AUTHORITY. E-Mail dated 28 February 2003 from Ms Non-Responsive, Industrial Hygienist, MD Army National Guard, to the USACHPPM Industrial Hygiene Field Services Program.

2. PURPOSE OF EVALUATION. To conduct surveys at Army National Guard (ARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions at ARNG facilities. The survey will serve to establish a baseline so that a worker's history of exposures is provided for each civilian or military employee.

3. BACKGROUND INFORMATION.

a. Armory Mission. Infantry and Communications 1st Battalion, 115 Infantry Regiment, Company B.

b. Date of Construction. 1980.

c. POC. SGM Non-Responsive (410)702-9772; (410)446-2972.

d. Survey Date. 7 August 2003.

4. SUMMARY OF ACTIONS.

a. Sampling. Surface dust-lead wipe and air sampling was conducted to determine the existence of lead-based paint and/or lead-based paint hazards (paint-lead hazards). Sample locations are in Appendix D.

b. Physical Condition of Facilities.

(1) Paint. All paint was in an intact condition. Asbestos. Staff Sergeant Non-Responsive, Environmental Compliance Assessment Coordinator for the MD NGB, stated that all lead and asbestos has been abated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2818 of 5269

BEST AVAILABLE COPY

(2) Mold. The armory POC stated that the roof leaked causing mold growth. (photo # 1468). Funding has been received for a new roof. The roof is scheduled to be installed in late August.

(3) Safety Hazards. No safety hazards were observed.

c. Other Building Issues. SGT Non-Responsive [redacted] offices were recently renovated. New duct work was installed to give supply air to the offices.

d. Safety and Industrial Hygiene Programs. There are no written program records at the armory.

e. Heating, Ventilation, and Air-conditioning System (HVAC). There is a central HVAC system. At the time of our visit it was not working up to capacity. The armory manager ordered a new pulley for the fan supplying office area ventilation.

f. Noise Dosimetry. No operation that could produce hazardous noise levels was identified.

g. Lighting. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting. No measurements were taken.

h. Converted indoor firing range (IFR). The old IFR was converted to a storage garage for the tractor.

i. Photographs (Appendix C).

j. Site Maps (Appendix B).

k. Facility use by children. The POC stated that the use of this facility for children is occasional.

5. ASSESSMENT CRITERIA FOR LEAD. (Appendix A).

6. SAMPLING RESULTS. Lead in air and surface dust-lead wipe sample results are shown in Appendix D. All air sample results were below the laboratory analytical detection limits of 0.003mg/m³ lead in air. One of 7 surface dust-lead wipe samples exceeded the USACHPPM recommended decontamination level of 200µg/ft² for floors and other frequently-contacted surfaces. Three surface dust-lead wipe samples exceeded the EPA lead exposure levels for children under 6.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2819 of 5269

BEST AVAILABLE COPY

7. DISCUSSION.

a. Lead. The surface dust-lead wipe sample exceeding USACHPPM decontamination guidance was collected on the floor in the back of the IFR where the baffle used to be (1459). Three surface dust-lead wipe samples exceeded the EPA lead exposure levels for children. The first was on the floor in the back of the IFR where the baffle used to be (1459); the second on the floor of the IFR in front of where the baffle used to be (1460); and the third on the floor of the storage area adjacent to the old IFR near the NBC cage. EPA regulations define dust-lead standards for young children in child-occupied facilities. The EPA standard for dust-lead on floors is 40µg/ft², and 100µg/ft² for dust-lead on window sills. These levels were developed for children under 6 spending at least 60 hours per year in pre-1978 facilities. Two surface dust-lead samples collected in this armory exceeded these standards and one of these samples greatly exceeded the standard. Although this armory does not meet the EPA definition of child-occupied facility's minimum time requirement for child use, USACHPPM believes that there is a potential hazard for children using this facility. AR 420-70 states that the purpose of Army lead hazard management is to protect children from all sources of lead exposure. However, its provisions only control these exposures, and do not eliminate them. Although this facility may comply with EPA and Army regulations, exposures for children under 6 may exceed those that the regulations are intended to prevent.

b. The mold growth observed can be remediated by following USACHPPM guidance in Appendix G.

8. CONCLUSIONS.

a. All air samples are below the laboratory analytical detection limit for lead in air of 0.003mg/m³.

b. One surface dust-lead sample is above the USACHPPM recommended decontamination levels.

c. Three surface dust-lead samples exceeded the EPA lead exposure levels for children under 6. One of these samples greatly exceeded the standard. There is a potential health risk to children from surface dust-lead in two rooms in the armory.

d. Elevated levels of dust-lead exist on surfaces that may be contacted by the general workforce.

e. Workers involved in renovation and abatement activities may be occupationally exposed to lead.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2820 of 5269

BEST AVAILABLE COPY

f. Excessive moisture from the leaking roof in the armory appears to have caused mold growth. The roof will be replaced.

9. RECOMMENDATIONS. Enclosure.

10. ADDITIONAL ASSISTANCE. For additional assistance, or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by e-mail Non-Responsive@apg.amedd.army.mil.

Non-Responsive

INDUSTRIAL HYGIENIST
USACHPPM LEAD AND ASBESTOS TEAM LEADER
Industrial Hygiene Field Services Program
EPA AHERA Asbestos Inspector and Management Planner/
Certification Number MD-070340
EPA Lead Inspector and Lead Risk Assessor/
Certification Number 04-7913

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2821 of 5269

BEST AVAILABLE COPY

ENCLOSURE

FREDERICK ARMORY RECOMMENDATIONS

The Department of Defense Instruction Number (DODI) 6055.1 provides Risk Assessment Codes (RAC) for Health Hazards, a procedure which allows us to assess the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single numeral. RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority. The RAC for this armory for Lead Exposure is classified as 4. The RAC for Mold Exposure is classified as 5.

1. RAC #1. Lead Exposure.

a. Develop a written Lead Hazard Management Plan for CPT Michael Cresap Armory.

b. Clean all areas in and adjacent to the old IFR where sampling results showed elevated levels of lead. Comprehensive guidelines are in Appendix F. Consult with the Maryland Armory Environmental Coordinator concerning waste disposal requirements after cleanup.

c. A potential occupational exposure to lead has been identified for workers involved in renovation and abatement activities. These workers are required to be in compliance with the OSHA lead in construction standard 29 CFR 1926.62.

d. There is a potential for personnel taking lead contamination out of the workplace into their vehicles and homes. Wear disposable gloves and disposable coveralls as extra protection when working in areas identified as having elevated levels of lead.

e. Test drinking water from water fountains and faucets for lead. It could not be determined if this has been done.

f. Address all potential lead hazards before extending this facility to use for children. If children will be using this facility, clean surfaces to the EPA dust-lead standards for young children of 40 $\mu g/ft^2$ on floors and 100$\mu g/ft^2$ for dust-lead on window sills.

2. RAC # 2. Mold Exposure.

Abate all areas of visible mold following the most current Army guidance on page 12 of USACHPPM Technical Guide 277 Army Facilities Management Information Document on Mold Remediation Issues, February 2002 in Appendix G.

3. Additional Recommendations. Replace the leaking roof.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2822 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

Subject: Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 $\mu g/ft^2$. This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e)(8)(viii))are not directly applicable because they are developed for floors (40 $\mu g/ft^2$), windowsills (250 $\mu g/ft^2$) and window troughs (400 $\mu g/ft^2$) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA used to cite a level of 200 $\mu g/ft^2$ in their Technical Manual and 29 CFR 1926.62 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 $\mu g/ft^2$ is a safe surface contamination level. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels above these recommendations do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All states will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 0.05 mg/m^3 averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

BEST AVAILABLE COPY

APPENDIX B

SITE MAPS

BEST AVAILABLE COPY

BEST AVAILABLE COPY

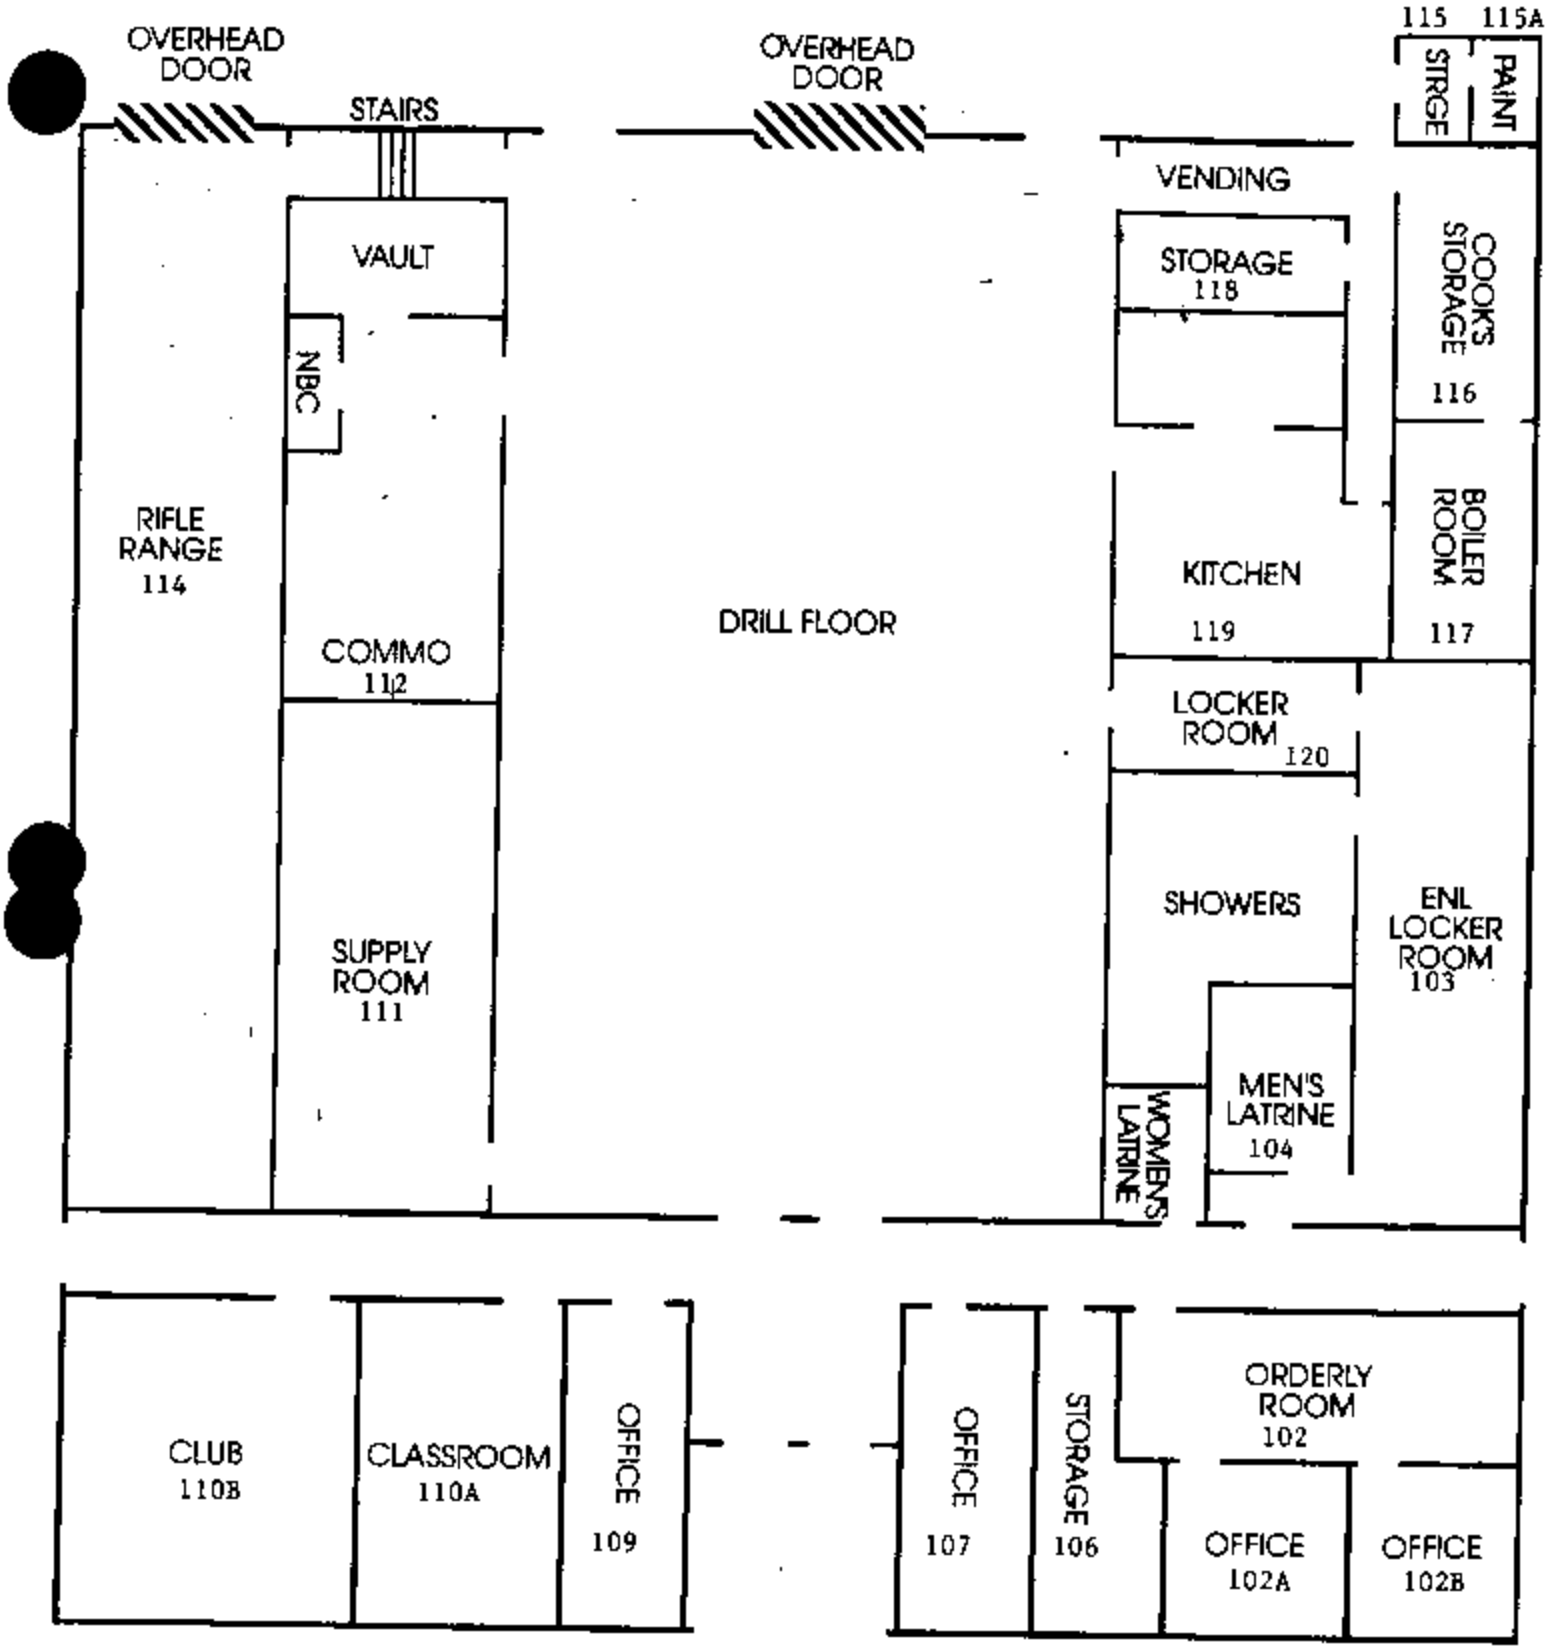

FREDRICK

BEST AVAILABLE COPY

APPENDIX C

PHOTOGRAPHS

BEST AVAILABLE COPY

Photo Number	Photo Location
1459	Former IFR floor (in back of where baffle used to be)
1460	Former IFR floor (in front of where baffle used to be)
1462	Office area directly adjacent to former IFR
1463	Floor outside former IFR door
1464	Cabinet near ventilation in former IFR
1465	Drill area floor outside former IFR
1466	Storage area floor outside former IFR near NBC cage
1468	Mold growth caused from roof leak

1459

1460

1462

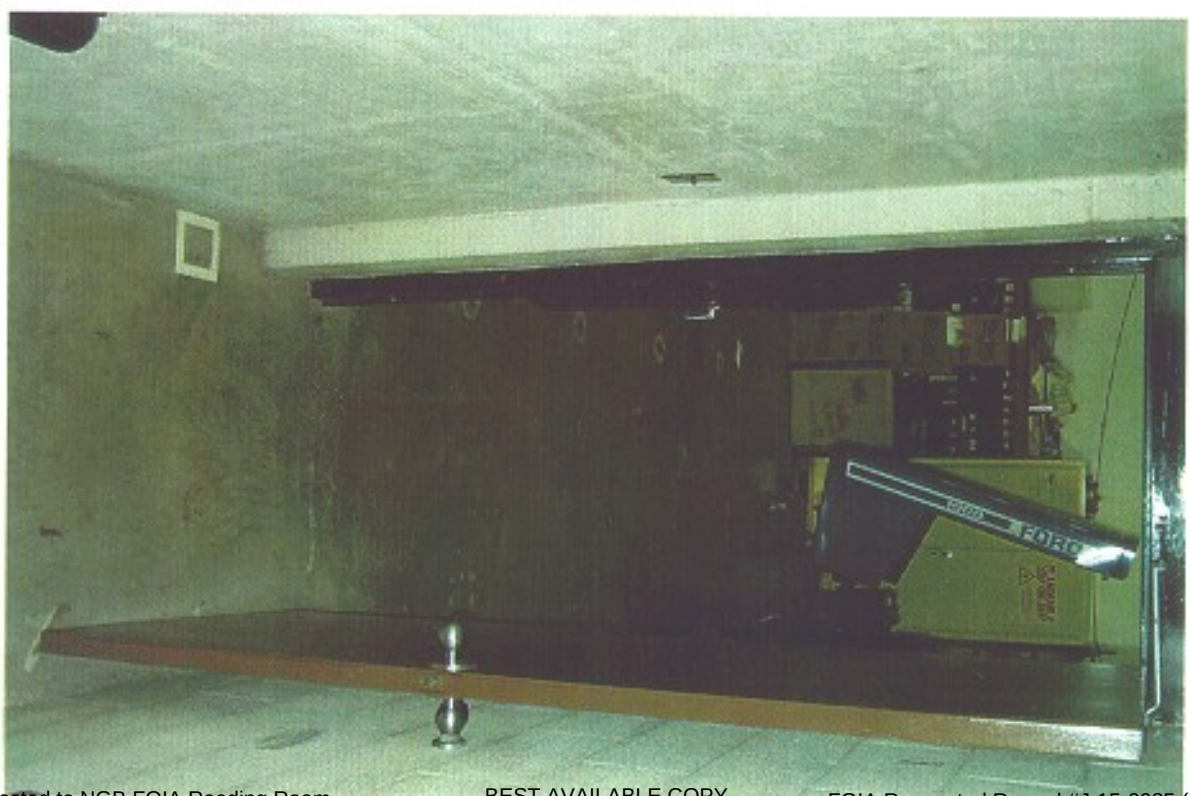

1463

1464

1465

1466

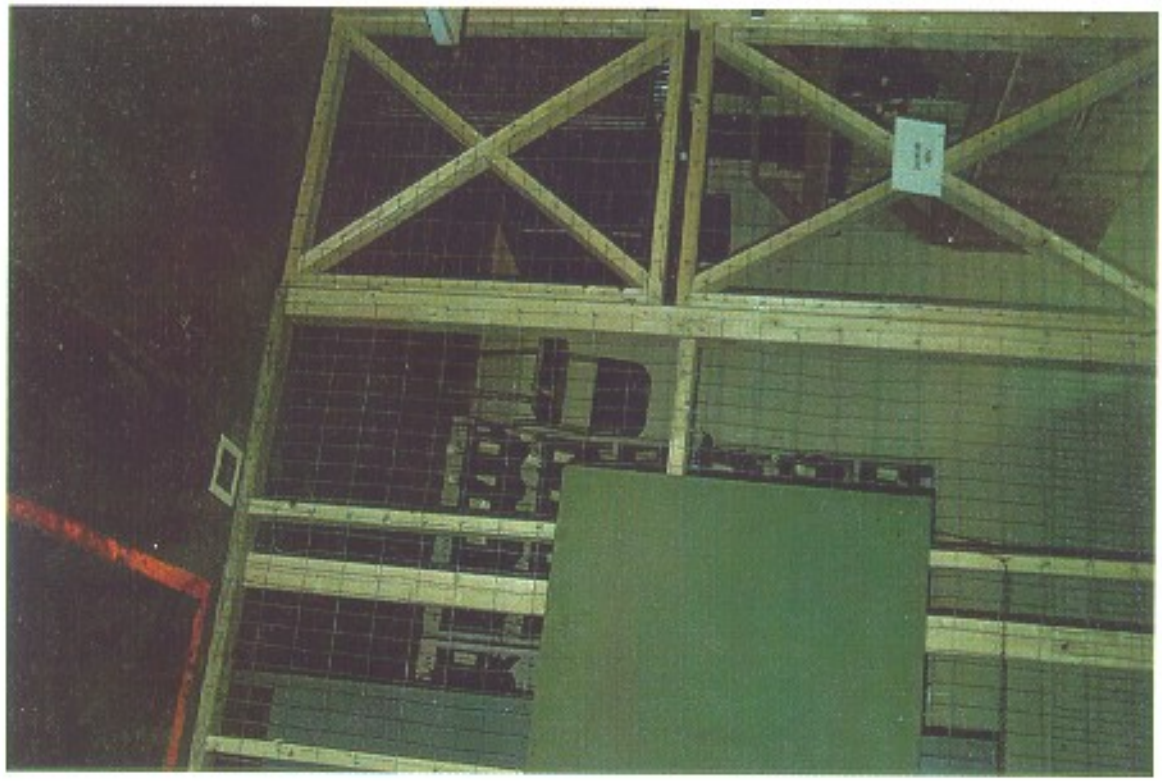

1468

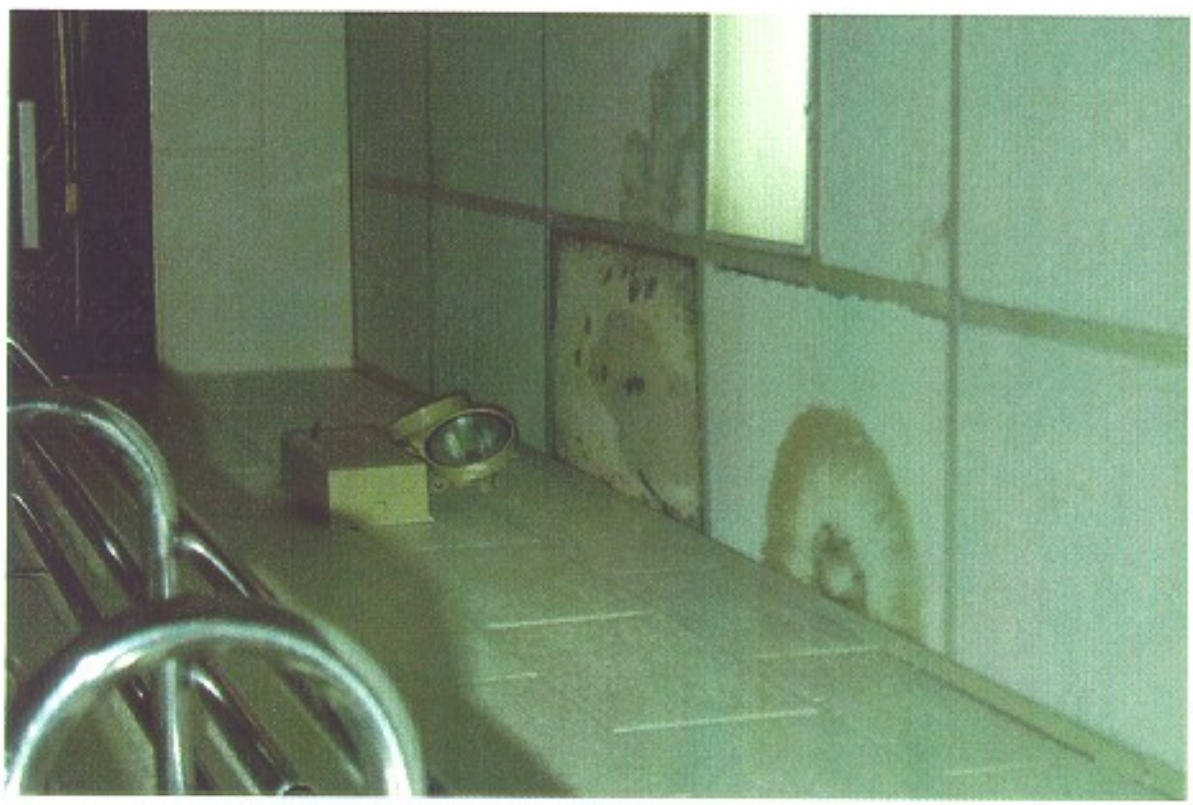

BEST AVAILABLE COPY

APPENDIX D

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

Wipe Sample #	Armory	City	Indoor Range Info: Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
			No			Unknown		
FRW01	Frederick	Frederick					Former IFR floor (in back of where baffle used to be)	834
FR02	Frederick	Frederick						
	Frederick	Frederick					Former IFR floor (in front of where baffle used to be)	57
FRW03	Frederick	Frederick						
	Frederick	Frederick					Office area directly adjacent to former IFR	BDL
FRW04	Frederick	Frederick						
	Frederick	Frederick					Floor outside former IFR door	27
FRW05	Frederick	Frederick						
	Frederick	Frederick					Cabinet near ventilation in former IFR	BDL
FRW06	Frederick	Frederick						
	Frederick	Frederick					Drill area floor outside former IFR	BDL
FRW07	Frederick	Frederick						
	Frederick	Frederick					Storage area floor outside former IFR near NBC cage	97

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
US Army CHPPM
Bldg. 1570 Stark Road
APG, MD 21015

Reference Data:	**Lead**
Client Sample No.:	SPAS01 through Blank01
P.O. No.:	Not Available
Sample Location:	Fredrick NG Armory & OMS
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-3990
DCL Sample ID No.:	03-24663 through 03-24667
Sample Receipt Date:	8/19/2003
Preparation Date:	08/20/03
Analysis Date:	08/20/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m^3
SPAS01	03-24663	325.2	ND	<0.003
SPAS02	03-24664	297.8	ND	<0.003
SPAS03	03-24665	332.3	ND	<0.003
Blank02	03-24666	0	ND	-
Blank01	03-24667	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		99.	
RPL			**1.**	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2836 of 5269

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

ANALYTICAL REQUEST FORM

☐ **REGULAR** Status (5 working days from receipt)

☐ **RUSH** Status Required - ADDITIONAL CHARGE
RESULTS REQUIRED BY _____ DATE
CONTACT DATACHEM LABS PRIOR TO SENDING SAMPLES

Date _____ Purchase Order No. _____

Company Name . COMMANDER, USACHPPM
ATTN: MCHB-TS-OFS
5158 BLACKHAWK ROAD
APG, MD 21010-5403

Address _____

City _____ Zip _____

Person to Conta[redacted]

Telephone (410) 436-3118

Fax Telephone (410) 436-5471

Billing Address (if different from above)
MD NG office
Havre de Grace, MD

Quote No. _____

Sample Collection

Sampling Site FREDRICK NG ARMORY + OMS

Industrial Process _____

Date of Collection 5 Aug 03

Time Collected _____

Date of Shipment _____

QC Require[redacted]

Collector's [redacted]

Signature [redacted]

REQUEST FOR ANALYSES 03-S-3990

Laboratory Use Only	Client Sample Number	Media Type*	Sample Volume (Liters)	ANALYSES REQUESTED - Use Method Number if Known
24663	SPAS01		325.2	LEAD - NIOSH 7300
24664	SPAS02		297.8	LEAD - NIOSH 7300
24665	SPAS03		332.3	LEAD - NIOSH 7300
24666	BLANK02			LEAD - NIOSH 7300
24667	BLANK01			Lead - NIOSH 7300

* EMAIL RESULTS TO [redacted]apg.amedd.army.mil

CHAIN OF CUSTODY

Relinquished by: (Signature)	Date / Time	Received by: (Signature)	Date / Time
[redacted]	6 Aug 03		8/7/03 1003
Relinquished by: (Signature)	Date / Time	Received by: (Signature)	Date / Time

4388 Glendale Milford Road / Cincinnati, OH 45242 • 800-458-1493 or 513-733-5336 / Fax: 513-733-5347

DISTRIBUTION: WHITE – LABORATORY COPY CANARY – CUSTOMER COPY

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
US Army CHPPM
Bldg. 1570 Stark Road
APG, MD 21015

Reference Data:	**Lead**
Client Sample No.:	SPAS01 through Blank01
P.O. No.:	Not Available
Sample Location:	Fredrick NG Armory & OMS
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-3990
DCL Sample ID No.:	03-24663 through 03-24667
Sample Receipt Date:	8/19/2003
Preparation Date:	08/20/03
Analysis Date:	08/20/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive

Analyst

Non-Responsive

Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m³
SPAS01	03-24663	325.2	ND	<0.003
SPAS02	03-24664	297.8	ND	<0.003
SPAS03	03-24665	332.3	ND	<0.003
Blank02	03-24666	0	ND	-
Blank01	03-24667	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		99.	
RPL			1.	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2839 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	RES 96596-1
Client:	Army National Guard Hf - West
Client Project Number / P.O.:	None Given
Client Project Description:	None Given
Date Samples Received:	August 19, 2003
Analysis Type:	USEPA SW846 3050B / AA(7420)
Turnaround:	3-5 Day
Date Samples Analyzed:	August 22, 2003

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
SPBLANK01	EM 806502	0.11	BDL	23	BDL
SPW01	EM 806503	0.11	BDL	23	BDL
SPW02	EM 806504	0.11	BDL	23	BDL
SPW03	EM 806505	0.11	17.3	23	157
SPW04	EM 806506	0.11	BDL	23	BDL
SPW05	EM 806507	0.11	4.5	23	41
SPBLANK02	EM 806508	0.11	BDL	23	BDL
SPW06	EM 806509	0.11	56.3	23	512
SPW07	EM 806510	0.11	3.8	23	35
SPW08	EM 806511	0.11	BDL	23	BDL
SPW09	EM 806512	0.11	BDL	23	BDL
SPW10	EM 806513	0.11	BDL	23	BDL
SPW11	EM 806514	0.11	BDL	23	BDL
SPW12	EM 806515	0.11	BDL	23	BDL
SPW13	EM 806516	0.11	BDL	23	BDL
SPBLANK03	EM 806517	0.11	BDL	23	BDL
FRBLANK01	EM 806518	0.11	BDL	23	BDL
FRW01	EM 806519	0.11	91.7	23	834
FRW02	EM 806520	0.11	6.3	23	57
FRW03	EM 806521	0.11	BDL	23	BDL
FRW04	EM 806522	0.11	3.0	23	27
FRW05	EM 806523	0.11	BDL	23	BDL
FRBLANK02	EM 806524	0.11	BDL	23	BDL
FRW06	EM 806525	0.11	BDL	23	BDL
FRW07	EM 806526	0.11	10.7	23	97

*Calculations Based On A 1 sq.ft. Sample Area Unless Otherwise Noted

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2840 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

REMIT TO: 2059 Bryant St. Denver, CO 80211

Invoice to:

Army National Guard IH - West
3401 Quebec Street, Suite 7200
Denver CO 80207

Invoice Date: August 26, 2003
Invoice Number: RES 96596-1

TERMS: Net 30 Days

Service Charge of 18% per annum may by charged on past due invoices.

Quantity	Analytical Procedure				Unit Price	Amount
	RES Job #:	RES 96596-1				
	Desc:	None Given				
	Submitted By:	Army National Guard IH - West				
	P/O No:	None Given				
	Contact:	[redacted]				
25	AA/ICP Metal	Wipe	3-5 Day	4125-02	$7.50	$187.50
					Invoice Total:	$187.50

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2841 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

2059 Bryant St., Denver CO 80211

Due Date: 8/22 → 8/20/03

Due Time: 2:45pm

RESI Job #: 96596

Page 2 of 2

SAMPLES SUBMITTED BY:

Company: COMMANDER, USACHPPM
Address: ATTN: MCHB-TS-DBS
3105 BLACKHAWK ROAD
APG, MD 21010-5403

Contact:
Phone: 410-436-3118
Contact:
Phone:
Project Number and/or P.O. #:
Project Description/Location:

INVOICE TO: (IF DIFFERENT)

MD NG OFFICE
HAVRE DE GRACE, MD
Fax: 410-436-5471 Pager:
Fax: Pager:
Non-Responsive [redacted] Address: [illegible]

After Hours/Weekend CHARGE: Amount $ ____ Authorized by: ____

Additional fees apply for after hours and holidays for all analysis types. Samples will be analyzed during normal laboratory hours unless otherwise arranged and specified on the chain of custody. Turnaround is subject to laboratory volume. You will be notified if delays are expected.

ASBESTOS LABORATORY HOURS: Weekdays:
7am - 7pm

PCM/PLM ___ 2 Hour RUSH ___ 24 hour ___ 3-5 weekdays

TEM ___ 6 Hour RUSH ___ 24 hour ___ 3-5 weekdays

Prior Notice REQUIRED for TEM 6 Hour RUSH

METALS LABORATORY HOURS: Weekdays:
8am - 5pm

AA ___ SPECIAL RUSH ___ 24 Hour ___ 3-5 Day

RCRA 8 ___ SPECIAL RUSH ___ 5 Day ___ 10 Day

TCLP ___ SPECIAL RUSH ___ 5 Day ___ 10 Day

Prior Notice REQUIRED for SPECIAL RUSH AA, RCRA or TCLP
RCRA and TCLP SPECIAL RUSH is 3 Day Turnaround

ANALYTICAL METHOD

AIR
- [ ] PCM 7400A, 7400B, OSHA
- [ ] TEM AHERA, Level II, 7402, ISO
  Direct/Abs ISO-Indirect Prep. Chatfield
- [ ] AA / ICP ____ ____ Metal ____ RCRA 8
- [ ] Dust Total Respirable

BULK
- [ ] PLM Short report, Long report, Point Count
- [ ] TEM 1/1, Quant, Semi-quant
- [x] AA / ICP LEAD ____ Metal ____ RCRA 8
  Paint, Soil, Dust, Wipe, TCLP
  (ASTM E 1792 approved wipes only)

WATER
- [ ] TEM Drinking, Waste Water
- [ ] AA Water ____ ____ Metal ____ RCRA 8
  Drinking, Waste Water

OTHER
- [ ] Specify ____

Special Instructions: PLEASE EMAIL

	Client Sample Number	Volume	EM #
1.	SP BLANK 03		[illegible]
2.	ER BLANK 01		18
3.	ER W01		19
4.	ER W02		20
5.	ER W03		21
6.	ER W04		22
7.	ER W05		23
8.	ER BLANK 02		24
9.	ER W06		25
10.	ER W07		26
11.			
12.			
13.			
14.			
15.			

Number of samples received: ____ (Use as many additional sheets as needed.)

NOTE: If the package has sustained substantial damage or the custody seal is broken, stop and contact project manager and shipper. RESI will analyze incoming samples based upon information received with these samples. RESI is not responsible for errors or omissions in calculations resulting from the inaccuracy of original data. Turnaround times are based upon times of receipt by Laboratory. Call Laboratory for number of samples guaranteed in short turnaround.

Relinquished By: ____ Date/Time: ____

Laboratory Use Only

Received By: Rahl
Carrier: Fed Ex
Condition of package/custody seal upon receipt:
Date/Time: 8-19-03 @ 2:45 Pm

RESULTS:	Contact	Page	Phone	Fax	Email	Date	Time	Initials

SPLITS: Authorization By/Time: ____
Analytical Method/Turnaround: ____
Results Due: ____ Results Out: ____

Lab Bench/Count Sheets Received By: ____
Time: ____ Date: ____

rev 9/2/01

Phone: (303) 924-1990 Fax: (303) 477-4275 WATS: (800) RESI STV (737-4788)
PAGER: ONCALE Page number available at Lab. Accounts Payable: PLM/TEM 555-2157 PCM Voice mail 294-7478 (AFTER HOURS USE ONLY)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2842 of 5269

BEST AVAILABLE COPY

APPENDIX E

REFERENCES

BEST AVAILABLE COPY

APPENDIX E

REGULATIONS AND STANDARDS

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current ed. http://www.osha.gov/comp-links.html.

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf.

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990. http://www.usapa.army.mil/pdffiles/r40_5.pdf.

4. AR 385-10, The Army Safety Program, 29 February 2000. http://www.usapa.army.mil/pdffiles/r385_10.pdf.

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000. http://www.usapa.army.mil/pdffiles/p40_503.pdf.

6. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), American Conference of Governmental Industrial Hygienists (ACGIH), current ed.

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality.

8. RP-1-1993, Office Lighting, ANSI/ESNA.

BEST AVAILABLE COPY

APPENDIX F

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Chapter 14: Cleaning

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2846 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2847 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2848 of 5269

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2849 of 5269

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris *and* dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2850 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2851 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2852 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards *and* were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2853 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

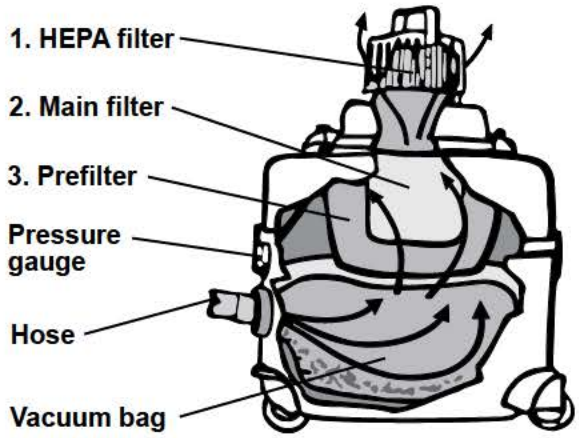

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and pre-filter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the pre-filter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

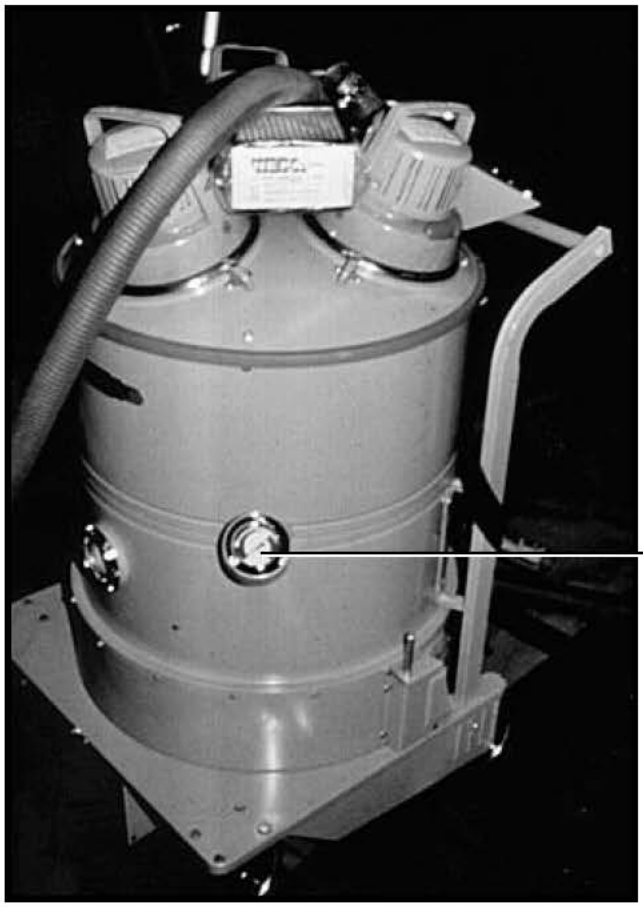

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2854 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

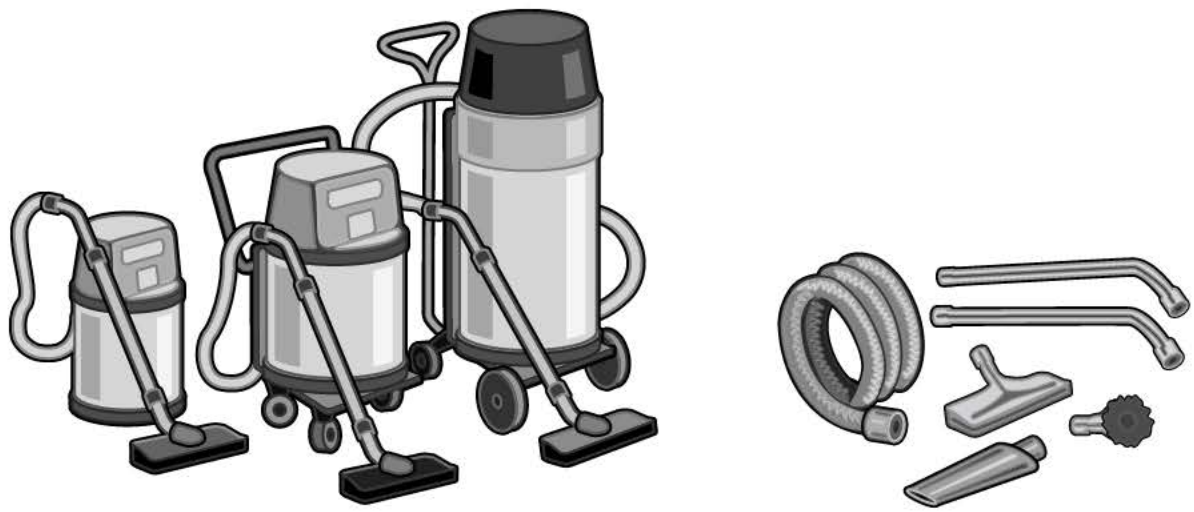

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2855 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

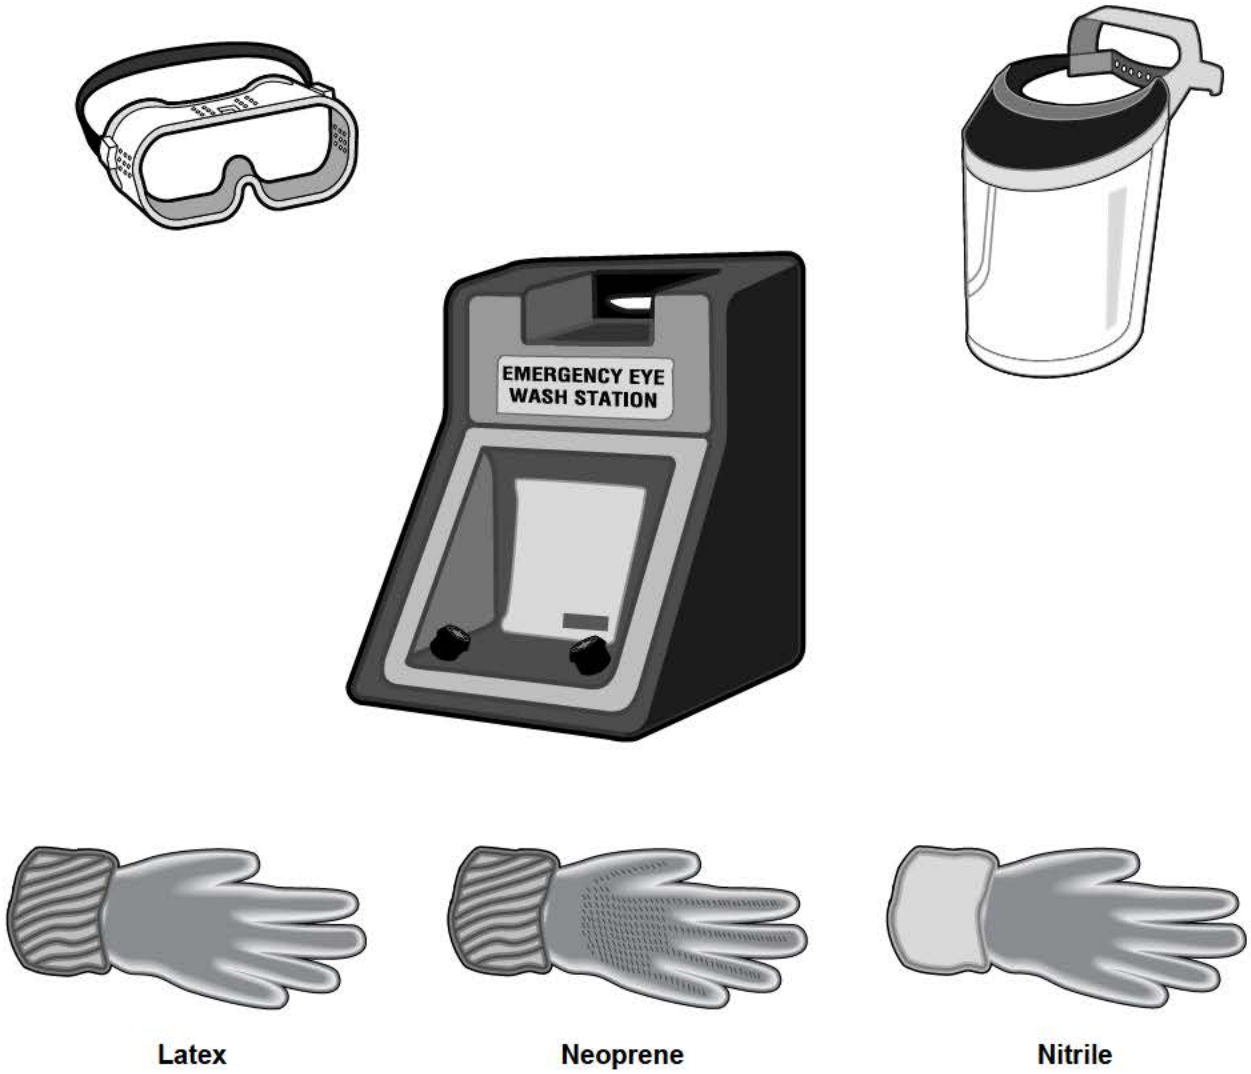

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2856 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

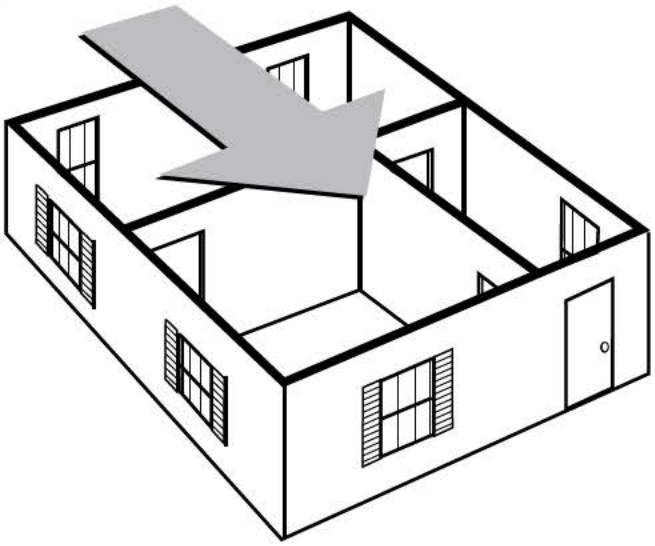

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

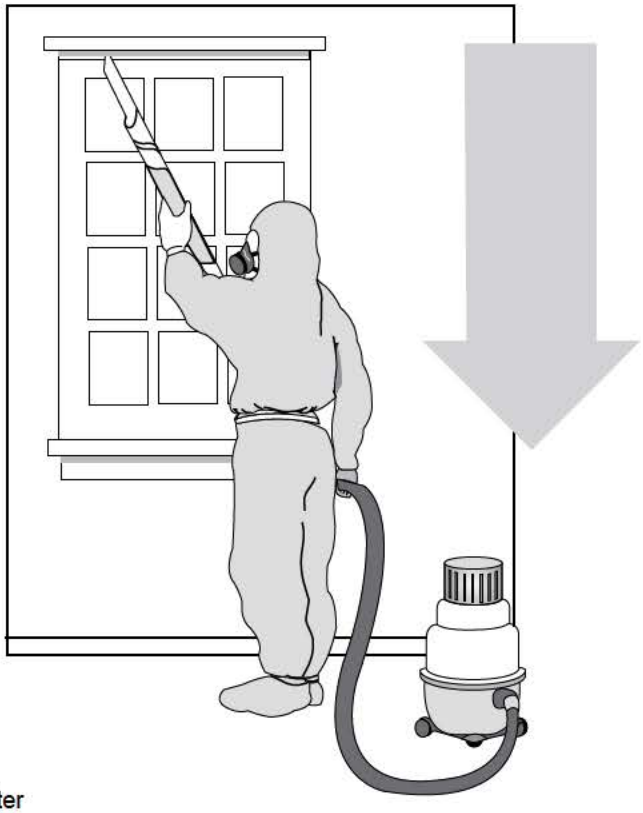

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2857 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2858 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

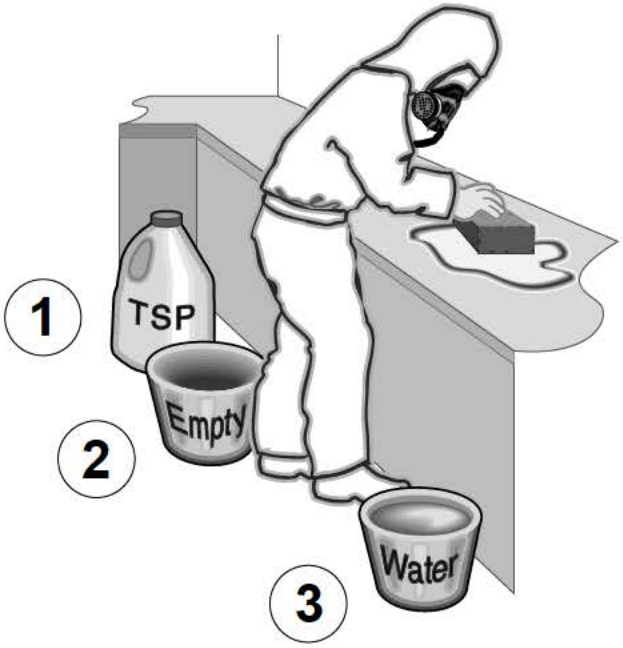

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2859 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

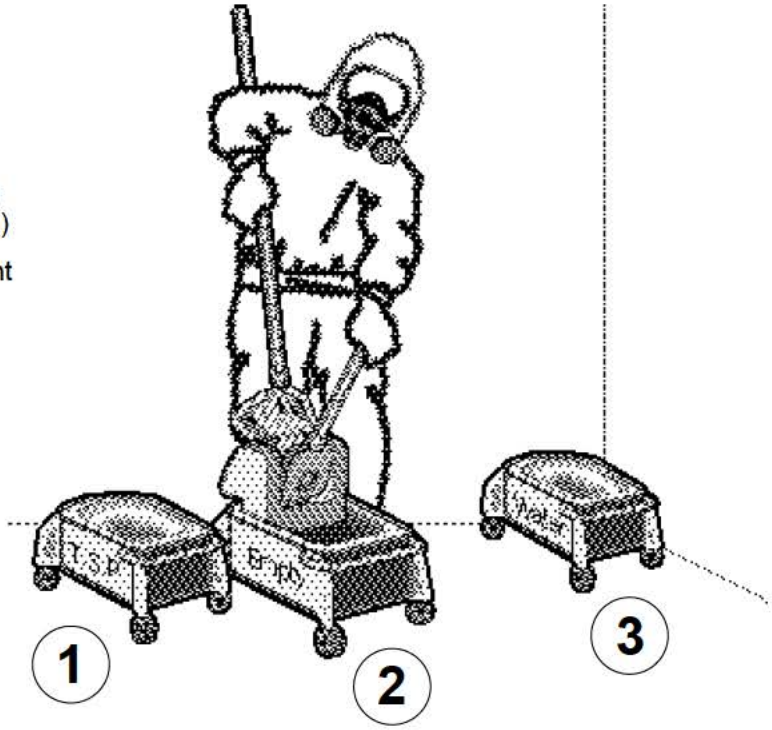

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

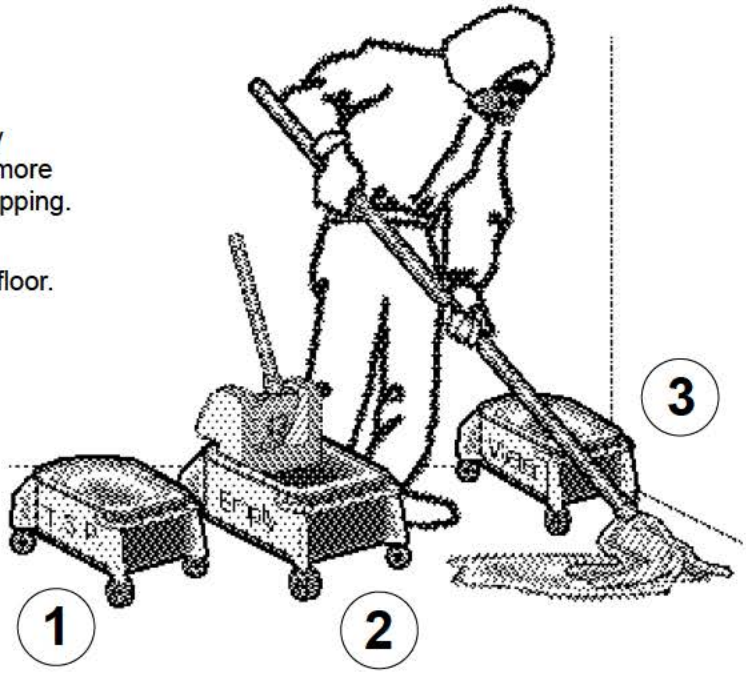

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2860 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

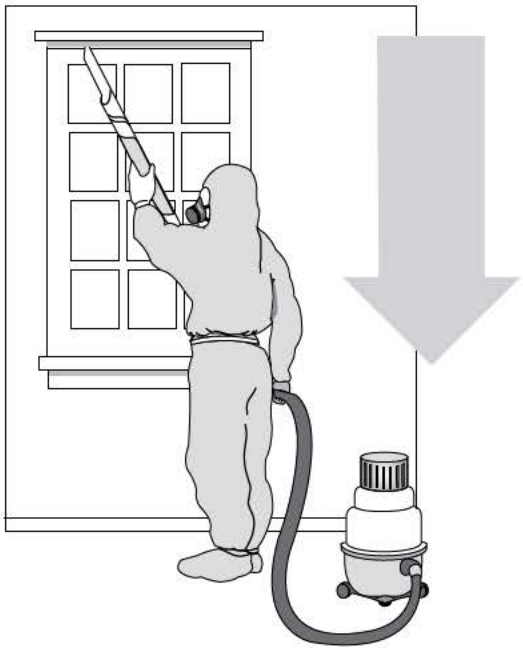

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2861 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2862 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2863 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water *and cleaned*. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2864 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2865 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2866 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2867 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation: Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2868 of 5269

BEST AVAILABLE COPY

APPENDIX G

MOLD GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Army Facilities Management Information Document on Mold Remediation Issues

TG 277

FEBRUARY 2002

USACHPPM

Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2870 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

TABLE OF CONTENTS

INTRODUCTION 2

MOLD PREVENTION TIPS 3

REMEDIATION PLANNING 3

REMEDIATE MOISTURE AND MOLD PROBLEMS 3

REMEDIATION PROCEDURES 4

FOUR REMEDIATION LEVELS 4

HAZARD COMMUNICATION 9

CONCLUSION 10

REFERENCES 10

APPENDIX A: WATER DAMAGE CLEANUP AND MOLD PREVENTION 11

APPENDIX B: MOLD REMEDIATION GUIDELINES 14

APPENDIX C: PERSONAL PROTECTIVE GUIDANCE 17

APPENDIX D: CONTAINMENT GUIDANCE 19

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2871 of 5269

BEST AVAILABLE COPY

ARMY FACILITIES MANAGEMENT INFORMATION DOCUMENT ON MOLD REMEDIATION ISSUES

Moisture Control: The Army Way to Mold Prevention!

INTRODUCTION

Concern about indoor exposure to mold has been increasing as the public becomes more aware that exposure to mold can cause a variety of health effects and symptoms, including allergic reactions.

This document provides the best and most current guidance for remediation of clean water damage (<48 hours) and mold contamination (>48 hours) into one resourceful Army guide. This guide has been designed to provide information to facilities management individuals who have little or no experience with mold remediation. It will assist them in making a reasonable judgment as to whether the situation can be handled in-house. It will help those in charge of maintenance to develop or evaluate an in-house remediation plan or evaluate a remediation plan submitted by an outside contractor. If an outside contractor is employed, they must have experience cleaning up mold. Check their references, and have them follow the recommendations presented in this document, EPA guidelines, and/or guidelines of the American Conference of Governmental Industrial Hygienists (ACGIH). A multi-disciplinary team approach to mold concerns is best. A health and safety professional, such as an industrial hygienist, should be consulted prior to any remediation activities to assist in the project.

Molds produce tiny spores to reproduce. Mold spores float through the indoor and outdoor air continually. When mold spores land on a damp spot, they may begin growing and digesting whatever they are growing on in order to survive. There are molds that can grow on wood, paper, carpet, and foods. When excessive moisture or water accumulates indoors, mold growth will often occur, particularly if the moisture problem remains undiscovered or uncorrected. There is no practical way to eliminate all molds and mold spores in the indoor environment; the way to control indoor mold growth is to control moisture.(1)

In all situations, the underlying cause of water accumulation must be rectified or mold growth will recur. Any initial water infiltration should be stopped and clean up began immediately. An immediate response (within 24 to 48 hours) and thorough clean up, drying, and/or removal of water damaged materials will prevent or limit mold growth. (Refer to Appendix A for detailed guidance on clean water damage response). If the source of water is elevated humidity, actions to maintain the relative humidity levels below 60% to inhibit mold growth should be taken (2). Emphasis should be on ensuring proper repairs of the building infrastructure, so that water damage and moisture buildup does not recur.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2872 of 5269

BEST AVAILABLE COPY

MOLD PREVENTION TIPS:

[Adapted from EPA, reference 1]

- Fix leaky plumbing and leaks in the building envelope as soon as possible.
- Watch for condensation and wet spots. Fix source(s) of moisture problem(s) as soon as possible.
- Prevent moisture due to condensation by increasing surface temperature or reducing the moisture level in air (humidity). To increase surface temperature, insulate or increase air circulation. To reduce the moisture level in air, repair leaks, increase ventilation (if outside air is cold and dry), or dehumidify (if outdoor air is warm and humid).
- Keep heating, ventilating, and air-conditioning (HVAC) drip pans clean, flowing properly, and unobstructed.
- Vent moisture-generating appliances, such as dryers, to the outside.
- Maintain low indoor humidity, below 60% relative humidity (RH), ideally 30-50%, if possible.
- Perform regular building/HVAC inspections and maintenance as scheduled.
- Clean and dry wet or damp spots within 48 hours.
- Don't let foundations stay wet. Provide adequate drainage and slope the ground away from the foundation.

REMEDIATION PLANNING

- Plan to dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Select cleanup methods for moldy items (Appendix B)
- Select Personal Protection Equipment (PPE)- protect remediators (Appendix B)
- Select containment equipment - protect building occupants (Appendix B)
- Select remediation personnel who have the experience and training needed to implement the remediation plan and use PPE and containment as appropriate

REMEDIATE MOISTURE AND MOLD PROBLEMS

- Fix moisture problem, implement repair plan and/or maintenance plan
- Dry wet, non-moldy materials within 48 hours to prevent mold growth (Appendix A)
- Clean and dry moldy materials (Appendix B)
- Discard moldy porous items that can't be cleaned (Appendix B)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2873 of 5269

BEST AVAILABLE COPY

REMEDIATION PROCEDURES

Four levels of abatement are described below. The size of the area impacted by mold contamination primarily determines the type of remediation. The sizing levels below are based on professional judgment and practicality; currently there is not adequate data to relate the extent of contamination to frequency or severity of health effects. The goal of remediation is to remove or clean contaminated materials in a way that prevents the emission of mold and preventing dust contaminated with mold from leaving a work area and entering an occupied or non-abatement area, while protecting the health of workers performing the abatement. The listed remediation methods were designed to achieve this goal, however, due to the general nature of these methods it is the responsibility of the people conducting remediation to ensure the methods enacted are adequate. (3)

Non-porous (e.g., metals, glass, and hard plastics) and semi-porous (e.g., wood, and concrete) materials that are structurally sound and are visibly moldy can be cleaned and reused. Cleaning should be done using a detergent solution. Porous materials such as ceiling tiles and insulation, and wallboards with more than a small area of contamination should be removed and discarded. Porous materials (e.g., wallboard, and fabrics) that can be cleaned, can be reused, but should be discarded if possible. All materials to be reused should be dry and visibly free from mold. Routine inspections should be conducted to confirm the effectiveness of remediation work. (1 and 3)

The use of bleach or other biocides is questionable in most cases (8). The effectiveness of bleach in reducing living mold is dependent on concentration, residual chlorine levels, and contact time on the surface (8). All of these factors are difficult to control during remediation. Removal of all mold growth can generally be accomplished by physical removal of materials supporting active growth and thorough cleaning of non-porous materials (4). Therefore, application of a biocide serves no purpose that could not be accomplished with a detergent or cleaning agent (4).

The use of gaseous ozone or chlorine dioxide for remedial purposes is **not** recommended. Both compounds are highly toxic and contamination of occupied space may pose a health threat. Furthermore, the effectiveness of these treatments is unproven. For additional information on the use of biocides for remedial purposes, refer to the American Conference of Governmental Industrial Hygienists' document, "Bioaerosols: Assessment and Control."(4)

FOUR REMEDIATION LEVELS

[Adapted from NYCDOH Guidelines on Assessment and Remediation of Fungi in Indoor Environments (3) and EPA (1)]

> **Level I: Small Isolated Areas – Total surface area affected less than 10 square feet** - e.g., ceiling tiles, small areas on walls. Refer to Appendix B for detailed guidance.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2874 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas used by remediation workers for egress should be cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Level II: Medium – Total Surface Area affected between 10 and 100 square feet - e.g., several wallboard panels. (See Appendix B for detailed guidance).

The following procedures *at a minimum* are recommended:

Refer to Appendix C for proper PPE selection. Limited or Full protection may be required depending on the situation.

Refer to Appendix D for Containment procedures.

The work area and areas directly adjacent should be covered with a single layer of 6 mil fire-retardant polyethylene sheet(s) and taped before remediation, to contain dust/debris.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2875 of 5269

BEST AVAILABLE COPY

Seal ventilation ducts/grills in the work area and areas directly adjacent with 6 mil polyethylene sheeting. Use an exhaust fan with a High Efficiency Particulate Air (HEPA) filter to generate negative pressurization.

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and surrounding areas should be HEPA vacuumed (a vacuum equipped with a High-Efficiency Particulate Air filter) and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

If abatement procedures are expected to generate a lot of dust (e.g., abrasive cleaning of contaminated surfaces, demolition of plaster walls) or the visible concentration of the mold is heavy (blanket coverage as opposed to patchy), then it is recommended that the remediation procedures for Level III be followed.

Level III: Large Area – Total Surface Area affected greater than 100 square feet or potential for increased occupant or remediator exposure during remediation is estimated to be significant. (See Appendix B for detailed guidance).

The following procedures are recommended:

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from occupied spaces using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2876 of 5269

BEST AVAILABLE COPY

The work area and areas directly adjacent should be unoccupied. Further vacating of people from spaces near the work area is recommended in the presence of infants (less than 12 months old), persons having undergone recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste. The outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed in the decontamination chamber prior to their transport to uncontaminated areas of the building.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop with a detergent solution and be visibly clean prior to the removal of isolation barriers.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air(4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If any remediation sampling is deemed necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program.

Level IV: Remediation of HVAC Systems (See Appendix B for detailed guidance. For a small area (<10 ft^2) follow Level I guidance for PPE and containment and for a areas (>10 ft^2) follow Medium (Level II) or when greater than 100 ft^2 follow Large (Level III) guidance for PPE and containment as discussed in Appendices B, C, and D)

A Small Isolated Area of Contamination (total surface area affected <10 square feet) in the HVAC System

The HVAC system should be shut down prior to any remedial activities.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2877 of 5269

BEST AVAILABLE COPY

Regular building maintenance staff can conduct this level of remediation. Such persons should receive training on proper clean up methods, personal protection, and potential health hazards. This training can be performed as part of a program to comply with the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200).

See Appendix C for PPE guidance. Respiratory protection (e.g., N95 disposable respirator), used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended (7). Gloves and goggles should be worn. All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional.

The work area should be unoccupied. Vacating people from spaces adjacent to the work area is not necessary but is recommended in the presence of infants (less than 12 months old), persons recovering from recent surgery, immune suppressed people, or people with chronic inflammatory lung diseases (e.g., asthma, hypersensitivity pneumonitis, and severe allergies).

Containment of the work area is not necessary. Dust suppression methods, such as misting (not soaking) surfaces prior to remediation, are recommended.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and double-bagged in 6-mil plastic bags and removed. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The work area and areas immediately surrounding the work area should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution.

All areas should be left dry and visibly free from contamination and debris.

Areas of Contamination (Total surface area affected >10 square feet) in the HVAC System

The following procedures are recommended:

The HVAC system should be shut down prior to any remedial activities.

Refer to Appendices C & D for PPE and Containment guidance.

Completely isolate the work area from other areas. Isolate the HVAC system using double layers of polyethylene plastic sheeting sealed with duct tape (including ventilation ducts/grills, fixtures, and any other openings).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2878 of 5269

BEST AVAILABLE COPY

Utilize an exhaust fan with a HEPA filter to generate negative pressurization. Provide airlocks and a decontamination room.

Growth supporting materials that are contaminated, such as the insulation of interior lined ducts and filters, should be removed. Other contaminated materials that cannot be cleaned should be sealed and removed in double-bagged 6-mil plastic. When a decontamination room is present, the outside of the bags should be cleaned with a damp cloth and a detergent solution or HEPA vacuumed prior to their transport to uncontaminated areas of the building. Since there are no special disposal requirements for moldy materials, they can be discarded as ordinary construction waste.

The contained area and decontamination room should be HEPA vacuumed and cleaned with a damp cloth and/or mop and a detergent solution prior to the removal of isolation barriers.

All areas should be left dry and visibly free from contamination and debris.

Pre- and post-remediation sampling may also be useful in determining whether remediation efforts have been effective. After remediation, the types and concentrations of mold in the indoor air samples should be similar to what is found in the local outdoor air (4). Since no Federal limits have been set for mold or mold spores, sampling cannot be used to check a building's compliance with Federal mold standards.

If remediation sampling is necessary contact your local industrial hygiene office or contact safety and health professionals with specific experience in designing mold sampling protocols, sampling methods, and interpretation of results. Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH).

HAZARD COMMUNICATION

When mold growth requiring Level III or IV (large-scale) remediation is found, the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners (1 and 3).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2879 of 5269

BEST AVAILABLE COPY

CONCLUSION

In summary, the prompt remediation of contaminated material and infrastructure repair must be the primary response to mold contamination in buildings. The simplest and most expedient remediation that properly and safely removes mold growth from buildings should be used. Widespread contamination poses much larger problems that must be addressed on a case-by-case basis in consultation with a health and safety specialist. Effective communication with building occupants is an essential component of all remedial efforts. Individuals with persistent health problems should go to the local occupational health clinic or see their physicians for a referral to practitioners who are trained in occupational/environmental medicine or related specialties and are knowledgeable about these types of exposures.

REFERENCES

1. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

2. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. Ventilation for Acceptable Indoor Air Quality - ASHRAE Standard (ANSI/ASHRAE 62-2001). Atlanta, Georgia, 2001.

3. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2880 of 5269

BEST AVAILABLE COPY

APPENDIX A

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

Water Damage Cleanup and Mold Prevention

Appendix A presents strategies to respond to water damage within 24-48 hours. These guidelines are designed to help avoid the need for remediation of mold growth by taking quick action before growth starts. If mold growth is found on the materials listed in Appendix A, refer to Appendix B for guidance on remediation. Depending on the size of the area involved and resources available, professional assistance may be needed to dry an area quickly and thoroughly.

Water Damage - Cleanup and Mold Prevention	
Guidelines for Response to Clean Water Damage within 24-48 Hours to Prevent Mold Growth£	
Water-Damaged Material†	**Actions**
Books and papers	• For non-valuable items, discard books and papers. • Photocopy valuable/important items, discard originals. • Freeze (in frost-free freezer or meat locker) or freeze-dry.
Carpet and backing - dry within 24-48 hours§	• Remove water with water extraction vacuum. • Reduce ambient humidity levels with dehumidifier. • Accelerate drying process with fans.
Ceiling tiles	• Discard and replace.
Cellulose insulation	• Discard and replace.
Concrete or cinder block surfaces	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters.
Fiberglass insulation	• Discard and replace.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2881 of 5269

BEST AVAILABLE COPY

Hard surface, porous flooring§ (Linoleum, ceramic tile, vinyl)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary. • Check to make sure under flooring is dry; dry under flooring if necessary.
Non-porous, hard surfaces (Plastics, metals)	• Vacuum or damp wipe with water and mild detergent and allow to dry; scrub if necessary.
Upholstered furniture	• Remove water with water extraction vacuum. • Accelerate drying process with dehumidifiers, fans, and/or heaters. • May be difficult to completely dry within 48 hours. If the piece is valuable, you may wish to consult a restoration/water damage professional who specializes in furniture.
Wallboard (Drywall and gypsum board)	• May be dried in place if there is no obvious swelling and the seams are intact. If not, remove, discard, and replace. • Ventilate the wall cavity, if possible.
Window drapes	• Follow laundering or cleaning instructions recommended by the manufacturer.
Wood surfaces	• Remove moisture immediately and use dehumidifiers, gentle heat, and fans for drying. (Use caution when applying heat to hardwood floors.) • Treated or finished wood surfaces may be cleaned with mild detergent and clean water and allowed to dry. • Wet paneling should be pried away from wall for drying

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2882 of 5269

BEST AVAILABLE COPY

£ If mold growth has occurred or materials have been wet for more than 48 hours, consult Appendix B. Even if materials are dried within 48 hours, mold growth may have occurred. Professionals may test items if there is doubt. Note that mold growth will not always occur after 48 hours; this is only a guideline.
These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then OSHA may have requirements for Personal Protective Equipment and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise remediating in contaminated water situations. Do not use fans before determining that the water is clean or sanitary.

† If a particular item(s) has high monetary or sentimental value, you may wish to consult a restoration/water damage specialist.

§ The subfloor under the carpet or other flooring material must also be cleaned and dried. See the appropriate section of this table for recommended actions depending on the composition of the subfloor.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2883 of 5269

BEST AVAILABLE COPY

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2884 of 5269

BEST AVAILABLE COPY

MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. Consult Appendix A if materials have been wet for less than 48 hours, and mold growth is not apparent. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2885 of 5269

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2886 of 5269

BEST AVAILABLE COPY

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2887 of 5269

BEST AVAILABLE COPY

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2888 of 5269

BEST AVAILABLE COPY

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips
• Always maintain the containment area under negative pressure. • Exhaust fans to outdoors and ensure that adequate makeup air is provided. • If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2889 of 5269

BEST AVAILABLE COPY

the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2890 of 5269

BEST AVAILABLE COPY

TG 277

February 2002

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2891 of 5269

BEST AVAILABLE COPY

Industrial Hygiene/ Preventive Medicine Mold Assessment Guide

TG 278
February 2002

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2892 of 5269

Table of Contents

Introduction 2

Safety Tips While Investigating And Evaluating Mold And Moisture Problems 2

Communicate With Building Occupants At All Stages Of Process, As Appropriate 3

Routine Investigation And Evaluation Of Moisture And Mold Problems 3

Assessments Requiring Sampling 3

References 4

APPENDIX A: Mold Investigation Decision Logic 5

APPENDIX B: Mold Remediation Guidelines 8

APPENDIX C: Personal Protective Equipment 11

APPENDIX D: Containment Guidance 13

Use of company or trademarked names does not imply endorsement by the U.S. Army but is intended only to assist in identification of a specific product.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2893 of 5269

Industrial Hygiene/Preventive Medicine Mold Assessment Guide

Introduction

The USACHPPM Industrial Hygiene Field Services Program receives requests from industrial hygiene (IH)/preventive medicine (PM) field personnel for information about mold investigations and clean-up procedures. Like all organisms, molds have an absolute requirement for water. The types of mold and their abundance in an area depend on the availability of nutrients (i.e., dirt), water and temperature. Chronic water intrusion, lack of adequate ventilation and moisture control, and or isolated floods, such as a water pipe bursting, are typical conditions, which lead to mold growth in buildings.

When mold growth is present, the removal and cleaning of contaminated materials must be handled with proper precautions, because disturbing this growth can result in bioaerosol release, i.e., sending millions of spores into the air.

This mold assessment guide used in conjunction with the *ARMY Facilities Management Information Document on Mold Remediation Issues (TG 277)*[1] will assist Industrial Hygienists and or Preventive Medicine personnel in conducting mold investigations. Since a team approach is recommended, the collaboration between IH/PM personnel and facility management personnel is vital to correct moldy conditions and prevent future mold growth. Use the following procedures and refer to Appendix A: Mold Investigation Decision Logic, for guidance on mold investigation, evaluation, and remediation for routine assessments.

Air sampling for mold should never be part of a routine assessment. Remediation strategies can generally be made on the basis of a visual inspection or confirmation with a bulk or surface sample. In addition, air sampling methods for some mold are prone to false negative results and therefore cannot be used to definitively rule out contamination[2].

Safety Tips While Investigating and Evaluating Mold and Moisture Problems[3]

- Be careful not to touch mold or moldy items with bare hands.
- Do not allow mold or mold spores to get into your eyes.
- Do not breathe in mold or mold spores.
- Consult **Appendices B, C, and D** for Remediation, Personal Protective Equipment (PPE) to be used during remediation and Containment guidance.
- Consider using PPE when disturbing mold during investigation. Depending upon the situation, a half-face NIOSH-approved N-95 respirator, gloves, and goggles are recommended.

Communicate with building occupants at all stages of process, as appropriate[1].

When mold growth requiring Level III or IV (large-scale) remediation is found (See Appendix B), the building owner, management, and/or employer should notify occupants in the affected area(s) of its presence. Notification should include a description of the remedial measures to be taken and a timetable for completion. Well-planned group meetings held before and after remediation with full disclosure of plans and results can be an effective communication mechanism. Individuals seeking medical attention should be provided with a copy of all inspection results and interpretation to give to their medical practitioners.

Routine Investigation and Evaluation of moisture and mold problems[3].

- Determine the total surface area of visible mold affected (square feet).
- Consider the possibility of hidden mold.
- Clean up small mold problems and fix moisture problems before they become large problems.
- Select remediation personnel or team based on the assessment.
- Investigate areas associated with occupant complaints.
- Identify source(s) or cause of water or moisture problem(s).
- Note type of water-damaged materials (wallboard, carpet, etc.).
- Check inside air ducts and air handling unit.

Assessments Requiring Sampling

Air sampling may be necessary if an individual(s) has been diagnosed with a disease that is or may be associated with mold exposure (e.g., aspergillosis) and the occupational health physician/medical practitioner desires to confirm the causative agent.

Pre- and post-remediation air sampling may be necessary if there is evidence from a visual inspection or bulk sampling that the ventilation systems are contaminated. The purpose of such sampling is to assess the extent of contamination throughout a building and to confirm adequate remediation.

Air sampling may be necessary if the presence of mold is suspected (e.g., musty odors) but cannot be identified by a visual inspection or bulk sampling (e.g., mold growth behind walls). The purpose of this sampling is to determine the location and degree of contamination[2].

When air sampling is deemed necessary and is performed, outdoor air samples should be collected at the same time at the fresh air intake, which serves the suspected area. Values obtained should be compared and the indoor and outdoor air samples should be similar in kinds and concentrations of mold to what is found locally in the outdoor air[4]. If they are different, bioamplification is occurring and the problem needs corrected.

Personnel conducting the sampling should be trained in proper air sampling methods for microbial contaminants. For additional information on air sampling, refer to the American Conference of Governmental Industrial Hygienists', "Bioaerosols: Assessment and Control[4]."

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2895 of 5269

Sample analysis should follow analytical methods recommended by the American Industrial Hygiene Association (AIHA) or the American Conference of Governmental Industrial Hygienists (ACGIH). The laboratory conducting the analyses should participate in the AIHA Environmental Microbiology Proficiency Analytical Testing (EMPAT) program. For further mold assistance, contact USACHPPM, Industrial Hygiene Field Services Program, DSN 584-3118 or (410) 436-3118.

References

1. USACHPPM Technical Guide 277, *Army Facilities Management Information Document on Mold Remediation Issues,* February 2002.

2. New York City Department of Health: Guidelines on Assessment and Remediation of Fungi in Indoor Environments. New York: New York City Department of Health, Bureau of Environmental & Occupational Disease Epidemiology, (April 2000) January 2002.

3. U.S. Environmental Protection Agency. *Mold Remediation in Schools and Commercial Buildings*, EPA 402-K-01-001, March 2001.

4. American Conference of Governmental Industrial Hygienists (ACGIH): *Bioaerosols: Assessment and Control*, edited by Janet Macher. Cincinnati, OH: ACGIH, 1999.

5. U.S. Environmental Protection Agency. *Should You Have the Air Ducts In Your Home Cleaned?* EPA-402-K-97-002. October 1997.

6. Institute of Inspection, Cleaning and Restoration Certification (IICRC). *IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration*, 2nd edition. 1999.

7. Occupational Safety & Health Administration. *Respiratory Protection Standard, 29 Code of Federal Regulations 1910.134.* 63 FR 1152. January 8, 1998.

8. American Industrial Hygiene Association, *Report of Microbial Growth Task Force*, AIHA Press, Fairfax, VA, May 2001.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2896 of 5269

APPENDIX A

MOLD INVESTIGATION DECISION LOGIC

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2897 of 5269

MOLD INVESTIGATION DECISION LOGIC

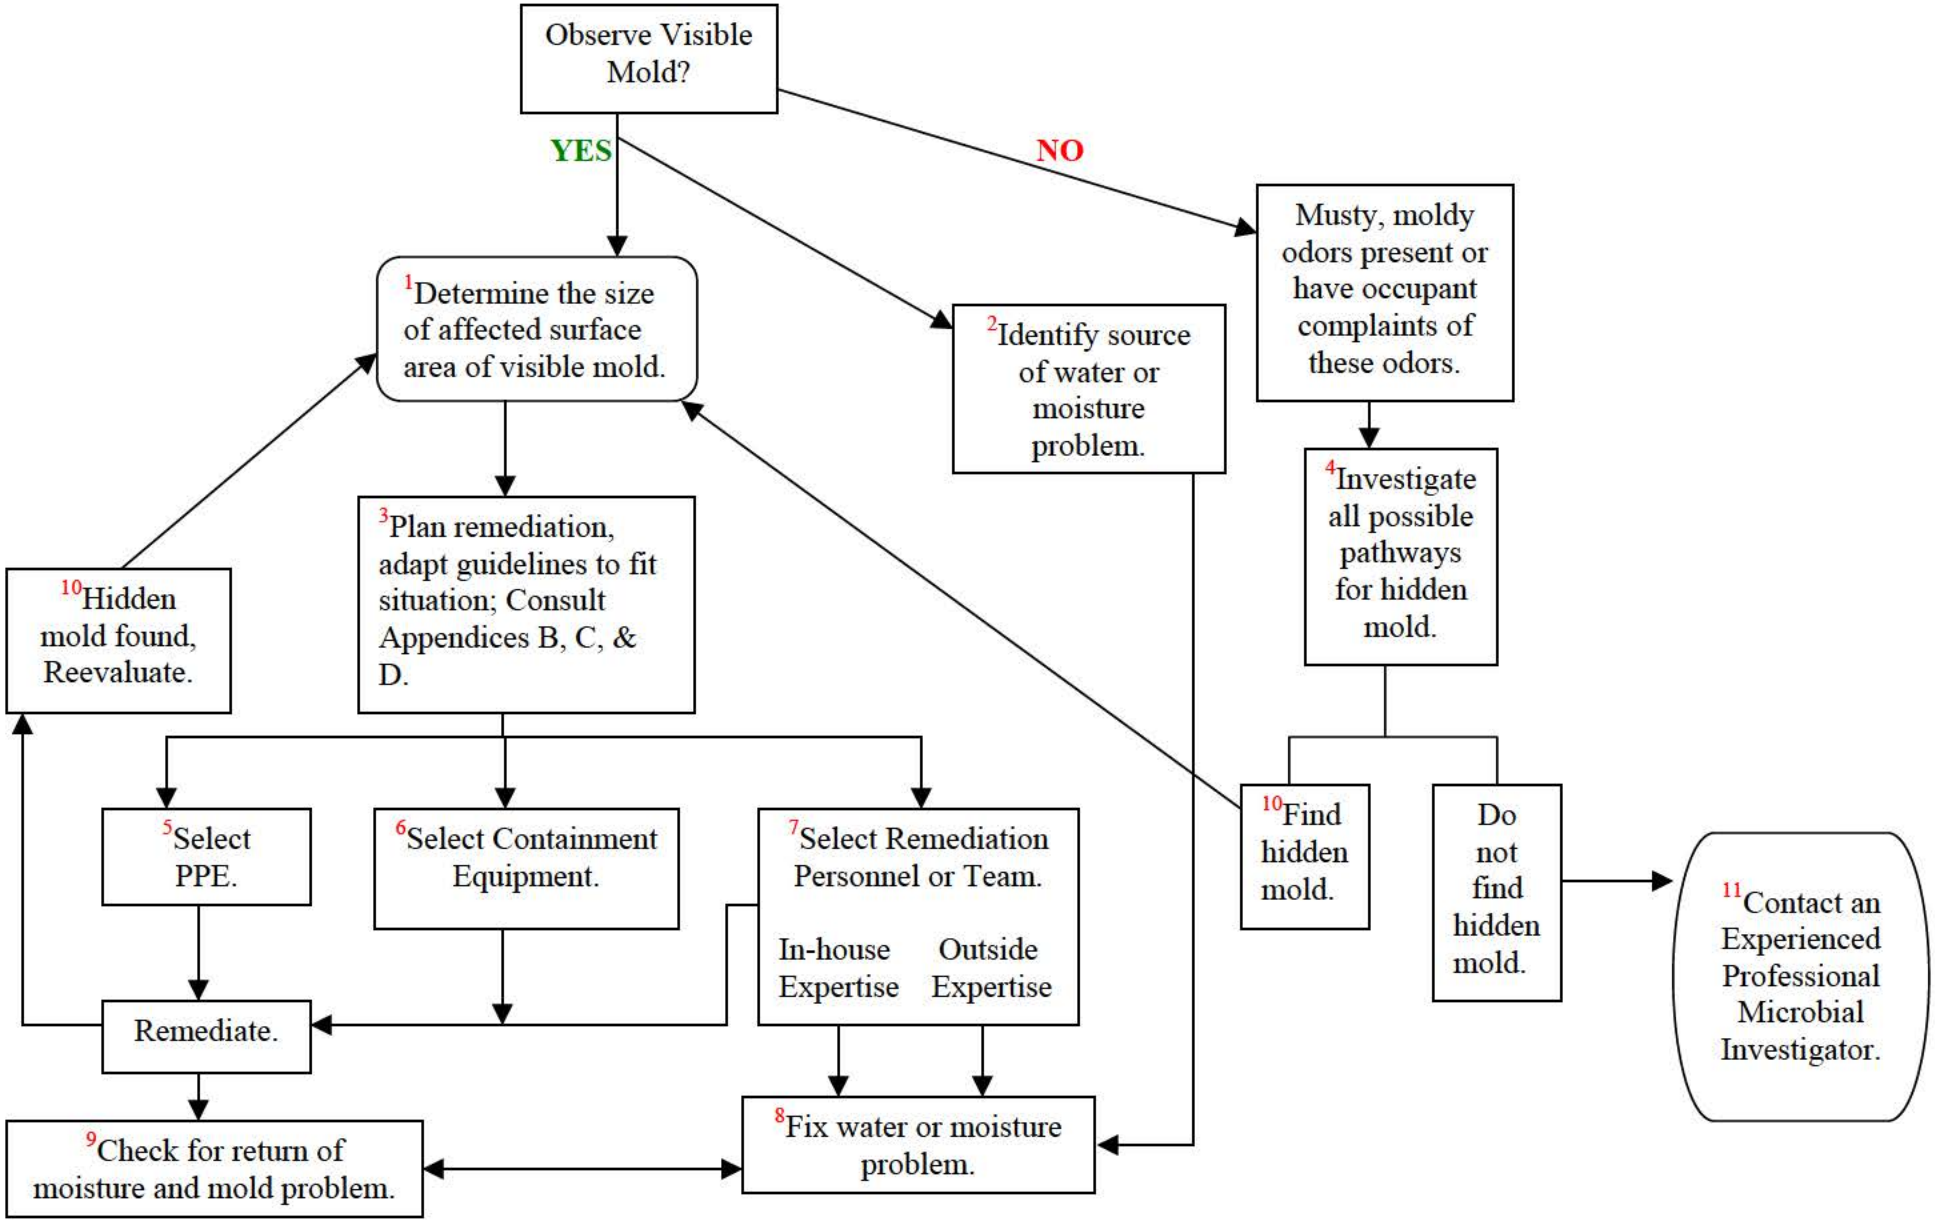

MOLD INVESTIGATION DECISION LOGIC NOTES:

1. Roughly approximate the total surface area of visible mold. Categorization of the remediation levels are sometimes borderline, so when trying to decide the category to apply, consider the extent of visible growth, such as a heavy blanket of growth on the surface, to barely visible. If heavy growth is apparent, consider moving up to the next level of protection.

2. Do not skip this step. Address the source of water or moisture problem or the mold will simply reappear.

3. Always protect the health and safety of the building occupants and remediators.

4. Mold may be hiding on the backside of drywall, vinyl wallpaper, or paneling, the top of ceiling tiles, the underside of carpets and pads. Check walls behind furniture, pipe chases and utility tunnels, porous thermal or acoustic liners inside ductwork, or check the rafters (due to roof leaks or insufficient insulation)[3].

5. Utilize appendices B and C for remediation guidance. Use your best judgment during investigations, if not disturbing the mold you may need minimal to no PPE. Do not alarm building occupants unnecessarily, but protect yourself as necessary.

6. If the containment is working properly, the polyethylene sheeting will billow inwards on all surfaces. If it flutters or billows outward, containment has not been achieved, and you should find and correct the problem before starting your remediation activities[3]. Confirm negative pressure with smoke tubes.

7. Select remediation personnel who have the experience and training needed to implement the remediation plan.

8. You must completely fix or eliminate the water or moisture problem to solve the problem.

9. You should revisit the site(s) approximately two weeks after remediation, and it should show no signs of water damage or mold growth.

10. If you discover hidden mold, revise your plan by reassessing the size of moldy area.

11. If you believe that you have a hidden mold problem, you may want to consider hiring an experienced mold investigative professional.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2899 of 5269

APPENDIX B

[Adapted from EPA 402-K-01-001, March 2001]

Mold Remediation Guidelines

Appendix B presents remediation guidelines for building materials that have or are likely to have mold growth. The guidelines in Appendix B are designed to protect the health of occupants and cleanup personnel during remediation. These guidelines are based on the area and type of material affected by water damage and/or mold growth. Please note that these are guidelines; some professionals may prefer other cleaning methods.

If you are considering cleaning your ducts as part of your remediation plan, you should consult EPA's publication entitled, Should You Have the Air Ducts In Your Home Cleaned? (5) Although this EPA document has a residential focus, the same concept applies to other building types. If possible, remediation activities should be scheduled during off-hours when building occupants are less likely to be affected.

Although the level of personal protection suggested in these guidelines is based on the total surface area contaminated and the potential for remediator and/or occupant exposure, professional judgment should always play a part in remediation decisions. These remediation guidelines are based on the size of the affected area to make it easier for remediators to select appropriate techniques, not on the basis of health effects or research showing there is a specific method appropriate at a certain number of square feet. The guidelines have been designed to help construct a remediation plan. The remediation manager will then use professional judgment and experience to adapt the guidelines to particular situations. When in doubt, caution is advised. Consult an experienced mold remediator for more information.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2900 of 5269

Guidelines for Remediating Building Materials with Mold Growth Caused by Clean Water*			
Material or Furnishing Affected	Cleanup Methods†	Personal Protective Equipment	Containment
SMALL - Total Surface Area Affected Less Than 10 square feet (ft^2)			
Books and papers	3	Minimum N-95 respirator, gloves, and goggles	None required
Carpet and backing	1, 3		
Concrete or cinder block	1, 3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1, 2, 3		
Non-porous, hard surfaces (plastics, metals)	1, 2, 3		
Upholstered furniture & drapes	1, 3		
Wallboard (drywall and gypsum board)	3		
Wood surfaces	1, 2, 3		
MEDIUM - Total Surface Area Affected Between 10 and 100 ft^2			
Books and papers	3	Limited or Full Use professional judgment, consider potential for remediator exposure and size of contaminated area	Limited Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,3,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3		
LARGE - Total Surface Area Affected Greater Than 100 ft^2 or Potential for Increased Occupant or Remediator Exposure During Remediation Estimated to be Significant			
Books and papers	3	Full Use professional judgment, consider potential for remediator/occupant exposure and size of contaminated area	Full Use professional judgment, consider potential for remediator exposure and size of contaminated area
Carpet and backing	1,3,4		
Concrete or cinder block	1,3		
Hard surface, porous flooring (linoleum, ceramic tile, vinyl)	1,2,3,4		
Non-porous, hard surfaces (plastics, metals)	1,2,3		
Upholstered furniture & drapes	1,2,4		
Wallboard (drywall and gypsum board)	3,4		
Wood surfaces	1,2,3,4		

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2901 of 5269

*Use professional judgment to determine prudent levels of Personal Protective Equipment and containment for each situation, particularly as the remediation site size increases and the potential for exposure and health effects rises. Assess the need for increased Personal Protective Equipment, if, during the remediation, more extensive contamination is encountered than was expected. These guidelines are for damage caused by clean water. If you know or suspect that the water source is contaminated with sewage, or chemical or biological pollutants, then the Occupational Safety and Health Administration (OSHA) requires PPE and containment. An experienced professional should be consulted if you and/or your remediators do not have expertise in remediating contaminated water situations.

†Select method most appropriate to situation. Since molds gradually destroy the things they grow on, if mold growth is not addressed promptly, some items may be damaged such that cleaning will not restore their original appearance. If mold growth is heavy and items are valuable or important, you may wish to consult a restoration/water damage/remediation expert. Please note that these are guidelines; other cleaning methods may be preferred by some professionals.

Cleanup Methods

- Method 1: Wet vacuum (in the case of porous materials, some mold spores/fragments will remain in the material but will not grow if the material is completely dried). Steam cleaning may be an alternative for carpets and some upholstered furniture.
- Method 2: Damp-wipe surfaces with plain water or with water and detergent solution (except wood —use wood floor cleaner); scrub as needed.
- Method 3: High-efficiency particulate air (HEPA) vacuum after the material has been thoroughly dried. Dispose of the contents of the HEPA vacuum in well-sealed plastic bags.
- Method 4: Discard - Remove water-damaged materials and seal in plastic bags while inside of containment, if present. Dispose of as normal waste. HEPA vacuum area after it is dried.

Personal Protective Equipment (PPE)

- Minimum: Gloves, N-95 respirator, goggles/eye protection
- Limited: Gloves, N-95 respirator or half-face respirator with HEPA filter, disposable overalls, goggles/eye protection
- Full: Gloves, disposable full body clothing, head gear, foot coverings, full-face respirator with HEPA filter

Containment

- Limited: Use polyethylene-sheeting ceiling to floor around affected area with a slit entry and covering flap; maintain area under negative pressure with HEPA filtered fan unit. Block supply and return air vents within containment area.
- Full: Use two layers of fire-retardant polyethylene sheeting with one airlock chamber. Maintain area under negative pressure with HEPA filtered fan exhausted outside of building. Block supply and return air vents within containment area.

Table developed from literature and remediation documents including Bioaerosols: Assessment and Control (American Conference of Governmental Industrial Hygienists, 1999) (4) and IICRC S500, Standard and Reference Guide for Professional Water Damage Restoration, (Institute of Inspection, Cleaning and Restoration, 1999) (6)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2902 of 5269

APPENDIX C

[Adapted Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

PERSONAL PROTECTIVE EQUIPMENT

Skin and Eye Protection

Gloves are required to protect the skin from contact with mold allergens (and in some cases mold toxins) and from potentially irritating cleaning solutions. Long gloves that extend to the middle of the forearm are recommended. The glove material should be selected based on the type of materials being handled. If you are using a strong cleaning solution, you should select gloves made from natural rubber, neoprene, nitrile, polyurethane, or polyvinyl chloride (PVC). If you are using a mild detergent or plain water, ordinary household rubber gloves may be used. To protect your eyes, use properly fitted goggles or a full-face respirator with HEPA filter. Goggles must be designed to prevent the entry of dust and small particles. Safety glasses or goggles with open vent holes are not acceptable.

Respiratory Protection

Respirators protect cleanup workers from inhaling airborne mold, mold spores, and dust. Respiratory protection used in accordance with the OSHA respiratory protection standard (29 CFR 1910.134), is recommended(7). All individuals must be trained, have medical clearance, and must be fit-tested by a trained professional before wearing a respirator.

- Minimum: When cleaning up a small area affected by mold, you should use an N-95 respirator. This device covers the nose and mouth, will filter out 95% of the particulates that pass through the filter. In situations where a full-face respirator is in use, additional eye protection is not required.
- Limited: Limited PPE includes use of a half-face or full-face air-purifying respirator (APR) equipped with a HEPA filter cartridge. These respirators filter mold particles in the air. Note that half-face APRs do not provide eye protection. In addition, the HEPA filters do not remove vapors or gases. You should always use respirators approved by the National Institute for Occupational Safety and Health.
- Full: In situations in which high levels of airborne dust or mold spores are likely or when intense or long-term exposures are expected (e.g., the cleanup of large areas of contamination), a full-face, powered air-purifying respirator (PAPR) is recommended. Full-face PAPRs use a blower to force air through a HEPA filter. The HEPA-filtered air is supplied to a mask that covers the entire face or a hood that covers the entire head. The positive pressure within the mask or hood prevents unfiltered air from entering through penetrations or gaps. Individuals must be trained to use their respirators before they begin remediation.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2903 of 5269

Disposable Protective Clothing

Disposable clothing is recommended during a medium or large remediation project to prevent the transfer and spread of mold to clothing and to eliminate skin contact with mold.

- Limited: Disposable paper overalls can be used.
- Full: Mold-impervious disposable head and foot coverings, and a body suit made of a breathable material, such as TYVEK®, should be used. All gaps, such as those around ankles and wrists, should be sealed (many remediators use duct tape to seal clothing).

®TYVEK, DuPont de Nemours, E.I., & Co., Wilmington, DE.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2904 of 5269

APPENDIX D

[Source: EPA 402-K-01-001: Mold Remediation in Schools and Commercial Buildings, March 2001]

CONTAINMENT GUIDANCE

Containment

The purpose of containment during remediation activities is to limit release of mold into the air and surroundings, in order to minimize the exposure of remediators and building occupants to mold. Mold and moldy debris should not be allowed to spread to areas in the building beyond the contaminated site.

The two types of containment recommended in Appendix B are limited and full. The larger the area of moldy material, the greater the possibility of human exposure and the greater the need for containment. In general, the size of the area helps determine the level of containment. However, a heavy growth of mold in a relatively small area could release more spores than a lighter growth of mold in a relatively large area. Choice of containment should be based on professional judgment. The primary object of containment should be to prevent occupant and remediator exposure to mold.

Containment Tips

- Always maintain the containment area under negative pressure.
- Exhaust fans to outdoors and ensure that adequate makeup air is provided.
- If the containment is working, the polyethylene sheeting should billow inwards on all surfaces. If it flutters or billows outward, containment has been lost, and you should find and correct the problem before continuing your remediation activities.

Limited Containment

Limited containment is generally recommended for areas involving between 10 and 100 square feet (ft^2) of mold contamination. The enclosure around the moldy area should consist of a single layer of 6-mil, fire-retardant polyethylene sheeting. The containment should have a slit entry and covering flap on the outside of the containment area. For small areas, the polyethylene sheeting can be affixed to floors and ceilings with duct tape. For larger areas, a steel or wooden stud frame can be erected and polyethylene sheeting attached to it. All supply and air vents, doors, chases, and risers within the containment area must be sealed with polyethylene sheeting to

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2905 of 5269

minimize the migration of contaminants to other parts of the building. Heavy mold growth on ceiling tiles may impact HVAC systems if the space above the ceiling is used as a return air plenum. In this case, containment should be installed from the floor to the ceiling deck, and the filters in the air-handling units serving the affected area may have to be replaced once remediation is finished.

The containment area must be maintained under negative pressure relative to surrounding areas. This will ensure that contaminated air does not flow into adjacent areas. This can be done with a HEPA-filtered fan unit exhausted outside of the building. For small, easily contained areas, an exhaust fan ducted to the outdoors can also be used. The surfaces of all objects removed from the containment area should be remediated/cleaned prior to removal. The remediation guidelines outlined in Appendix B can be implemented when the containment is completely sealed and is under negative pressure relative to the surrounding area.

Full Containment

Full containment is recommended for the cleanup of mold-contaminated surface areas greater than 100 ft^2 or in any situation in which it appears likely that the occupant space would be further contaminated without full containment. Double layers of polyethylene should be used to create a barrier between the moldy area and other parts of the building. A decontamination room or airlock should be constructed for entry into and exit from the remediation area. The entryways to the airlock from the outside and from the airlock to the main containment area should consist of a slit entry with covering flaps on the outside surface of each slit entry. The chamber should be large enough to hold a waste container and allow a person to put on and remove PPE. All contaminated PPE, except respirators, should be placed in a sealed bag while in this chamber. Respirators should be worn until remediators are outside the decontamination chamber. PPE must be worn throughout the final stages of HEPA vacuuming and damp-wiping of the contained area. PPE must also be worn during HEPA vacuum filter changes or cleanup of the HEPA vacuum.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2906 of 5269

BEST AVAILABLE COPY

Local Reproduction is Authorized and Encouraged.

USACHPPM
Readiness thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

National Guard Region North

National Guard Readiness Center
Industrial Hygiene Evaluation
Frederick Army National Guard Armory
Frederick, MD 21701-6758

Prepared for:

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078

Attn: Non-Responsive

Prepared by:

Bonus Environmental, LLC
P.O. Box 121
Mt. Pleasant, Michigan 48804

Project No. 1061-03
August 4, 2010

Bonus Environmental, LLC

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

TABLE OF CONTENTS

1. EXECUTIVE SUMMARY 1

2. LEAD SAMPLING 2
- *2.1 Lead Wipe Sampling 2*
- *2.2 Lead Air Sampling 2*

3. PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERS 3
- *3.1 Lead Based Paint 3*
- *3.2 Presumed Asbestos Containing Materials 4*
- *3.3 Water Damage/Mold Growth 4*
- *3.4 Housekeeping 4*
- *3.5 Employee Interviews 4*
- *3.6 Indoor Air Quality 4*

4. LIGHTING SURVEY 6

5. CONCLUSION 6

BEST AVAILABLE COPY

APPENDICES

Appendix A *Shop Diagram*

Appendix B *Lead Sample Results*

Appendix C *Photographs*

Appendix D *References*

BEST AVAILABLE COPY

BEST AVAILABLE COPY

August 4, 2010
Project No. 1061-03

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078-4003

Attn: Non-Responsive

Project: Army National Guard Readiness Center, Industrial Hygiene Evaluation
Frederick Army National Guard Armory

1.0 - EXECUTIVE SUMMARY

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Frederick Army National Guard Readiness Center located at 8501 Old National Pike in Frederick, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. The following industrial hygiene and safety programs were evaluated during this industrial hygiene evaluation performed by Bonus Environmental, LLC representative Non-Responsive on May 17, 2010:

- Indoor Air Quality
- Use of items on the Hazardous Materials List
- Vehicle maintenance activities
- Lead Wipe & Air Sampling
- Illumination
- Ergonomics
- Evaluation of the physical condition of the facility in regards to peeling paint, asbestos containing materials, water damage or mold problems, and housekeeping practices.

The Frederick Readiness Center is an Army National Guard armory comprised of offices, a drill hall, a kitchen, a fitness room, a boiler room, a classroom, a conference room, and a lounge. The point of contact for this facility was SFC Non-Responsive. Four (4) full-time administrative personnel are employed in the approximately 20,350 ft² facility. A shop diagram depicting the locations of the operations identified during this industrial hygiene evaluation is attached to this report as Appendix A.

The National Guard Bureau Region North Industrial Hygiene Office provided governmental furnished equipment and sampling media required to perform the industrial hygiene evaluation. Chain of custody forms for laboratories approved by the National Guard Bureau Region North Industrial Hygiene Office were provided with the sampling media. All samples collected during this industrial hygiene evaluation were sent to the National Guard Bureau Region North Industrial Hygiene Office approved laboratories for analysis.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

2.0 – LEAD SAMPLING

2.1 – Lead Wipe Sampling

Lead wipe sampling was performed according to the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame). Seventeen (17) wipe samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. The following table outlines the locations and analytical results for the lead wipe samples collected during this project

Army National Guard – Frederick Readiness Center ***Lead Wipe Sample Results***				
Sample #	***Sample Date***	***Sample Location***	***Sample Area (ft^2)***	***Sample Result ($\mu g/ft^2$)***
F-W-1	5-17-10	Field Blank	---	< 12
F-W-2	5-17-10	Drill hall, NW corner, on Internet Access Point keyboard	0.111	< 110
F-W-3	5-17-10	Drill hall, west wall, top of water dispenser	0.111	< 110
F-W-4	5-17-10	Drill hall, SE corner, top of "Amnesty box"	0.111	< 110
F-W-5	5-17-10	Drill hall, floor, south end "free throw" line	0.111	< 110
F-W-6	5-17-10	Drill hall, floor, north end "free throw" line	0.111	< 110
F-W-7	5-17-10	Room 114 (former indoor firing range), north end, light fixture	0.111	< 110
F-W-8	5-17-10	Room 114 (former indoor firing range), east wall-center, top of locker	0.111	< 110
F-W-9	5-17-10	Room 114 (former indoor firing range), center of room, floor	0.111	290
F-W-10	5-17-10	Stairwell handrail leading to room 101, SW of room 114	0.111	< 110
F-W-11	5-17-10	Room 119, kitchen, on prep table	0.111	< 110
F-W-12	5-17-10	Room 110, on bar table surface	0.111	< 110
F-W-13	5-17-10	North lobby area, on trophy cabinet	0.111	< 110
F-W-14	5-17-10	Room 117-1, above entrance door, supplied-air grill	0.111	< 110
F-W-15	5-17-10	Room 102, top of copy machine	0.111	< 110
F-W-16	5-17-10	Room 103, center of room, table top surface	0.111	< 110
F-W-17	5-17-10	Room 117-2, boiler room, top of boiler	0.111	< 110
F-W-18	5-17-10	Room 116-2, storage room, west side shelf	0.111	140

Surface cleanliness threshold = < 200 $\mu g/ft^2$

2.2 – Lead Air Sampling

The purpose of lead air monitoring was to document task-specific activities and corresponding exposures to lead. Occupational Safety and Health Administration (OSHA) 29 CFR 1926.62 requires employers whose employees are exposed to lead in the work place, in any quantity, make a

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2912 of 5269

BEST AVAILABLE COPY

determination whether any employee's exposure exceeds the action level (AL) of 30 µg/m^3 or the maximum permissible exposure limit (PEL) of 50 µg/m^3 as 8-hour time weighted averages (TWAs). If employee exposures are less than 30 µg/m^3, training is required under the Hazard Communication 29 CFR 1926.59. Exposures that exceed the AL or PEL require the employer to comply with additional requirements, including air monitoring, additional training, and restricted work practices as outlined in OSHA 29 CFR 1926.62.

Representative personal and fixed area sampling was conducted for potential airborne concentrations of lead in accordance with accepted Industrial Hygiene methods recognized by the National Institute for Occupational Safety and Health (NIOSH) and OSHA. Representative breathing zone samples were collected from an employee performing administrative tasks. Any employees performing a specific task utilized the same work practices. Employees not monitored for exposure to airborne lead dust can assume to have the same exposure as the monitored employees performing the same task.

Lead exposure monitoring was performed in accordance with the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame) with SKC personal air sampling pumps calibrated to 2.0 liters per minute. All samples were collected on 37 mm diameter cassettes with mixed-cellulose ester filters. All sampling pumps were calibrated before and after each use to ensure volume accuracy. Two (2) samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. Analytical results of the lead wipe and air samples are attached to this report as Appendix B.

Army National Guard – Frederick Readiness Center
Lead Air Sample Results

Sample #	Sample Type	Sample Location	Flow Rate	Start	Stop	Vol.	Rpt. Limit (µg/m³)	Results (µg/m³)	8 hr TWA (µg/m³)
May 17, 2010									
F-A-1	FB	Field Blank	---	---	---	0	3.0	< 3.0	N/A
F-A-2	PS	Sgt. [redacted], working in office room 117-1	2.0	0827	1534	854	3.5	< 3.5	≤ 3.1
F-A-3	IWA	Room 114, former indoor firing range, south end	2.0	0830	1533	846	3.5	< 3.5	N/A

PS = Personal sample, **IWA** = Inside work area, **N/A** = Not Applicable
Note: The OSHA PEL of 50 µg/m³ is averaged over an 8 hr work shift

3.0 - PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERNS

3.1 - Lead Based Paint

During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC performed a visual inspection of the facility in regards to lead based paint. Bonus Environmental, LLC identified no areas of peeling paint which could potentially pose a lead exposure hazard.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2913 of 5269

BEST AVAILABLE COPY

3.2 – Presumed Asbestos Containing Materials
During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC performed a visual inspection to identify presumed asbestos containing materials (PACM) and, if found, to note their condition. Bonus Environmental, LLC did not identify any PACM that was considered to be in poor or damaged condition.

3.3 - Water Damage/Mold Growth
During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC performed a visual inspection to report the location and perform an evaluation of any water damaged or visible mold problems. Bonus Environmental, LLC identified no water-damaged and/or moldy building materials during the survey.

3.4 - Housekeeping
During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC performed an evaluation of the housekeeping practices. Bonus Environmental, LLC found the housekeeping to be in good order.

3.5 – Employee Interviews
During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC performed interviews and made observations to determine if the work activities being performed possessed any ergonomic concerns. Following the interviews and observations, no ergonomic and or indoor air quality concerns were identified.

3.6 – Indoor Air Quality
During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC measured temperature, relative humidity, carbon monoxide (CO), and carbon dioxide (CO_2) throughout the facility. A calibrated TSI Q-Trak Model 7565 Indoor Air Quality Monitor equipped with a Q-Trak Probe 982 was utilized to record indoor air quality measurements.

Carbon dioxide is a natural component of air and the amount of CO_2 in a given air sample is commonly expressed as parts per million (ppm). The outdoor air in most locations contains about 380 ppm carbon dioxide. Higher outdoor CO_2 concentrations can be found near vehicle traffic areas, industry and sources of combustion. The concentrations of CO_2 found in most offices are well below the OSHA Permissible Exposure Limit (PEL) of 5,000 ppm when averaged over an 8-hour time period for an industrial workplace. While levels below 5,000 ppm are considered to pose no serious health threat, studies have indicated that individuals in offices with elevated CO_2 concentrations tend to report drowsiness, lethargy and a general sense that the air is stale. Ventilation rates for office spaces are defined by various codes and standards. The most widely accepted standard is the American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE) Standard 62. According to ASHRAE Standard 62.1-2007, CO_2 concentrations below 700 ppm above the outdoor level are considered to indicate adequate ventilation and provide human comfort. The CO_2 measurements collected during this industrial hygiene evaluation ranged from 471 ppm to 612 ppm and indicate adequate ventilation within the facility.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2914 of 5269

BEST AVAILABLE COPY

Carbon monoxide, also known as the "silent killer," is a colorless, odorless, poisonous gas that results from the incomplete burning of common fuels such as natural or liquefied petroleum gas, oil, wood or coal. When carbon monoxide is inhaled, it enters the blood stream and reduces the ability of the blood to carry oxygen to vital organs, such as the heart and brain. Because it is impossible to see, taste or smell the toxic fumes, CO can harm you before you are aware it is in your work area. At lower levels of exposure, CO causes mild effects that are often mistaken for the flu. These symptoms include headaches, dizziness, disorientation, nausea and fatigue. The effects of CO exposure can vary greatly from person to person depending on age, overall health and the concentration and length of exposure. The OSHA has established a PEL of 50 ppm. OSHA standards prohibit worker exposure to more than 50 parts of the gas per million parts of air averaged during an 8-hour time period. The peak CO level for employees is 200 ppm. The CO measurements collected during this industrial hygiene evaluation ranged from 0.7 ppm to 2.4 ppm. CO levels were well below the OSHA PEL during this industrial hygiene evaluation.

During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC collected temperature measurements. Temperature measurements throughout the facility ranged from 66.1ºF to 77.1ºF (except for a reading of 82.7ºF in the boiler room) and are considered to be within an acceptable range.

During the industrial hygiene evaluation of the Army National Guard Frederick Readiness Center, Bonus Environmental, LLC collected relative humidity measurements. Relative humidity measurements throughout the facility ranged from 37.6% to 60.5% and are considered to be within an acceptable range. Indoor air quality measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard – Frederick Readiness Center
Indoor Air Quality Measurements

Location	*CO_2 (ppm)*	*CO (ppm)*	*Relative Humidity (%)*	*Temperature (ºF)*
Outdoors, north side entrance	437	2.0	95.0	59.7
Room 114, south end	493	0.7	55.3	72.0
Room 101 (Drill hall), center of room	509	1.7	52.1	71.5
Room 110	494	2.3	37.6	68.2
North lobby area	471	1.7	55.4	66.7
Room 117-1	531	1.5	56.9	66.7
Room 102	491	1.6	57.0	66.1
Room 103, south end	542	1.0	60.5	67.8
Room 119 (Kitchen)	514	1.1	57.0	69.2
Room 117-2 (Boiler room)	612	0.8	41.8	82.7
Room 116-2	551	2.4	40.2	77.1

Required/Recommended Values
CO_2 *- OSHA PEL = 5,000 ppm and ASHRAE Standard 62.1-2007 = no greater than 700 ppm above outdoor*
CO *- OSHA PEL = 50 ppm and OSHA Ceiling Limit = 200 ppm*
Temperature *- ASHRAE Standard 55-2004 = between approximately 67 and 82 °F.*
RH *– ANSI/ASHRAE Standard 62.1-2007 = <65%*

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2915 of 5269

BEST AVAILABLE COPY

4.0 – LIGHTING

Utilizing a properly calibrated Cooke Corporation cal-Light 400 light meter, Bonus Environmental, LLC collected illumination readings throughout the facility. Illumination measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard – Frederick Readiness Center Lighting Survey			
Location	*Measurement in Foot Candles*	*Requirement in Foot Candles*	*Requirement Met?*
Room 114 – Storage (former indoor firing range)	*11.4*	*30*	NO
Room 101 – Drill hall	12.8	30	NO
Room 111 – Storage	51.3	30	YES
Room north of room 111 – Office	43.8	50	NO
Room 110 – Lounge	51.3	50	YES
Room between rooms 110 & 109 – Office	94.4	50	YES
Room 109 – Office	44.5	50	NO
Room 117-1 – Office	59.2	50	YES
Room 116-1 – Office	86.7	50	YES
Room 102 – Conference room	45.3	30	YES
Room 102A – Office	13.8	50	NO
Room 105 – Women's restroom	40.1	5	YES
Hallway outside of room 117-1	22.3	5	YES
Room 104 – Men's restroom	58.6	5	YES
Room 103 – Classroom	16.2	50	NO
Room 103A – Storage	27.4	30	NO
Room 120 – Storage	6.5	30	NO
Room 119 – Kitchen	52.4	10	YES
Room 119A – Kitchen	40.5	10	YES
Room 118 – Storage	11.3	30	NO
Room 116-2 – Storage	15.6	30	NO
Room 117-2 – Boiler room	10.2	30	NO
Room 115 – Storage	102.1	30	YES
Room 115A – Storage	14.3	30	NO
Room 112, 112A, 113	Inaccessible; off-limits		
Room 102B	Inaccessible		

Lighting levels were compared to the levels outlined within the ANSI/IESNA RP-1-04 Office Lighting Handbook, and the ANSI/IESI RP-7-01 Lighting Industrial Facilities Handbook. Areas within the facility which did not meet the foot candle requirements are identified with a "NO" within the Requirement Met? column. It is recommended that illumination be improved in all the areas that did not meet the requirements. Improving illumination can be achieved by replacing burned-out lamps/bulbs, cleaning fixtures, relocating detailed work activities to more illuminated areas, and using supplemental task lighting.

5.0 - CONCLUSION

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Frederick

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2916 of 5269

BEST AVAILABLE COPY

Army National Guard Readiness Center located at 8501 Old National Pike in Frederick, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. An industrial hygiene evaluation of the facility was performed by Bonus Environmental, LLC representative [redacted] Non-Responsive on May 17, 2010:

Bonus Environmental, LLC recommends that any areas of concerns outlined within this report be evaluated to ensure the necessary actions are made. Following the completion of the industrial hygiene evaluation, Bonus Environmental, LLC found the following safety and/or indoor air quality conditions of the facility to be within acceptable levels/condition in regards to the following:

- Carbon Dioxide
- Carbon Monoxide
- Presumed Asbestos Containing Materials
- Ergonomics
- Housekeeping
- Temperature
- Relative Humidity
- Lead Air Samples
- Water-damaged/Moldy Building Material

It has been a pleasure to be of assistance to you. Please contact us if you have any questions concerning this report or if we can be of any further assistance in any other environmental or occupational health matter.

Sincerely,

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Frederick_10_Report.docx

BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2917 of 5269

BEST AVAILABLE COPY

Appendix A

Shop Diagram

BEST AVAILABLE COPY

BEST AVAILABLE COPY

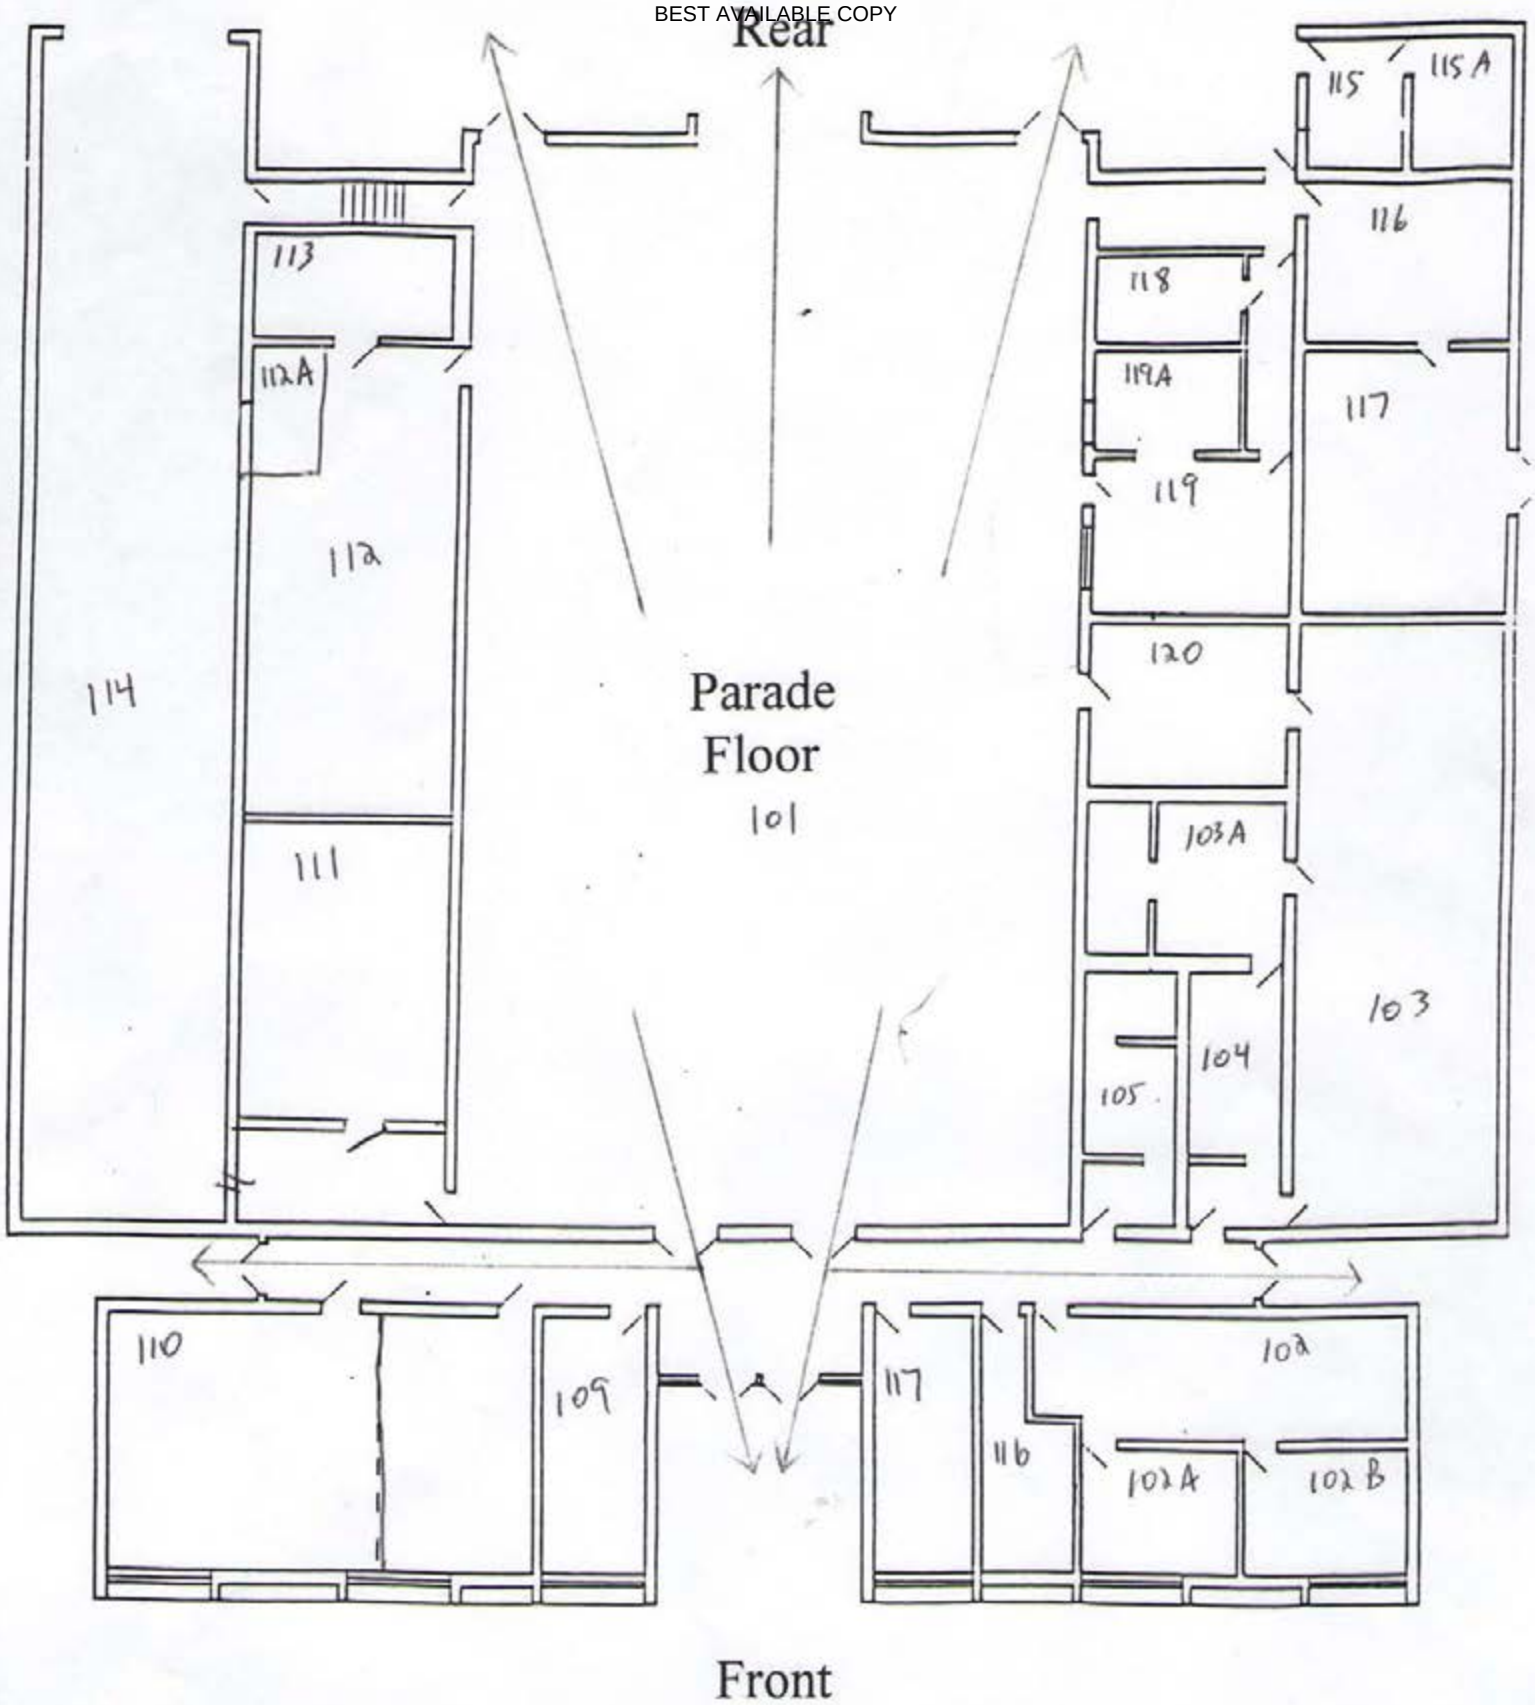

Frederick Armory Evacuation Plan

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Appendix B

Lead Sample Results

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

RECEIVED JUN 14 2010

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client: National Guard Bureau

Address: 301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation
Havre de Grace, Maryland 21078

Attention: [redacted]

Job Name: Frederick Armory

Job Location: Frederick, MD

Job Number: Frederick Armory

P.O. Number: W912K6-09-A-0003

Chain Of Custody: 507189

Date Submitted: 5/21/2010

Person Submitting: [redacted]

Date Analyzed: 5/28/2010 **Report Date:** 6/1/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047845	F-A-1	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1047846	F-A-2	Flame	Air	854	N/A	3.5	ug/m³	<3	<3.5	ug/m³	
1047847	F-A-3	Flame	Air	846	N/A	3.5	ug/m³	<3	<3.5	ug/m³	
1047848	F-W-1	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1047849	F-W-2	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047850	F-W-3	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047851	F-W-4	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047852	F-W-5	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047853	F-W-6	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047854	F-W-7	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047855	F-W-8	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047856	F-W-9	Flame	Wipe	****	0.111	110	ug/ft²	32	290	ug/ft²	
1047857	F-W-10	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047858	F-W-11	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047859	F-W-12	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047860	F-W-13	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047861	F-W-14	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047862	F-W-15	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047863	F-W-16	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0055-MD
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	Frederick Armory	**Chain Of Custody:**	507189
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation Havre de Grace, Maryland 21078	**Job Location:**	Frederick, MD	**Date Submitted:**	5/21/2010
		Job Number:	Frederick Armory	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	5/28/2010
Attention:	[redacted]			**Report Date:**	6/1/2010

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047864	F-W-17	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047865	F-W-18	Flame	Wipe	****	0.111	110	ug/ft²	15	140	ug/ft²	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: Ang Cao

Technical Manager: G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0808 (NGB)
Released by National Guard Bureau
Page 292 of 5269

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved.
AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 19396

Analysis Type: Flame
Sample Type: Wipe
Analysis Date: 5/28/2010

	Result		Percent Recovery	RPD	Comment
Preparation Blank	-0.075	ppm			Acceptable
Report Limit Verification Sample	0.272	ppm	81.6%		Acceptable
Expected Spike Level (ppm) 0.3333					
Duplicate Sample 1		mg/Kg			
Duplicate Sample 2		mg/Kg			Acceptable
Matrix Spike Analysis					
Spiked Sample					Acceptable
Spike Duplicate					Acceptable
Laboratory Control Sample 1	309.410	µg	102.01%		Acceptable
Laboratory Control Sample 2	287.202	µg	103.06%	1.02%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999846

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507189	47848	F-W-1
507189	47849	F-W-2

SDG Number: 19396

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2923 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507189	47850	F-W-3
507189	47851	F-W-4
507189	47852	F-W-5
507189	47853	F-W-6
507189	47854	F-W-7
507189	47855	F-W-8
507189	47856	F-W-9
507189	47857	F-W-10
507189	47858	F-W-11
507189	47859	F-W-12
507189	47860	F-W-13
507189	47861	F-W-14
507189	47862	F-W-15
507189	47863	F-W-16
507189	47864	F-W-17
507189	47865	F-W-18
507190	47890	CL-W-21
507190	47891	CL-W-22

SDG Number: 19396

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2924 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Focused on Results!!

NVLAP 101143-0

NY ELAP 10920

AIHA 100470

Submitting Samples for National Guard Jobs

1) All samples shall be submitted to AMA Analytical Services, Attn: Sample Receiving, utilizing the enclosed Chain-of-Custody Form. The highlighted areas must be completed by the Subcontractor, however, the Sample Information/Analysis/Matrix section will not need to be completed if field date sheets are submitted with the samples. Please be sure to include a contact phone number for the person submitting the samples.
2) Results shall be reported via email to the following persons:
   a. National Guard Subcontractor [redacted] Non-Responsive [redacted] @bonusenvironmental.com
   b. [redacted] Non-Responsive CIV NGB: [redacted] us.army.mil
   c. [redacted] CIV NGB: [redacted] rmy.mil
3) Hard Copy Reports & Invoices shall be handled in the following manner:
   a. Original Invoices and Copies of Reports shall be sent to the National Guard
      National Guard Bureau
      Attn: [redacted] Non-Responsive
      301-In Old Bay Lane
      Attn: NGB-AVN-SI, State Military Reservation
      Havre de Grace, Maryland 21078
   b. Original Reports shall be sent the National Guard Subcontractor

      Attn: [redacted] Non-Responsive
      office: 989-779-7686
      cell: 989-621-3862
4) All Pb Wipes shall be handled in the following manner:
   a. All samples shall be analyzed utilizing FLAA procedures
   b. Samples whose results are reported as less than the reporting limit, and the reporting limit is greater than 40ug/ft2 shall be re-analyzed utilizing GFAA procedures.
5) All other samples – Pb Paints, Soils, & Airs, PCM Airs, PLM Bulks, TEM Airs, & TEM Bulks shall be analyzed utilizing standard analytical procedures

Asbestos · Lead · Mold

4475 Forbes Blvd. · Lanham, MD 20706 · (301) 459-2640 · Fax (301) 459-2643 · www.amalab.com

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) **507189**

Sheet 1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Frederick Armory
2. Job Location: Frederick, MD
3. Job #: Frederick Armory
4. Contact Pers[redacted] PO #: W912K6-09-A-0003
5. Submitted by [redacted] @ phone # (410) [redacted]3

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due:
❑ 24 Hours Time Due:
Comments:

Reporting Information (Results will be provided [redacted] as technically feasible):

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day + Date Due: 5-28-10
❑ 2 Day
❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
☒ Incl[redacted] with Report
☒ Email [redacted] bonvi environmental.com
❑ Fax: [redacted] @us.army.mil
❑ Verba[redacted] @us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)
TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
❑ Pb Paint Chip ____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost, 18 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
F-A-1	Field Blank	5-17	0	—				✓		✓						
F-A-2	Sgt Irizarry		854	—				✓		✓						
F-A-3	Rm 114		846	—				✓		✓						
F-W-1	Field Blank		—	—				✓		✓						
F-W-2	Drill Hall		—	4"x4"				✓				✓				
F-W-3	Drill Hall		—					✓				✓				
F-W-4	Drill Hall		—					✓				✓				
F-W-5	Drill Hall		—					✓				✓				
F-W-6	Drill Hall		—					✓				✓				
F-W-7	Rm 114		—					✓				✓				
F-W-8	Rm 114		—					✓				✓				
F-W-9	Rm 114		—					✓				✓				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 21 / 10 @ 9:45 Via: FedEx By (Print): Surat Watson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: Mail Date: 6 / 1 / 10 Time: 1905 Initials: MM
4. Comments:

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2926 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2927 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

DWI (410) 247-2024

159202

210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Sheet 2 of 2

507189

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Frederick Armory
2. Job Location: Frederick, MD
3. Job #: Frederick Armory
4. Contact Person [redacted] #: W912K6-09-A-0003
5. Submitted by: [redacted] Signature: [redacted]

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due: ____
❑ 24 Hours Time Due: ____
Comments: ____

Reporting Information (Results will be provided as soon as technically feasible):

NORMAL BUSINESS HOURS
❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day + Date Due: 5-28-10
❑ 2 Day
❑ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
☒ Incl[redacted]vith Report
☒ [redacted] Donv@environmental.com
❑ Fax: [redacted] Non-Responsive
❑ Verba[redacted]Dus.army.mil
[redacted]Dus.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)
TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

☑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
❑ Pb Paint Chip ____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 18 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
F-W-10	SE Stairwell	5-17	—	4"x4"				X				X				
F-W-11	Rm 119- Kitchen		—					X				X				
F-W-12	Rm 110		—					X				X				
F-W-13	Lobby		—					X				X				
F-W-14	Rm 117		—					X				X				
F-W-15	Rm 102		—					X				X				
F-W-16	Rm 103		—					X				X				
F-W-17	Rm 117		—					X				X				
F-W-18	Rm 116		—					X				X				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 21 / 10 @ 9:45 Via: FedEx By (Print): Surat Watson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

Appendix C

Photographs

BEST AVAILABLE COPY

Building exterior, north side entrance

Room 101, Drill Hall/Parade Floor

Room 114, former indoor firing range

Room 119, Kitchen

Room 117, Boiler Room

Room 116, Storage Room

Posted to NGB/ FOIA Reading Room
May 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-19-0085 (MB)
Released by National Guard Bureau
Page 2929 of 5269

BEST AVAILABLE COPY

Building exterior, south side

Posted to NGB FOIA Reading Room
May 2018

BEST AVAILABLE COPY

FOIA Requested Record #0-19-0085 (MB)
Released by National Guard Bureau
Page 2930 of 5269

BEST AVAILABLE COPY

Appendix D

References

BEST AVAILABLE COPY

BEST AVAILABLE COPY

1. Department of Defense Instruction (0001) 6055.1, Department of Defense Occupational Safety and Health (OS H) Program, August 19, 1998.

2. Army Regulation (AR) 11-34, The Army Respiratory Protection Program, February 15, 1990.

3. DA PAM 40-503, Medical Service, Industrial Hygiene Program, October 30, 2000.

4. Technical Manual (T.M) 5-810-1, Mechanical Design, Heating, Ventilation, and Air Conditioning, June 1991.

5. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEls), American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

6. Industrial Ventilation - A Manual of Recommended Practices, American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

7. UFC 3-410-01 FA Heating, Ventilating, and Air Conditioning, 15 May 2003

8. Occupational Safety and Health Administration (OSHA) Lead in Construction Standard, 29 CFR 1926.62

9. OSHA Lead Standard 29 CFR 1910.1025

10. OSHA Respiratory Protection Standard 29 CFR 1910.134

11. Army Regulation (AR) 385-10, The Army Safety Program, August 23, 2007.

12. RP-1-2004, Office Lighting, Illuminating Engineering Society of North America (IESNA)/ANSI.

13. RP-7-2001, Industrial Lighting, (IESNA)/ANSI.

14. The American Society of Heating, Refrigerating, and Air-Conditioning Engineers (ASHRAE), Standard 62.1-2007, "Ventilation for Acceptable Indoor Air Quality".

15. ASHRAE Standard 55-2004 – “Thermal Environmental Conditions for Human Occupancy”

16. Title 24, CFR, Part 35, Subpart B, Sections 35.110, Definitions of Lead-Based Paint, Housing and Urban Development, U.S. Department of Housing.

17. OSHA Personal Protective Equipment 29 CFR 1910.132

18. OSHA Permissible Exposure Limit (PEL) for General Industry 29 CFR 1910.1000 Z-1 Table

19. Guidelines on Assessment and Remediation of Fungi in Indoor Environments, New York City Department of Health and Mental Hygiene, November 2008.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2932 of 5269

BEST AVAILABLE COPY

20. Mold Remediation in Schools and Commercial Buildings, U.S. Environmental Protection Agency, March 2001

21. Army Facilities Management Information Document on Mold Remediation Issues TG277, February 2002

22. OSHA Welding, Cutting, Brazing 29 CFR 1910.252

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2933 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Frederick Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Frederick Readiness Center** **8501 Old National Pike** **Frederick MD, 21701**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**January 3, 2013**
Report Date:	**February 18, 2013**

Non-Responsive

[redacted]

Manager, Industrial Hygiene Services

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2935 of 5269

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on January 3, 2013, at the Frederick Readiness Center located at 8501 Old National Pike, Frederick, MD 21701. The survey was performed by Mr. Non-Responsive.

1. Lead bulk, surface and air samples were collected. Surface levels of lead exceeded 200 micrograms per square foot (ug/ft^2) in two locations. Cleaning procedures should be improved and remedial action should be taken to maintain lead levels below 200 ug/ft^2. See Section 3.0 for sampling results.

2. Lighting levels did not meet the American National Standard Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in two locations. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Relative humidity levels were less than the American Society of Heating, Refrigeration, and Air-conditioning Engineers (ASHRAE) recommended guideline of 30-60% in all locations.

    b. Temperature levels were less than the ASHRAE recommended guideline of 68-79 degrees F at one location.

    See Section 5.0 for detailed sampling results

4. Several conditions or factors that could affect indoor air quality were observed at the time of this survey. This includes:

    a. Roof leaks and sources of water infiltration;
    b. Dirty supply and return vents.
    c. Some water damaged ceiling tiles as well as ceiling tiles with minimal fungal growth were at several locations in the facility.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2936 of 5269

Section 2.0 Operation Description & Observations

The Frederick Readiness Center is mainly an administrative facility with a drill hall, offices, classroom, and converted firing range/storage areas. There were approximately 4 full-time employees stationed at this facility at the time of this survey.

The building was initially constructed in 1982. The building is one story with a brick exterior. The interior walls are concrete block or drywall. The floors are concrete with vinyl floor tile or carpet.

The Heating, Ventilation, and Air-Conditioning (HVAC) system consisted of an oil-fired forced air furnace for heat and roof top units for air conditioning.

The area of the building that was once a firing range has been converted into a wall locker storage area. No firing range components remain. Wood has been placed on the floor covering the bullet trap.

There is no child-care facility in the building.

Overall housekeeping practices were adequate.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared properly designed. Personnel had supportive chairs.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2937 of 5269

Section 3.0 Lead Testing

Due to the age of the building there is a low potential for lead based paint to be present. Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 um mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Bulk (%)	Air ug/m^3	Surface ug/ft^2
1	Drill Hall	*	<6.7	*
2	Converted Firing Range – Storage Area	*	<6.6	*
3	Drill Hall – Center of Floor	*	*	<110
4	**Drill Hall – Top of Coke Machine**	*****	*****	**270**
5	Drill Hall – Top of Table	*	*	<110
6	Kitchen – Top or Refrigerator	*****	*	<110
7	Kitchen – Top of Microwave	*****	*	<110
8	Hallway – Outside Converted Firing Range	*	*****	<110
9	Converted Indoor Firing Range – Concrete Floor	*	*****	<110
10	**Converted Indoor Firing Range – Wooden Floor**	*****	*****	**340**
11	Converted Indoor Firing Range – Top of Wall Locker	*****	*****	<110
12	Classroom – Break Room Top of Book Shelf	*	*	<110
13	Office 102A – Top of Deck	*	*	<110
14	Classroom/Weight Room Top of Desk	*	*	<110
15	Office 120 – Top of File Cabinet	*	*	<110
16	Office 106 Top of Table	*	*	<110
17	Blank- Wipe	*	*	<12 ug
18	Blank - Air	*	<3 ug	*
19	Paint Chip – Men's Bathroom Ceiling	<0.011	*	*
20	Paint Chip – Kitchen Ceiling	<0.01	*	*
-	Criteria	0.5	50	200

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Source: NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2938 of 5269

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead bulk, surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were above the recommended guideline of 200 ug/ft^2 in the following locations:

    - Drill Hall – Top of Coke Machine
    - Converted Indoor Firing Range – Top of Wooden Floor

  Cleaning procedures should be improved to maintain lead levels on surfaces below the recommended guideline of 200 ug/ft^2.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

- Paint was observed to be peeling on ceilings in the kitchen and men's bathroom. A bulk samples were collected and determined to contain <0.001%Pb. This is less than the EPA definition of lead based paint = 0.5%. However, all areas of peeling paint should be repaired.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2939 of 5269

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. K98364). The light meter was last calibrated in April 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Drill Hall	47.1	10	Yes
Office 111	63.3	30-50	Yes
Break Room 110A	56.4	10	Yes
Office 110B	108.3	30-50	Yes
Office 109	44.1	30-50	Yes
Office 107	67.0	30-50	Yes
Office 102A	41.1	30-50	Yes
Office 102B	56.1	30-50	Yes
Office 102	46.6	30-50	Yes
Men's Bathroom	78.1	5	Yes
Classroom/Weight Room	**18.6**	**30-50**	**No**
Office 120	25.5	30-50	Yes
Kitchen	58.3	50	Yes
Converted Firing Range/Storage	**22.1**	**30**	**No**

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting level did not meet the minimum recommended guideline in the classroom/weight room and converted firing range/storage area. Lighting should be improved in these areas.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2940 of 5269

Section 5.0 Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, carbon monoxide and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7565 (Serial #02041015). The IAQ Meter was last calibrated in August 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (◦F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Office 111	**59.2**	**26.2**	542	0.0
Office 110B	69.3	**21.1**	800	0.0
Office 107	73.8	**15.7**	729	0.0
Outdoors	45.3	**20.2**	303	0.0
Criteria	**68.0-79.0**	**30-60**	**<1,003**	**<9.0**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **F =** degrees Fahrenheit

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature and relative humidity levels were outside the recommended guidelines. We recommend that the temperature levels be maintained at 68-79 degrees F for comfort during occupied periods. Low relative humidity can cause the drying of the mucous tissues and an increased susceptibility to respiratory infection. Relative humidity should be maintained at 30-60%.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2941 of 5269

- Carbon dioxide levels measured did not exceed the recommended ceiling of 1,003 parts per million (ppm). This indicates that outdoor air ventilation is adequate in all areas.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm.

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observations were noted:

    - A roof leak and associated water damaged ceilings in the kitchen and men's bathroom. All sources of water infiltration should be identified and repaired. Water stained ceiling tile should be removed and replaced.
    - Overall housekeeping was adequate.
    - The HVAC supply grills located in some areas were dirty. These should be cleaned. Do not permit dirt, debris, microbial growth, etc. to accumulate in any portion of the HVAC system.
    - Approximately 10 water stained ceiling tiles were observed in the facility office areas.
    - Three ceiling tiles with minimal fungal growth were observed in the break room. The tiles should be carefully removed, placed in a plastic bag and disposed of.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2942 of 5269

Section 6.0 Suspect Asbestos Containing Building Materials

Based on the age of the building (e.g., constructed in 1982) it is unlikely asbestos-containing materials (ACM) are present in the facility. It was reported that no asbestos containing materials were present in the facility. No suspect ACM was observed at the time of this survey. Inaccessible areas such as behind walls or crawlspaces were not inspected.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2943 of 5269

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	02041015	8/2012	NA
Cal Light 400 Light Meter	K98364	4/2012	NA
TSI 4199 Calibrator	41460827002	8/2012	NA
SKC Air Sampling Pump	647631	1/2/2013	2.50 LPM
SKC Air Sampling Pump	647610	1/2/2013	2.47 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2946 of 5269

Appendix B. Photographs

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2947 of 5269

Appendix C. Floor Plan

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2948 of 5269

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition

4. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h)(3)]

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 NOV 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

1720 Walton Road Blue Bell, PA 19422 610-828-3078 Fax 610-828-7842

February 9, 2009

E-MAIL
Ms. Non-Responsive
Army National Guard
ATTN: NGB-ARS-IHNE
301-IH Old Bay Lane
Havre de Grace, MD 21078

Subject: Industrial Hygiene Assessment Report
Fort Ritchie Readiness Center, Cascade, Maryland 21719
IES Project No. EHS08794.02

Dear Shirley:

IES Engineers (IES) is pleased to enclose the final report of the Industrial Hygiene assessment conducted at the Army National Guard Fort Ritchie Readiness Center facility located in Cascade, Maryland. Thank you for the opportunity to perform this assessment. Should you have any questions, please contact Non-Responsive or me.

Sincerely,

[redacted] Non-Re
[redacted] CIH
Senior Manager, Health, Safety
& Industrial Hygiene Services

cc: Non-Responsive, IES

BEST AVAILABLE COPY

NATIONAL GUARD BUREAU
REGION NORTH INDUSTRIAL HYGIENE OFFICE
HAVRE DE GRACE, MARYLAND

FINAL
INDUSTRIAL HYGIENE ASSESSMENT
FORT RITCHIE READINESS CENTER
13817 RITCHIE ROAD, CASCADE, MARYLAND, 21719
SURVEY DATE: JULY 16, 2008

IES PROJECT NO. EHS08794.02
REPORT DATE: FEBRUARY 9, 2009

Prepared and submitted by:

[redacted] /e/
[redacted], CIH
Senior Project Manager

Certified Industrial Hygienist review by:

[redacted] /e/
[redacted], CIH
Senior Manager, Health, Safety & Industrial Hygiene Services

BEST AVAILABLE COPY

TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
	1.1 Introduction	1
	1.2 Facility Description	2
	1.3 Findings and Conclusions	3
	1.4 Recommendations	5
2.0	OPERATION DESCRIPTION AND CONDITION	6
	2.1 General Description and Condition	6
	2.2 Specific Site Survey and Conditions	6
3.0	SAMPLE RESULTS AND MEASUREMENTS	7
	3.1 Air Sampling	7
	3.1.1 Indoor Air Quality	7
	3.1.2 Airborne Lead Sampling	9
	3.2 Lead Dust and Bulk Sampling	10
	3.3 Illuminance Survey	12
4.0	ONSITE OBSERVATIONS	13
	4.1 Physical Conditions of RC	13
	4.2 Housekeeping	13
	4.3 Ergonomics	13
5.0	EQUIPMENT AND CALIBRATION DATA	13
	5.1 Sampling Equipment List	13
	5.2 Sampling Equipment Calibration Data	14
6.0	REFERENCES	14

TABLES

Table 1 – Air Temperature, Relative Humidity, CO_2 and CO Measurements 8

Table 2 – Airborne Lead Sampling Results Summary 9

Table 3 – Wipe/Bulk Sample Results Summary 11

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2952 of 5269

BEST AVAILABLE COPY

TABLE OF CONTENTS (Cont'd)

Table 4 – Illuminance Readings Summary 12

Table 5 – Sampling Equipment List 14

Table 6 – Sampling Equipment Calibration Data 14

APPENDICES

Appendix A – Readiness Center Photographs

Appendix B –Indoor Air Quality Map

Appendix C – Laboratory Analysis Results

Appendix D – Illuminance Readings Map

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2953 of 5269

1.0 EXECUTIVE SUMMARY

1.1 Introduction

Assessment Date: July 16, 2008

Purpose: The National Guard Bureau (NGB) retained IES Engineers (IES) to assist it in performing an Industrial Hygiene assessment at the Army National Guard (ARNG) Readiness Center (RC) located at 13817 Ritchie Road in Cascade, Maryland. The purpose of the Industrial Hygiene survey was to identify and measure the existence and extent of potentially hazardous operations or conditions at the ARNG facility. Mr. [redacted], CIH, Senior Project Manager, of IES performed the assessment. All assessment activities were conducted with reference to the Statement of Work – Industrial Hygiene Services for National Guard Bureau Industrial Hygiene Region North Baseline Surveys for Readiness Centers and Administrative Buildings, May 2008. Assessment activities within the readiness center included:

1) Dust sampling and analysis for lead surface contamination,
2) Air sampling and analysis for lead (to determine administrative personnel exposure to airborne lead),
3) Bulk sampling of suspected asbestos-containing building materials, or lead-containing paint (where advised),
4) Physical (visual) site inspection of all internal building areas to note condition of materials, particularly those suspected to be lead or asbestos-containing, as well as potential water-damaged materials, housekeeping conditions and related safety hazards, ergonomic considerations, and indicators of indoor air quality,
5) Measurements of relative humidity, carbon dioxide and temperature in occupied areas of each floor, as well as lighting supporting evaluation with respect to indoor environmental standards,
6) Visual inspection and/or measurement of ventilation systems within the readiness center (general and local exhaust), as pertinent, supporting evaluation of indoor air quality and maintenance procedures,
7) Evaluation of attached garages, with respect to visual examination, hazards present, and observation/documentation of controls utilized including administrative, personal protective equipment and ventilation controls, and associated impact upon readiness center operations.

Conferred With: SSG [redacted], Administrative Supervisor, Fort Ritchie Readiness Center

1.2 Facility Description

Fort Ritchie RC (also referred to as Edgar Boyd Armory), located at 13817 Ritchie Road, Cascade, Maryland is single-story training facility constructed in 1994. Standard working hours are from Tuesday through Friday, between the hours 0630 to 1700.

Predominant construction features include interior block masonry walls on concrete slab with brick exterior cladding, and insulated metal pan roof structure. Interior finishes included 12 inch square (12” x 12”) floor tile, or masonry tile floors, suspended fiber acoustic ceiling tile (2’ x 2’), and painted drywall partitions. There is no attached garage at the facility. All garage/maintenance activity is conducted through the facility located in conjunction with the Hagerstown Readiness Center, located in Hagerstown, Maryland. Minor vehicular checks, (fluid levels, tire pressure, etc.) are conducted in the vehicle storage/fueling/cleaning lot, located at rear of drill room, particularly on drill weekends. Occasionally, vehicles may be driven into the drill room area for loading, presumably during inclement weather. The drill room is composed of block walls, sealed concrete floor, and metal frame roof with Tectum-type insulation. The RC includes: drill room, converted parachute packing room (old firing range), kitchen/dining facility, exercise room, men’s and women’s locker rooms/toilets, supply storage area, arms vault, administrative office area, team drill/briefing rooms and exterior accessible boiler room, and flammable storage room. Refer to Appendix A of this report for current photographs of facility areas/conditions.

Heating, ventilation and air-conditioning (HVAC) service is achieved through various methods at the Fort Ritchie RC. Heating is achieved primarily by hot water boiler/circulating hot water heat delivered to perimeter unit ventilators, ceiling mounted space heaters (drill room and supply storage), and to roof-mounted package heating units (hallways, kitchen/dining facility, lockers). Separate package HVAC units are located within the supply storage area, serving the administrative offices, team offices and supply storage areas; however, cooling systems were found to be fouled or non-functional in these areas. Cooling is also achieved primarily by four perimeter unit ventilators located in the administrative offices section. An additional five unit ventilators are located within the area of caretakers office, exercise room and dining facility; however, these units do not properly operate in the cooling mode, and provide heating only. Other facility areas are cooled by natural ventilation (open doors and windows), or exhaust fans located within the drill room, kitchen, and locker rooms. A separate, fully-functional HVAC system is installed in the parachute room, which provides cooling. During the cooling season (summer months), natural ventilation is used throughout most of the facility.

This facility is occupied by two full-time administrative (active guard reserve) personnel (SSGs [redacted]. [redacted] and [redacted]). Additionally, one full-time Caretaker ([redacted]) provides routine maintenance and custodial service. Occasionally, other military/national guard personnel may be temporarily assigned to this location. M-Day National Guard personnel occupy the site on drill weekends.

1.3 Findings and Conclusions

The predominant findings and conclusions of the assessment at this location are as follows:

- The facility is relatively new, generally in good condition, with exception of heating, ventilating and air-conditioning systems, as discussed below.

HVAC Service

- Heating, ventilating and air-conditioning (HVAC) service was found to be largely non-functional at the site due to equipment malfunction, with unknown capability, or inaccessibility.
    - Five of nine unit ventilators were not able to supply cooling to areas served (caretaker's office, exercise room, dining facility).
    - All three HVAC systems located in the supply storage area (serving administrative offices, team offices and supply areas) were found non-functional or with limited function.
        - The unit serving team offices was apparently disconnected from service, and was found inaccessible due to razor/security wire atop lumber/wire partitions.
        - Other units were observed with heavily fouled cooling coils, inadequate filtration (not suitable for commercial use), broken filter panels, or reportedly unused due to frequent "freeze-up: of equipment.
    - Roof-mounted package units could not be inspected due to bee and wasp nests located in access panels of all units. The caretaker could not verify functionality of this equipment (whether heating and/or air-conditioning could be supplied by this equipment).
    - Localized oil-fired heaters were found located within the drill hall and supply storage.
    - A fully-functional HVAC system was found located within the parachute room.
    - Caretaker responsibility is limited to changing filters; however, a standard change schedule was not used. All roof top HVAC equipment were inaccessible for inspection on the date of the assessment due to bee and wasp nests within the access panels. This problem may impact indoor environmental quality by reducing access for service, and/or necessary and frequent use of insecticide in proximity within the equipment may contribute to increased insecticide exposure unless properly applied.
    - No annual HVAC service records were available on-site, and the HVAC servicer, assigned at Pikesville Unit "Garage 13" is not readily accessible for needed assistance.

Facility Condition

- Ceiling tiles were observed to be warped in team office and general hall areas (indication of excess moisture absorption); however, musty odor or visible mold growth was not readily observed during the survey.

- The exercise room was found to contain carpet on slab, with wall to wall rubber mat on carpet. This condition may lead to microbial growth, particularly during summer conditions with high relative humidity, or ineffective air exchange. General musty odor was present in the room, in addition to rubber odor. No cleaning/disinfection program was noted for the exercise equipment.

- All building materials present within the RC were found in good condition on the day of the Industrial Hygiene Assessment. IES did not find presumed asbestos-containing materials (PACM) to be present. Facility paint was found in good condition with the exception of a small section of delaminated paint located in the Women's locker room, due to a roof drain leak. The roof drain leak has since been repaired.

- The main supply storage area was observed with numerous personal packs/rucksacks, scattered within the storage area, limiting free access within the space.

- No boiler chemical treatment program was currently implemented.

- A small section of paint was found delaminated at the women's restroom, due to a prior-leaking roof drain. The roof drain has since been repaired.

- The parachute room (former firing range) did not have any evidence of prior firing range use, and was completely renovated.

- Live and dead insects were observed at various facility hallways and areas. Mouse droppings were found atop storage cabinets in the parachute space. The caretaker indicates that no pest control program is implemented; no support is provided for a pest control program.

- No maintenance garage was present; however, due to sealed concrete floor, vehicular traffic may be brought into the drill hall, perhaps during drill weekends for loading purposes. Idling vehicles with inadequate exhaust may contribute to build-up of exhaust emissions and CO within the building.

<u>Security</u>

- Facility security may be limited. The front door is propped open during summer months. The boiler room was found unlocked.

<u>Other Ventilation</u>

- The exhaust fans were found non-functional in the men's room locker area.

<u>EH&S Compliance & Support</u>

- Caretaker is provided cleaning chemicals and agents by order, through the Pikesville Armory; however, the caretaker may not be provided adequate functional materials needed, or limited quantities, leading to need for localized purchase of chemical products or materials. Material safety data sheets are not secured during these purchases.

- Current, up-to-date MSDS are not maintained on-site for chemical products used. Caretaker utilizes personal protection only to extent that such protection is voluntarily used (i.e. hearing

protectors or glove protection may be used during chemical use, though no particular glove types were specified for certain jobs).

- The average illuminance levels in several areas throughout the shop were below the recommended values. Although the lower-than-recommended lighting levels are not expected to present an imminent hazard, safety and ergonomic improvements could result from enhanced lighting in these areas.

- A separate flammable storage room was found located with outdoor access from the vehicle storage lot. The flammable storage room is used for other storage at present.

- An outdoor portable truck wash/recycling system was observed on-site, in addition to other hazardous material storage. System maintenance is managed by off-site personnel, and is not monitored by on-site personnel.

1.4 Recommendations

IES' recommendations resulting from this assessment, including the determination of the Risk Assessment Codes (RACs) exposures, are included in a separate document entitled, "Fort Ritchie_RC_08_Recommendations."

2.0 OPERATION DESCRIPTION

INSTALLATION: RC Army National Guard
BUILDING: 13817 Ritchie Road, Cascade, Maryland, 21719
LOCATION: Facility-wide

2.1 General Description and Condition

OPERATION DESCRIPTION: No vehicle maintenance function is provided at the Fort Ritchie RC. The operations performed at this site are described in Section 1.2, Facility Description.

2.2 Specific Site Survey and Conditions

Various RC personnel provided assistance to Mr. [redacted], Senior Project Manager of IES during and subsequent to the survey period, as coordinated by SSG [redacted], Administrative Supervisor, of the Ft. Ritchie RC.

CHEMICAL AND PHYSICAL AGENTS SAMPLED: During the assessment, two personal samples for airborne lead were collected. All sample results were reported less than the adjusted OSHA Permissible Exposure Limit, time-weighted average (PEL-TWA) standard of 40 $\mu g/m^3$ for a 10-hour work shift. 15 surface wipe samples were collected throughout the facility, at specified or suspect areas. None of the surfaces sampled were found to have contaminant levels exceeding the 200 $\mu g/ft^2$ reference level for housekeeping.

Facility paint was generally found in good condition. One bulk sample collected from peeling paint in the Women's locker room was not considered lead-based paint. No presumed asbestos containing materials (PACM) were identified during the assessment.

General IAQ measurements (relative humidity, carbon dioxide, carbon monoxide and temperature) were made throughout the RC facility at 18 point locations. Refer to report sections 1.3 – Key Findings and Conclusions, and 3.0 – Sample Results and Measurements for details.

VENTILATION/ HEATING, VENTILATING & AIR-CONDITIONING (HVAC) SYSTEMS: Heating, ventilation and air-conditioning (HVAC) service is achieved through various methods at the Fort Ritchie RC. Heating is achieved primarily by hot water boiler/circulating hot water heat delivered to perimeter unit ventilators, ceiling mounted space heaters (drill room and supply storage), and to roof-mounted package heating units (hallways, kitchen/dining facility, lockers). Separate package HVAC units are located within the supply storage area, serving the administrative offices, team offices and supply storage areas; however, cooling systems were found to be fouled or non-functional in these areas. Cooling is also achieved primarily by four perimeter unit ventilators located in the administrative offices section. An additional five unit ventilators are located within the area of caretakers office, exercise room and dining facility; however, these units do not properly operate in the cooling mode, and provide heating only. Other facility areas are cooled by natural

ventilation (open doors and windows), or exhaust fans located within the drill room, kitchen, and locker rooms. A separate, fully-functional HVAC system is installed in the parachute room, which provides cooling. During the cooling season (summer months), natural ventilation is used throughout most of the facility.

LIGHTING: The average luminance levels were collected throughout the facility, with certain locations found with illuminance levels less than ARNG recommended standards. Refer to Section 3.2 for a summary of the lighting measurements, and for identification of the deficient lighting levels.

WATER DAMAGE: Ceiling tiles were observed to be warped in team office and general hall areas (indication of excess moisture absorption); however, musty odor or visible mold growth was not readily observed during the survey. The exercise room was found to contain carpet on slab, with wall to wall rubber mat on carpet. This condition may lead to microbial growth, particularly during summer conditions with high relative humidity, or ineffective air exchange. General musty odor was present in the room, in addition to rubber odor. No cleaning/disinfection program was noted for the exercise equipment. Facility paint was found in good condition with the exception of a small section of delaminated paint located in the Women's locker, due to a roof drain leak. The roof drain leak has since been repaired.

HOUSEKEEPING: Live and dead insects were observed at various facility hallways and areas. Mouse droppings were found atop storage cabinets in the parachute space. The caretaker indicates that no pest control program is implemented; no support is provided for a pest control program. Current MSDSs were not found readily accessible on-site for the Caretaker and within readiness center operations.

ERGONOMICS: No inherent ergonomic hazards were noted during the survey.

A copy of IES' field notes from this assessment is included in a separate document entitled, "Ft. Ritchie_RC_08_Field_Notes." Please also refer to the determination of the Risk Assessment Code (RAC) for occupational exposures, included in the separate document entitled, "Ft. Ritchie _RC_08_Recommendations."

3.0 SAMPLE RESULTS AND MEASUREMENTS

3.1 Air Sampling

3.1.1 Indoor Air Quality

Measurements of air temperature, relative humidity, carbon dioxide (CO_2), and carbon monoxide (CO) concentrations were collected using a calibrated direct reading hand-held TSI Q-Trak indoor air quality monitoring instrument. The carbon monoxide sample results were compared with the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Values

(TLVs) for exposure assessment purposes. TLVs are established through a peer review process, and are published annually in ACGIH's *TLVs and BEIs* booklet. The TLV's represent airborne exposure concentrations and conditions under which it is believed that nearly all workers may be repeatedly exposed day after day without adverse health effects. Due to wide variations in individual susceptibility, a small percentage of workers may experience discomfort or be affected by certain substances at concentrations below the recommended threshold limit.[1]

Refer to Table 1 below for details of measured air temperature, relative humidity, CO_2, and CO collected throughout the building during the assessment.

Refer to Appendix B - Indoor Air Quality Sample Location Maps for the IAQ measurement locations throughout the facility.

TABLE 1
AIR TEMPERATURE, RELATIVE HUMIDITY, CO_2, AND CO MEASUREMENTS

Location: Ft. Ritchie National Guard RC (Edgar Boyd Armory), Cascade, Maryland
Date: July 16, 2008

Sample Location ID	Sample Location/Description	Sample Time	CO_2 (ppm)	CO (ppm)	Temperature (°F)	Relative Humidity (%RH)
Q1	**Outdoors (A.M.)** – Entry sidewalk to Armory	0930	350	1.1	84	48
Q2	**Operations Room** – Central Area, occupied	0940	640*	0.4	81	43.3
Q3	**Team Equip Storage** – Locker area	1025	485	0.0	77	60***
Q4	**Storage, Aisle** – Adjacent to Team Equip. Storage	1030	470	0.4	77	52
Q5	**Caretaker's Office** – Central, occupied	1040	804*	0.6	78	51
Q6	**Exercise Room** – Central	1045	410	0.9	76	53
Q7	**Electrical Room** – Central	1050	381	0.8	78	44
Q8	**Dining facility** – Central	1055	455	0.1	77	45
Q9	**Parachute Room,** near HVAC unit	1100	373	0.4	74	40
Q10	**Drill Room** – Central	1115	463	0.0	77	45
Q11	**Storage, Aisle** - Adjacent to Team Equip. Storage	1130	405	0.3	78	42
Q12	**Boiler Room** - Central	1145	450	0.5	81	43
Q13	**Roof,** near access from Elec. Room	1330	414	1.3	93	25**
Q14	**Caretaker's Office** - Central	1630	476	0.4	78	51
Q15	**Dining facility** – Central	1640	410	0.9	76	53
Q16	**Parachute Room** – Central	1650	388	0.7	77	42
Q17	**Drill Room** - Central	1700	394	0.6	78	48
Q18	**Orderly Room** – Central, occupied	1710	653	0.1	77	54

Notes: *Carbon dioxide readings are likely influenced by exhalation of surveyor.
** Radiant heat from roof likely to reduce relative humidity in survey area.
*** Relative humidity levels exceeding 60% may contribute to bioaerosol amplification.

TABLE FOOTNOTES

Measurement device: All measurements collected in real-time using a TSI Q-Trak indoor air quality monitor, at approximately 4 feet above ground/floor height.

ppm Parts per million contaminant in air. All CO_2 and CO concentrations expressed in ppm.

Exposure Guidelines

CO_2	Indoor CO_2 concentrations should be maintained at less than 700 ppm above outdoor air levels – (ASHRAE 62.1-2007)[2]
CO	50 ppm (OSHA PEL-TWA); 25 ppm (ACGIH TLV-TWA)
Temperature	68 ºF to 79 ºF (ASHRAE 55-2004)[3]
Relative Humidity	30% to 60% (ASHRAE 55-2004)[3]

3.1.2 Airborne Lead Sampling

Air sampling and analysis for lead were conducted with reference to the National Institute for Occupational Safety and Health (NIOSH) Method 7903 – Elements, by Ion Chromatography (IC).

Air samples were collected using constant flow, personal air sampling pumps on closed face 37-mm (0.8-µm pore size) mixed cellulose ester (MCE) membrane filters mounted in two-piece cassettes. All sampling pumps were calibrated before and after the sampling period with media in-line, using a primary gas flow standard per method requirements. Following the survey, the air samples and a field blanks were collected and shipped via overnight courier to AMA Analytical Services, Inc (AMA) in Lanham, Maryland, which is accredited by the American Industrial Hygiene Association (AIHA) for lead analysis. All air sample results were reported in micrograms of lead cubic meters of air sample ($\mu g/m^3$) for comparison with applicable standards of this assessment.

A summary of analysis results are presented in Table 2 below.

Refer to Appendix C for the complete laboratory analysis results. Worksite Sampling Data Records are included in a separate document entitled, "Ft. Ritchie_RC_08_Medical."

TABLE 2
AIRBORNE LEAD SAMPLING RESULTS SUMMARY

Location: Ft. Ritchie National Guard RC (Edgar Boyd Armory), Cascade, Maryland
Date: July 16, 2008

Sample ID	Equipment ID	Sample Description	Start Time	End Time	Sample Time (Minutes)	Flow Rate (lpm)	Air Volume (L)	Lead Sample Result (mg/m3)
FR-01	IES-105	SSG [redacted] – Personal Breathing Zone Sample; during routine administrative duties within the Ft. Ritchie Armory.	0825 1400	1201 1700	396	1.99	788	<0.0038
FR-02	IES-BFE-1272-96	SSG [redacted] – Personal Breathing Zone Sample, During routine administrative duties within the Ft. Ritchie Armory.	0827	1202	216*	1.97	425	<0.0071

* SSG Deprenda left the facility at 1200 hours for other detail and/or personal business.

TABLE FOOTNOTES

Measurement device: MSA ELF Escort constant flow air sampling pump, with 37mm, 0.8-µm MCE filter media
Mg/m3 Milligrams per cubic meter air. Sample results expressed in milligrams contaminant per cubic meter of air.

Occupational Exposure Limits	OSHA Permissible Exposure Limit, 8-hour time-weighted average (PEL-TWA) = 0.05 mg/m^3; OSHA Action Limit-TWA = 0.03 mg/m^3 **NOTE: Due to workshift duration of 10 hours, all sample results must be interpreted in relation to an adjusted OSHA PEL-TWA of 40 µg/m^3.** Refer to the OSHA Lead Standard at 29 CFR 1910.1025 for details of the OSHA compliance requirements. ACGIH TLV-TWA= 0.05 mg/m^3

Refer to Section 5.0, Equipment and Calibration Data, for calibration data of equipment used during this assessment.

3.2 Lead Dust and Bulk Sampling

IES performed wipe sampling in the Drill Hall, Parachute Room (prior firing range), and in select areas throughout the facility, per the National Guard Bureau – Statement of Work requirements for Industrial Hygiene Services. All wipe sampling was performed in accordance with: best Industrial Hygiene practices and the guidelines published in Section II: Chapter 2, Sampling for Surface Contamination, of the OSHA Technical Manual. The wipe samples were collected over 100 square centimeter areas using pre-wetted Ghost Wipes (Environmental Express). The wipe samples collected as a part of this assessment, along with appropriate field blanks, were shipped to AMA for analysis and were analyzed using the NIOSH 7082 flame atomic absorption spectrophotometer (FAAS) method. All wipe sample results were reported in micrograms of lead per square foot of surface sampled (µg/ft^2) for the purposes of this assessment, and for subsequent comparison with OSHA guideline criteria of 200 µg/ft^2.

One bulk sample was collected from a portion of the delaminated paint located in the Women's locker room. This paint sample was determined to be not lead based paint.

A summary of analysis results are presented in Table 3 below. Refer to Appendix C for the complete laboratory analysis results.

BEST AVAILABLE COPY

ENGINEERS

TABLE 3 – WIPE/BULK SAMPLE RESULTS SUMMARY

Location: Ft. Ritchie National Guard RC (Edgar Boyd Armory), Cascade, Maryland
Date: July 16, 2008

Sample ID	Location	Surface Area Sampled	Lead Surface Concentration ($\mu g/ft^2$)
FR-W01	**Supply Room HVAC unit,** evaporator side of drain pan	100 cm^2	110
FR-W02	**Supply Room HVAC unit,** bulk dust from filter	Bulk	590 mg/kg, <1%
FR-W03	**Supply Room HVAC unit,** condenser side cooling coil	Bulk	100 mg/kg, <1%
FR-W05	**Roof**, abandoned exhaust vent (old firing range)	100 cm^2	< 110
FR-W06	**Executive Officer's office** (Rm 115), top of door frame	100 cm^2	< 110
FR-W07	**Administrative Office**, top of pipe cover to unit ventilator	100 cm^2	< 110
FR-W08	**Team Briefing Room** (Rm 108), supply vent from non-functional HVAC in supply storage	100 cm^2	< 110
FR-W09	**Armory Entry Lobby**, top of hot water heat/floor radiator cover	100 cm^2	< 110
FR-W10	**Exercise Room**, return side intake of unit ventilator	100 cm^2	< 110
FR-W11	**Dining facility**, supply vent ribs of unit ventilator	100 cm^2	< 110
FR-W12	**Kitchen**, ceiling supply vent composite	100 cm^2	< 110
FR-W13	**Parachute Packing Room** (Old Firing Range), HVAC return vent opening	100 cm^2	130
FR-W14	**Parachute Packing Room** (Old Firing Range), top of storage cabinet, HVAC end	100 cm^2	< 110
FR-W15	**Drill Room**, top of emergency light, wall separating Parachute Packing Room	100 cm^2	< 110
FR-W16	**Drill Room**, chair storage room, door vent	100 cm^2	130*
FR-W17	**Drill Room**, top of personnel lockers (composite), nearest wall separating supply storage	100 cm^2	140*
FR-W18	**Supply Storage Area**, top of fluorescent light fixture, central aisleway	100 cm^2	< 110
FR-W19	**Orderly Room** (Administrative Office Block), ceiling supply vent composite	100 cm^2	< 110

BULK SAMPLE ANALYSIS RESULTS (%Pb)

FR-W04	**Women's RR/Locker**, peeling paint @ previous roof drain leak	chip	< 1% Pb

* Trace contamination likely due to military personnel bringing lead contamination into building from outdoors, and/or stored on equipment

TABLE FOOTNOTES

Collection procedure: Wipe sample collected with nitrile glove donned on hand, using "Ghost Wipe" towlette, by sequential wipe using template or best estimate of 100 cm^2 area; multiple passes with clean surface of wipe and subsequent folding, and placement to a labeled, sealed plastic vial or bag.

ug/ft2: Micrograms lead per square foot. Note: laboratory converts result from ug/100 cm2 to ug/ft2, prior to reporting.

< 1% Pb Less than 1% lead detected in sample results.

OSHA guideline standard for surface contamination by lead The USDOL/OSHA does not have a promulgated standard for lead surface contamination; however, OSHA has provided an interpretive level of 200 ug/ft^2 to assess the housekeeping requirement of "as free as reasonably practicable". This interpretation is presented in OSHA Industrial Hygiene Technical Manual (TED 01-00-0150; 1/20/1999), and in a letter of interpretation dated 01/13/2003, and subsequently issued into public domain.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #U-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

ENGINEERS

3.3 Illuminance Survey

The illumination survey was performed pursuant to best Industrial Hygiene practices and the guidelines found in the ARNG document entitled, "Evaluation of Lighting Standing Operating Procedure (SOP) and Illumination Requirements for Existing Facilities," dated November 17, 2007.[4] All measurements were made in slow response mode and were expressed in foot candles (fc). The measurements were used to calculate average illuminance levels for each workspace.

Based on the activities conducted in each workspace, the calculated average illuminance level was compared to the ARNG recommended illuminance values.

A table of illuminance measurements is presented in Table 4 below. The data reported in this table represent the average illuminance readings from the accessible locations of the commonly occupied work areas of the facility.

Refer to Appendix D – Illuminance Readings Map for sample locations.

TABLE 4
ILLUMINANCE READINGS SUMMARY

Location: Ft. Ritchie National Guard RC (Edgar Boyd Armory), Cascade, Maryland
Date: July 16, 2008

Sample ID	Sample Description	Average Illuminance Measurements (fc)	ARNG Recommended Illuminance Value (fc)
I1	**Orderly Room** (Administrative Office Block), central, on table	60	30-50
I2	**Sg[redacted] Office**, central, table height	25	30-50
I3	**Aisleway adjacent to Operations Rooms**, outside Room 108	12	5
I4	**Operations Briefing Room**, central	75	30-50
I5	**Team Briefing Room** (Room 108), central	47	30-50
I6	**Supply Storage Area**, aiselway outside caged storage areas	2.4	5
I7	**Main Supply Store Room**, central, table height	4	30
I8	**Caretaker's Office**, central, table height	48	30-50
I9	**Exercise Room**, central, table height	65	30
I10	**Dining facility**, central, table height	55	10
I11	**Kitchen,** central, table height, not currently used for group cooking	94	50
I12	**Electrical Room**, central, near access to roof	14	30
I13	**Parachute Packing Room** (Old Firing Range), front-HVAC end, table height	47	140 (inspect)
I14	**Drill Hall (Assembly Area)**, central, ½ overhead lighting "on"	9.3	10
I15	**Drill Hall (Assembly Area)**, central full overhead lighting "on"	12	10
I16	**Boiler Room,** central, approximate table height	24	30
I17	**Parachute Packing Room** (Old Firing Range), central–main entry, table height	15	140 (inspect)

Notes: All illuminance measurements and recommended values are expressed in foot candles (fc)

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #L15-0085 (MD)
Released by National Guard Bureau
Page 2965 of 5269

4.0 ONSITE OBSERVATIONS

A copy of IES' field notes from this assessment is included in a separate document entitled, "Fort Ritchie_RC_08_Field_Notes."

4.1 Physical Condition of RC

All building materials present within the RC were in good condition on the day of the Industrial Hygiene Assessment. IES did not find presumed asbestos-containing materials (PACM) at this facility. Generally, paint was found in good condition with exception of certain floor areas (storage room), slight delamination with Women's RR, and exterior vehicle storage lot, environmental storage buildings. IES observed one small section of ceiling in the Operations area hall, with apparent mold staining associated with a prior repaired roof leak.

Separately, the condenser side cooling coils of the HVAC equipment located in the supply storage room, nearest Supply Seargent's Office was found in fouled condition. This condition should be corrected prior to returning the HVAC equipment to service.

4.2 Housekeeping

Housekeeping within the facility was found generally good. IES observed no imminent slip, trip and fall hazards on the day of the assessment, with the exception of findings previously noted for the main supply storage room. All walking surfaces were clear of hazards and objects above the head were secured safely to the wall or columns to reduce the risk of head injuries.

Outdoor environmental storage locations were observed; however, site personnel are not assigned responsibility to observe or maintain condition.

4.3 Ergonomics

No observations of work practices with inherent ergonomic hazards were noted during the survey; however, certain postural/work conditions may be anticipated in the parachute packing/repair operations. These operations are conducted primarily during or associated with drill weekends.

5.0 EQUIPMENT AND CALIBRATION DATA

5.1 Sampling Equipment List

Table 5 lists the sampling equipment that was used as a part of the assessment.

TABLE 5
SAMPLING EQUIPMENT LIST

Equipment Type	Make/Model	Equipment/Serial Number	Equipment Identification
Personal Sampling Pump	MSA Escort ELF	IES-105	IES-105
Personal Sampling Pump	MSA Escort ELF	BFE-1272-96	IES-BFE-1272-96
Bios Dry Cal Calibrator	Bios DCL-MH	101784	101784
Light Meter	International Light, IL1400A, illum. probe	3206/1782	R2373/3691
Indoor Air Quality Monitor	TSI Model 8554 Q-Trak	02071015	R10120
Velocity Meter	TSI Velocicheck, 8340	00100195	00100195

5.2 Sampling Equipment Calibration Data

Table 6 details the calibration data for each piece of sampling equipment used during the assessment.

TABLE 6
SAMPLING EQUIPMENT CALIBRATION DATA

Equipment ID	Calibrator Used	Date of Pre-Sampling Calibration	Pre-Sampling Calibration Value (lpm)	Date of Post-Sampling Calibration	Post-Sampling Calibration Value (lpm)	Average Calibration Value (lpm)
IES-105	101784	7/16/08	2.02	7/16/08	1.96	1.99
IES-BFE-1272-96	101784	7/16/08	1.98	7/16/08	1.96	1.97

6.0 REFERENCES

1. ACGIH, *2008 TLVs and BEIs*.
2. American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE), Standard 62-2007, "Ventilation for Acceptable Indoor Air Quality," ASHRAE, Atlanta, Georgia, 2004.
3. American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE), Standard 55-2004, "Thermal Environmental Conditions for Human Occupancy," ASHRAE, Atlanta, Georgia, 2004.
4. "Evaluation of Lighting Standing Operating Procedure (SOP) and Illumination Requirements for Existing Facilities," ARNG, 17 November 2007.
5. Occupational Safety and Health Administration, 29 CFR 1910.1025, Lead.

BEST AVAILABLE COPY

APPENDIX A

READINESS CENTER PHOTOGRAPHS

Photograph #1 – RC General Construction Features, Indoors,
on careful inspection-ceiling tile warpage due to ambient humidity

Photograph #2 – RC Dining facility Unit Ventilator

Photograph #3 – Parachute Packing Room (Converted Firing Range)

Photograph #4 – Parachute Packing Room, new HVAC system

Photograph #5 – Minor Paint Delamination in Women's RR, prior roof drain leak

Photograph #6 – Exercise Room, rubber mat on carpet

Photograph #7 – Prior Roof Drain Leak – Operations Area

Photograph #8 – Supply Storage Room, ineffective storage-housekeeping

Photograph #9 – Supply Storage Area, inaccessible HVAC equipment

Photograph #10 – Package Unit on Build-up Roof

Photographs #11,12 – Prolific wasp nests in HVAC access panels & Kitchen exhaust ventilators

Photograph #13 – Vehicle Storage Lot, wash recycle system

Photograph #14 – Vehicle Storage Lot, Environmental Storage, Flammable Storage Room at main building to right, used also for mower/equipment storage

Photographs #15,16 – Boiler Rm, boiler and hot water heater

APPENDIX B

INDOOR AIR QUALITY MAP

INDUSTRIAL HYGIENE SURVEY
FT RITCHIE READINESS CENTER (NGB)
CASCADE, MD

JULY 16 2008

INDOOR AIR QUALITY + VENTILATION MEASUREMENT LOCATIONS

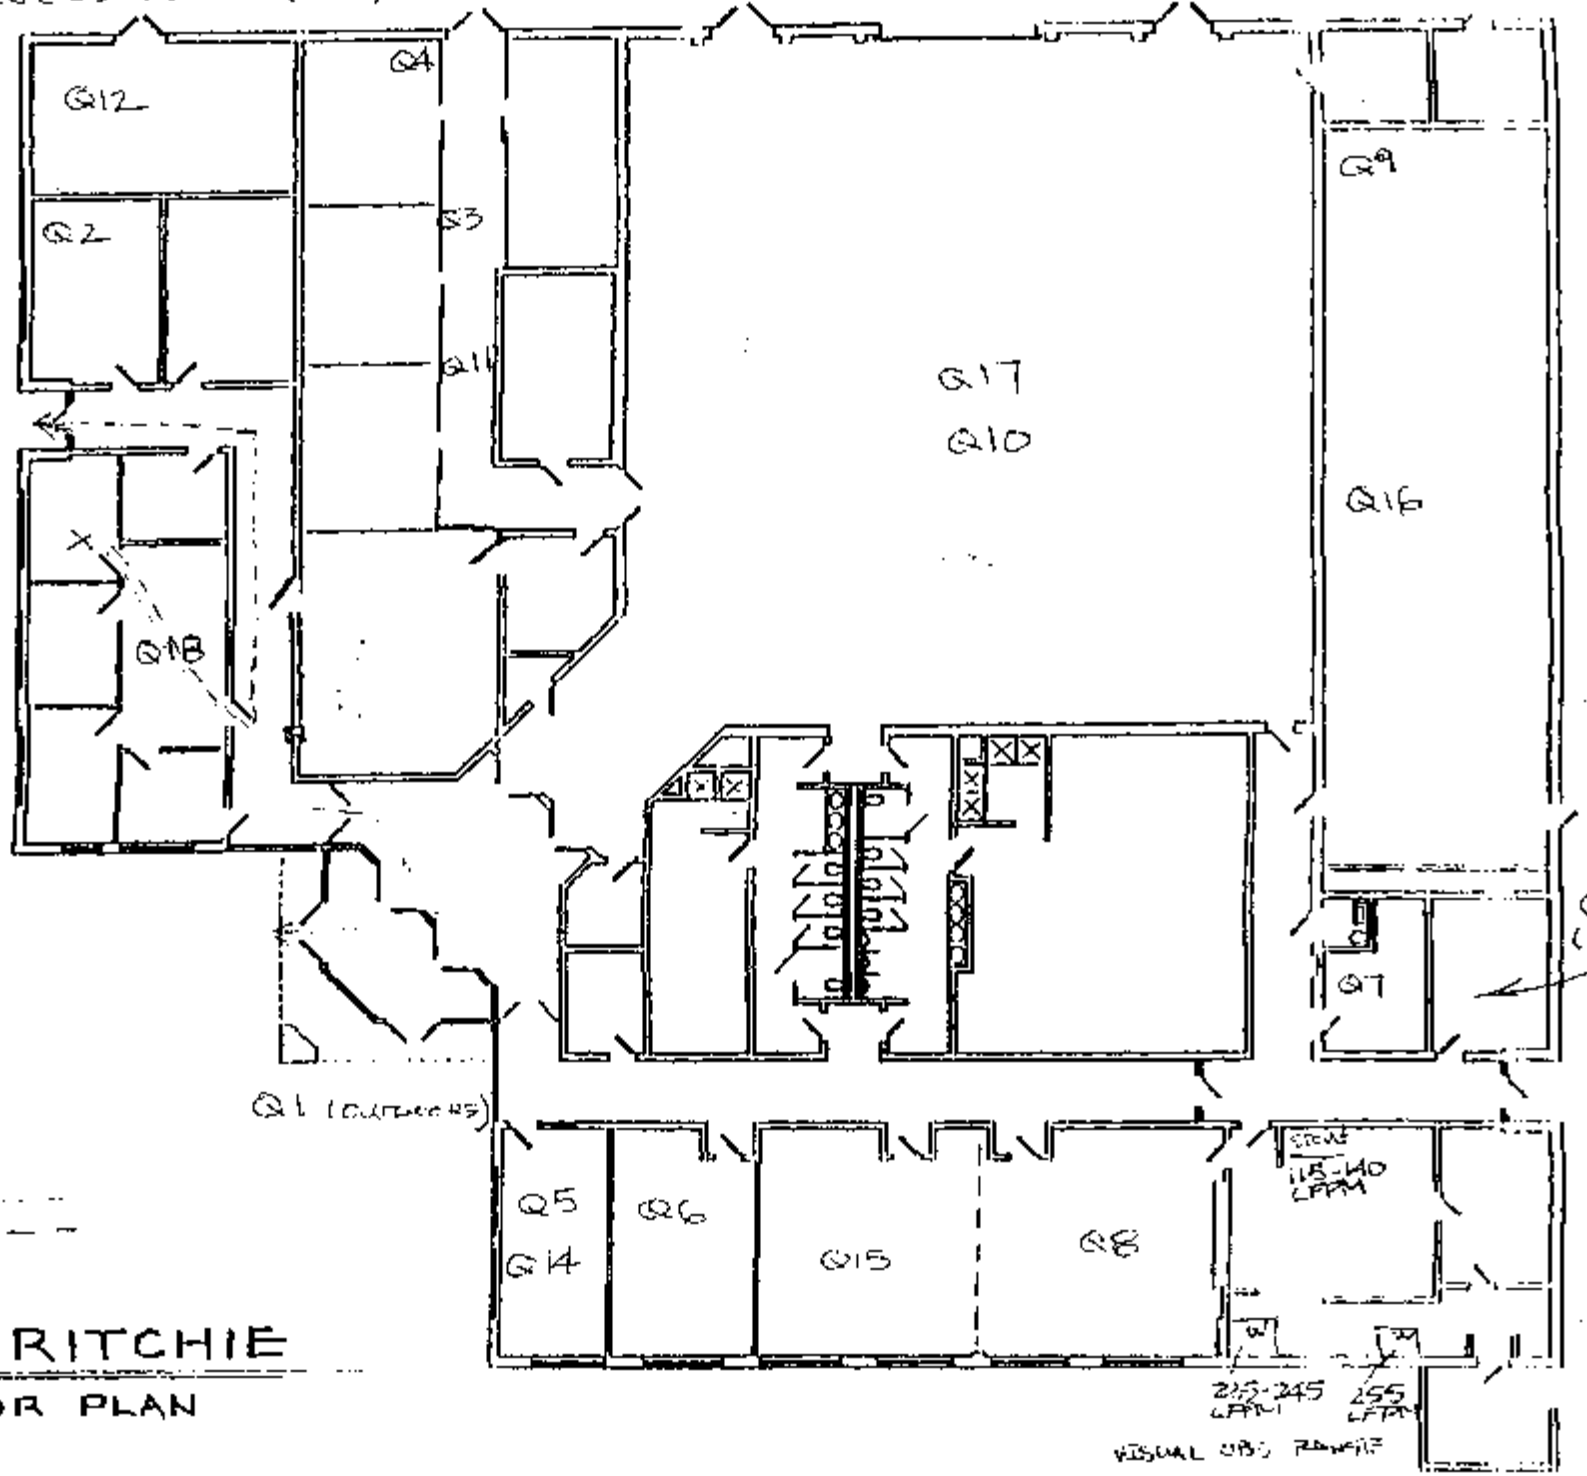

Your Location X
Primary Route - - - - -
Alternate Route — — —

FORT RITCHIE

FLOOR PLAN

EVACUATION PLAN

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2978 of 5269
Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

APPENDIX C

LABORATORY ANALYSIS RESULTS

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaelap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	National Guard Bureau	**Chain Of Custody:**	503036		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	8/7/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	EHS 08794.02	**Person Submitting:**	[redacted] Non-Responsive		
		P.O. Number:	Not Provided	**Date Analyzed:**	8/11/2008	**Report Date:**	8/11/2008

Attention: [redacted] Non-Responsive

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result		Comments
0875728	FR-W01	Flame	Wipe	****	0.108	111.52	ug/ft²	110	ug/ft²	
0875729	FR-W02	Flame	Soil/Solid	****	N/A	201.34	mg/Kg	590	mg/Kg	Insufficient sample was submitted to meet recommended reporting limits.
0875730	FR-W03	Flame	Soil/Solid	****	N/A	30.76	mg/Kg	100	mg/Kg	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2980 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To T. Number For Inquir **503036**

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location:
3. Job #: EHS 08794.02 P.O. #:
4. Contact Pe[redacted] Non-Responsive
5. Submitted [redacted] Non-Responsive 8

Reporting Information (Results will be provided as soon as technically feasible[redacted]ERS

AFTER HOURS (must be pre-scheduled)
- ☐ Immediate Date Due:
- ☐ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ☐ Immediate
- ☐ Next Day
- ☐ 2 Day
- ☐ 3 Day
- ☒ 5 Day
- Date Due: 8/14/08
- ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
- ☒ Includ[redacted] Non-Responsive with Report
- ☒ Emai[redacted] @iesengineers.com
- ☐ Fax:
- ☐ Verbals:

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
- ☒ Paint Chip ____ (QTY)
- ☒ Dust Wipe (wipe type 100 cm²) 1 (QTY)
- ☐ Air ____ (QTY)
- ☐ Soil/Solid Bulk (QTY)
- ☐ TCLP ____ (QTY)
- ☐ Drinking Water ____ (QTY)
- ☐ Waste Water ____ (QTY)
- ☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
- ☐ Spore Trap ____ (QTY) ☐ Bulk ____ (QTY)
- ☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
FR-W01	HVAC S1 EVAP			100 cm²				✓				✓				
FR-W02	HVAC S1 FILT							✓			✓					
FR-W03	HVAC S2 COND			100 cm²				✓			✓	✗				

This sample is a bulk material

7/16/08

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: 8/8/8 Contact: TH Derr By: GEL
FR-W03 - is a bulk sample
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 8/07/08 0950 Via: Fed Ex By (Print): Chris Nicodemus Sign: Chris Nicodemus
2. Date/Time Analyzed: ___/___/___ @ ___ By (Print): ___ Sign:
3. Results Reported To: ___ Via: ___ Date: ___/___/___ Time: ___ Initials:
4. Comments:

LAB CONTACT: [redacted] Non-Responsive / AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaelap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	National Guard Bureau	**Chain Of Custody:**	503036		
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	8/7/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	EHS 08794.02	**Person Submitting:**	Non-Responsive [redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	8/11/2008	**Report Date:**	8/11/2008

Attention: Non-Responsive [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result		Comments
0875728	FR-W01	Flame	Wipe	****	0.108	111.52	ug/ft²	110	ug/ft²	
0875729	FR-W02	Flame	Soil/Solid	****	N/A	201.34	mg/Kg	590	mg/Kg	Insufficient sample was submitted to meet recommended reporting limits.
0875730	FR-W03	Flame	Soil/Solid	****	N/A	30.76	mg/Kg	100	mg/Kg	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2982 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To T. Number For Inquir **503036**

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location:
3. Job #: EHS 08794.02 P.O. #:
4. Contact Pe[redacted] Non-Responsive
5. Submitted [redacted] Non-Responsive 8

Reporting Information (Results will be provided as soon as technically feasible[redacted]ERS

AFTER HOURS (must be pre-scheduled)
- ☐ Immediate Date Due:
- ☐ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ☐ Immediate
- ☐ Next Day
- ☐ 2 Day
- ☐ 3 Day
- ☒ 5 Day
- Date Due: 8/14/08
- ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
- ☒ Inclu[redacted]s with Report
- ☒ Emai[redacted] Non-Responsive @iesengineers.com
- ☐ Fax:
- ☐ Verbals:

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
- ☐ Paint Chip ____ (QTY)
- ☒ Dust Wipe (wipe type 100 cm²) 1 (QTY)
- ☐ Air ____ (QTY)
- ☐ Soil/Solid Bulk (QTY)
- ☐ TCLP ____ (QTY)
- ☐ Drinking Water ____ (QTY)
- ☐ Waste Water ____ (QTY)
- ☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
- ☐ Spore Trap ____ (QTY) ☐ Bulk ____ (QTY)
- ☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
FR-W01	HVAC S1 EVAP			100 cm²				✓				✓				
FR-W02	HVAC S1 FILT							✓			✓					
FR-W03	HVAC S2 COND			100 cm²				✓			✓	✗				

This sample is a bulk material

7/16/08

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: 8/8/8 Contact: TH Derr By: GEL
FR-W03 - is a bulk sample
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 8/07/08 0950 Via: Fed Ex By (Print): Chris Nicodemo Sign: Chris Nicodemo
2. Date/Time Analyzed: ___/___/___ @ ___ By (Print): ___ Sign:
3. Results Reported To: ___ Via: ___ Date: ___/___/___ Time: ___ Initials:
4. Comments:

LAB CONTACT: [redacted] Non-Responsive / AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	Natl Guard Bureau	**Chain Of Custody:**	503007
Address:	301-IH Old Bay Lane, Attn: NGB-AVNSI, State Military Reservation	**Job Location:**	Ft. Richie MD	**Date Submitted:**	7/31/2008
	Havre de Grace, Maryland 21078	**Job Number:**	EHS 08794.02	**Person Submitting:**	Non-Responsive [redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	8/1/2008 **Report Date:** 8/1/2008
Attention:	Non-Responsive [redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0874216	FR-01	Flame	Air	788	N/A	3.81	ug/m³	<	3.8	ug/m³	
0874217	FR-02	Flame	Air	424	N/A	7.08	ug/m³	<	7.1	ug/m³	
0874218	FR-03	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0874219	FR-W04(Paint)	Flame	Paint Chip	****	N/A	0.01	%Pb	<	0.01	%Pb	
0874220	FR-W05	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874221	FR-W06	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874222	FR-W07	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874223	FR-W08	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874224	FR-W09	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874225	FR-W10	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874226	FR-W11	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874227	FR-W12	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874228	FR-W13	Flame	Wipe	****	0.108	111.52	ug/ft²		130	ug/ft²	
0874229	FR-W14	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874230	FR-W15	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874231	FR-W16	Flame	Wipe	****	0.108	111.52	ug/ft²		130	ug/ft²	
0874232	FR-W17	Flame	Wipe	****	0.108	111.52	ug/ft²		140	ug/ft²	
0874233	FR-W18	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0874234	FR-W19	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that itis not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guiddines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

BEST AVAILABLE COPY

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihalqap.org for details

100470

NY ELAP

10920

Client:	National Guard Bureau	**Job Name:**	Natl Guard Bureau	**Chain Of Custody:**	503007		
Address:	301-JH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Ft. Richie MD	**Date Submitted:**	7/31/2008		
	Havre de Grace, Maryland 21078	**Job Number:**	EHS 08794.02	**Person Submitting:**	Non-Responsive [redacted]		
		P.O. Number:	Not Provided	**Date Analyzed:**	8/1/2008	**Report Date:**	8/1/2008

Attention: Non-Responsive [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson

Technical Manager: G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guiddines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-7643

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2985 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To Number For Inqui **503007**

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location: FT. RITCHIE MD
3. Job #: EHS 08794.02 P.O. #:
4. Contact Pers[redacted] @ phone # 610 828-3078
5. Submitted b[redacted]

Non-Responsive

Non-Responsive

Reporting Information (Results will be provide[redacted]ble): [redacted]GINEERS

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due:	☐ Immediate ☐ 3 Day	☐ Incl[redacted]heets with Report
☐ 24 Hours Time Due:	☐ Next Day ☑ 5 Day +	☐ Ema[redacted] @ ieseugineers.com
Comments:	☐ 2 Day Date Due:	☐ Fax:
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals:

Non-Responsive

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ NIOSH 7400 ____ (QTY)
☐ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
☐ AHERA ____ (QTY)
☐ NIOSH 7402 ____ (QTY)
☐ Other (specify ____) ____ (QTY)
PLM Bulk
☐ EPA 600 – Visual Estimate ____ (QTY)
☐ EPA Point Count ____ (QTY)
☐ NY State Friable 198.1 ____ (QTY)
☐ Grav. Reduction ELAP 198.6 ____ (QTY)
☐ Other (specify ____) ____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield ____ (QTY)
☐ NY State PLM/TEM ____ (QTY)
☐ Residual Ash ____ (QTY)
TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
☐ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
☐ Qual. (pres/abs) ____ (QTY)
☐ ELAP 198.2/EPA 100.2 ____ (QTY)
☐ EPA 100.1 ____ (QTY)

☒ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Lead Analysis
☒ Paint Chip 1 (QTY)
☒ Dust Wipe (wipe type ____) 15 (QTY)
☒ Air 3 (QTY)
☐ Soil/Solid ____ (QTY)
☐ TCLP ____ (QTY)
☐ Drinking Water ____ (QTY)
☐ Waste Water ____ (QTY)
☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap ____ (QTY) ☐ Bulk ____ (QTY)
☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
FR-01	Boncella	7/16/08	788					✓		✓						
FR-02	Deprenda	7/16/08	424					✓		✓						
FR-03	F/Blank	7/16/08	—					✓		✓						

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 7 / 29 / 08 @930 Via: Fed Ex By (Print): Chris Nicodemus Sign: Chris Nicodemus
2. Date/Time Analyzed: ___ / ___ / ___ @ ___ By (Print): ___ Sign: ___
3. Results Reported To: ___ Via: ___ Date: ___ / ___ / ___ Time: ___ Initials: ___
4. Comments: ___

LAB CONTACT > Non-Responsive /AMA ANALYTICAL SERVICES, INC.

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

BEST AVAILABLE COPY

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) 503007

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: Fax #:

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location:
3. Job #: EHS 08794.02 P.O. #:
4. Contact Perso[redacted] 610 828-3078
5. Submitted by [redacted] INEERS

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
❑ Immediate Date Due: ❑ 24 Hours Time Due: Comments:	❑ Immediate ❑ 3 Day ❑ Next Day ❑ 5 Day + ❑ 2 Day Date Due: ❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	❑ Include COC/Field Data Sheets with Report ❑ Email: @ ❑ Fax: ❑ Verbals:

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)
TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area) Dust D6480-99 ____ (QTY)
TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

❑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Lead Analysis
❑ Paint Chip ____ (QTY)
❑ Dust Wipe (wipe type ____) ____ (QTY)
❑ Air ____ (QTY)
❑ Soil/Solid ____ (QTY)
❑ TCLP ____ (QTY)
❑ Drinking Water ____ (QTY)
❑ Waste Water ____ (QTY)
❑ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
❑ Spore-Trap ____ (QTY) ❑ Bulk ____ (QTY)
❑ Surface Swab ____ (QTY) ❑ Surface Vacuum Dust ____ (QTY)
❑ Surface Tape ____ (QTY) ❑ Other (Specify ____) ____ (QTY)

Sample Not

OFR/ ROOF EXH VENT

CLIENT ID NUMBER	SAMPLE INFORMATION: SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	ANALYSIS: TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	MATRIX: DUST	WATER AND OTHER	WIPE LEAD	TAPE	SWAB	CLIENT CONTACT (LABORATORY STAFF ONLY)
PR-W01	HVAC S1 EVAP	↑		100cm²				✓				✓					Date/Time: Contact: By:
W02	HVAC S1 FILT											✓					
W03	HVAC S2 COND											✓					
W04	W/L RR CEILING										✓						
W05	~~OFFICE 115 TOP~~											✓					Date/Time: Contact: By:
W06	OFFICE 115											✓					
W07	ADM OFFICE											✓					
W08	RM 108 SV											✓					
W09	FOYER											✓					Date/Time: Contact: By:
W10	E/R RET UV											✓					
W11	CHOW SUV	↓		↓				↓				✓					

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ____ / ____ / ____ @ ____ Via: ____ By (Print): ____ Sign: ____
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): ____ Sign: ____
3. Results Reported To: ____ Via: ____ Date: ____ / ____ / ____ Time: ____ Initials: ____
4. Comments: ____

BEST AVAILABLE COPY

LAB CONTACT: [redacted] / AMA ANALYTICAL SERVICES, INC.

Posted to NGB FOIA Reading Room May, 2018
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

AMA Analytical Services, Inc.
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

BEST AVAILABLE COPY

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

503007

BILL THE NATIONAL GUARD BUREAU REGION NORTH IH OFFICE DIRECTLY.

Mailing/Billing Information:
1. Client Name: IES ENGINEERS
2. Address 1: 1720 WALTON RD
3. Address 2: BLUE BELL PA 19422
4. Address 3:
5. Phone #: _____ Fax #: _____

Submittal Information:
1. Job Name: NATL GUARD BUREAU
2. Job Location:
3. Job #: EHS 08794.02 P.O. #
4. Contact Pers[redacted] @ phone # 610 828-3078
5. Submitted b[redacted] Si[redacted]GINEERS

Non-Responsive

Non-Responsive

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)	NORMAL BUSINESS HOURS	REPORT TO:
☐ Immediate Date Due: _____	☐ Immediate ☐ 3 Day	☐ Include COC/Field Data Sheets with Report
☐ 24 Hours Time Due: _____	☐ Next Day ☐ 5 Day +	☐ Email: _____ @ _____
Comments: _____	☐ 2 Day Date Due: _____	☐ Fax: _____
	☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)	☐ Verbals: _____

Asbestos Analysis

PCM Air - Please Indicate Filter Type:
PC MCE Porosity _____ in a 25mm 37mm
☐ NIOSH 7400 _____ (QTY)
☐ Fiberglass _____ (QTY)

TEM Air - Please Indicate Filter Type:
PC MCE Porosity _____ in a 25mm 37mm
☐ AHERA _____ (QTY)
☐ NIOSH 7402 _____ (QTY)
☐ Other (specify _____) _____ (QTY)

PLM Bulk
☐ EPA 600 – Visual Estimate _____ (QTY)
☐ EPA Point Count _____ (QTY)
☐ NY State Friable 198.1 _____ (QTY)
☐ Grav. Reduction ELAP 198.6 _____ (QTY)
☐ Other (specify _____) _____ (QTY)

TEM Bulk
☐ ELAP 198.4/Chatfield _____ (QTY)
☐ NY State PLM/TEM _____ (QTY)
☐ Residual Ash _____ (QTY)

TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust _____ (QTY)
☐ Quan. (s/area) Vacuum D5755-95 _____ (QTY)
☐ Quan. (s/area) Dust D6480-99 _____ (QTY)

TEM Water
☐ Qual. (pres/abs) _____ (QTY)
☐ ELAP 198.2/EPA 100.2 _____ (QTY)
☐ EPA 100.1 _____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples _____ °C)

Lead Analysis
☐ Paint Chip _____ (QTY)
☐ Dust Wipe (wipe type _____) _____ (QTY)
☐ Air _____ (QTY)
☐ Soil/Solid _____ (QTY)
☐ TCLP _____ (QTY)
☐ Drinking Water _____ (QTY)
☐ Waste Water _____ (QTY)
☐ Dust Wipe Furnace (wipe type _____) _____ (QTY)

Mold - Direct Microscopic Analysis
☐ Spore-Trap _____ (QTY) ☐ Bulk _____ (QTY)
☐ Surface Swab _____ (QTY) ☐ Surface Vacuum Dust _____ (QTY)
☐ Surface Tape _____ (QTY) ☐ Other (Specify _____) _____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
FR-W12	KITCHEN SV	7/16/08		100cm²				✓				✓				
FR-W13	PACK RM RV											✓				
FR-W14	PACK RM CAB											✓				
FR-W15	DRILL RM											✓				
FR-W16	DRILL RM											✓				
FR-W17	DRILL RM											✓				
FR-W18	SST-LT TOP											✓				
FR-W19	ORDER RM SV											✓				

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time: Contact: By:

Date/Time: Contact: By:

Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: ___ / ___ / ___ @ ___ Via: _____ By (Print): _____ Sign: _____
2. Date/Time Analyzed: ___ / ___ / ___ @ ___ By (Print): _____ Sign: _____
3. Results Reported To: _____ Via: _____ Date: ___ / ___ / ___ Time: _____ Initials: _____
4. Comments:

LAB CONTACT [redacted] / AMA ANALYTICAL SERVICES, INC.

Non-Responsive

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2988 of 5269

BEST AVAILABLE COPY

APPENDIX D

ILLUMINANCE READING MAP

INDUSTRIAL HYGIENE SURVEY
FT RITCHIE HEADQUARTERS CENTER (HQB)
CASCADE, MD

JULY 16, 2008

ILLUMINATION MEASUREMENT LOCATIONS

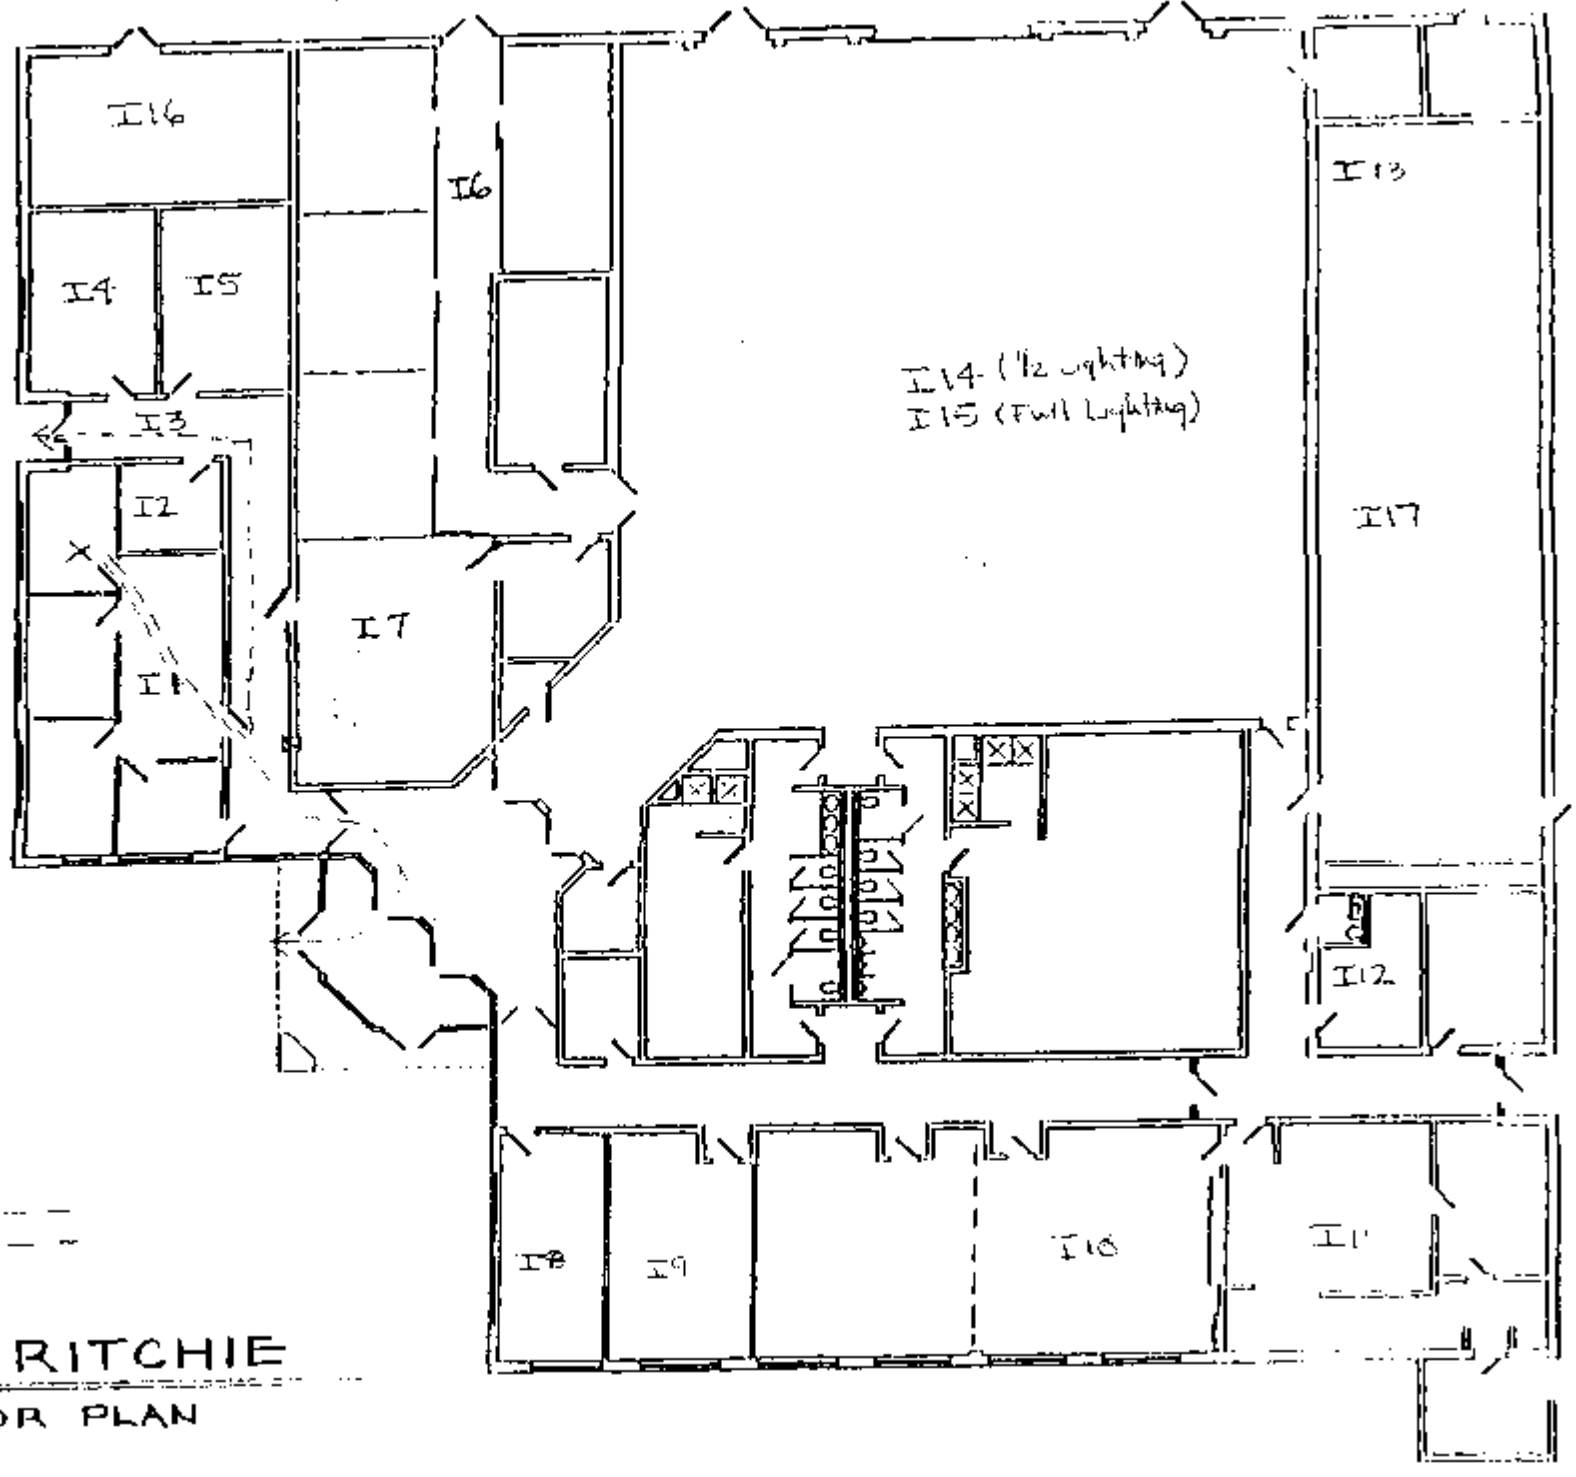

FORT RITCHIE

FLOOR PLAN

EVACUATION PLAN

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2990 of 5269
Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

National Guard Region North

National Guard Readiness Center
Industrial Hygiene Evaluation
Fort Ritchie Army National Guard Armory
Cascade, MD 21719-9645

Prepared for:

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078

Attn: Non-Responsive

Prepared by:

Bonus Environmental, LLC
P.O. Box 121
Mt. Pleasant, Michigan 48804

Project No. 1061-03
August 21, 2010

Bonus Environmental, LLC

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2991 of 5269

TABLE OF CONTENTS

1. EXECUTIVE SUMMARY 1

2. LEAD SAMPLING 2
- *2.1 Lead Wipe Sampling 2*
- *2.2 Lead Air Sampling 3*

3. PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERS 4
- *3.1 Lead Based Paint 4*
- *3.2 Presumed Asbestos Containing Materials 4*
- *3.3 Water Damage/Mold Growth 4*
- *3.4 Housekeeping 4*
- *3.5 Employee Interviews 5*
- *3.6 Indoor Air Quality 5*

4. LIGHTING SURVEY 6

5. CONCLUSION 7

BEST AVAILABLE COPY

APPENDICES

Appendix A *Shop Diagram*

Appendix B *Lead Sample Results*

Appendix C *Photographs*

Appendix D *References*

BEST AVAILABLE COPY

BEST AVAILABLE COPY

August 21, 2010
Project No. 1061-03

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078-4003

Attn: Non-Responsive

Project: Army National Guard Readiness Center, Industrial Hygiene Evaluation
Fort Ritchie Army National Guard Armory

1.0 - EXECUTIVE SUMMARY

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Fort Ritchie Army National Guard Readiness Center located at 13817 Ritchie Road in Cascade, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. The following industrial hygiene and safety programs were evaluated during this industrial hygiene evaluation performed by Bonus Environmental, LLC representative Non-Responsive on May 20, 2010:

- Indoor Air Quality
- Use of items on the Hazardous Materials List
- Vehicle maintenance activities
- Lead Wipe & Air Sampling
- Illumination
- Ergonomics
- Evaluation of the physical condition of the facility in regards to peeling paint, asbestos containing materials, water damage or mold problems, and housekeeping practices.

The Fort Ritchie Readiness Center is an Army National Guard armory comprised of offices, a drill hall, a kitchen, conference rooms, storage rooms, a boiler room, a fitness room, a former indoor firing range, and classrooms. The point of contact for this facility was MSGT Non-Responsive. Five (5) full-time administrative personnel (plus one (1) recruiter and one (1) caretaker) are employed in the approximately 18,400 ft² facility. A shop diagram depicting the locations of the operations identified during this industrial hygiene evaluation is attached to this report as Appendix A.

The National Guard Bureau Region North Industrial Hygiene Office provided governmental furnished equipment and sampling media required to perform the industrial hygiene evaluation. Chain of custody forms for laboratories approved by the National Guard Bureau Region North Industrial Hygiene Office were provided with the sampling media. All samples collected during this industrial

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

hygiene evaluation were sent to the National Guard Bureau Region North Industrial Hygiene Office approved laboratories for analysis.

2.0 – LEAD SAMPLING

2.1 – Lead Wipe Sampling

Lead wipe sampling was performed according to the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame). Twenty (20) wipe samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. The National Guard Bureau Region North Industrial Hygiene Office has established/interpreted a threshold of 200 µg/ft² of lead concentration for surface cleanliness. The following table outlines the locations and analytical results for the lead wipe samples collected during this project

Army National Guard – Fort Ritchie Readiness Center
Lead Wipe Sample Results

Sample #	*Sample Date*	*Sample Location*	*Sample Area (ft^2)*	*Sample Result ($\mu g/ft^2$)*
FR-W-1	5-20-10	Field Blank	---	< 12
FR-W-2	5-20-10	Drill hall, along west wall, Internet access point keyboard	0.111	< 110
FR-W-3	5-20-10	Drill hall, SW corner, surface of recruiting supplies table	0.111	< 110
FR-W-4	5-20-10	Drill hall, along east wall, top of locker	0.111	110
FR-W-5	5-20-10	Drill hall, along north wall, top of spill kit	0.111	< 110
FR-W-6	5-20-10	Drill hall, floor, center of room	0.111	< 110
FR-W-7	5-20-10	Room 129 (former indoor firing range), west side-center, light fixture	0.111	< 110
FR-W-8	5-20-10	Room 129 (former indoor firing range), NW corner of room, top of locker	0.111	< 110
FR-W-9	5-20-10	Room 129 (former indoor firing range), floor, center of room	0.111	< 110
FR-W-10	5-20-10	Hallway outside of room 129, east wall, top of fire extinguisher case	0.111	< 110
FR-W-11	5-20-10	HVAC unit, south side of roof, fan side	0.111	< 110
FR-W-12	5-20-10	HVAC unit, south side of roof, filter side	0.111	< 110
FR-W-13	5-20-10	Room 134, kitchen, top of Univex M20 mixing machine	0.111	< 110
FR-W-14	5-20-10	Boiler room, along south wall, top of indicator panel box	0.111	< 110
FR-W-15	5-20-10	Supply room, center of room, surface of storage shelf	0.111	< 110
FR-W-16	5-20-10	Room 113, supplied-air grill	0.111	< 110
FR-W-17	5-20-10	Room 138, fitness room, SE corner window sill	0.111	< 110

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2995 of 5269

BEST AVAILABLE COPY

Army National Guard – Fort Ritchie Readiness Center Lead Wipe Sample Results				
Sample #	***Sample Date***	***Sample Location***	***Sample Area (ft^2)***	***Sample Result ($\mu g/ft^2$)***
FR-W-18	5-20-10	Room 136, SE corner, top of heating register	0.111	< 110
FR-W-19	5-20-10	Lobby, top of display case	0.111	< 110
FR-W-20	5-20-10	Room 118, copy room, top of copy machine	0.111	< 110
FR-W-21	5-20-10	Room 132, top of transformer box	0.111	< 110

Surface cleanliness threshold = < 200 $\mu g/ft^2$

2.2 – Lead Air Sampling

The purpose of lead air monitoring was to document task-specific activities and corresponding exposures to lead. Occupational Safety and Health Administration (OSHA) 29 CFR 1926.62 requires employers whose employees are exposed to lead in the work place, in any quantity, make a determination whether any employee's exposure exceeds the action level (AL) of 30 $\mu g/m^3$ or the maximum permissible exposure limit (PEL) of 50 $\mu g/m^3$ as 8-hour time weighted averages (TWAs). If employee exposures are less than 30 $\mu g/m^3$, training is required under the Hazard Communication 29 CFR 1926.59. Exposures that exceed the AL or PEL require the employer to comply with additional requirements, including air monitoring, additional training, and restricted work practices as outlined in OSHA 29 CFR 1926.62.

Representative fixed area sampling was conducted for potential airborne concentrations of lead in accordance with accepted Industrial Hygiene methods recognized by the National Institute for Occupational Safety and Health (NIOSH) and OSHA. Representative breathing zone samples were not collected from an employee performing administrative tasks.

Lead exposure monitoring was performed in accordance with the EPA method 600/R-93/200(M)-7420 (Atomic Absorption - Flame) with SKC personal air sampling pumps calibrated to 2.0 liters per minute. All samples were collected on 37 mm diameter cassettes with mixed-cellulose ester filters. All sampling pumps were calibrated before and after each use to ensure volume accuracy. Two (2) samples and one (1) field blank were sent under chain-of-custody procedures to AMA Analytical Services, Inc., an AIHA accredited laboratory located in Lanham, Maryland. Analytical results of the lead wipe and air samples are attached to this report as Appendix B.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2996 of 5269

BEST AVAILABLE COPY

Army National Guard – Fort Ritchie Readiness Center Lead Air Sample Results									
Sample #	**Sample Type**	**Sample Location**	**Flow Rate**	**Start**	**Stop**	**Vol.**	**Reprt. Limit (µg/m³)**	**Results (µg/m³)**	**8 hr TWA (µg/m³)**
May 20, 2010									
FR-A-1	FB	Field Blank	---	---	---	0	3	< 3	N/A
FR-A-2	IWA	Room 113, south side, during daily office activities	2.0	0914	1524	740	4.1	< 4.1	N/A
FR-A-3	IWA	Room 103, Drill hall, SW corner on recruiting supplies table	2.0	0917	1525	736	4.1	< 4.1	N/A

PS = Personal sample, **IWA** = Inside work area, **N/A** = Not Applicable
Note: The OSHA PEL of 50 µg/m³ is averaged over an 8 hr work shift

3.0 - PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERNS

3.1 - Lead Based Paint

During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC performed a visual inspection of the facility in regards to lead based paint. Bonus Environmental, LLC identified no areas of peeling paint which could potentially pose a lead exposure hazard.

3.2 – Presumed Asbestos Containing Materials

During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC performed a visual inspection to identify presumed asbestos containing materials (PACM) and, if found, to note their condition. Bonus Environmental, LLC did not identify any PACM that was considered to be in poor or damaged condition.

3.3 - Water Damage/Mold Growth

During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC performed a visual inspection to report the location and perform an evaluation of any water damaged or visible mold problems. Water-damaged building materials were noted on the ceiling tiles in room 109, the hallway outside of room 109, and in the hallway outside of women's restroom #122. In addition, fungal growth was noted on the drywall ceiling above the stalls in women's restroom #122. The source of the water damage was reported to Bonus Environmental, LLC as roof leaks.

3.4 - Housekeeping

During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC performed an evaluation of the housekeeping practices. Bonus Environmental, LLC found the housekeeping to be in good order, with the exception of clutter (mostly vehicle parts) on the floor of the Drill hall.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2997 of 5269

BEST AVAILABLE COPY

3.5 – Employee Interviews
During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC performed interviews and made observations to determine if the work activities being performed possessed any concerns. Following the interviews and observations, no ergonomic or indoor air quality concerns were identified.

3.6 – Indoor Air Quality
During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC measured temperature, relative humidity, carbon monoxide (CO), and carbon dioxide (CO_2) throughout the facility. A calibrated TSI Q-Trak Model 7565 Indoor Air Quality Monitor equipped with a Q-Trak Probe 982 was utilized to record indoor air quality measurements.

Carbon dioxide is a natural component of air and the amount of CO_2 in a given air sample is commonly expressed as parts per million (ppm). The outdoor air in most locations contains about 380 ppm carbon dioxide. Higher outdoor CO_2 concentrations can be found near vehicle traffic areas, industry and sources of combustion. The concentrations of CO_2 found in most offices are well below the OSHA Permissible Exposure Limit (PEL) of 5,000 ppm when averaged over an 8-hour time period for an industrial workplace. While levels below 5,000 ppm are considered to pose no serious health threat, studies have indicated that individuals in offices with elevated CO_2 concentrations tend to report drowsiness, lethargy and a general sense that the air is stale. Ventilation rates for office spaces are defined by various codes and standards. The most widely accepted standard is the American Society of Heating, Refrigerating, and Air Conditioning Engineers (ASHRAE) Standard 62. According to ASHRAE Standard 62.1-2007, CO_2 concentrations below 700 ppm above the outdoor level are considered to indicate adequate ventilation and provide human comfort. The CO_2 measurements collected during this industrial hygiene evaluation ranged from 401 ppm to 510 ppm and indicate adequate ventilation within the facility.

Carbon monoxide, also known as the "silent killer," is a colorless, odorless, poisonous gas that results from the incomplete burning of common fuels such as natural or liquefied petroleum gas, oil, wood or coal. When carbon monoxide is inhaled, it enters the blood stream and reduces the ability of the blood to carry oxygen to vital organs, such as the heart and brain. Because it is impossible to see, taste or smell the toxic fumes, CO can harm you before you are aware it is in your work area. At lower levels of exposure, CO causes mild effects that are often mistaken for the flu. These symptoms include headaches, dizziness, disorientation, nausea and fatigue. The effects of CO exposure can vary greatly from person to person depending on age, overall health and the concentration and length of exposure. The OSHA has established a PEL of 50 ppm. OSHA standards prohibit worker exposure to more than 50 parts of the gas per million parts of air averaged during an 8-hour time period. The peak CO level for employees is 200 ppm. The CO measurements collected during this industrial hygiene evaluation ranged from 0.9 ppm to 1.3 ppm. CO levels were well below the OSHA PEL during this industrial hygiene evaluation.

During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC collected temperature measurements. Temperature measurements

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2998 of 5269

BEST AVAILABLE COPY

throughout the facility ranged from 66.1ºF to 68.2ºF and are considered to be within an acceptable range.

During the industrial hygiene evaluation of the Army National Guard Fort Ritchie Readiness Center, Bonus Environmental, LLC collected relative humidity measurements. Relative humidity measurements throughout the facility ranged from 52.2% to 54.8% and are considered to be within an acceptable range. Indoor air quality measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard – Fort Ritchie Readiness Center Indoor Air Quality Measurements				
Location	*CO_2 (ppm)*	*CO (ppm)*	*Relative Humidity (%)*	*Temperature (ºF)*
Outdoors, SW entrance	379	0.5	57.3	67.1
Room 113	462	0.9	52.5	68.2
Supply room	469	1.3	52.6	67.7
Lobby	481	0.9	53.5	67.4
Room 118, copy room	510	1.2	54.3	67.7
Room 138, fitness room	497	1.2	54.5	67.5
Room 137/136	470	1.0	54.2	67.2
Room 134, kitchen	417	1.0	52.9	67.3
Room 129	488	0.9	53.4	67.3
Room 103, Drill hall	401	0.9	52.2	66.8
Boiler room	464	0.9	54.8	66.1

Required/Recommended Values
CO_2 *- OSHA PEL = 5,000 ppm and ASHRAE Standard 62.1-2007 = no greater than 700 ppm above outdoor*
CO *- OSHA PEL = 50 ppm and OSHA Ceiling Limit = 200 ppm*
Temperature *- ASHRAE Standard 55-2004 = between approximately 67 and 82 °F.*
RH *– ANSI/ASHRAE Standard 62.1-2007 = <65%*

4.0 – LIGHTING

Utilizing a properly calibrated Cooke Corporation cal-Light 400 light meter, Bonus Environmental, LLC collected illumination readings throughout the facility. Illumination measurements recorded during this industrial hygiene evaluation are summarized in the table below.

Army National Guard – Fort Ritchie Readiness Center Lighting Survey			
Location	*Measurement in Foot Candles*	*Requirement in Foot Candles*	*Requirement Met?*
Room 129 – Former indoor firing range/Msgt. Kunis's room	76.2	50	YES
Room 109 – Office	83.6	50	YES
Room 108 – Office	77.4	50	YES
Room 110 – Storage	38.4	30	YES
Supply room	19.4	30	NO
Room 105 – Storage	74.4	30	YES

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 2999 of 5269

BEST AVAILABLE COPY

Army National Guard – Fort Ritchie Readiness Center Lighting Survey			
Location	*Measurement in Foot Candles*	*Requirement in Foot Candles*	*Requirement Met?*
Supply storage	7.8	30	NO
Boiler room	19.1	30	NO
Room 113 – Break room	68.1	10	YES
Room 111 – Office	61.3	50	YES
Room 112 – Office	77.8	50	YES
Room 115 – Office	88.7	50	YES
Lobby	27.1	5	YES
Room 139 – Office	56.7	50	YES
Room 141 – Office	51.6	50	YES
Room 118 – Copy room	15.1	30	NO
Room 138 – Fitness room	44.1	30	YES
Room 122 – Women's restroom & showers	51.9	5	YES
Room 123 – Men's restroom	65.4	5	YES
Room 125 – Men's locker room	19.9	7	YES
Room 137/136 – Classroom/Dining room	66.8	30	YES
Hallway outside of room 136	14.1	5	YES
Room 134 – Kitchen	128.5	10	YES
Room 133 – Kitchen storage	38.3	30	YES
Room 132 – Mechanical room	56.7	30	YES
Room 131 - Restroom	62.3	5	YES
Room 103 – Drill hall	14.7	30	NO
Room 128 – Storage	11.4	30	NO
NW exterior room (caretaker's storage)	20.3	30	NO
Room 119 – Storage	28.8	30	NO
Room 130 – Storage	36.6	30	YES
Room 114 – Office	Light switch malfunctioning		
Vault	Inaccessible		

Lighting levels were compared to the levels outlined within the ANSI/IESNA RP-1-04 Office Lighting Handbook, and the ANSI/IESI RP-7-01 Lighting Industrial Facilities Handbook. Areas within the facility which did not meet the foot candle requirements are identified with a "NO" within the Requirement Met? column. It is recommended that illumination be improved in all the areas that did not meet the requirements. Improving illumination can be achieved by replacing burned-out lamps/bulbs, cleaning fixtures, relocating detailed work activities to more illuminated areas, and using supplemental task lighting.

5.0 - CONCLUSION

Bonus Environmental, LLC was contracted by the National Guard Bureau Region North to identify and measure the existence and extent of potentially hazardous operations or conditions at the Fort Ritchie Army National Guard Readiness Center located at 13817 Ritchie Road in Cascade, Maryland. The purpose of this evaluation was to generate or to update a previous baseline evaluation so that employee exposure history can be provided to each civilian and military employee. An industrial

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3000 of 5269

BEST AVAILABLE COPY

hygiene evaluation of the facility was performed by Bonus Environmental, LLC representative Jeff Walworth on May 20, 2010.

Bonus Environmental, LLC recommends that any areas of concerns outlined within this report be evaluated to ensure the necessary actions are made. Following the completion of the industrial hygiene evaluation, Bonus Environmental, LLC found the following safety and/or indoor air quality conditions of the facility to be within acceptable levels/condition in regards to the following:

- Carbon Dioxide
- Carbon Monoxide
- Presumed Asbestos-Containing Materials
- Lead Wipe and Air Samples
- Ergonomics
- Temperature
- Relative Humidity

It has been a pleasure to be of assistance to you. Please contact us if you have any questions concerning this report or if we can be of any further assistance in any other environmental or occupational health matter.

Sincerely,

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Non-Responsive [redacted]

Principal
Bonus Environmental, LLC

Fort Ritchie_10_Report.docx

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3001 of 5269

BEST AVAILABLE COPY

Appendix A

Shop Diagram

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3003 of 5269

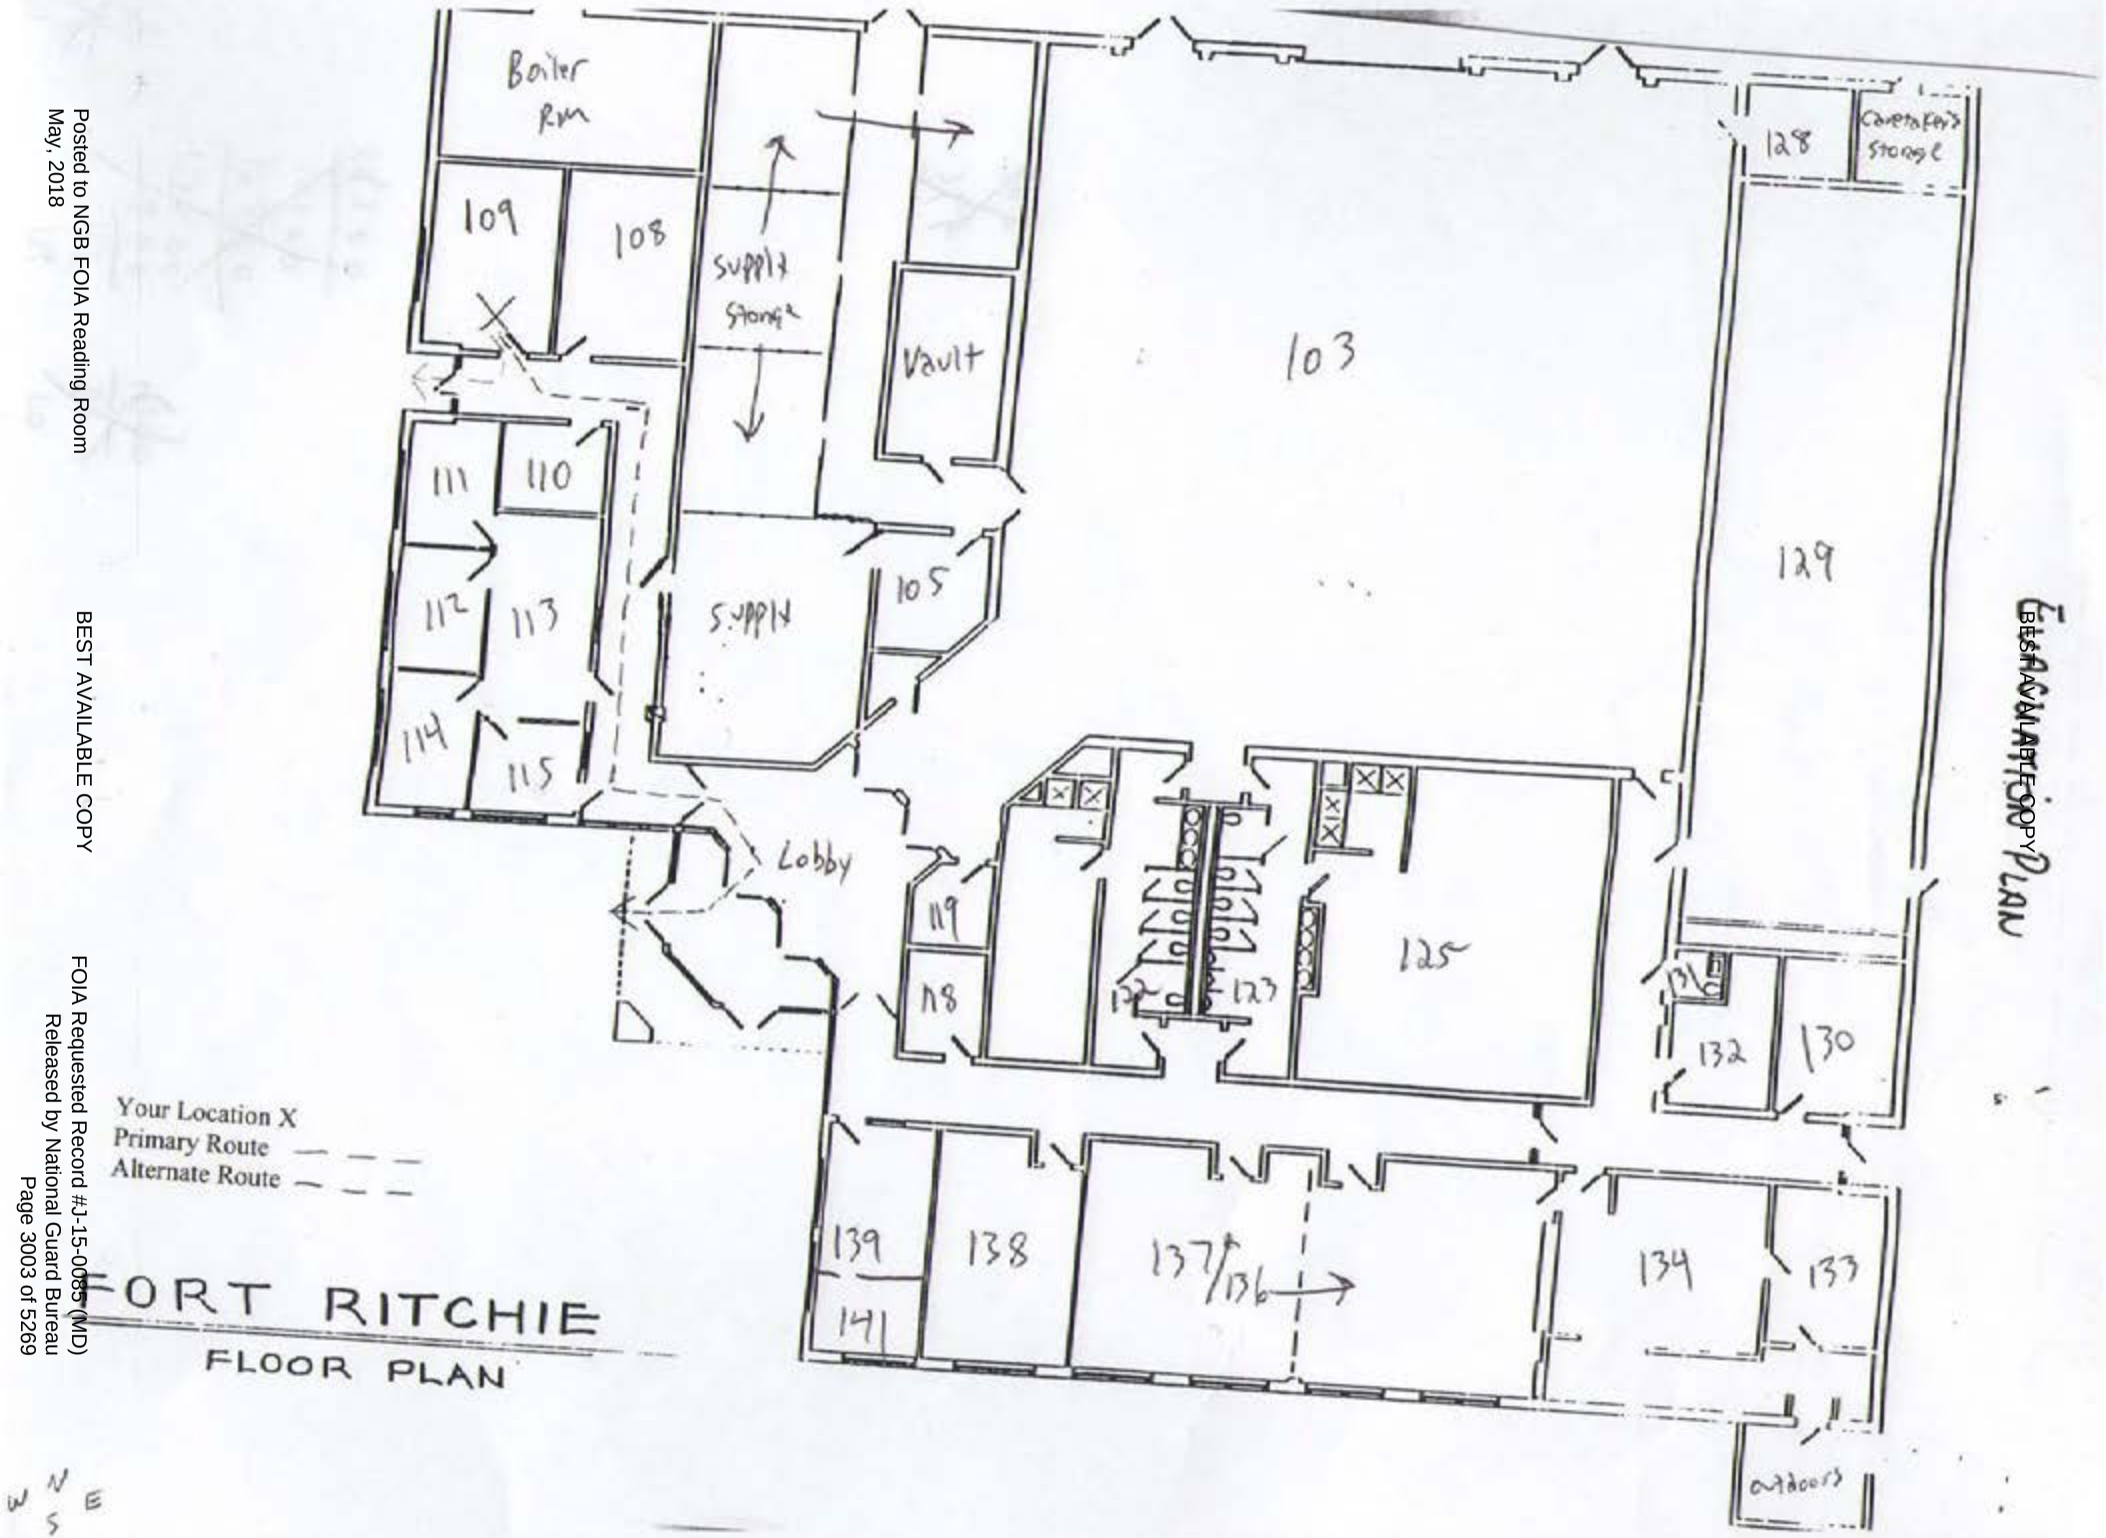

BEST AVAILABLE COPY

BEST AVAILABLE COPY

EVACUATION PLAN

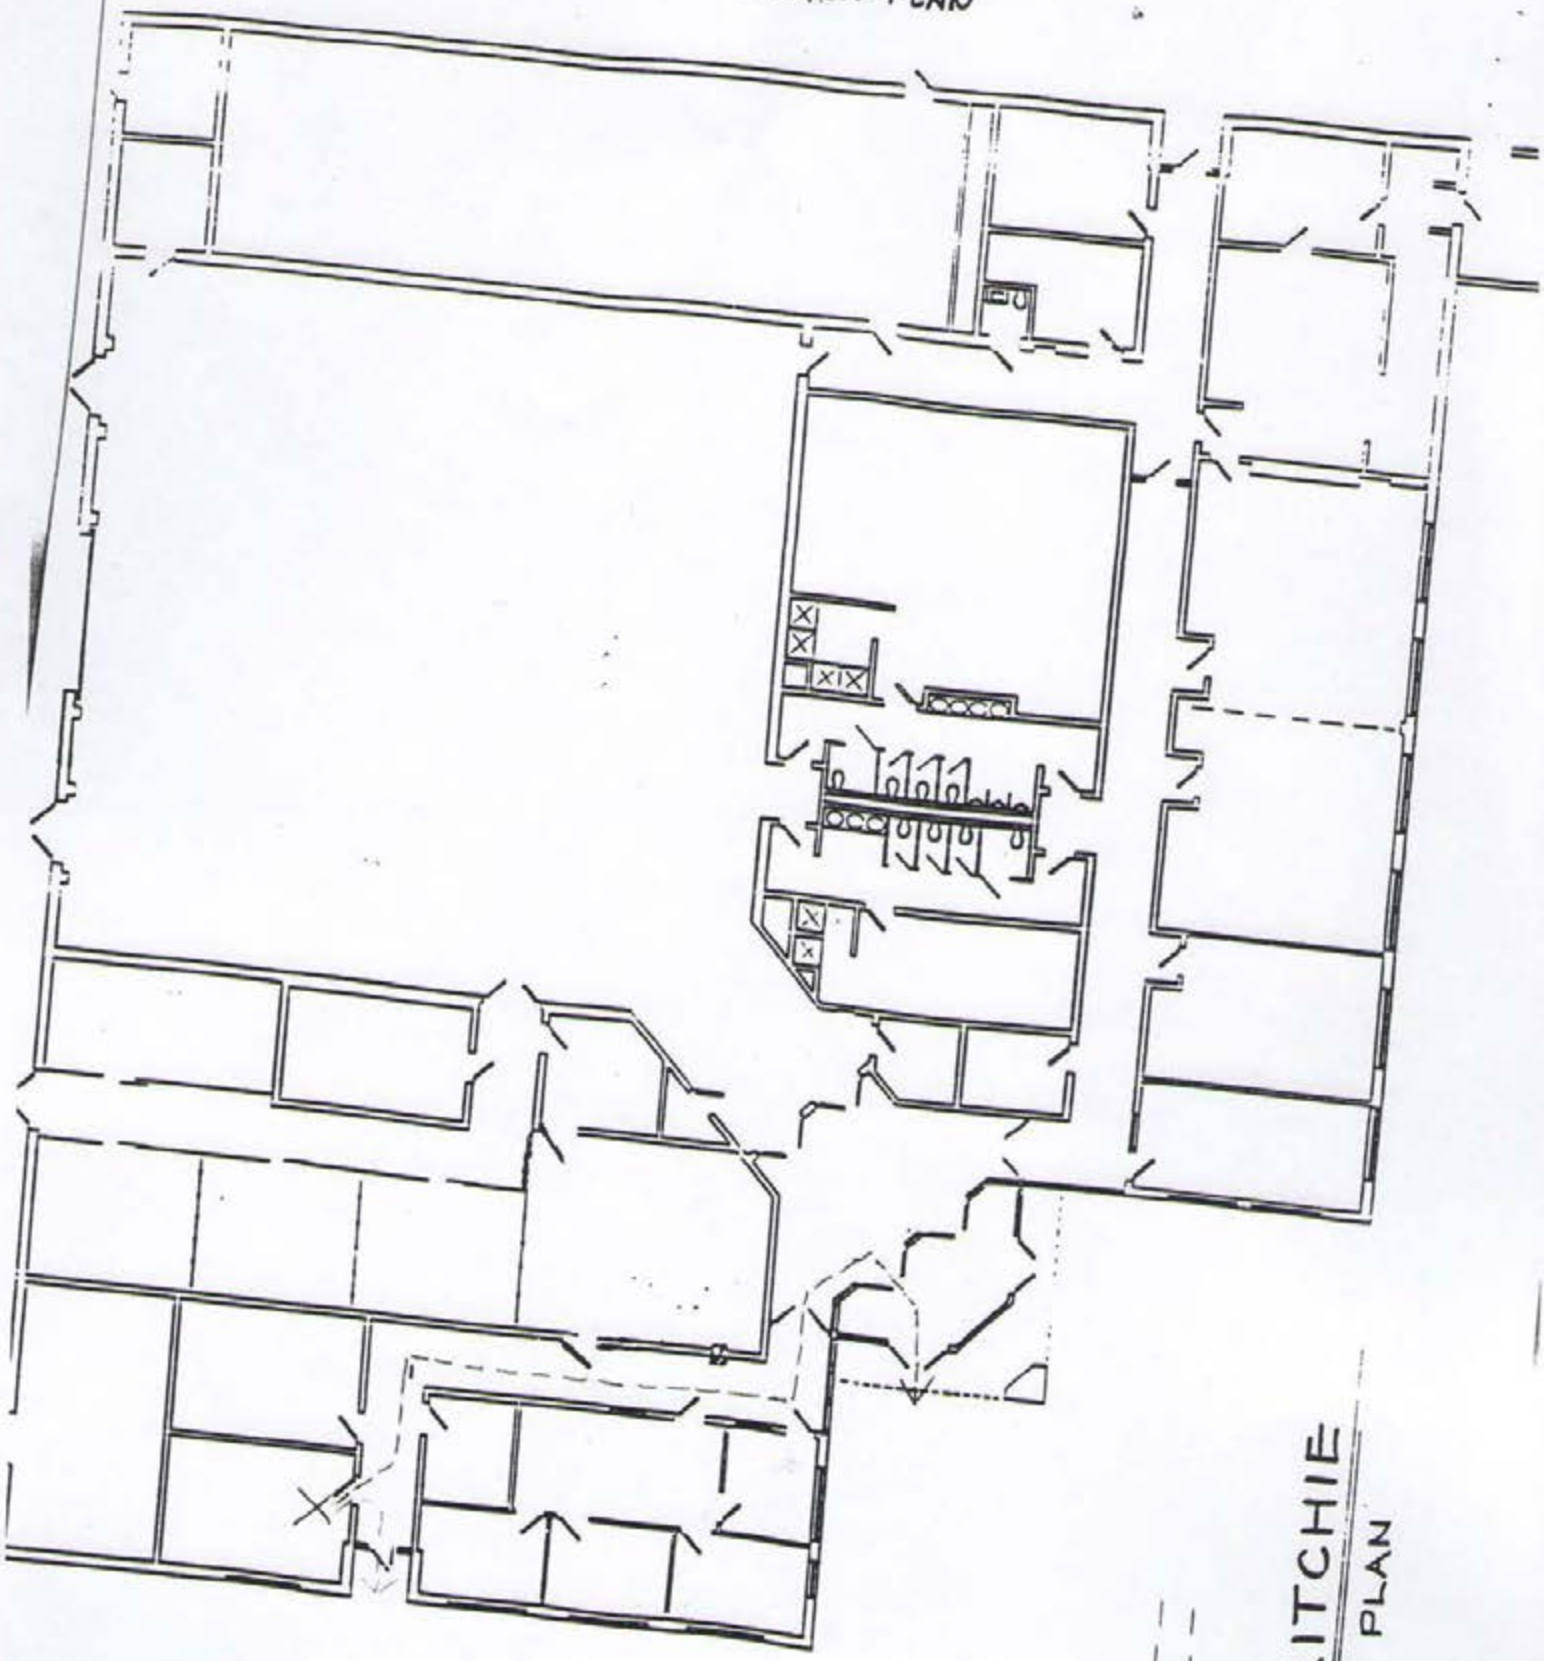

Your Location X
Primary Route
Alternate Route

FORT RITCHIE
FLOOR PLAN

BEST AVAILABLE COPY

Appendix B

Lead Sample Results

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

RECEIVED JUN 14 2010

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details
100470

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	Fort Ritchie Armory	**Chain Of Custody:**	507188
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Cascade, MD	**Date Submitted:**	5/21/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Fort Ritchie Armory	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	5/28/2010 **Report Date:** 6/1/2010
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047776	FR-A-1	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	
1047777	FR-A-2	Flame	Air	740	N/A	4.1	ug/m³	<3	<4.1	ug/m³	
1047778	FR-A-3	Flame	Air	736	N/A	4.1	ug/m³	<3	<4.1	ug/m³	
1047779	FR-W-1	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
1047780	FR-W-2	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047781	FR-W-3	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047782	FR-W-4	Flame	Wipe	****	0.111	110	ug/ft²	13	110	ug/ft²	
1047783	FR-W-5	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047784	FR-W-6	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047785	FR-W-7	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047786	FR-W-8	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047787	FR-W-9	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047788	FR-W-10	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047789	FR-W-11	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047790	FR-W-12	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047791	FR-W-13	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047792	FR-W-14	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047793	FR-W-15	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047794	FR-W-16	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

FOIA Requested Record #J-15-0866 (Ms. Cole)
Released by National Guard Bureau

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihalap.org for details
100470

NY ELAP
10920

Client:	National Guard Bureau	**Job Name:**	Fort Ritchie Armory	**Chain Of Custody:**	507188
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Cascade, MD	**Date Submitted:**	5/21/2010
	Havre de Grace, Maryland 21078	**Job Number:**	Fort Ritchie Armory	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	5/28/2010 **Report Date:** 6/1/2010
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
1047795	FR-W-17	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047796	FR-W-18	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047797	FR-W-19	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047798	FR-W-20	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	
1047799	FR-W-21	Flame	Wipe	****	0.111	110	ug/ft²	<12	<110	ug/ft²	

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)
%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.
Air and Wipe results are not corrected for any blank results
Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

See QC Summary for analytical results of quality control samples associated with these sampes.
NY ELAP accreditation applies only to paint chip, wipe, and soil samples.

Analyst: Ang Cao

Technical Manager: G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0253 Page 3007 of 5269
Released by National Guard Bureau

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved.
AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 19393

Analysis Type: Flame
Sample Type: Wipe
Analysis Date: 5/27/2010

		Result		Percent Recovery	RPD	Comment
Preparation Blank		-0.061	ppm			Acceptable
Report Limit Verification Sample		0.2937	ppm	88.1%		Acceptable
Expected Spike Level (ppm)	0.3333					
Duplicate Sample 1			mg/Kg			
Duplicate Sample 2			mg/Kg			
Matrix Spike Analysis						Acceptable
Spiked Sample						
Spike Duplicate						Acceptable
Laboratory Control Sample 1		160.194	µg	103.29%		Acceptable
Laboratory Control Sample 2		256.311	µg	105.42%	2.04%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.99969

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507188	47779	FR-W-1
507188	47780	FR-W-2

SDG Number: 19393

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3008 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507188	47781	FR-W-3
507188	47782	FR-W-4
507188	47783	FR-W-5
507188	47784	FR-W-6
507188	47785	FR-W-7
507188	47786	FR-W-8
507188	47787	FR-W-9
507188	47788	FR-W-10
507188	47789	FR-W-11
507188	47790	FR-W-12
507188	47791	FR-W-13
507188	47792	FR-W-14
507188	47793	FR-W-15
507188	47794	FR-W-16
507188	47795	FR-W-17
507188	47796	FR-W-18
507188	47797	FR-W-19
507188	47798	FR-W-20

SDG Number: 19393

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3009 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 19408

Analysis Type: Flame
Sample Type: Air
Analysis Date: 5/28/2010

	Result		Percent Recovery	RPD	Comment
Preparation Blank	-0.075	ppm			Acceptable
Report Limit Verification Sample	0.2114	ppm	84.6%		Acceptable
Expected Spike Level (ppm) 0.25					
Duplicate Sample 1		mg/Kg			
Duplicate Sample 2		mg/Kg			Acceptable
Matrix Spike Analysis					
Spiked Sample					Acceptable
Spike Duplicate					Acceptable
Laboratory Control Sample 1	91.418	µg	106.60%		Acceptable
Laboratory Control Sample 2	99.378	µg	107.50%	0.84%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.99992

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507188	47776	FR-A-1
507188	47777	FR-A-2

SDG Number: 19408

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3010 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
507188	47778	TR-A-3
507189	47845	F-A-1
507189	47846	F-A-2
507189	47847	F-A-3
507190	47867	CL-A-1
507190	47868	CL-A-2
507190	47869	CL-A-3
507201	48097	W-A-1
507201	48098	W-A-2
507201	48099	W-A-3
196472	49492	52410-JN01
196472	49493	52410-JN02
196472	49494	52510-JN01
196472	49495	52510-JN02
196472	49496	52610-JN01
196472	49497	52610-JN02
196472	49498	52710-JN01
196472	49499	52710-JN02

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3011 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Focused on Results!!

NVLAP 101143-0

NY ELAP 10920

AIHA 100470

Submitting Samples for National Guard Jobs

1) All samples shall be submitted to AMA Analytical Services, Attn: Sample Receiving, utilizing the enclosed Chain-of-Custody Form. The highlighted areas must be completed by the Subcontractor, however, the Sample Information/Analysis/Matrix section will not need to be completed if field date sheets are submitted with the samples. Please be sure to include a contact phone number for the person submitting the samples.
2) Results shall be reported via email to [redacted]ns:
   a. National Guard Subcontractor [redacted] @bonusenvironmental.com
   b. [redacted]IV NGB: [redacted]@us.army.mil
   c. [redacted] CIV NGB: [redacted]army.mil
3) Hard Copy Reports & Invoices shall be [redacted] following manner:
   a. Original Invoices and Copies of Reports shall be sent to the National Guard
      National Guard Bureau
      Attn: [redacted]
      301-IH Old Bay Lane
      Attn: NGB-AVN-SI, State Military Reservation
      Havre de Grace, Maryland 21078
   b. Original Reports shall be sent the National Guard Subcontractor

      Attn: [redacted]
      office: 989-779-7686
      cell: 989-621-3862
4) All Pb Wipes shall be handled in the following manner:
   a. All samples shall be analyzed utilizing FLAA procedures
   b. Samples whose results are reported as less than the reporting limit, and the reporting limit is greater than 40ug/ft2 shall be re-analyzed utilizing GFAA procedures.
5) All other samples – Pb Paints, Soils, & Airs, PCM Airs, PLM Bulks, TEM Airs, & TEM Bulks shall be analyzed utilizing standard analytical procedures

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3012 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3013 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

210 REV. 6.08

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) Sheet 1 of 2

507188

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Job Name: Fort Ritchie Armory
2. Job Location: Cascade, MD
3. Job #: Fort Ritchie Armory
4. Contact Pers[redacted] #: W912K6-09-A-0003
5. Submitted by [redacted] @ phone # [redacted]3
[redacted]ature [redacted]

AFTER HOURS (must be pre-scheduled)
❑ Immediate Date Due: ____
❑ 24 Hours Time Due: ____
Comments: ____

Reporting Information (Results will be provided as soon as technically feasible):

NORMAL BUSINESS HOURS
❑ Immediate
❑ Next Day
❑ 2 Day
❑ 3 Day
☒ 5 Day + Date Due: 5-28-10
❑ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
☒ Includ[redacted]ith Report
☒ [redacted] bonvsenvironmental.com
❑ Fax: [redacted]us.army.mil
❑ Verba[redacted]us.army.mil

Asbestos Analysis
PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 ____ (QTY)
❑ Fiberglass ____ (QTY)
TEM Air – Please Indicate Filter Type:
❑ AHERA ____ (QTY)
❑ NIOSH 7402 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
PLM Bulk
❑ EPA 600 – Visual Estimate ____ (QTY)
❑ EPA Point Count ____ (QTY)
❑ NY State Friable 198.1 ____ (QTY)
❑ Grav. Reduction ELAP 198.6 ____ (QTY)
❑ Other (specify ____) ____ (QTY)
MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield ____ (QTY)
❑ NY State PLM/TEM ____ (QTY)
❑ Residual Ash ____ (QTY)
TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
❑ Quan. (s/area)Dust D6480-99 ____ (QTY)
TEM Water
❑ Qual. (pres/abs) ____ (QTY)
❑ ELAP 198.2/EPA 100.2 ____ (QTY)
❑ EPA 100.1 ____ (QTY)

☑ All samples received in good condition unless otherwise noted.
(TEM Water samples ____ °C)

Metals Analysis
❑ Pb Paint Chip ____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost, 21 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid ____ (QTY)
❑ Pb TCLP ____ (QTY)
❑ Drinking Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Waste Water ❑ Pb ____ (QTY) ❑ Cu ____ (QTY) ❑ As ____ (QTY)
❑ Pb Furnace (Media ____) ____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: ____
Collection Media ____
❑ Spore-Trap ____ (QTY)
❑ Surface Swab ____ (QTY)
❑ Surface Tape ____ (QTY)
❑ Other (Specify ____) ____ (QTY)
❑ Surface Vacuum Dust ____ (QTY)
❑ Culturable ID Genus (Media ____) ____ (QTY)
❑ Culturable ID Species (Media ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WASTE AND OTHER	SPORE TRAP	TAPE	SWAB
FR-A-1	Field Blank	5-20	0	—				✱		✱						
FR-A-2	Rm 113		740	—				✱		✱						
FR-A-3	Rm 103		736	—				✱		✱						
FR-W-1	Field Blank		—	—				✱				✱				
FR-W-2	Drill Hall		—	4"x4"				✱				✱				
FR-W-3	Drill Hall		—					✱				✱				
FR-W-4	Drill Hall		—					✱				✱				
FR-W-5	Drill Hall		—					✱				✱				
FR-W-6	Drill Hall		—					✱				✱				
FR-W-7	Rm 129		—					✱				✱				
FR-W-8	Rm 129		—					✱				✱				
FR-W-9	Rm 129		—					✱				✱				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 5 / 21 / 10 @ 9:45 Via: FedEx By (Print): Sarah Watson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): Nidu Sign: ____
3. Results Reported To: ____ Via: email Date: 6 / 1 / 10 Time: 1906 Initials: [initials]
4. Comments: ____

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3014 of 5269

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

OWI (410) 247-2024

159202

210 REV. 6.08

507188

Sheet 2 of 2

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires)

Mailing/Billing Information:

1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-AVN-SI, State Military Reservation
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:

1. Job Name: Fort Ritchie Armory
2. Job Location: Cascade, MD
3. Job #: Fort Ritchie Armory
4. Contact Perso[redacted] #: W912K6-09-A-0003
5. Submitted by: [redacted] 0273

AFTER HOURS (must be pre-scheduled)

❑ Immediate Date Due: _____
❑ 24 Hours Time Due: _____
Comments: _____

Reporting Information (Results will be provided as soon as technically feasible):

NORMAL BUSINESS HOURS

❑ Immediate ❑ 3 Day
❑ Next Day ☒ 5 Day + Date Due: 5-28-10
❑ 2 Day

❑ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

[redacted] RT TO:
with Report
@bonvsenvironmental.com
@us.army.mil
@us.army.mil
❑ Fax: _____
❑ Verbal: [redacted]

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
❑ NIOSH 7400 _____ (QTY)
❑ Fiberglass _____ (QTY)

TEM Air – Please Indicate Filter Type:
❑ AHERA _____ (QTY)
❑ NIOSH 7402 _____ (QTY)
❑ Other (specify _____) _____ (QTY)

PLM Bulk
❑ EPA 600 – Visual Estimate _____ (QTY)
❑ EPA Point Count _____ (QTY)
❑ NY State Friable 198.1 _____ (QTY)
❑ Grav. Reduction ELAP 198.6 _____ (QTY)
❑ Other (specify _____) _____ (QTY)

MISC
❑ Vermiculite
❑ Asbestos Soil PLM__(Qual) PLM__(Quan) PLM/TEM__(Qual) PLM/TEM__(Quan)

TEM Bulk
❑ ELAP 198.4/Chatfield _____ (QTY)
❑ NY State PLM/TEM _____ (QTY)
❑ Residual Ash _____ (QTY)

TEM Dust
❑ Qual. (pres/abs) Vacuum/Dust _____ (QTY)
❑ Quan. (s/area) Vacuum D5755-95 _____ (QTY)
❑ Quan. (s/area)Dust D6480-99 _____ (QTY)

TEM Water
❑ Qual. (pres/abs) _____ (QTY)
❑ ELAP 198.2/EPA 100.2 _____ (QTY)
❑ EPA 100.1 _____ (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples _____ °C)

Metals Analysis
❑ Pb Paint Chip _____ (QTY)
☒ Pb Dust Wipe (wipe type Ghost) 21 (QTY)
☒ Pb Air 3 (QTY)
❑ Pb Soil/Solid _____ (QTY)
❑ Pb TCLP _____ (QTY)
❑ Drinking Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
❑ Waste Water ❑ Pb____(QTY) ❑ Cu____(QTY) ❑ As____(QTY)
❑ Pb Furnace (Media _____) _____ (QTY)

Fungal Analysis
Collection Apparatus for Spore Traps/Air Samples: _____
Collection Media _____
❑ Spore-Trap _____ (QTY)
❑ Surface Swab _____ (QTY)
❑ Surface Tape _____ (QTY)
❑ Other (Specify _____) _____ (QTY)
❑ Surface Vacuum Dust _____ (QTY)
❑ Culturable ID Genus (Media _____) _____ (QTY)
❑ Culturable ID Species (Media _____) _____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
FR-W-10	Hallway outside 129	5-20	—	4"x4"				*				*				
FR-W-11	HVAC-Fan side		—					*				*				
FR-W-12	HVAC-Filter side		—					*				*				
FR-W-13	Rm 134		—					*				*				
FR-W-14	Boiler Rm		—					*				*				
FR-W-15	Supply Rm		—					*				*				
FR-W-16	Rm 113		—					*				*				
FR-W-17	Rm 138		—					*				*				
FR-W-18	Rm 136		—					*				*				
FR-W-19	Lobby		—					*				*				
FR-W-20	Rm 118		—					*				*				
FR-W-21	Rm 132		—					*				*				

CLIENT CONTACT
(LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)

1. Date/Time RCVD: 5 / 21 / 10 @ 9:45 Via: FedEx By (Print): Surat Watson Sign: [signature]
2. Date/Time Analyzed: ____ / ____ / ____ @ ____ By (Print): _____ Sign: _____
3. Results Reported To: _____ Via: _____ Date: ____ / ____ / ____ Time: _____ Initials: _____
4. Comments: _____

BEST AVAILABLE COPY

Appendix C

Photographs

BEST AVAILABLE COPY

Building exterior, southwest entrance

Rm. 103, drill hall from north bay door

Rm. 122, water damaged/moldy ceiling above stairs

Rooftop AHU, south side of roof, fan side

Hallway outside of Rm. 109, water stained ceiling tiles

Rooftop AHU, south side of roof, filter side

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3016 of 5269

BEST AVAILABLE COPY

Boiler Room

Exterior POL storage

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3017 of 5269

Appendix D

References

BEST AVAILABLE COPY

1. Department of Defense Instruction (0001) 6055.1, Department of Defense Occupational Safety and Health (OS H) Program, August 19, 1998.

2. Army Regulation (AR) 11-34, The Army Respiratory Protection Program, February 15, 1990.

3. DA PAM 40-503, Medical Service, Industrial Hygiene Program, October 30, 2000.

4. Technical Manual (T.M) 5-810-1, Mechanical Design, Heating, Ventilation, and Air Conditioning, June 1991.

5. Threshold Limit Values (TLVs) and Biological Exposure Indices (BEls), American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

6. Industrial Ventilation - A Manual of Recommended Practices, American Conference of Governmental Industrial Hygienists (ACGIH), current edition.

7. UFC 3-410-01 FA Heating, Ventilating, and Air Conditioning, 15 May 2003

8. Occupational Safety and Health Administration (OSHA) Lead in Construction Standard, 29 CFR 1926.62

9. OSHA Lead Standard 29 CFR 1910.1025

10. OSHA Respiratory Protection Standard 29 CFR 1910.134

11. Army Regulation (AR) 385-10, The Army Safety Program, August 23, 2007.

12. RP-1-2004, Office Lighting, Illuminating Engineering Society of North America (IESNA)/ANSI.

13. RP-7-2001, Industrial Lighting, (IESNA)/ANSI.

14. The American Society of Heating, Refrigerating, and Air-Conditioning Engineers (ASHRAE), Standard 62.1-2007, "Ventilation for Acceptable Indoor Air Quality".

15. ASHRAE Standard 55-2004 – “Thermal Environmental Conditions for Human Occupancy”

16. Title 24, CFR, Part 35, Subpart B, Sections 35.110, Definitions of Lead-Based Paint, Housing and Urban Development, U.S. Department of Housing.

17. OSHA Personal Protective Equipment 29 CFR 1910.132

18. OSHA Permissible Exposure Limit (PEL) for General Industry 29 CFR 1910.1000 Z-1 Table

19. Guidelines on Assessment and Remediation of Fungi in Indoor Environments, New York City Department of Health and Mental Hygiene, November 2008.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3019 of 5269

BEST AVAILABLE COPY

20. Mold Remediation in Schools and Commercial Buildings, U.S. Environmental Protection Agency, March 2001

21. Army Facilities Management Information Document on Mold Remediation Issues TG277, February 2002

22. OSHA Welding, Cutting, Brazing 29 CFR 1910.252

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3020 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

6 SEPTEMBER 2005

MEMORANDUM FOR Region North Industrial Hygiene Office (NGB-AVS-SI-IH/ Ms. Non-Responsive) Army National Guard Bureau, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities Industrial Hygiene Baseline Surveys, MG William C. Purnell Armory, Gunpowder Military Reservation, Glen Arm, MD, Project No. 55-ML-01ED-03/05

1. Enclosed is the final copy of the subject report and two CD-ROMs.

2. The project number for this service reflects the current fiscal year of dispatch and the actual field work which was completed for fiscal year 2003. The State of Maryland Army National Guard occupational health nurse was immediately notified in writing of findings necessitating immediate corrective action in Maryland armories. In addition, the National Guard Bureau Region North Industrial Hygiene Office has been notified of all the results of lead in dust sampling conducted in all facilities. Draft reports were reviewed by you or other members of the National Guard and members of this Center, including our editorial staff, during drafting stages in report preparation leading up to the final report.

3. Our point of contact is Ms. Non-Responsive, at commercial (410) 436-5475/3118, DSN 584-5475/3118, or electronic mail: Non-Responsive@us.army.mil

FOR THE COMMANDER:

Non-Responsive

Director, Occupational Health Sciences

Encl

Readiness thru Health

Printed on Recycled Paper
BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USCHPPM

MDARNG FACILITIES IH BASELINE SURVEY
MG WILLIAM C PURNELL ARMORY
GLEN ARM, MD
PROJECT NO. 55-ML-01ED-03/05
31 JULY 2003

Approved for public release; distribution unlimited.

Readiness Thru Health

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3022 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

EXECUTIVE SUMMARY
MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
MG WILLIAM C. PURNELL ARMORY
GLEN ARM, MD
PROJECT NO. 55-ML-01ED-03/05
31 JULY 2003

1. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee for the Defense Occupational and Environmental Health Readiness System.

2. CONCLUSIONS.

a. Lead Exposure. Levels of lead in dust that exceeded safe limits for adults and children were identified. These levels may result in health hazards to adults and to children visiting the Armory. Personnel working in the Armory were tracking dust containing lead throughout the facility. Cleaning areas with elevated levels of lead in dust may further prevent lead from becoming redistributed throughout the Armory.

b. Asbestos. There was a potential for exposure to asbestos in the Armory. Damaged asbestos insulation, if present, may become friable and asbestos fibers released, resulting in exposure to Armory occupants. The pipe insulation may be asbestos-containing material (ACM). This should be confirmed by reviewing Armory records or by sampling. Army policy requires the Armory to establish and execute an Asbestos Management Plan (AMP) for any asbestos in the facility, and to take immediate corrective action where a possible asbestos hazard has been identified.

c. Heating, Ventilation, and Air Conditioning Systems. The heating and cooling systems were not operating in some rooms in the building.

d. Other Building Concerns. The point of contact stated that the drinking water had a bad taste.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3023 of 5269

BEST AVAILABLE COPY

3. RECOMMENDATIONS.

a. Lead Exposure. Health Hazard Risk Assessment Code (RAC) 3. Clean horizontal surfaces in the administrative areas to the National Guard Bureau (NGB) Region North and U.S. Army Center for Health Promotion and Preventive Medicine (USACHPM) decontamination levels. Address all potential lead hazards before continuing to extend the use of this facility to children. If children will visit this facility, clean the floors in the Drill Hall and Classroom to the Environmental Protection Agency lead in dust standards for young children, and clean other horizontal surfaces in the Drill Hall and Classroom to the NGB Region North and USACHPPM decontamination level for lead in dust on frequently contacted surfaces. Ensure that personnel wear disposable gloves and disposable coveralls as extra protection when working in all areas identified as having elevated levels of lead. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after cleanup.

b. Asbestos Exposure. Health Hazard RAC 3 if asbestos is present.

(1) Review Armory and the Maryland NGB office records to determine whether there are asbestos records for inspection and abatement, or if there is an AMP for Glen Arm Armory.

(2) Perform an asbestos survey if no records are located.

(3) If asbestos is found, develop and implement an AMP if there is not one for the Armory.

(4) If the insulation is determined to be ACM and becomes damaged, encapsulate or remove it as soon as possible.

c. Heating, Ventilation, and Air Conditioning Systems. RAC 3. Investigate operating problems with the heating and cooling systems. Consider re-surveying indoor air conditions in hot weather with windows closed and systems fully operational.

d. Other Building Concerns. RAC 3. Hire an accredited laboratory certified in lead in water analyses to test the drinking water from water fountains and faucets for lead and other contaminants.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3024 of 5269

BEST AVAILABLE COPY

TABLE OF CONTENTS

Paragraph Page

1. REFERENCES 1
2. PURPOSE OF EVALUATION 1
3. AUTHORITY 1
4. BACKGROUND INFORMATION 1
5. FACILITY EVALUATION 2
6. ASSESSMENT CRITERIA FOR LEAD 2
7. SAMPLING RESULTS, DISCUSSION, AND CONCLUSIONS 3
8. RECOMMENDATIONS 4
9. PHOTOGRAPHS 5
10. ADDITIONAL ASSISTANCE 6

Appendices

A. REFERENCES A-1
B. SAMPLING SHEETS AND LAB ANALYSES B-1
C. ASSESSMENT CRITERIA FOR LEAD C-1
D. LEAD CLEANING GUIDANCE D-1
E. PHOTOGRAPHS E-1

TABLE

Lead in Surface Dust Wipe Locations and Analytical Results 3

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3025 of 5269

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

MARYLAND ARMY NATIONAL GUARD FACILITIES
INDUSTRIAL HYGIENE BASELINE SURVEYS
MG WILLIAM C. PURNELL ARMORY
GLEN ARM, MD
PROJECT NO. 55-ML-01ED-03/05
31 JULY 2003

1. REFERENCES. See Appendix A.

2. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve to establish a baseline so that an occupational exposure history can be compiled for each civilian or military employee for the Defense Occupational and Environmental Health Readiness System.

3. AUTHORITY. Electronic mail: MDARNG, Ms. Non-Responsive, 28 February 2003, subject: SAB.

4. BACKGROUND INFORMATION.

a. Armory Mission and Background Information. The Armory mission was Special Forces. The resident units were B-2 BN-20 Special Forces Group ABN and the C-1 BN-20 Special Forces Group ABN.

b. Date of Construction. The construction date was 1974.

c. Armory Use by Children. The point of contact (POC) stated that children occupied the drill area or classroom occasionally for family support meetings. The Maryland Military Department is currently advertising Glen Arm Armory as available for rental for activities that include young children.

d. POC. The POC was Mr. Non-Responsive Armory Manager, 10901 Notchcliff Road, Glen Arm, MD 21057-9998, Phone. 410-592-2535.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY
Printed on Recycled Paper

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3026 of 5269

BEST AVAILABLE COPY

5. FACILITY EVALUATION.

a. Sampling. Surface lead in dust, air and paint sampling was conducted to determine the existence of lead hazards. Results are shown in Appendix B.

b. Physical Condition of Facilities.

(1) Paint. The date of construction of the facility indicated that the use of lead in paint was likely.

(2) Asbestos. The POC stated that some pipe insulation may have been asbestos-containing material (ACM). No Asbestos Management Plan (AMP) was found.

(3) Mold and Moisture Problems. No mold or moisture problems were observed or reported.

(4) Building Physical Condition. The building was in good condition and had been well maintained. There was fresh paint throughout the facility.

(5) Indoor Firing Range (IFR). The IFR had been closed, lead had been abated, and the IFR had been converted to a locker room. This room was called the Team Room.

c. Safety and Occupational Health Programs. No Lead Hazard Management Plan or other occupational health program records were found.

d. Heating, Ventilation, and Air Conditioning Systems. The building was heated with central heat and air conditioning. The heating and cooling systems were not working effectively in the wing containing the supply rooms, the Team Room, and the Weight Room. Mr. Frick reported having submitted work orders but the ventilation problems had never been resolved.

e. Noise Dosimetry. No operations with the potential to generate hazardous noise levels were identified.

f. Lighting. All areas were visually judged to be adequately lit.

g. Other Building Concerns. The POC stated that the drinking water had a bad taste.

6. ASSESSMENT CRITERIA FOR LEAD. See Appendix C.

a. Lead in Air. The Army complies with the Occupational Safety and Health Administration (OSHA) 8-hour time-weighted average Permissible Exposure Limit of 50 micrograms of lead per cubic meter ($\mu g/m^3$) of air.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3027 of 5269

BEST AVAILABLE COPY

b. Lead in Dust. The Environmental Protection Agency (EPA) and State of Maryland limits for lead in dust are 40 micrograms per square foot (μg/ft^2) on floors, 250 μg/ft^2 on window sills, and 400 μg/ft^2 in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year. The National Guard Bureau (NGB) Region North concurs with the U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended safe limit of 200 μg/ft^2 on floors and frequently contacted surfaces, which is more stringent for window sills than the EPA/State standards.

c. Lead in Paint. Paint containing lead levels of 0.5 percent or more by weight in dried solid (also reported as 5000 milligrams per kilogram) is considered to be Lead Based Paint (LBP) according to both Federal and Maryland State Regulations. Paint containing lead levels of more than 0.7 milligrams per square centimeter is considered to be LBP according to Maryland State Regulations. In Army Regulation 420-70, Buildings and Structures, lead-contaminated paint (LCP) is defined as any paint containing detectable amounts of lead. The Army considers LCP to be potentially hazardous to children if it is disturbed or deteriorating.

d. Lead Carcinogenicity. The Department of Health and Human Services National Toxicology Program (NTP) released the Report on Carcinogens, Eleventh Edition in February 2005. The NTP report lists "lead and lead compounds" as "reasonably anticipated to be human carcinogens."

7. SAMPLING RESULTS, DISCUSSION, AND CONCLUSIONS.

a. Lead in Dust. Lead in dust sample locations and analytical results are shown in the Table. Sample results greater than 40 μg/ft^2 for floors or 200 μg/ft^2 for other surfaces are highlighted.

TABLE. Lead in Surface Dust Locations and Analytical Results.

Wipe Sample Number	Location of Samples	Result (μg/ft^2)
GAW01	LOCKER ROOM (CONVERTED IFR) FLOOR OF FORMER BULLET TRAP	25
GAW02	DESK TOP IN CONVERTED IFR	56
GAW03	FOOD PREPARATION AREA IN KITCHEN	<23
GAW04	WORK OUT ROOM ON WALL NEAR EXTERIOR EXIT	<23
GAW05	WINDOW SILL IN ROOM 125 A	568
GAW06	LOCKER ROOM OFF MEN'S ROOM. ROOM 124 ON FLOOR	<23
GAW07	ROOM 108 (STORAGE) SUPPLY ROOM FLOOR	97

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3028 of 5269

BEST AVAILABLE COPY

Three lead in dust results exceeded the EPA and State of Maryland limits for young children. One lead in dust result exceeded the NGB Region North and USACHPPM recommended decontamination levels for lead in dust on frequently contacted surfaces. There were very high levels of lead dust on the window sill in Room 125A. Personnel working in this room were potentially exposed to lead, and were tracking lead out of the area and redistributing it into adjacent rooms in the Armory. This can result in lead exposures for the general workforce and for children visiting this facility. Three lead in dust sample results exceeded the EPA and the State of Maryland lead exposure standard for children of 40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ on window sills. These levels are hazardous to children exposed to lead dust through physical contact, inhalation, or ingestion of lead dust while visiting the Armory.

b. Lead in Air. General area lead in air sampling was conducted in Room 104C, which was occupied by up to 14 people, and in Room 127A, which had the potential for three occupants. The air sample results were less than 4 $\mu g/m^3$, and were below the laboratory analytical reporting limit for lead in air of 1 μg/sample, as well as the OSHA standard of 50 $\mu g/m^3$ for lead in air over an 8 hour day.

c. Lead in Paint. Lead in deteriorated paint sampling was conducted on the supply (storage) room ceiling in Room 110. This sample result was also representative of the type of paint in Rooms 107, 108, and 110. The paint was LCP and may be hazardous to children.

d. Asbestos. There was a potential for exposure to asbestos in the Armory. Damaged asbestos insulation, if present, may become friable and asbestos fibers released, resulting in exposure to Armory occupants. The pipe insulation may be ACM. This should be confirmed by Armory records or by sampling. Army policy requires the Armory to establish and execute an AMP for any asbestos in the facility, and to take immediate corrective action where a possible asbestos hazard has been identified.

8. RECOMMENDATIONS. The Department of Defense Instruction 6055.1 provides Risk Assessment Codes (RACs) for health hazards, a procedure which allows assessment of the magnitude of exposure to physical, chemical, and biological agents and the possible medical effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single number. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead Exposure. Health Hazard RAC 3. Clean horizontal surfaces in the administrative areas to the NGB Region North and USACHPPM decontamination levels. Address all potential lead hazards before continuing to extend the use of this facility to children. If children will visit this facility, clean the floors in the Drill Hall and Classroom to the EPA lead in dust standards for young children, and clean other horizontal surfaces in the Drill Hall and Classroom to the NGB

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3029 of 5269

BEST AVAILABLE COPY

Region North and USACHPPM decontamination level for lead in dust on frequently contacted surfaces. Ensure that personnel wear disposable gloves and disposable coveralls as extra protection when working in all areas identified as having elevated levels of lead. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up.

b. Asbestos Exposure. Health Hazard RAC 3 if asbestos is present.

(1) Review Armory and the Maryland NGB office records to determine whether there are asbestos records for inspection and abatement, or if there is an AMP for Glen Arm Armory.

(2) Perform an asbestos survey if no records are located.

(3) If asbestos is found, develop and implement an AMP if there is not one for the Armory.

(4) If the insulation is determined to be ACM and becomes damaged, encapsulate or remove it as soon as possible.

c. Heating, Ventilation, and Air Conditioning Systems. RAC 3. Investigate operating problems with air handling unit systems. Consider re-surveying indoor air conditions in hot weather with windows closed and systems fully operational.

d. Other Building Concerns. RAC 3. Hire an accredited laboratory certified in lead in water analyses to test the drinking water from water fountains and faucets for lead and other contaminants.

9. PHOTOGRAPHS. See Appendix E.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3030 of 5269

BEST AVAILABLE COPY

10. ADDITIONAL ASSISTANCE. For additional assistance or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by electronic mail: Non-Responsive [redacted] @us.army.mil

Non-Responsive [redacted]
Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive [redacted]
Technical Program Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3031 of 5269

BEST AVAILABLE COPY

APPENDIX A

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

1. Title 29, Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration, current edition.
http://www.osha.gov/comp-links.html

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, August 19, 1998.
http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

3. AR 40-5, Medical Service, Preventive Medicine, 15 October 1990.
http://www.usapa.army.mil/pdffiles/r40_5.pdf

4. AR 385-10, The Army Safety Program, 29 February 2000.
http://www.usapa.army.mil/pdffiles/r385_10.pdf

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 October 2000.
http://www.usapa.army.mil/pdffiles/p40_503.pdf

6. USACHPPM Interim Report No. 39-EJ-1157-99, Derivation of Wipe Surface Screening Levels for Environmental Chemicals, 1999.

7. OSHA Instruction, CPL 02-02-058 - CPL 2-2.58 - 29 CFR 1926.62, Lead Exposure In Construction; Interim Final Rule-- Inspection and Compliance, Procedures, 1993.
http://www.osha.gov/pls/oshaweb/owadisp.show_document?p_table=DIRECTIVES&p_id=1570

8. U.S. Department of Housing and Urban Development (HUD), Technical Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing 1998.
http://www.hud.gov/offices/lead/guidelines/hudguidelines/index.cfm

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3033 of 5269

BEST AVAILABLE COPY

APPENDIX B

SAMPLING SHEETS AND LAB ANALYSES

BEST AVAILABLE COPY

Glen Arm - Lead Dust Wipe Samples

Wipe Sample #	Armory	City	Indoor Range Info: Active	Inactive	N/A	Cleaned?	Location of Samples	Conc. (µg/ft²)
			No			Yes		
GAW01	Glen Arm	Glen Arm					Locker room (Converted FR) floor where forever bullet trap	25
GAW02	Glen Arm	Glen Arm					Desk top in converted FR	56
GAW03	Glen Arm	Glen Arm					Food prep area in kitchen	BDL
GAW04	Glen Arm	Glen Arm					Work out room on wall near exterior exit	BDL
GAW05	Glen Arm	Glen Arm					Window sill in room 125 A	568
GAW06	Glen Arm	Glen Arm					Locker room off men's room . Room 124 on floor	BDL
GAW07	Glen Arm	Glen Arm					Room 108 (storage) supply room floor	97

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

August 15, 2003

Laboratory Code:	**RES**
Subcontract Number:	**NA**
Laboratory Report:	**RES 96187-1**
Project Description:	**None Given**
	None Given

Non-Responsive
USACHPPM
USACHPM, ATTN: MCHB-TS-OFS Bldg 1570
APG MD 21010

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the American Industrial Hygiene Association, Lab ID 101533 - Accreditation Certificate #480. The laboratory is currently proficient in both PAT & ELPAT programs respectively.

Reservoirs has analyzed the following sample(s) using Atomic Emission Spectroscopy - Inductively Coupled Plasma (AES-ICP) per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the analysis table. Results have been sent to your office.

RES 96187-1 is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those authorized by the client. Samples will be disposed of after sixty days unless longer storage is requested. If you should have any questions about this report, please feel free to call me at 303-964-1986.

Sincerely,

Non-Responsive
President

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3036 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accreditation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	**RES 96187-1**
Client:	**USACHPPM**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**None Given**
Date Samples Received:	**August 4, 2003**
Analysis Type:	**USEPA SW846 3050B / AA(7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 11, 2003**

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
CF BLANK01	EM 802204	0.11	BDL	23	BDL
CF W01	EM 802205	0.11	BDL	23	BDL
CF W02	EM 802206	0.11	BDL	23	BDL
CF W03	EM 802207	0.11	BDL	23	BDL
CF W04	EM 802208	0.11	BDL	23	BDL
CF W05	EM 802209	0.11	8.0	23	73
CF BLANK02	EM 802210	0.11	BDL	23	BDL
CF W06	EM 802211	0.11	46.3	23	421
CF W07	EM 802212	0.11	BDL	23	BDL
WR BLANK01	EM 802213	0.11	BDL	23	BDL
WR W01	EM 802214	0.11	BDL	23	BDL
WR W02	EM 802215	0.11	BDL	23	BDL
WR W03	EM 802216	0.11	150.0	23	1364
WR W04	EM 802217	0.11	14.5	23	132
WR W05	EM 802218	0.11	BDL	23	BDL
WR BLANK02	EM 802219	0.11	BDL	23	BDL
WR W06	EM 802220	0.11	BDL	23	BDL
WR W07	EM 802221	0.11		No Sample Submitted In Tube	
EC BLANK01	EM 802222	0.11	BDL	23	BDL
EC W01	EM 802223	0.11	BDL	23	BDL
EC W02	EM 802224	0.11	BDL	23	BDL
EC W03	EM 802225	0.11	2.5	23	23
EC W04	EM 802226	0.11	BDL	23	BDL
EC W05	EM 802227	0.11	BDL	23	BDL
EC BLANK02	EM 802228	0.11	BDL	23	BDL
EC W06	EM 802229	0.11	BDL	23	BDL
EC W07	EM 802230	0.11	BDL	23	BDL
EC W08	EM 802231	0.11	BDL	23	BDL
GA BLANK01	EM 802232	0.11	BDL	23	BDL
GA W01	EM 802233	0.11	2.7	23	25

BDL = Below Detection Limit

Data Qa _____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3037 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD BY WIPE SAMPLING

RES Job Number:	**RES 96187-1**
Client:	**USACHPPM**
Client Project Number / P.O.:	**None Given**
Client Project Description:	**None Given**
Date Samples Received:	**August 4, 2003**
Analysis Type:	**USEPA SW846 3050B / AA(7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 11, 2003**

Client ID Number	Lab ID Number	Sample Area (sq.ft.)	LEAD (µg)	Detection Limit (µg/sq.ft.)	LEAD CONCENTRATION (µg/sq.ft.)
GA W02	EM 802234	0.11	6.2	23	56
GA W03	EM 802235	0.11	BDL	23	BDL
GA W04	EM 802236	0.11	BDL	23	BDL
GA W05	EM 802237	0.11	62.5	23	568
GA BLANK02	EM 802238	0.11	BDL	23	BDL
GA W06	EM 802239	0.11	BDL	23	BDL
GA W07	EM 802240	0.11	10.7	23	97

***Calculations Based On A 1 sq.ft. Sample Area Unless Otherwise Noted**

BDL Below Detection Limit

Data Qa ___ ____

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3038 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN PAINT

RES Job Number:	RES 96188-1
Client:	USACHPPM
Client Project Number / P.O.:	None Given
Client Project Description:	None Given
Date Samples Received:	August 4, 2003
Analysis Type:	USEPA SW846 3050B / AA (7420)
Turnaround:	3-5 Day
Date Samples Analyzed:	August 11, 2003

Client ID Number	Lab ID Number	Detection Limit (%)	LEAD CONCENTRATION (%)
CF BULK 01	EM 802169	0.005	BDL
CF BULK 02	EM 802170	0.005	0.053
CF BULK 03	EM 802171	0.006	0.072
CF BULK 04	EM 802172	0.005	0.093
CF BULK 05	EM 802173	0.005	0.134
EC BULK 01	EM 802174	0.009	0.270
EC BULK 02	EM 802175	0.005	0.052
EC BULK 03	EM 802176	0.005	0.047
EC BULK 04	EM 802177	0.005	BDL
EC BULK 05	EM 802178	0.005	0.005
GA BULK 01	EM 802179	0.005	0.012

BDL - Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3039 of 5269

BEST AVAILABLE COPY

DATA CHEM LABORATORIES, INC.

Submitted To: Non-Responsive
Commander, USACHPPM
MCHB TS OFS; 5158 Blackhawk Road
APG, MD 21010-5403

Reference Data:	**Lead**
Client Sample No.:	GAAS01 through GABLANK02
P.O. No.:	Not Available
Sample Location:	Glen Arm NG Armory
Sample Type:	Filter
Method Reference:	NIOSH 7300
DCL Set ID No.:	03-S-3737
DCL Sample ID No.:	03-22938 through 03-22941
Sample Receipt Date:	8/4/2003
Preparation Date:	08/06/03
Analysis Date:	08/07/03

The samples were prepared and analyzed in accordance with NIOSH method 7300 using a Perkin Elmer 3000XL ICP.

The sample condition upon receipt was acceptable except where noted.

The results are in the enclosed data table. Results relate only to the items tested and are not blank corrected unless indicated in the data table.

This report shall not be reproduced except in full, without the written approval of the laboratory.

Non-Responsive
Analyst

Non-Responsive
Reviewer

CINCINNATI OFFICE
4388 GLENDALE-MILFORD ROAD
CINCINNATI, OHIO 45242-3706
513 733-5336, FAX 513 733-5347

WEST COAST OFFICE
11 SANTA YORMA COURT
NOVATO, CALIFORNIA 94945
800 280-8071, FAX 415 893-9469

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

BEST AVAILABLE COPY

Results
Lead

Client #	DCL #	Sample Volume (L)	µg/sample	mg/m^3
GAAS01	03-22938	242.8	ND	<0.004
GAAS02	03-22939	271.4	ND	<0.004
GABLANK01	03-22940	0	ND	-
GABLANK02	03-22941	0	ND	-
	Prep Blank		ND	
% Recovery	LCS		99.	
RPL			**1.**	

ND = not detected at or above the reporting limit (RPL).
LCS = laboratory control sample.

Non-Responsive [redacted]
Analyst

Non-Responsive [redacted]
Reviewer

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3041 of 5269

BEST AVAILABLE COPY

APPENDIX C

ASSESSMENT CRITERIA FOR LEAD

BEST AVAILABLE COPY

SUBJECT: National Guard Bureau Region North Industrial Hygiene Office
Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 µg/ft². This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. EPA standards (40 CFR 745.227(e) (8) (viii)) and State of Maryland standards are not directly applicable because they are developed for floors (40 µg/ft²), windowsills (250 µg/ft²)and window troughs (400 µg/ft²) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. OSHA has no specific requirement for work area surfaces. The OSHA lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. OSHA cites a level of 200 µg/ft² in OSHA Instruction CPL 2-2.58 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 µg/ft² is a safe surface contamination level for adult exposures. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels higher than those recommended above do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All States will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 50 µg/m³ averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3043 of 5269

BEST AVAILABLE COPY

APPENDIX D

LEAD CLEANING GUIDANCE

BEST AVAILABLE COPY

BEST AVAILABLE COPY

CHAPTER 14:

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3045 of 5269

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14–19
A. Final Cleaning 14–19
1. Decontamination of Workers, Supplies, and Equipment 14–19
B. Preliminary Visual Examination 14–20
C. Surface Painting or Sealing of Nonfloor Surfaces 14–20
D. Final Inspection 14–20
E. Recleaning After Clearance Failure 14–20
VI. Cleaning Cost Considerations 14–21
A. Initial Clearance Test Failure Rates 14–21
B. Key Factors In Effective Cleaning 14–21
C. Special Problems 14–21
VII. Alternative Methods 14–22
A. Vacuums 14–22
B. Trisodium Phosphate and Other Detergents 14–22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3046 of 5269

BEST AVAILABLE COPY

Step-by-Step Summary

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3047 of 5269

BEST AVAILABLE COPY

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

- HEPA vacuums.
- Detergent.
- Waterproof gloves.
- Rags.
- Sponges.
- Mops.
- Buckets.
- HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
- 6-mil plastic bags.
- Debris containers.
- Waste water containers.
- Shovels.
- Rakes.
- Water-misting sprayers.
- 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3048 of 5269

BEST AVAILABLE COPY

Chapter 14:

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris and dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3049 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3050 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3051 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards and were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3052 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

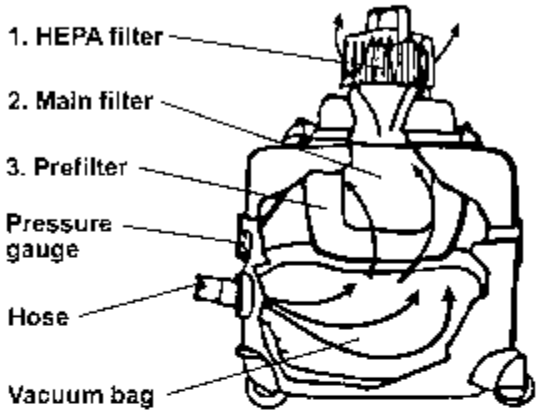

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and prefilter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the prefilter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

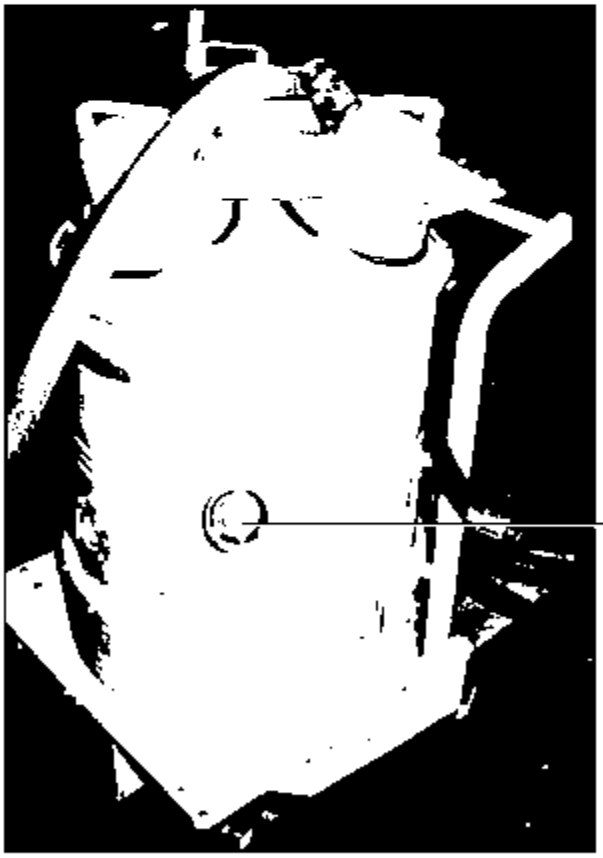

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3053 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

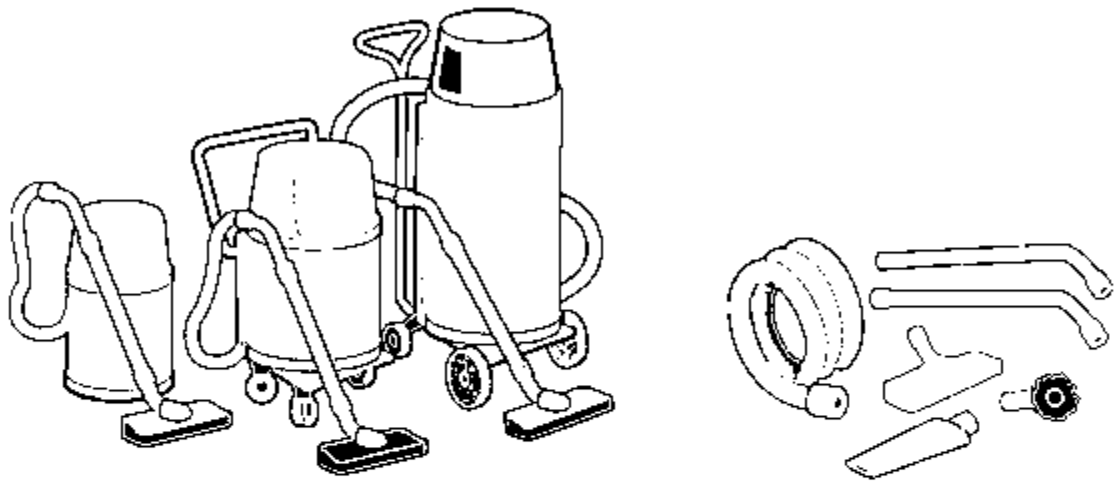

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3054 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

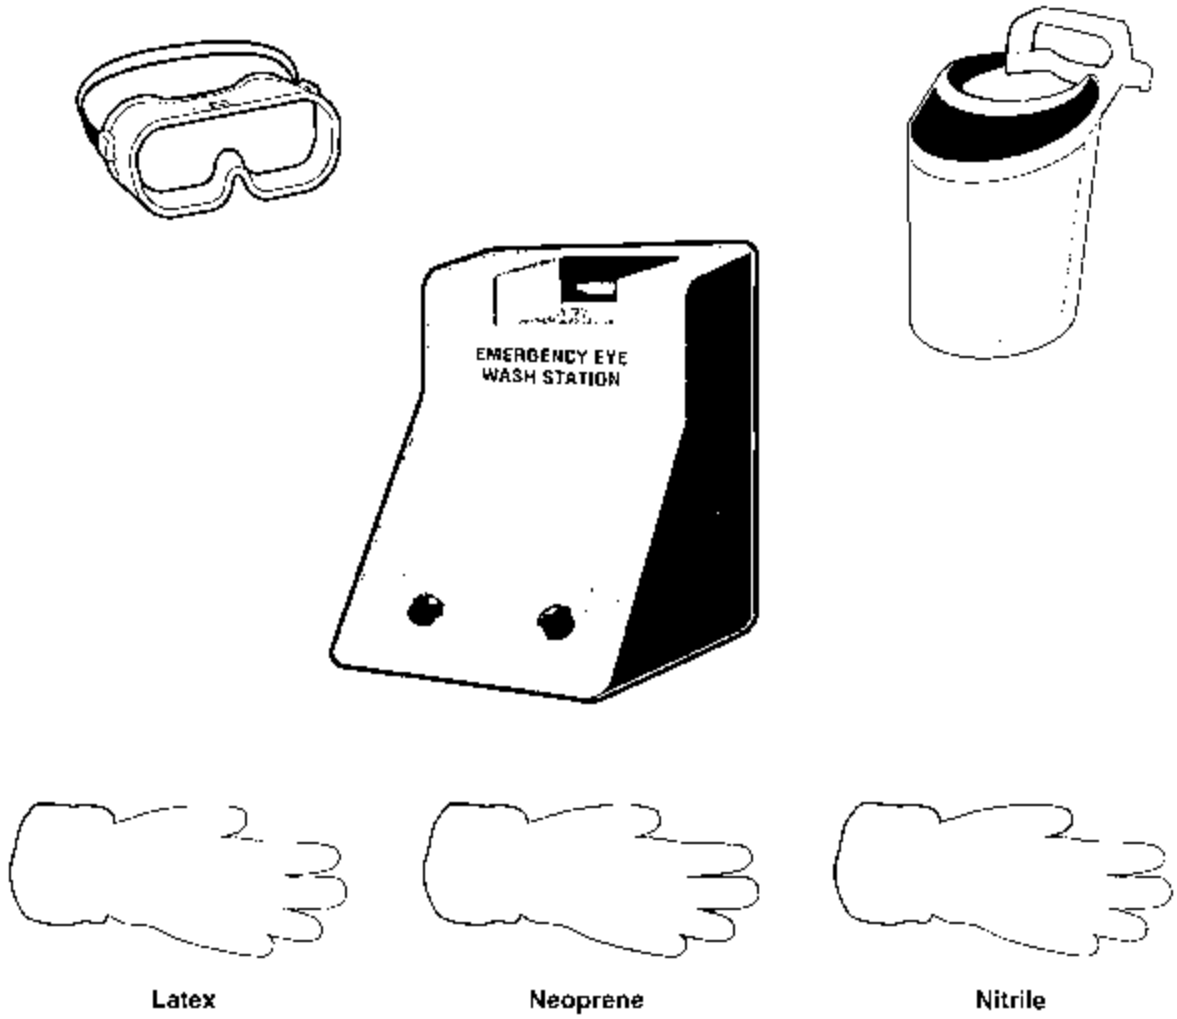

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3055 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

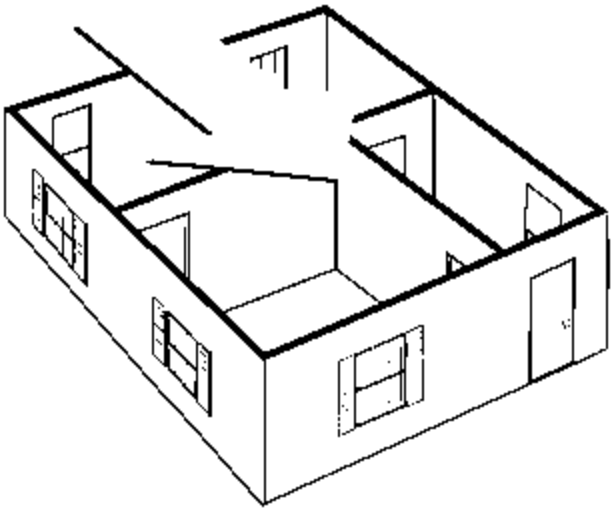

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3056 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

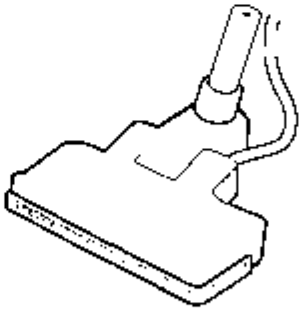

Powered Carpet Beater

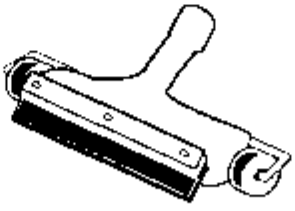

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3057 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents
Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

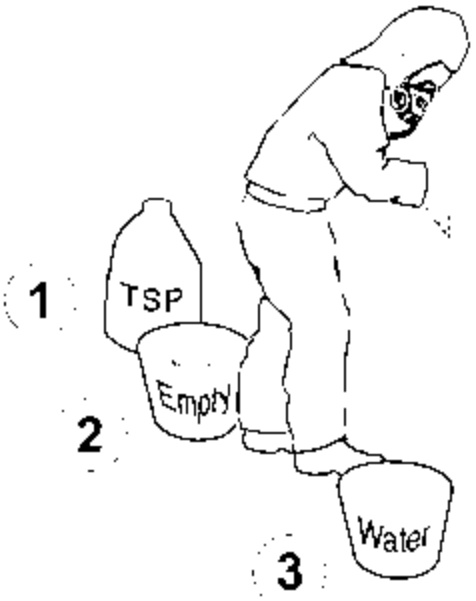

Wipe All Surfaces

Wet Mop Floor

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3058 of 5269

BEST AVAILABLE COPY

APPENDIX E

PHOTOGRAPHS

BEST AVAILABLE COPY

1432

1431

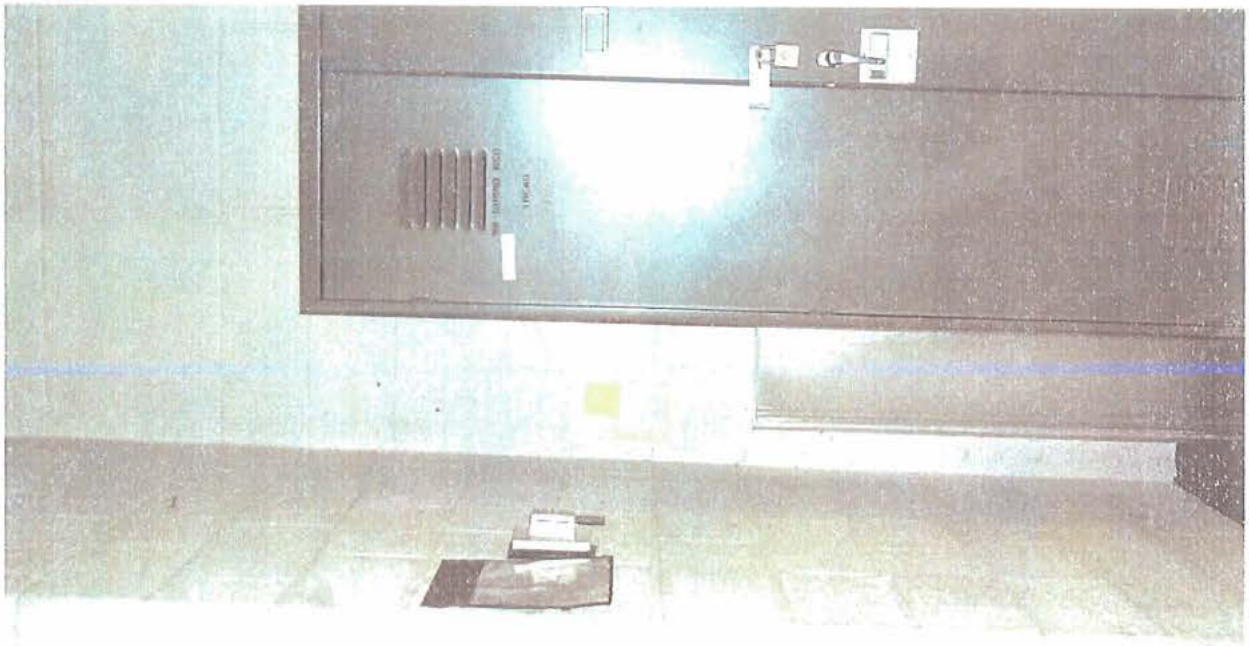

1434

1433

1436

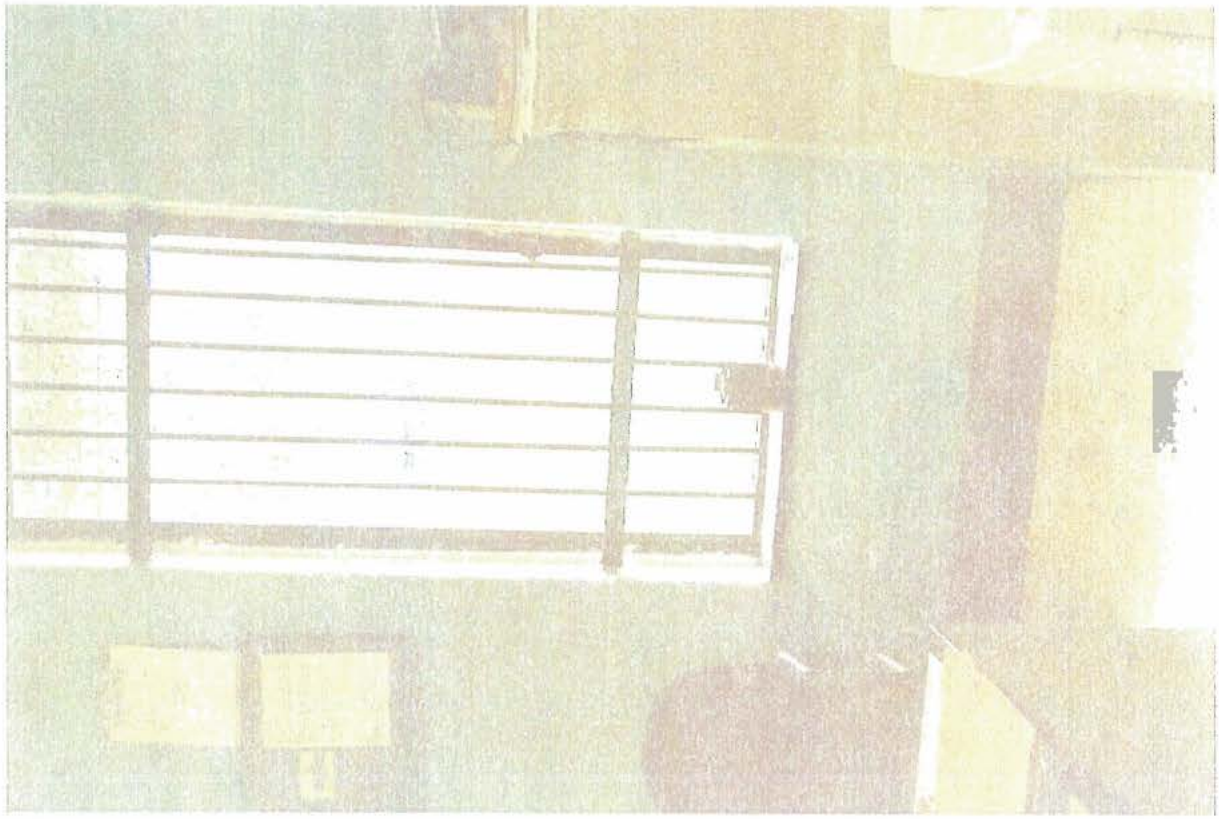

1435

1438

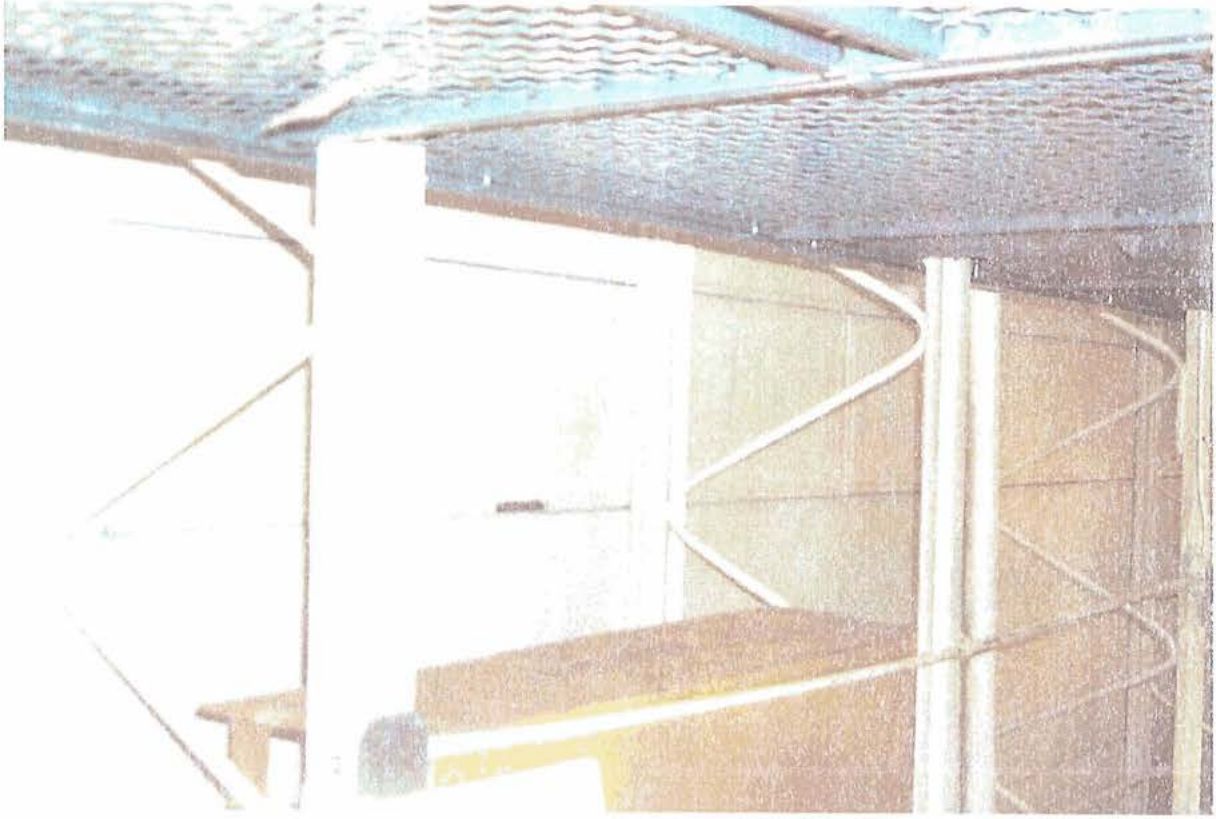

1437

BEST AVAILABLE COPY

Industrial Hygiene Study

National Guard Facility
Glen Arm Readiness Center
10901 Notchcliff Road
Glen Arm, MD
21057

Prepared for:

National Guard Bureau Region North IH Office
301-IH Old Bay Lane
Havre de Grace, Maryland
21078

Prepared by:

The EI Group, Inc.
2101 Gateway Centre Blvd.
Morrisville, North Carolina
27560

Report Date: December 30, 2008

Project ID: IHMO080101.03

Non-Responsive [redacted]

Manager, Charlotte Operations

Non-Responsive [redacted]

Senior Industrial Hygienist

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3064 of 5269

TABLE OF CONTENTS

Executive Summary	3
Operation Description	4
Noise	4
Lead Testing	4
Lighting	5
Indoor Air Quality	6
Suspect ACBM	8
Maintenance Bay	8
Ventilation Assessment	8
Limitations	8
References	9

List of Appendices

Appendix A: Photographs

Appendix B: Laboratory Analysis Report

EXECUTIVE SUMMARY

An industrial hygiene survey was conducted August 5, 2008 at the Readiness Center located in Glen Arm, Maryland. The study was performed by Mr. Non-Responsive, CIH.

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lighting within the facility was also evaluated. Lighting was found to be within applicable recommended levels.

Various surfaces within the HVAC system and throughout the facility were screened for lead. The screening was completed using surface/wipe and air samples. None of the air samples collected were found to have detectable levels of the respective lead contaminant, and three (3) of the six (6) surface samples collected were found to have detectable levels of lead.

Indoor air quality parameters were also evaluated during the assessment. Indoor air quality was found to be within those parameters established by the Environmental Protection Agency (EPA) and American Society of Heating, Refrigerating, and Air-conditioning Engineers, Inc. (ASHRAE). The firing range is inactive, having been converted into a locker room, but could have contributed to lead exposure to building occupants. If not addressed, these may provide sources of poor indoor air quality.

During the assessment, written programs for Health and Safety, NESHAP Operations and Maintenance Asbestos Survey, and the Hazard Communication Program were requested for review, however, the onsite personnel was not able to locate the documents.

Operation Description

The Glen Arm Readiness Center primarily serves as an equipment storage facility and administrative work. The facility consists of a single story response center that contains office spaces, classrooms, a kitchen area, an assembly hall, mechanical room, locker rooms, and unit storage areas.

The exterior walls of the building were constructed of a concrete block system (CBS) finished with red brick. The interior walls were composed of concrete block and in some areas were finished with drywall. The roof of the facility consisted of two systems; one a flat rubber membrane roof system covered with stone, and the other a pitched metal roof system. The heating, ventilating, and air conditioning system (HVAC) consisted of a split direct-expansion (DX) system. The floors were composed of a poured concrete slab and in some areas were finished with vinyl floor tiles. The ceilings were generally composed of metal corrugated roof deck and in some areas were finished with a suspended drop ceiling system.

Site personnel at the time of the site assessment consisted of five (5) administrative maintenance personnel. The employees on site were conducting general administrative work.

Noise Survey

Employees were not performing tasks that provided excessive noise levels, as such; noise exposure monitoring was not conducted.

Lead Testing

At the time of the assessment, no activities were observed which may lead to lead exposure other than ammunition handling. The facility contains an indoor firing range that was converted to a locker area.

Various surfaces within the facility were screened for lead using surface/wipe samples and the collection of air samples. Surface/wipe samples were collected using Ghost Wipe™ samples and were collected in accordance with the ASTM E 1792 protocols. Air samples were collected using 0.8 µm MCE cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, MD for lead analysis using EPA Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix B.

Lead Testing Results Summary

Location	Air ug/m^3	Surface ug/ft^2	Bulk	Chip %Pb
Range	ND			
Left Hallway	ND			
Blank	ND			
Room 105 Return		170		
Left Hallway Floor		ND		
Range-Top of Locker		ND		
Kitchen- Top of Refrigerator		170		
Room 116-Top of Desk		ND		
Room 105-Supply Duct		**1600**		
Blank		ND		
Criteria	**50**	**200**	**5,000**	**0.5**

Key: ND – None Detected
PB – Lead

Detectable levels of lead were identified in the kitchen and office 105. The National Guard Bureau currently utilizes 200 ug/ft^2 as a benchmark for identifying contaminated surfaces. In the" Derivation of Wipe Surface Screening Levels for Environmental Chemicals", the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) has determined that 200 ug/ft^2 is a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, HUD levels of 40 µg/ft^2 on floors and 250 µg/ft^2 on windowsills should be observed.

No detectable levels of lead were identified in those air samples collected. Currently, OSHA observed an 8-hour time weighted average of 50 ug/m^3.

Lighting

A lighting assessment was conducted throughout the facility. The survey was conducted with large bay doors closed. Measurements were collected using a Cooke Cal-Light 400L Precision Light Meter (Serial No. 98047EL). The light meter was last calibrated on February 22, 2008. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles	Recommended Lighting	Sufficient Lighting
Room 105	44-63	30-50	Yes
Foyer	42-102	10	Yes
Room 127	48-56	30-50	Yes
Right Hallway	38-62	5	Yes
Room 117	78-142	30-50	Yes
Room 117 @ Desk	96-102	30-50	Yes
Left Hallway	7-57	5	Yes
Locker Room 112-Old Range	11-31	7	Yes
Room 120-Gym	19-38	30	Yes
Room 121-Latrine	5-17	5	Yes

Lighting within the facility was found to be sufficient.

Indoor Air Quality

Survey measurements were made for ventilation and comfort parameters (carbon dioxide, temperature, and relative humidity). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTrak IAQ Meter, Model 8550 (Serial No. 11050). The IAQ Meter was last calibrated in January 2008.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2004). ASHRAE specifies temperature and relative humidity ranges for human comfort (ASHRAE 55-2004). The US Army Technical Guide 277, Army Facilities Management Information Document on Mold remediation Issues, recommends maintaining a relative humidity range between 30 to 60% in occupied areas.

The recommendations for temperature and humidity are based on seasonal and regional influences to allow comfort for 80% of a building's population. The temperature readings from the interior of the structure ranged from 77.9°F to 79.7°F with relative humidity readings ranging from 50.5% to 57.9%. The results of the testing for relative humidity exceeded the US Army guidelines in none of the ten (10) locations tested. Temperature was within the recommended guidelines with the exception of the latrine and room 105, which were found to be higher than the recommended temperature of 79.0 degrees Fahrenheit.

During the survey, CO_2 levels ranged from 403 ppm to 468 ppm within the facility compared to an outdoor CO_2 level of 410 ppm. Based on the outdoor levels observed at the time of the testing, the maximum indoor concentration of CO_2 recommended is 1,110 ppm (410 ppm + 700 ppm). The results of the testing met the ASHRAE guidelines.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Office 105	79.7	54.6	442	0
Front Hallway	78.8	55.9	461	0
Office 127	78.8	57.9	468	0
Right Side Hall	78.6	52.3	403	0
Class 117	78.8	53.9	407	0
Left Side Hall	79.7	52.1	442	0
Locker Room/ Range 112	77.9	55.5	436	0
Drill Hall	78.8	53.4	441	0
Gym 120	78.7	50.5	416	0
Latrine 121	79.7	52.1	446	0
Outdoors	85.2	45.3	410	0
Criteria	**73.0-79.0**	**30-50**	**<1,110**	**<9.0**

Housekeeping within the facility was poor. Carpeting was damaged and deteriorated, HVAC components were found to have significant dust accumulation. HVAC components could not be assessed at the time of the inspection. The HVAC filter of the system located in 106 could not be removed due to the proximity of piping. HVAC components located in the boiler room and gym were found to be in poor condition and laden with dust and debris. Rooms 105, 127 A and 127B as well as 117A were found to contain water impacted ceiling panels. Additionally, site personnel suggest that no maintenance activities have been performed within the facility for over 3 years. HVAC filters were found to contain significant dust loading. Carpeting was found to be in poor condition through the facility.

Air quality samples were collected from Rooms 105, 102 Hall, and 117A as well as outdoors (as control). Samples were collected due to the presence of significant moisture impacted building materials. Indoor fungal spore levels ranged from <28 spores/m^3 to 468 spores/m^3. The concentration observed outdoors was found to be 11,300 spores/m^3. The highest indoor concentration was identified in room 127B.

Location	Concentration	Predominant Genera
Office 105 (Sample 500-4)	468 sp/m^3	Basidiospores
Office 127B (Sample 500-5)	2,450 sp/m^3	Basidiospores
Foyer 102 (Sample 500-6)	413 sp/m^3	Basidiospores
Class 117 (Sample 500-7)	<28 sp/m^3	NA
Outdoors (Sample 500-8)	11,300 sp/m^3	Basidiospores

Based on a review of the analytical data, no amplification of fungal spores was present despite the presence of significant moisture intrusion into the facility.

Suspect Asbestos Containing Building Materials

Suspect asbestos containing materials include sheetrock/joint compound, floor tiles and associated mastic (both 9” x 9” and 12” x 12”), and vinyl covebase. Thermal system insulation was found to be paper wrapped fiberglass with PVC elbows.

Maintenance Bay

The maintenance bay was not found to contain a local exhaust ventilation system which was not operable. The Maintenance Bay is used for vehicle storage and on the day of the site visit was being used as a carpentry shop.

The maintenance bay was found to contain custodial items, tools, waste motor oil, ladders and flammable storage cabinet. The flammable storage cabinet contained various paints and cleaning solvents.

PPE identified in the site included safety glasses and chemical gloves. Materials were kept in good, clean condition.

Ventilation System Assessment

The facility was found to contain three HVAC mechanical systems located throughout the building. All three units were found to be in poor condition. Based on information provided by site personnel, no maintenance activities have been conducted in over three years.

Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicated within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and The EI Group, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

References

Title 29 Code of Federal Regulations (CFR), Part 1910, Occupational Safety and Health Administration.

Lead - (29 CFR 1910.1025(h))

American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2008 Edition

Industrial Ventilation: A Manual of Recommended Practice for Design, 25th Edition

Georgia Army National Guard: Standard Army Safety and Occupational Health Inspection Checklist; 1 October 1999 Edition

ANSI Z358.1 – 2004, Emergency Eye Wash and Shower Equipment

American Society of Heating, Refrigerating and Air-Conditioning Engineers, Ventilation for Acceptable Indoor Air Quality, 62.1-2007.

RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI

National Emission Standard Hazardous Air Pollutants (NESHAP) - The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

Environmental Protection Agency (EPA) standards (40 Code of Federal Regulations (CFR) 745.227(h)(3))

Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM)

The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation

BEST AVAILABLE COPY

Appendix A

Photographs

BEST AVAILABLE COPY

Exterior view of facility

Room 105: Water damaged ceiling panels

BEST AVAILABLE COPY

Hallway (102): Water damaged ceiling panels

Water damaged ceiling tiles: Room 127

BEST AVAILABLE COPY

View of old firing range. Converted to locker room

Exterior view of facility

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

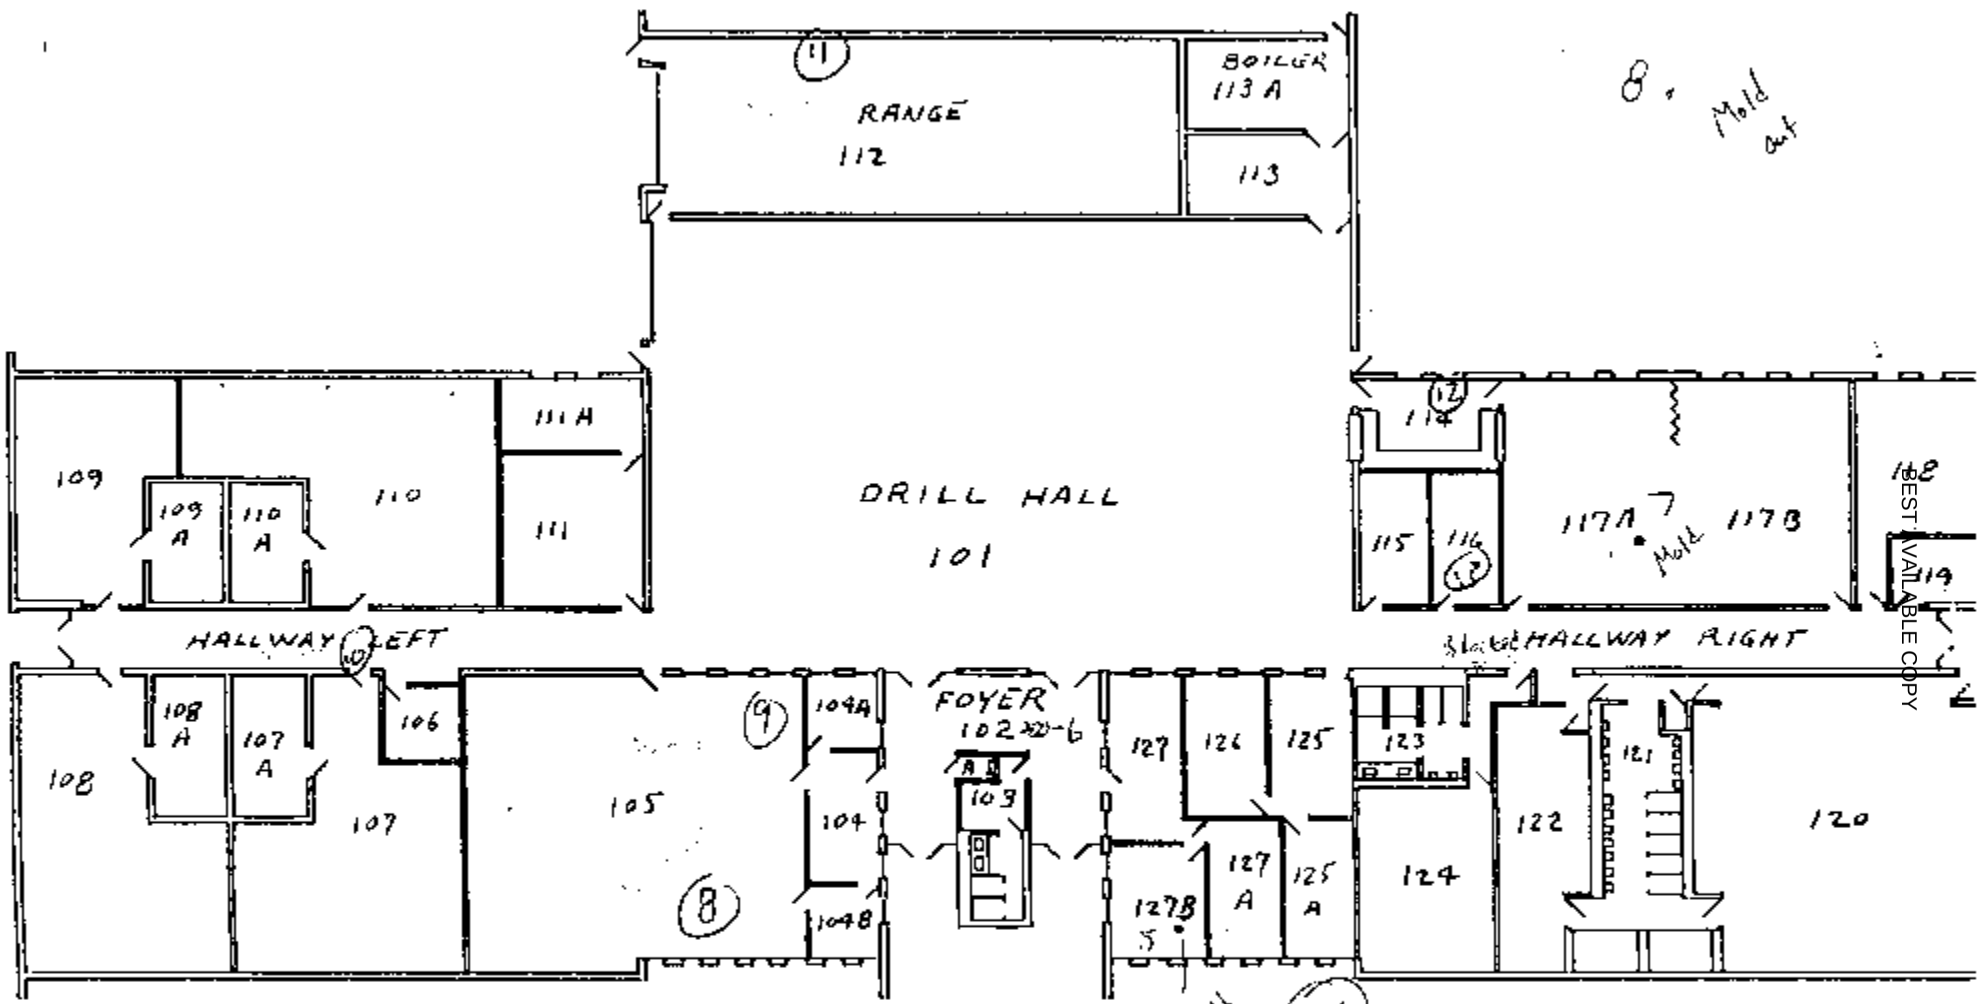

(12) Top of Frider 100 cm²

(13) 116 Top of Desk 100 cm²

14 Blank

(15) ~~8~~ Supply duct (10 × 2) + (7 × 2)

(9) Rotor 15 × 1

(10) Flr 100 cm²

(11) Locker Top 100 cm²

PURNELL ARMORY

FLOOR PLAN
NO SCALE

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

Appendix B
Analytical Reports

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

Invoice: 95230

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI	**Job Location:**	Not Provided	**Date Submitted:**	10/1/2008
	State Military Reservation	**Job Number:**	Not Provided	**Date Analyzed:**	10/8/2008
	Havre de Grace, Maryland	**P.O. Number:**	Not Provided	**Date Invoiced:**	10/8/2008
	21078			**Person Submitting:**	Non-Responsive

Attention: Non-Responsive

Page 1 of 1

AMA Sample #	Client Sample #	Analysis and Sample Type	Turn Around	Cost	Additional Analysis and Sample Type *	Turn Around *	Additional Cost *	Total Cost
0881923	500-1	AA Lead Air	5 Day +	$8.00				$8.00
0881924	500-2	AA Lead Air	5 Day +	$8.00				$8.00
0881925	500-3	AA Lead Air	5 Day +	$8.00				$8.00
0881931	9	AA Lead Wipe	5 Day +	$8.00				$8.00
0881932	10	AA Lead Wipe	5 Day +	$8.00				$8.00
0881933	11	AA Lead Wipe	5 Day +	$8.00				$8.00
0881934	12	AA Lead Wipe	5 Day +	$8.00				$8.00
0881935	13	AA Lead Wipe	5 Day +	$8.00				$8.00
0881936	14	AA Lead Wipe	5 Day +	$8.00				$8.00
0881937	15	AA Lead Wipe	5 Day +	$8.00				$8.00
0881926	500-4	MLD Spore Trap	5 Day +	$30.00				$30.00
0881927	500-5	MLD Spore Trap	5 Day +	$30.00				$30.00
0881928	500-6	MLD Spore Trap	5 Day +	$30.00				$30.00
0881929	500-7	MLD Spore Trap	5 Day +	$30.00				$30.00
0881930	500-8	MLD Spore Trap	5 Day +	$30.00				$30.00

Sub-Total:	$230.00
Additional Charge:	$0.00
Total:	$230.00

Note: Payment Due Upon Receipt.

Note: All Accounts over 30 days are subject to a 1½% per month service charge.

* Only apply if additional analysis was performed on the sample(s)

Account Code: NATLG

Remit to: P.O. Box 646, Hanover, Maryland 21076, 410-684-3327

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaiqap.org for details

100470

NY ELAP

10920

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/8/2008 **Report Date:** 9/8/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

Page 1 of 2

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Final Result			Comments
0881923	500-1	Flame	Air	1068	N/A	2.81	ug/m³	<	2.8	ug/m³	
0881924	500-2	Flame	Air	1005	N/A	2.99	ug/m³	<	3	ug/m³	
0881925	500-3	Flame	Air Blank	0	N/A	3.00	ug/m³	<	3	ug	
0881931	9	Flame	Wipe	****	0.108	111.52	ug/ft²		170	ug/ft²	
0881932	10	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0881933	11	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0881934	12	Flame	Wipe	****	0.108	111.52	ug/ft²		170	ug/ft²	
0881935	13	Flame	Wipe	****	0.108	111.52	ug/ft²	<	110	ug/ft²	
0881936	14	Flame	Wipe Blank	****	N/A	12.00	ug	<	12	ug	
0881937	15	Flame	Wipe	****	0.037	327.87	ug/ft²		1600	ug/ft²	

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-[illegible]-0085 (MD)
Released by National Guard Bureau
Page 3080 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

ACCREDITED LABORATORY AIHA Environmental Lead See aihaelap.org for details

100470

NY ELAP 10920

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-lH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	Not Provided	**Date Analyzed:**	9/8/2008 **Report Date:** 9/8/2008

Attention: [redacted]

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7420; Water: SM-3111B

Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7421; Water: SM-3113B

N/A = Not Applicable mg/Kg = parts per million (ppm) by weight mg/L = parts per million (ppm)

%Pb = percent lead by weight ug = micrograms ug/L = parts per billion (ppb)

Note: All samples were received in good condition unless otherwise noted.

Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

See QC Summary for analytical results of quality control samples associated with these sampes.

NY ELAP accrediation applies only to paint chip, wipe, and water samples.

Analyst: Melissa Sampson

Technical Manager: G Edward Carney

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-10085 (MD)
Released by National Guard Bureau
Page 3081 of 5269

Posted to NGB FOIA Reading Room
May, 2018

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. NVLAP accreditation applies only to polarized light microscopy of bulk samples and transmission electron microscopy of AHERA air samples. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16543

Analysis Type: Flame
Sample Type: Wipe
Analysis Date: 9/8/2008

	Result		Percent Recovery	RPD	Comment
Preparation Blank	-0.113	ppm			Acceptable
Report Limit Verification Sample	0.2343	ppm	70.3%		Outside Limits
Expected Spike Level (ppm) 0.3333					
Duplicate Sample 1	#Num!	mg/Kg			
Duplicate Sample 2	#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis					
Spiked Sample			99.69%		Acceptable
Spike Duplicate					Acceptable
Laboratory Control Sample 1	330.278	µg	102.38%		Acceptable
Laboratory Control Sample 2	294.439	µg	100.89%	1.47%	Acceptable

Calibration Information

Correlation of Calibration Curve 0.999768

All calibration verification samples are within acceptance limits.

Notes: Recovery for the Report Limit Verification Sample was 70.3%, below the lower control limit of 80%. A passing Report Limit Verification sample for wipe samples for this analysis date can be found with SDG 16540 (119.02% recovery).

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181396	81888	L1
181396	81889	L1A

SDG Number: 16543

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3082 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
181396	81890	L2
181396	81891	L3
181396	81892	L4
181396	81893	L5
181396	81894	L6
181396	81895	L7
181396	81896	L8
181396	81897	L9
181396	81898	L10
181399	81931	9
181399	81932	10
181399	81933	11
181399	83934	12
181399	81935	13
181399	81936	14
181399	81937	15

SDG Number: 16543

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3083 of 5269

BEST AVAILABLE COPY

AMA Analytical Services, Inc.

QC Summary

Sample Delivery Group: 16542

Analysis Type: Flame
Sample Type: Air
Analysis Date: 9/8/2008

		Result		Percent Recovery	RPD	Comment
Preparation Blank		0.010	ppm			Acceptable
Report Limit Verification Sample		0.2686	ppm	107.4%		Acceptable
Expected Spike Level (ppm)	0.25					
Duplicate Sample 1		#Num!	mg/Kg			
Duplicate Sample 2		#Num!	mg/Kg		#Error	#Error
Matrix Spike Analysis						
Spiked Sample				102.73%		Acceptable
Spike Duplicate				99.56%	3.14%	Acceptable
Laboratory Control Sample 1		133.956	µg	103.29%		Acceptable
Laboratory Control Sample 2		120.145	µg	100.16%	3.07%	Acceptable

Calibration Information

Correlation of Calibration Curve: 0.999875

All calibration verification samples are within acceptance limits.

Notes:

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
182853	81722	84081
182853	81724	84083

SDG Number: 16542

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3084 of 5269

BEST AVAILABLE COPY

Samples included in this Sample Delivery Group (SDG)

Chain Of Custody	AMA Sample Number	Client Sample Number
182853	81738	84087
182853	81739	84088
503162	81781	OLN-LA-01
503162	81782	OLN-LA-FB1
503158	81797	HLN-LA-01
503158	81798	HLN-LA-FB1
503165	81852	JTN-LA-01
503165	81853	JTN-LA-FB1
181396	81872	1
181396	81873	2
181396	81874	3
181398	81913	516-1
181398	81914	516-2
181398	81915	516-3
181399	81923	500-1
181399	81924	500-2
181399	81925	500-3

SDG Number: 16542

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3085 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihalap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
Attention:	Non-Responsive [redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/8/2008
				Report Date:	

AMA Sample #	0881926	**AMA Sample #**	0881927
Client ID	500-4	**Client ID**	500-5
Analyst ID	RC	**Analyst ID**	RC
Collection Apparatus	Allergenco	**Collection Apparatus**	Allergenco
Sample Volume (L)	150	**Sample Volume (L)**	150
Analytical Sensitivity (sp/m³)	28	**Analytical Sensitivity (sp/m³)**	28
Sample Condition	Acceptable	**Sample Condition**	Acceptable

	Raw CT.	%	sp/m³	Raw CT.	%	sp/m³
Alternaria						
Ascospores	1	5.9%	28	3	3.4%	83
Aureobasidium						
Basidiospores	9	52.9%	248	47	52.8%	1,290
Bipolaris/Drechslera/Helm.						
Boletus						
Botrytis						
Cercospora						
Chaetomium						
Cladosporium	2	11.8%	55	10	11.2%	275
Coprinus						
Curvularia						
Epicoccum						
Fusarium						
Ganoderma						
Nigrospora						
Penicillium / Aspergillus	3	17.6%	83	9	10.1%	248
Pithomyces				1	1.1%	28
Rusts						
Smuts/Periconia/Myxomycetes						
Stachybotrys						
Stemphylium						
Trichoderma						
Torula						
Ulocladium						
Zygomycetes						
Other Colorless	2	11.8%	55	19	21.3%	523
Unknown						
Hyphal Fragments*						
Totals Spore Concentration			468			2,450
Location						
Comments						

BEST AVAILABLE COPY
Posted to NGB FOIA Reading Room
May, 2018
Released by National Guard Bureau
Page 3086 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
Attention:	[redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/8/2008
				Report Date:	

AMA Sample #	0881928	**AMA Sample #**	0881929
Client ID	500-6	**Client ID**	500-7
Analyst ID	RC	**Analyst ID**	RC
Collection Apparatus	Allergenco	**Collection Apparatus**	Allergenco
Sample Volume (L)	150	**Sample Volume (L)**	150
Analytical Sensitivity (sp/m³)	28	**Analytical Sensitivity (sp/m³)**	28
Sample Condition	Acceptable	**Sample Condition**	Acceptable

	Raw CT.	%	sp/m³		Raw CT.	%	sp/m³
Alternaria	Present		< 28	**Alternaria**			
Ascospores	Present		< 28	**Ascospores**			
Aureobasidium				**Aureobasidium**			
Basidiospores	5	33.3%	138	**Basidiospores**			
Bipolaris/Drechslera/Helm.				**Bipolaris/Drechslera/Helm.**			
Boletus				**Boletus**			
Botrytis				**Botrytis**			
Cercospora				**Cercospora**			
Chaetomium				**Chaetomium**			
Cladosporium	2	13.3%	55	**Cladosporium**			
Coprinus				**Coprinus**			
Curvularia				**Curvularia**			
Epicoccum				**Epicoccum**			
Fusarium				**Fusarium**			
Ganoderma				**Ganoderma**			
Nigrospora				**Nigrospora**			
Penicillium / Aspergillus	3	20.0%	83	**Penicillium / Aspergillus**			
Pithomyces	Present		< 28	**Pithomyces**			
Rusts				**Rusts**			
Smuts/Periconia/Myxomycetes				**Smuts/Periconia/Myxomycetes**			
Stachybotrys				**Stachybotrys**			
Stemphylium				**Stemphylium**			
Trichoderma				**Trichoderma**			
Torula				**Torula**			
Ulocladium				**Ulocladium**			
Zygomycetes				**Zygomycetes**			
Other Colorless	4	26.7%	110	**Other Colorless**			
Unknown	1	6.7%	28	**Unknown**			
Hyphal Fragments*	7		193	**Hyphal Fragments***			
Totals Spore Concentration			413	**Totals Spore Concentration**			< 28
Location				**Location**			
Comments				**Comments**			

No Visble Trace.
No Mold Spores Detected.

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
Released by National Guard Bureau
Page 3087 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaiqap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	Non-Responsive [redacted]
Attention:	Non-Responsive [redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/8/2008
				Report Date:	

AMA Sample #	0881930
Client ID	500-8
Analyst ID	RC
Collection Apparatus	Allergenco
Sample Volume (L)	150
Analytical Sensitivity (sp/m³)	41
Sample Condition	Acceptable

	Raw CT.	%		sp/m³
Alternaria	3	1.1%		124
Ascospores	39	14.2%		1,610
Aureobasidium				
Basidiospores	105	38.3%		4,340
Bipolaris/Drechslera/Helm.				
Boletus				
Botrytis				
Cercospora	Present		<	41
Chaetomium				
Cladosporium	100	36.5%		4,130
Coprinus				
Curvularia	Present		<	41
Epicoccum	Present		<	41
Fusarium	1	0.4%		41
Ganoderma				
Nigrospora				
Penicillium / Aspergillus	8	2.9%		330
Pithomyces	Present		<	41
Rusts				
Smuts/Periconia/Myxomycetes	1	0.4%		41
Stachybotrys				
Stemphylium				
Trichoderma				
Torula				
Ulocladium				
Zygomycetes				
Other Colorless	17	6.2%		702
Unknown				
Hyphal Fragments*	1			41
Totals Spore Concentration				11,300
Location				
Comments				

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #: 15-0085 (MD)
Released by National Guard Bureau
Page 3088 of 5269

AMA Analytical Services, Inc.

BEST AVAILABLE COPY

A Specialized Environmental Laboratory

ACCREDITED LABORATORY AIHA Environmental Microbiology See aihaloap.org for details

CERTIFICATE OF ANALYSIS

Spore Trap Analysis Report

Client:	National Guard Bureau	**Job Name:**	RC 500 Glen Arn, MD	**Chain Of Custody:**	181399
Address:	301-IH Old Bay Lane, Attn: NGB-AVN-SI, State Military Reservation	**Job Location:**	Not Provided	**Date Submitted:**	9/4/2008
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
Attention:	[redacted]	**P.O. Number:**	Not Provided	**Date Analyzed:**	9/8/2008
				Report Date:	

General Comments, Disclaimers, and Footnotes

Analytical Method: Sample are analyzed following the instructions and guidelines outlined in AMA Analytical Services, Inc. SOP 901.

Sample Condition: Acceptable: The sample was collected and delivered to the our location without disturbing the material on the sampling media.

Unacceptable: 1. The sample is overloaded with material. 2. The sample trace has been disturbed. 3. The sample was not collected properly.

Obscured: The loading on the sample is high, possibly obscuring spores present. The quantity reported should be considered the minimum concentration present. The actual concentration may be higher than the reported concentration.

Spore Notes: Based on their small size and very few distinguishing characteristics, Aspergillus and Penicillium cannot be differentiated by non-viable sampling methods. There are other types of spores whose morphology is similar to Aspergillus and Penicillium and cannot be differentiated by non-viable sampling methods. Examples of these similar spores are Acremonium, Paecilomyces, Wallemia, and Trichoderma.

Smut, Periconia and Myxomycetes are three different types of organisms that have similar morphological characteristics.

Bipolaris/Dreschlera/Helm: Bipolaris / Dreschlera / Helminthosporium group.

Other Colorless represents all colorless spores that are non-distinctive and unidentifiable.

* Hyphal Fragments: A portion of the mycelium that becomes separated from the remainder of the thallus (vegetative body), each of which has the capacity to grow and form new individuals. Results for hyphal fragments are in fragments/m³ and are not incorporated in the total spore concentration.

Quantification: Analytical Sensitivity (A.S.): This is dependent on the volume of air collected and the amount of the trace that was analyzed.

The value of "Present" indicated in the Raw Count column represents the presence of this spore type during the preliminary exam at 400x. The Raw Count converts to a whole number if the spore type is encountered again during the 1,000x enumeration. The sp/m³concentration will be reported as less than the analytical sensitivity if "Present" is reported in the Raw Count.

Due to rounding, totals may not equal 100%

sp/m³: Spores per cubic meter.

Results are reported to 3 significant figures.

Analyst Rolenda Chuyate

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client.

An AIHA (#100470), NVLAP (101143-0), and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643
Monday, September 08, 2008
Page 4 of 4

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #9-2643085 (MD)
Released by National Guard Bureau
Page 3089 of 5269

SAMPLE CHAIN OF CUSTODY

EI

DATE SHIPPED	# OF SAMPLES	SAMPLE MEDIA TYPE	PROJECT NAME
	15		Glen Arm 181399

CONTACT	TELEPHONE NUMBER

SAMPLE # OR AREA	SAMPLE DATE	SAMPLE VOLUME	ANALYSIS REQUESTED
500-1		1068.24 L	Lead Air
500-2		1004.97 L	↓
500-3		0 L	↓
500-4		150 L	Fungal Spore
500-5		150 L	↓
500-6		150 L	↓
500-7		150 L	↓
500-8		150 L	↓
9 Return: 106		100 cm²	Lead wipe
10 Floor @111		100 cm²	↓
11 Locker Top: 112		100 cm²	↓
12 Finder: 114		100 cm²	↓
13 116: Desk		100 cm²	↓
14 [illegible]		[illegible]	↓
15 Supply 106		34 cm²	↓

Samples Relinquished By: [signature] Signature 8/28/18 Date

Samples Received By: Signature Date

Samples Analyzed By: Signature Date

Glen Arm

BEST AVAILABLE COPY

AMA Analytical Services, Inc.
Focused on Results
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643
www.amalab.com

CHAIN OF CUSTODY

(Please Refer To This Number For Inquiries) 181399

Mailing/Billing Information:
1. Client Name: National Guard Bureau NE
2. Address 1: 301-1H Old Bay Lane
3. Address 2: Harve de Grace, MD 21078
4. Address 3:
5. Phone #: 336 455 2558 Fax #: 704 593 1650

Submittal Information:
1. Job Name: RC 500 Glen Arm, MD
2. Job Location:
3. Job #: P.O. #:
4. Contact Person [redacted] Phone #: 336 455 2558
5. Submitted by: [redacted] Signature: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
- ☐ Immediate Date Due:
- ☐ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ☐ Immediate
- ☐ Next Day
- ☐ 2 Day
- ☐ 3 Day
- ☒ 5 Day + Date Due: 09/11/08
- ☐ Results Required By Noon (Every Attempt Will Be Made to Accomodate)

REPORT TO:
- ☐ Include [redacted] Data Sheets with Report
- ☒ Email [redacted] @ e12.com
- ☐ Fax:
- ☐ Verbal:

Asbestos Analysis

PCM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
- ☐ NIOSH 7400 ____ (QTY)
- ☐ Fiberglass ____ (QTY)

TEM Air – Please Indicate Filter Type:
PC MCE Porosity ____ in a 25mm 37mm
- ☐ AHERA ____ (QTY)
- ☐ NIOSH 7402 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate ____ (QTY)
- ☐ EPA Point Count ____ (QTY)
- ☐ NY State Friable 198.1 ____ (QTY)
- ☐ Grav. Reduction ELAP 198.6 ____ (QTY)
- ☐ Other (specify ____) ____ (QTY)

TEM Bulk
- ☐ ELAP 198.4/Chatfield ____ (QTY)
- ☐ NY State PLM/TEM ____ (QTY)
- ☐ Residual Ash ____ (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust ____ (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 ____ (QTY)
- ☐ Quan. (s/area) Dust D6480-99 ____ (QTY)

TEM Water
- ☐ Qual. (pres/abs) ____ (QTY)
- ☐ ELAP 198.2/EPA 100.2 ____ (QTY)
- ☐ EPA 100.1 ____ (QTY)

☐ All samples received in good condition unless otherwise noted. (TEM Water samples ____ °C)

Lead Analysis
- ☐ Paint Chip ____ (QTY)
- ☒ Dust Wipe (wipe type ____) 7 (QTY)
- ☒ Air 3 (QTY)
- ☐ Soil/Solid ____ (QTY)
- ☐ TCLP ____ (QTY)
- ☐ Drinking Water ____ (QTY)
- ☐ Waste Water ____ (QTY)
- ☐ Dust Wipe Furnace (wipe type ____) ____ (QTY)

Mold - Direct Microscopic Analysis
- ☐ Collection Apparatus for Spore Traps:
- ☒ Spore Trap 5 (QTY) ☐ Bulk ____ (QTY)
- ☐ Surface Swab ____ (QTY) ☐ Surface Vacuum Dust ____ (QTY)
- ☐ Surface Tape ____ (QTY) ☐ Other (Specify ____) ____ (QTY)

SAMPLE INFORMATION / **ANALYSIS** / **MATRIX**

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
	See Attached															

CLIENT CONTACT (LABORATORY STAFF ONLY)

Date/Time:	Contact:	By:
Date/Time:	Contact:	By:
Date/Time:	Contact:	By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 9 / 4 / 08 @ 800 Via: UPS By (Print): [illegible] Sign: [illegible]
2. Date/Time Analyzed: 9 / 8 / 08 @ ____ By (Print): Rolenda Chuyate Sign: Rolenda Chuyate
3. Results Reported To: Vince Maisto Via: Email Date: 9 / 8 / 08 Time: ____ Initials: ____
4. Comments:

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3091 of 5269

BEST AVAILABLE COPY

COMPLIANCE MANAGEMENT INTERNATIONAL

1215 Manor Drive, Suite 205
Mechanicsburg, PA 17055
Phone: 717.590.7031
Fax: 717.590.7936
www.complianceplace.com

Industrial Hygiene Survey Report

National Guard Facility
Glen Arm (Gunpowder) Readiness Center

Prepared For:	**National Guard Bureau Region North IH** **301-IH Old Bay Lane** **Havre de Grace, MD 21078**
Survey Location:	**Glen Arm (Gunpowder) Readiness Center** **10901 Notchcliff Road** **Glen Arm, MD 21057**
Prepared By:	**Compliance Management International, Inc.** **1215 Manor Drive** **Suite 205** **Mechanicsburg, PA 17055**
Survey Date:	**May 31, 2013**
Report Date:	**June 24, 2013**

[redacted]

Non-Responsive
Senior Industrial Hygienist

BEST AVAILABLE COPY

Table of Contents

Section 1.0 Executive Summary 3

Section 2.0 Operation Description & Observations 4

Section 3.0 Lead Testing 5

Section 4.0 Lighting 7

Section 5.0 Indoor Air Quality 8

Section 6.0 Suspect Asbestos Containing Building Materials 10

Section 7.0 Equipment 11

Section 8.0 Limitations 12

Appendix A. Laboratory Analysis Report 13

Appendix B. Photographs 14

Appendix C. Floor Plan 15

Appendix D. References 16

Section 1.0 Executive Summary

An industrial hygiene survey was conducted on May 31, 2013, at the Glen Arm (Gunpowder) Readiness Center located at 10901 Notchcliff Road, Glen Arm, MD 21057. The survey was performed by Mr. Non-Responsive[redacted].

1. Lead surface and air samples were collected. Sample results were all within regulatory standards or recommended guidelines. See Section 3.0 for detailed sampling results.

2. Lighting levels met the American National Standards Institute/Illuminating Engineering Society of North America (ANSI/IESNA) recommended guideline in all locations evaluated. See Section 4.0 for detailed findings.

3. Indoor air quality (IAQ) parameters of temperature, relative humidity, carbon monoxide and carbon dioxide (ventilation) were evaluated during the assessment.

    a. Temperature levels met the American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 55-2010 recommended guideline of 68-79 °F in areas sampled.

    b. The relative humidity levels met the US Army Center for Health Promotion and Preventive Medicine (USACHPPM) TG 277 recommended guideline of 30-60% in areas sampled.

    c. Carbon monoxide (CO) levels were less than the National Ambient Air Quality Standard (NAAQS) recommended ceiling of 9 ppm.

    d. Carbon dioxide (CO_2) levels met the ASHRAE 62.1-2010 recommended guidelines for mechanically ventilated office buildings and commercial settings.

    See Section 5.0 for detailed sampling results.

4. Water-stained ceiling tiles were observed in the facility. A water leak was noted in the Drill Hall. See Section 5.0 for detailed findings.

Section 2.0 Operation Description & Observations

The Glen Arm (Gunpowder) Readiness Center is mainly an administrative facility with a drill hall, offices, and classrooms. At the time of the inspection only one person was present at the facility. He limited inspection access to the foyer, drill hall, main hallway, copy room, kitchen, and one classroom.

The building was been built in 1974. It is a one-story structure. The exterior is constructed concrete. The interior walls are concrete block and drywall. The floors are concrete, carpet, 12”X12” floor tiles.

There is a forced air, ducted system that provides heating and cooling to the building.

It did not appear that there was any daycare at this facility.

No ergonomic concerns were reported. Office areas have computer work stations. Work stations appeared to be properly designed. Personnel had supportive chairs.

Housekeeping practices were adequate.

Section 3.0 Lead Testing

Various surfaces within the facility were screened for lead using surface/wipe samples. Surface/wipe samples were collected in accordance with the American Society for Testing and Materials (ASTM) E 1792 protocols. Air samples were collected using 0.8 micrometer (um) mixed cellulose ester (MCE) filter cassettes attached to low volume air sampling pumps. Blank samples were submitted to the laboratory for quality control purposes. Samples were sent to AMA Analytical Services, Inc., in Lanham, Maryland, for lead analysis using Environmental Protection Agency (EPA) Method 600/R-93/200 (M)-7420. A copy of the laboratory analysis report can be found in Appendix A.

Lead Testing Results Summary

Sample #	Location	Air ug/m^3	Surface ug/ft^2
1	Drill Hall	<6.7	*
2	Classroom 117-A	<6.7	*
3	Drill Hall – Floor	*	<110
4	Drill Hall – Top of Coke Machine	*	140
5	Drill Hall – Top of Elliptical Machine	*	<110
6	Kitchen – Top of Microwave	*	<110
7	Kitchen – Counter Top	*	<110
8	Left Hallway – Floor	*****	<110
9	Foyer – Top of Computer	*****	<110
10	Copier Room – Top of Desk	*	<110
11	Classroom 117-A – Top of Table	*****	<110
12	Blank – Wipe	*	<12 ug
13	Blank – Air	<3 ug	*
-	**Criteria**	**50**	**200**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **ug/ft^2 =** micrograms per square foot
4. **ug/m^3** = micrograms per cubic meter
5. **ug =** micrograms

Sources:

1. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges
2. OSHA 29CFR1910.1025 Lead Standard

The National Guard Bureau currently utilizes 200 micrograms per square foot (ug/ft^2) as a benchmark for identifying lead-contaminated surfaces. This guideline is referenced in NG PAM 420-15 "Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges" as a satisfactory surface contamination level unless the facility is utilized as a childcare facility. In such cases, U.S. Department of Housing and Urban

Development (HUD) limit of 40 ug/ft^2 on floors and 250 ug/ft^2 on windowsills should be observed. There is no child care provided at this facility.

Lead surface and air samples were collected. The following is a summary of the sample results from this survey.

- Surface levels of lead were below the recommended guideline of 200 ug/ft^2 in all locations tested.

- Air samples for lead were below the Occupational Safety and Health Administration (OSHA) Permissible Exposure Limit of 50 micrograms per cubic meter (ug/m^3).

- No chipping or peeling paint was observed.

Section 4.0 Lighting

A lighting assessment was conducted throughout the facility. Measurements were collected using a Cooke Cal-Light 400 Precision Light Meter (Serial No. 98011EL). The light meter was last calibrated in November 2012. Measurements collected were compared to ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

Light Survey Assessment Summary

Location	Foot Candles (FC)	Recommended Lighting (FC)	Sufficient Lighting
Drill Hall	31.8	10	Yes
Foyer	55.3	10	Yes
Copier Room	45.0	10	Yes
Left Hallway	30.4	5	Yes
Classroom 117-A	158.4	50	Yes
Men's Bathroom	30.5	5	Yes
Kitchen	77.0	50	Yes

Table Notes:

1. FC = Foot Candles
2. **Bolded** results did not meet listed criteria

Source: ANSI/IESNA RP-7-01 Lighting Industrial Facilities and RP-1-04 Office Lighting.

The lighting levels meet the minimum recommended guidelines in all areas accessible.

Section 5.0 Indoor Air Quality

Survey measurements were made for comfort parameters and ventilation (temperature, relative humidity, carbon dioxide, and carbon monoxide). The air quality measurements were collected using direct reading instrumentation for comfort parameters using a QTRAK IAQ Meter, Model 7575-X (Serial #1228008). The IAQ Meter was last calibrated in July 2012.

The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) have developed indoor air quality guidelines for mechanically ventilated office buildings and commercial settings (ASHRAE standard 62.1-2010). ASHRAE specifies temperature ranges for human comfort (ASHRAE 55-2010). The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, recommends maintaining a relative humidity range between 30 to 60%.

The following table summarizes the measurements collected.

IAQ Assessment Summary

Location	Temperature (°F)	Relative Humidity (%)	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)
Drill Hall	77.8	59.8	462	*2.6
Outdoors	84.1	59.3	327	0
Criteria	**68-79**	**30-60**	**<1,027**	**<9**

Table Notes:

1. **Bolded** results exceed listed criteria
2. **ppm =** parts per million
3. **(%) =** percent relative humidity
4. **°F =** degrees Fahrenheit
5. * A four wheeler type vehicle was driven into the drill hall.

Sources: The American Society of Heating, Refrigerating, and Air Conditioning Engineers, Inc. (ASHRAE) 55-2010, 62.1-2010, Environmental Protection Agency (EPA) National Ambient Air Quality Standard (NAAQS) & The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation.

Summary of findings and recommendations:

- Temperature measurements were within the recommended guideline of 68-79°F in all sampled areas.

- Relative humidity levels were within the recommended guideline of 30-60% in all sampled areas.

- Carbon dioxide levels were measured to evaluate building ventilation or the introduction or outdoor air into the building. The recommended ceiling is obtained by adding 700 ppm to the measured outdoor carbon dioxide level for this

survey. For this survey, carbon dioxide levels did not exceed the recommended ceiling of 1,027 ppm. This is an indication that outdoor air ventilation is adequate.

- Carbon monoxide levels measured were less than the recommended ceiling of 9 ppm. The recommended ceiling of 9 ppm referenced in the above table is the National Ambient Air Quality Standard for carbon monoxide

- A visual inspection was conducted throughout accessible portions of the facility to assess sources or pathways of factors potentially deleterious to IAQ. The following observations were noted:

    - Water-stained/damaged ceiling tiles were observed in the foyer and main hallway.

    - A water leak was present in the drill hall. A garbage can was collecting water runoff from the leak.

Section 6.0 Suspect Asbestos Containing Building Materials

The following suspect asbestos-containing material (ACM) was observed at the time of this survey:

1. No suspect ACM was observed in the areas inspected.

Inaccessible areas such as behind walls or crawlspaces were not inspected. ACM could potentially be present in these areas.

Section 7.0 Equipment

The following equipment was utilized during this survey. All sampling equipment was properly calibrated prior to use and verified for accuracy as applicable. See daily reports and calibrations logs for detailed information.

Equipment	Serial #	Calibration Date	Value
TSI QTrak IAQ Meter	1228008	7/2012	NA
Cal Light 400 Light Meter	98011EL	11/2012	NA
SKC Air Sampling Pump	647598	5/31/13	2.5 LPM
SKC Air Sampling Pump	648349	5/31/13	2.5 LPM

Section 8.0 Limitations

This report summarizes our evaluation of the conditions observed at the above referenced location. Our findings are based upon our observations and sampling results obtained at the facility at the time of our visit. The report, results, and subsequent recommendations reported herein are also limited to the information available at the time it was prepared and investigated. Conditions may have been in effect prior to the sampling events that have changed over time and which cannot be predicted within the scope of this limited investigation. Any conditions discovered which deviate from the data contained in this report should be presented to us for our evaluation.

This report is intended for the exclusive use of the client. This report and the findings herein shall not, in whole or in part, be relied upon by any other parties, disseminated or conveyed to any other party without prior written consent of the National Guard Bureau, and Compliance Management International, Inc. The findings are relative to the dates of our site visits and should not be relied upon for substantially later dates.

Appendix A. Laboratory Analysis Report

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY INDUSTRIAL HYGIENE, ENVIRONMENTAL LEAD & ENVIRONMENTAL MICROBIOLOGY ISO/IEC 17025:2005 LAB #100470

Client:	National Guard Bureau	**Job Name:**	Glen Arm RC	**Chain Of Custody:**	516025
Address:	301-IH Old Bay Lane, Attn: ARNG-CJG-P, State Military Reservation	**Job Location:**	Glen Arm, MD	**Date Submitted:**	6/4/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/11/2013 **Report Date:** 6/11/2013
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit		Total ug	Final Result		Comments
13067151	1	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13067152	2	Flame	Air	450	N/A	6.7	ug/m³	<3	<6.7	ug/m³	
13067153	3	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067154	4	Flame	Wipe	****	0.108	110	ug/ft²	15	140	ug/ft²	
13067155	5	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067156	6	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067157	7	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067158	8	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067159	9	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067160	10	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067161	11	Flame	Wipe	****	0.108	110	ug/ft²	<12	<110	ug/ft²	
13067162	12	Flame	Wipe Blank	****	N/A	12	ug		<12	ug	
13067163	13	Flame	Air Blank	0	N/A	3	ug/m³		<3	ug	

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory

4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0095 (NGB)
Released by National Guard Bureau
Page 3105 of 5269

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.

A Specialized Environmental Laboratory

CERTIFICATE OF ANALYSIS

AIHA LAP, LLC ACCREDITED LABORATORY INDUSTRIAL HYGIENE, ENVIRONMENTAL LAB & ENVIRONMENTAL MICROBIOLOGY
LAB #100470

Client:	National Guard Bureau	**Job Name:**	Glen Arm RC	**Chain Of Custody:**	516025
Address:	301-IH Old Bay Lane, Attn: ARNG-CIG-P, State Military Reservation	**Job Location:**	Glen Arm, MD	**Date Submitted:**	6/4/2013
	Havre de Grace, Maryland 21078	**Job Number:**	Not Provided	**Person Submitting:**	[redacted]
		P.O. Number:	W912K6-09-A-0003	**Date Analyzed:**	6/11/2013 **Report Date:** 6/11/2013
Attention:	[redacted]				

Summary of Atomic Absorption Analysis for Lead

AMA Sample Number	Client Sample Number	Analysis Type	Sample Type	Air Volume (L)	Area Wiped (ft²)	Reporting Limit	Total ug	Final Result	Comments

Analysis Method for Flame: Air, Wipes, Paints, and Soil/Solids: EPA 600/R-93/200(M)-7000B; Water: SM-3111B
Analysis Method For Furnace: Air, Wipes, Paints, and Soil/Solids : EPA 600/R-93/200(M)-7010; Water: SM-3113B
N/A = Not Applicable mg/Kg = parts per million (ppm) on a dry weight basis mg/L = parts per million (ppm)
%Pb = percent lead on a dry weight basis ug = micrograms ug/L = parts per billion (ppb)
Note: All samples were received in good condition unless otherwise noted.
Note: All results have two significant digits. Any additional digits shown should not be considered when interpreting the result.

Air and Wipe results are not corrected for any blank results

Final results for air and wipe samples are based on client supplied information nor verified by this laboratory.

All results are to be considered preliminary and subject to change unless signed by the Technical Director or Deputy.

See QC Summary for analytical results of quality control samples associated with these samples.

Analyst: S. Chinnapad / K. Shipe **Technical Manager:** G Edward Carney

This report applies only to the sample, or samples, investigated and is not necessarily indicative of the quality or condition of apparently identical or similar products. As a mutual protection to clients, the public, and these Laboratories, this report is submitted and accepted for the exclusive use of the client to whom it is addressed and upon the condition that it is not to be used, in whole or in part, in any advertising or publicity matter without prior written authorization from us. Sample types, locations, and collection protocols are based upon the information provided by the persons submitting them and, unless collected by personnel of these Laboratories, we expressly disclaim any knowledge and liability for the accuracy and completeness of this information. Residual sample material will be discarded in accordance with the appropriate regulatory guidelines, unless otherwise requested by the client. This report must not be used to claim, and does not imply product certification, approval, or endorsement by NY ELAP, AIHA, or any agency of the Federal Government. All rights reserved. AMA Analytical Services, Inc.

An AIHA (#100470) and NY ELAP (#10920) Accredited Laboratory
4475 Forbes Blvd. · Lanham, MD, 20706 · (301) 459-2640 · Toll Free (800) 346-0961 · Fax (301) 459-2643

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0005 (MD)
Released by National Guard Bureau
Page 3106 of 5269
Posted to NGB FOIA Reading Room
May, 2018

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3107 of 5269

BEST AVAILABLE COPY

OM (410) 247-2024 159202 210 REV. 6.08

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516025

page 1 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. Submitted: Glen ARM RC
2. Location: Glen ARM - MD
3. Job #: P.O. #: W912K6-09-A-0003
4. Contact Person: [redacted] @ phone # (410) 942-0273
5. Submitted by: [redacted] Address: [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
- ☐ Immediate Date Due:
- ☐ 24 Hours Time Due:
- Comments:

NORMAL BUSINESS HOURS
- ☒ Immediate
- ☐ Next Day
- ☐ 2 Day
- ☐ 3 Day
- ☒ 5 Day + Date Due: 6/11/13
- ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)

REPORT TO:
- ☒ Include COC/Field Data Sheets with Report
- ☒ Email: [redacted] @ glenn@ccmplan.com
- ☐ Fax: [redacted] @us.army.mil
- ☐ Verbal: [redacted] @us.army.mil

ASBESTOS ANALYSIS

PCM Air – Please Indicate Filter Type:
- ☐ NIOSH 7400 (QTY)
- ☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
- ☐ AHERA (QTY)
- ☐ NIOSH 7402 (QTY)
- ☐ Other (specify) (QTY)

PLM Bulk
- ☐ EPA 600 – Visual Estimate (QTY)
- ☐ EPA Point Count (QTY)
- ☐ NY State Friable 198.1 (QTY)
- ☐ Grav. Reduction ELAP 198.6 (QTY)
- ☐ Other (specify) (QTY)

MISC
- ☐ Vermiculite
- ☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
- ☐ ELAP 198.4/Chatfield (QTY)
- ☐ NY State PLM/TEM (QTY)
- ☐ Residual Ash (QTY)

TEM Dust
- ☐ Qual. (pres/abs) Vacuum/Dust (QTY)
- ☐ Quan. (s/area) Vacuum D5755-95 (QTY)
- ☐ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
- ☐ Qual. (pres/abs) (QTY)
- ☐ ELAP 198.2/EPA 100.2 (QTY)
- ☐ EPA 100.1 (QTY)

☒ All samples received in good condition unless otherwise noted.
(TEM Water samples °C)

METAL ANALYSIS
- ☐ Pb Paint Chip (QTY)
- ☒ Pb Dust Wipe (wipe type Gauze) 10 (QTY)
- ☒ Pb Air 3 (QTY)
- ☐ Pb Soil/Solid (QTY)
- ☐ Pb TCLP (QTY)
- ☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
- ☐ Pb Furnace (Media) (QTY)

MICROBIOLOGY

Collection Apparatus for Spore Traps/Air Samples:
Collection Media
- ☐ Spore-Trap (QTY)
- ☐ Surface Swab (QTY)
- ☐ Surface Tape (QTY)
- ☐ Other (Specify) (QTY)
- ☐ Surface Vacuum Dust (QTY)
- ☐ Culturable ID Genus (Media) (QTY)
- ☐ Culturable ID Species (Media) (QTY)

SAMPLE INFORMATION / ANALYSIS / MATRIX

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHERS	SPORE TRAP	TAPE	SWAB
1 Dell Hall		5-31	450					X		X						
2 Classroom	117		450					X		X						
3 Dell Hall	Floor			100 cm²				X				X				
4 Dell Hall	Coke machine							X				X				
5 Dell Hall	Elliptical							X				X				
6 Kitchen	Microwave							X				X				
7 Kitchen	Counter Top							X				X				
8 Hallway	Left Floor							X				X				
9 Foyer	Top of Computer							X				X				
10 Copy Room	Desk							X				X				
11 Classroom	117-A Table							X				X				
12 Binder	Wipe							X				X				

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: 6 / 4 / 13 @ 1000 Via: Fedex By (Print): MEM Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments: 1945 0135 4187

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

AMA Analytical Services, Inc.
Focused on Results www.amalab.com
AIHA (#100470) NVLAP (#101143-0) NY ELAP (10920)
4475 Forbes Blvd. • Lanham, MD 20706
(301) 459-2640 • (800) 346-0961 • Fax (301) 459-2643

CHAIN OF CUSTODY

(Please Refer To This Number For Inquires) 516025 page 2 of 2

Mailing/Billing Information:
1. Client Name: National Guard Bureau
2. Address 1: 301-IH Old Bay Lane
3. Address 2: Attn: NGB-ARS-IHNE
4. Address 3: Havre de Grace, Maryland 21078
5. Phone #: (410) 942-0273 Fax #: (410) 942-0254

Submittal Information:
1. [redacted] Glen Arm - RC
2. [redacted] Glen Arm - MD
3. Job #: PO. #: W912K6-09-A-0003
4. Contact Person [redacted] @ phone # (410) 942-0273
5. [redacted]

Reporting Information (Results will be provided as soon as technically feasible):

AFTER HOURS (must be pre-scheduled)
☐ Immediate Date Due:
☐ 24 Hours Time Due:
Comments:

NORMAL BUSINESS HOURS
☒ Immediate ☐ 3 Day ☐ Results Required By Noon (EveryAttempt Will Be Made to Accomodate)
☐ Next Day ☐ 5 Day +
☐ 2 Day Date Due:

REPORT TO:
☒ Include COC/Field Data Sheets with Report
☒ [redacted] @ [illegible]
☐ Fax: [redacted] @us.army.mil
☐ Verbal: [redacted] @us.army.mil

ASBESTOS ANALYSIS

PCM Air – Please Indicate Filter Type:
☐ NIOSH 7400 (QTY)
☐ Fiberglass (QTY)

TEM Air – Please Indicate Filter Type:
☐ AHERA (QTY)
☐ NIOSH 7402 (QTY)
☐ Other (specify) (QTY)

PLM Bulk
☐ EPA 600 – Visual Estimate (QTY)
☐ EPA Point Count (QTY)
☐ NY State Friable 198.1 (QTY)
☐ Grav. Reduction ELAP 198.6 (QTY)
☐ Other (specify) (QTY)

MISC
☐ Vermiculite
☐ Asbestos Soil PLM (Qual) PLM (Quan) PLM/TEM (Qual) PLM/TEM (Quan)

TEM Bulk
☐ ELAP 198.4/Chatfield (QTY)
☐ NY State PLM/TEM (QTY)
☐ Residual Ash (QTY)

TEM Dust
☐ Qual. (pres/abs) Vacuum/Dust (QTY)
☐ Quan. (s/area) Vacuum D5755-95 (QTY)
☐ Quan. (s/area)Dust D6480-99 (QTY)

TEM Water
☐ Qual. (pres/abs) (QTY)
☐ ELAP 198.2/EPA 100.2 (QTY)
☐ EPA 100.1 (QTY)

☐ All samples received in good condition unless otherwise noted.
(TEM Water samples °C)

METALS ANALYSIS
☐ Pb Paint Chip (QTY)
☐ Pb Dust Wipe (wipe type) (QTY)
☐ Pb Air (QTY)
☐ Pb Soil/Solid (QTY)
☐ Pb TCLP (QTY)
☐ Drinking Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Waste Water ☐ Pb (QTY) ☐ Cu (QTY) ☐ As (QTY)
☐ Pb Furnace (Media) (QTY)

SURFACE ANALYSIS
Collection Apparatus for Spore Traps/Air Samples:
Collection Media
☐ Spore-Trap (QTY) ☐ Surface Vacuum Dust (QTY)
☐ Surface Swab (QTY) ☐ Culturable ID Genus (Media) (QTY)
☐ Surface Tape (QTY) ☐ Culturable ID Species (Media) (QTY)
☐ Other (Specify) (QTY)

SAMPLE INFORMATION / ANALYSIS / METHOD

CLIENT ID NUMBER	SAMPLE LOCATION/ IDENTIFICATION	DATE	VOLUME (LITERS)	WIPE AREA	TEM	PCM	PLM	LEAD	MOLD	AIR	BULK	DUST	WATER AND OTHER	SPORE TRAP	TAPE	SWAB
13 - Blank -	Air	5-31	0					X		X						

CLIENT CONTACT (LABORATORY STAFF ONLY)
Date/Time: Contact: By:
Date/Time: Contact: By:
Date/Time: Contact: By:

LABORATORY STAFF ONLY: (CUSTODY)
1. Date/Time RCVD: / / @ Via: By (Print): Sign:
2. Date/Time Analyzed: / / @ By (Print): Sign:
3. Results Reported To: Via: Date: / / Time: Initials:
4. Comments:

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3108 of 5269
Posted to NGB FOIA Reading Room
May, 2018

Appendix B. Photographs

Drill Hall

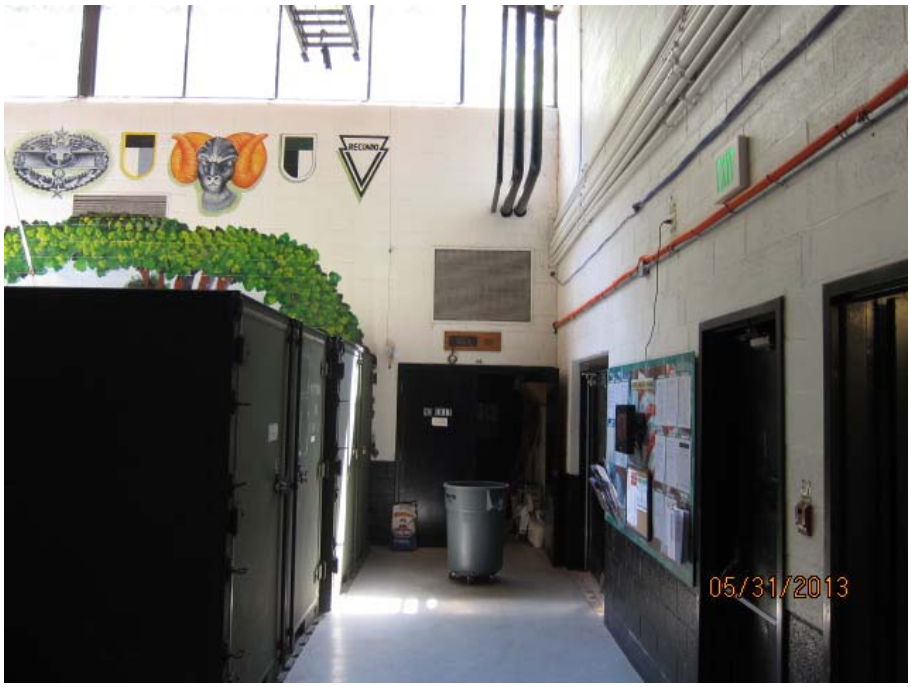

Drill Hall leaking pipe garbage can collecting water

Water stained and damaged ceiling tiles in the foyer

Exterior of facility

Appendix C. Floor Plan

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3113 of 5269

BEST AVAILABLE COPY

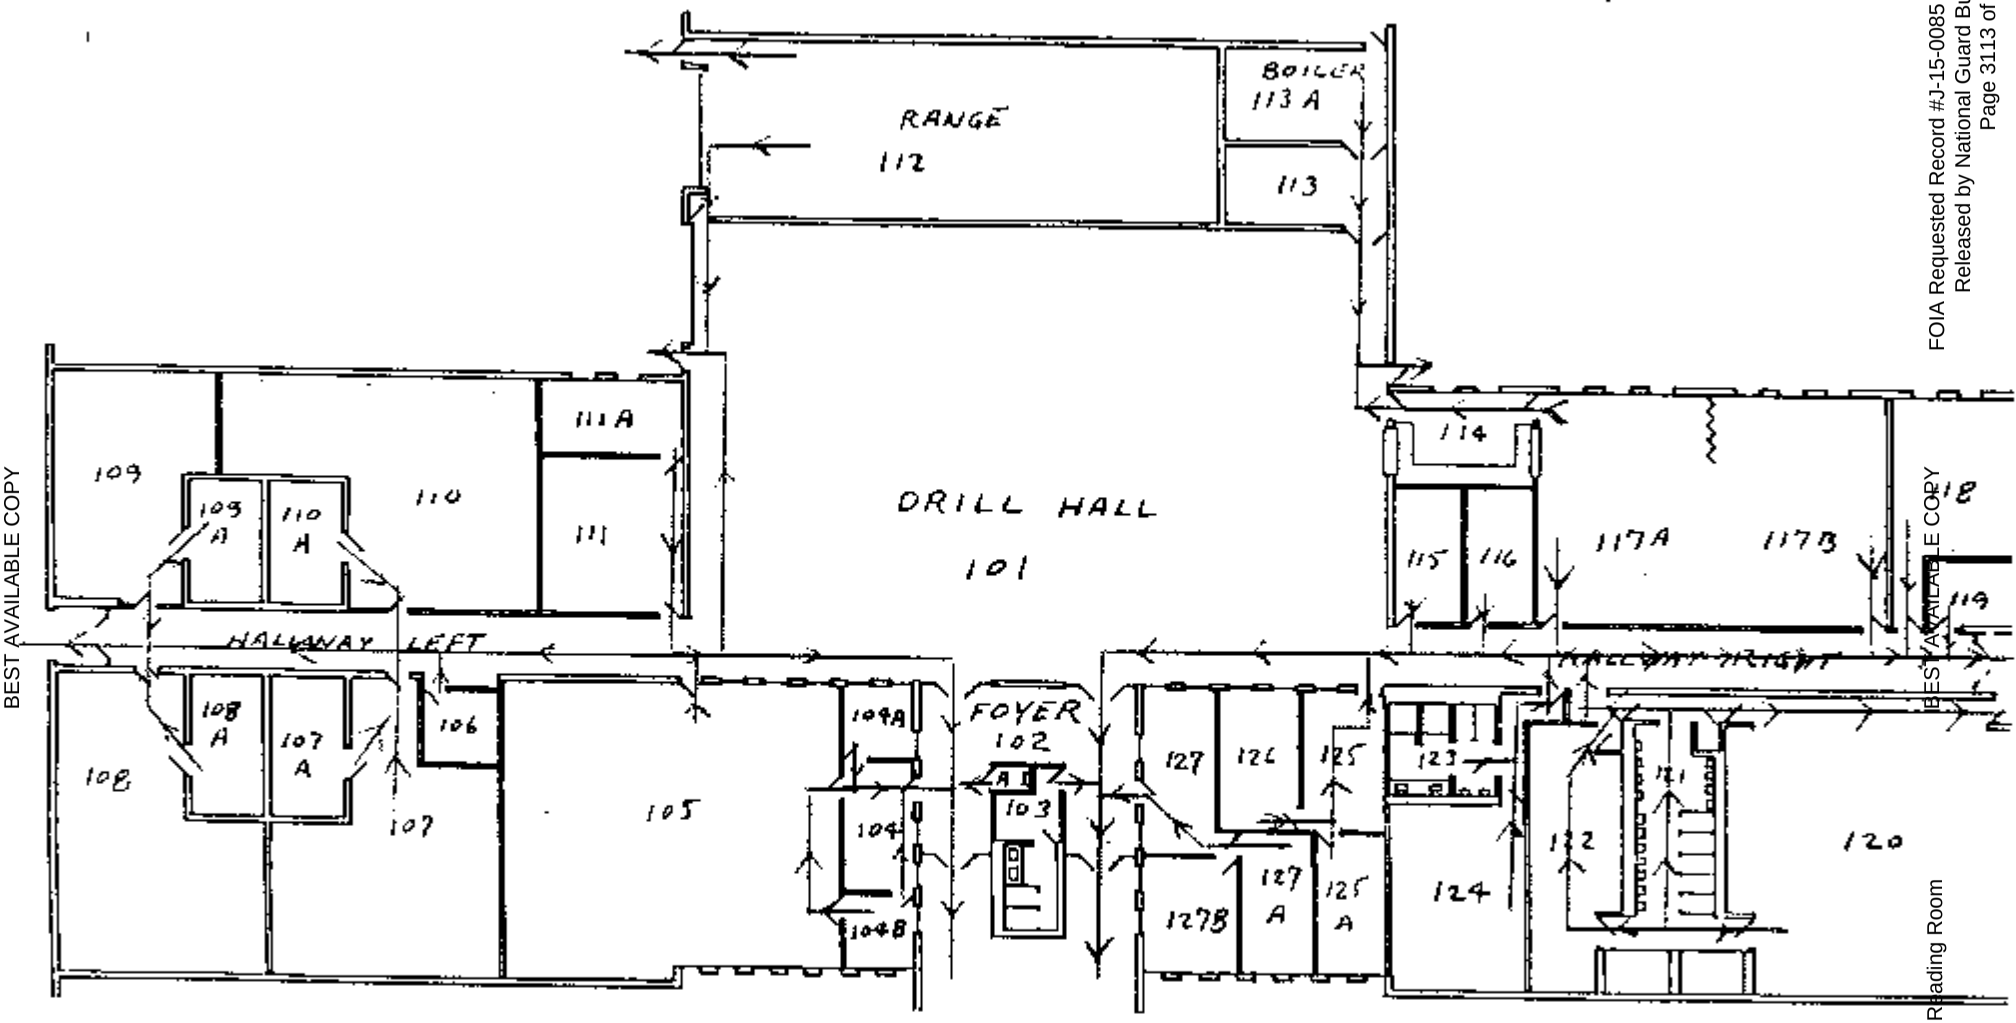

PURNELL ARMORY

FLOOR PLAN
NO SCALE

BEST AVAILABLE COPY

Posted to NGB FOIA Reading Room
May, 2018

Appendix D. References

1. Title 29 Code of Federal Regulations (CFR), Part 1910.1025, Occupational Safety and Health Administration, Occupational Exposure to Lead.

2. American Conference of Governmental Industrial Hygienists (ACGIH) – Threshold Limit Values and Biological Exposure Indices, 2011 Edition.

3. Industrial Ventilation: A Manual of Recommended Practice for Design, 27th Edition.

4. American National Standards Institute (ANSI)/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Ventilation for Acceptable Indoor Air Quality, 62.1-2010.

5. RP-1-2004, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

6. RP-7-2001, Industrial Lighting, Illuminating Engineering Society of North America/ANSI.

7. National Emission Standard Hazardous Air Pollutants (NESHAP) – The standards for asbestos are contained in 40 CFR 61.140 through 61.157.

8. National Ambient Air Quality Standards (NAAQS) - National primary ambient air quality standards for carbon monoxide 40 CFR 50.8.

9. Environmental Protection Agency (EPA) standards [40 Code of Federal Regulations (CFR) 745.227(h) (3)].

10. Derivation of Wipe Surface Screening Levels for Environmental Chemicals, the US Army Center for Health Promotion and Preventive Medicine (USACHPPM).

11. The US Army Technical Guide 277 Army Facilities Management Information Document on Mold Remediation, February 2002.

12. NG PAM 420-15 Guidelines and Procedures for Rehabilitation and Conversion of Indoor Firing Ranges, 3 Nov 06.

13. ANSI/American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE), Thermal Environmental Conditions for Human Occupancy, 55-2010.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS 23 FEBRUARY 2006

MEMORANDUM FOR Region North Industrial Hygiene Office (NGB-AVS-SI-IH/ Ms. [redacted]), Army National Guard Bureau, 301-IH Old Bay Lane, Havre de Grace, MD 21078

SUBJECT: Maryland Army National Guard Facilities, Industrial Hygiene Baseline Survey, First Regiment Armory, Glen Burnie, MD, Report No. 55-ML-01ED-03/06

1. Enclosed is the final copy of the subject report and two CD-ROMs.

4. Our point of contact is Ms. [redacted], at commercial (410) 436-5475/3118, DSN 584-5475/3118 or electronic mail:[redacted]@us.army.mil

FOR THE COMMANDER:

[redacted]

Encl

Director, Occupational Health Sciences

Readiness thru Health

Printed on Recycled Paper
BEST AVAILABLE COPY

BEST AVAILABLE COPY

U.S. Army Center for Health Promotion and Preventive Medicine

USACHPPM

INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/06
MARYLAND ARMY NATIONAL GUARD
FIRST REGIMENT ARMORY
GLEN BURNIE, MD
23 JULY 2003

Approved for public release; distribution unlimited

Readiness Thru Health

Posted to NGB FOIA Reading Room
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
DESTRUCTION NOTICE - Destroy by any method that will prevent disclosure of contents or reconstruction of the document.

BEST AVAILABLE COPY

DEPARTMENT OF THE ARMY
US ARMY CENTER FOR HEALTH PROMOTION AND PREVENTIVE MEDICINE
5158 BLACKHAWK ROAD
ABERDEEN PROVING GROUND MD 21010-5403

MCHB-TS-OFS

EXECUTIVE SUMMARY
INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/06
MARYLAND ARMY NATIONAL GUARD
FIRST REGIMENT ARMORY
GLEN BURNIE, MD
23 JULY 2003

1. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions.

2. CONCLUSIONS.

a. Lead Exposure. Levels of lead in dust that exceeded safe limits for adults and children were identified. These levels may result in health hazards to adults and to children visiting the Armory. Personnel working in the Armory may have been tracking dust containing lead throughout the facility. Cleaning areas with elevated levels of lead in dust may further prevent lead from becoming redistributed throughout the Armory.

b. Asbestos. There was a potential for exposure to asbestos in the Armory. A site Asbestos Management Program (AMP) Plan was not found. The Conference Room had areas of deteriorated and missing tile flooring, which may have been asbestos-containing building material (ACBM).

c. Safety Hazards. There were loose ceiling tiles in the Conference Room ceiling.

3. RECOMMENDATIONS.

a. Lead Exposure. Health Hazard Risk Assessment Code (RAC) 3. Develop and implement a lead hazard management plan for the Armory. Clean horizontal surfaces in the administrative areas to the National Guard Bureau (NGB) Region North and U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) recommended levels. Address all potential lead hazards before continuing to extend the use of this facility to children. If children will visit this facility, clean the floors in the Drill Hall and Classroom to the Environmental Protection Agency lead in dust standards for young children, and clean other horizontal surfaces in the Drill Hall and Conference Room to the NGB Region North and USACHPPM recommended level for lead in dust on frequently contacted surfaces. Ensure that personnel wear disposable gloves and

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3117 of 5269

BEST AVAILABLE COPY

disposable coveralls as extra protection when working in all areas identified as having elevated levels of lead. Follow the cleaning guidelines in Appendix D. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up.

b. Safety. Safety RAC 4. Replace the damaged ceiling tiles and damaged floor tiles. See paragraph c below concerning the floor tiles.

c. Asbestos Exposure. Health Hazard RAC 4 if asbestos is present.

(1) Review the Armory and the Maryland NGB office records to determine whether there are asbestos records for inspection and abatement, or if there is an AMP for Glen Burnie Armory.

(2) Perform an asbestos survey if no records are located. Determine whether the floor tiles are ACBM.

(3) If asbestos is found, develop and implement an AMP if there is not one for the Armory. If the damaged floor tiles are ACBM, ensure that they are replaced in accordance with the AMP.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3118 of 5269

BEST AVAILABLE COPY

TABLE OF CONTENTS

PARAGRAPH Page

1. REFERENCES 1
2. PURPOSE OF EVALUATION 1
3. AUTHORITY 1
4. BACKGROUND INFORMATION 1
5. FACILITY EVALUATION 1
6. ASSESSMENT CRITERIA FOR LEAD 2
7. SAMPLING RESULTS, DISCUSSION, AND CONCLUSIONS 3
8. RECOMMENDATIONS 6
9. ADDITIONAL ASSISTANCE 7

APPENDICES

A. REFERENCES A-1
B. ASSESSMENT CRITERIA FOR LEAD B-1
C. SAMPLING SHEETS AND LAB ANALYSES C-1
D. CLEANING GUIDELINES FOR LEAD D-1
E. SITE MAP E-1

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3119 of 5269

BEST AVAILABLE COPY

INDUSTRIAL HYGIENE BASELINE SURVEY
REPORT NO. 55-ML-01ED-03/06
MARYLAND ARMY NATIONAL GUARD FACILITIES
FIRST REGIMENT ARMORY
GLEN BURNIE, MD
23 JULY 2003

1. REFERENCES. See Appendix A.

2. PURPOSE OF EVALUATION. To conduct surveys at Maryland Army National Guard (MDARNG) facilities to identify and measure the existence and extent of potentially hazardous operations or conditions. This survey will serve as a baseline so that an occupational exposure history can be compiled for each civilian or military employee.

3. AUTHORITY. Fax, National Guard Bureau Region North Industrial Hygiene Office (NGB-AVS-SI-IH/Ms. Non-Responsive), 28 February 2003, subject: SAB.

4. BACKGROUND INFORMATION.

a. Armory Background Information. The Armory resident unit is the First Regiment. The approximate date of construction was 1940.

b. Armory Use by Children. The manager stated that the Armory was used for family functions. We informed the National Guard Bureau (NGB Region North Industrial Hygiene Office) of the high lead in dust sample results. The NGB requested that children not occupy the facility until all the facility was cleaned and retested. As of 2005, the Maryland Military Department was advertising Glen Burnie Armory as available for rental for activities that include young children. We do not know whether the facility had been cleaned and retested.

c. Point of contact (POC). The POC was the manager, SFC Non-Responsive, 14 Dorsey Road, Glen Burnie, MD 21061-3203.

5. FACILITY EVALUATION.

a. Physical Condition of Facilities.

(1) Paint. The age of the building indicated that the presence of lead-based paint (LBP) was likely. Some rooms in the Armory had extensive areas of deteriorated paint. Staff Sergeant Ruth McCuen, Environmental Compliance Assessment Coordinator for the Maryland NGB, stated that there were no records of lead abatement in this facility.

(2) Asbestos. We were not able to determine whether an asbestos inspection or abatement had ever been conducted at the Armory. A site Asbestos Management Program Plan was not found. The Conference Room had areas of deteriorated and missing tile flooring, which

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3120 of 5269

BEST AVAILABLE COPY

may have been asbestos-containing building material (ACBM). The MDARNG State Occupational Health Nurse, LTC[redacted], was notified. LTC[redacted] stated that the MDARNG Facilities Main Office would investigate this finding.

(3) Mold and Moisture Problems. No mold or moisture problems were observed.

(4) Safety Hazards. There were loose ceiling tiles in the Conference Room ceiling.

(5) Indoor Firing Range (IFR). The firing range had been closed, and was being used as a gym. No records of cleaning or lead abatement in the IFR could be located.

b. Safety and Occupational Health Programs. We could not locate lead or asbestos management plans in the facility. No other safety or occupational health plans were required to be present in the facility.

c. Heating, Ventilation, and Air-conditioning Systems. The building was heated with ceiling mounted units.

d. Noise Dosimetry. No operations with the potential to generate hazardous noise levels were identified.

e. Lighting. All areas appeared to be adequately lit and occupants reported no areas of deficient lighting.

6. ASSESSMENT CRITERIA FOR LEAD. See Appendix B.

a. Lead in Air. The Army complies with the Occupational Safety and Health Administration 8-hour time-weighted average Permissible Exposure Limit of 50 micrograms of lead per cubic meter ($\mu g/m^3$) of air.

b. Lead in Dust.

(1) The Environmental Protection Agency (EPA) and State of Maryland limits for lead in dust are 40 $\mu g/ft^2$ on floors, 250 $\mu g/ft^2$ on window sills, and 400 $\mu g/ft^2$ in window troughs. These limits apply to pre-1978 Army facilities only if children under 6 years of age occupy them for 60 or more hours per year.

(2) The U.S. Army Center for Health Promotion and Preventive Medicine (USACHPPM) applies these limits to areas of Army National Guard facilities that children may occupy, regardless of the amount of time that children occupy them.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3121 of 5269

BEST AVAILABLE COPY

(3) The NGB Region North concurs with the USACHPPM recommended safe limit of 200 μg/ft² on floors and surfaces frequently contacted by facility employees, which is more stringent for window sills than the EPA/State standards.

c. Lead in Paint. Paint containing lead levels of 0.5 percent or more by weight in dried solid (also reported as 5000 milligrams per kilogram) is considered to be LBP according to both Federal and Maryland State Regulations. Paint containing lead levels of more than 0.7 milligrams per square centimeter is considered to be LBP according to Maryland State Regulations. In Army Regulation 420-70, Buildings and Structures, lead-contaminated paint (LCP) is defined as any paint containing detectable amounts of lead. The Army considers LCP to be potentially hazardous to children if it is disturbed or deteriorating.

d. Lead Carcinogenicity. The Department of Health and Human Services National Toxicology Program (NTP) released the Report on Carcinogens, Eleventh Edition in February 2005. The NTP report lists "lead and lead compounds" as "reasonably anticipated to be human carcinogens."

7. SAMPLING RESULTS, DISCUSSION, AND CONCLUSIONS.

a. Lead in Dust. Lead in dust sample locations and analytical results are shown in the Table 1. Sample results greater than 40 μg/ft² for floors or 200 μg/ft² for other surfaces are highlighted. High levels of lead were found on the Conference Room file cabinet (486 μg/ft²) and the Conference Room window sill (527 μg/ft²).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3122 of 5269

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3123 of 5269

Table 1
Lead in Surface Dust

Wipe Sample Number	Location of Samples	Result (µg/ft²)
GBW01	Gym Floor	<23
GBW02	Gym Floor	<23
GBW03	Gym Floor	<23
GBW04	Gym Floor	<23
GBW05	Gym Floor	<23
GBW06	Conference Room/Top of File Cabinet	[redacted]
GBW07	Conference Room Desk	<23
GBW08	Conference Room Desk	23
GBW09	Conference Room/Window Sill	[redacted]
GBW10	Drill Room Floor	<23
GBW11	Drill Room Floor/Next to Garage Entrance	[redacted]
GBW12	NCO Club	<23
GBW13	Hallway	<23
GBW14	Second Floor Locker Top	<23
GBW15	Second Floor Latrine	<23
GBW16	Second Floor Hallway	<23
GBW17	Conference Room Floor	[redacted]
GBW18	Drill Floor	<23

Table 2
Lead in Paint

Wipe Sample Number	Location of Samples	Result (%)
GB Bulk-1	Conference Room/Wall 1	0.324
GB Bulk-2	Conference Room/Wall 2	0.696
GB Bulk-3	Hallway	0.348

BEST AVAILABLE COPY

BEST AVAILABLE COPY

Photograph 1. Converted IFR/Classroom

Photograph 2. Converted IFR/Gym

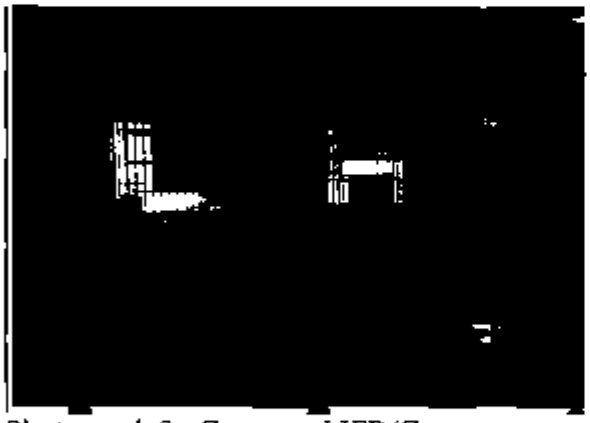

Photograph 3. Converted IFR/Gym

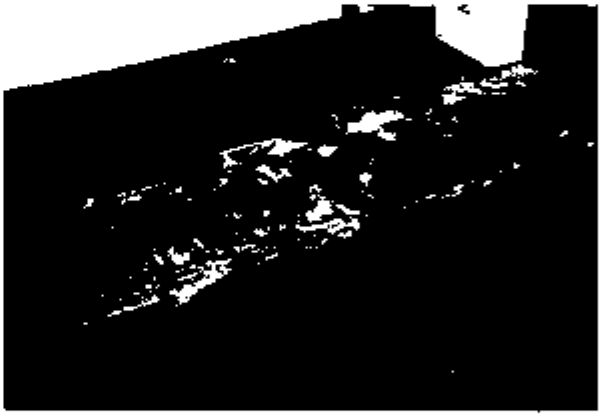

Photograph 4. Conference Room, Asbestos Floor Tiles

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3124 of 5269

BEST AVAILABLE COPY

Photograph 5. Drill Hall

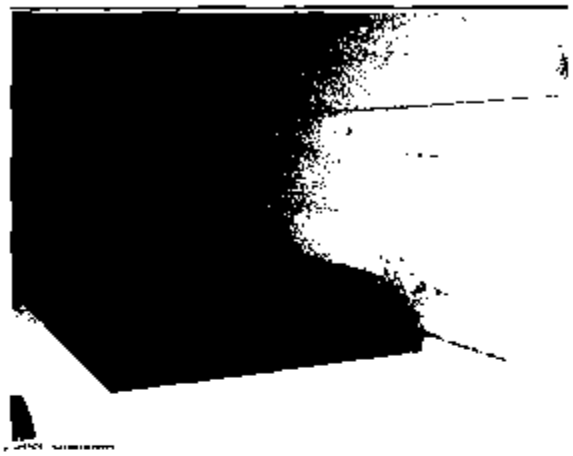

Photograph 6. Hallway, Deteriorated Lead Paint

Four lead in dust sample results exceeded the EPA and State of Maryland limits for young children. One lead in dust result exceeded the OSHA compliance letter recommended level for lead in dust on clean surfaces that has been adopted by NGB Region North and USACHPPM. There were very high levels of lead dust on the window sill in the Conference Room. Personnel working in this room were potentially exposed to lead, and may have been tracking lead out of the area and redistributing it into adjacent rooms in the Armory. This can result in lead exposures for the general workforce and for children visiting this facility. Three lead in dust sample results exceeded the EPA and the State of Maryland lead exposure standard for children of 40 $\mu g/ft^2$ on floors and 250 $\mu g/ft^2$ on window sills. These levels are hazardous to children exposed to lead dust through physical contact, inhalation, or ingestion while visiting the Armory.

b. Lead in Paint. See Table 2 for sample locations and results. Three bulk samples of deteriorated paint were collected for lead analysis. The results ranged from 0.324 percent to 0.696 percent lead in paint. All paint samples were LCP and the latter one was LBP. Deteriorated LBP and LCP are a potential hazard for employees and for children.

c. Asbestos. There was a potential for exposure to asbestos in the Armory. Damaged floor tiles that may have been ACBM may become friable and release asbestos fibers, resulting in exposure to Armory occupants. This should be confirmed by Armory records or by sampling. Army policy requires the Armory to establish and execute an AMP for any asbestos in the facility, and to take immediate corrective action where a possible asbestos hazard has been identified.

8. RECOMMENDATIONS. The Department of Defense Instruction 6055.1 provides Risk Assessment Codes (RACs) for health hazards, a procedure which allows assessment of the magnitude of exposure to physical, chemical, and biological agents and the possible medical

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3125 of 5269

BEST AVAILABLE COPY

effects of exposure. The RAC is an expression of the risk associated with the hazard and combines the hazard severity and accident probability into a single number. The RACs enable one to prioritize hazards. They range in magnitude from 1 to 5, with 1 being the highest priority.

a. Lead Exposure. Health Hazard RAC 3. Develop and implement a lead hazard management plan for the Armory. Clean horizontal surfaces in the administrative areas to the NGB Region North and USACHPM recommended levels. Address all potential lead hazards before continuing to extend the use of this facility to children. If children will visit this facility, clean the floors in the Drill Hall and Classroom to the EPA lead in dust standards for young children, and clean other horizontal surfaces in the Drill Hall and Conference Room to the NGB Region North and USACHPPM recommended level for lead in dust on frequently contacted surfaces. Ensure that personnel wear disposable gloves and disposable coveralls as extra protection when working in all areas identified as having elevated levels of lead. Follow the cleaning guidelines in Appendix D. Consult with the MDARNG Environmental Coordinator concerning waste disposal requirements after clean up.

b. Safety. Safety RAC 4. Replace the damaged ceiling tiles and damaged floor tiles. See paragraph c below concerning the floor tiles.

c. Asbestos Exposure. Health Hazard RAC 4 if asbestos is present.

(1) Review the Armory and the Maryland NGB office records to determine whether there are asbestos records for inspection and abatement, or if there is an AMP for Glen Burnie Armory.

(2) Perform an asbestos survey if no records are located. Determine whether the floor tiles are ACBM.

(3) If asbestos is found, develop and implement an AMP if there is not one for the Armory. If the damaged floor tiles are ACBM, ensure that they are replaced in accordance with the AMP.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3126 of 5269

MDARNG Facilities, IH Baseline Survey, First Regiment Armory, Glen Burnie, MD, Report No.55-MI-01ED-03/06

10. ADDITIONAL ASSISTANCE. For additional assistance or questions concerning this report, please contact the undersigned at DSN 584-3118, commercial 410-436-3118, or by electronic mail: Non-Responsive [redacted] us.army.mil

Non-Responsive

Industrial Hygienist
USACHPPM Lead and Asbestos Team Leader
Industrial Hygiene Field Services Program

APPROVED:

Non-Responsive

Administrative Program Manager
Industrial Hygiene Field Services Program

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3127 of 5269

BEST AVAILABLE COPY

APPENDIX A

REFERENCES

1. Title 29, Code of Federal Regulations (CFR), Parts 1910 and 1962, 2005 rev. http://www.osha.gov/comp-links.html

2. Department of Defense Instruction (DODI) 6055.1, Department of Defense Occupational Safety and Health (OSH) Program, 19 Aug 98. http://www.dtic.mil/whs/directives/corres/pdf/i60551_081998/i60551p.pdf

3. AR 40-5, Preventive Medicine, 22 July 2005. http://www.usapa.army.mil/pdffiles/r40_5.pdf

4. AR 385-10, The Army Safety Program, 29 Feb 00. http://www.usapa.army.mil/pdffiles/r385_10.pdf

5. DA PAM 40-503, Medical Services, Industrial Hygiene Program, 30 Oct 00. http://www.usapa.army.mil/pdffiles/p40_503.pdf

6. American Conference of Governmental Industrial Hygienists (ACGIH), Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs), ACGIH, Cincinnati, OH, 2005. http://www.acgih.org/TLV/

7. American Society of Heating, Refrigerating and Air-Conditioning Engineers, Inc. (ASHRAE) 62-2002, Ventilation for Acceptable Indoor Air Quality, Atlanta, GA, 2002. http://www.ashrae.org

8. Illumination Engineering Society of North America, American National Standard Practice for Office Lighting, ANSI/IESNA RP-1-1993.

9. USACHPPM Interim Report No. 39-EJ-1157-99, Derivation of Wipe Surface Screening Levels for Environmental Chemicals, 1999.

10. OSHA Instruction, CPL 02-02-058 - CPL 2-2.58 - 29 CFR 1926.62, Lead Exposure In Construction; Interim Final Rule Inspection and Compliance, Procedures, 1993. http://www.osha.gov/pls/oshaweb/owadisp.show_document?p_table=DIRECTIVES&p_id=1570

11. U.S. Department of Housing and Urban Development (HUD), Technical Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing, 1998. http://www.hud.gov/offices/lead/guidelines/hudguidelines/index.cfm

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3128 of 5269

BEST AVAILABLE COPY

APPENDIX B

SUBJECT: National Guard Bureau Region North Industrial Hygiene Office
Proposed Recommendations for Surface Lead in Armories

1. In armories that do not contain childcare facilities, the NGB Region North Industrial Hygiene Office recommends cleaning the areas in which sample results are greater than 200 μg/ft². This guidance is based on professional judgment, risk assessments, adaptation of OSHA guidance, and feasibility of cleaning to a certain level.

a. The EPA standards (40 CFR 745.227(e) (8) (viii)) and State of Maryland standards are not directly applicable because they are developed for floors (40 μg/ft²), windowsills (250 μg/ft²) and window troughs (400 μg/ft²) in residential and childcare facilities. Most of the wipe samples in armories were collected in undisturbed areas and therefore, results are worst case scenarios and do not correlate to these standards.

b. The OSHA has no specific requirement for work area surfaces. The OSHA lead standard (29 CFR 1910.1025(h)) states that all surfaces shall be maintained as free as practicable of accumulations of lead. In workplaces where lead is generated, surface levels may be much higher, but personnel exposures can be controlled by limiting airborne lead levels and following good cleanup and hygienic practices.

c. The OSHA cites a level of 200 μg/ft² in OSHA Instruction CPL 2-2.58 as guidance to its own inspectors for evaluating the cleanliness of lunchroom and locker room surfaces that are supposed to be kept as clean as possible.

d. In a report titled Derivation of Wipe Surface Screening Levels for Environmental Chemicals, USACHPPM has determined that 200 μg/ft² is a safe surface contamination level for adult exposures. They have also applied these standards as the decontamination levels for surfaces in administrative offices.

e. It should be noted that levels higher than those recommended above do not necessarily mean there is a significant hazard to workers who are following good cleaning and hygienic practices since there is no correlation between wipe and air samples. Rather, we recommend these levels as a precautionary measure.

2. The NGB Occupational Health Branch is developing guidance for armories that are used as childcare facilities. All States will receive this guidance when it is completed.

3. Ambient air samples collected in the armory were well below OSHA's permissible exposure limit for lead (29 CFR 1910.1025(c)) of 50 μg/m³ averaged over an 8-hour day. Therefore, based on these conditions there is currently no overexposure to personnel from lead in this building.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3129 of 5269

BEST AVAILABLE COPY

APPENDIX C

SAMPLING SHEETS AND LAB ANALYSES

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3130 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

August 8, 2003

Laboratory Code:	**RES**
Subcontract Number:	**NA**
Laboratory Report:	**RES 95872-1**
Project Description:	**None given**
	None given

Non-Responsive
USACHPPM
USACHPM, ATTN: MCHB-TS-OFS Bldg 1570
APG MD 21010

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the American Industrial Hygiene Association, Lab ID 101533 - Accreditation Certificate #480. The laboratory is currently proficient in both PAT & ELPAT programs respectively.

Reservoirs has analyzed the following sample(s) using Atomic Emission Spectroscopy - Inductively Coupled Plasma (AES-ICP) per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the analysis table. Results have been sent to your office.

RES 95872-1 is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those authorized by the client. Samples will be disposed of after sixty days unless longer storage is requested. If you should have any questions about this report, please feel free to call me at 303-964-1986.

Sincerely,

Non-Responsive

President

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3131 of 5269

BEST AVAILABLE COPY

RESERVOIRS ENVIRONMENTAL, INC.

NVLAP Accredited Laboratory #101896
AIHA Certificate of Accredidation #480 LAB ID 101533

TABLE ANALYSIS: LEAD IN PAINT

RES Job Number:	**RES 95872-1**
Client:	**USACHPPM**
Client Project Number / P.O.:	**None given**
Client Project Description:	**None given**
Date Samples Received:	**July 25, 2003**
Analysis Type:	**USEPA SW846 3050B / AA (7420)**
Turnaround:	**3-5 Day**
Date Samples Analyzed:	**August 6, 2003**

Client ID Number	Lab ID Number	Detection Limit (%)	LEAD CONCENTRATION (%)
GB Bulk-1	EM 798809	0.005	0.324
GB Bulk-2	EM 798810	0.005	0.696
GB Bulk-3	EM 798811	0.005	0.348

BDL = Below Detection Limit

Data Qa

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3132 of 5269

BEST AVAILABLE COPY

Reservoirs Environmental, Inc.

2059 Bryant St. Denver, CO 80211
(303) 964-1986 Fax (303) 477-4275 Toll Free (866) RESI-ENV

REMIT TO: 2059 Bryant St. Denver, CO 80211

Invoice to:

[redacted]
MD National Guard Bureau
301-IH Old Bay Lane
Havre De Grace MD 21078

Invoice Date: August 8, 2003
Invoice Number: 95872-1

TERMS: Net 30 Days

Service Charge of 18% per annum may by charged on past due invoices.

Quantity	Analytical Procedure				Unit Price	Amount
	RES Job #:	95872-1				
	Desc:	None given				
	Submitted By:	MD National Guard Bureau				
	P/O No:	None given				
	Contact:	[redacted]				
25	AA/ICP Metal	Wipe	3-5 Day	4125-02	$7.50	$187.50

Invoice Total: $187.50

BEST AVAILABLE COPY

BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3134 of 5269

RESERVOIRS ENVIRONMENTAL, INC.

Posted to NGB FOIA Reading Room
May, 2018

RESI Job #: 95822

SAMPLES SUBMITTED BY:

Due Date: 7-30-8-1
Due Time: 10:15

Company: USACHPPM
Contact:
Project Description and/or P.O. #:
SAMPLES:

No.	Client Sample Number	Volume	EM #
1	CBW-12		[illegible]
2	-13		03
3	-15		04
4	CBW BLANK 1		05
5	CBW-16		06
6	-17		07
7	-18		08
8			
9	CB BLK-1		09
10	-2		10
11	-3		11
12			
13			
14			
15			
16			
17			
18			
19			
20			
21			
22			
23			
24			
25			
26			
27			
28			
29			
30			
31			
32			
33			
34			
35			
36			
37			
38			
39			
40			
41			
42			
43			
44			
45			
46			
47			
48			
49			
50			

1

2

BEST AVAILABLE COPY

BEST AVAILABLE COPY

APPENDIX D

CLEANING GUIDELINES FOR LEAD

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3135 of 5269

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3136 of 5269

CHAPTER 14: CLEANING

Step-by-Step Summary 14–3

I. Introduction 14–5
- A. Performance Standard 14–5
- B. Small Dust Particles 14–5
- C. Difficulties in Cleaning 14–5
  - 1. Low Clearance Standards 14–5
  - 2. Worker Inexperience 14–6
  - 3. High Dust-Producing Methods and/or Inadequate Containment 14–6
  - 4. Deadlines 14–6

II. Coordination of Cleaning Activities 14–6
- A. Checklist 14–6
- B. Equipment Needed for Cleaning 14–6
- C. Waste Disposal 14–7

III. Cleaning Methods and Procedures 14–7
- A. Containment 14–7
- B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques 14–7
  - 1. HEPA Vacuuming 14–7
  - 2. Wet-Detergent Wash 14–9
  - 3. The HEPA/Wet Wash/HEPA Cycle 14–11
  - 4. Sealing Floors 14–16

IV. Order of Cleaning Procedures During Lead Hazard Control 14–16
- A. Precleaning Procedures 14–16
- B. Ongoing Cleaning During the Job 14–18
- C. Daily Cleaning Procedures 14–18
  - 1. Large Debris 14–18
  - 2. Small Debris 14–18
  - 3. Exterior Cleaning 14–18
  - 4. Worker Protection Measures 14–19
  - 5. Maintaining Containment 14–19

BEST AVAILABLE COPY

BEST AVAILABLE COPY

V. Order of Final Cleaning Procedures After Lead Hazard Control 14-19
A. Final Cleaning 14-19
1. Decontamination of Workers, Supplies, and Equipment 14-19
B. Preliminary Visual Examination 14-20
C. Surface Painting or Sealing of Nonfloor Surfaces 14-20
D. Final Inspection 14-20
E. Recleaning After Clearance Failure 14-20
VI. Cleaning Cost Considerations 14-21
A. Initial Clearance Test Failure Rates 14-21
B. Key Factors In Effective Cleaning 14-21
C. Special Problems 14-21
VII. Alternative Methods 14-22
A. Vacuums 14-22
B. Trisodium Phosphate and Other Detergents 14-22

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3137 of 5269

BEST AVAILABLE COPY

Cleaning: How To Do It

1. Include step-by-step procedures for precleaning, cleaning during the job, and daily and final cleanings in project design or specifications.
2. Assign responsibilities to specific workers for cleaning and for maintaining cleaning equipment.
3. Have sufficient cleaning equipment and supplies *before* beginning work.
4. If contamination is extensive, conduct precleaning of the dwelling unit. Move or cover all furniture and other objects.
5. Conduct ongoing cleaning during the job, including regular removal of large and small debris and dust. Decontamination of all tools, equipment, and worker protection gear is required before it leaves containment areas. Electrical equipment should be wiped and high-efficiency particulate air (HEPA) vacuumed, not wetted down, to minimize electrocution hazards.
6. Schedule sufficient time (usually 30 minutes to an hour) for a complete daily cleaning, starting at the same time near the end of each workday after lead hazard control activity has ceased.
7. For final cleaning, wait at least 1 hour after active lead hazard control activity has ceased to let dust particles settle.
8. Use a vacuum cleaner equipped with a HEPA exhaust filter. HEPA vacuum all surfaces in the room (ceilings, walls, trim, and floors). Start with the ceiling and work down, moving toward the entry door. Completely clean each room before moving on.
9. Wash all surfaces with a lead-specific detergent, high-phosphate detergent, or other suitable cleaning agent to dislodge any ground-in contamination, then rinse. Change the cleaning solution after every room is cleaned.
10. Repeat step 8. To meet clearance standards consistently, a HEPA vacuum, wet wash, and HEPA vacuum cycle is recommended. For interim control projects involving dust removal only, the final HEPA vacuuming step is usually not needed (see Chapter 11). Other cleaning methods are acceptable, as long as clearance criteria are met and workers are not overexposed.
11. After final cleaning, perform a visual examination to ensure that all surfaces requiring lead hazard control have been addressed and all visible dust and debris have been removed. Record findings and correct any incomplete work. This visual examination should be performed by the owner or an owner's representative who is independent of the lead hazard control contractor.
12. If other construction work will disturb the lead-based paint surfaces, it should be completed at this point. If those surfaces are disturbed, repeat the final cleaning step after the other construction work has been completed.
13. Paint or otherwise seal treated surfaces and interior floors.
14. Conduct a clearance examination (see Chapter 15).
15. If clearance is not achieved, repeat the final cleaning.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3138 of 5269

BEST AVAILABLE COPY

Step-by-Step Summary (continued)

16. Continue clearance testing and repeated cleaning until the dwelling achieves compliance with all clearance standards. As an incentive to conduct ongoing cleaning and a thorough final cleaning, the cost of repeated cleaning after failing to achieve clearance should be borne by the contractor as a matter of the job specification, not the owner.

17. Do not allow residents to enter the work area until cleaning is completed and clearance is established.

18. Cleaning equipment list:

    - HEPA vacuums.
    - Detergent.
    - Waterproof gloves.
    - Rags.
    - Sponges.
    - Mops.
    - Buckets.
    - HEPA vacuum attachments (crevice tools, beater bar for cleaning rugs).
    - 6-mil plastic bags.
    - Debris containers.
    - Waste water containers.
    - Shovels.
    - Rakes.
    - Water-misting sprayers.
    - 6-mil polyethylene sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3139 of 5269

BEST AVAILABLE COPY

Chapter 14: Cleaning

I. Introduction

This chapter describes cleaning procedures to be employed following abatement and interim control work. Dust removal as an interim control measure is covered in Chapter 11.

All lead hazard control activities can produce dangerous quantities of leaded dust. Unless this dust is properly removed, a dwelling unit will be more hazardous after the work is completed than it was originally. Once deposited, leaded dust is difficult to clean effectively. Whenever possible, ongoing and daily cleaning of leaded dust during lead hazard control projects is recommended. Ongoing and daily cleaning is also necessary to minimize worker exposures.

Cleaning is the process of removing visible debris and dust particles too small to be seen by the naked eye. Removal of lead-based paint hazards in a dwelling unit will not make the unit safe unless excessive levels of leaded dust are also removed. This is true regardless of whether the dust was present before or generated by the lead hazard control process itself. Improper cleaning can increase the cost of a project considerably because additional cleaning and clearance sampling will be necessary. However, cleaning and clearance can be achieved routinely if care and diligence are exercised.

A. Performance Standard

Although the cleaning methods described in this chapter are feasible and have been shown to be effective in meeting clearance standards, other methods may also be used if they are safe and effective. This performance-oriented approach should stimulate innovation, reduce cost, and ensure safe conditions for both residents and workers.

B. Small Dust Particles

Dust particles that are invisible to the naked eye remain on surfaces after ordinary cleaning procedures. A visibly clean surface may contain high and unacceptable levels of dust particles and require special cleaning procedures.

C. Difficulties in Cleaning

While cleaning is an integral and essential component of any lead hazard control activity, it is also the most likely part of the activity to fail.

Several common reasons for this failure include low clearance standards, worker inexperience, high dust-producing methods, and deadlines.

1. Low Clearance Standards

Because very small particles of leaded dust are easily absorbed by the body when ingested or inhaled, a small amount can create a health hazard for young children. Therefore, "clearance standards" are extremely low for acceptable levels of leaded dust particles on surfaces after hazard control activities, and careful cleaning procedures are required. Although it is not possible to remove *all* leaded dust from a dwelling, it is possible to reduce it to a safe level.

Clearance standards are described more fully in Chapter 15. The permissible amount of leaded dust remaining on each of the following surfaces following lead hazard work is as follows:

- 100 $\mu g/ft^2$ on floors.
- 500 $\mu g/ft^2$ on interior window sills (stools).
- 800 $\mu g/ft^2$ on window troughs (the area where the sash sits when closed).
- 800 $\mu g/ft^2$ on exterior concrete.

These levels are based on wipe sampling. Clearance testing determines whether the premises or area are clean enough to be reoccupied after the completion of a lead paint hazard control project. A cleaned area may not be reoccupied until compliance with clearance standards has been established. To prevent delays, final testing and final cleaning activities should be coordinated.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3140 of 5269

BEST AVAILABLE COPY

2. Worker Inexperience

To understand the level of cleanliness required to meet the established clearance standards for hazard control cleanup, new hazard control personnel often require a significant reorientation to cleaning. Many construction workers are used to cleaning up only dust that they can see, not the invisible dust particles that are also important to remove.

3. High Dust-Producing Methods and/or Inadequate Containment

High dust-generating methods, inadequate containment during hazard control work, and poor work practices can all make achievement of clearance particularly difficult. Work practices necessary to prevent spreading of dust throughout a dwelling (e.g., by tracking dust out of work areas) are essential but sometimes tedious. Essential work practices are sometimes mistakenly considered to be "flexible guidelines" rather than necessary standards that are designed to ensure that the job is completed, not only safely, but also on time and within budget.

4. Deadlines

Daily and final cleanings have sometimes been compromised due to project deadlines, since cleaning comes at the end of the job. Hurried efforts often result in clearance failure. Delayed and over-budget hazard control projects are often the result of repeated, unplanned recleanings that are necessitated by inadequate containment and sloppy work practices.

II. Coordination of Cleaning Activities

A. Checklist

The owner or contractor may use the following cleaning checklist before any lead hazard control activity:

- ✓ Is the critical importance of cleaning in a hazard control project understood?
- ✓ Have all workers been trained and certified for hazard control work?
- ✓ Have the precleaning, daily, and final cleanings been scheduled properly and coordinated with the other participants in the hazard control process?
- ✓ Have cleaning equipment and materials been obtained?
- ✓ Do the workers know how to operate and maintain special cleaning equipment, and do they have directions for the proper use of all cleaning materials?
- ✓ Have all workers carefully studied the step-by-step procedures for precleaning (if needed), in-progress cleaning, and daily and final cleanings?
- ✓ Are all workers properly protected during the cleaning processes (see Chapter 9)?
- ✓ Have provisions been made to properly contain and store potentially hazardous debris (see Chapter 10)?
- ✓ Have dust-clearance testing and related visual inspections been arranged (see Chapter 15)?
- ✓ Are the clearance criteria to be met fully understood?
- ✓ Have all appropriate surfaces been properly painted or otherwise sealed?
- ✓ Have appropriate records been maintained that document participants' roles in the hazard control project?

B. Equipment Needed for Cleaning

The following equipment is needed to conduct cleaning: high-efficiency particulate air (HEPA) vacuums and attachments (crevice tools, beater bar for cleaning rugs), detergent, waterproof gloves, rags, sponges, mops, buckets, 6-mil plastic bags, debris containers, waste water containers, shovels, rakes, water-misting sprayers, and 6-mil polyethylene plastic sheeting (or equivalent).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3141 of 5269

BEST AVAILABLE COPY

C. Waste Disposal

Regulations governing hazardous and nonhazardous waste storage, transportation, and disposal affect both the daily and final cleaning procedures. The hazard control contractor and the disposal contractor should work together to establish formal written procedures, specifying selected containers, storage areas, and debris pickups, to ensure that all relevant regulations are met.

III. Cleaning Methods and Procedures

Many of the special cleaning methods and procedures detailed in this chapter are not standard operating procedure for general home improvement contractors. Therefore, project designers, responsible agencies, or owners must ensure that contractors follow the methods and procedures recommended herein or specially designed alternative procedures, even though some may appear to be redundant and unnecessary. These methods have been shown to be feasible and effective in many situations and skipping steps in the cleaning procedures can be counterproductive.

A. Containment

Because of the difficulty involved in the removal of fine dust, dust generated by hazard control work should be contained to the extent possible to the inside of work areas. Inadequately constructed or maintained containment or poor work practices will result in additional cleaning efforts, due to dust that has leaked out or been tracked out of the work area (see Chapter 8).

B. Basic Cleaning Methods: Wet Wash and Vacuum Cleaning Techniques

Because leaded dust adheres tenaciously, especially to such rough or porous materials as weathered or worn wood surfaces and masonry surfaces (particularly concrete), workers should be trained in cleaning methods. As a motivator, some contractors have awarded bonuses to workers who pass clearance the first time.

Two basic cleaning methods have proven effective, when used concurrently, in lead-based paint hazard control projects: a special vacuum cleaner equipped with a HEPA exhaust filter, followed by wet washing with special cleaning agents and rinsing, followed by a final pass with the HEPA vacuum.

Although HEPA filtered vacuums and trisodium phosphate (TSP) cleaners have been considered the standard cleaning tools for lead hazard control projects, new research, discussed under the "Alternatives Methods" section in this chapter, suggests that other tools and products may also be effective in efficiently cleaning dust while providing adequate worker protection from airborne exposure risks. Some of these innovations may even be superior.

1. HEPA Vacuuming

HEPA vacuums differ from conventional vacuums in that they contain high-efficiency filters that are capable of trapping extremely small, micron-sized particles. These filters can remove particles of 0.3 microns or greater from air at 99.97 percent efficiency or greater. (A micron is 1 millionth of a meter, or about 0.00004 inches.) Some vacuums are equipped with an ultra-low penetration air (ULPA) filter that is capable of filtering out particles of 0.13 microns or greater at 99.9995 percent efficiency. However, these ULPA filters are slightly more expensive, and may be less available than HEPA filters.

Vacuuming with conventional vacuum machines is unlikely to be effective, because much of the fine dust will be exhausted back into the environment where it can settle on surfaces. A recent Canadian study revealed that fine-dust air levels were exceedingly high when a standard portable vacuum with a new bag was used, although partially filled bags were found to be more efficient (CMHC, 1992). Considerations for the proper use of a HEPA vacuum are listed below.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3142 of 5269

BEST AVAILABLE COPY

Operating Instructions

There are a numerous manufacturers of HEPA vacuums. Although all HEPA vacuums operate on the same general principle, they may vary considerably with respect to specific procedures, such as how to change the filters. To ensure the proper use of equipment, the manufacturer's operating instructions should be carefully followed and if possible, training sessions arranged with the manufacturer's representative.

Although HEPA vacuums have the same "suction" capacity as ordinary vacuums that are comparably sized, their filters are more efficient. Improper cleaning or changing of HEPA filters may reduce the vacuum's suction capability.

Special Attachments

Because the HEPA vacuum will be used to vacuum surfaces other than floors, operators should buy attachments and appropriate tool kits for use on different surfaces—such as brushes of various sizes, crevice tools, and angular tools.

Selecting Appropriate Size(s)

HEPA vacuums are available in numerous sizes, ranging from a small lunchbucket-sized unit to track-mounted systems. Two criteria for size selection are the size of the job and the type of electrical power available. Manufacturer recommendations should be followed.

Wet-Dry HEPA Vacuums

Some hazard control contractors have found the wet-dry HEPA vacuums to be particularly effective in meeting clearance standards. These vacuums are equipped with a special shut-off float switch to protect the electrical motor from water contact.

Prefilters

HEPA filters are usually used in conjunction with a prefilter or series of prefilters that trap the bulk of the dust in the exhaust airstream, particularly the larger particles. The HEPA filter traps most of the remaining small particles that have passed through the prefilter(s). All filters must be maintained and replaced or cleaned as specified in the manufacturer's instructions. Failure to do so may cause a reduction in suction power (thus reducing the vacuum's efficiency and effectiveness). Failure to change prefilters may damage the vacuum motor and will also shorten the service life of the HEPA filter, which is far more expensive than the prefilters.

HEPA Vacuuming Procedures

Surfaces frequently vacuumed include ceilings, walls, floors, windows, interior and exterior sills, doors, heating, ventilation, and air conditioning (HVAC) equipment (heating diffusers, radiators, pipes, vents), fixtures of any kind (light, bathroom, kitchen), built-in cabinets, and appliances.

To aid in dislodging and collecting deep dust and lead from carpets, the HEPA vacuum must be equipped with a beater bar (agitator head) that is fixed to the cleaning head. This bar should be used on all passes on the carpet face during dry vacuuming (see Chapter 11 for details on carpet and furniture cleaning).

All rooms and surfaces should be included in the HEPA vacuum process, except for those that (1) were found not to have lead-paint hazards and were properly separated from work areas before the process began (see Chapter 8), or (2) were never entered during the process. Porches, sidewalks, driveways, and other exterior surfaces should be vacuumed if exterior hazard control work was conducted, or if debris was stored or dropped outside. Vacuuming should begin on the ceilings and end on the floors, sequenced to avoid passing through rooms already cleaned, with the dwellings' entryway cleaned last.

Emptying the HEPA Vacuum

Used filters and vacuumed debris are potentially hazardous waste and should be treated accordingly (see Chapter10). Therefore, operators should use extreme caution when opening the HEPA vacuum for filter replacement or debris removal to avoid accidental release of accumulated dust into the environment. This may occur, for example, if the vacuum's seal has been broken and the vacuum's bag is disturbed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3143 of 5269

BEST AVAILABLE COPY

Figure 14.1a Vacuum With a HEPA Filter.

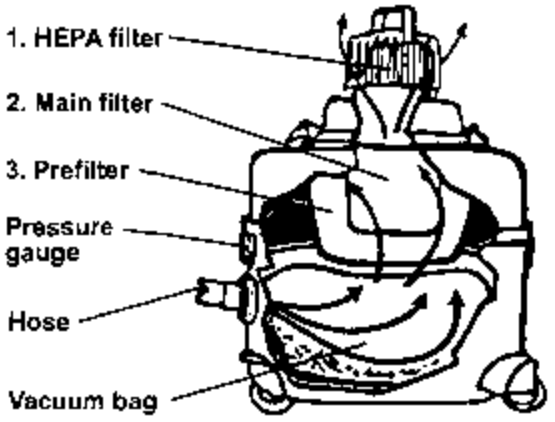

Parts of a HEPA-vacuum

Most HEPA-vacuums have three filters: HEPA filter, main filter, and prefilter. Debris gets sucked in through the hose into the vacuum bag. The air and dust get filtered through the prefilter, the main filter, and the HEPA filter. The HEPA filter captures the lead dust before the air is released into the work area again.

Operators should also wear a full set of protective clothing and equipment, including appropriate respirators, when performing this maintenance function, which should be done in the containment area or offsite.

2. Wet Detergent Wash

Several types of detergents have been used to remove leaded dust. Those with a high-phosphate content (containing at least 5 percent trisodium phosphate, also known as TSP) have been found to be effective when used as part of the final cleaning process (Milar, 1982). TSP detergents are thought to work by coating the surface of dusts with phosphate or polyphosphate groups which reduces electrostatic interactions with other surfaces and thereby permits easier removal. Because of environmental concerns some States have restricted the use of TSP, and some manufacturers have eliminated phosphates from their household detergents. However, high-TSP detergents can usually be found in hardware stores and may be permitted for limited use, such as lead hazard control.

Other non-TSP cleaning agents developed specifically for removing leaded dust have also been found to be effective (possibly more effective than TSP) in limited trials by several

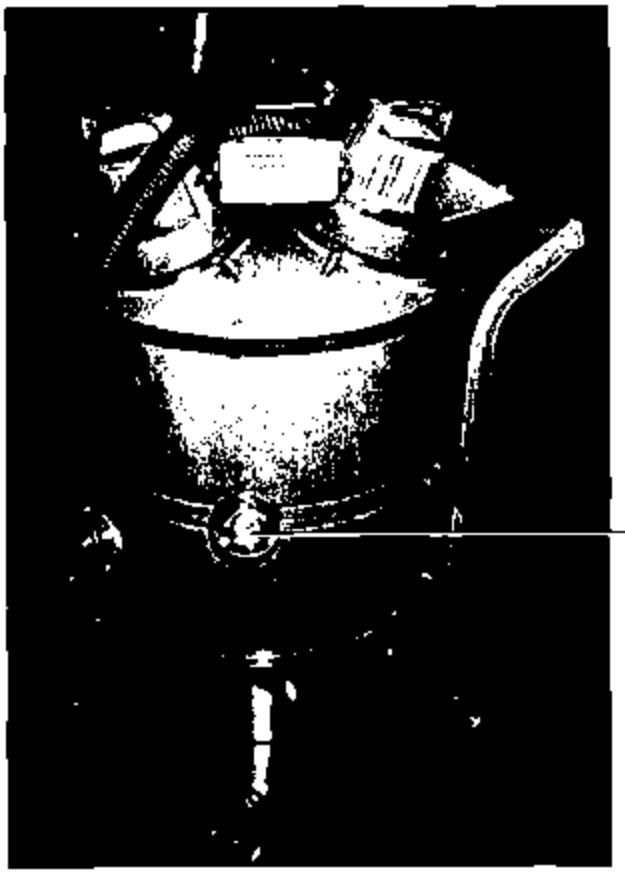

Figure 14.1b Pressure Gauge Indicator Shows When Filters Require Changing.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3144 of 5269

BEST AVAILABLE COPY

Figure 14.2 HEPA Vacuum Sizes and Tools.

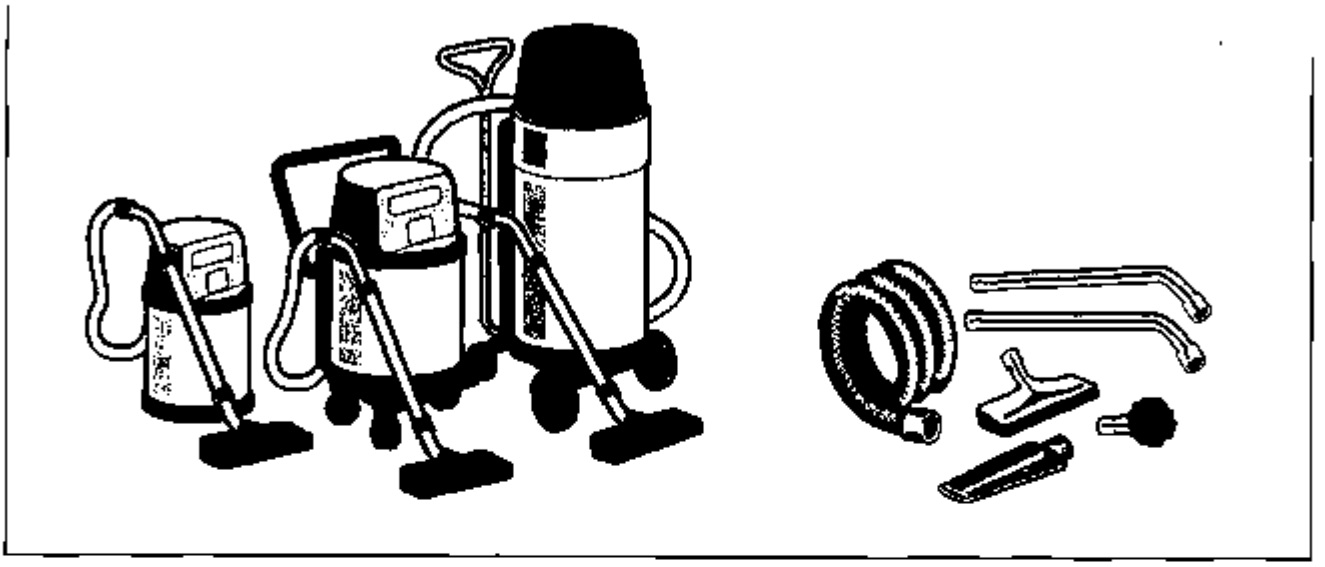

investigators (Grawe, 1993; Wilson, 1993) and may also be safer, since TSP is a skin and eye irritant. See section VII for more information on non-TSP detergents. Proper procedures for using high-phosphate detergents also apply to most other types of detergents and include the following steps:

Manufacturer's Dilution Instructions

Users of cleaning agents for leaded dust removal should follow manufacturer's instructions for the proper use of a product, especially the recommended dilution ratio. Even diluted, trisodium phosphate is a skin irritant and users should wear waterproof gloves. Eye protection should also be worn, and portable eyewash facilities should be located in or very near the work area. Consult manufacturer's directions for the use of other detergents.

Appropriate Cleaning Equipment

Because a detergent may be used to clean leaded dust from a variety of surfaces, several types of application equipment are needed, including cleaning solution spray bottles, wringer buckets, mops, variously sized hand sponges, brushes, and rags. Using the proper equipment on each surface is essential to the quality of the wet-wash process.

Proper Wet-Cleaning Procedures

At the conclusion of the active lead hazard control process and the initial HEPA vacuuming, all vacuumed surfaces should be thoroughly and completely washed with a high-phosphate solution or other lead-specific cleaning agent (or equivalent) and rinsed. Select a detergent that does not damage existing surface finishes (TSP may damage some finishes). Work should proceed from ceilings to floors and sequenced to avoid passing through rooms already cleaned.

Changing Cleaning Mixture

Many manufacturers of cleaners will indicate the surface area that their cleaning mixture will cover. To avoid recontaminating an area by cleaning it with dirty water, users should follow manufacturer-specified surface-area limits. However, regardless of manufacturers' recommendations, the cleaning mixture should be changed after its use for each room. As a rule of thumb, 5 gallons should be used to clean no

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3145 of 5269

BEST AVAILABLE COPY

Figure 14.3 Goggles, Face Shields, Gloves, and Eye Wash Facilities Should Be Available When Used With Chemicals Such as TSP.

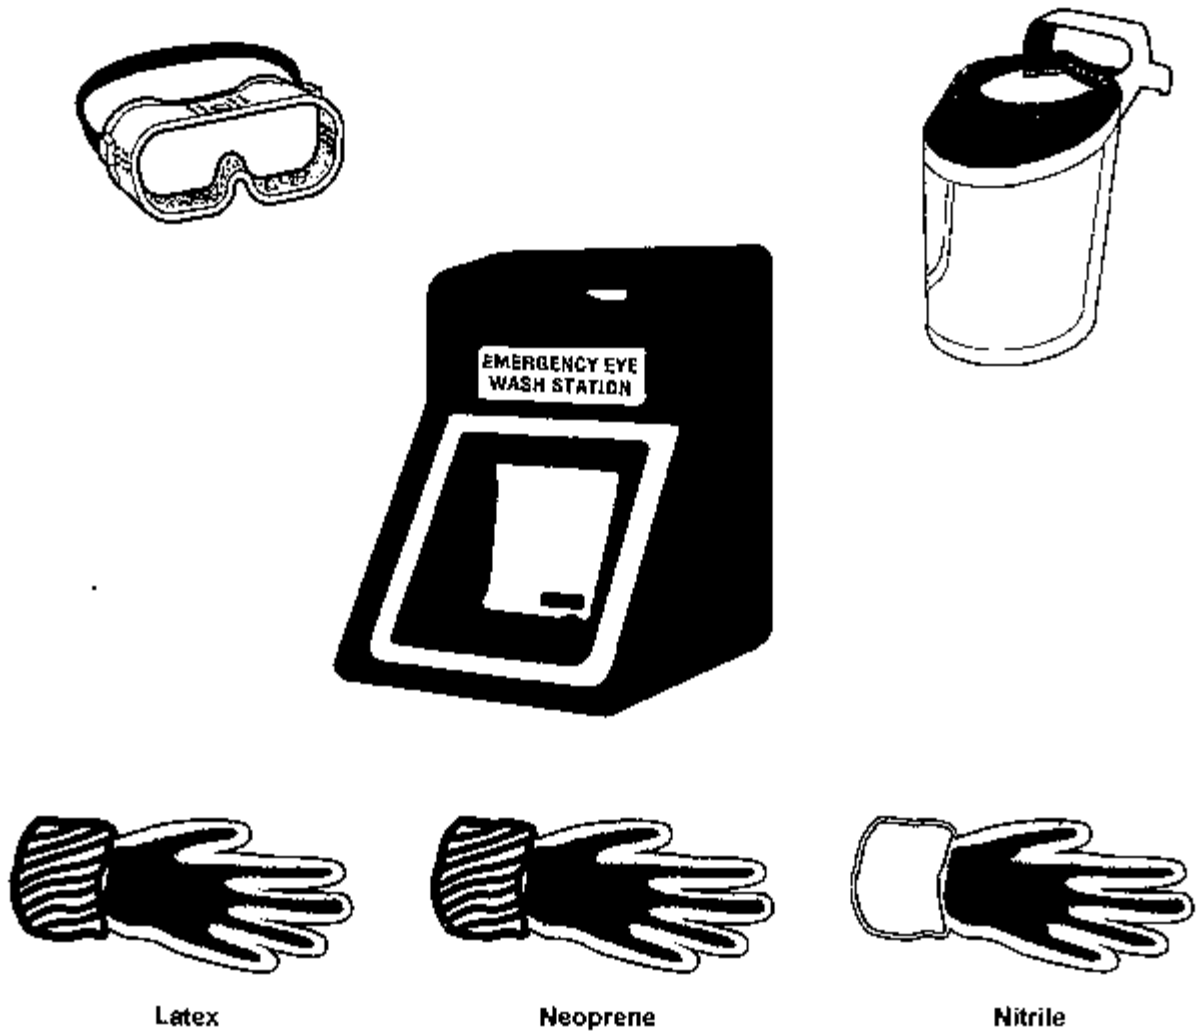

more than 1,000 square feet. Used cleaning mixture is potentially hazardous waste (see Chapter 10); consult with your local water and sewage utility for directions on its proper disposal. Wash water should never be poured onto the ground. The wash water is usually filtered and then poured down a toilet (if the local water authority approves).

3. The HEPA/Wet Wash/HEPA Cycle

Typical Procedures

The usual cleaning cycle that follows lead hazard control activities is called the HEPA vacuum/wet wash/HEPA cycle and is applied to an entire affected area as follows:

- First, the area is HEPA vacuumed.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3146 of 5269

BEST AVAILABLE COPY

Figure 14.4a The HEPA Vacuum, Wet Wash, HEPA Vacuum Cycle Helps in Meeting Clearance Standards.

HEPA vacuum all surfaces
Start at the end farthest from the main entrance/exit. As you vacuum, move towards the main exit and finish there.

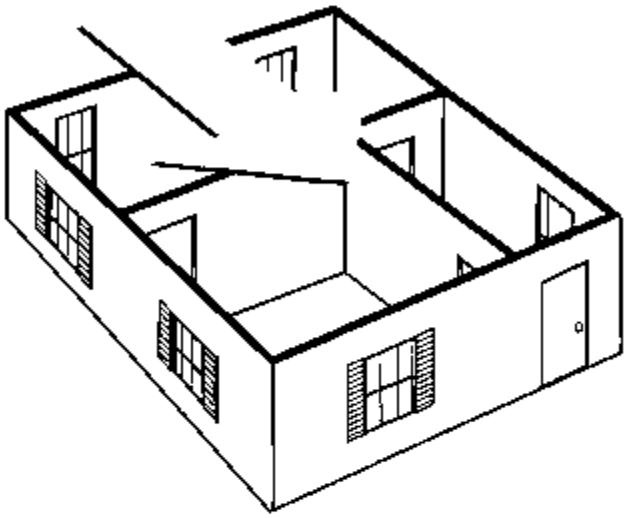

Begin at the top of each room and work down. For example, start with the top shelves, the top of the woodwork, and so on, and work down to the floor. Do every inch of the windows, especially the window troughs.

Courtesy: Alice Hamilton Occupational Health Center

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3147 of 5269

BEST AVAILABLE COPY

- Next, the area is washed down.
- After drying, the area is again HEPA vacuumed.

The rationale for this three-pass system is as follows:

- The first HEPA vacuum removes as much dust and remaining debris as possible.
- The wet wash further dislodges dust from surfaces.
- The final HEPA cycle removes any remaining particles dislodged but not removed by the wet wash.

Single-Pass Wet Wash/HEPA Vacuum

Some lead hazard control contractors have found HEPA spray cleaner vacuums to be a cost-effective alternative to the three-pass system. Similar to home carpet-cleaning machines, these vacuums simultaneously deliver a solution to the surface and recover the dirty solution. Theoretically, this process combines two of the steps in the HEPA vacuum/wet wash/HEPA cycle into one step. While anecdotal evidence indicates that the spray cleaner wet wash/HEPA is effective for some uses, limitations have been noted in its use for ceilings, vertical surfaces, and hard to reach areas. This device may be used as long as clearance standards are met.

Figure 14.4b (continued)

Use special attachments
Use the rubber cone where the floor meets the baseboard and along all the cracks in the floor boards. Use the brush tool for walls and woodwork.

Use the wheeled floor nozzle for bare floors and the carpet beater for rugs.

Move slowly
Vacuum slowly so the HEPA vacuum can pick up all the lead dust.

Rubber Cone

Dust Brush

Powered Carpet Beater

Wheeled Floor Nozzle

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3148 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Wash all surfaces with suitable detergents

Wash *all surfaces* in the work area with suitable detergents, including areas that had been covered with plastic. Some wallpaper should only be HEPA vacuumed, since it may be damaged by the detergent.

Wipe All Surfaces

Wet Mop Floor

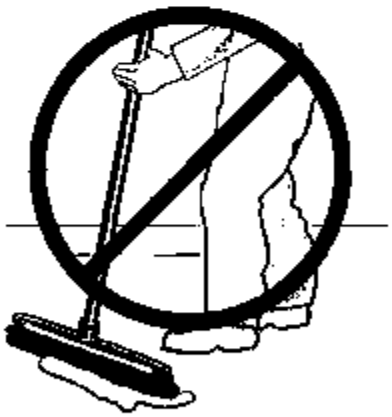

Don't Dry Sweep

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3149 of 5269

BEST AVAILABLE COPY

Figure 14.4c (continued)

Use the 3-Bucket System.

To wash: Use string mops and mop buckets with wringers. (Some experts say NEVER use a sponge mop on the floor. Sponge mops may only push the lead around on the floor, not remove it.)

Dip the string mophead in the detergent wash in bucket #1. Mop the floor.

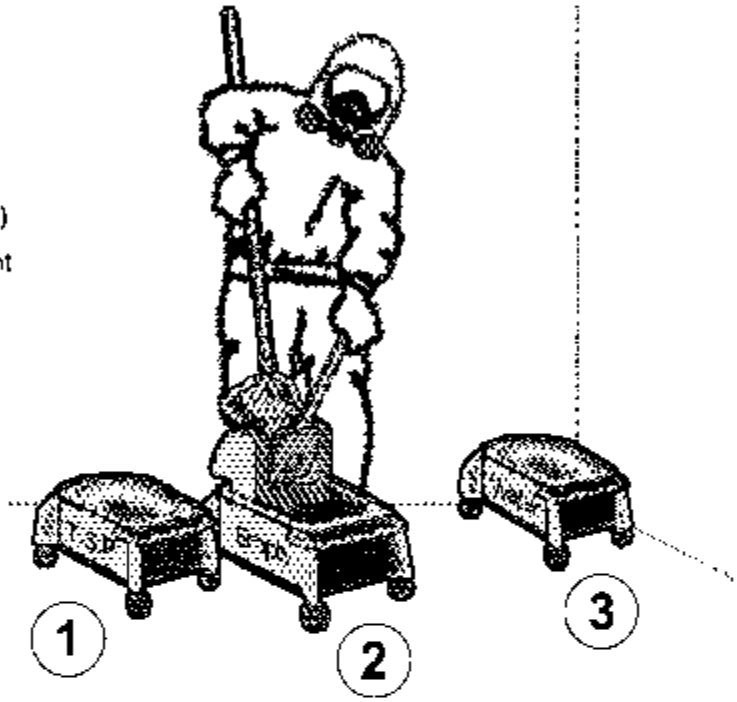

Squeeze out the mophead in empty bucket #2. Return to bucket #1 for more detergent solution and continue mopping. Repeat.

Use the third bucket for rinsing the floor.

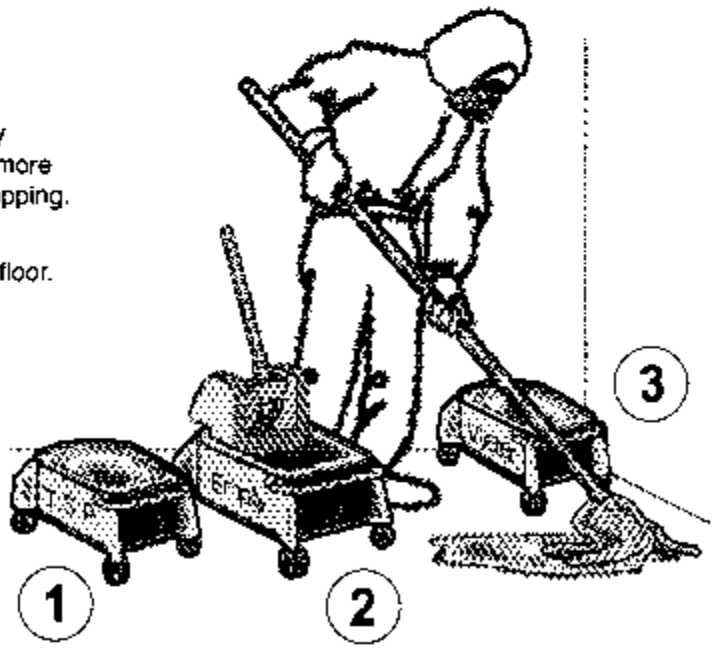

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3150 of 5269

BEST AVAILABLE COPY

Figure 14.4d (continued)

HEPA vacuum all surfaces a final time
HEPA vacuum *all surfaces* in the work area, including areas that had been covered with plastic.

Starting at the far end, work towards the decontamination area. Begin with ceilings or the top of the walls and work down, cleaning the floors last. Do every inch of the windows, especially the troughs. Use the corner tool to clean where the floor meets the baseboard and all the cracks in the floor boards. Use the brush tool for the walls. Move slowly and carefully to get all the dust.

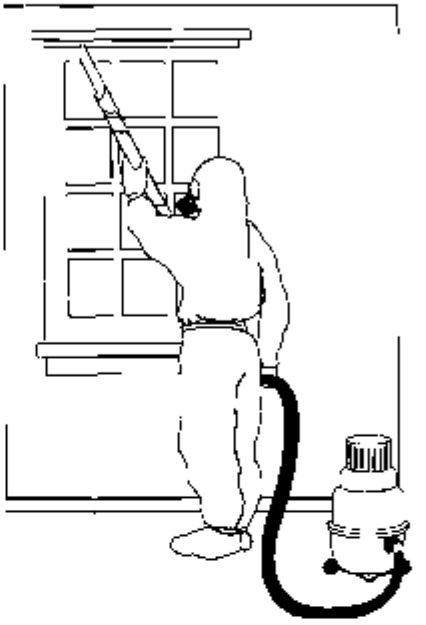

4. Sealing Floors

Before clearance, all floors without an intact, nonporous coating should be coated. Sealed surfaces are easier for residents to clean and maintain over time than those that are not sealed. Wooden floors should be sealed with a clear polyurethane or painted with deck enamel or durable paint. Vinyl tile, linoleum, and other similar floors should be sealed with an appropriate wax. Concrete floors should be sealed with a concrete sealer or other type of concrete deck enamel. However, if these floors are already covered by an effective coat of sealant, it may be possible to skip this step.

As an alternative to sealing, floors may be covered with new vinyl tile, sheet vinyl, linoleum flooring, or the equivalent to create a more permanent cleanable surface. New surfaces should be cleaned with a cleaning solution that is appropriate for that type of surface.

IV. Order of Cleaning Procedures During Lead Hazard Control

The special cleaning procedures to be followed during a lead-based paint hazard control project are discussed in chronological order below. Skipping steps in the process may result in failure to meet post-lead hazard control clearance standards.

A. Precleaning Procedures

Precleaning (i.e., cleaning conducted before lead hazard control is begun) is necessary only in dwelling units that are heavily contaminated with paint chips. Precleaning involves the removal of large debris and paint chips, followed by HEPA vacuuming. These steps may be followed by removal of occupant personal possessions, furniture, or carpeting, depending on the

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3151 of 5269

BEST AVAILABLE COPY

Figure 14.5 Single-Pass HEPA Vacuum/Wet Wash Technology.

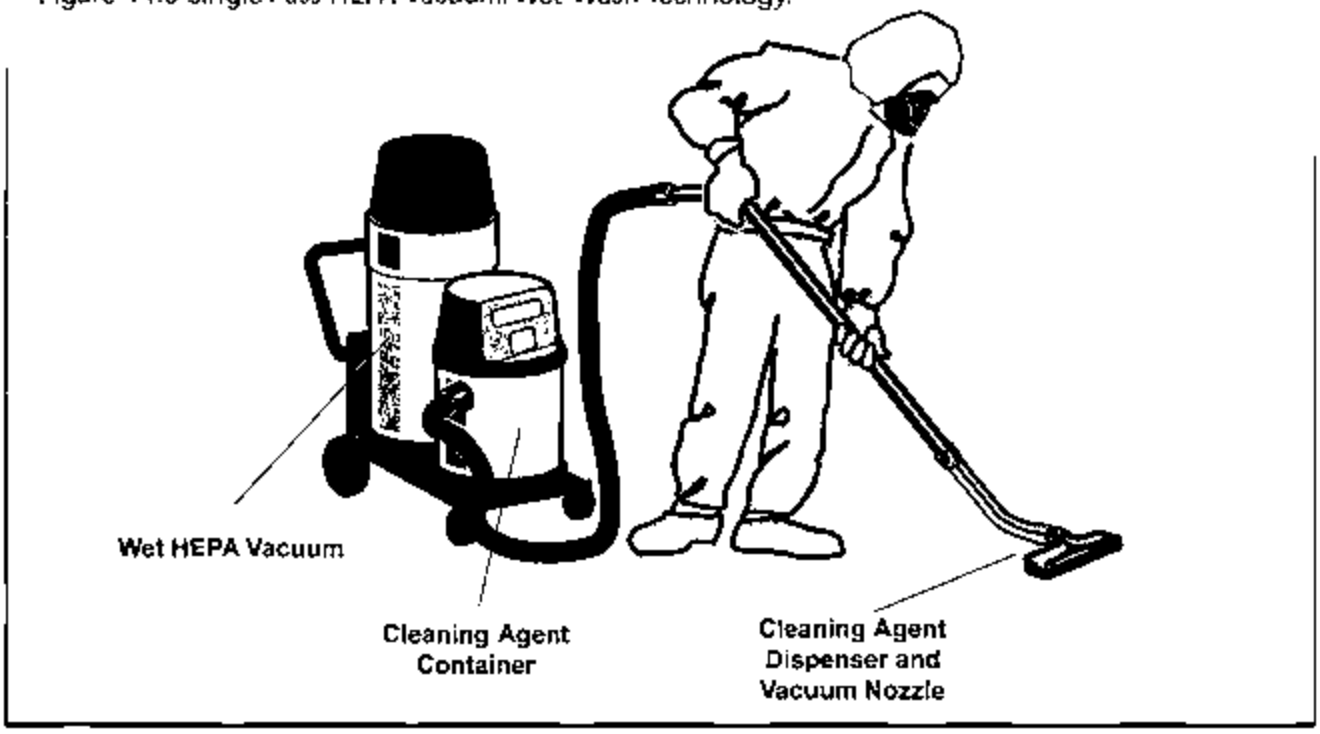

Worksite Preparation Level selected (see Chapter 8). If the furniture will not be cleaned, it should be removed from the area or covered with plastic prior to beginning the precleaning procedure. Carpeting should always be misted before its removal to control the generation of hazardous dust.

It is usually the resident's responsibility to remove most of his or her personal possessions. However, if necessary, owners or project management should be prepared to complete this activity before lead hazard control work begins. As a last resort, the contractor may pack any remaining belongings and carefully seal and move the boxes, supplying all necessary boxes, packing materials, and staff to complete the task. Following cleaning and clearance, the contractor should return all packed items to their appropriate places. Leaving these tasks to the contractor may be expensive and inefficient, since the contractor will need to be insured for this function if the occupant's

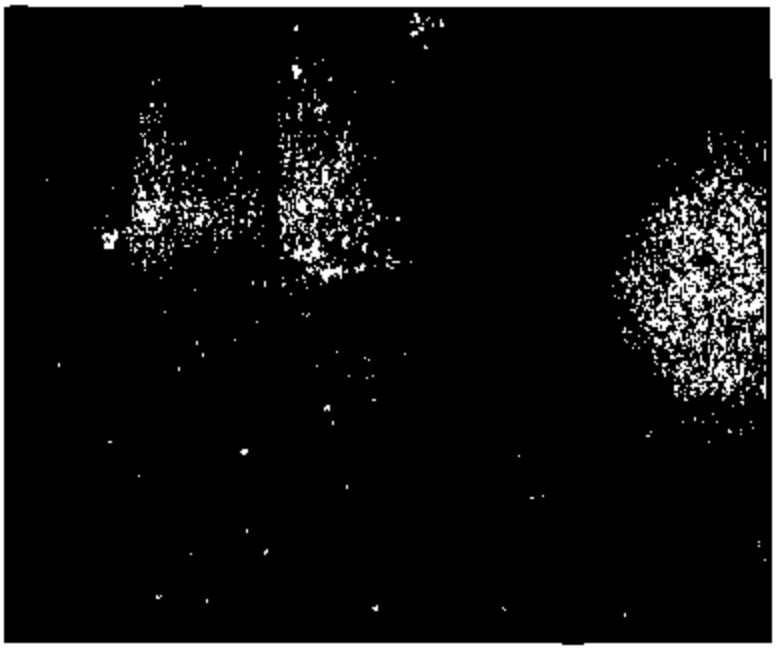

Figure 14.6 Precleaning Is Needed in Areas Where Contamination and Deterioration Are High.

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3152 of 5269

BEST AVAILABLE COPY

belongings are damaged. Additionally, moving furniture, rugs, drapes, and other items owned by the occupant could increase leaded dust levels. Clearance should be conducted after cleaning but before resident items are moved back in.

B. Ongoing Cleaning During the Job

Periodic HEPA vacuuming during the lead hazard control work may be necessary to minimize tracking of dust and paint chips from one area to another (e.g., when a large amount of paint chips or dust is being generated).

C. Daily Cleaning Procedures

Cleaning activity should be scheduled at the end of each workday when all active lead hazard control throughout the dwelling has ceased. Sufficient time must be allowed for a thorough and complete cleaning (usually about 30 minutes to an hour). Daily cleaning helps achieve clearance dust levels by minimizing problems that may otherwise occur during final cleaning and limiting worker exposures. While daily cleaning can be skipped in vacant dwelling units, it is required when occupants will return in the evening. Under no circumstances should debris or plastic be left outside overnight in an unsecured area, even if the dwelling is vacant. Daily cleaning should consist of:

- Removing large debris.
- Removing small debris.
- HEPA vacuuming, wet clean, HEPA vacuuming (horizontal surfaces only).
- Cleaning exterior.
- Patching and repairing plastic sheeting.
- Securing debris/plastic.

Figure 14.7 Plastic Sheeting Should Be Repaired as Part of Daily Cleanup.

1. Large Debris

Large demolition-type debris (e.g., doors, windows, trim) should be wrapped in 6-mil plastic, sealed with tape, and moved to a secure area on the property designated for waste storage. All sharp corners, edges, and nails should be hammered down to prevent injury and minimize the tearing of plastic. It is not necessary to wrap each individual piece of debris in plastic if the entire load can be wrapped. A secure area either outside or inside the property must be designated as a temporary waste-storage area. Covered, secured, and labeled dumpsters placed on or near the property may be used. Proper segregation of waste should be enforced at this time (see Chapter 10).

2. Small Debris

After being misted with water, small debris should be swept up, collected, and disposed of properly. The swept debris should be placed in double 4-mil or single 6-mil polyethylene (or equivalent) plastic bags, properly sealed, and moved to the designated trash storage area. Trash bags should not be overloaded; overloaded bags may rupture or puncture during handling and transport.

3. Exterior Cleaning

Areas potentially affected by exterior lead hazard control should be protected via a containment system (see Chapter 8). Because weather can adversely affect the efficacy of exterior

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3153 of 5269

BEST AVAILABLE COPY

containment, the surface plastic of the containment system should be removed at the end of each workday. On a daily basis, as well as during final cleaning, the immediate area should be examined visually to ensure that no debris has escaped containment. Any such debris should be raked or vacuumed and placed in single 6-mil or double 4-mil plastic bags, which should then be sealed and stored along with other contaminated debris. HEPA vacuuming is appropriate for hard exterior surfaces, not soil.

4. Worker Protection Measures

General worker protection measures are discussed in Chapter 9. Studies indicate that during daily cleaning activities, especially while wet sweeping, workers may be exposed to high levels of airborne dust. Therefore, workers should wear protective clothing and equipment, especially appropriate respirators.

5. Maintaining Containment

The integrity of the plastic sheeting used in a lead hazard control project must be maintained. During their daily cleaning activities, workers should monitor the sheeting and immediately repair any holes or rips with 6-mil plastic and duct tape.

V. Order of Final Cleaning Procedures After Lead Hazard Control

Before treated surfaces can be painted or sealed, final cleaning procedures must be completed. Because airborne dust requires time to settle, the final cleaning process should start no sooner than 1 hour after active lead hazard control has ceased in the room. See Appendix 11 for details regarding dust settling.

A. Final Cleaning

As the first stage in the final cleaning, floor plastic should be misted and swept as detailed earlier in this chapter. Upper-level plastic, such as that on cabinets and counters, should be removed first, after it has been misted with water and cleaned. All plastic should be folded carefully from the corners/ends to the middle to trap any remaining dust. Next, remove both layers of plastic from the floor.

Plastic sheets used to isolate contaminated rooms from noncontaminated rooms should remain in place until after the cleaning and removal of other plastic sheeting; these sheets may then be misted, cleaned, and removed last.

Removed plastic should be placed into double 4-mil or single 6-mil plastic bags, or plastic bags with equivalent (or better) performance characteristics, which are sealed and removed from the premises. As with daily cleanings, this plastic-removal process usually requires workers to use protective clothing and respirators.

After the plastic has been removed from the contaminated area, the entire area should be cleaned using the HEPA/wet wash/HEPA cycle, starting with the ceiling and working down to the floor. After surfaces are repainted or sealed, a final HEPA/wet wash/HEPA cycle may be necessary if accumulated dust caused by other work is visible.

1. Decontamination of Workers, Supplies, and Equipment

Decontamination is necessary to ensure that worker's families, other workers, and subsequent properties do not become contaminated. Specific procedures for proper decontamination of equipment, tools, and materials prior to their removal from lead hazard control containment areas should be implemented, as described below and in Chapters 9 and 10.

Work clothing, work shoes, and tools should not be placed in a worker's automobile unless they have been laundered or placed in sealed bags. All vacuums and tools that were used should be wiped down using sponges or rags with detergent solutions.

Consumable/disposable supplies, such as mop heads, sponges, and rags, should be replaced, after each dwelling is completed. Soiled items should be treated as contaminated debris (see Chapter 10).

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3154 of 5269

BEST AVAILABLE COPY

Figure 14.8a Pick Up Corners of Plastic Sheeting.

Figure 14.8b Fold Plastic Inward.

Durable equipment, such as power and hand tools, generators, and vehicles, should be cleaned prior to their removal from the site; the cleaning should consist of a thorough HEPA vacuuming followed by washing.

B. Preliminary Visual Examination

After the preliminary final cleaning effort is completed, the certified supervisor should visually evaluate the entire work area to ensure that all work has been completed and all visible dust and debris have been removed. While the preliminary examination may be performed by the lead hazard control supervisor, contractor, or owner as a preparatory step before the final clearance examination, it does not replace the independent visual assessment conducted during clearance.

If the visual examination results are unsatisfactory, affected surfaces must be retreated and/or recleaned. Therefore, it is more cost effective to have the supervisor rather than the clearance examiner perform this initial examination.

C. Surface Painting or Sealing of Nonfloor Surfaces

The next step of the cleaning process is painting or otherwise sealing all treated surfaces except floors.

Surfaces, including walls, ceilings, and woodwork, should be coated with an appropriate primer and repainted. Surfaces enclosed with vinyl, aluminum coil stock, and other materials traditionally not repainted are exempt from the painting provision.

D. Final Inspection

The final clearance evaluation should take place at least 1 hour after the final cleaning. Clearance has three purposes: 1) to ensure that the lead hazard control work is complete, 2) to detect the presence of leaded dust, and 3) to make sure that all treated surfaces have been repainted or otherwise sealed. Clearance is usually performed after the sealant is applied to the floor. See Chapter 15 for information on clearance examination procedures.

E. Recleaning After Clearance Failure

If after passing the final visual examination, the dwelling unit fails the clearance wipe dust tests,

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3155 of 5269

BEST AVAILABLE COPY

the HEPA/wet wash/HEPA cleaning cycle should be carefully and methodically repeated. Failure is an indication that the cleaning has not been successful. Recleaning should be conducted under the direct supervision of a certified supervisor. Care should be exercised during the recleaning of "failed" surfaces or components to avoid recontaminating "cleared" surfaces or components.

VI. Cleaning Cost Considerations

An important consideration in determining lead hazard control strategies and methods is the cost and difficulty of required daily and final cleanup operations and the ease with which one can meet dust-clearance standards. A general rule of thumb is that lead hazard control strategies that generate the most dust will have higher cleanup costs and higher initial clearance test-failure rates.

A. Initial Clearance Test Failure Rates

The likelihood of passing final dust-clearance tests is highly correlated with the chosen intervention strategy, methods, and care exercised by the contractor. For example, in one study (HUD, 1991) initial wipe-test failure rates were 14 percent for interior window sills, 19 percent for floors, and 33 percent for window troughs. The pass/fail rates for each surface were strongly associated with the dwelling unit abatement strategy employed. Chemical removal and hand-scraping strategies experi-enced higher failure rates than replacement and encapsulation/enclosure strategies (see Table 14.1).

However, results of the HUD demonstration project indicated that clearance failure is not solely related to abatement method. The report stated that "the diligence and effectiveness of an abatement contractor's cleaning process ... had a major impact on ... the likelihood of the dwelling unit to pass the final wipe test clearance" (HUD, 1991).

Figure 14.8c Dispose of Plastic Sheeting in a Plastic Trash Bag.

B. Key Factors In Effective Cleaning

Effective cleaning will be aided by adequate sealing of surfaces with polyethylene sheeting prior to lead hazard control, proper daily cleaning practices, good worker training, and attention to detail. Where poor worksite preparation is employed, additional cleaning may be required to meet clearance.

C. Special Problems

Surfaces such as porous concrete, old porous hardwood floors, and areas such as corners of rooms and window troughs pose especially difficult cleaning challenges. Porous concrete and corners of rooms normally require additional vacuuming to achieve an acceptable level of cleanliness.

The lead hazard control strategy of enclosure is frequently chosen for window troughs and for old porous hardwood floors due to the difficulty of adequately cleaning these surfaces. This

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3156 of 5269

BEST AVAILABLE COPY

option provides not only a clean surface but a more permanently cleanable surface for dwelling occupants to maintain.

VII. Alternative Methods

Alternatives to the recommended cleaning tools and practices discussed in this chapter are available, some having significant potential for increasing effectiveness and lowering costs.

A recent Canadian study (CMHC, 1992) evaluated the effectiveness of contaminated dust cleanup activities using tools that would generally be available to construction contractors and homeowners. Vinyl flooring and carpeting were cleaned using several wet/dry vacuuming systems, sweeping, and wet mopping. The study found that regular vacuums with empty bags send a steady stream of fine particles into the air, while vacuums with partially filled bags were more efficient. This finding suggests the necessity for HEPA vacuums. Other vacuums may be used if workers do not experience increased exposures, if compliance with clearance standards is achieved, and if a variance from OSHA regulation (29 CFR 1926.62 (h)(4)) is obtained by the contractor or employer (if required).

Agitator heads on vacuums were demonstrated to significantly enhance vacuum effectiveness on carpets in cleaning up fine dust without increasing airborne dust levels. Table 14.2 suggests that a central vacuum with an agitator head is most efficient at removing dust and minimizing recontamination, probably because the vacuum exhaust is blown away from living areas. Because many houses do not have central vacuuming systems, a portable HEPA vacuum is the next best choice (see Table 14.2). Vacuums without agitator heads appeared to perform relatively poorly on carpets.

A. Vacuums

Regular (non-HEPA) dry vacuums potentially produce hazardous levels of airborne dust and therefore should be avoided. Externally exhausted vacuum units with adequate dust-retaining capability may be used. The OSHA lead standard requires the use of HEPA vacuum equipment (see 29 CFR 1926.62 (h)(4), which states, "where vacuuming methods are selected, the vacuums shall be equipped with HEPA filters").

B. Trisodium Phosphate and Other Detergents

TSP detergents have been used successfully for a number of years in lead hazard control work. However, in recent years, other new cleaning agents have been developed specifically for leaded dust removal. The need for alternatives has been fueled by the fact that TSP is an eye

Table 14.1 Initial Cleaning Wipe-Test Failure Rates for Various Abatement Strategies

Dust Test Location	Hand Scrape w/Heat Gun	Chemical Removal	Enclosure	Encapsulation	Replacement	All Methods
Floors	28.8%	22.7%	20.0%	13.8%	12.5%	19%
Sills	24.4%	24.1%	8.2%	4.8%	17.4%	14%
Wells	44.5%	45.7%	23.7%	25.7%	21.0%	33%

Source: U.S. Department of Housing and Urban Development (August 1991) The HUD Lead-Based Paint Abatement Demonstration (FHA)

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3157 of 5269

BEST AVAILABLE COPY

and skin irritant and is increasingly restricted from household use and unavailable in many local jurisdictions. TSP also damages some finishes. Recently reported trials of two new products suggest that alternative lead-specific cleaning agents may be more effective and safer than TSP (Grawe, 1993; Wilson, 1993).

These *Guidelines* do not prohibit the use of non-TSP cleaning agents. HUD encourages further evaluation of alternative cleaning methods. Use of any cleaning agent that results in compliance with clearance criteria is encouraged.

Table 14.2 Mass Removal Efficiency for Extended Vacuuming Cycles

Cycle Number	Mass Removal Efficiency Percentages			
	Cleaning Method			
	Central Vacuum—Plain Tool	Central Vacuum—Agitator Head	HEPA Vacuum	Portable Vacuum—Plain Tool
1	34.7	71.0	55.4	17.5
2	47.0	80.2	61.2	23.0
3	51.9	85.9	66.3	26.6
4	56.0	87.8	67.0	29.4
5	59.3	88.9	72.1	32.5
6	61.6	91.2	74.4	34.9
7	63.8	93.1	76.4	36.5
8	67.5	95.4	77.5	38.1
9	67.5	97.7	78.7	40.1
10	67.2	100.0	80.2	41.7
11		102.3	80.2	41.7
12		104.6	84.1	44.8
13		104.6	84.5	46.8
14		103.8	84.5	48.4
15				49.6
16				50.8
17				52.4
18				53.6
19				54.4
20				55.2

Source: Canada Mortgage and Housing Corporation; Saskatchewan Research Council (December 1992) *Effectiveness of Clean-up Techniques for Leaded Paint Dust*

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3158 of 5269

Posted to NGB FOIA Reading Room
May, 2018
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3159 of 5269

APPENDIX E

SITE MAPS

BEST AVAILABLE COPY

Glen Burnie MD 21061

Glen Burnie

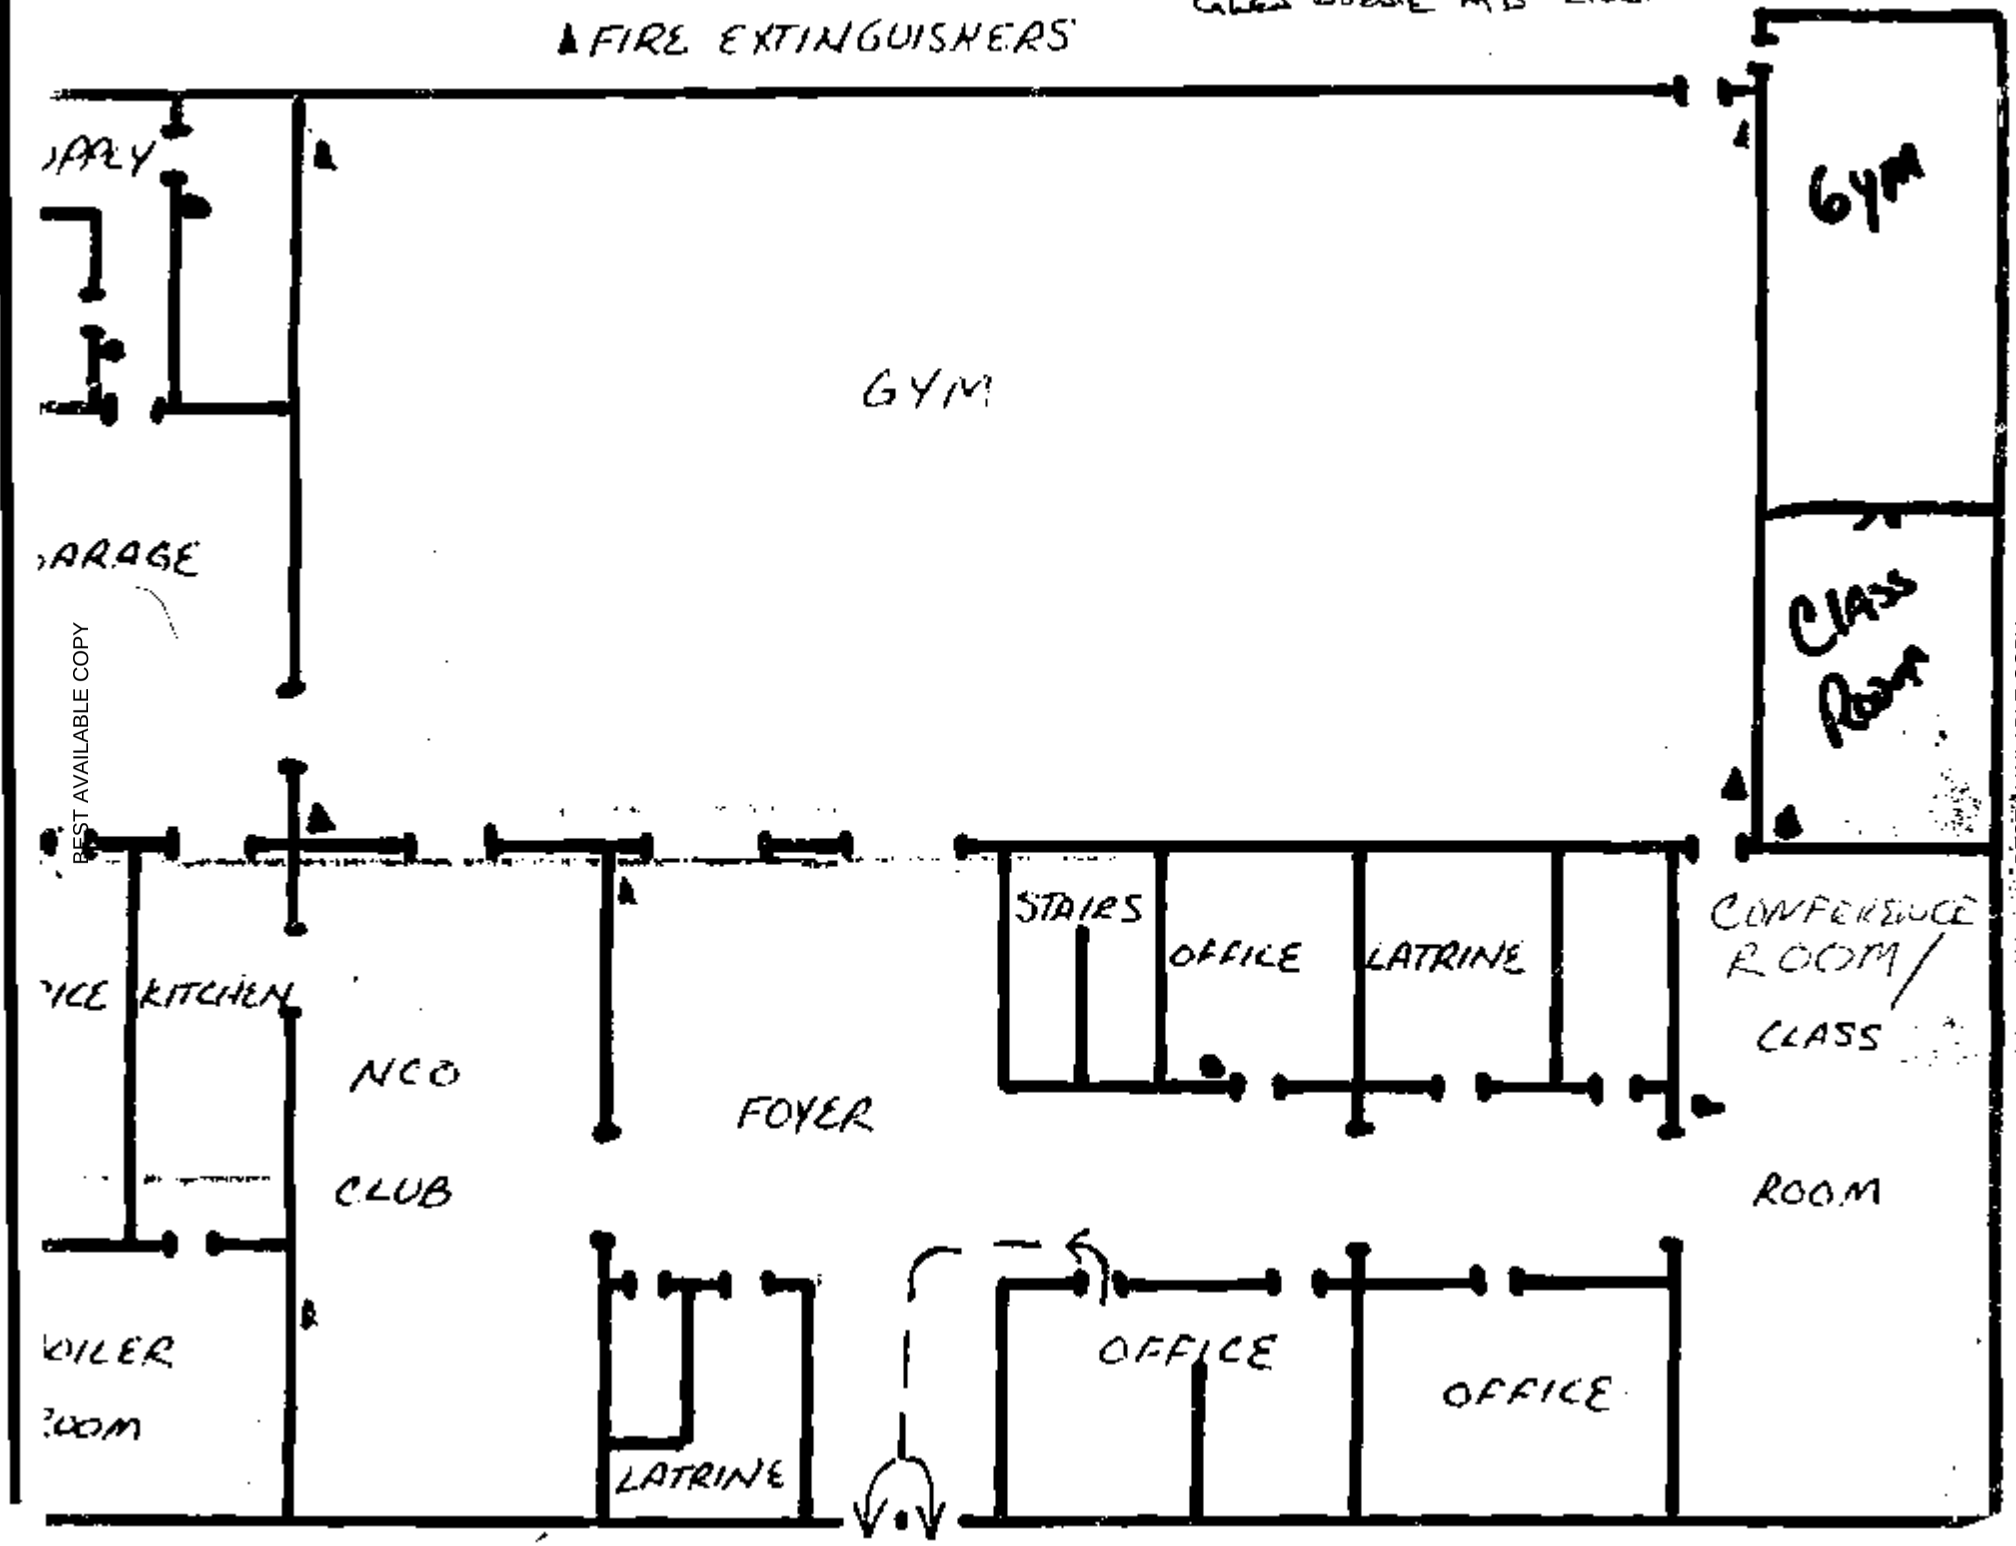

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3160 of 5269
Posted to NGB FOIA Reading Room
May, 2018

A/2/115th INF
GLEN BURNIE MD.

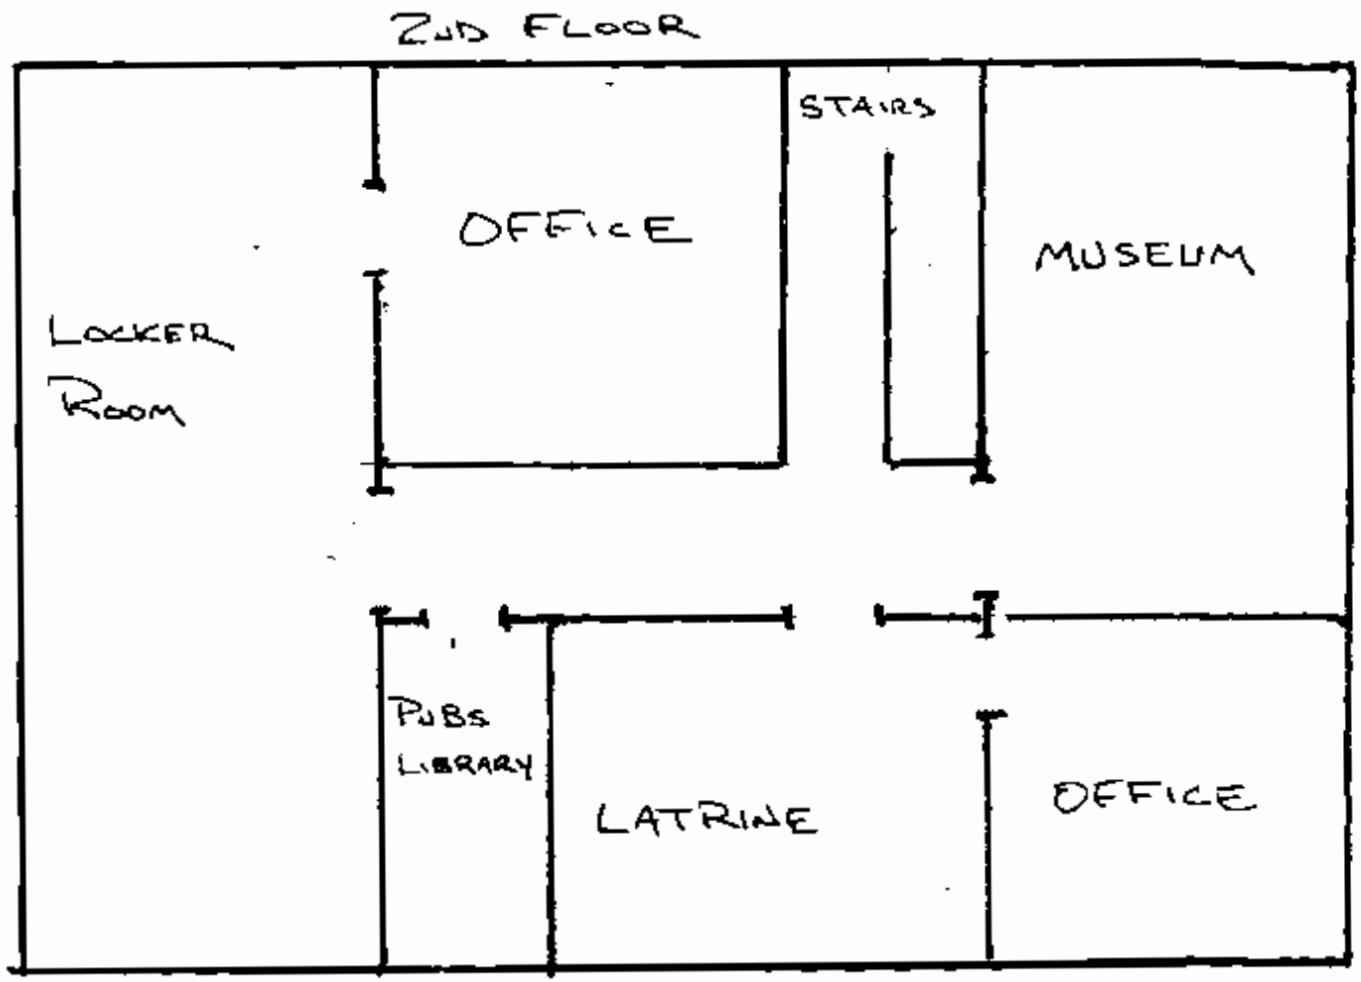

BEST AVAILABLE COPY
BEST AVAILABLE COPY
FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3161 of 5269
Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

National Guard Region North

National Guard Readiness Center
Industrial Hygiene Evaluation
Glen Burnie Army National Guard Armory
Glen Burnie, MD 21061-3203

Prepared for:

National Guard Region North
Industrial Hygiene Office
301 Old Bay Lane
Havre De Grace, MD 21078

Attn: Non-Responsive

Prepared by:

Bonus Environmental, LLC
P.O. Box 121
Mt. Pleasant, Michigan 48804

Project No. 1061-03
July 13, 2010

Bonus Environmental, LLC

Posted to NGB FOIA Reading Room
May, 2018

BEST AVAILABLE COPY

FOIA Requested Record #J-15-0085 (MD)
Released by National Guard Bureau
Page 3162 of 5269

TABLE OF CONTENTS

1. EXECUTIVE SUMMARY 1

2. LEAD SAMPLING 2
- *2.1 Lead Wipe Sampling 2*
- *2.2 Lead Air Sampling 2*

3. PHYSICAL CONDITION OF FACILITY / PERSONNEL CONCERS 3
- *3.1 Lead Based Paint 3*
- *3.2 Presumed Asbestos Containing Materials 4*
- *3.3 Water Damage/Mold Growth 4*
- *3.4 Housekeeping 4*
- *3.5 Employee Interviews 4*
- *3.6 Indoor Air Quality 4*

4. LIGHTING SURVEY 6

5. CONCLUSION 7